DEMONSTRATION ONLY — NOT A QUALIFIED PROCEDURE; THE FACILITY OWNER'S QUALIFIED PROCEDURES AND APPLICABLE CODES GOVERN.

WO-300-04 — Bench test relief valve 3"-P300-RV-4001/2 on D-101-N3

Area	A300 Exchangers and drum	**Task**	PR Relief valve bench test and reinstatement
Priority	1 (safety)	**Issued by**	Facility owner (demonstration)
Primary asset	**D-101** — D-101 horizontal vessel 60" ID × 180" — E 84'-0" N -25'-0" EL 107'-6"		
Equipment	D-101	**Lines**	3"-P300-RV-4001, 4"-P150-FL-4004
Isometrics	ISO-3"-P300-RV-4001, ISO-4"-P150-FL-4004		
Permits	General work permit, Lifting plan		

Reason

Relief valve due for its periodic bench test.

Scope of work

1. Confirm D-101 depressured and isolated.
2. Unbolt and remove VALVE, PRESSURE SAFETY VALVE 3" P300 INLET × 4" P150 OUTLET (3"-P300-RV-4001/2); blind the nozzle and the outlet line.
3. Bench test: set pressure 300 psi and seat tightness (SW-TEST-3); service the valve as found.
4. Reinstall with new gaskets and studs, tightened per SW-WO-5; remove blinds.

Affected items: 3"-P300-RV-4001/2, 3"-P300-RV-4001/1, 4"-P150-FL-4004/A1

Rules: SW-ITP-1, SW-ITP-2, SW-ITP-3, SW-NDE-5, SW-TEST-3, SW-WO-1, SW-WO-2, SW-WO-5, SW-WO-7

Assets in the plant model (SW-WO-7)

Tag	Kind	Description	Line	Location
D-101	equipment	D-101 horizontal vessel 60" ID × 180"		E 84'-0" N -25'-0" EL 107'-6"
3"-P300-RV-4001/2	item	VALVE, PRESSURE SAFETY VALVE 3" P300 INLET × 4" P150 OUTLET	3"-P300-RV-4001	E 94'-0" N -25'-0" EL 111'-6"
3"-P300-RV-4001/1	item	GASKET 3" P300 COMPRESSED SHEET	3"-P300-RV-4001	E 94'-0" N -25'-0" EL 110'-10-3/8"
4"-P150-FL-4004/A1	item	GASKET 4" P150 COMPRESSED SHEET	4"-P150-FL-4004	E 94'-0" N -24'-4-1/16" EL 111'-6"

Isolation list (SW-WO-3)

#	Kind	Tag	Line	Action	Location	Fitted ✓	Removed ✓
1	equipment	D-101	3"-P300-RV-4001	D-101 depressured, drained and isolated under the shutdown isolation (no inlet valve)			
2	blind	3"-P300-RV-4001/1	3"-P300-RV-4001	Blind the nozzle D-101-N3 once the valve is removed	E 94'-0" N -25'-0" EL 110'-10-5/16"		
3	blind	4"-P150-FL-4004/A1	4"-P150-FL-4004	Blind the outlet line 4"-P150-FL-4004 at its first flange	E 94'-0" N -24'-4-1/8" EL 111'-6"		

Parts

Description	Qty	Replaces
GASKET 3" P300 COMPRESSED SHEET	1	3"-P300-RV-4001/1
STUD SET 4 × 0.875" × 5-3/4" WITH 2 NUTS, FOR 3" P300	1	3"-P300-RV-4001/3
GASKET 4" P150 COMPRESSED SHEET	1	4"-P150-FL-4004/A1
STUD SET 4 × 1" × 6-1/4" WITH 2 NUTS, FOR 4" P150	1	4"-P150-FL-4004/A3

Bolt-up (SW-WO-5)

Joint	Studs	Preload per stud (lbf)	Passes	Done ✓
3"-P300-RV-4001/1	4 × 0.875" studs (3"-P300-RV-4001/3)	27,059	3	
4"-P150-FL-4004/A1	4 × 1" studs (4"-P150-FL-4004/A3)	35,343	3	

Test — Relief valve bench test

Description	Set pressure 300 psi (class design pressure, PSV-1) and seat tightness
Pressure	300 psi
Basis	SW-TEST-3

Inspection and test plan (SW-ITP-1..3)


H hold · W witness · R review · S surveillance. Status: accepted / rejected / not applicable.

#	Activity	Reference	Acceptance	Record	Contr.	Owner	3rd party	Status	Signed (contr. / owner / 3rd)	Date	Remark
1	Work permit issued; isolation list (valves locked, blinds fitted) verified at zero pressure and drained	SW-WO-3, isolation list	Every isolation in place and tagged; zero pressure at the vent	Signed isolation certificate	H	H	—				
2	Relief valve removed; nozzle and outlet blinded	SW-WO-3	Both openings blinded and tagged	Isolation certificate	W	W	—				
3	As-found bench test (pop pressure recorded before any service)	SW-TEST-3	Recorded	Bench test record	W	W	W				
4	Set pressure and seat tightness after service	SW-TEST-3, PSV-1	Set at 300 psi; seat tight	Bench test record, seal tag	H	H	W				
5	Valve reinstalled; new gaskets; studs to preload	SW-WO-5	Preload as stated	Bolt-up record	W	W	—				
6	Blinds removed, isolations returned to normal line-up per the isolation list	SW-WO-3	Every blind removed and accounted for	Isolation certificate closed	H	H	—				
7	Records complete; work order handed back to operations	SW-ITP-3	All ITP activities accepted or not applicable	Signed ITP and completion record	H	H	R				

Isometric ISO-3"-P300-RV-4001

ISOMETRIC — 3"-P300-RV-4001 — Bench test relief valve 3"-P300-RV-4001/2 on D-101-N3

N

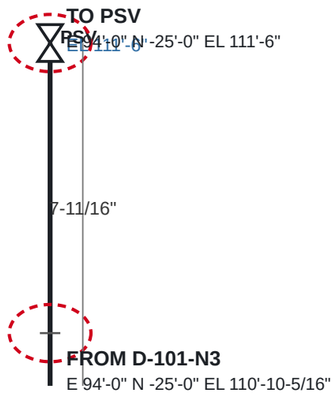

BILL OF MATERIALS

1	GASKET 3" P300 COMPRESSED SHEET	1
2	VALVE, PRESSURE SAFETY VALVE 3" P300 INLET × 4" P150 OU…	1
3	STUD SET 4 × 0.875" × 5-3/4" WITH 2 NUTS, FOR 3" P300	1

WELDS 0 (0 FIELD) · SUPPORTS 0 · SPOOLS 0

3"-P300-RV-4001

CLASS H300 — Hydrocarbon process
SERVICE RV · 3" · P300 · DESIGN 300 psi
D-101-N3 → PSV
PIPE 0.000" · WEIGHT 133 lb


DWG ISO-3"-P300-RV-4001 REV 0 WO-300-04

SmartWeld AI · not to scale · E lower right, N upper right, EL up (SW-ISO-1)

DEMONSTRATION ONLY — NOT A QUALIFIED PROCEDURE

Isometric ISO-4"-P150-FL-4004

ISOMETRIC — 4"-P150-FL-4004 — Bench test relief valve 3"-P300-RV-4001/2 on D-101-N3

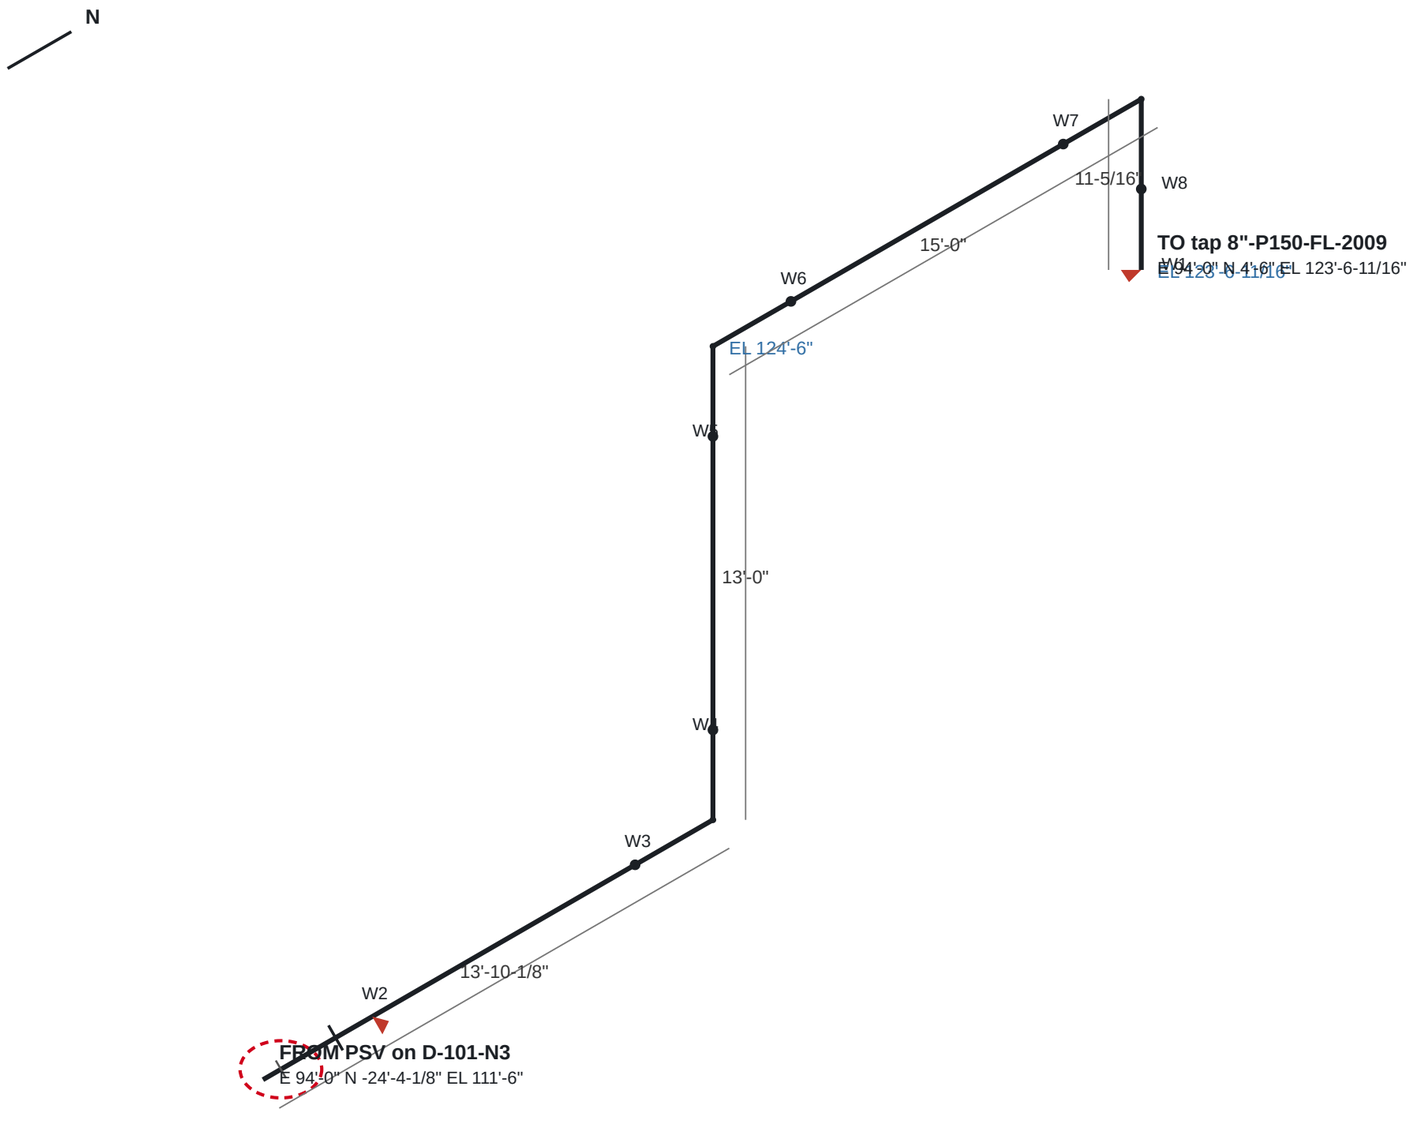

BILL OF MATERIALS

1	GASKET 4" P150 COMPRESSED SHEET	1
2	FLANGE WELD-NECK 4" P150 RAISED FACE	1
3	STUD SET 4 × 1" × 6-1/4" WITH 2 NUTS, FOR 4" P150	1
4	PIPE 4" P150 BEVELLED ENDS	38'-11-15/16"
5	ELBOW 90° R = 5/3 OD 4" P150	3

WELDS 8 (2 FIELD) · SUPPORTS 0 · SPOOLS 2

W1F W2F W3 W4 W5 W6 W7 W8

4"-P150-FL-4004

CLASS F150 — Flare and relief outlets
SERVICE FL · 4" · P150 · DESIGN 150 psi
PSV on D-101-N3 → tap 8"-P150-FL-2009
PIPE 38'-11-15/16" · WEIGHT 355 lb

DWG ISO-4"-P150-FL-4004 REV 0 WO-300-04

SmartWeld AI · not to scale · E lower right, N upper right, EL up (SW-ISO-1)

DEMONSTRATION ONLY — NOT A QUALIFIED PROCEDURE