01 Chassis plate

Print 1 4 thick (the wing is 2 thick)

TOP VIEW (looking down on it)

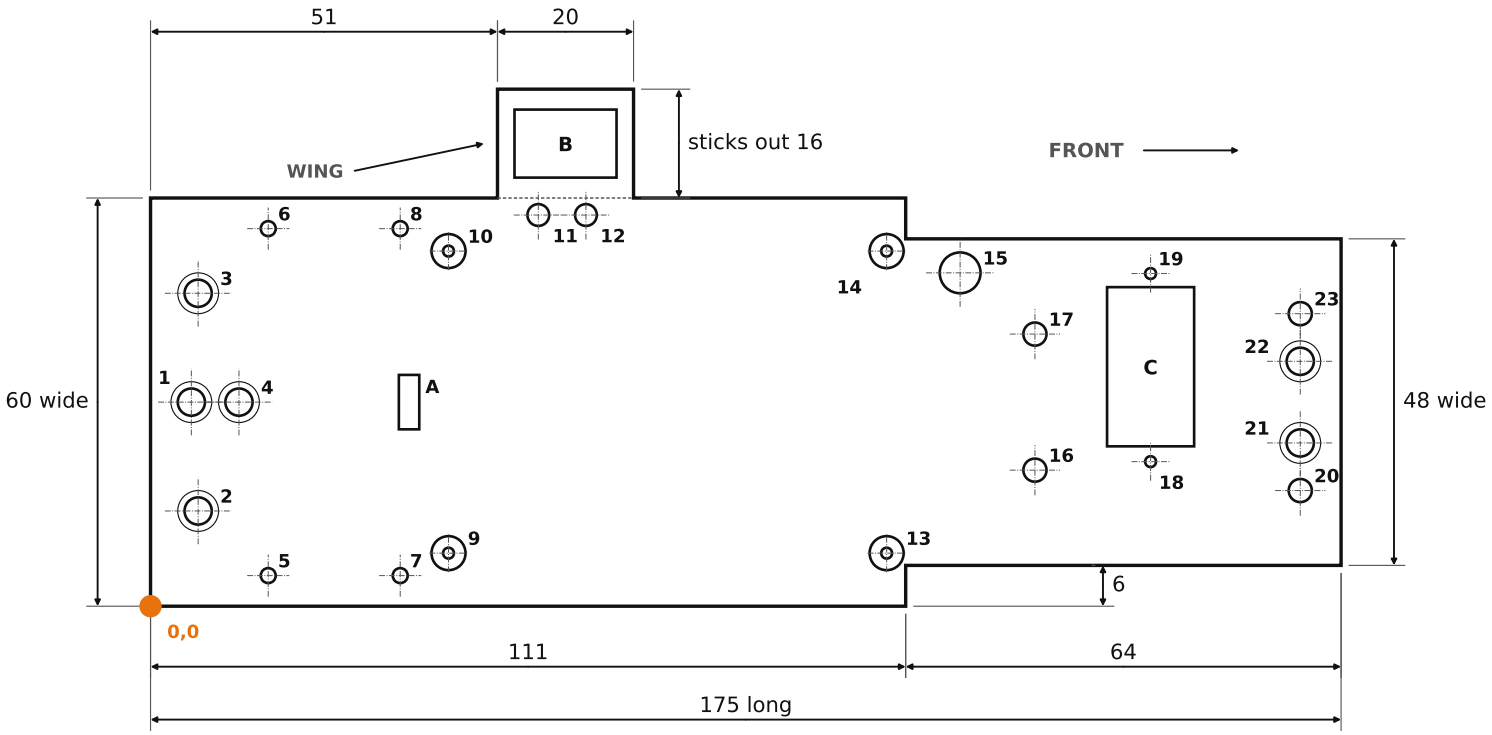

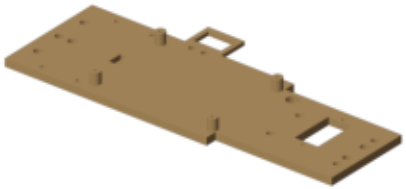

ONE POST, CUT IN HALF

posts 9, 10, 13, 14

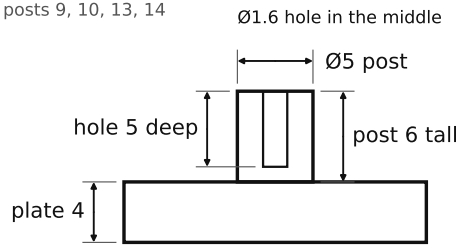

HOLE LIST

from back = from the back edge **from right = from the right side edge** **both measured to the centre**

#	from back	from right	size
1	6	30	Ø4.0 insert hole, through
2	7	14	Ø4.0 insert hole, through
3	7	46	Ø4.0 insert hole, through
4	13	30	Ø4.0 insert hole, through
5	17.3	4.5	Ø2.2 hole, through
6	17.3	55.5	Ø2.2 hole, through
7	36.7	4.5	Ø2.2 hole, through
8	36.7	55.5	Ø2.2 hole, through
A	38	30	3 x 8 cutout, through

#	from back	from right	size
9	43.8	7.8	Ø5 post 6 tall, Ø1.6 x 5 deep
10	43.8	52.2	Ø5 post 6 tall, Ø1.6 x 5 deep
11	57	57.5	Ø3.2 hole, through
B	61	68	15 x 10 cutout, through
12	64	57.5	Ø3.2 hole, through
13	108.2	7.8	Ø5 post 6 tall, Ø1.6 x 5 deep
14	108.2	52.2	Ø5 post 6 tall, Ø1.6 x 5 deep
15	119	49	Ø6 hole, through
16	130	20	Ø3.4 hole, through

#	from back	from right	size
17	130	40	Ø3.4 hole, through
18	147	21.25	Ø1.6 hole, through
C	147	35.2	12.8 x 23.4 cutout, through
19	147	48.9	Ø1.6 hole, through
20	169	17	Ø3.4 hole, through
21	169	24	Ø4.0 insert hole, through
22	169	36	Ø4.0 insert hole, through
23	169	43	Ø3.4 hole, through

"through" = cut all the way through the 4 thick plate. Ø4.0 insert hole = a plain Ø4.0 hole, no threads (a brass insert is melted in after printing).