


FLIGHT CREW CALL SYSTEM

R Y R
O C T 10/06

23-42-00
SECTION TITLE
PAGE 1

BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

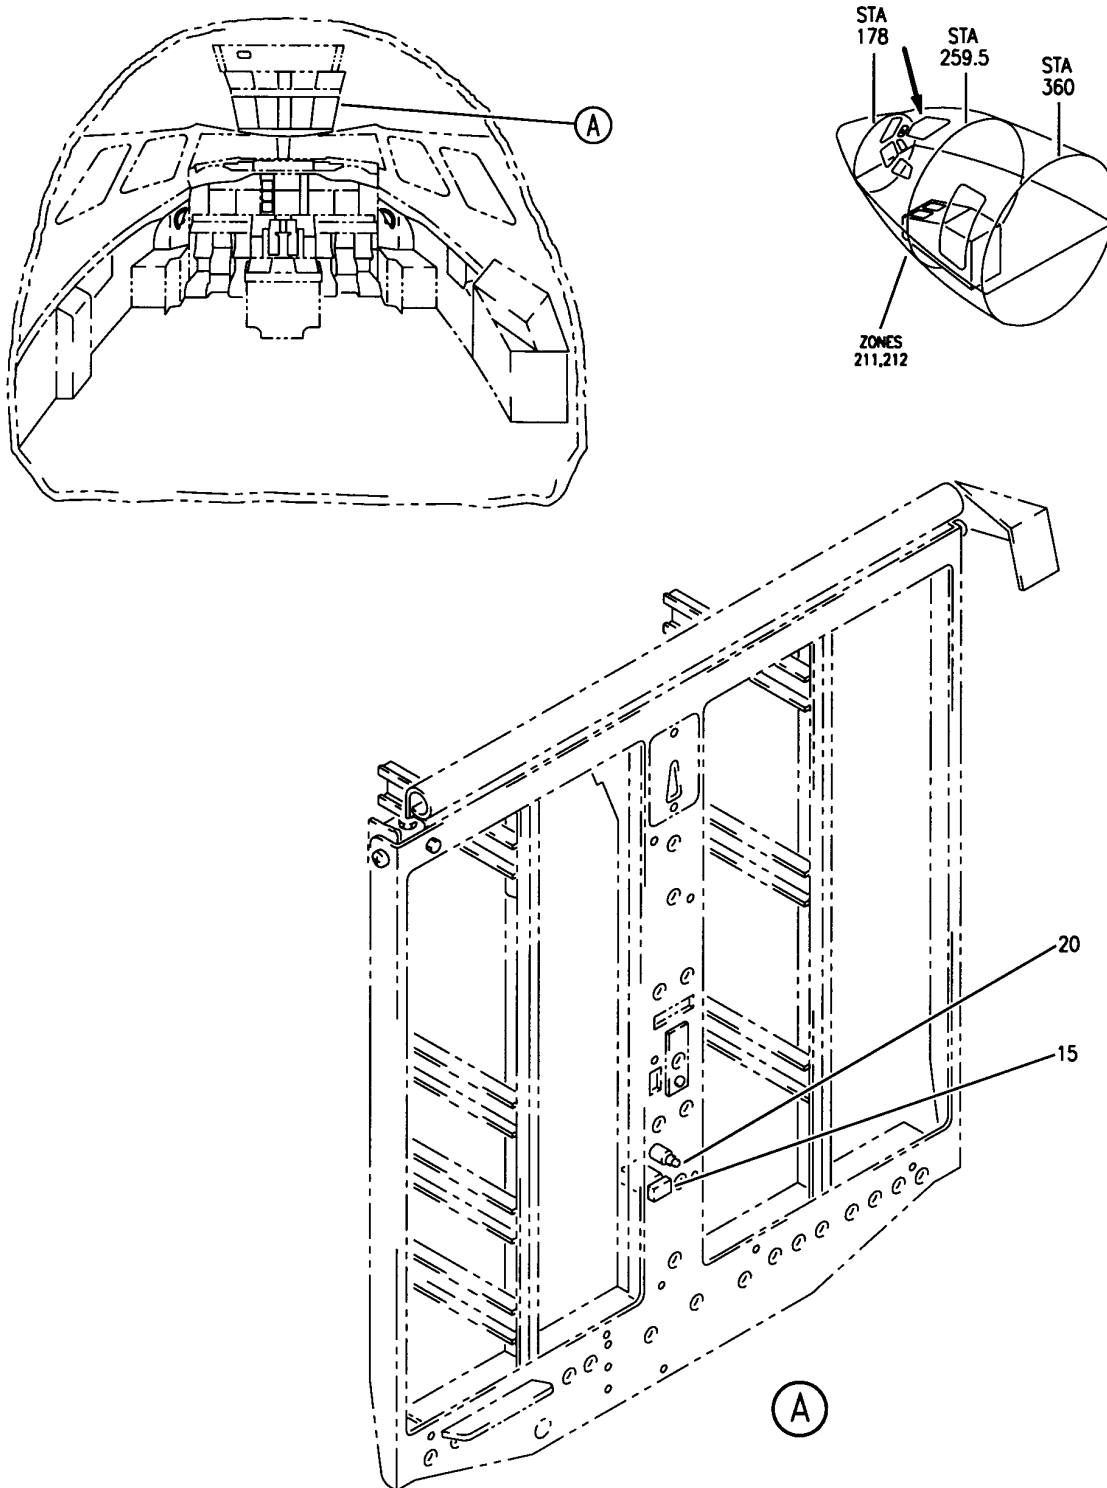

ELECTRICAL INSTL AND ASSY-P5 FWD OVHD (CABIN INTERPHONE SYSTEM ONLY)

FIGURE 1

23-42-00-01

RJR
OCT 10/06

23-42-00-01
PAGE 0

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

E 23420001 REV 019

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
1			ELECTRICAL INSTL AND ASSY- P5 FWD OVHD (CABIN INTERPHONE SYSTEM ONLY)	056120	
- 5	MODREF82478		ELECTRICAL INSTL-P5 OVHD (CABIN INTERPHONE SYSTEM ONLY) MODULE NUMBER: 233A3303-349 REV A POSITION DATA: FWD FOR OTHER SYS DETAILS SEE: 11-32-02-19 21-27-00-01 23-43-00-01 30-42-31-02 31-11-94-03A 33-11-00-08 33-14-00-06 33-25-52-02 33-32-00-03 33-41-00-01 33-42-00-02 33-43-00-01 33-44-00-01 33-45-00-01 33-49-00-02 33-51-00-02 49-61-00-01 74-31-52-02	056120	RF
15	BCREF4152		.LIGHT ASSY-PRESS TO TEST IND-CALL SUPPLIER CODE: V81590 OVERLENGTH PART NUMBER: 318-630-1002-017 SPECIFICATION NUMBER: 10-61803-72 ELECTRICAL EQUIP NUMBER: L00019 COMPONENT MAINT MANUAL REF: 33-10-05 FOR DETAILS SEE: 33-11-50-18	056120	1
20	D20011-01		.SWITCH-PUSH BUTTON SUPPLIER CODE: V81640 ELECTRICAL EQUIP NUMBER: S00036	056120	1
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

- ITEM NOT ILLUSTRATED


RYR

23-42-00-01

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

23-42-00
 FIG. 01
 PAGE 1
 JUN 15/23

BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

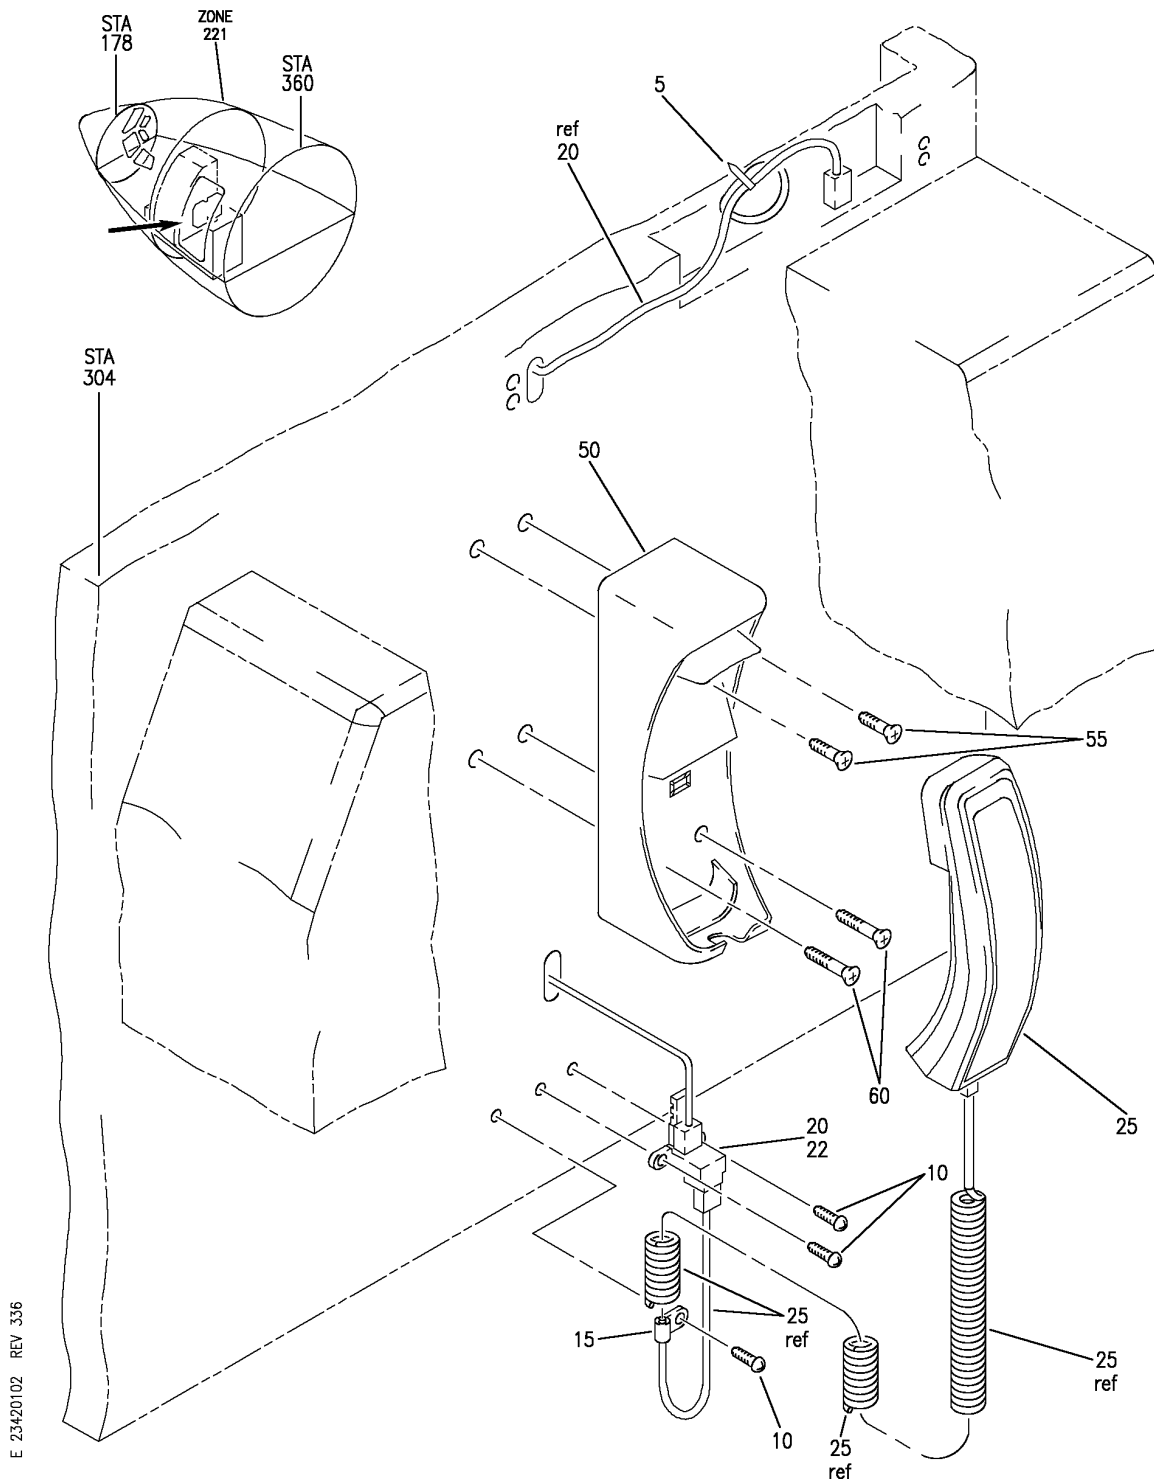

E 23420102 REV 336

HANDSET INSTL-ATTENDANT LAV A (COMMUNICATIONS ONLY)
FIGURE 2

23-42-01-02

R/YR
AUG 15/24

23-42-01-02
PAGE 0

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
2			HANDSET INSTL-ATTENDANT LAV A (COMMUNICATIONS ONLY)	056377	
- 2	MODREF96828		HANDSET INSTL-ATTENDANT LAV A (COMMUNICATIONS ONLY)	056377	RF
			MODULE NUMBER: 417A6500-100A REV A POSITION DATA: STA 304.00 LBL 26.63 WL 259.35 FOR OTHER SYS DETAILS SEE: 11-32-03-03		
5	PLT1MM		.STRAP SUPPLIER CODE: V06383 SPECIFICATION NUMBER: BACS38K4 OPTIONAL PART: TOR180 V53421	056377	1
10	BACS12FA3K7		.SCREW- MAINTENANCE MANUAL REF: 23-43-01	056377	3
10	BACS12CK3-7		.SCREW- MAINTENANCE MANUAL REF: 23-43-01	056377	3
15	BACC10DK3		.CLAMP- MAINTENANCE MANUAL REF: 23-43-01	056377	1
20	HA623-257A		.CORD ASSY- SUPPLIER CODE: V71777 TRUE PART NUMBER: HA623-257-A MAINTENANCE MANUAL REF: 23-42-01	056377	1
22	CTZ623-6CH		..RECEPTACLE-6 POS MODULAR PHONE SUPPLIER CODE: V55104	056377	1
25	285W0024-1B		.MODULE ASSY- NO MOD 285W0024-1B MOD A 285W0024-1B MOD AB 285W0024-1B MOD D 285W0024-1B MOD AD 285W0024-1B MOD AC 285W0024-1B MOD ABC	056377	1
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

- ITEM NOT ILLUSTRATED

RYR

23-42-01-02

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

23-42-01
 FIG. 02
 PAGE 1
 APR 15/25

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
2			285W0024-1B MOD ACD 285W0024-1B MOD ACDE 285W0024-1B MOD ACEF SUPPLIER CODE: V89954 FUNCTIONAL DESCRIPTION: THE HANDSET IS A PART OF THE CABIN MANAGEMENT SYSTEM (CMS). THE HANDSET INTERFACES TO THE CABIN INTERPHONE SYSTEM (CIS) FOR VOICE COMMUNICATIONS AND TO THE PASSENGER ADDRESS SYSTEM (PAS) FOR PASSENGER ADDRESS ANNOUNCEMENTS. MISCELLANEOUS DATA: BAE PART NUMBER 285W0024-1 HANDSETS LABELED "MOD ACEF" MAY BE USED AT ANY 737 PASSENGER CABIN HANDSET LOCATIONS EXCEPT THE 737 FORWARD ("LAV A") LOCATION. MOD ACEF HAS A KNOWN AUDIO CUT-OUT ISSUE UNDER THE FOLLOWING TWO CONDITIONS: 1) IT'S INSTALLED AT A 737 FORWARD ("LAV A") LOCATION, AND 2) WHEN SPEAKING TOO LOUDLY INTO THE MICROPHONE. THIS AUDIO CUT-OUT PROBLEM DOES NOT OCCUR AT OTHER PASSENGER CABIN LOCATIONS ON 737. ELECTRICAL EQUIP NUMBER: M00074 COMPONENT MAINT MANUAL REF: 23-42-01 MAINTENANCE MANUAL REF: 23-43-01 23-42-01 MODIFICATION DRAWING REF: 285W0024-5003B V89954		
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

— ITEM NOT ILLUSTRATED

R Y R

23-42-01-02

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

23-42-01
 FIG. 02
 PAGE 2
 APR 15/25

 BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
2			285W0024-5008B V89954 285W0024-5011B V89954 285W0024-5014B V89954 285W0024-5017B V89954 285W0024-5025B V89954 285W0024-5026B V89954 285W0024-5027B V89954 285W0024-5040B V89954 QUALIFIED I/W DATA: 285W0024-1M (GRAY) CAN REPLACE OR BE REPLACED BY 285W0024-1B (DARK GRAY) CONDITIONAL UPON CUSTOMER COLOR PREFERENCE. P/N 285W0024-5B CAN REPLACE OR BE REPLACED BY P/N 285W0024-1B UPON CUSTOMER PREFERENCE. THE -1B HANDSET HAS NUMBERS ON THE KEYPAD AND THE -5B HANDSET HAS DESCRIPTIONS ON THE KEYPAD. P/N 285W0024-5M (GRAY) CAN REPLACE OR BE REPLACED BY P/N 285W0024-1B (DARK GRAY) UPON CUSTOMER PREFERENCE. THE -1B HANDSET HAS NUMBERS ON THE KEYPAD AND THE -5M HANDSET HAS DESCRIPTIONS ON THE KEYPAD. 285W0024-23B CAN REPLACE OR BE REPLACED BY 285W0024-1B WHEN INSTALLED AT ALL		
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

— ITEM NOT ILLUSTRATED

R Y R

23-42-01-02

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

23-42-01
FIG. 02
PAGE 3
APR 15/25

BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
2			NON-FORWARD LOCATIONS. 285W0024-23B CAN REPLACE BUT NOT BE REPLACED BY 285W0024-1B ONLY WHEN INSTALLED IN FORWARD LOCATION. 285W0024-22M CAN REPLACE OR BE REPLACED BY 285W0024-1B AT ALL NON-LAVATORY A LOCATIONS. 285W0024-22M CAN REPLACE BUT NOT BE REPLACED BY 285W0024-1B AT LAVATORY A LOCATION. 285W0024-23M (GRAY) CAN REPLACE BUT NOT BE REPLACED BY 285W0024-1B (DARK GRAY) FOR AT LAV A CABIN LOCATION. 285W0024-23M (GRAY) CAN REPLACE OR BE REPLACED BY 285W0024-1B (DARK GRAY) FOR AT NON-LAV A CABIN LOCATION. FUNCTIONAL REFERENCE: COMMUNICATIONS FOR DETAILS SEE 23-42-01-55 PLACARDS AND MARKINGS FOR DETAILS SEE 11-32-03-03A		
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

— ITEM NOT ILLUSTRATED

R Y R

23-42-01-02

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

23-42-01
FIG. 02
PAGE 4
APR 15/25

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
2					
50	476W2220-9N		.CRADLE ASSY- SUPPLIER CODE: V89954 SB DATA FROM A CMM: POST SB 476W2220-23-01 CONFIG CHG DATA FROM A CMM: POST SB 476W2220-03-01 COMPONENT MAINT MANUAL REF: 23-42-02 MAINTENANCE MANUAL REF: 23-43-01 23-42-01 QUALIFIED I/W DATA: 476W2220-9N (GREY) IS FULLY INTERCHANGEABLE WITH 476W2220-9P (DARK GREY) CONDITIONAL UPON CUSTOMER COLOR PREFERENCE. FUNCTIONAL REFERENCE: COMMUNICATIONS FOR DETAILS SEE 23-42-01-50A PLACARDS AND MARKINGS FOR DETAILS SEE 11-32-03-74B	056377	1
50	476W2220-2K		.CRADLE ASSY- SUPPLIER CODE: V89954 COMPONENT MAINT MANUAL REF: 23-42-02 MAINTENANCE MANUAL REF: 23-43-01 23-42-01 QUALIFIED I/W DATA: P/N 476W2220-9P CAN REPLACE OR BE REPLACED BY P/N 476W2220-2K ATTACHING PARTS	056377	1
55	BACB30NN3K5		.BOLT- MAINTENANCE MANUAL REF: 23-43-01	056377	2
60	BACB30NN3K16		.BOLT- MAINTENANCE MANUAL REF: 23-43-01 -----*-----	056377	2
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

— ITEM NOT ILLUSTRATED


RYR

23-42-01-02

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

23-42-01
FIG. 02
PAGE 5
APR 15/25

BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

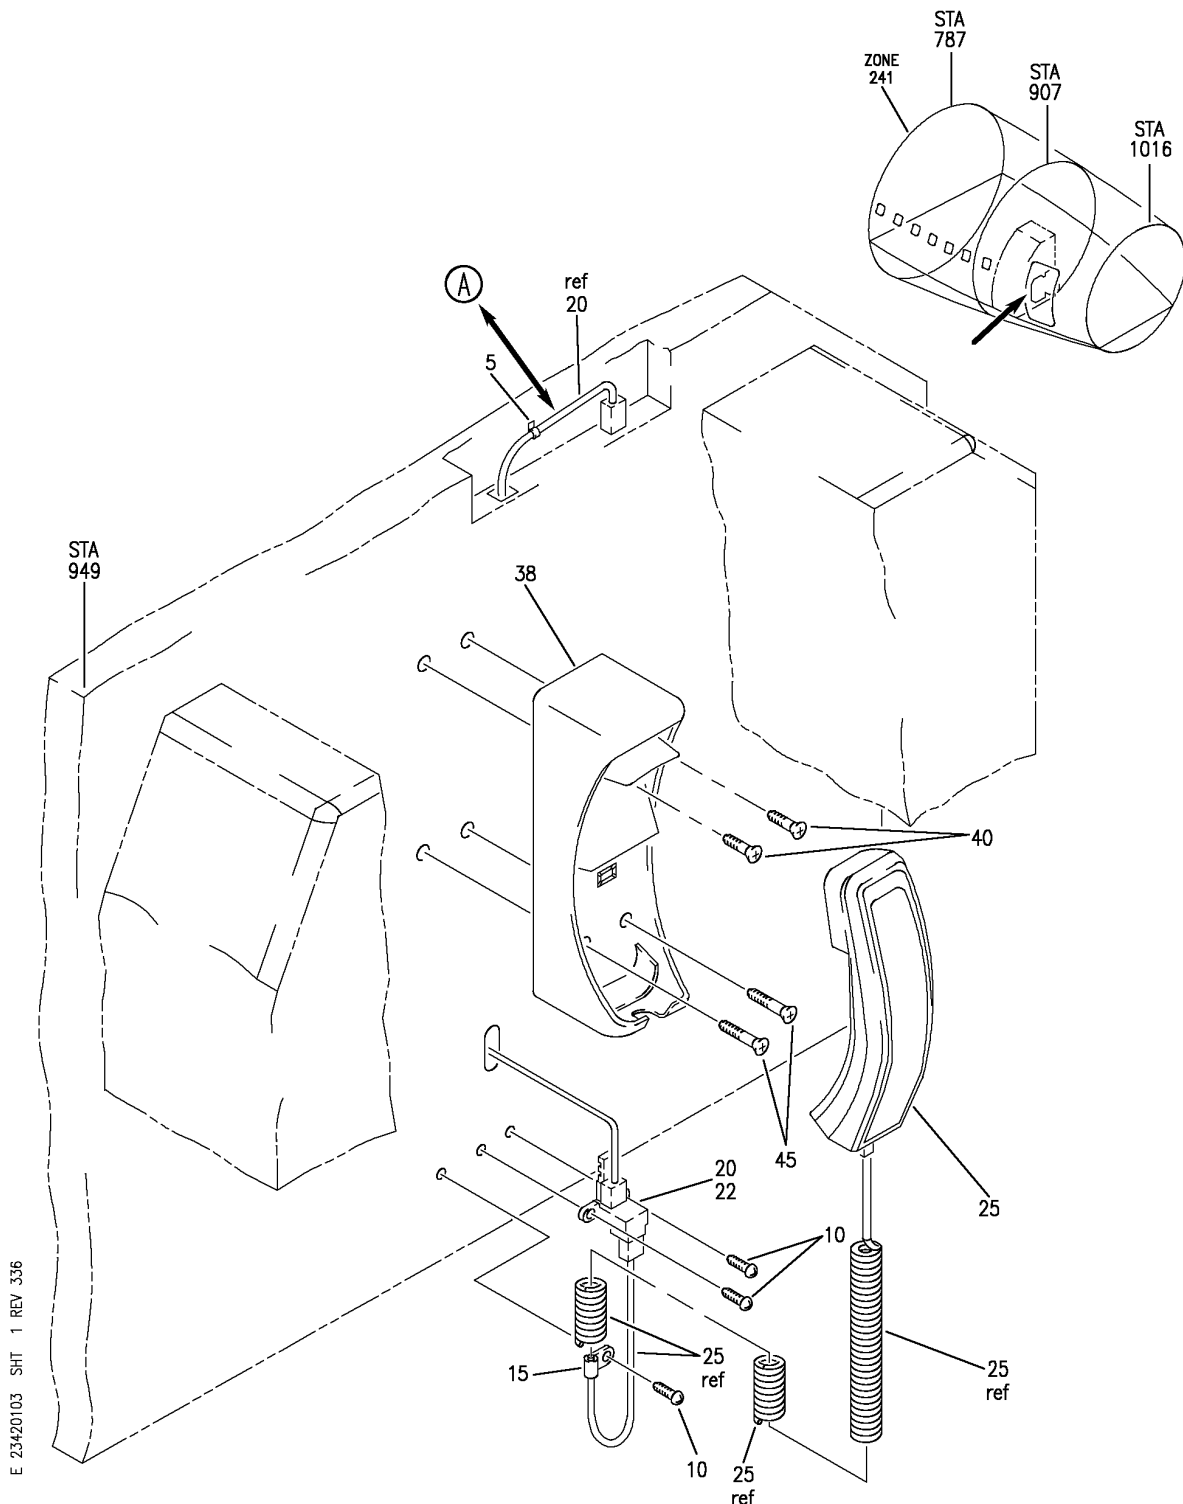

E 23420103 SHT 1 REV 336

HANDSET INSTL-ATTENDANT LAVS D AND E (COMMUNICATIONS ONLY)
FIGURE 3 (SHEET 1)


23-42-01-03

R/YR
AUG 15/24

23-42-01-03
PAGE 0

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

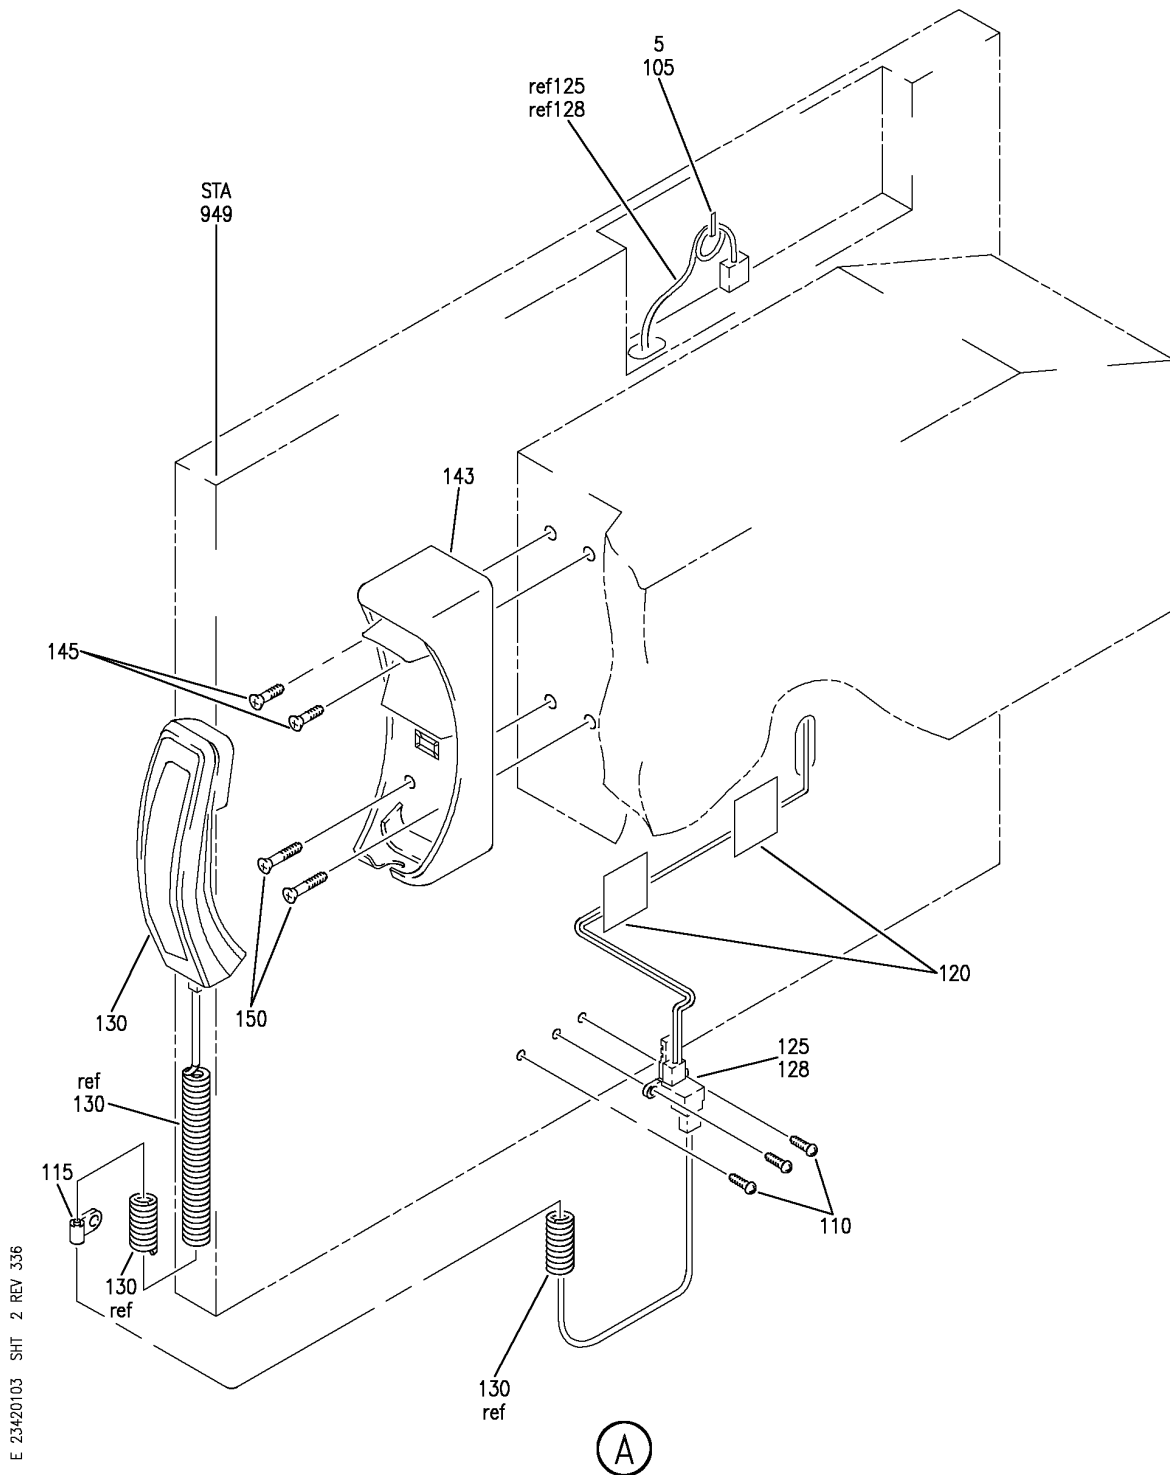

E 23420103 SHT 2 REV 336

HANDSET INSTL-ATTENDANT LAVS D AND E (COMMUNICATIONS ONLY)
FIGURE 3 (SHEET 2)

RJR
AUG 15/24

23-42-01-03

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

23-42-01-03
PAGE 0A

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
3			HANDSET INSTL-ATTENDANT LAVS D AND E (COMMUNICATIONS ONLY)	056377	
- 1	MODREF96840		HANDSET INSTL-ATTENDANT LAV D (COMMUNICATIONS ONLY) MODULE NUMBER: 417A6500-300A REV A POSITION DATA: STA 949.00 LBL 27.63 WL 260.15 FOR OTHER SYS DETAILS SEE: 11-32-03-03D	056377	RF
5	PLT1MM		.STRAP SUPPLIER CODE: V06383 SPECIFICATION NUMBER: BACS38K4 OPTIONAL PART: TOR180 V53421	056377	1
10	BACS12FA3K7		.SCREW- MAINTENANCE MANUAL REF: 23-43-01	056377	3
10	BACS12CK3-7		.SCREW- MAINTENANCE MANUAL REF: 23-43-01	056377	3
15	BACC10DK3		.CLAMP- MAINTENANCE MANUAL REF: 23-43-01	056377	1
20	HA623-257A		.CORD ASSY- SUPPLIER CODE: V71777 TRUE PART NUMBER: HA623-257-A MAINTENANCE MANUAL REF: 23-42-01	056377	1
22	CTZ623-6CH		..CONNECTOR-6 POS MODULAR PHONE SUPPLIER CODE: V55104	056377	1
25	285W0024-1B		.MODULE ASSY- NO MOD 285W0024-1B MOD A 285W0024-1B MOD AB 285W0024-1B MOD D 285W0024-1B MOD AD 285W0024-1B MOD AC 285W0024-1B MOD ABC	056377	1
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

- ITEM NOT ILLUSTRATED

RYR

23-42-01-03

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

23-42-01
 FIG. 03
 PAGE 1
 APR 15/25

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
3			285W0024-1B MOD ACD 285W0024-1B MOD ACDE 285W0024-1B MOD ACEF SUPPLIER CODE: V89954 FUNCTIONAL DESCRIPTION: THE HANDSET IS A PART OF THE CABIN MANAGEMENT SYSTEM (CMS). THE HANDSET INTERFACES TO THE CABIN INTERPHONE SYSTEM (CIS) FOR VOICE COMMUNICATIONS AND TO THE PASSENGER ADDRESS SYSTEM (PAS) FOR PASSENGER ADDRESS ANNOUNCEMENTS. MISCELLANEOUS DATA: BAE PART NUMBER 285W0024-1 HANDSETS LABELED "MOD ACEF" MAY BE USED AT ANY 737 PASSENGER CABIN HANDSET LOCATIONS EXCEPT THE 737 FORWARD ("LAV A") LOCATION. MOD ACEF HAS A KNOWN AUDIO CUT-OUT ISSUE UNDER THE FOLLOWING TWO CONDITIONS: 1) IT'S INSTALLED AT A 737 FORWARD ("LAV A") LOCATION, AND 2) WHEN SPEAKING TOO LOUDLY INTO THE MICROPHONE. THIS AUDIO CUT-OUT PROBLEM DOES NOT OCCUR AT OTHER PASSENGER CABIN LOCATIONS ON 737. ELECTRICAL EQUIP NUMBER: M00075 COMPONENT MAINT MANUAL REF: 23-42-01 MAINTENANCE MANUAL REF: 23-43-01 23-42-01 MODIFICATION DRAWING REF: 285W0024-5003B V89954		
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

— ITEM NOT ILLUSTRATED

R Y R

23-42-01-03

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

23-42-01
 FIG. 03
 PAGE 2
 APR 15/25

 BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
3			285W0024-5008B V89954 285W0024-5011B V89954 285W0024-5014B V89954 285W0024-5017B V89954 285W0024-5025B V89954 285W0024-5026B V89954 285W0024-5027B V89954 285W0024-5040B V89954 QUALIFIED I/W DATA: 285W0024-1M (GRAY) CAN REPLACE OR BE REPLACED BY 285W0024-1B (DARK GRAY) CONDITIONAL UPON CUSTOMER COLOR PREFERENCE. P/N 285W0024-5B CAN REPLACE OR BE REPLACED BY P/N 285W0024-1B UPON CUSTOMER PREFERENCE. THE -1B HANDSET HAS NUMBERS ON THE KEYPAD AND THE -5B HANDSET HAS DESCRIPTIONS ON THE KEYPAD. P/N 285W0024-5M (GRAY) CAN REPLACE OR BE REPLACED BY P/N 285W0024-1B (DARK GRAY) UPON CUSTOMER PREFERENCE. THE -1B HANDSET HAS NUMBERS ON THE KEYPAD AND THE -5M HANDSET HAS DESCRIPTIONS ON THE KEYPAD. 285W0024-23B CAN REPLACE OR BE REPLACED BY 285W0024-1B WHEN INSTALLED AT ALL		
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

— ITEM NOT ILLUSTRATED

R Y R

23-42-01-03

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

23-42-01
FIG. 03
PAGE 3
APR 15/25

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
3			NON-FORWARD LOCATIONS. 285W0024-23B CAN REPLACE BUT NOT BE REPLACED BY 285W0024-1B ONLY WHEN INSTALLED IN FORWARD LOCATION. 285W0024-22M CAN REPLACE OR BE REPLACED BY 285W0024-1B AT ALL NON-LAVATORY A LOCATIONS. 285W0024-22M CAN REPLACE BUT NOT BE REPLACED BY 285W0024-1B AT LAVATORY A LOCATION. 285W0024-23M (GRAY) CAN REPLACE BUT NOT BE REPLACED BY 285W0024-1B (DARK GRAY) FOR AT LAV A CABIN LOCATION. 285W0024-23M (GRAY) CAN REPLACE OR BE REPLACED BY 285W0024-1B (DARK GRAY) FOR AT NON-LAV A CABIN LOCATION. FUNCTIONAL REFERENCE: COMMUNICATIONS FOR DETAILS SEE 23-42-01-55 PLACARDS AND MARKINGS FOR DETAILS SEE 11-32-03-03A		
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

— ITEM NOT ILLUSTRATED

R Y R

23-42-01-03

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

23-42-01
 FIG. 03
 PAGE 4
 APR 15/25

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7 NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
3				
38	476W2220-9N	.CRADLE ASSY- SUPPLIER CODE: V89954 SB DATA FROM A CMM: POST SB 476W2220-23-01 COMPONENT MAINT MANUAL REF: 23-42-02 MAINTENANCE MANUAL REF: 23-43-01 23-42-01 QUALIFIED I/W DATA: 476W2220-9N (GREY) IS FULLY INTERCHANGEABLE WITH 476W2220-9P (DARK GREY) CONDITIONAL UPON CUSTOMER COLOR PREFERENCE. FUNCTIONAL REFERENCE: COMMUNICATIONS FOR DETAILS SEE 23-42-01-50A PLACARDS AND MARKINGS FOR DETAILS SEE 11-32-03-74B	056377	1
38	476W2220-2K	.CRADLE ASSY- SUPPLIER CODE: V89954 COMPONENT MAINT MANUAL REF: 23-42-02 MAINTENANCE MANUAL REF: 23-43-01 23-42-01 QUALIFIED I/W DATA: P/N 476W2220-9P CAN REPLACE OR BE REPLACED BY P/N 476W2220-2K ATTACHING PARTS	056377	1
40	BACB30NN3K5	.BOLT- MAINTENANCE MANUAL REF: 23-43-01	056377	2
45	BACB30NN3K16	.BOLT- MAINTENANCE MANUAL REF: 23-43-01 -----*-----	056377	2
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE				


— ITEM NOT ILLUSTRATED

RYR

23-42-01-03

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

23-42-01
 FIG. 03
 PAGE 5
 APR 15/25

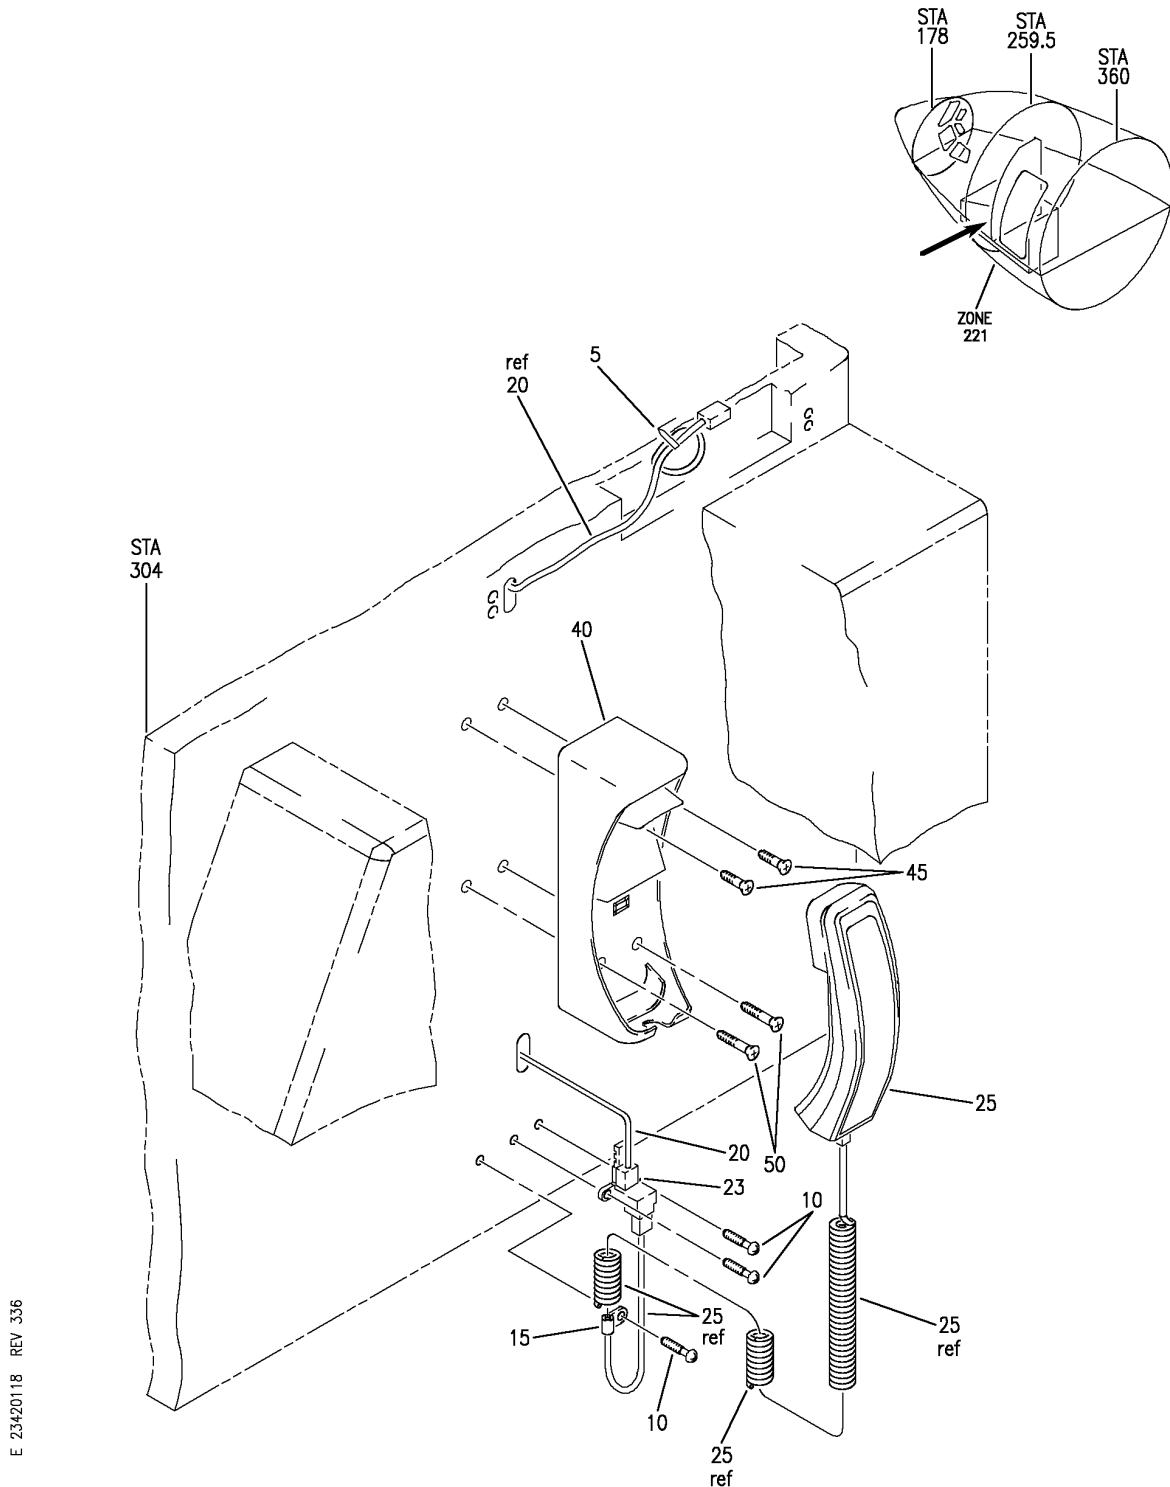

E 23420118 REV 336

HANDSET INSTL-ATTENDANT LAV A (COMMUNICATIONS ONLY)
FIGURE 18

23-42-01-18

R Y R
AUG 15/24

23-42-01-18
PAGE 0

 BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
18			HANDSET INSTL-ATTENDANT LAV A (COMMUNICATIONS ONLY)	378999	
- 1	MODREF474540		HANDSET INSTL-ATTENDANT LAV A (COMMUNICATIONS ONLY) MODULE NUMBER: 417A6501-100 REV B POSITION DATA: STA 304.00, LBL 26.63, WL 259.35 FOR OTHER SYS DETAILS SEE: 11-32-03-03Q	378999	RF
5	PLT1MM		.STRAP SUPPLIER CODE: V06383 SPECIFICATION NUMBER: BACS38K4 OPTIONAL PART: TOR180 V53421	378999	1
10	BACS12CK3-7		.SCREW-	378999	3
10	BACS12FA3K7		.SCREW-	378999	3
15	BACC10DK3		.CLAMP	378999	1
20	HA623-257B		.CABLE ASSY- SUPPLIER CODE: V55104 TRUE PART NUMBER: HA623-257-B MAINTENANCE MANUAL REF: 23-42-01	378999	1
23	CTZ623-6CH		..RECEPTACLE-6 POS MODULAR PHONE SUPPLIER CODE: V55104	378999	1
25	285W0024-1M		.MODULE ASSY-CAH/FDH GRAY 285W0024-1M MOD ACD 285W0024-1M MOD ACDE 285W0024-1M MOD ACEF SUPPLIER CODE: V89954 FUNCTIONAL DESCRIPTION: THE HANDSET IS A PART OF THE CABIN MANAGEMENT SYSTEM (CMS). THE HANDSET INTERFACES TO THE CABIN INTERPHONE SYSTEM (CIS) FOR VOICE COMMUNICATIONS AND TO	378999	1
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

- ITEM NOT ILLUSTRATED

RYR

23-42-01-18

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

23-42-01
FIG. 18
PAGE 1
APR 15/25

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
18			THE PASSENGER ADDRESS SYSTEM (PAS) FOR PASSENGER ADDRESS ANNOUNCEMENTS. MISCELLANEOUS DATA: BAE PART NUMBER 285W0024-1 HANDSETS LABELED "MOD ACEF" MAY BE USED AT ANY 737 PASSENGER CABIN HANDSET LOCATIONS EXCEPT THE 737 FORWARD ("LAV A") LOCATION. MOD ACEF HAS A KNOWN AUDIO CUT-OUT ISSUE UNDER THE FOLLOWING TWO CONDITIONS: 1) IT'S INSTALLED AT A 737 FORWARD ("LAV A") LOCATION, AND 2) WHEN SPEAKING TOO LOUDLY INTO THE MICROPHONE. THIS AUDIO CUT-OUT PROBLEM DOES NOT OCCUR AT OTHER PASSENGER CABIN LOCATIONS ON 737. ELECTRICAL EQUIP NUMBER: M00074 COMPONENT MAINT MANUAL REF: 23-42-01 MAINTENANCE MANUAL REF: 23-42-01 QUALIFIED I/W DATA: 285W0024-1M (GRAY) CAN REPLACE OR BE REPLACED BY 285W0024-1B (DARK GRAY) CONDITIONAL UPON CUSTOMER COLOR PREFERENCE. 285W0024-5M CAN REPLACE OR BE REPLACED BY 285W0024-1M UPON CUSTOMER PREFERENCE. THE -1M HANDSET HAS NUMBERS ON THE KEYPAD AND THE -5M HANDSET HAS DESCRIPTIONS ON THE KEYPAD.		
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

— ITEM NOT ILLUSTRATED

RYR

23-42-01-18

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

23-42-01
FIG. 18
PAGE 2
APR 15/25

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
18			285W0024-22M CAN REPLACE OR BE REPLACED BY 285W0024-1M AT ALL NON-LAVATORY A LOCATIONS. 285W0024-22M CAN REPLACE BUT NOT BE REPLACED BY 285W0024-1M AT LAVATORY A LOCATION. 285W0024-23M CAN REPLACE BUT NOT BE REPLACED BY 285W0024-1M FOR AT LAV A CABIN LOCATION. 285W0024-23M CAN REPLACE OR BE REPLACED BY 285W0024-1M FOR AT NON-LAV A CABIN LOCATION. FUNCTIONAL REFERENCE: COMMUNICATIONS FOR DETAILS SEE 23-42-01-55 PLACARDS AND MARKINGS FOR DETAILS SEE 11-32-03-03A		
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

— ITEM NOT ILLUSTRATED

R Y R

23-42-01-18

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

23-42-01
 FIG. 18
 PAGE 3
 APR 15/25

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7 NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
18 40	476W2220-9P	.CRADLE ASSY- SUPPLIER CODE: V89954 COMPONENT MAINT MANUAL REF: 23-42-02 MAINTENANCE MANUAL REF: 23-42-01 QUALIFIED I/W DATA: 476W2220-9N (GREY) IS FULLY INTERCHANGEABLE WITH 476W2220-9P (DARK GREY) CONDITIONAL UPON CUSTOMER COLOR PREFERENCE. P/N 476W2220-9P CAN REPLACE OR BE REPLACED BY P/N 476W2220-2K FUNCTIONAL REFERENCE: COMMUNICATIONS FOR DETAILS SEE 23-42-01-50A PLACARDS AND MARKINGS FOR DETAILS SEE 11-32-03-74B ATTACHING PARTS .BOLT .BOLT -----*-----	378999	1
45	BACB30NN3K5		378999	2
50	BACB30NN3K16		378999	2
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE				

— ITEM NOT ILLUSTRATED


R Y R

23-42-01-18

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

23-42-01
 FIG. 18
 PAGE 4
 APR 15/25

BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

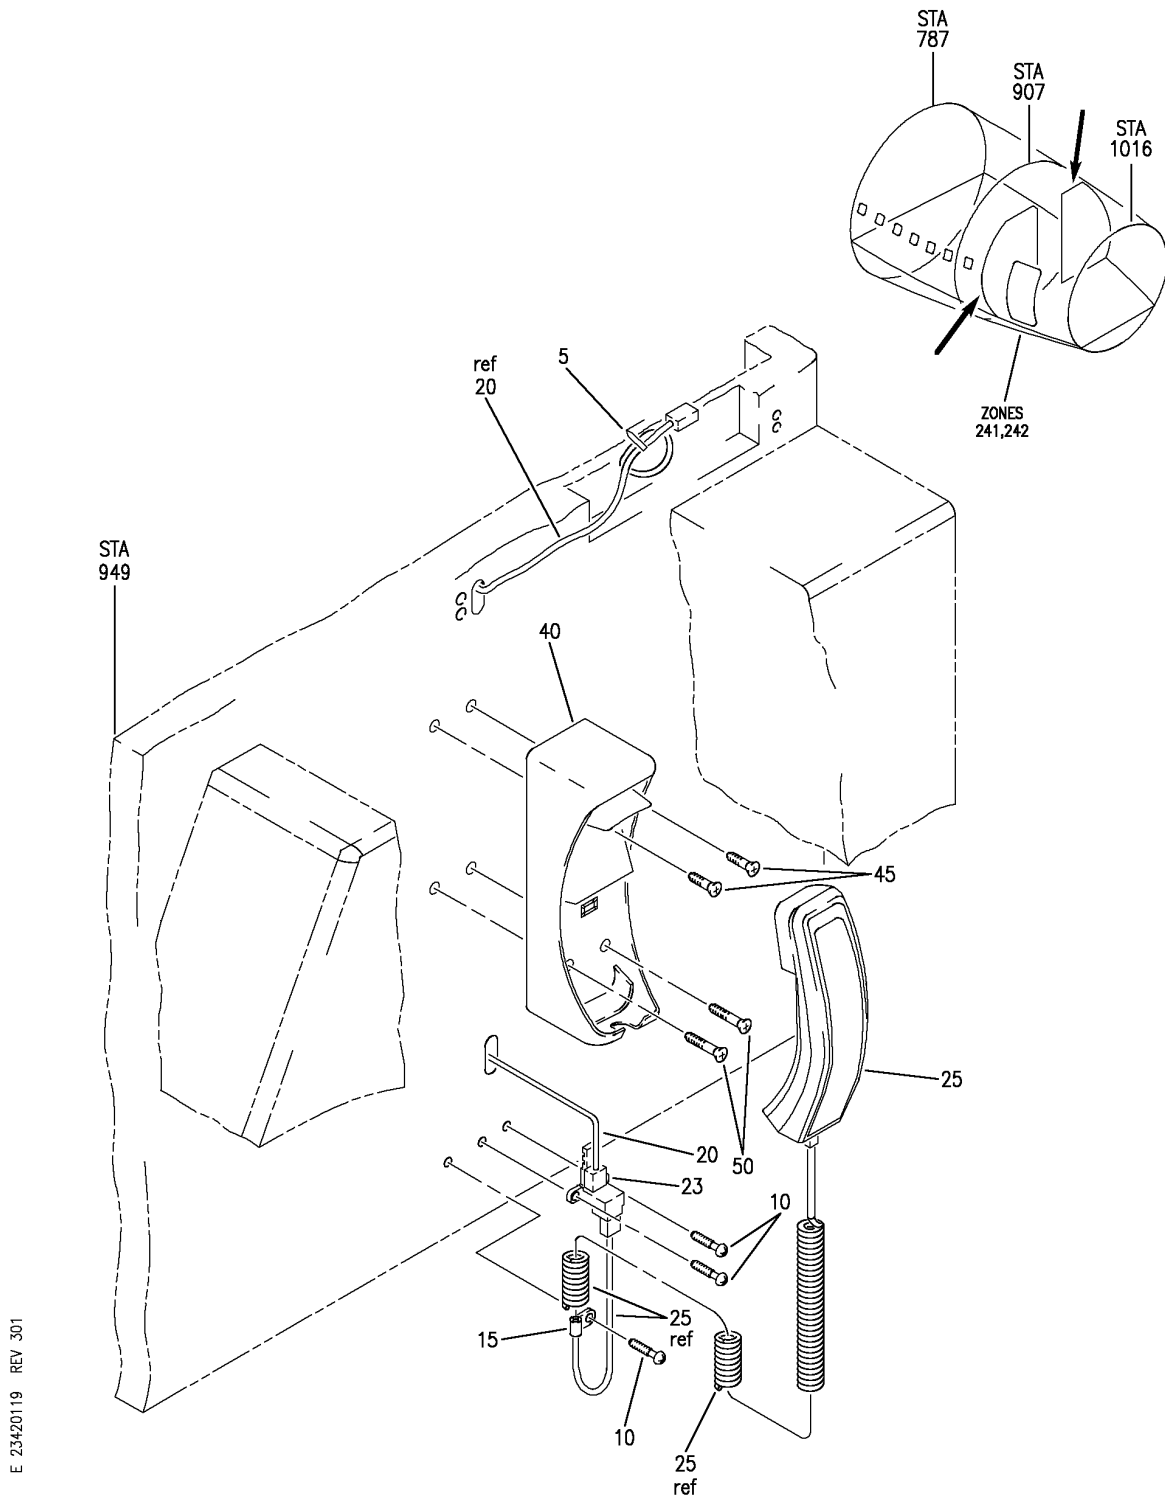

E 23420119 REV 301

HANDSET INSTL-ATTENDANT LAV D (COMMUNICATIONS ONLY)
FIGURE 19

23-42-01-19

R Y R
AUG 15/21

23-42-01-19
PAGE 0

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
19			HANDSET INSTL-ATTENDANT LAV D (COMMUNICATIONS ONLY)	378999	
- 1	MODREF474539		HANDSET INSTL-ATTENDANT LAV D (COMMUNICATIONS ONLY) MODULE NUMBER: 417A6501-300 REV B POSITION DATA: STA 949.00, LBL 27.63, WL 260.15 FOR OTHER SYS DETAILS SEE: 11-32-03-03R	378416	RF
- 1	MODREF573323		HANDSET INSTL-ATTENDANT LAV D (COMMUNICATIONS ONLY) MODULE NUMBER: 417A6501-304 REV A POSITION DATA: STA 949.00, LBL 27.63, WL 260.15 FOR OTHER SYS DETAILS SEE: 11-32-03-03R	417999	RF
5	PLT1MM		.STRAP- SUPPLIER CODE: V06383 SPECIFICATION NUMBER: BACS38K4 OPTIONAL PART: TOR180 V53421 USED ON: MODREF474539	378999	1
10	BACS12CK3-7		.SCREW-	378999	3
10	BACS12FA3K7		.SCREW-	378999	3
15	BACC10DK3		.CLAMP	378999	1
20	HA623-257B		.CABLE ASSY- SUPPLIER CODE: V55104 TRUE PART NUMBER: HA623-257-B MAINTENANCE MANUAL REF: 23-42-01 USED ON: MODREF474539	378999	1
23	CTZ623-6CH		..RECEPTACLE-6 POS MODULAR PHONE SUPPLIER CODE: V55104	378999	1
R 25	285W0024-1M		.MODULE ASSY-CAH/FDH GRAY	378999	1
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

- ITEM NOT ILLUSTRATED

RYR

23-42-01-19

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

23-42-01
 FIG. 19
 PAGE 1
 APR 15/25

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
19			285W0024-1M MOD ACD 285W0024-1M MOD ACDE 285W0024-1M MOD ACEF SUPPLIER CODE: V89954 FUNCTIONAL DESCRIPTION: THE HANDSET IS A PART OF THE CABIN MANAGEMENT SYSTEM (CMS). THE HANDSET INTERFACES TO THE CABIN INTERPHONE SYSTEM (CIS) FOR VOICE COMMUNICATIONS AND TO THE PASSENGER ADDRESS SYSTEM (PAS) FOR PASSENGER ADDRESS ANNOUNCEMENTS. MISCELLANEOUS DATA: BAE PART NUMBER 285W0024-1 HANDSETS LABELED "MOD ACEF" MAY BE USED AT ANY 737 PASSENGER CABIN HANDSET LOCATIONS EXCEPT THE 737 FORWARD ("LAV A") LOCATION. MOD ACEF HAS A KNOWN AUDIO CUT-OUT ISSUE UNDER THE FOLLOWING TWO CONDITIONS: 1) IT'S INSTALLED AT A 737 FORWARD ("LAV A") LOCATION, AND 2) WHEN SPEAKING TOO LOUDLY INTO THE MICROPHONE. THIS AUDIO CUT-OUT PROBLEM DOES NOT OCCUR AT OTHER PASSENGER CABIN LOCATIONS ON 737. ELECTRICAL EQUIP NUMBER: M00075 COMPONENT MAINT MANUAL REF: 23-42-01 MAINTENANCE MANUAL REF: 23-42-01 QUALIFIED I/W DATA: 285W0024-1M (GRAY) CAN REPLACE OR BE REPLACED BY 285W0024-1B (DARK		
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

— ITEM NOT ILLUSTRATED

R Y R

23-42-01-19

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

23-42-01
 FIG. 19
 PAGE 2
 APR 15/25

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
19			GRAY) CONDITIONAL UPON CUSTOMER COLOR PREFERENCE. 285W0024-5M CAN REPLACE OR BE REPLACED BY 285W0024-1M UPON CUSTOMER PREFERENCE. THE -1M HANDSET HAS NUMBERS ON THE KEYPAD AND THE -5M HANDSET HAS DESCRIPTIONS ON THE KEYPAD. 285W0024-22M CAN REPLACE OR BE REPLACED BY 285W0024-1M AT ALL NON-LAVATORY A LOCATIONS. 285W0024-22M CAN REPLACE BUT NOT BE REPLACED BY 285W0024-1M AT LAVATORY A LOCATION. 285W0024-23M CAN REPLACE BUT NOT BE REPLACED BY 285W0024-1M FOR AT LAV A CABIN LOCATION. 285W0024-23M CAN REPLACE OR BE REPLACED BY 285W0024-1M FOR AT NON-LAV A CABIN LOCATION. FUNCTIONAL REFERENCE: COMMUNICATIONS FOR DETAILS SEE 23-42-01-55 PLACARDS AND MARKINGS FOR DETAILS SEE 11-32-03-03A		
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

— ITEM NOT ILLUSTRATED

R Y R

23-42-01-19

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

23-42-01
 FIG. 19
 PAGE 3
 APR 15/25

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7 NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
19 40	476W2220-9P	.CRADLE ASSY- SUPPLIER CODE: V89954 COMPONENT MAINT MANUAL REF: 23-42-02 MAINTENANCE MANUAL REF: 23-42-01 QUALIFIED I/W DATA: 476W2220-9N (GREY) IS FULLY INTERCHANGEABLE WITH 476W2220-9P (DARK GREY) CONDITIONAL UPON CUSTOMER COLOR PREFERENCE. P/N 476W2220-9P CAN REPLACE OR BE REPLACED BY P/N 476W2220-2K FUNCTIONAL REFERENCE: COMMUNICATIONS FOR DETAILS SEE 23-42-01-50A PLACARDS AND MARKINGS FOR DETAILS SEE 11-32-03-74B ATTACHING PARTS .BOLT .BOLT -----*-----	378999	1
45	BACB30NN3K5		378999	2
50	BACB30NN3K16		378999	2
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE				

— ITEM NOT ILLUSTRATED


R Y R

23-42-01-19

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

23-42-01
 FIG. 19
 PAGE 4
 OCT 15/24

BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

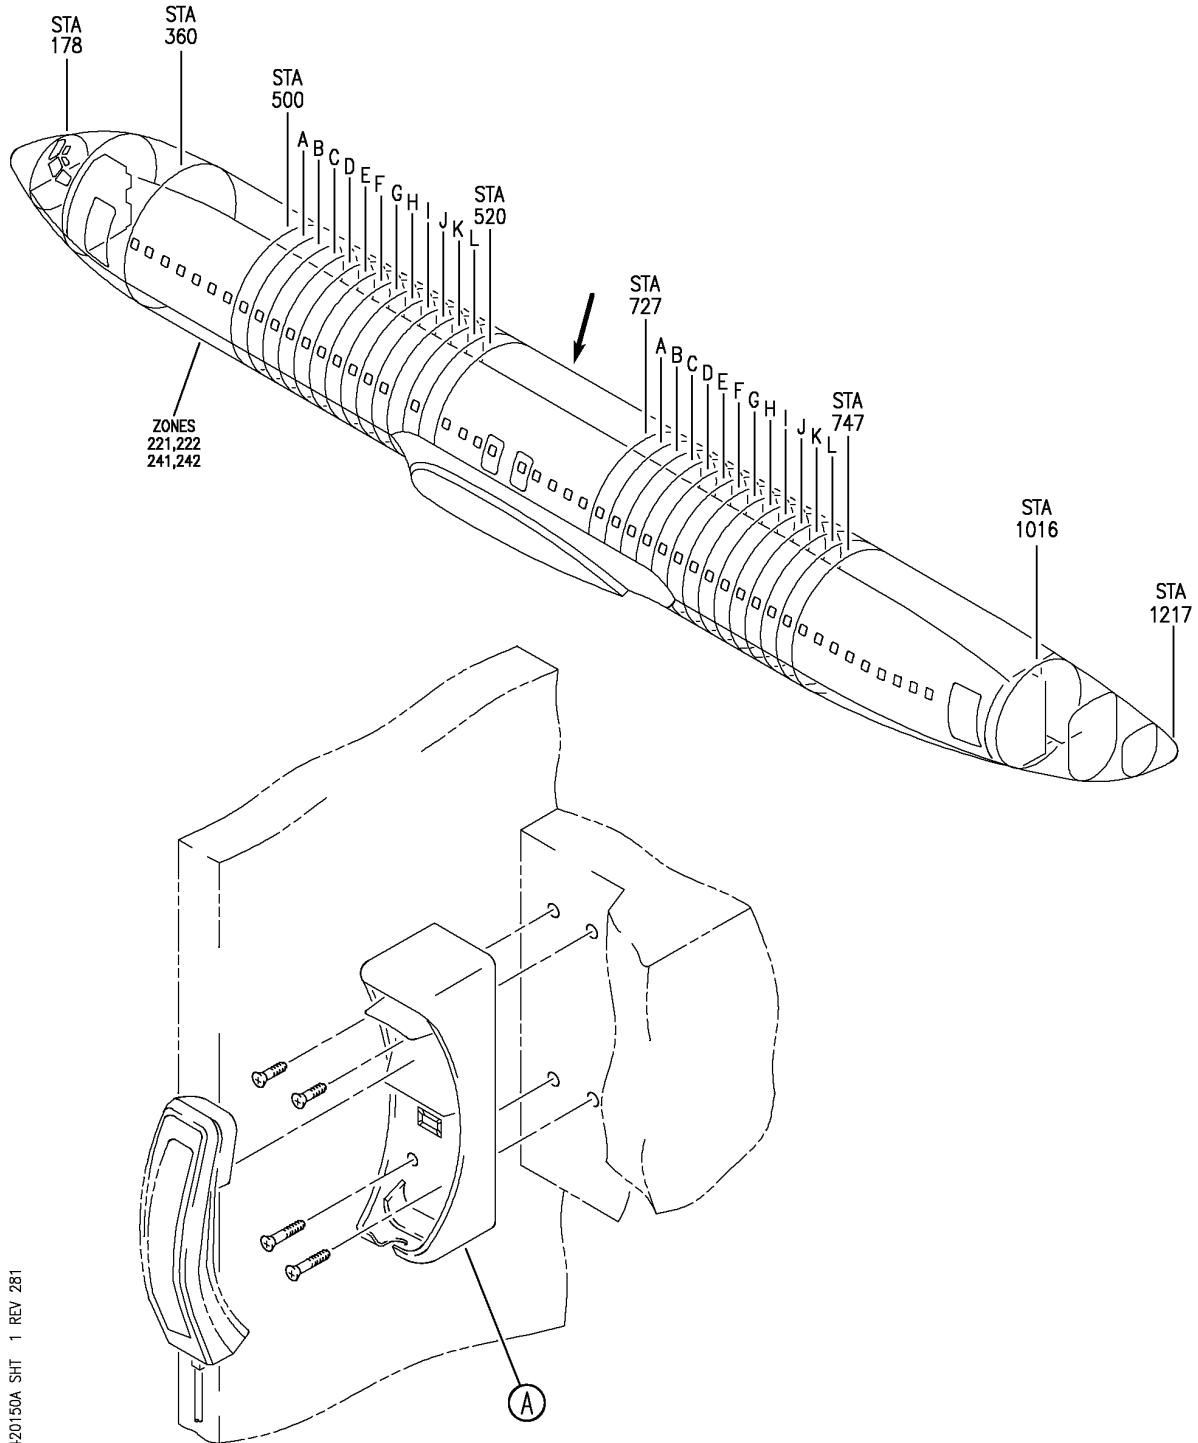

E 23420150A SHT 1 REV 281

CRADLE ASSEMBLY
FIGURE 50A (SHEET 1)


23-42-01-50A

RJR
DEC 15/19

23-42-01-50A
PAGE 0

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

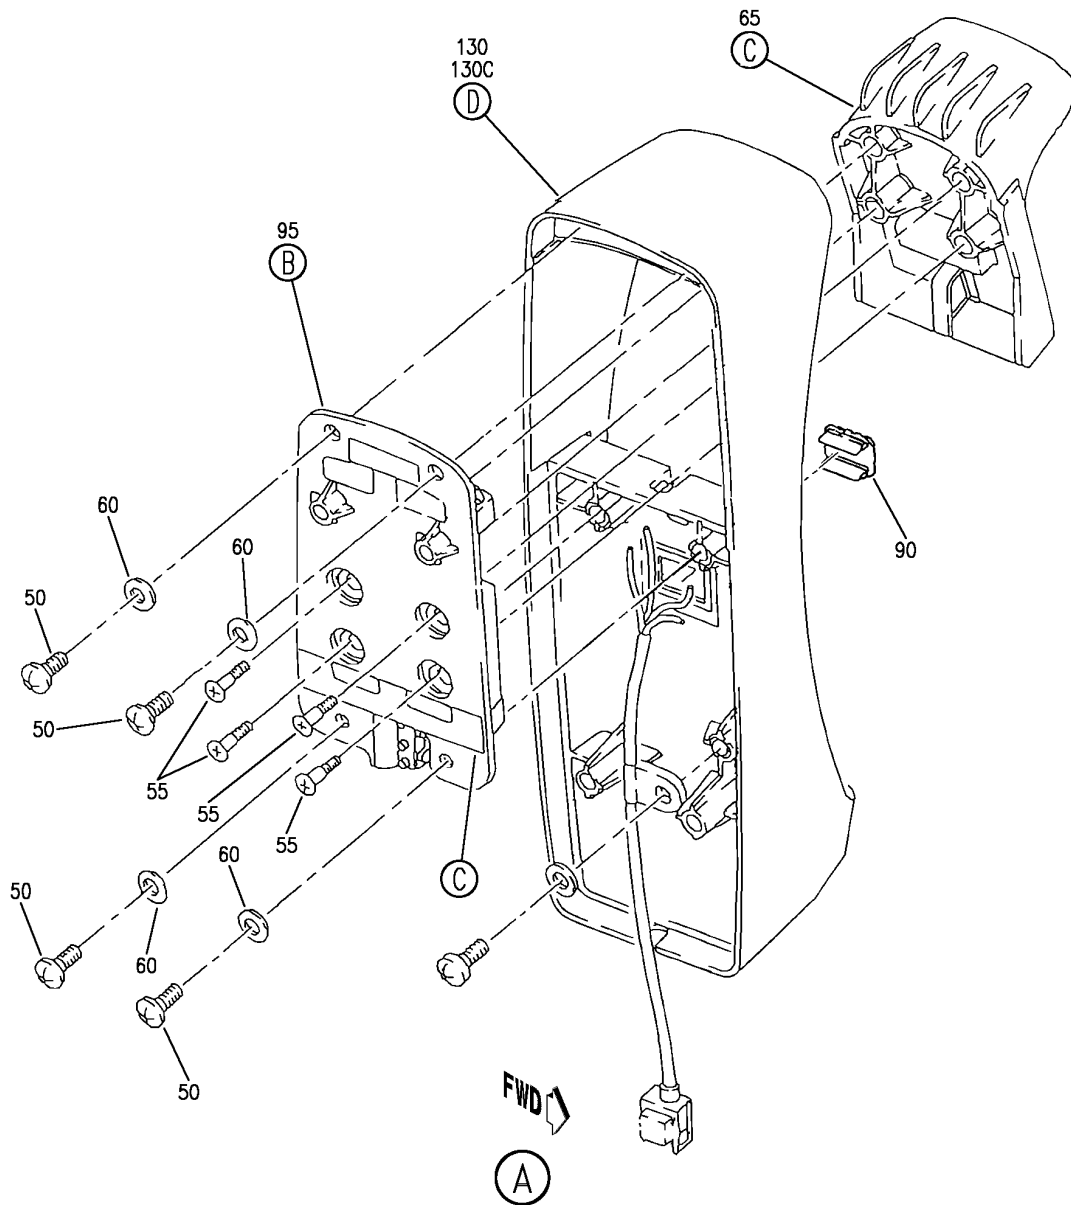

E 23420150A SHT 2 REV 281

CRADLE ASSEMBLY
FIGURE 50A (SHEET 2)


23-42-01-50A

R Y R
DEC 15/19

23-42-01-50A
PAGE 0A

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

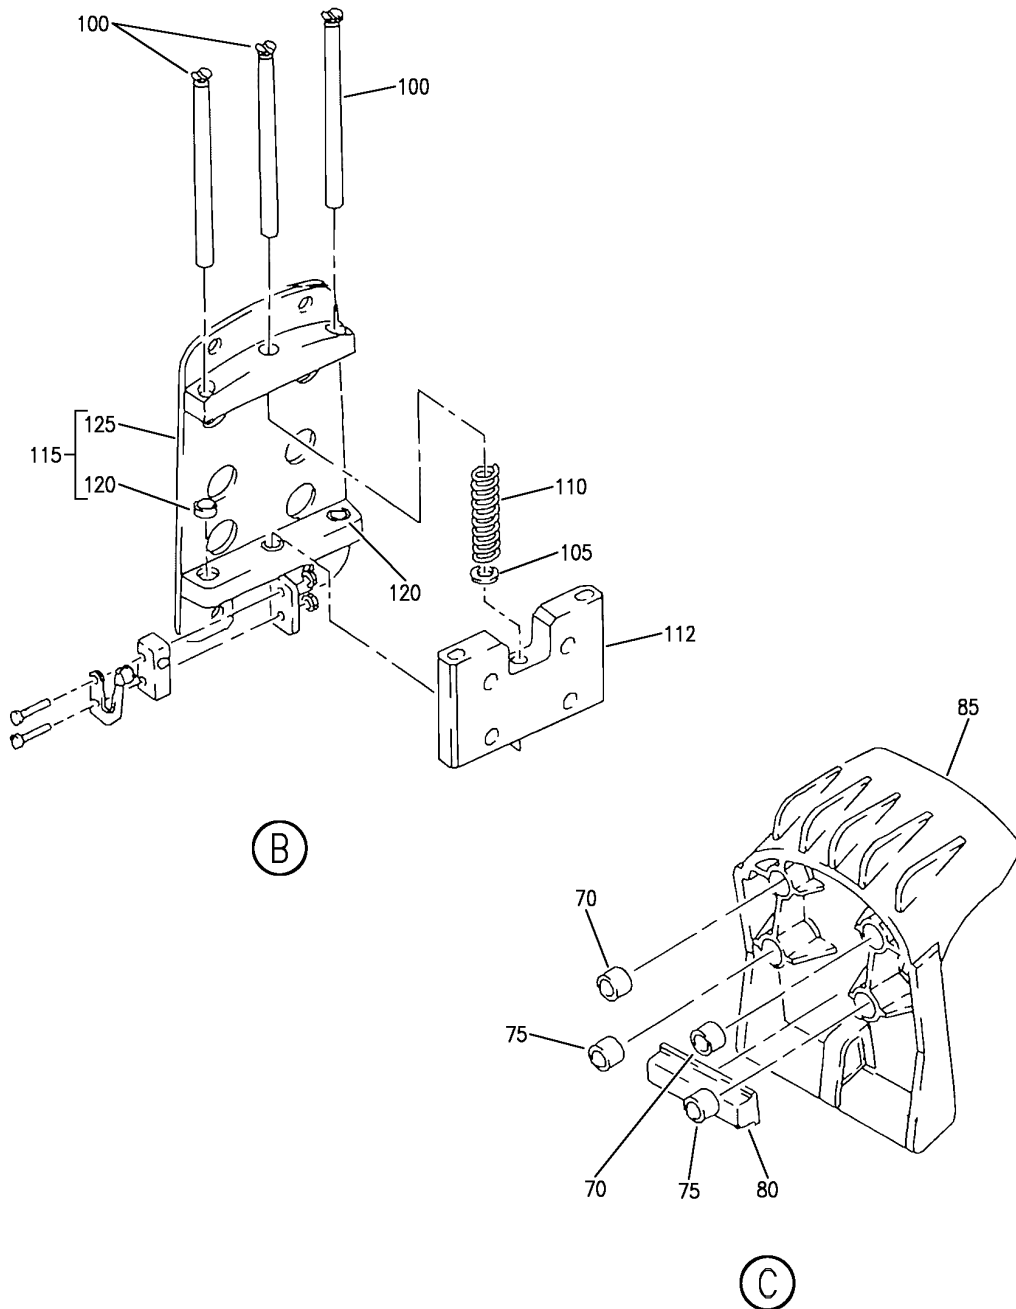

E 23420150A SHT 3 REV 281

CRADLE ASSEMBLY
FIGURE 50A (SHEET 3)


23-42-01-50A

R Y R
DEC 15/19

23-42-01-50A
PAGE 0B

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

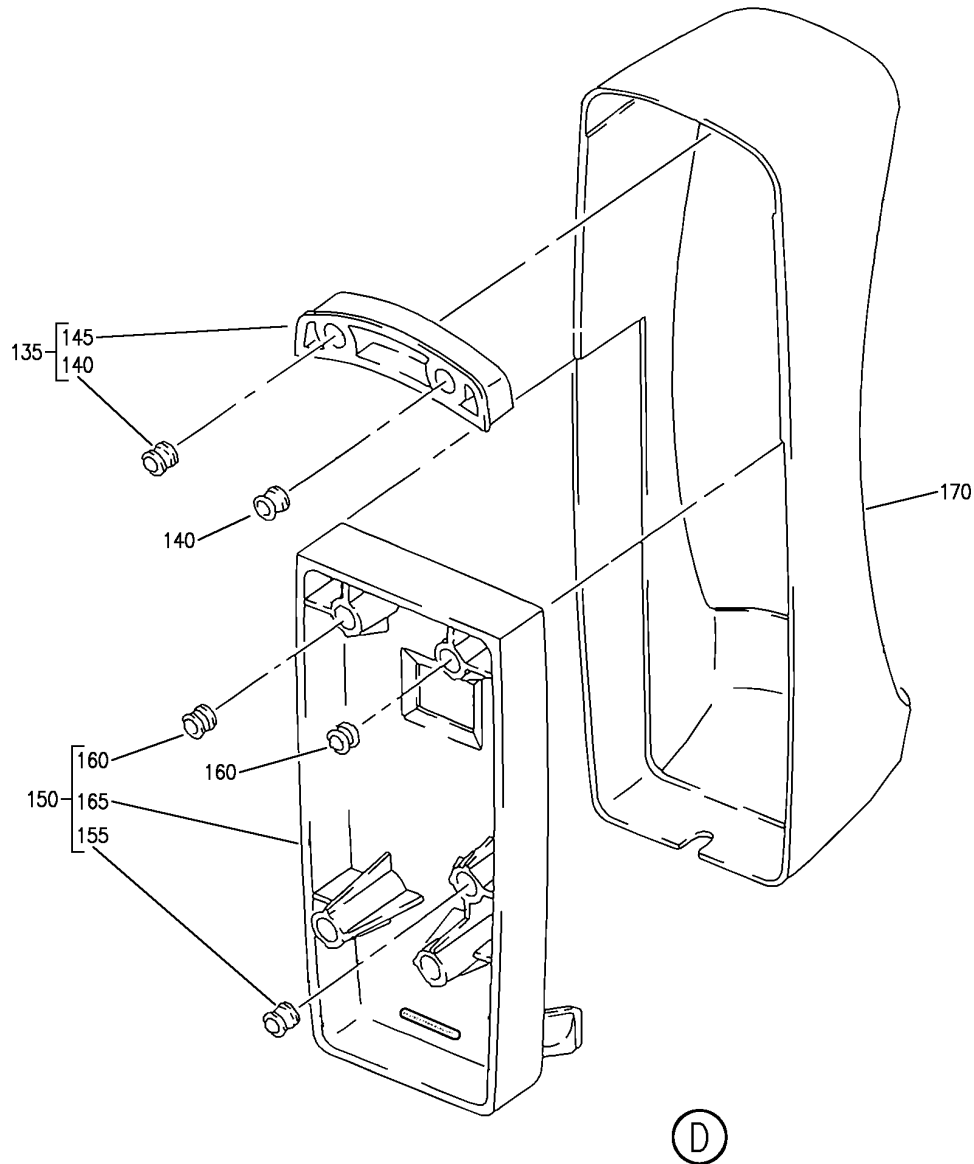

E 23420150A SHT 4 REV 281

CRADLE ASSEMBLY
FIGURE 50A (SHEET 4)

23-42-01-50A

RJR
DEC 15/19

23-42-01-50A
PAGE 0C

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
50A					
- 1	476W2220-9N		CRADLE ASSEMBLY CRADLE ASSY- SUPPLIER CODE: V89954 COMPONENT MAINT MANUAL REF: 23-42-02 QUALIFIED I/W DATA: 476W2220-9N (GREY) IS FULLY INTERCHANGEABLE WITH 476W2220-9P (DARK GREY) CONDITIONAL UPON CUSTOMER COLOR PREFERENCE. FOR NHA/OTHER SYS DET SEE: 23-42-01-02 23-42-01-03	056377	RF
- 1	476W2220-9P		CRADLE ASSY- SUPPLIER CODE: V89954 COMPONENT MAINT MANUAL REF: 23-42-02 QUALIFIED I/W DATA: 476W2220-9N (GREY) IS FULLY INTERCHANGEABLE WITH 476W2220-9P (DARK GREY) CONDITIONAL UPON CUSTOMER COLOR PREFERENCE. P/N 476W2220-9P CAN REPLACE OR BE REPLACED BY P/N 476W2220-2K FOR NHA/OTHER SYS DET SEE: 23-42-01-18 23-42-01-19	378999	RF
50	BACB30LK3U2	.BOLT			4
55	BACB30LH3PU4	.BOLT			4
60	NAS1149C0332R	.WASHER			4
65	476W2221-12N	.RETAINER ASSY- SUPPLIER CODE: V89954		056377	1
65	476W2221-12P	.RETAINER ASSY- SUPPLIER CODE: V89954		378999	1
70	461032X225	..ULTRASERT- SUPPLIER CODE: V25283 TRUE PART NUMBER: 461032X.225			2
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

- ITEM NOT ILLUSTRATED

RYR

23-42-01-50A

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

23-42-01
 FIG. 50A
 PAGE 1
 JUN 15/23

 BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
50A					
75	6041-3BRX375	..	INSERT- SUPPLIER CODE: V26344 TRUE PART NUMBER: 6041-3BR X .375 OPTIONAL SUPPLIER CODE: 01556		2
80	VIPX100	..	MAGNET- SUPPLIER CODE: V28406		1
85	476W2221-13N	..	RETAINER- SUPPLIER CODE: V89954	056377	1
85	476W2221-13P	..	RETAINER- SUPPLIER CODE: V89954	378999	1
90	476W2221-9K	.PLUG-	SUPPLIER CODE: V89954	056377	1
90	476W2221-9P	.PLUG-	SUPPLIER CODE: V89954	378999	1
95	476W2220-10P	.BACK PLATE ASSY-	SUPPLIER CODE: V89954	378999	1
100	476W2222-2	..	ROD-RETENTION SUPPLIER CODE: V89954	378999	3
100	476W2222-6	..	ROD-RETENTION SUPPLIER CODE: V89954	378999	3
105	476W2222-3	..	WASHER- SUPPLIER CODE: V89954	056377	1
105	476W2222-3	..	WASHER- SUPPLIER CODE: V89954	378999	1
110	MS24585C241	..	SPRING- CONFIG CHG DATA FROM A CMM: SUPSD BY 332B1193P1	056377	1
110	332B1193P1	..	SPRING- SUPPLIER CODE: V89954	378999	1
110	332B1193P1	..	SPRING- SUPPLIER CODE: V89954 CONFIG CHG DATA FROM A CMM: SUPERSEDES MS24585C241	056377	1
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

— ITEM NOT ILLUSTRATED

R Y R

23-42-01-50A

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

23-42-01
FIG. 50A
PAGE 2
JUN 15/23

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
50A					
112	476W2222-4		..PLATE- SUPPLIER CODE: V89954		1
115	476W2221-5SP		..PLATE ASSY- SUPPLIER CODE: V89954	056377	1
115	476W2221-5P		..BACKPLATE ASSY- SUPPLIER CODE: V89954	378999	1
120	6035-3BRX225		...INSERT- SUPPLIER CODE: V01556 TRUE PART NUMBER: 6035-3BRX.225		3
125	476W2221-6SP		...BACKPLATE- SUPPLIER CODE: V89954	056377	1
125	476W2221-6P		...BACKPLATE- SUPPLIER CODE: V89954	378999	1
130	476W2221-1K		.HOUSING ASSY- SUPPLIER CODE: V89954	056377	1
130C	476W2221-1P		.HOUSING ASSY- SUPPLIER CODE: V88954 COMPONENT MAINT MANUAL REF: 23-42-02	378999	1
135	476W2221-11SP		..WEDGE ASSY- SUPPLIER CODE: V89954	056377	1
135	476W2221-11P		..WEDGE ASSY- SUPPLIER CODE: V89954	378999	1
140	6041-3BRX375		...INSERT- SUPPLIER CODE: V26344 TRUE PART NUMBER: 6041-3BR X .375 OPTIONAL SUPPLIER CODE: 01556		2
145	476W2221-10SP		...INSERT- SUPPLIER CODE: V89954	056377	1
145	476W2221-10P		...INSERT- SUPPLIER CODE: V89954	378999	1
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

— ITEM NOT ILLUSTRATED

RYR

23-42-01-50A

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

23-42-01
 FIG. 50A
 PAGE 3
 JUN 15/23

BOEING
 737-600/700/800/900
 PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7 NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
50A				
150	476W2221-7SP	..MOUTHPIECE ASSY- SUPPLIER CODE: V89954 COMPONENT MAINT MANUAL REF: 23-42-02	056377	1
150	476W2221-7P	..MOUTHPIECE ASSY- SUPPLIER CODE: V88954 COMPONENT MAINT MANUAL REF: 23-42-02	378999	1
155	461032X225	...ULTRASERT- SUPPLIER CODE: V25283 TRUE PART NUMBER: 461032X.225		1
160	6041-3BRX375	...INSERT- SUPPLIER CODE: V26344 TRUE PART NUMBER: 6041-3BR X .375 OPTIONAL SUPPLIER CODE: 01556	056377	2
165	476W2221-8SP	...MOUTHPIECE- SUPPLIER CODE: V89954	056377	1
165	476W2221-8P	...MOUTH PIECE- SUPPLIER CODE: V89954	378999	1
170	476W2221-2SP	..HOUSING- SUPPLIER CODE: V89954	056377	1
170	476W2221-2P	..HOUSING- SUPPLIER CODE: V89954	378999	1
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE				


— ITEM NOT ILLUSTRATED

R Y R

23-42-01-50A


ECCN 9E991 BOEING PROPRIETARY – See title page for details.

23-42-01
 FIG. 50A
 PAGE 4
 JUN 15/23

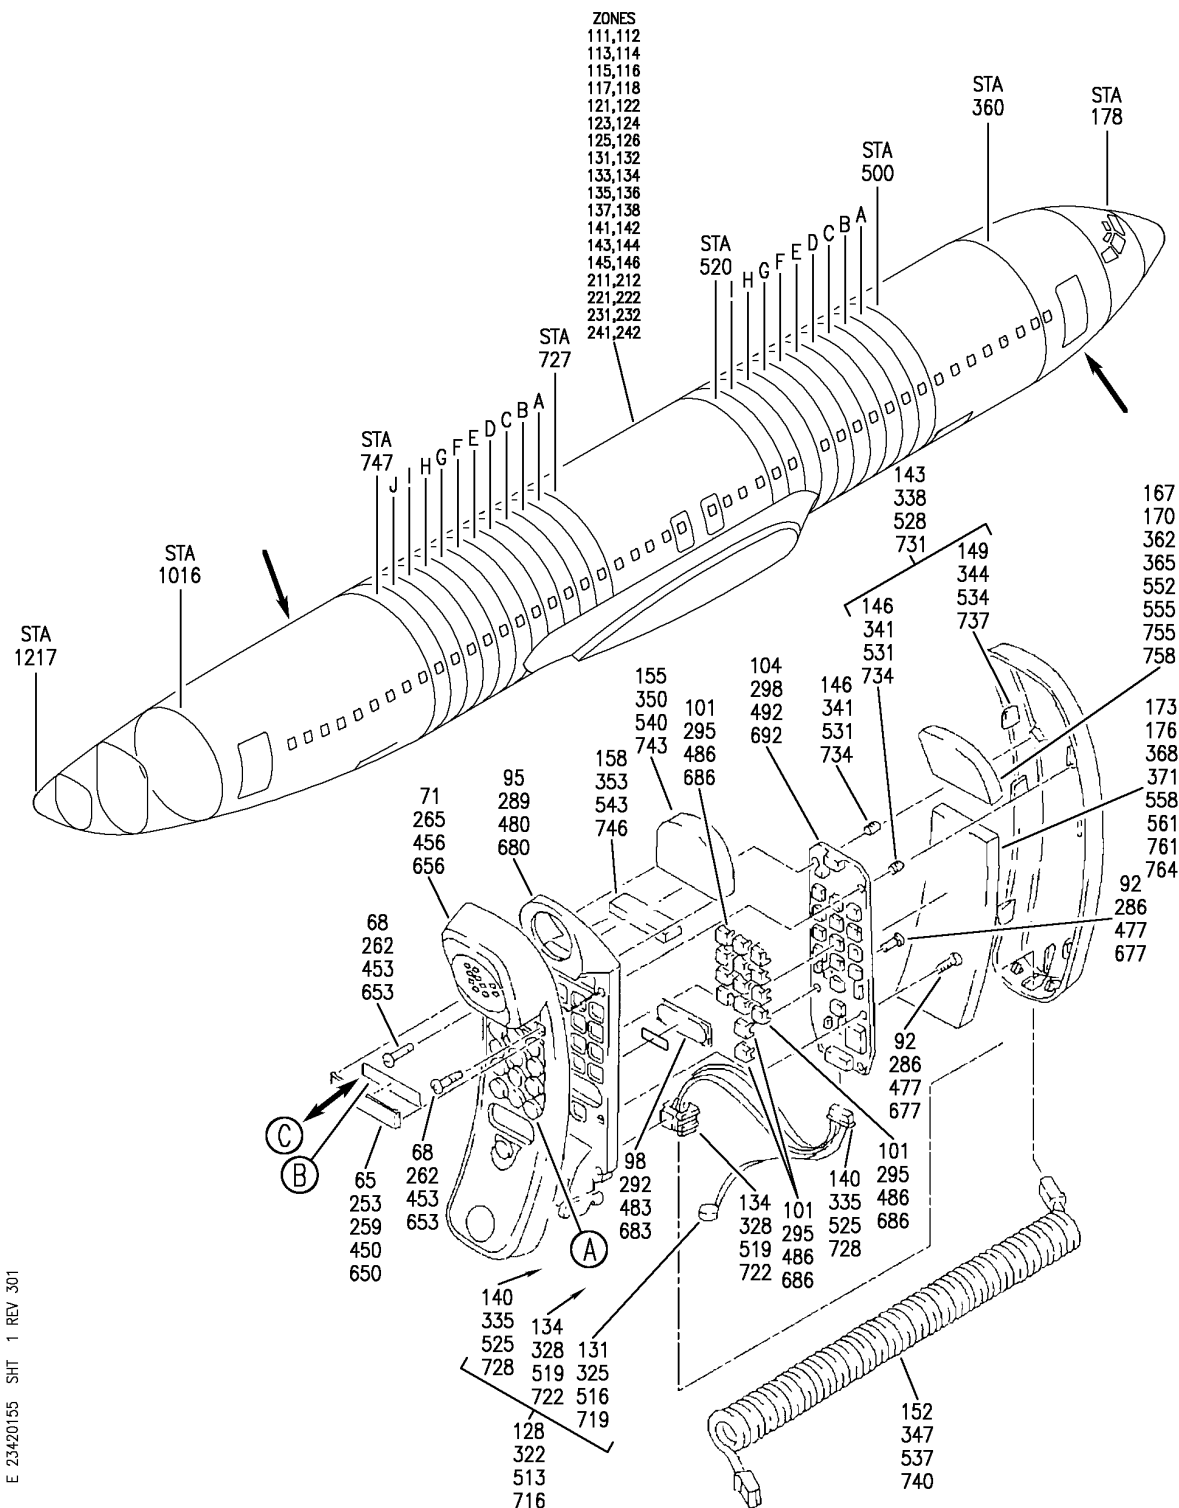

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

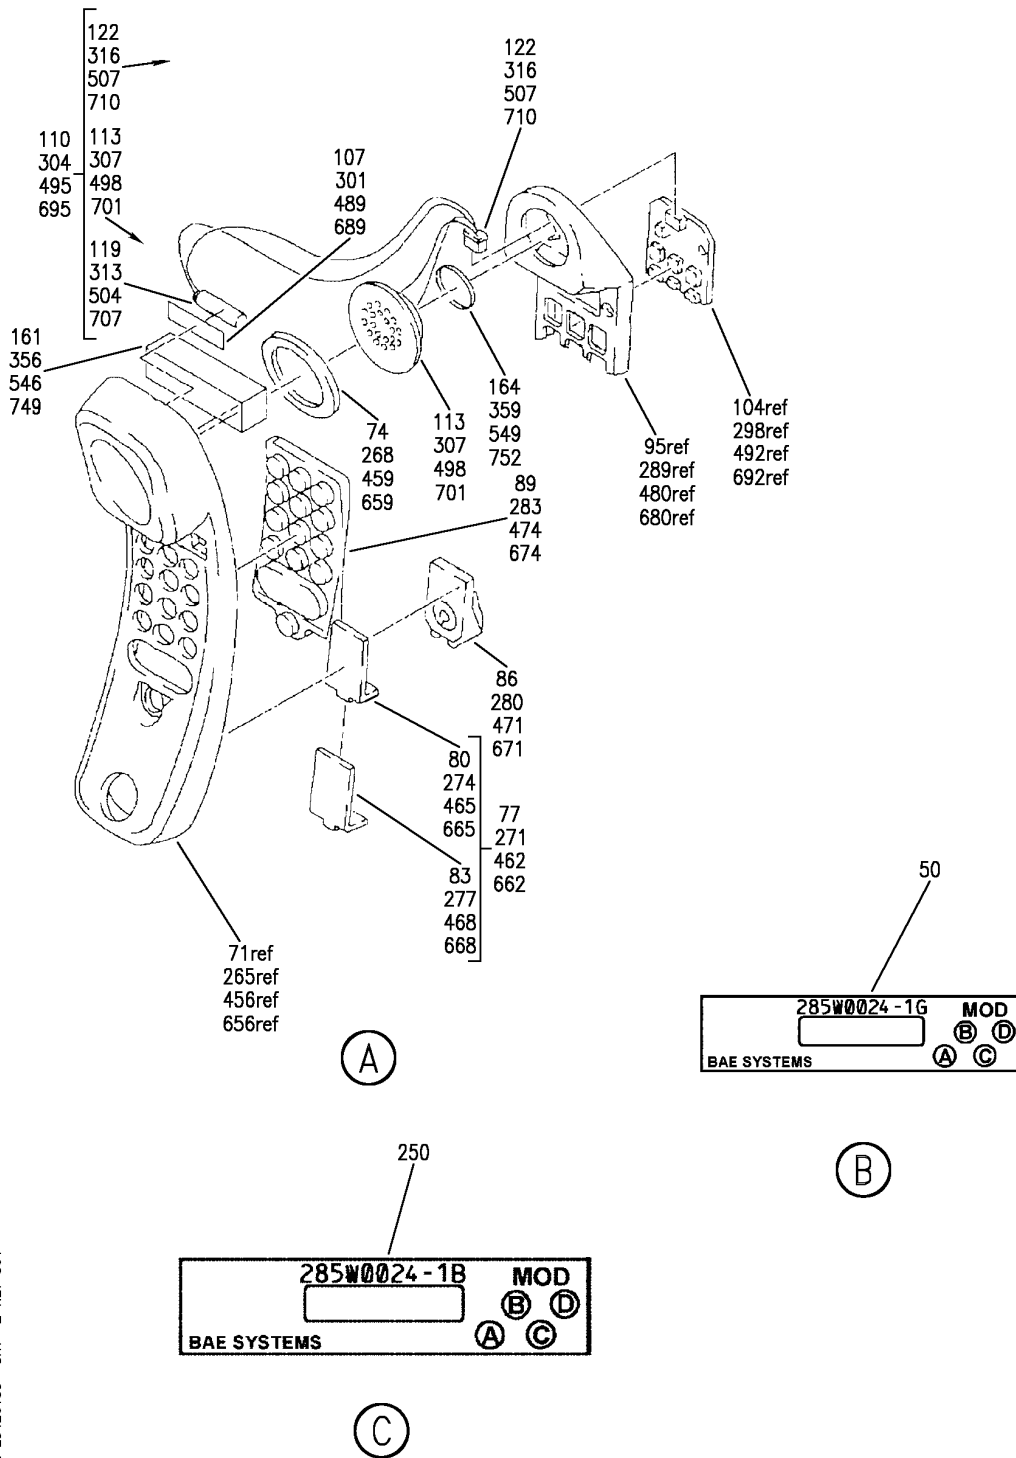

E 23420155 SHT 2 REV 301

MODULE ASSY-(COMMUNICATIONS ONLY)
FIGURE 55 (SHEET 2)

23-42-01-55

R/YR
AUG 15/21

23-42-01-55
PAGE 0A

 BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7 NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
55		MODULE ASSY-(COMMUNICATIONS ONLY)		
- 200	285W0024-1B	MODULE ASSY-(COMMUNICATIONS ONLY)	056377	RF
R		285W0024-1B NO MOD		
R		285W0024-1B MOD A		
R		285W0024-1B MOD AB		
R		285W0024-1B MOD AD		
R		285W0024-1B MOD AC		
R		285W0024-1B MOD ABC		
R		285W0024-1B MOD D		
R		285W0024-1B MOD ACD		
R		SUPPLIER CODE:		
R		V89954		
R		FUNCTIONAL DESCRIPTION:		
R		THE HANDSET IS A PART OF		
R		THE CABIN MANAGEMENT		
R		SYSTEM (CMS). THE		
R		HANDSET INTERFACES TO		
R		THE CABIN INTERPHONE		
R		SYSTEM (CIS) FOR VOICE		
R		COMMUNICATIONS AND TO		
R		THE PASSENGER ADDRESS		
R		SYSTEM (PAS) FOR		
R		PASSENGER ADDRESS		
R		ANNOUNCEMENTS.		
R		MISCELLANEOUS DATA:		
R		BAE PART NUMBER		
R		285W0024-1 HANDSETS		
R		LABELED "MOD ACEF" MAY		
R		BE USED AT ANY 737		
R		PASSENGER CABIN HANDSET		
R		LOCATIONS EXCEPT THE 737		
R		FORWARD ("LAV A")		
R		LOCATION. MOD ACEF HAS A		
R		KNOWN AUDIO CUT-OUT		
R		ISSUE UNDER THE		
R		FOLLOWING TWO		
R		CONDITIONS: 1) IT'S		
R		INSTALLED AT A 737		
R		FORWARD ("LAV A")		
R		LOCATION, AND 2) WHEN		
R		SPEAKING TOO LOUDLY INTO		
R		THE MICROPHONE. THIS		
R		AUDIO CUT-OUT PROBLEM		
R		DOES NOT OCCUR AT OTHER		
R		PASSENGER CABIN		
R		LOCATIONS ON 737.		
R		COMPONENT MAINT MANUAL REF:		
		ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE		

— ITEM NOT ILLUSTRATED

RYR

23-42-01-55

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

23-42-01
FIG. 55
PAGE 1
APR 15/25

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
55			23-42-01 QUALIFIED I/W DATA: 285W0024-1M (GRAY) CAN REPLACE OR BE REPLACED BY 285W0024-1B (DARK GRAY) CONDITIONAL UPON CUSTOMER COLOR PREFERENCE. P/N 285W0024-5B CAN REPLACE OR BE REPLACED BY P/N 285W0024-1B UPON CUSTOMER PREFERENCE. THE -1B HANDSET HAS NUMBERS ON THE KEYPAD AND THE -5B HANDSET HAS DESCRIPTIONS ON THE KEYPAD. P/N 285W0024-5M (GRAY) CAN REPLACE OR BE REPLACED BY P/N 285W0024-1B (DARK GRAY) UPON CUSTOMER PREFERENCE. THE -1B HANDSET HAS NUMBERS ON THE KEYPAD AND THE -5M HANDSET HAS DESCRIPTIONS ON THE KEYPAD. 285W0024-23B CAN REPLACE OR BE REPLACED BY 285W0024-1B WHEN INSTALLED AT ALL NON-FORWARD LOCATIONS. 285W0024-23B CAN REPLACE BUT NOT BE REPLACED BY 285W0024-1B ONLY WHEN INSTALLED IN FORWARD LOCATION. 285W0024-22M CAN REPLACE OR BE REPLACED BY 285W0024-1B AT ALL NON-LAVATORY A LOCATIONS. 285W0024-22M CAN REPLACE BUT NOT BE REPLACED BY 285W0024-1B AT LAVATORY		
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

— ITEM NOT ILLUSTRATED

R Y R

23-42-01-55

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

23-42-01
 FIG. 55
 PAGE 2
 APR 15/25

 BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7 NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
55		A LOCATION. 285W0024-23M (GRAY) CAN REPLACE BUT NOT BE REPLACED BY 285W0024-1B (DARK GRAY) FOR AT LAV A CABIN LOCATION. 285W0024-23M (GRAY) CAN REPLACE OR BE REPLACED BY 285W0024-1B (DARK GRAY) FOR AT NON-LAV A CABIN LOCATION. FOR NHA/OTHER SYS DET SEE: 23-42-01-02 23-42-01-03		
- 203	285W0024-1M	MODULE ASSY-(COMMUNICATIONS ONLY) 285W0024-1M MOD ACD SUPPLIER CODE: V89954 FUNCTIONAL DESCRIPTION: THE HANDSET IS A PART OF THE CABIN MANAGEMENT SYSTEM (CMS). THE HANDSET INTERFACES TO THE CABIN INTERPHONE SYSTEM (CIS) FOR VOICE COMMUNICATIONS AND TO THE PASSENGER ADDRESS SYSTEM (PAS) FOR PASSENGER ADDRESS ANNOUNCEMENTS. MISCELLANEOUS DATA: BAE PART NUMBER 285W0024-1 HANDSETS LABELED "MOD ACEF" MAY BE USED AT ANY 737 PASSENGER CABIN HANDSET LOCATIONS EXCEPT THE 737 FORWARD ("LAV A") LOCATION. MOD ACEF HAS A KNOWN AUDIO CUT-OUT ISSUE UNDER THE FOLLOWING TWO CONDITIONS: 1) IT'S INSTALLED AT A 737 FORWARD ("LAV A") LOCATION, AND 2) WHEN SPEAKING TOO LOUDLY INTO	378999	RF
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE				

— ITEM NOT ILLUSTRATED

RYR

23-42-01-55

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

23-42-01
FIG. 55
PAGE 3
APR 15/25

 BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
55			THE MICROPHONE. THIS AUDIO CUT-OUT PROBLEM DOES NOT OCCUR AT OTHER PASSENGER CABIN LOCATIONS ON 737. COMPONENT MAINT MANUAL REF: 23-42-01 QUALIFIED I/W DATA: 285W0024-5M CAN REPLACE OR BE REPLACED BY 285W0024-1M UPON CUSTOMER PREFERENCE. THE -1M HANDSET HAS NUMBERS ON THE KEYPAD AND THE -5M HANDSET HAS DESCRIPTIONS ON THE KEYPAD. 285W0024-1M (GRAY) CAN REPLACE OR BE REPLACED BY 285W0024-1B (DARK GRAY) CONDITIONAL UPON CUSTOMER COLOR PREFERENCE. 285W0024-22M CAN REPLACE OR BE REPLACED BY 285W0024-1M AT ALL NON-LAVATORY A LOCATIONS. 285W0024-22M CAN REPLACE BUT NOT BE REPLACED BY 285W0024-1M AT LAVATORY A LOCATION. 285W0024-23M CAN REPLACE BUT NOT BE REPLACED BY 285W0024-1M FOR AT LAV A CABIN LOCATION. 285W0024-23M CAN REPLACE OR BE REPLACED BY 285W0024-1M FOR AT NON-LAV A CABIN LOCATION. FOR NHA/OTHER SYS DET SEE: 23-42-01-18 23-42-01-19 ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE		

— ITEM NOT ILLUSTRATED

R Y R

23-42-01-55

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

23-42-01
FIG. 55
PAGE 4
APR 15/25

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
55					
250	BAC27DEX6280		.MARKER- SUPPLIER CODE: V89954 MISCELLANEOUS DATA: USED ON 285W0024-1B NO MOD 285W0024-1B MOD A 285W0024-1B MOD AB 285W0024-1B MOD D 285W0024-1B MOD AD 285W0024-1B MOD AC 285W0024-1B MOD ABC 285W0024-1B MOD ACD	056377	1
259	087514-101		.RETAINER- SUPPLIER CODE: V25397 MISCELLANEOUS DATA: USED ON 285W0024-1B NO MOD 285W0024-1B MOD A 285W0024-1B MOD AB 285W0024-1B MOD D 285W0024-1B MOD AD 285W0024-1B MOD AC 285W0024-1B MOD ABC 285W0024-1B MOD ACD 285W0024-1M MOD ACD OPTIONAL SUPPLIER CODE: 21340 71468		1
262	MS51957-18		.SCREW		2
265	285W0096-7B		.SHELL-FRONT SUPPLIER CODE: V89954 MISCELLANEOUS DATA: USED ON 285W0024-1B NO MOD 285W0024-1B MOD A 285W0024-1B MOD AB 285W0024-1B MOD D 285W0024-1B MOD AD	056377	1
265	285W0096-10B		.SHELL-FRONT SUPPLIER CODE: V89954 MISCELLANEOUS DATA: USED ON 285W0024-1B MOD AC 285W0024-1B MOD ABC 285W0024-1B MOD ACD	056377	1
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

— ITEM NOT ILLUSTRATED

R Y R

23-42-01-55

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

23-42-01
 FIG. 55
 PAGE 5
 APR 15/25

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7 NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
55 265	285W0096-10P	.SHELL-FRONT SUPPLIER CODE: V89954 MISCELLANEOUS DATA: USED ON 285W0024-1M MOD ACD	378999	1
268	61788	.GASKET- SUPPLIER CODE: V4F561		1
271	285W0755-1	.SCREEN ASSY- SUPPLIER CODE: V89954 MISCELLANEOUS DATA: USED ON 285W0024-1B NO MOD 285W0024-1B MOD A 285W0024-1B MOD AB 285W0024-1B MOD D 285W0024-1B MOD AD 285W0024-1B MOD AC 285W0024-1B MOD ABC 285W0024-1B MOD ACD 285W0024-1M MOD ACD		1
271	285W0755-4	.SCREEN ASSY- SUPPLIER CODE: V89954 MISCELLANEOUS DATA: USED ON 285W0024-1B MOD AC 285W0024-1B MOD ABC 285W0024-1B MOD ACD 285W0024-1M MOD ACD 285W0024-10G NO MOD 285W0024-10G MOD A		1
274	285W0755-3	..DAMPER-ACOUSTIC SUPPLIER CODE: V89954 USED ON: 285W0755-1	056377	1
274	285W0755-6	..DAMPER-ACOUSTIC SUPPLIER CODE: V89954 USED ON: 285W0755-4		1
277	285W0755-2	..SCREEN- SUPPLIER CODE: V89954 USED ON: 285W0755-1	056377	1
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE				

— ITEM NOT ILLUSTRATED

R Y R

23-42-01-55

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

23-42-01
 FIG. 55
 PAGE 6
 APR 15/25

 BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7 NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
55				
277	285W0755-5	..SCREEN- SUPPLIER CODE: V89954 USED ON: 285W0755-4		1
280	285W0087-4	.HOLDER-MIC SUPPLIER CODE: V89954		1
283	GM335167	.KEYPAD- SUPPLIER CODE: V22670		1
283	115E5492P1	.KEYPAD- SUPPLIER CODE: V22670		1
286	224-20300-382	.SCREW- SUPPLIER CODE: V93907		2
289	285W0097-2	.CARRIER- SUPPLIER CODE: V89954 MISCELLANEOUS DATA: USED ON 285W0024-1B NO MOD 285W0024-1B MOD A 285W0024-1B MOD AB 285W0024-1B MOD AC 285W0024-1B MOD ABC 285W0024-10G NO MOD	056377	1
289	285W0097-3	.CARRIER- SUPPLIER CODE: V89954 MISCELLANEOUS DATA: USED ON 285W0024-1B MOD D 285W0024-1B MOD AD 285W0024-1B MOD ACD 285W0024-1M MOD ACD 285W0024-10G MOD A		1
292	285W0099-1	.BUTTON-PUSH TO TALK SUPPLIER CODE: V89954 CONFIG CHG DATA FROM A CMM: REPLD BY 285W0099-3		1
292	285W0099-3	.BUTTON-PUSH TO TALK SUPPLIER CODE: V89954 CONFIG CHG DATA FROM A CMM: REPLS 285W0099-1		1
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE				

— ITEM NOT ILLUSTRATED

R Y R

23-42-01-55

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

23-42-01
FIG. 55
PAGE 7
APR 15/25

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
55					
295	363A2243P1		.CAP-KEY SUPPLIER CODE: VF0537 MISCELLANEOUS DATA: USED ON 285W0024-1B MOD D 285W0024-1B MOD AD 285W0024-1B MOD ACD 285W0024-1M MOD ACD 285W0024-10G MOD A		14
298	285W0098-5		.WIRING ASSY-PRINTED SUPPLIER CODE: V89954 MISCELLANEOUS DATA: USED ON 285W0024-1B NO MOD 285W0024-1B MOD A 285W0024-1B MOD AC	056377	1
298	285W0098-7		.WIRING ASSY-PRINTED SUPPLIER CODE: V89954 MISCELLANEOUS DATA: USED ON 285W0024-1B MOD AB 285W0024-1B MOD ABC COMPONENT MAINT MANUAL REF: 23-42-01	056377	1
298	285W0098-8		.WIRING ASSY-PRINTED SUPPLIER CODE: V89954 MISCELLANEOUS DATA: USED ON 285W0024-1B MOD ABC 285W0024-1B MOD ACD 285W0024-1M MOD ACD 285W0024-10G NO MOD COMPONENT MAINT MANUAL REF: 23-42-01		1
298	285W0098-9		.WIRING ASSY-PRINTED SUPPLIER CODE: V89954 MISCELLANEOUS DATA: USED ON 285W0024-1B MOD D 285W0024-1B MOD AD 285W0024-1B MOD ACD 285W0024-1M MOD ACD 285W0024-10G MOD A		1
301	N0002111		.TAPE-		1
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

— ITEM NOT ILLUSTRATED

R Y R

23-42-01-55

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

23-42-01
 FIG. 55
 PAGE 8
 FEB 15/25

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7 NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
55				
301	4052-1	.TAPE- SUPPLIER CODE: V1A9T3		1
304	285W0095-1	.CABLE ASSY-REED SWITCH TO RCVR INTERFACE SUPPLIER CODE: V89954		1
307	S906-10135-9005	..RECEIVER		1
- 310	BMS13-48T01C01G	..WIRE		AR
313	59025-030	..SWITCH-REED SUPPLIER CODE: V12617		1
316	DF3-4S2C	..HOUSING-CONTACT SUPPLIER CODE: VOAG18 TRUE PART NUMBER: DF3-4S-2C		1
- 319	DF3-2428SC	..SOCKET-CONTACT, CRIMP SUPPLIER CODE: VOAG18		4
322	285W0095-2	.CABLE ASSY-MIC, PHONE JACK SUPPLIER CODE: V89954 MISCELLANEOUS DATA: USED ON 285W0024-1B NO MOD 285W0024-1B MOD A 285W0024-1B MOD AB 285W0024-1B MOD D 285W0024-1B MOD AD 285W0024-1B MOD AC 285W0024-1B MOD ABC 285W0024-1B MOD ACD 285W0024-1M MOD ACD		1
325	S906-10135-9004	..MICROPHONE-CAP., ELECTRET USED ON: 285W0095-2		1
328	90319-0005	..CONNECTOR-JACK, PHONE SUPPLIER CODE: V27264 USED ON: 285W0095-2		1
328	883-6525-00	..CONNECTOR-JACK, PHONE SUPPLIER CODE: V27264 USED ON: 285W0095-2		1
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE				

- ITEM NOT ILLUSTRATED

R Y R

23-42-01-55

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

23-42-01
 FIG. 55
 PAGE 9
 FEB 15/25

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
55					
328	TM1RV623K6635S1	..	CONNECTOR-JACK, PHONE SUPPLIER CODE: V27264 USED ON: 285W0095-2		1
328	1061-623K600	..	CONNECTOR-E/E, MODULAR JACK SUPPLIER CODE: V89954 TRUE PART NUMBER: 1061-623K-600 USED ON: 285W0095-2		1
328	883-6272-00	..	CONNECTOR-JACK, MODULAR SUPPLIER CODE: V27264 USED ON: 285W0095-2		1
328	362A6639P1	..	CONNECTOR-E/E, MODULAR JACK SUPPLIER CODE: V89954 USED ON: 285W0095-2		1
- 332	DF3-2428SC	..	SOCKET-CONTACT, CRIMP SUPPLIER CODE: VOAG18		7
335	DF3-7S2C	..	HOUSING-INSULATOR, SOCKET SUPPLIER CODE: VOAG18 TRUE PART NUMBER: DF3-7S-2C		1
338	285W0096-8B	.S	SHELL ASSY-HANDSET SUPPLIER CODE: V89954 MISCELLANEOUS DATA: USED ON 285W0024-1B NO MOD 285W0024-1B MOD A 285W0024-1B MOD AB 285W0024-1B MOD D 285W0024-1B MOD AD	056377	1
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

— ITEM NOT ILLUSTRATED

RYR

23-42-01-55

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

23-42-01
 FIG. 55
 PAGE 10
 FEB 15/25

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7 NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
55				
338	285W0096-11B	.SHELL ASSY-HANDSET SUPPLIER CODE: V89954 MISCELLANEOUS DATA: USED ON 285W0024-1B MOD AC 285W0024-1B MOD ABC 285W0024-1B MOD ACD	056377	1
338	285W0096-11P	.SHELL ASSY-HANDSET SUPPLIER CODE: V89954 MISCELLANEOUS DATA: USED ON 285W0024-1M MOD ACD	378999	1
341	6035-04BR135	..INSERT- SUPPLIER CODE: V01556		2
344	285W0096-9B	..SHELL- SUPPLIER CODE: V89954 USED ON: 285W0096-8B	056377	1
344	285W0096-12B	..SHELL- SUPPLIER CODE: V89954 USED ON: 285W0096-11B	056377	1
344	285W0096-12P	..SHELL- SUPPLIER CODE: V89954 MISCELLANEOUS DATA: USED ON 285W0024-1M MOD ACD USED ON: 285W0096-11P	378999	1
347	020003263	.CORD-COILED DARK GRAY SUPPLIER CODE: V59608 MISCELLANEOUS DATA: USED ON 285W0024-1B NO MOD 285W0024-1B MOD A 285W0024-1B MOD AB 285W0024-1B MOD D 285W0024-1B MOD AD 285W0024-1B MOD AC 285W0024-1B MOD ABC 285W0024-1B MOD ACD	056377	1
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE				

— ITEM NOT ILLUSTRATED

R Y R

23-42-01-55

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

23-42-01
 FIG. 55
 PAGE 11
 FEB 15/25

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7 NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
55				
347	020003800	.CORD-COILED GRAY SUPPLIER CODE: V59608 MISCELLANEOUS DATA: USED ON 285W0024-1M MOD ACD	378999	1
350	285W1001-1	.ISOLATOR- SUPPLIER CODE: V89954 MISCELLANEOUS DATA: USED ON 285W0024-1B MOD A 285W0024-1B MOD AB 285W0024-1B MOD AD 285W0024-1B MOD AC 285W0024-1B MOD ABC 285W0024-1B MOD ACD 285W0024-1M MOD ACD 285W0024-10G NO MOD 285W0024-10G MOD A		1
353	285W1001-9	.GASKET- SUPPLIER CODE: V89954 MISCELLANEOUS DATA: USED ON 285W0024-1B MOD A 285W0024-1B MOD AB 285W0024-1B MOD AD 285W0024-1B MOD AC 285W0024-1B MOD ABC 285W0024-1B MOD ACD 285W0024-1M MOD ACD 285W0024-10G NO MOD 285W0024-10G MOD A		1
356	285W1001-4	.ISOLATOR- SUPPLIER CODE: V89954 MISCELLANEOUS DATA: USED ON 285W0024-1B MOD A 285W0024-1B MOD AB 285W0024-1B MOD AD 285W0024-1B MOD AC 285W0024-1B MOD ABC 285W0024-1B MOD ACD 285W0024-1M MOD ACD 285W0024-10G NO MOD 285W0024-10G MOD A		1
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE				

— ITEM NOT ILLUSTRATED

R Y R

23-42-01-55

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

23-42-01
 FIG. 55
 PAGE 12
 FEB 15/25

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
55					
359	285W1001-8		. SEAL- SUPPLIER CODE: V89954 MISCELLANEOUS DATA: USED ON 285W0024-1B MOD A 285W0024-1B MOD AB 285W0024-1B MOD AD 285W0024-1B MOD AC 285W0024-1B MOD ABC 285W0024-1B MOD ACD 285W0024-1M MOD ACD 285W0024-10G NO MOD 285W0024-10G MOD A		1
362	285W1001-2		. ISOLATOR ASSY- SUPPLIER CODE: V89954 MISCELLANEOUS DATA: USED ON 285W0024-1B MOD A 285W0024-1B MOD AB 285W0024-1B MOD AD 285W0024-1B MOD AC 285W0024-1B MOD ABC 285W0024-1B MOD ACD 285W0024-1M MOD ACD 285W0024-10G NO MOD 285W0024-10G MOD A		1
365	285W1001-5		.. SEAL- SUPPLIER CODE: V89954		1
368	285W1001-3		. ISOLATOR ASSY- SUPPLIER CODE: V89954 MISCELLANEOUS DATA: USED ON 285W0024-1B MOD A 285W0024-1B MOD AB 285W0024-1B MOD AD 285W0024-1B MOD AC 285W0024-1B MOD ABC 285W0024-1B MOD ACD 285W0024-1M MOD ACD 285W0024-10G NO MOD 285W0024-10G MOD A		1
371	285W1001-7		.. GASKET- SUPPLIER CODE: V89954		1
R - 400	285W0024-1B		MODULE ASSY-(COMMUNICATIONS	056377	RF
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

— ITEM NOT ILLUSTRATED

R Y R

23-42-01-55

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

23-42-01
 FIG. 55
 PAGE 13
 APR 15/25

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
55			ONLY) 285W0024-1B MOD ACDE SUPPLIER CODE: V89954 FUNCTIONAL DESCRIPTION: THE HANDSET IS A PART OF THE CABIN MANAGEMENT SYSTEM (CMS). THE HANDSET INTERFACES TO THE CABIN INTERPHONE SYSTEM (CIS) FOR VOICE COMMUNICATIONS AND TO THE PASSENGER ADDRESS SYSTEM (PAS) FOR PASSENGER ADDRESS ANNOUNCEMENTS. MISCELLANEOUS DATA: BAE PART NUMBER 285W0024-1 HANDSETS LABELED "MOD ACEF" MAY BE USED AT ANY 737 PASSENGER CABIN HANDSET LOCATIONS EXCEPT THE 737 FORWARD ("LAV A") LOCATION. MOD ACEF HAS A KNOWN AUDIO CUT-OUT ISSUE UNDER THE FOLLOWING TWO CONDITIONS: 1) IT'S INSTALLED AT A 737 FORWARD ("LAV A") LOCATION, AND 2) WHEN SPEAKING TOO LOUDLY INTO THE MICROPHONE. THIS AUDIO CUT-OUT PROBLEM DOES NOT OCCUR AT OTHER PASSENGER CABIN LOCATIONS ON 737. COMPONENT MAINT MANUAL REF: 23-42-01 QUALIFIED I/W DATA: 285W0024-1M (GRAY) CAN REPLACE OR BE REPLACED BY 285W0024-1B (DARK GRAY) CONDITIONAL UPON CUSTOMER COLOR PREFERENCE. P/N 285W0024-5B CAN		
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

— ITEM NOT ILLUSTRATED

R Y R

23-42-01-55

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

23-42-01
FIG. 55
PAGE 14
APR 15/25

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
55			REPLACE OR BE REPLACED BY P/N 285W0024-1B UPON CUSTOMER PREFERENCE. THE -1B HANDSET HAS NUMBERS ON THE KEYPAD AND THE -5B HANDSET HAS DESCRIPTIONS ON THE KEYPAD. P/N 285W0024-5M(GRAY) CAN REPLACE OR BE REPLACED BY P/N 285W0024-1B(DARK GRAY) UPON CUSTOMER PREFERENCE. THE -1B HANDSET HAS NUMBERS ON THE KEYPAD AND THE -5M HANDSET HAS DESCRIPTIONS ON THE KEYPAD. 285W0024-23B CAN REPLACE OR BE REPLACED BY 285W0024-1B WHEN INSTALLED AT ALL NON-FORWARD LOCATIONS. 285W0024-23B CAN REPLACE BUT NOT BE REPLACED BY 285W0024-1B ONLY WHEN INSTALLED IN FORWARD LOCATION. 285W0024-22M CAN REPLACE OR BE REPLACED BY 285W0024-1B AT ALL NON-LAVATORY A LOCATIONS. 285W0024-22M CAN REPLACE BUT NOT BE REPLACED BY 285W0024-1B AT LAVATORY A LOCATION. 285W0024-23M (GRAY) CAN REPLACE BUT NOT BE REPLACED BY 285W0024-1B (DARK GRAY) FOR AT LAV A CABIN LOCATION. 285W0024-23M (GRAY) CAN REPLACE OR BE REPLACED BY 285W0024-1B (DARK		
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

— ITEM NOT ILLUSTRATED

R Y R

23-42-01-55

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

23-42-01
 FIG. 55
 PAGE 15
 APR 15/25

 BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7 NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
55				
- 406	285W0024-1M	GRAY) FOR AT NON-LAV A CABIN LOCATION. FOR NHA/OTHER SYS DET SEE: 23-42-01-02 MODULE ASSY-(COMMUNICATIONS ONLY) 285W0024-1M MOD ACDE SUPPLIER CODE: V89954 FUNCTIONAL DESCRIPTION: THE HANDSET IS A PART OF THE CABIN MANAGEMENT SYSTEM (CMS). THE HANDSET INTERFACES TO THE CABIN INTERPHONE SYSTEM (CIS) FOR VOICE COMMUNICATIONS AND TO THE PASSENGER ADDRESS SYSTEM (PAS) FOR PASSENGER ADDRESS ANNOUNCEMENTS. MISCELLANEOUS DATA: BAE PART NUMBER 285W0024-1 HANDSETS LABELED "MOD ACEF" MAY BE USED AT ANY 737 PASSENGER CABIN HANDSET LOCATIONS EXCEPT THE 737 FORWARD ("LAV A") LOCATION. MOD ACEF HAS A KNOWN AUDIO CUT-OUT ISSUE UNDER THE FOLLOWING TWO CONDITIONS: 1) IT'S INSTALLED AT A 737 FORWARD ("LAV A") LOCATION, AND 2) WHEN SPEAKING TOO LOUDLY INTO THE MICROPHONE. THIS AUDIO CUT-OUT PROBLEM DOES NOT OCCUR AT OTHER PASSENGER CABIN LOCATIONS ON 737. COMPONENT MAINT MANUAL REF: 23-42-01 QUALIFIED I/W DATA: 285W0024-5M CAN REPLACE OR BE REPLACED BY 285W0024-1M UPON	378999	RF
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE				

— ITEM NOT ILLUSTRATED

RYR

23-42-01-55

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

23-42-01
FIG. 55
PAGE 16
APR 15/25

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
R R	55		CUSTOMER PREFERENCE. THE -1M HANDSET HAS NUMBERS ON THE KEYPAD AND THE -5M HANDSET HAS DESCRIPTIONS ON THE KEYPAD. 285W0024-1M (GRAY) CAN REPLACE OR BE REPLACED BY 285W0024-1B (DARK GRAY) CONDITIONAL UPON CUSTOMER COLOR PREFERENCE. 285W0024-22M CAN REPLACE OR BE REPLACED BY 285W0024-1M AT ALL NON-LAVATORY A LOCATIONS. 285W0024-22M CAN REPLACE BUT NOT BE REPLACED BY 285W0024-1M AT LAVATORY A LOCATION. 285W0024-23M CAN REPLACE BUT NOT BE REPLACED BY 285W0024-1M FOR AT LAV A CABIN LOCATION. 285W0024-23M CAN REPLACE OR BE REPLACED BY 285W0024-1M FOR AT NON-LAV A CABIN LOCATION. FOR NHA/OTHER SYS DET SEE: 23-42-01-18 23-42-01-19		
	450	087514-101	.RETAINER- SUPPLIER CODE: V25397 OPTIONAL SUPPLIER CODE: 21340 71468		1
	453	MS51957-18	.SCREW		2
	456	285W0096-10B	.SHELL-HANDSET SUPPLIER CODE: V89954 MISCELLANEOUS DATA: USED ON 285W0024-1B MOD ACDE	056377	1
			ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE		

— ITEM NOT ILLUSTRATED

R Y R

23-42-01-55

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

23-42-01
 FIG. 55
 PAGE 17
 APR 15/25

 BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7 NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
55				
456	285W0096-10P	.SHELL-HANDSET SUPPLIER CODE: V89954	378999	1
459	61788	.GASKET- SUPPLIER CODE: V4F561		1
462	285W0755-4	.SCREEN ASSY- SUPPLIER CODE: V89954		1
465	285W0755-6	..DAMPER-ACOUSTIC SUPPLIER CODE: V89954		1
468	285W0755-5	..SCREEN- SUPPLIER CODE: V89954		1
471	285W0087-4	.HOLDER-MIC SUPPLIER CODE: V89954		1
474	115E5492P1	.KEYPAD-ELASTOMER SUPPLIER CODE: V22670		1
477	224-20300-382	.SCREW- SUPPLIER CODE: V93907		2
480	285W0097-3	.CARRIER-HANDSET SUPPLIER CODE: V89954		1
483	285W0099-1	.BUTTON-PUSH TO TALK SUPPLIER CODE: V89954 CONFIG CHG DATA FROM A CMM: REPLD BY 285W0099-3		1
483	285W0099-3	.BUTTON-PUSH TO TALK SUPPLIER CODE: V89954 CONFIG CHG DATA FROM A CMM: REPLS 285W0099-1		1
486	363A2243P1	.CAP-KEY SUPPLIER CODE: VF0537		14
489	4052-1	.TAPE- SUPPLIER CODE: V1A9T3		1
489	N0002111	.TAPE-		1
492	285W0098-9	.WIRING ASSY-PRINTED SUPPLIER CODE: V89954		1
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE				

— ITEM NOT ILLUSTRATED

R Y R

23-42-01-55

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

23-42-01
FIG. 55
PAGE 18
APR 15/25

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
55					
495	285W0095-4		.CABLE ASSY- SUPPLIER CODE: V89954		1
498	S906-10135-9005		..RECEIVER- CONFIG CHG DATA FROM A CMM: REPLD BY ARO42300MRR		1
498	ARO42300MRR		..SPEAKER- SUPPLIER CODE: V6NGJ6 TRUE PART NUMBER: ARO42300MR-R CONFIG CHG DATA FROM A CMM: REPLS S906-10135-9005		1
- 501	BMS13-48T01C01G		..WIRE		AR
504	363A5320P1		..SWITCH-REED SUPPLIER CODE: V89954		1
507	DF3-4S2C		..HOUSING-CONTACT SUPPLIER CODE: VOAG18 TRUE PART NUMBER: DF3-4S-2C		1
- 510	DF3-2428SC		..SOCKET-CONTACT, CRIMP SUPPLIER CODE: VOAG18		4
513	285W0095-5		.CABLE ASSY- SUPPLIER CODE: V89954		1
516	363A5320P3		..MICROPHONE- SUPPLIER CODE: V89954		1
519	363A5320P2		..CONNECTOR-JACK, PHONE, RCPT SUPPLIER CODE: V89954		1
519	363A5320P4		..CONNECTOR-JACK, PHONE, RCPT SUPPLIER CODE: V89954		1
- 522	DF3-2428SC		..SOCKET-CONTACT, CRIMP SUPPLIER CODE: VOAG18		7
525	DF3-7S2C		..HOUSING-INSULATOR, SOCKET SUPPLIER CODE: VOAG18 TRUE PART NUMBER: DF3-7S-2C		1
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

- ITEM NOT ILLUSTRATED

R Y R

23-42-01-55

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

23-42-01
 FIG. 55
 PAGE 19
 APR 15/25

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7 NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
55				
528	285W0096-11B	.SHELL ASSY-HANDSET SUPPLIER CODE: V89954 MISCELLANEOUS DATA: USED ON 285W0024-1B MOD ACDE	056377	1
528	285W0096-11P	.SHELL ASSY-HANDSET SUPPLIER CODE: V89954	378999	1
531	6035-04BR135	..INSERT- SUPPLIER CODE: V01556		2
534	285W0096-12B	..SHELL- SUPPLIER CODE: V89954	056377	1
534	285W0096-12P	..SHELL- SUPPLIER CODE: V89954	378999	1
537	020003263	.CORD-COILED SUPPLIER CODE: V59608 MISCELLANEOUS DATA: USED ON 285W0024-1B MOD ACDE	056377	1
537	020003800	.CORD-COILED SUPPLIER CODE: V59608	378999	1
540	285W1001-1	.ISOLATOR- SUPPLIER CODE: V89954		1
543	285W1001-9	.GASKET- SUPPLIER CODE: V89954		1
546	285W1001-4	.ISOLATOR- SUPPLIER CODE: V89954		1
549	285W1001-8	.SEAL- SUPPLIER CODE: V89954		1
552	285W1001-2	.ISOLATOR ASSY- SUPPLIER CODE: V89954		1
555	285W1001-5	..SEAL- SUPPLIER CODE: V89954		1
558	285W1001-3	.ISOLATOR ASSY- SUPPLIER CODE: V89954		1
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE				

— ITEM NOT ILLUSTRATED

R Y R

23-42-01-55

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

23-42-01
 FIG. 55
 PAGE 20
 APR 15/25

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7 NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
55	285W1001-7	..GASKET- SUPPLIER CODE: V89954		1
- 600	285W0024-1B	MODULE ASSY-(COMMUNICATIONS ONLY) 285W0024-1B MOD ACEF SUPPLIER CODE: V89954 FUNCTIONAL DESCRIPTION: THE HANDSET IS A PART OF THE CABIN MANAGEMENT SYSTEM (CMS). THE HANDSET INTERFACES TO THE CABIN INTERPHONE SYSTEM (CIS) FOR VOICE COMMUNICATIONS AND TO THE PASSENGER ADDRESS SYSTEM (PAS) FOR PASSENGER ADDRESS ANNOUNCEMENTS. MISCELLANEOUS DATA: BAE PART NUMBER 285W0024-1 HANDSETS LABELED "MOD ACEF" MAY BE USED AT ANY 737 PASSENGER CABIN HANDSET LOCATIONS EXCEPT THE 737 FORWARD ("LAV A") LOCATION. MOD ACEF HAS A KNOWN AUDIO CUT-OUT ISSUE UNDER THE FOLLOWING TWO CONDITIONS: 1) IT'S INSTALLED AT A 737 FORWARD ("LAV A") LOCATION, AND 2) WHEN SPEAKING TOO LOUDLY INTO THE MICROPHONE. THIS AUDIO CUT-OUT PROBLEM DOES NOT OCCUR AT OTHER PASSENGER CABIN LOCATIONS ON 737. COMPONENT MAINT MANUAL REF: 23-42-01 QUALIFIED I/W DATA: 285W0024-1M (GRAY) CAN REPLACE OR BE REPLACED BY 285W0024-1B (DARK GRAY) CONDITIONAL UPON	056377	RF
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE				

— ITEM NOT ILLUSTRATED

RYR

23-42-01-55

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

23-42-01
 FIG. 55
 PAGE 21
 APR 15/25

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
55			CUSTOMER COLOR PREFERENCE. P/N 285W0024-5B CAN REPLACE OR BE REPLACED BY P/N 285W0024-1B UPON CUSTOMER PREFERENCE. THE -1B HANDSET HAS NUMBERS ON THE KEYPAD AND THE -5B HANDSET HAS DESCRIPTIONS ON THE KEYPAD. P/N 285W0024-5M(GRAY) CAN REPLACE OR BE REPLACED BY P/N 285W0024-1B(DARK GRAY) UPON CUSTOMER PREFERENCE. THE -1B HANDSET HAS NUMBERS ON THE KEYPAD AND THE -5M HANDSET HAS DESCRIPTIONS ON THE KEYPAD. 285W0024-23B CAN REPLACE OR BE REPLACED BY 285W0024-1B WHEN INSTALLED AT ALL NON-FORWARD LOCATIONS. 285W0024-23B CAN REPLACE BUT NOT BE REPLACED BY 285W0024-1B ONLY WHEN INSTALLED IN FORWARD LOCATION. 285W0024-22M CAN REPLACE OR BE REPLACED BY 285W0024-1B AT ALL NON-LAVATORY A LOCATIONS. 285W0024-22M CAN REPLACE BUT NOT BE REPLACED BY 285W0024-1B AT LAVATORY A LOCATION. 285W0024-23M (GRAY) CAN REPLACE BUT NOT BE REPLACED BY 285W0024-1B (DARK GRAY) FOR AT LAV A		
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

— ITEM NOT ILLUSTRATED

R Y R

23-42-01-55

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

23-42-01
FIG. 55
PAGE 22
APR 15/25

 BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7 NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
55		CABIN LOCATION. 285W0024-23M (GRAY) CAN REPLACE OR BE REPLACED BY 285W0024-1B (DARK GRAY) FOR AT NON-LAV A CABIN LOCATION. FOR NHA/OTHER SYS DET SEE: 23-42-01-02		
- 606	285W0024-1M	MODULE ASSY-(COMMUNICATIONS ONLY) 285W0024-1M MOD ACEF SUPPLIER CODE: V89954 FUNCTIONAL DESCRIPTION: THE HANDSET IS A PART OF THE CABIN MANAGEMENT SYSTEM (CMS). THE HANDSET INTERFACES TO THE CABIN INTERPHONE SYSTEM (CIS) FOR VOICE COMMUNICATIONS AND TO THE PASSENGER ADDRESS SYSTEM (PAS) FOR PASSENGER ADDRESS ANNOUNCEMENTS. MISCELLANEOUS DATA: BAE PART NUMBER 285W0024-1 HANDSETS LABELED "MOD ACEF" MAY BE USED AT ANY 737 PASSENGER CABIN HANDSET LOCATIONS EXCEPT THE 737 FORWARD ("LAV A") LOCATION. MOD ACEF HAS A KNOWN AUDIO CUT-OUT ISSUE UNDER THE FOLLOWING TWO CONDITIONS: 1) IT'S INSTALLED AT A 737 FORWARD ("LAV A") LOCATION, AND 2) WHEN SPEAKING TOO LOUDLY INTO THE MICROPHONE. THIS AUDIO CUT-OUT PROBLEM DOES NOT OCCUR AT OTHER PASSENGER CABIN LOCATIONS ON 737. COMPONENT MAINT MANUAL REF: 23-42-01	378999	RF
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE				

— ITEM NOT ILLUSTRATED

RYR

23-42-01-55

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

23-42-01
FIG. 55
PAGE 23
APR 15/25

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
55			QUALIFIED I/W DATA: 285W0024-5M CAN REPLACE OR BE REPLACED BY 285W0024-1M UPON CUSTOMER PREFERENCE. THE -1M HANDSET HAS NUMBERS ON THE KEYPAD AND THE -5M HANDSET HAS DESCRIPTIONS ON THE KEYPAD. 285W0024-1M (GRAY) CAN REPLACE OR BE REPLACED BY 285W0024-1B (DARK GRAY) CONDITIONAL UPON CUSTOMER COLOR PREFERENCE. 285W0024-22M CAN REPLACE OR BE REPLACED BY 285W0024-1M AT ALL NON-LAVATORY A LOCATIONS. 285W0024-22M CAN REPLACE BUT NOT BE REPLACED BY 285W0024-1M AT LAVATORY A LOCATION. 285W0024-23M CAN REPLACE BUT NOT BE REPLACED BY 285W0024-1M FOR AT LAV A CABIN LOCATION. 285W0024-23M CAN REPLACE OR BE REPLACED BY 285W0024-1M FOR AT NON-LAV A CABIN LOCATION. FOR NHA/OTHER SYS DET SEE: 23-42-01-18 23-42-01-19		
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

— ITEM NOT ILLUSTRATED

R Y R

23-42-01-55

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

23-42-01
 FIG. 55
 PAGE 24
 APR 15/25

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7 NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
55				
650	087514-101	.RETAINER- SUPPLIER CODE: V25397 MISCELLANEOUS DATA: USED ON 285W0024-1B MOD ACEF 285W0024-1G MOD ACEF 285W0024-1M MOD ACEF OPTIONAL SUPPLIER CODE: 21340 71468		1
653	MS51957-18	.SCREW		2
656	285W0096-10B	.SHELL-HANDSET SUPPLIER CODE: V89954	056377	1
656	285W0096-10P	.SHELL-HANDSET SUPPLIER CODE: V89954	378999	1
659	61788	.GASKET- SUPPLIER CODE: V4F561		1
662	285W0755-4	.SCREEN ASSY- SUPPLIER CODE: V89954		1
662	285W0755-1	.SCREEN ASSY- SUPPLIER CODE: V89954 MISCELLANEOUS DATA: USED ON 285W0024-1B MOD ACEF 285W0024-1G MOD ACEF 285W0024-1M MOD ACEF		1
665	285W0755-6	..DAMPER-ACOUSTIC SUPPLIER CODE: V89954		1
668	285W0755-5	..SCREEN- SUPPLIER CODE: V89954		1
671	285W0087-4	.HOLDER-MIC SUPPLIER CODE: V89954		1
674	115E5492P1	.KEYPAD-ELASTOMER SUPPLIER CODE: V22670		1
677	224-20300-382	.SCREW- SUPPLIER CODE: V93907		2
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE				

— ITEM NOT ILLUSTRATED

RYR

23-42-01-55

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

23-42-01
 FIG. 55
 PAGE 25
 APR 15/25

BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
55					
680	285W0097-3		.CARRIER-HANDSET SUPPLIER CODE: V89954		1
683	285W0099-1		.BUTTON-PUSH TO TALK SUPPLIER CODE: V89954 CONFIG CHG DATA FROM A CMM: REPLD BY 285W0099-3		1
683	285W0099-3		.BUTTON-PUSH TO TALK SUPPLIER CODE: V89954 CONFIG CHG DATA FROM A CMM: REPLS 285W0099-1		1
686	363A2243P1		.CAP-KEY SUPPLIER CODE: VF0537		14
689	N0002111		.TAPE		1
692	285W0098-11		.WIRING ASSY-PRINTED SUPPLIER CODE: V89954		1
695	285W0095-4		.CABLE ASSY- SUPPLIER CODE: V89954		1
- 698	AR042300MRR		..SPEAKER- SUPPLIER CODE: V6NGJ6 TRUE PART NUMBER: AR042300MR-R CONFIG CHG DATA FROM A CMM: REPLS S906-10135-9005		1
701	S906-10135-9005		..RECEIVER- CONFIG CHG DATA FROM A CMM: REPLD BY AR042300MRR		1
- 704	BMS13-48T01C01G		..WIRE		AR
707	363A5320P1		..SWITCH-REED SUPPLIER CODE: V89954		1
710	DF3-4S2C		..HOUSING-CONTACT SUPPLIER CODE: VOAG18 TRUE PART NUMBER: DF3-4S-2C		1
- 713	DF3-2428SC		..SOCKET-CONTACT, CRIMP SUPPLIER CODE: VOAG18		4
716	285W0095-5		.CABLE ASSY- SUPPLIER CODE: V89954		1
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

- ITEM NOT ILLUSTRATED

RYR

23-42-01-55

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

23-42-01
 FIG. 55
 PAGE 26
 APR 15/25

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
55					
719	363A5320P3		..MICROPHONE- SUPPLIER CODE: V89954		1
722	363A5320P2		..CONNECTOR-JACK, PHONE, RCPT SUPPLIER CODE: V89954		1
722	363A5320P4		..CONNECTOR-JACK, PHONE, RCPT SUPPLIER CODE: V89954		1
- 725	DF3-2428SC		..SOCKET-CONTACT, CRIMP SUPPLIER CODE: VOAG18		7
728	DF3-7S2C		..HOUSING-INSULATOR, SOCKET SUPPLIER CODE: VOAG18 TRUE PART NUMBER: DF3-7S-2C		1
731	285W0096-11B		.SHELL ASSY-HANDSET SUPPLIER CODE: V89954	056377	1
731	285W0096-11P		.SHELL ASSY-HANDSET SUPPLIER CODE: V89954	378999	1
734	6035-04BR135		..INSERT- SUPPLIER CODE: V01556		2
737	285W0096-12B		..SHELL- SUPPLIER CODE: V89954	056377	1
737	285W0096-12P		..SHELL- SUPPLIER CODE: V89954	378999	1
740	020003263		.CORD-COILED SUPPLIER CODE: V59608	056377	1
740	020003800		.CORD-COILED SUPPLIER CODE: V59608	378999	1
743	285W1001-1		.ISOLATOR- SUPPLIER CODE: V89954		1
746	285W1001-9		.GASKET- SUPPLIER CODE: V89954		1
749	285W1001-4		.ISOLATOR- SUPPLIER CODE: V89954		1
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

- ITEM NOT ILLUSTRATED

R Y R

23-42-01-55

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

23-42-01
 FIG. 55
 PAGE 27
 APR 15/25

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
55					
752	285W1001-8		. SEAL- SUPPLIER CODE: V89954		1
755	285W1001-2		. ISOLATOR ASSY- SUPPLIER CODE: V89954		1
758	285W1001-5		.. SEAL- SUPPLIER CODE: V89954		1
761	285W1001-3		. ISOLATOR ASSY- SUPPLIER CODE: V89954		1
764	285W1001-7		.. GASKET- SUPPLIER CODE: V89954		1
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

— ITEM NOT ILLUSTRATED


R Y R

23-42-01-55

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

23-42-01
 FIG. 55
 PAGE 28
 APR 15/25

BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

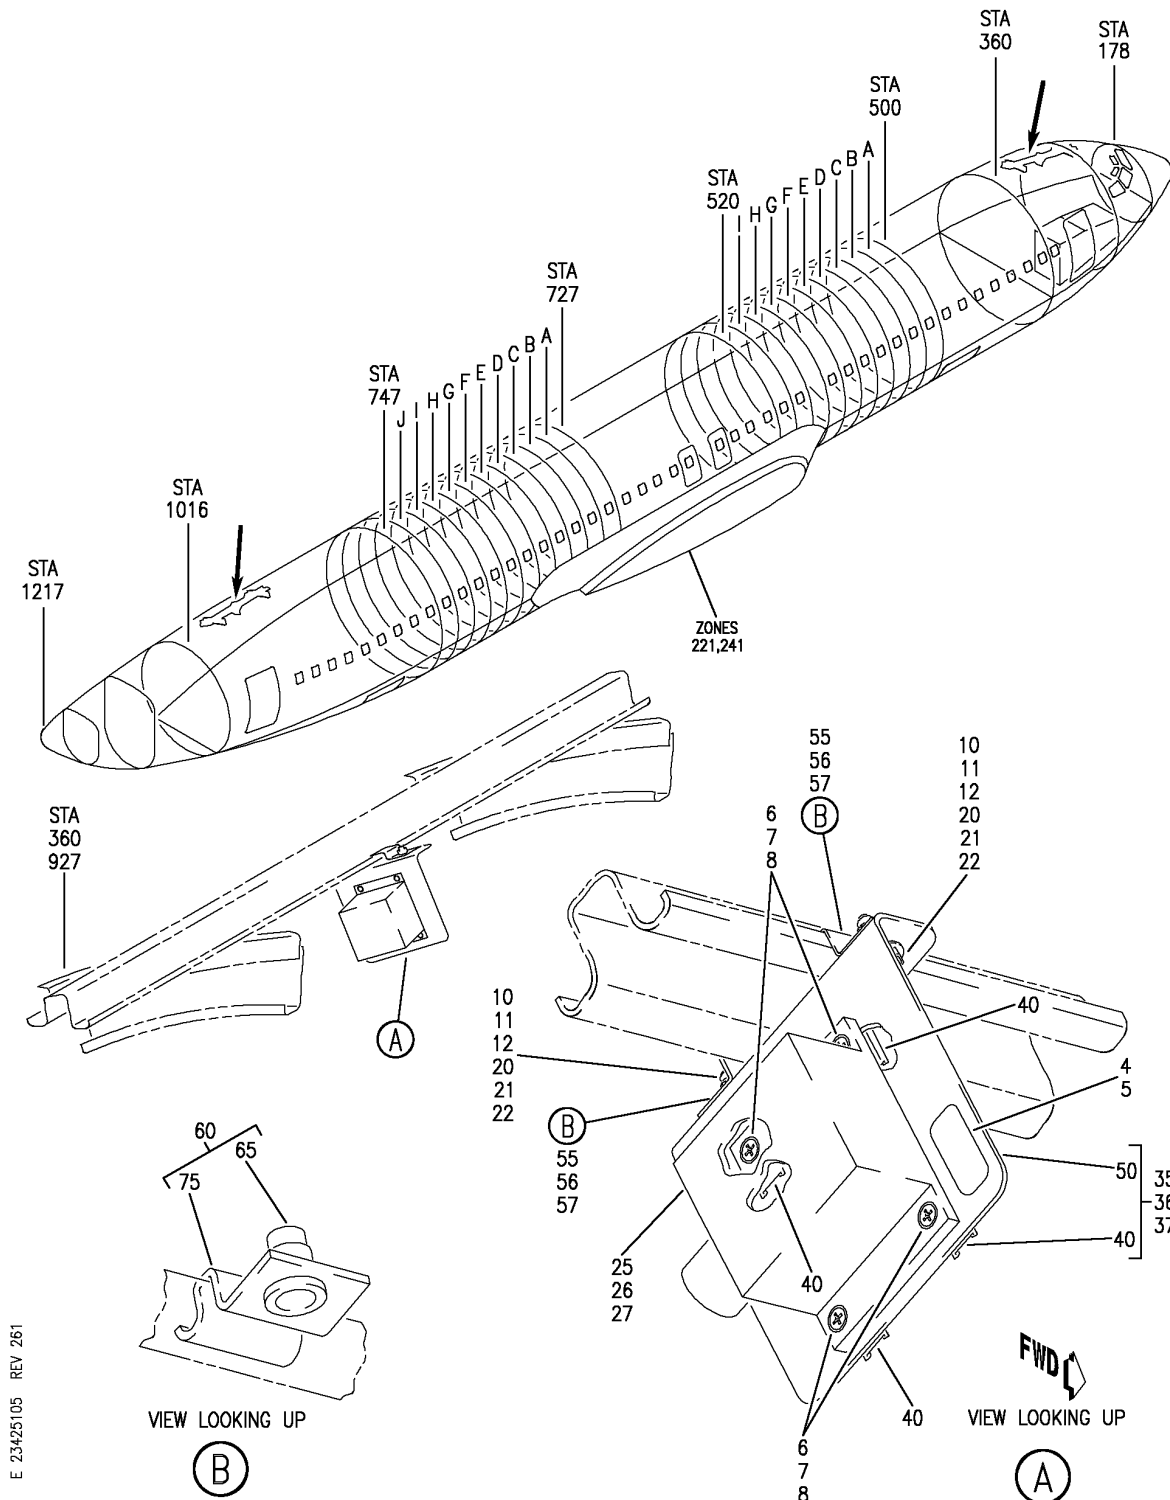

E 23425105 REV 261

FILTER INSTL-IN LINE
FIGURE 5

23-42-51-05

R/YR
APR 15/18

23-42-51-05
PAGE 0

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
5					
- 1	MODREF570807		FILTER INSTL-IN LINE FILTER INSTL-IN LINE MODULE NUMBER: 417A6701-7 REV C POSITION DATA: STA 917.35, LBL 34.73, WL 295.93	357999 365999	RF
- 2	MODREF657792		FILTER INSTL-IN LINE MODULE NUMBER: 417A6700-48 REV A POSITION DATA: STA 914.00, LBL 7.97, WL 304.88	357364	RF
- 3	MODREF657791		FILTER INSTL-IN LINE MODULE NUMBER: 417A6700-47 REV A POSITION DATA: STA 353.00, LBL 1.21, WL 299.58	357364	RF
4	417A6701-13		.MARKER- PLACARD CONTENT: M2931 USED ON: MODREF570807 MODREF657792	357999	1
4	417A6701-14		.MARKER- PLACARD CONTENT: M2932 USED ON: MODREF657791	357360 364364	1
5	417A6701-14		.MARKER- PLACARD CONTENT: M2932 MISCELLANEOUS DATA: NCR-N1450125512 USED ON: MODREF657791	361363	1
6	BACS12ER06K9		.SCREW-	357360 364999	4
7	BACS12ER06K9		.SCREW- USED ON: MODREF657792	361363	4
8	BACS12ER06K9		.SCREW- MISCELLANEOUS DATA: NCR-N1450125512 USED ON: MODREF657791	361363	4
10	BACS12GU3K9		.SCREW-	357360 364999	2
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

- ITEM NOT ILLUSTRATED

RYR

23-42-51-05

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

23-42-51
 FIG. 05
 PAGE 1
 OCT 15/24

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
5	11 BACS12GU3K9	.SCREW-	USED ON: MODREF657792	361363	2
	12 BACS12GU3K9	.SCREW-	MISCELLANEOUS DATA: NCR-N1450125512 USED ON: MODREF657791	361363	2
	20 NAS1149D0332J	.WASHER-		357360 364999	2
	21 NAS1149D0332J	.WASHER-	USED ON: MODREF657792	361363	2
	22 NAS1149D0332J	.WASHER-	MISCELLANEOUS DATA: NCR-N1450125512 USED ON: MODREF657791	361363	2
	25 G3269-02	.FILTER-INLINE	SUPPLIER CODE: V99837 FUNCTIONAL DESCRIPTION: THE INLINE ELECTRONIC FILTER IS USED FOR AUDIO NOISE REDUCTION COMPONENT MAINT MANUAL REF: 23-50-48	357360 364999	1
	26 G3269-02	.FILTER-INLINE	SUPPLIER CODE: V99837 FUNCTIONAL DESCRIPTION: THE INLINE ELECTRONIC FILTER IS USED FOR AUDIO NOISE REDUCTION COMPONENT MAINT MANUAL REF: 23-50-48 USED ON: MODREF657792	361363	1
		ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE			

— ITEM NOT ILLUSTRATED

R Y R

23-42-51-05

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

23-42-51
 FIG. 05
 PAGE 2
 APR 15/18

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
5					
27	G3269-02		. FILTER-INLINE SUPPLIER CODE: V99837 FUNCTIONAL DESCRIPTION: THE INLINE ELECTRONIC FILTER IS USED FOR AUDIO NOISE REDUCTION MISCELLANEOUS DATA: NCR-N1450125512 COMPONENT MAINT MANUAL REF: 23-50-48 USED ON: MODREF657792	361363	1
35	417A6710-29		. SUPPORT ASSY-	357360 364999	1
36	417A6710-29		. SUPPORT ASSY- USED ON: MODREF657792	361363	1
37	417A6710-29		. SUPPORT ASSY- MISCELLANEOUS DATA: NCR-N1450125512 USED ON: MODREF657791 LIAISON CHANGE PART NUMBER: 417A6710-29 SPARES SUPPORT PART NUMBER: 417A6710-29	361363	1
40	BRF100C06D		.. NUTPLATE SUPPLIER CODE: V52828 SPECIFICATION NUMBER: BACN10KB06CFD OPTIONAL PART: 102F9207P62 V72962 F51604-06 V15653 NS202478-62 V80539 ATTACHING PARTS	357999	4
- 45	BACR15BA3AD3C		.. RIVET -----*-----	357999	8
50	417A6710-30		.. PLATE	357999	1
55	69-37170-1		. CLIP ASSY-STRINGER	357360 364999	2
56	69-37170-1		. CLIP ASSY-STRINGER USED ON: MODREF657792	361363	2
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

- ITEM NOT ILLUSTRATED

R Y R

23-42-51-05

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

23-42-51
 FIG. 05
 PAGE 3
 APR 15/18

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
5					
57	69-37170-1		.CLIP ASSY-STRINGER MISCELLANEOUS DATA: NCR-N1450125512 USED ON: MODREF657791	361363	2
60	69-37170-6		..CLIP ASSY-	357999	1
60	69-37170-4		..CLIP ASSY-	357999	1
65	79NC2-02		...NUT- SUPPLIER CODE: V019L2 USED ON: 69-37170-6	357999	1
65	NC2-1032		...NUT- SUPPLIER CODE: V27687 USED ON: 69-37170-6	357999	1
65	BACN11BN20A		...NUT-CLINCH USED ON: 69-37170-6	357999	1
- 70	SL854C3F1CM		...INSERT- SUPPLIER CODE: V97393 USED ON: 69-37170-4	357999	1
75	69-37170-5		...CLIP- USED ON: 69-37170-6	357999	1
75	69-37170-3		...CLIP- USED ON: 69-37170-4	357999	1
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

- ITEM NOT ILLUSTRATED


R Y R

23-42-51-05

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

23-42-51
 FIG. 05
 PAGE 4
 APR 15/18

BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

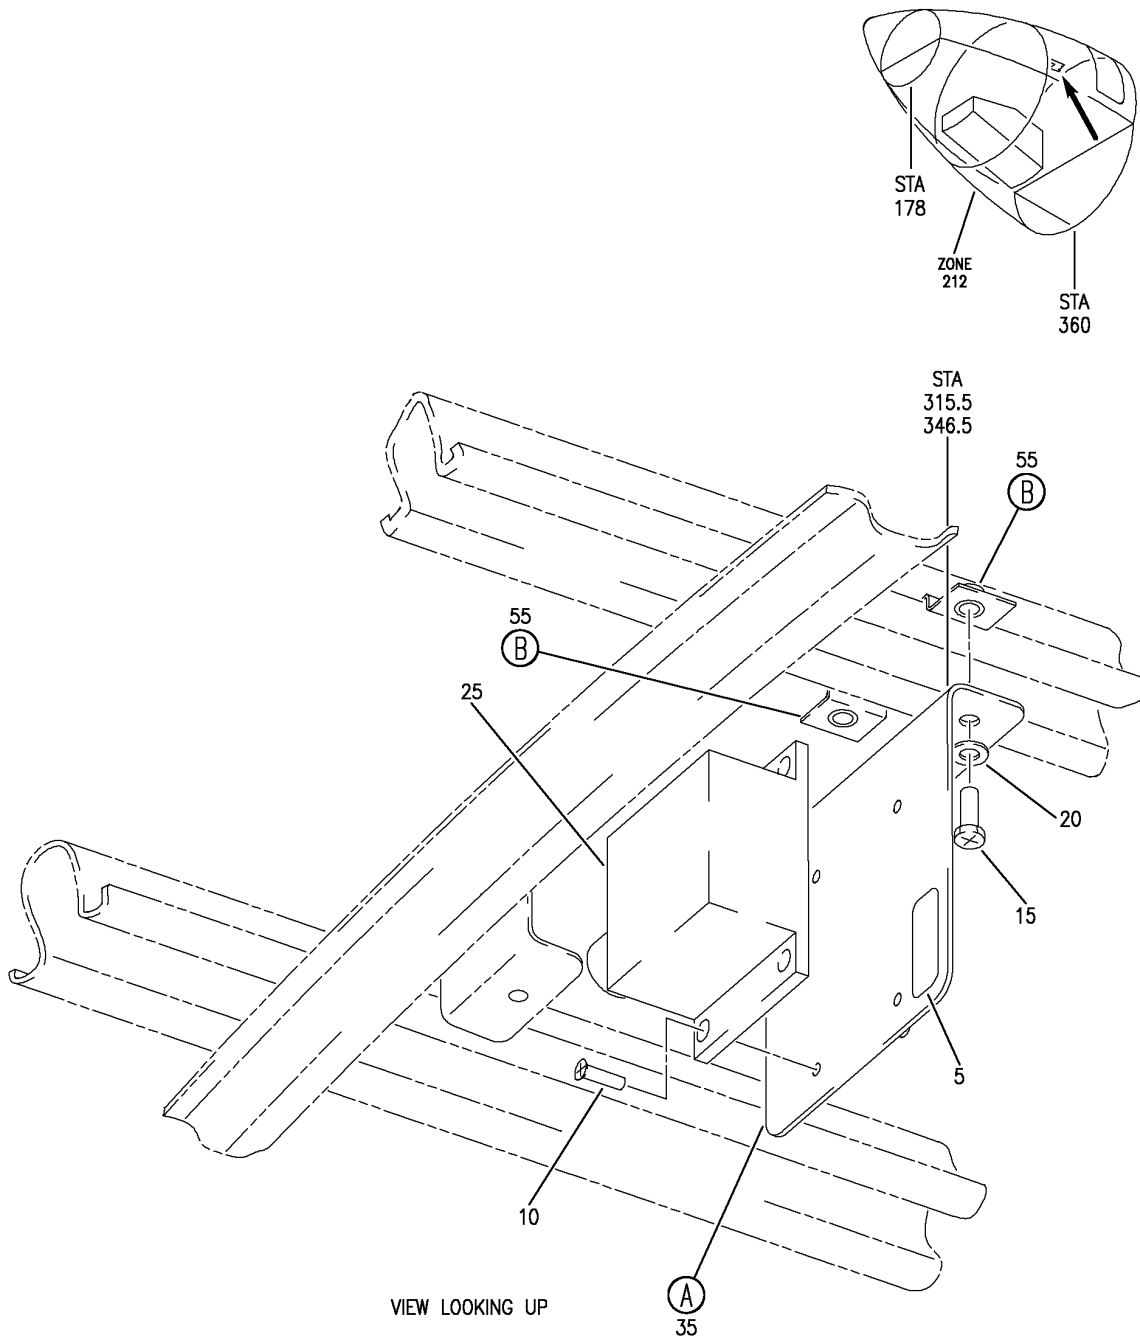

E 23425106 SHT 1 REV 236

FILTER INSTL-IN LINE
FIGURE 6 (SHEET 1)


23-42-51-06

R/YR
APR 15/16

23-42-51-06
PAGE 0


ECCN 9E991 BOEING PROPRIETARY – See title page for details.

BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

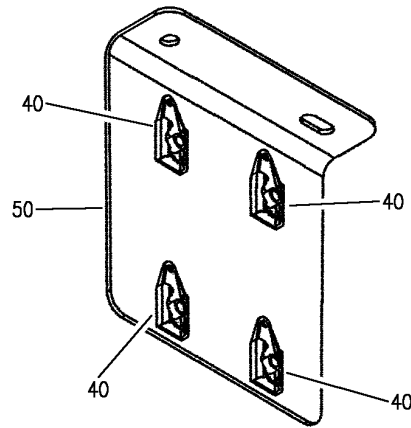

VIEW LOOKING UP

(A)

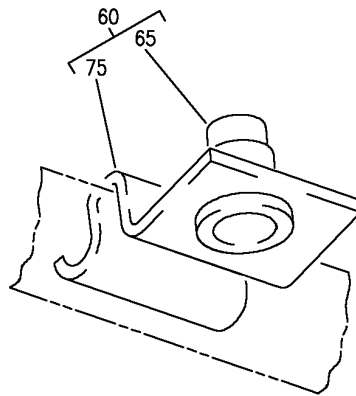

(B)

E 23425106 SHT 2 REV 198

FILTER INSTL-IN LINE
FIGURE 6 (SHEET 2)

23-42-51-06

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

R Y R
JUN 15/15

23-42-51-06
PAGE 0A

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7 NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
6		FILTER INSTL-IN LINE	360360	
- 1	MODREF570808	FILTER INSTL-IN LINE MODULE NUMBER: 417A6701-12 REV D POSITION DATA: STA 346.97, RBL 7.46, WL 298.69	365999 360360 365999	RF
5	417A6701-14	.MARKER- PLACARD CONTENT: M2932	360360 365999	1
10	BACS12ER06K9	.SCREW	360360 365999	4
15	BACS12GU3K9	.SCREW	360360 365999	2
20	NAS1149D0332J	.WASHER	360360 365999	2
25	G3269-02	.FILTER-INLINE SUPPLIER CODE: V99837 FUNCTIONAL DESCRIPTION: THE INLINE ELECTRONIC FILTER IS USED FOR AUDIO NOISE REDUCTION ELECTRICAL EQUIP NUMBER: M02932 COMPONENT MAINT MANUAL REF: 23-50-48	360360 365999	1
35	417A6710-29	.SUPPORT ASSY	360360 365999	1
40	BRF100C06D	..NUTPLATE SUPPLIER CODE: V52828 SPECIFICATION NUMBER: BACN10KB06CFD OPTIONAL PART: 102F9207P62 V72962 F51604-06 V15653 NS202478-62 V80539 ATTACHING PARTS	360360 365999	4
- 45	BACR15BA3AD3C	..RIVET	360360 365999	8
50	417A6710-30	-----*----- ..PLATE	360360 365999	1
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE				

- ITEM NOT ILLUSTRATED

RYR

23-42-51-06

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

23-42-51
FIG. 06
PAGE 1
AUG 15/15

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
6					
55	69-37170-1	.	CLIP ASSY-STRINGER	360360 365999	2
60	69-37170-6	..	CLIP ASSY-	360360 365999	1
60	69-37170-4	..	CLIP ASSY-	360360 365999	1
65	79NC2-02	...	NUT- SUPPLIER CODE: V019L2 USED ON: 69-37170-6	360360 365999	1
65	NC2-1032	...	NUT- SUPPLIER CODE: V27687 USED ON: 69-37170-6	360360 365999	1
65	BACN11BN20A	...	NUT-CLINCH USED ON: 69-37170-6	360360 365999	1
- 70	SL854C3F1CM	...	INSERT- SUPPLIER CODE: V97393 USED ON: 69-37170-4	360360 365999	1
75	69-37170-5	...	CLIP- USED ON: 69-37170-6	360360 365999	1
75	69-37170-3	...	CLIP- USED ON: 69-37170-4	360360 365999	1
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

- ITEM NOT ILLUSTRATED


R Y R

23-42-51-06

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

23-42-51
 FIG. 06
 PAGE 2
 AUG 15/17

BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

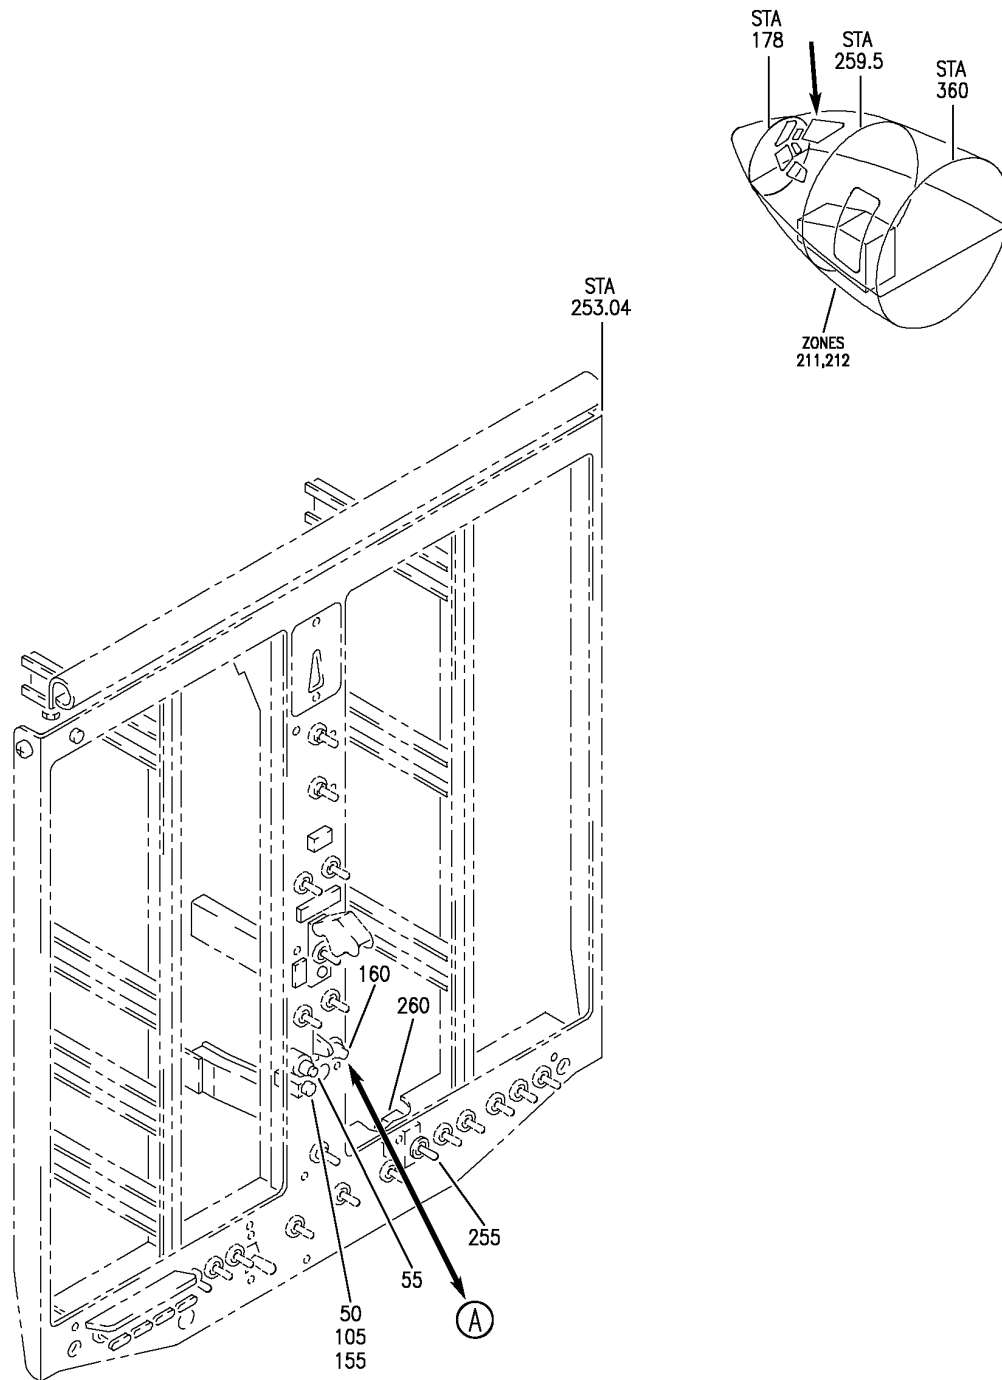

E 23425201 SHT 1 REV 269


ELECTRICAL INSTL-P5 FWD OVHD (CABIN INTERPHONE SYSTEM ONLY)
FIGURE 1 (SHEET 1)

23-42-52-01

RJR
DEC 15/18

23-42-52-01
PAGE 0

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

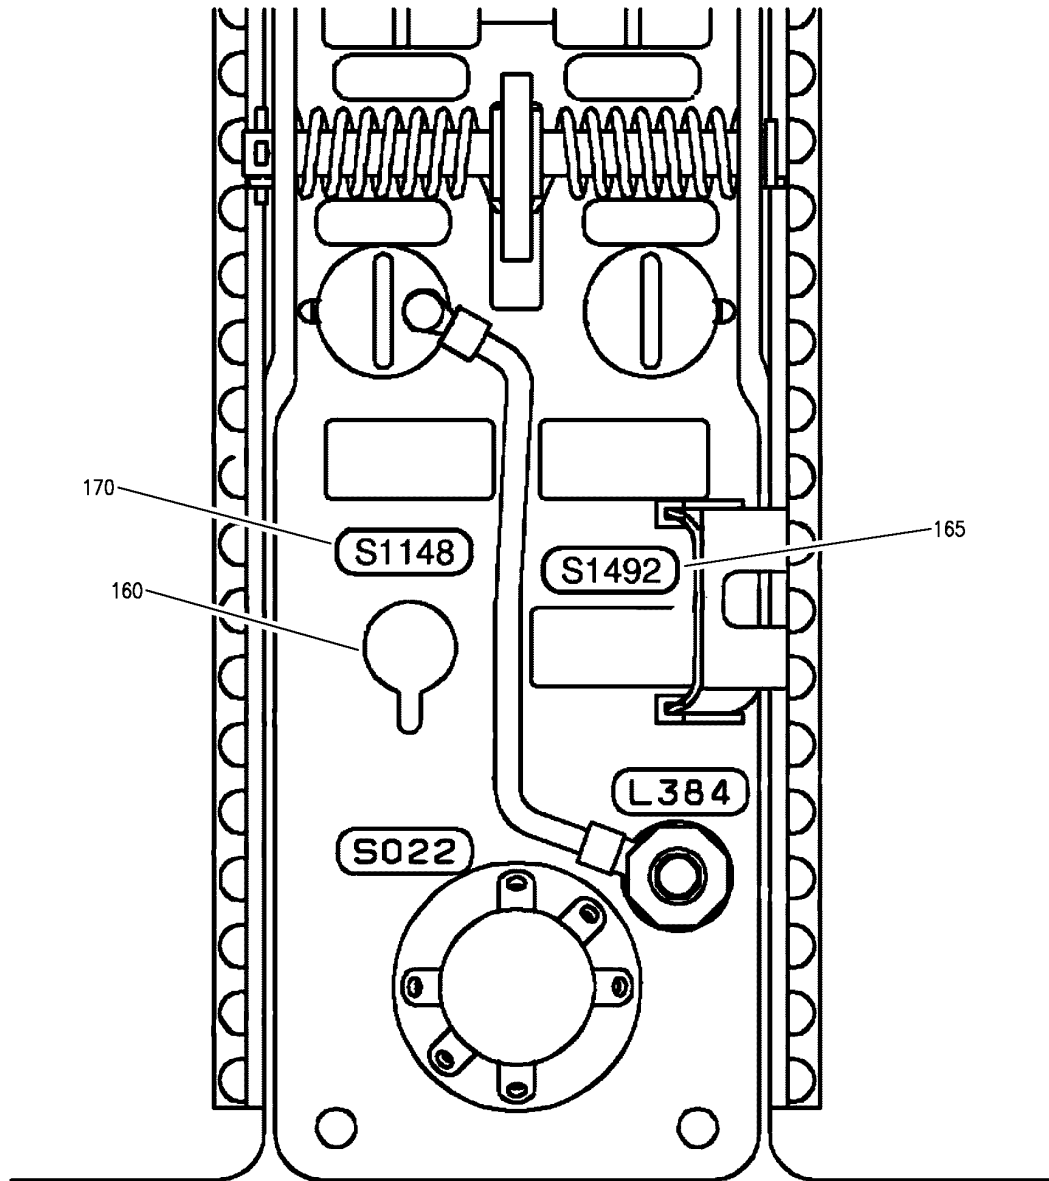

(A)

E 23425201 SHT 2 REV 269

ELECTRICAL INSTL-P5 FWD OVHD (CABIN INTERPHONE SYSTEM ONLY)
FIGURE 1 (SHEET 2)

23-42-52-01

R Y R
DEC 15/18

23-42-52-01
PAGE 0A

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
1			ELECTRICAL INSTL-P5 FWD OVHD (CABIN INTERPHONE SYSTEM ONLY)	121999	
- 1	MODREF318918		ELECTRICAL INSTL-P5 OVHD (CABIN INTERPHONE SYSTEM ONLY) MODULE NUMBER: 233A3323-1 REV A2 POSITION DATA: FWD FOR OTHER SYS DETAILS SEE: 11-32-02-19A 21-27-52-01 23-43-52-01 30-42-31-01 31-11-94-30 33-11-52-01 33-14-00-40 33-25-52-01 33-32-52-01 33-41-52-01 33-42-52-01 33-45-52-01 33-51-52-01 49-61-52-01 74-31-52-01	121137	RF
- 1	MODREF340186		ELECTRICAL INSTL-P5 OVHD (CABIN INTERPHONE SYSTEM ONLY) MODULE NUMBER: 233A3323-1 REV F POSITION DATA: FWD FOR OTHER SYS DETAILS SEE: 11-32-02-19A 21-27-52-01 23-43-52-01 30-42-31-01 31-11-94-30 33-11-52-01 33-14-00-40 33-25-52-01 33-32-52-01 33-41-52-01 33-42-52-01 33-45-52-01 33-51-52-01 49-61-52-01 74-31-52-01	138176	RF
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

- ITEM NOT ILLUSTRATED

RYR

23-42-52-01

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

23-42-52
 FIG. 01
 PAGE 1
 FEB 15/21

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
1					
- 1	MODREF374993		ELECTRICAL INSTL-P5 OVHD (CABIN INTERPHONE SYSTEM ONLY) MODULE NUMBER: 233A3323-1 REV G POSITION DATA: FWD FOR OTHER SYS DETAILS SEE: 11-32-02-19A 21-27-52-01 23-43-52-01 30-42-31-01 31-11-94-30 33-11-52-01 33-14-00-40 33-25-52-01 33-32-52-01 33-41-52-01 33-42-52-01 33-45-52-01 33-51-52-01 49-61-52-01 74-31-52-01	177356	RF
- 2	MODREF623630		ELECTRICAL INSTL-P5 OVHD (CABIN INTERPHONE SYSTEM ONLY) MODULE NUMBER: 233A3323-12 REV B POSITION DATA: FWD FOR OTHER SYS DETAILS SEE: 11-32-02-19A 21-27-52-01 23-43-52-01 30-42-31-01 31-11-94-30 33-11-52-01 33-14-00-40 33-25-52-01 33-32-52-01 33-41-52-01 33-42-52-01 33-45-52-01 33-51-52-01 49-61-52-01 74-31-52-01	357369	RF
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

- ITEM NOT ILLUSTRATED

RYR

23-42-52-01

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

23-42-52
 FIG. 01
 PAGE 2
 FEB 15/21

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7 NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
1				
- 2	MODREF669964	ELECTRICAL INSTL-P5 OVHD (CABIN INTERPHONE SYSTEM ONLY) MODULE NUMBER: 233A3323-15 REV B POSITION DATA: FWD FOR OTHER SYS DETAILS SEE: 11-32-02-19A 21-27-52-01 23-43-52-01 30-42-31-01 31-11-94-30 33-11-52-01 33-14-00-40 33-25-52-01 33-32-52-01 33-41-52-01 33-45-52-01 33-51-52-01 49-61-52-01 74-31-52-01	370371	RF
- 2	MODREF679792	ELECTRICAL INSTL-P5 OVHD (CABIN INTERPHONE SYSTEM ONLY) MODULE NUMBER: 233A3323-15 REV C POSITION DATA: FWD FOR OTHER SYS DETAILS SEE: 11-32-02-19A 21-27-52-01 23-43-52-01 30-42-31-01 31-11-94-30 33-11-52-01 33-14-00-40 33-25-52-01 33-32-52-01 33-41-52-01 33-45-52-01 33-51-52-01 49-61-52-01 74-31-52-01	372392	RF
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE				

- ITEM NOT ILLUSTRATED

RYR

23-42-52-01

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

23-42-52
 FIG. 01
 PAGE 3
 FEB 15/21

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7 NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
1 - 2	MODREF691707	ELECTRICAL INSTL-P5 OVHD (CABIN INTERPHONE SYSTEM ONLY) MODULE NUMBER: 233A3323-20 REV A POSITION DATA: FWD FOR OTHER SYS DETAILS SEE: 11-32-02-19A 21-27-52-01 23-43-52-01 30-42-31-01 31-11-94-30 33-11-52-01 33-14-00-40 33-25-52-01 33-32-52-01 33-41-52-01 33-45-52-01 33-51-52-01 49-61-52-01 74-31-52-01	393999	RF
55	D20011-01	.SWITCH-PUSH BUTTON SUPPLIER CODE: V81640 ELECTRICAL EQUIP NUMBER: S00036	121999	1
- 100	MODREF271322	ELECTRICAL INSTL-P5 OVHD MODULE NUMBER: 233A3323-235001 REV A POSITION DATA: FWD	121137	RF
- 100	MODREF342073	ELECTRICAL INSTL-P5 OVHD MODULE NUMBER: 233A3323-235001 REV B POSITION DATA: FWD	138176	RF
- 100	MODREF374991	ELECTRICAL INSTL-P5 OVHD MODULE NUMBER: 233A3323-235001 REV C POSITION DATA: FWD	177999	RF
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE				

- ITEM NOT ILLUSTRATED

RYR

23-42-52-01

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

23-42-52
 FIG. 01
 PAGE 4
 FEB 15/21

BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
1 105	BCREF4152		.LIGHT ASSY-PRESS TO TEST IND-CALL SUPPLIER CODE: V81590 OVERLENGTH PART NUMBER: 318-630-1002-017 SPECIFICATION NUMBER: 10-61803-72 ELECTRICAL EQUIP NUMBER: L00019 COMPONENT MAINT MANUAL REF: 33-10-05 FOR DETAILS SEE: 33-11-50-18	121999	1
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

— ITEM NOT ILLUSTRATED

R Y R

23-42-52-01

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

23-42-52
 FIG. 01
 PAGE 5
 FEB 15/21