


FLIGHT INTERPHONE SYSTEM

R Y R
O C T 10/06

23-51-00
SECTION TITLE
PAGE 1

BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

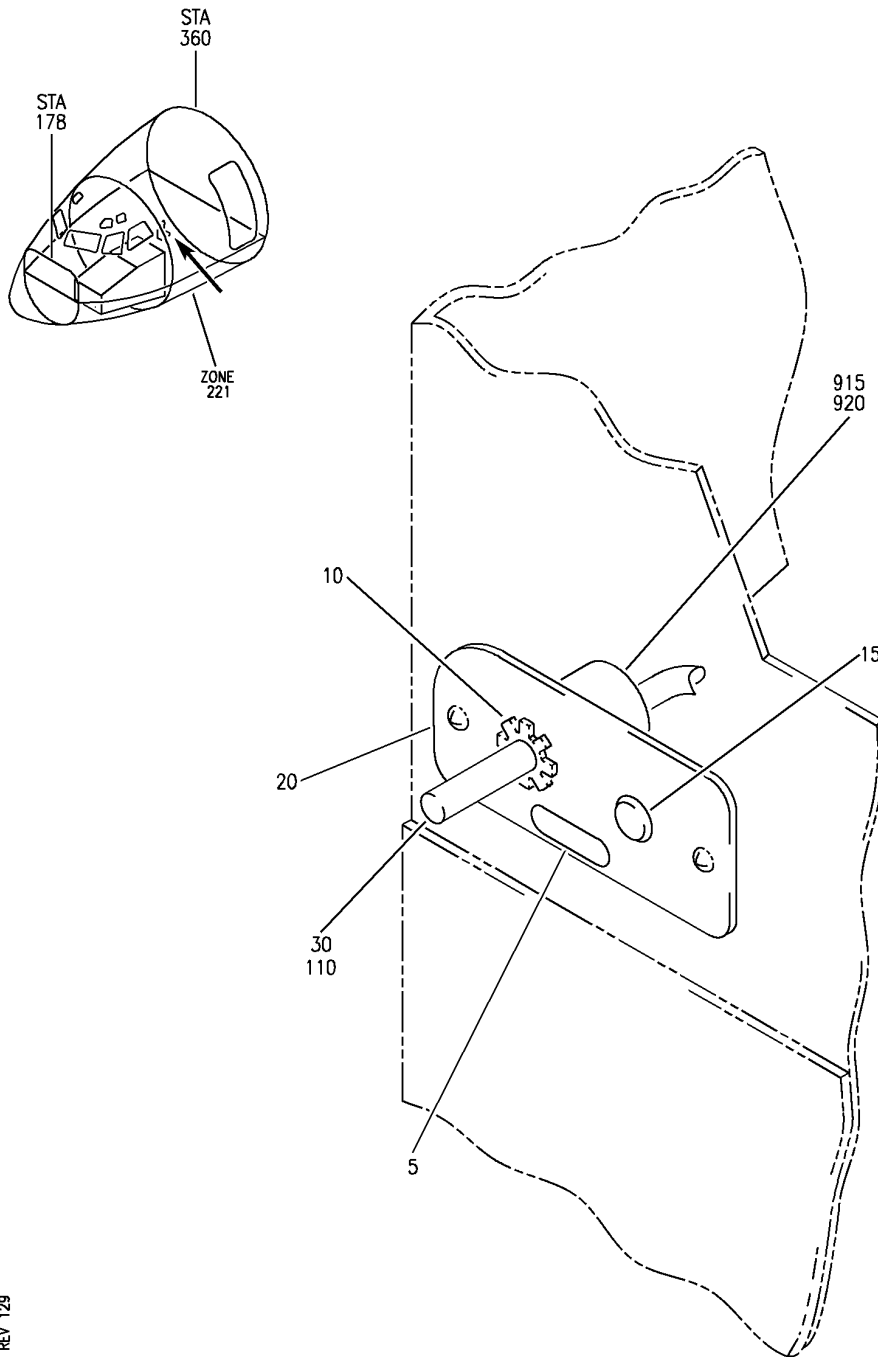

E 23510005 REV 129

INTERPHONE, HEADPHONE, BOOMMIC HEADSET AND JACK INSTL-SECOND OBSERVER

FIGURE 5

23-51-00-05

RJR
JUN 10/07

23-51-00-05
PAGE 0

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
5			INTERPHONE, HEADPHONE, BOOMMIC HEADSET AND JACK INSTL-SECOND OBSERVER		
- 1	MODREF82021		JACK INSTL-SECOND OBSERVER MODULE NUMBER: 232A4400-6 REV A		RF
5	BAC27DCC2776		.MARKER- PLACARD CONTENT: HEAD PHONE		1
10	BACW10CR6		.WASHER		1
15	BACP20B6B		.PLUG- STANDARD SUBSTITUTION: BACP20B6P		1
20	232A4280-8		.PLATE-JACK ATTACHING PARTS		1
- 25	BACS12FA08K7BK		.SCREW -----*-----		2
- 905	286A3327-173		WIRE BUNDLE ASSY-	056099	RF
- 909	286A3327-281		WIRE BUNDLE ASSY	100230	RF
920	2J1866A		.JACK-SECOND OBSERVER HEAD PHONE SUPPLIER CODE: V82389 TRUE PART NUMBER: 2J-1866A ELECTRICAL EQUIP NUMBER: D06037 WIRING DIAGRAM REF: 235131	056230	1
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

- ITEM NOT ILLUSTRATED





R Y R

23-51-00-05

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

23-51-00
 FIG. 05
 PAGE 1
 JUN 15/23

BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

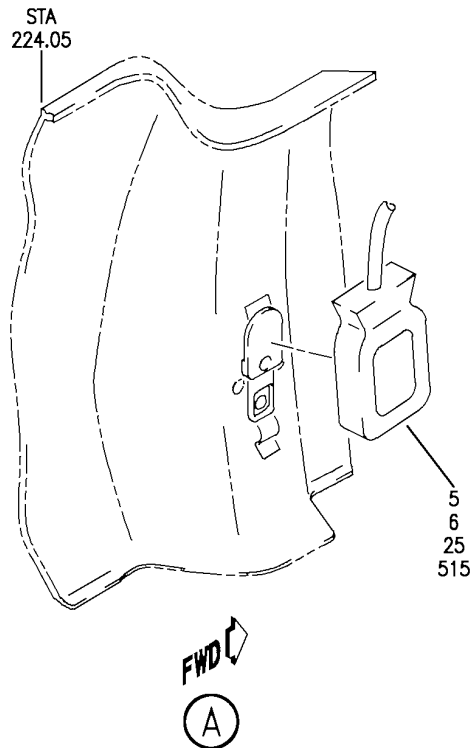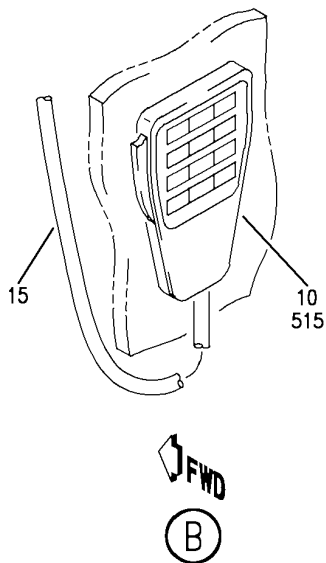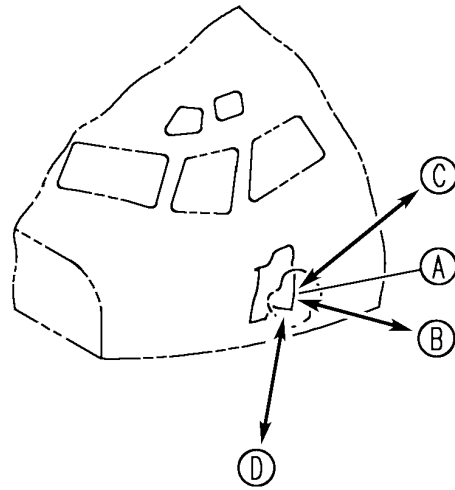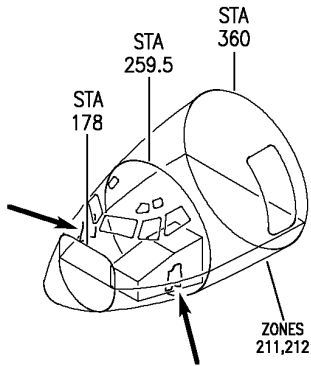

E 23510009 SHT 1 REV 243

INTERPHONE INSTL- CAPT AND FIRST OFFICER HAND MIC CONT CAB.
FIGURE 9 (SHEET 1)


23-51-00-09

R/YR
OCT 15/16

23-51-00-09
PAGE 0

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

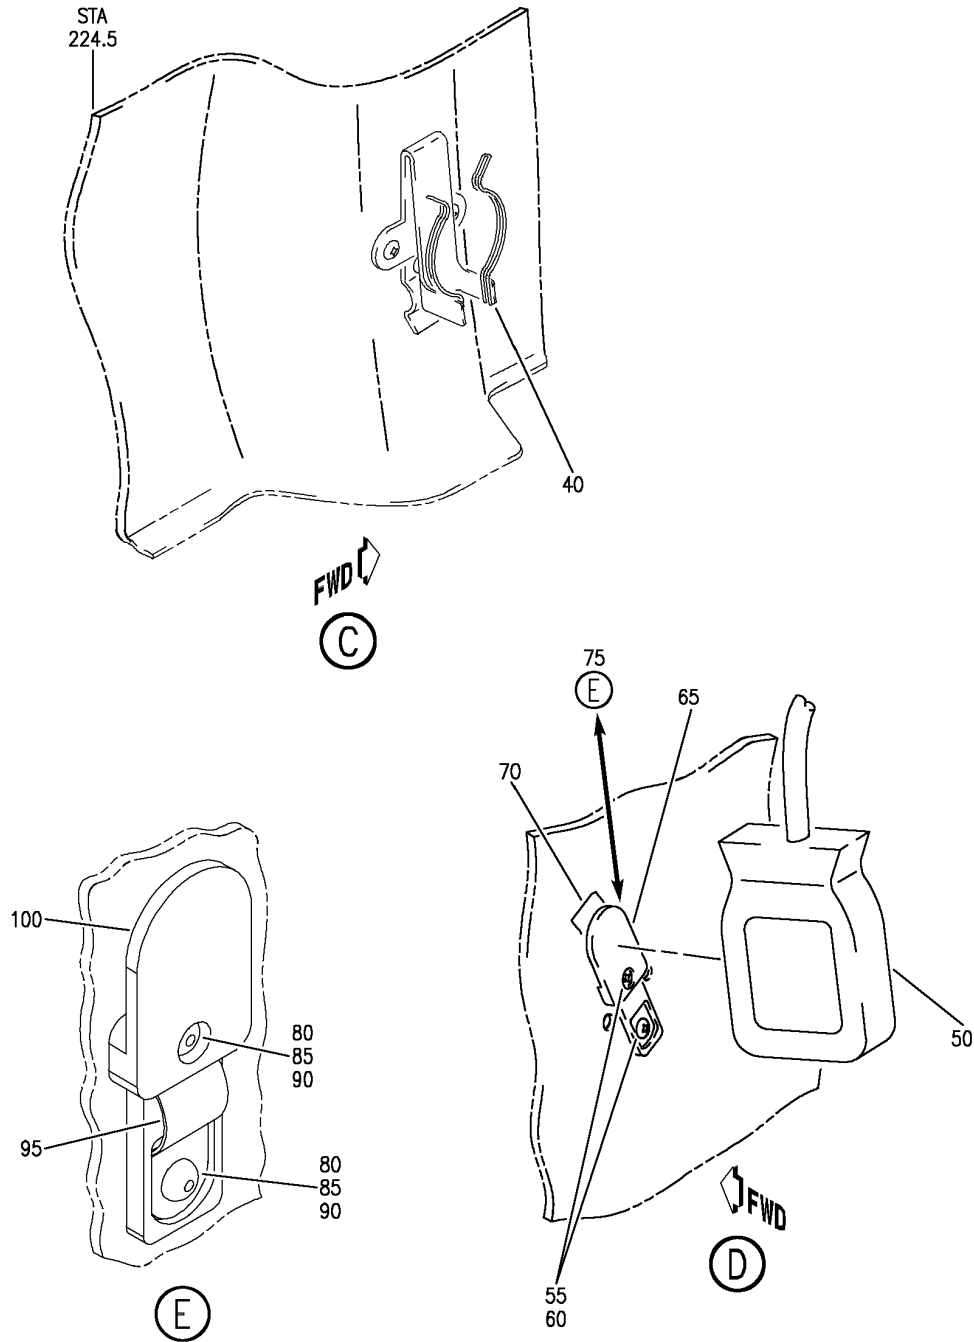

E 23510009 SHT 2 REV 265

INTERPHONE INSTL- CAPT AND FIRST OFFICER HAND MIC CONT CAB.
FIGURE 9 (SHEET 2)

23-51-00-09

RJR
AUG 15/18

23-51-00-09
PAGE 0A

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
9			INTERPHONE INSTL- CAPT AND FIRST OFFICER HAND MIC CONT CAB.		
- 2	MODREF104134		INTERPHONE INSTL-CONT CAB. CAPT AND FIRST OFFICER HAND MICS		RF
5	602-4183		MODULE NUMBER: 232A4400-655 REV B .MICROPHONE-HAND		2
5	903-1341		SUPPLIER CODE: V81134 .MICROPHONE-		2
5	903-2341		SUPPLIER CODE: V3GDR4 .MICROPHONE-		2
			SUPPLIER CODE: V3GDR4		
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

- ITEM NOT ILLUSTRATED


R Y R

23-51-00-09

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

23-51-00
 FIG. 09
 PAGE 1
 AUG 15/24

BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

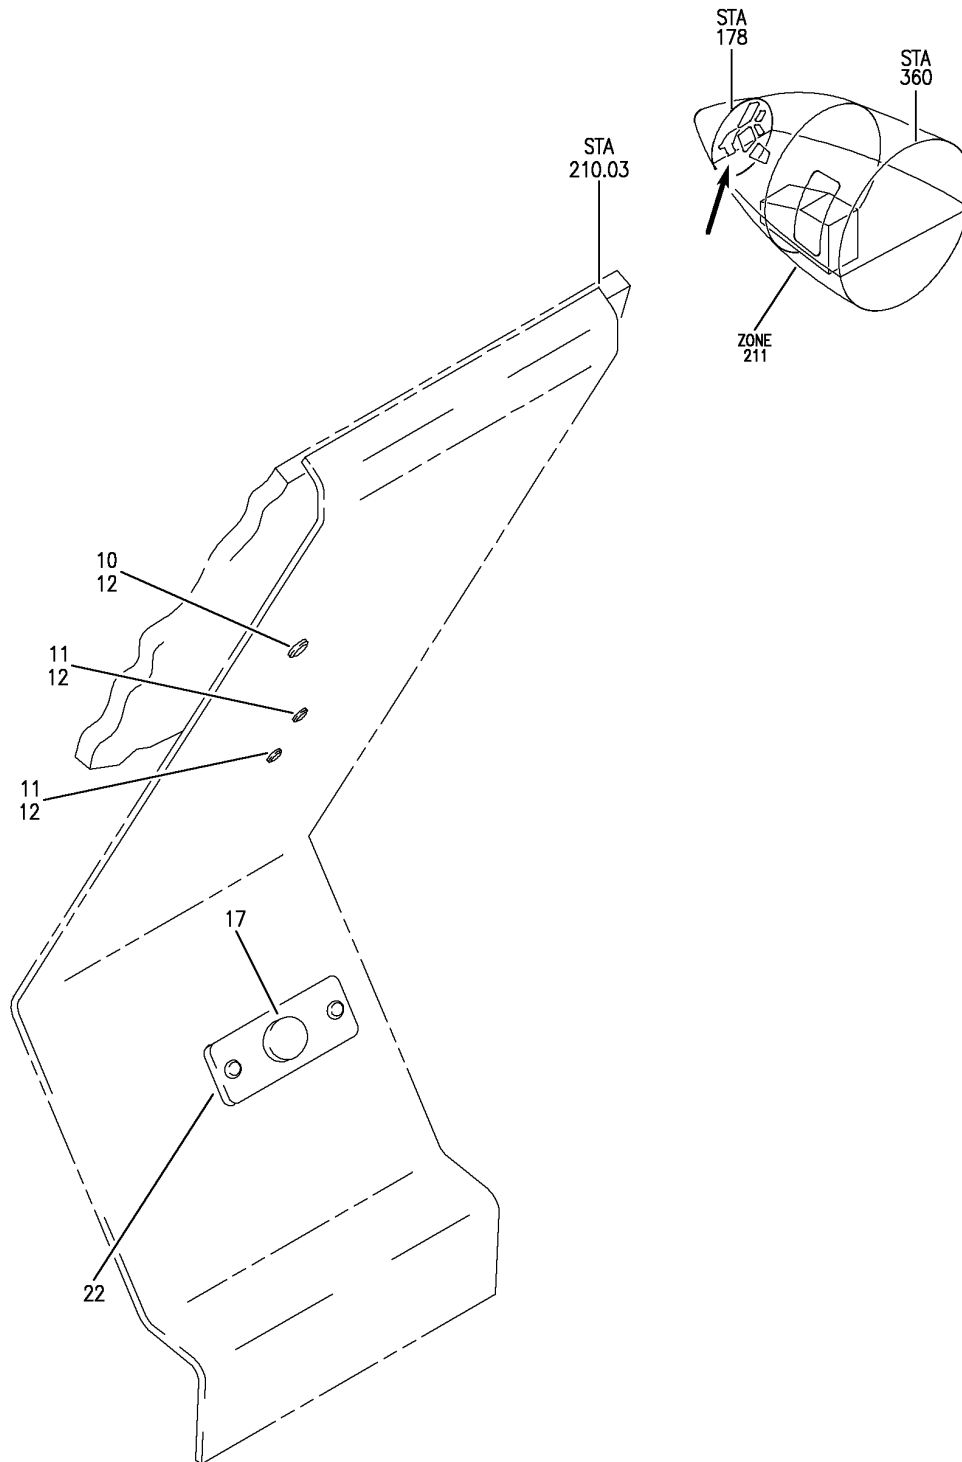

E 23510013 REV 279

INTERPHONE INSTL-CONT CAB. CAPT HANDMIKE
FIGURE 13

23-51-00-13

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

R Y R
O C T 15 / 19

23-51-00-13
PAGE 0

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
13			INTERPHONE INSTL-CONT CAB. CAPT HANDMIKE		
- 1	MODREF82003		INTERPHONE INSTL-CONT CAB. CAPT HANDMIC MODULE NUMBER: 232A4400-27 REV A		RF
12	S6C8TPKL16GY		.SCREW- SUPPLIER CODE: V12324		3
17	BACP20B6B		.PLUG- STANDARD SUBSTITUTION: BACP20B6P		1
22	232A4255-28		.PLATE ATTACHING PARTS		1
- 25	WHS8C7TPKL16GY		.SCREW- SUPPLIER CODE: V12324		2
- 25	BACS12FA08K7		.SCREW- -----*-----		2
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

— ITEM NOT ILLUSTRATED




RYR

23-51-00-13

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

23-51-00
 FIG. 13
 PAGE 1
 APR 15/23

BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

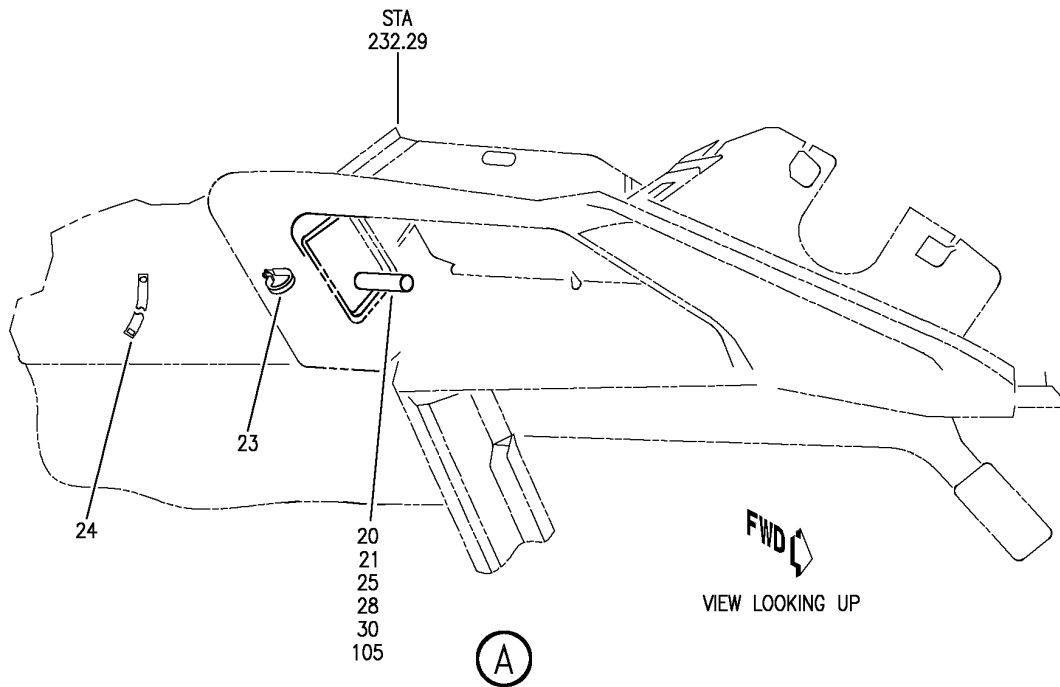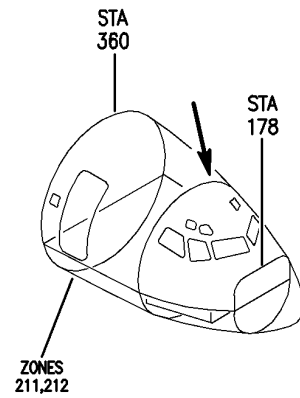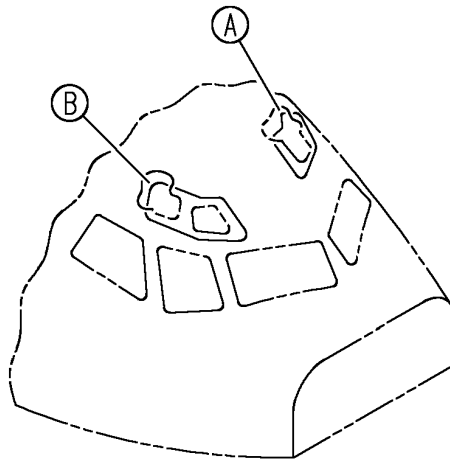

FWD
VIEW LOOKING UP

E 23510026 SH1 1 REV 159

INTERPHONE, HEADPHONE, HEADSET AND BOOMMIC HEADSET INSTL
FIGURE 26 (SHEET 1)


23-51-00-26

R/YR
OCT 15/09

23-51-00-26
PAGE 0

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

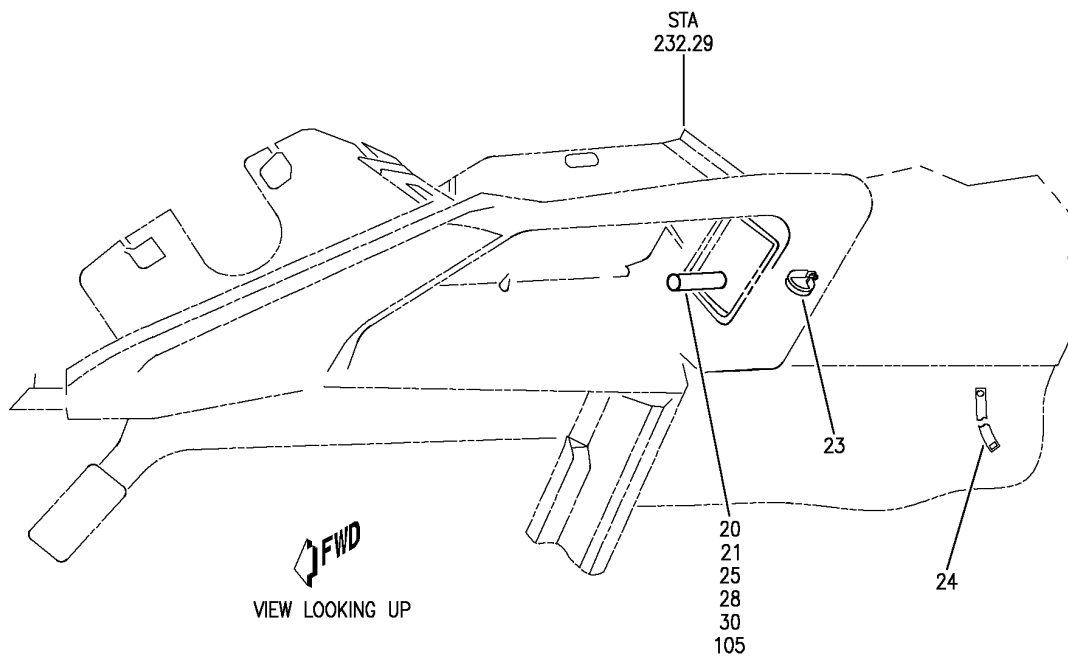

(B)

E 23510026 SHT 2 REV 159

INTERPHONE, HEADPHONE, HEADSET AND BOOMMIC HEADSET INSTL
FIGURE 26 (SHEET 2)

23-51-00-26

R Y R
O C T 15 / 09

23-51-00-26
PAGE 0A

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
26			INTERPHONE, HEADPHONE, HEADSET AND BOOMMIC HEADSET INSTL		
- 3	MODREF181916		INTERPHONE INSTL- CAPT AND FIRST OFFICER TELEX		RF
20	64300-100		MODULE NUMBER: 232A4400-612 REV C .HEADSET-BOOM MIC		2
21	64300-200		SUPPLIER CODE: V25734 COMPONENT MAINT MANUAL REF: 23-50-06 .HEADSET-BOOM MIC		2
21	64300-000		SUPPLIER CODE: V3GDR4 ELECTRICAL EQUIP NUMBER: M00428 M00429 COMPONENT MAINT MANUAL REF: 23-50-06 .HEADSET-BOOM MIC		2
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

- ITEM NOT ILLUSTRATED


RYR

23-51-00-26

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

23-51-00
 FIG. 26
 PAGE 1
 JUN 15/23

BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

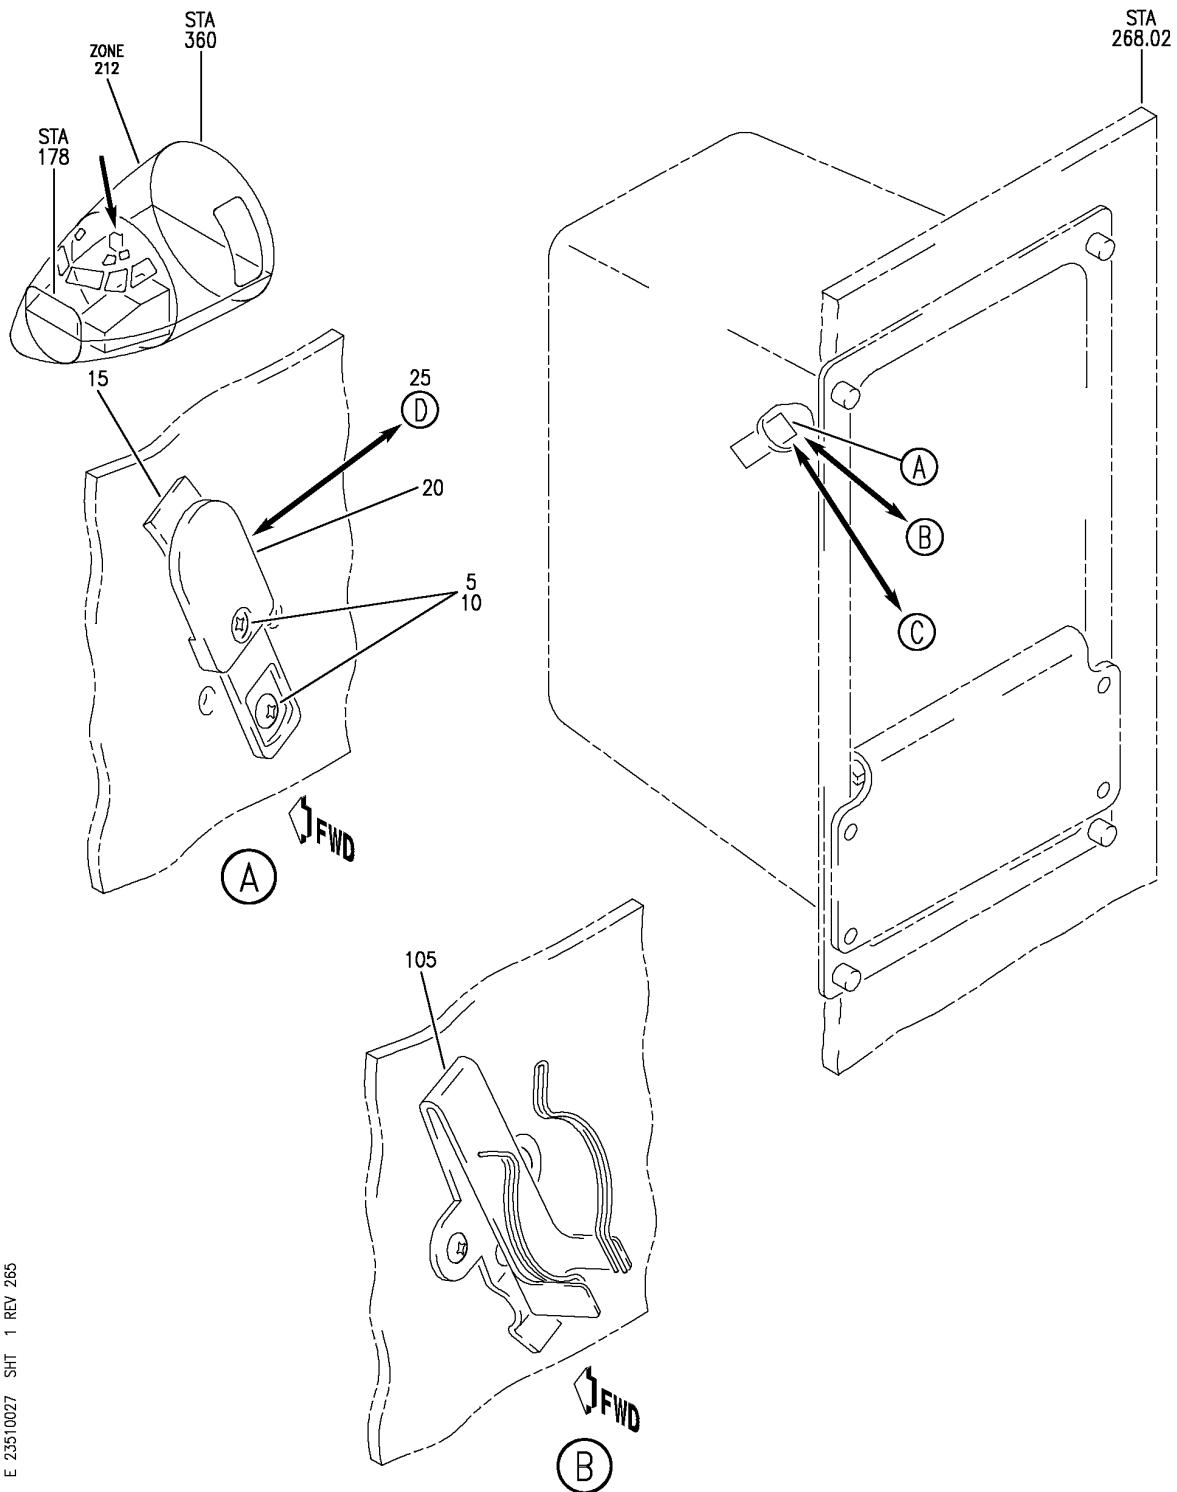

E 23510027 SHT 1 REV 265



HOLDER INSTL-FIRST OBSERVER HANDMIC
FIGURE 27 (SHEET 1)

23-51-00-27

R/YR
AUG 15/18

23-51-00-27
PAGE 0

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

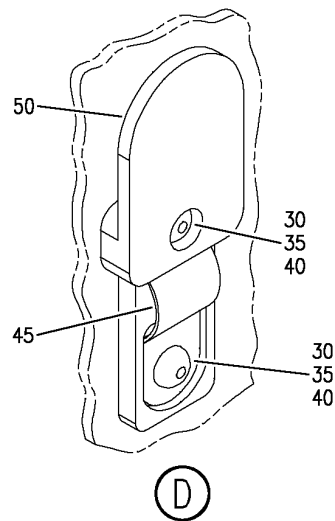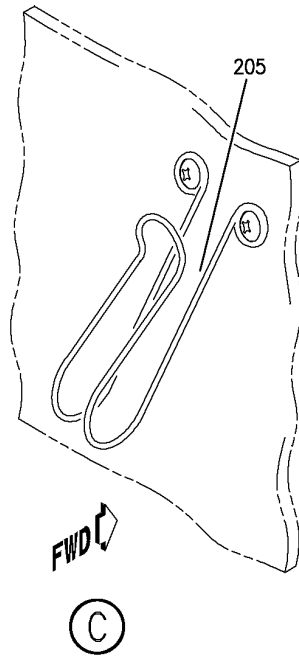

E 23510027 SH1 2 REV 265

HOLDER INSTL-FIRST OBSERVER HANDMIC
FIGURE 27 (SHEET 2)

23-51-00-27

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
27					
- 1	MODREF81971		HOLDER INSTL-FIRST OBSERVER HANDMIC HOLDER INSTL-FIRST OBSERVER HANDMIC (ELECTROVOICE) MODULE NUMBER: 232A4400-141 REV A	056173	RF
- 1	MODREF375640		HOLDER INSTL-FIRST OBSERVER HANDMIC (ELECTROVOICE) MODULE NUMBER: 232A4400-141 REV B	174999	RF
5	NAS8201A7		.SCREW- STANDARD SUBSTITUTION: BACS12HJ06K7		2
5	BACS12HK06-7		.SCREW-		2
10	PLH506CD		.NUT SUPPLIER CODE: VF0224 SPECIFICATION NUMBER: BACN10YR06CD OPTIONAL PART: H52732-06CD V15653		2
15	RCS5402-1		.SPRING- SUPPLIER CODE: V08205 MISCELLANEOUS DATA: 659A4100-1 IS BOEING PREFERRED SPARE PART.		1
15	659A4100-1		.SPRING- MISCELLANEOUS DATA: 659A4100-1 IS BOEING PREFERRED SPARE PART		1
20	8474		.HOLDER- SUPPLIER CODE: V81134 MISCELLANEOUS DATA: 659A4890-1 IS BOEING PREFERRED SPARE PART.		1
25	659A4890-1		.HOLDER ASSY-MIC MISCELLANEOUS DATA: 659A4890-1 IS BOEING PREFERRED SPARE PART		1
30	BACS12HJ06K10		..SCREW- USED ON: 659A4890-1		2
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

- ITEM NOT ILLUSTRATED

RYR

23-51-00-27

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

23-51-00
 FIG. 27
 PAGE 1
 APR 15/24

BOEING
 737-600/700/800/900
 PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
27					
35	MS35333-37		.. WASHER- USED ON: 659A4890-1		2
40	PLH506CD		.. NUT- SUPPLIER CODE: VF0224 SPECIFICATION NUMBER: BACN10YR06CD OPTIONAL PART: H52732-06CD V15653 USED ON: 659A4890-1		2
45	659A4891-2		.. CLIP- USED ON: 659A4890-1		1
50	659A4891-1		.. BRACKET- USED ON: 659A4890-1		1
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

— ITEM NOT ILLUSTRATED


R Y R

23-51-00-27

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

23-51-00
 FIG. 27
 PAGE 2
 APR 15/24

BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

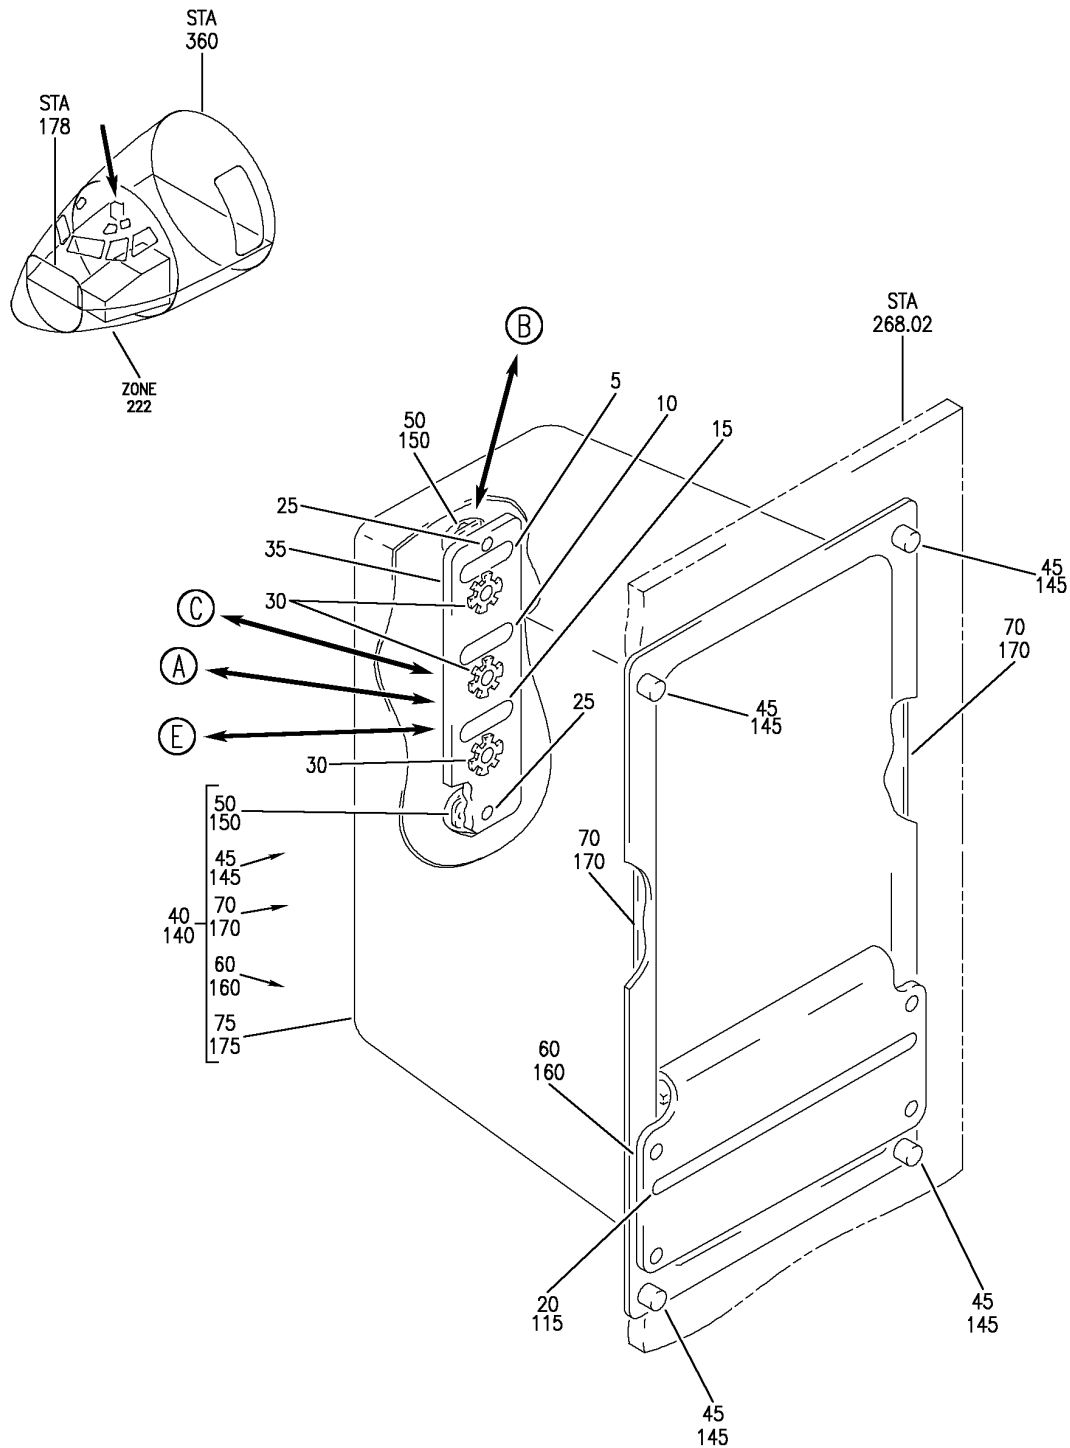

E 23510028 SHT 1 REV 225

JACK INSTL-FIRST OBSERVER
FIGURE 28 (SHEET 1)


23-51-00-28

R/YR
APR 15/15

23-51-00-28
PAGE 0

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

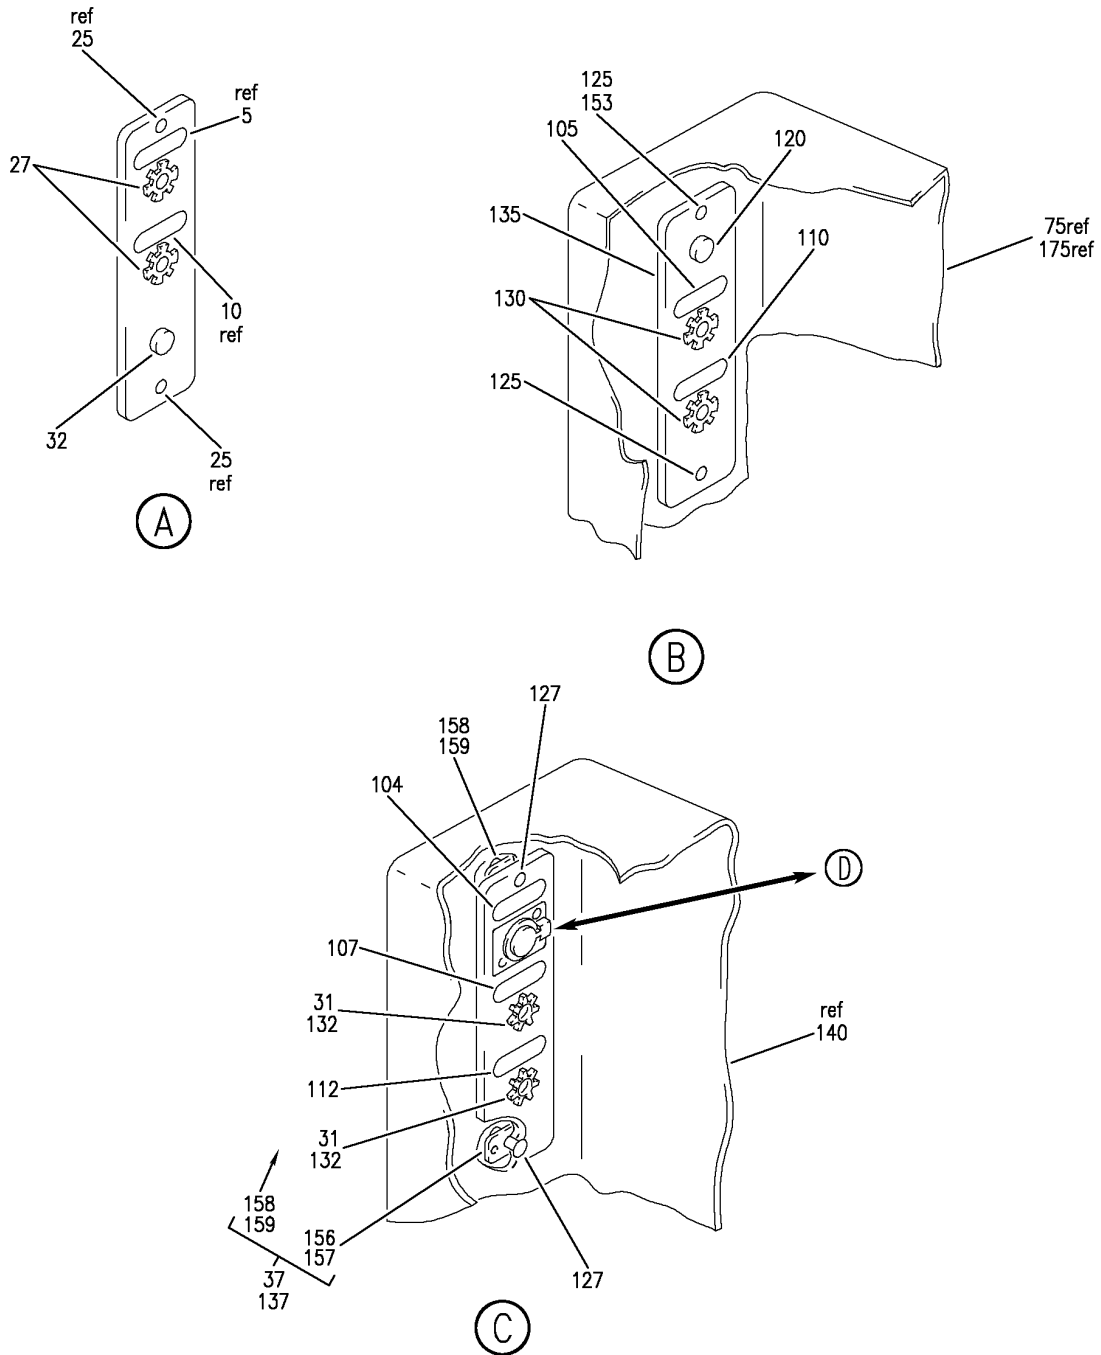

E 23510028 SHT 2 REV 199


JACK INSTL-FIRST OBSERVER
FIGURE 28 (SHEET 2)

23-51-00-28


R Y R
F E B 15 / 13

23-51-00-28
PAGE 0A

BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

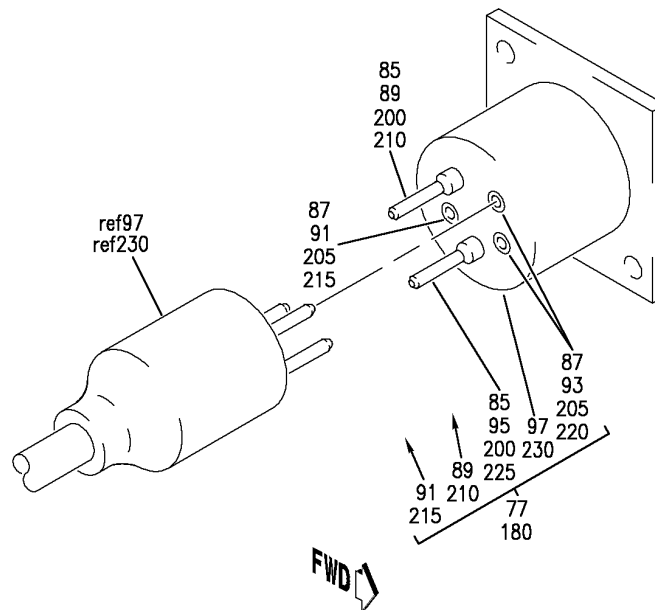

(D)

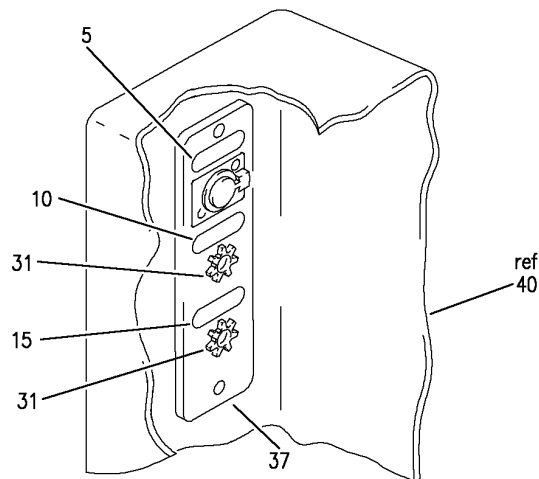

(E)

E 23510028 SHT 3 REV 233

JACK INSTL-FIRST OBSERVER
FIGURE 28 (SHEET 3)

23-51-00-28

R Y R
DEC 15/15

23-51-00-28
PAGE 08

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7 NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
28				
- 1	MODREF82007	JACK INSTL-FIRST OBSERVER JACK INSTL-FIRST OBSERVER (2J-2J-2J) MODULE NUMBER: 232A4400-301 REV A	056173	RF
- 1	MODREF349165	JACK INSTL-FIRST OBSERVER (2J-2J-2J) MODULE NUMBER: 232A4400-301 REV B	174238	RF
- 1	MODREF433330	JACK INSTL-FIRST OBSERVER (2J-2J-2J) MODULE NUMBER: 232A4400-301 REV C	239999	RF
5	BAC27DCC2774	.MARKER- PLACARD CONTENT: BOOM MIKE		1
10	BAC27DCC2777	.MARKER- PLACARD CONTENT: HEAD PHONE		1
15	BAC27DCC2779	.MARKER- PLACARD CONTENT: HAND MIKE		1
20	BAC27DCC3002	.MARKER- PLACARD CONTENT: BOOM MIC/HEADSET HEADPHONE HANDMIC		1
25	WHS8C7TPKL26GY	.SCREW- SUPPLIER CODE: V12324		2
25	BACS12FA08K7	.SCREW-		2
30	BACW10CR6	.WASHER-		3
35	232A4255-3	.PLATE-JACK		1
40	232A4440-1	.BOX ASSY-STOWAGE		1
45	PFSC35-44ASEG	..STUD SUPPLIER CODE: V72794 SPECIFICATION NUMBER: BACS21DX3G		4
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE				

- ITEM NOT ILLUSTRATED

R Y R

23-51-00-28

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

23-51-00
 FIG. 28
 PAGE 1
 JUN 15/23

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
28					
50	MF53050-08DL		..NUTPLATE SUPPLIER CODE: V15653 SPECIFICATION NUMBER: BACN10JN08CM OPTIONAL PART: BRFM20C08M V52828 MF1001-08BAC V15653 NS103218SE82 V80539 VN252D82 V92215 109F9201M82 V72962 T8125C08C V11815 ATTACHING PARTS		2
- 55	BACR15BA3		..RIVET- SIZE DETERMINED ON INSTL. -----*-----	056416	4
60	232A4255-16		..PANEL ATTACHING PARTS		1
- 65	BACR15BA3		..RIVET- SIZE DETERMINED ON INSTL. -----*-----	056416	4
70	232A4255-2		..PLATE		2
75	232A4280-4		..BOX		1
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

- ITEM NOT ILLUSTRATED


R Y R

23-51-00-28

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

23-51-00
 FIG. 28
 PAGE 2
 JUN 15/23

BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

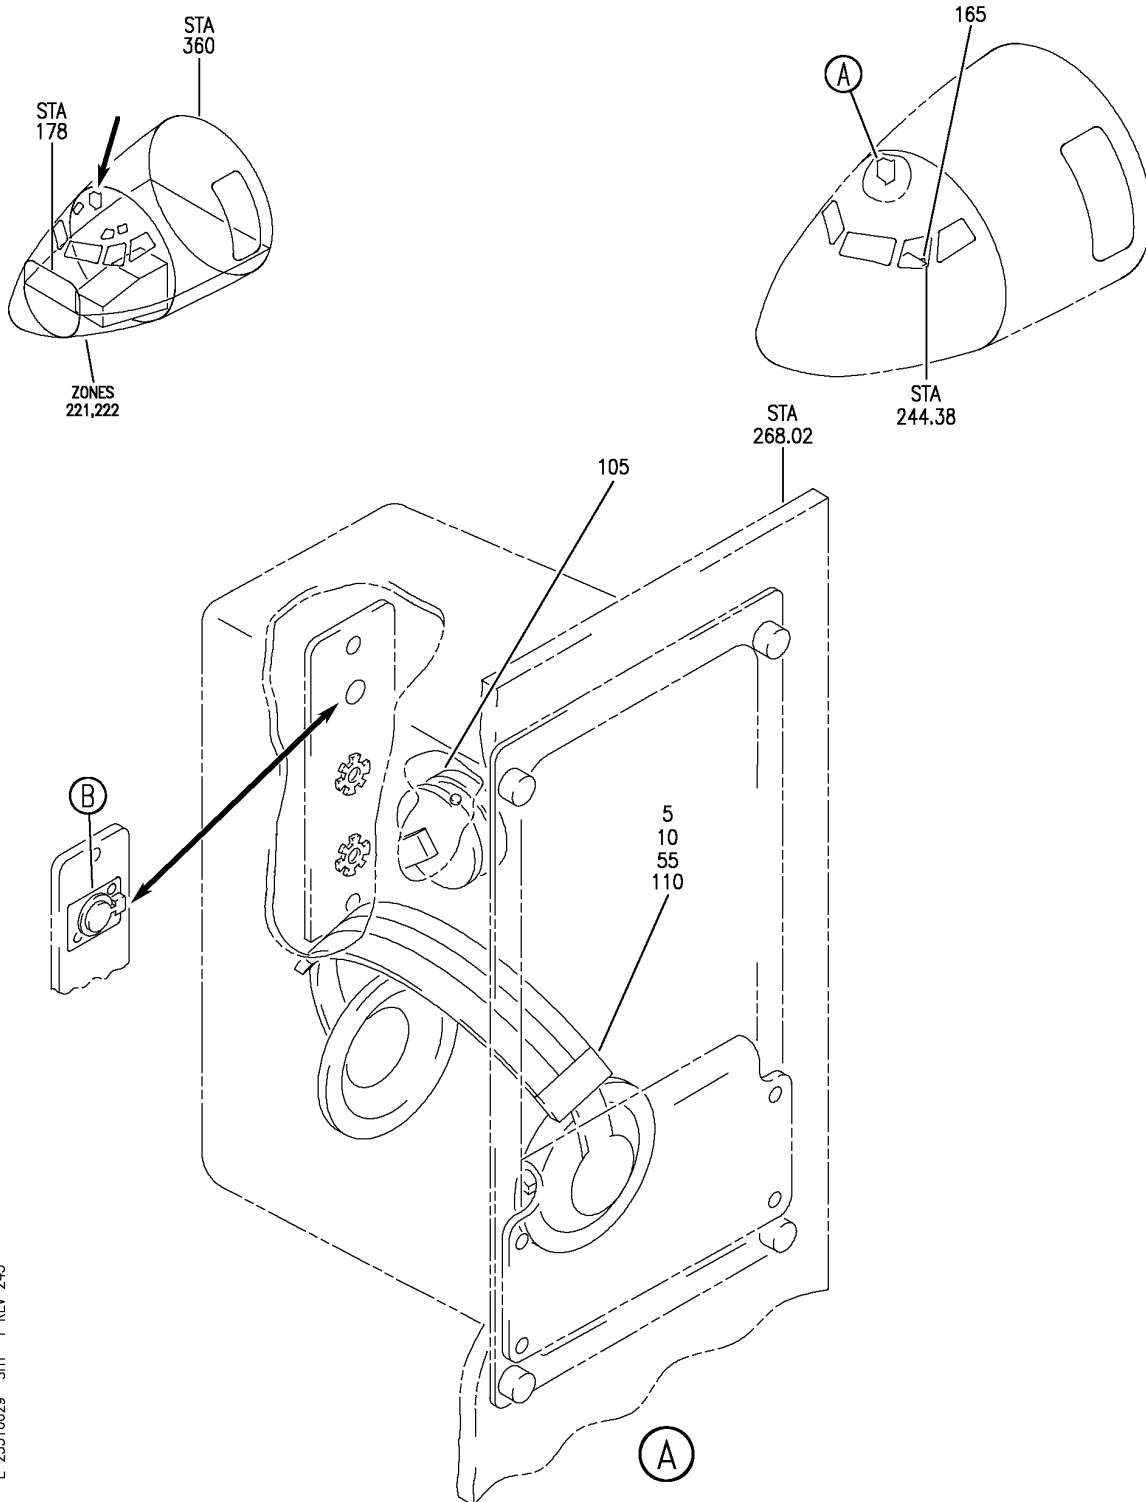

E 23510029 SHT 1 REV 243

INTERPHONE, HEADPHONE BOOMMIC HEADSET AND HANDMIC INSTL- FIRST OBSERVER
FIGURE 29 (SHEET 1)


23-51-00-29

RJR
OCT 15/16

23-51-00-29
PAGE 0

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

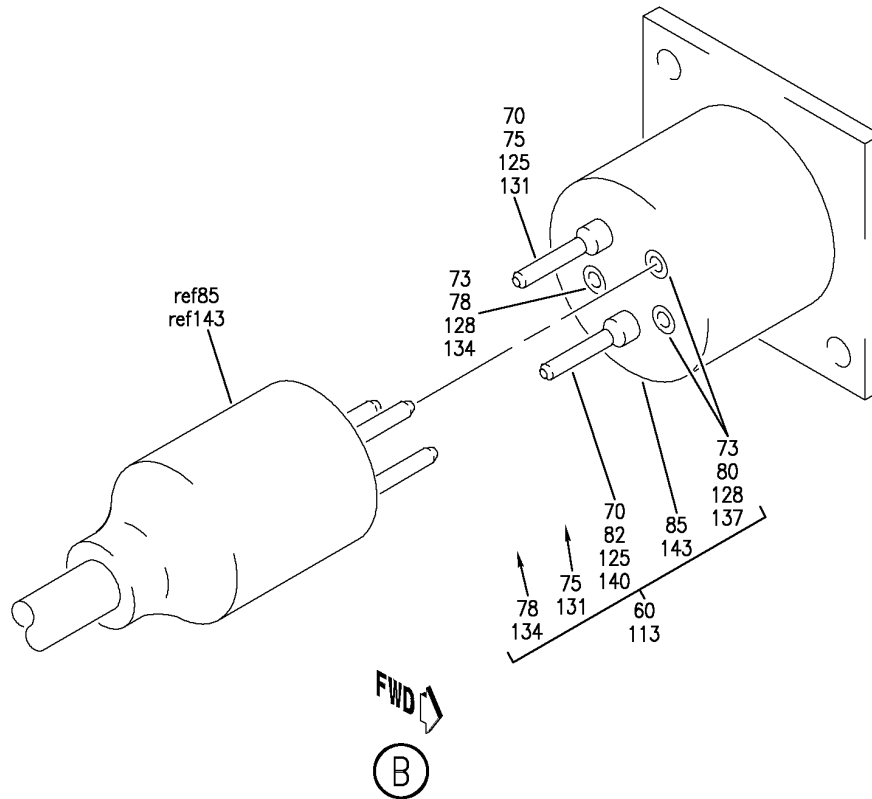

E 23510029 SH 2 REV 243

INTERPHONE, HEADPHONE BOOMMIC HEADSET AND HANDMIC INSTL- FIRST OBSERVER
FIGURE 29 (SHEET 2)

R Y R
O C T 15 / 16

23-51-00-29

23-51-00-29
PAGE 0A

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
29			INTERPHONE, HEADPHONE BOOMMIC HEADSET AND HANDMIC INSTL- FIRST OBSERVER		
- 1	MODREF181917		INTERPHONE INSTL-FIRST OBSERVER HEADPHONE (ASTRO METALLURGICAL) MODULE NUMBER: 232A4400-716 REV B	056222	RF
- 1	MODREF431491		INTERPHONE INSTL-FIRST OBSERVER (TELEX) MODULE NUMBER: 232A4400-716 REV C	223999	RF
5	64400-200		.HEADPHONE ASSY- SUPPLIER CODE: V3GDR4 FUNCTIONAL DESCRIPTION: PROVIDES BACK UP LISTEN ONLY COMMUNICATIONS FOR FLIGHT CREW. ELECTRICAL EQUIP NUMBER: M00296 COMPONENT MAINT MANUAL REF: 23-50-06		1
5	64400-000		.HEADPHONE- SUPPLIER CODE: V59446 FUNCTIONAL DESCRIPTION: PROVIDES BACK UP LISTEN ONLY COMMUNICATIONS FOR THE FLIGHT CREW. ELECTRICAL EQUIP NUMBER: M00296 COMPONENT MAINT MANUAL REF: 23-50-06		1
5	64060-001		.HEADPHONE- SUPPLIER CODE: V25734 ELECTRICAL EQUIP NUMBER: M00296		1
5	20046-1		.HEADPHONE- SUPPLIER CODE: V78711 ELECTRICAL EQUIP NUMBER: M00296 COMPONENT MAINT MANUAL REF: 23-43-21		1
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

- ITEM NOT ILLUSTRATED

RYR

23-51-00-29

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

23-51-00
 FIG. 29
 PAGE 1
 JUN 15/23

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
29	5 AST2110BC		.HEADPHONE- SUPPLIER CODE: VK1057 ELECTRICAL EQUIP NUMBER: M00296		1
- 100	MODREF101494		INTERPHONE INSTL-FIRST OBSERVER HAND (ELECTROVOICE) MODULE NUMBER: 232A4400-755 REV B		RF
105	903-1341		.MICROPHONE- SUPPLIER CODE: V3GDR4 ELECTRICAL EQUIP NUMBER: M00245		1
105	903-2341		.MICROPHONE- SUPPLIER CODE: V3GDR4 ELECTRICAL EQUIP NUMBER: M00245		1
105	602-4183		.MICROPHONE- SUPPLIER CODE: V81134 ELECTRICAL EQUIP NUMBER: M00245		1
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

— ITEM NOT ILLUSTRATED


R Y R

23-51-00-29

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

23-51-00
 FIG. 29
 PAGE 2
 AUG 15/24

BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

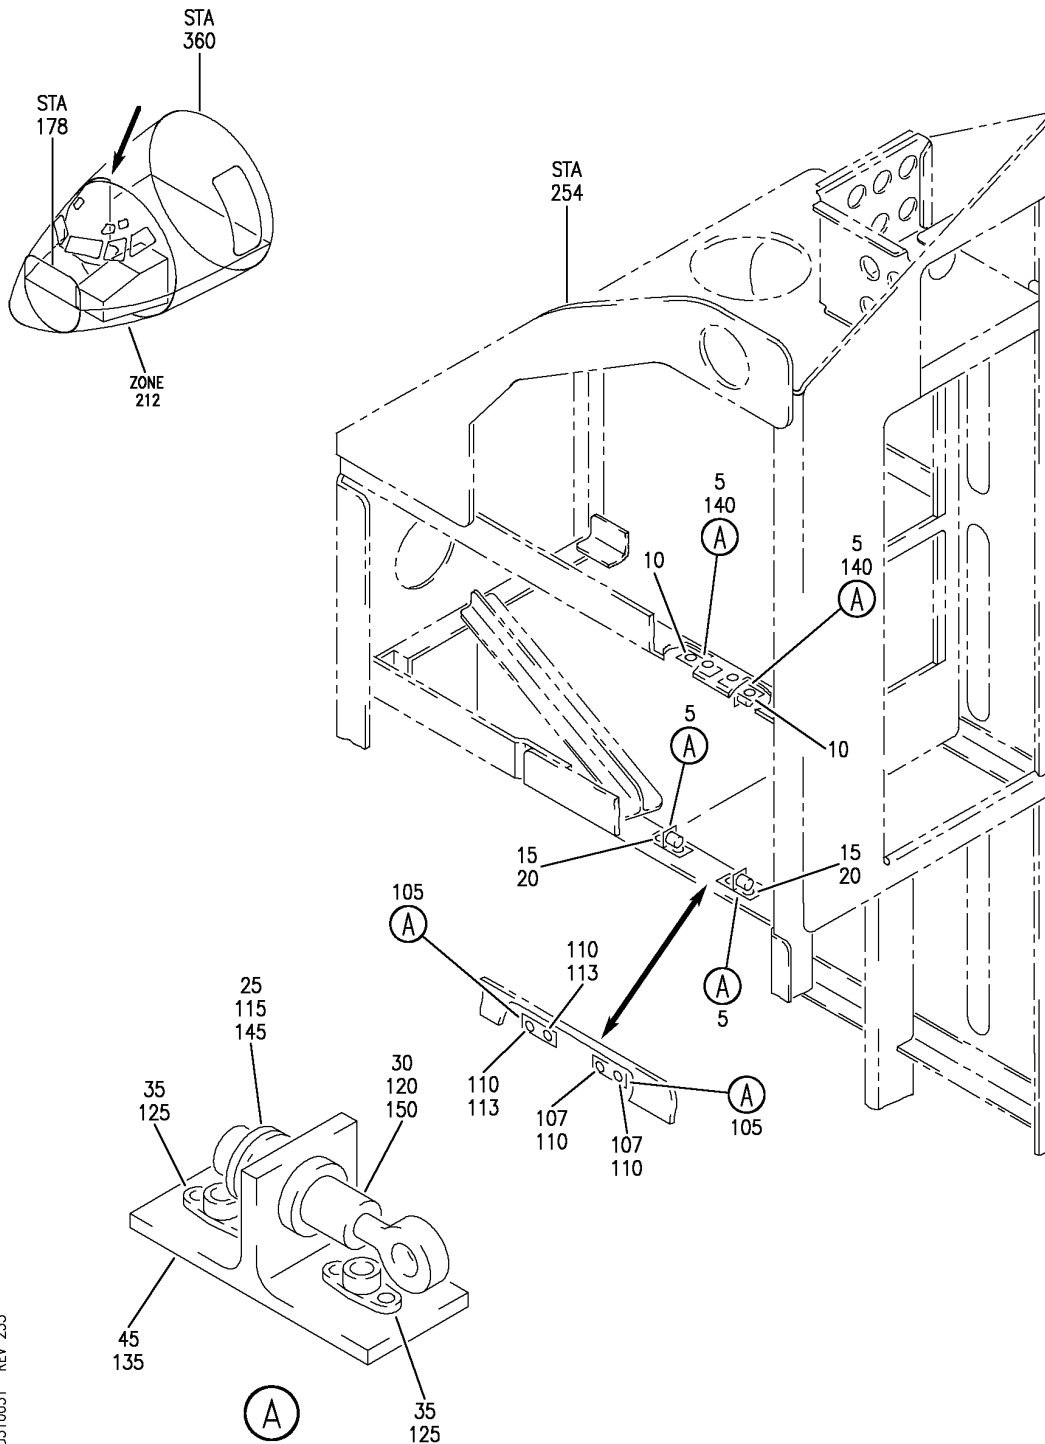

E 23510031 REV 253

EQUIPMENT INSTL-P6 CB PNL (FLIGHT INTERPHONE SYSTEM ONLY)
FIGURE 31

23-51-00-31

R Y R
AUG 15 / 17

23-51-00-31
PAGE 0

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
31			EQUIPMENT INSTL-P6 CB PNL (FLIGHT INTERPHONE SYSTEM ONLY)		
- 1	MODREF215734		EQUIPMENT INSTL-P6 CB PNL (FLIGHT INTERPHONE SYSTEM ONLY) MODULE NUMBER: 233A5220-11 REV E FOR OTHER SYS DETAILS SEE: 11-31-01-53A 21-25-02-02A 21-31-00-02 24-34-11-03 24-51-11-01A 24-52-00-02 24-61-00-03 28-21-21-01A 28-21-81-03 31-11-98-09 33-11-00-04A 33-18-00-03 33-25-00-02A 33-29-00-03A	056062	RF
- 1	MODREF229774		EQUIPMENT INSTL-P6 CB PNL (FLIGHT INTERPHONE SYSTEM ONLY) MODULE NUMBER: 233A5220-11 REV F FOR OTHER SYS DETAILS SEE: 11-31-01-53A 21-25-02-02A 21-31-00-02 24-34-11-03 24-51-11-01A 24-52-00-02 24-61-00-03 28-21-21-01A 28-21-81-03 31-11-98-09 33-11-00-04A 33-18-00-03 33-25-00-02A 33-29-00-03A	063082	RF
5	69-76658-7		.DIODE ASSY- ELECTRICAL EQUIP NUMBER: M00542 M00543 M00544 M00545	056082	4
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

- ITEM NOT ILLUSTRATED

RYR

23-51-00-31

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

23-51-00
 FIG. 31
 PAGE 1
 JUN 15/23

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
31			ATTACHING PARTS		
10	NAS514P632-5	.SCREW		056082	4
15	NAS8201A6	.SCREW		056082	4
			STANDARD SUBSTITUTION:		
			BACS12HJ06K6		
20	NAS1149DN616J	.WASHER		056082	4
		-----*-----			
25	4729	..KIT-MTG		056082	1
		SUPPLIER CODE:			
		V91833			
30	JANTX1N1206A	..DIODE		056082	1
35	MF53050-06CD	..NUTPLATE		056082	2
		SUPPLIER CODE:			
		V15653			
		SPECIFICATION NUMBER:			
		BACN10JN06CD			
		OPTIONAL PART:			
		T8301C632CD			
		V11815			
		102F9201M62			
		V72962			
		NS202487-62			
		V80539			
		MF51637-06			
		V15653			
		BRFM20C06LD			
		V52828			
		ATTACHING PARTS			
- 40	BACR15BA3D	..RIVET-		056082	4
		SIZE DETERMINED ON INSTL.			
		-----*-----			
45	69-76658-6	..TEE		056082	1
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

- ITEM NOT ILLUSTRATED

R Y R

23-51-00-31

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

23-51-00
 FIG. 31
 PAGE 2
 JUN 15/23

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7 NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
31 - 100	MODREF266311	EQUIPMENT INSTL-P6 CB PNL (FLIGHT INTERPHONE SYSTEM ONLY) MODULE NUMBER: 233A5220-11 REV M1 FOR OTHER SYS DETAILS SEE: 11-31-01-53A 21-25-02-02A 21-31-00-02 24-34-11-03 24-51-11-01A 24-52-00-02 24-61-00-03 28-21-21-01A 28-21-81-03 31-11-98-09 33-11-00-04A 33-18-00-03 33-25-00-02A 33-29-00-03A	083090	RF
- 100	MODREF267101	EQUIPMENT INSTL-P6 CB PNL (FLIGHT INTERPHONE SYSTEM ONLY) MODULE NUMBER: 233A5220-11 REV P FOR OTHER SYS DETAILS SEE: 11-31-01-53A 21-25-02-02A 21-31-00-02 24-34-11-03 24-51-11-01A 24-52-00-02 24-61-00-03 28-21-21-01A 28-21-81-03 31-11-98-09 33-11-00-04A 33-18-00-03 33-25-00-02A 33-29-00-03A	091151	RF
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE				

— ITEM NOT ILLUSTRATED

RYR

23-51-00-31

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

23-51-00
 FIG. 31
 PAGE 3
 JUN 15/23

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
31 - 100	MODREF351279		EQUIPMENT INSTL-P6 CB PNL (FLIGHT INTERPHONE SYSTEM ONLY) MODULE NUMBER: 233A5220-11 REV R FOR OTHER SYS DETAILS SEE: 11-31-01-53A 21-25-02-02A 21-31-00-02 24-34-11-03 24-51-11-01A 24-52-00-02 24-61-00-03 28-21-21-01A 28-21-81-03 31-11-98-09 33-11-00-04A 33-18-00-03 33-25-00-02A 33-29-00-03A	152173	RF
- 100	MODREF371110		EQUIPMENT INSTL-P6 CB PNL (FLIGHT INTERPHONE SYSTEM ONLY) MODULE NUMBER: 233A5220-11 REV T FOR OTHER SYS DETAILS SEE: 11-31-01-53A 21-25-02-02A 21-31-00-02 24-34-11-03 24-51-11-01A 24-52-00-02 24-61-00-03 28-21-21-01A 28-21-81-03 31-11-98-09 33-11-00-04A 33-18-00-03 33-25-00-02A 33-29-00-03A	174201	RF
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

— ITEM NOT ILLUSTRATED

RYR

23-51-00-31

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

23-51-00
 FIG. 31
 PAGE 4
 JUN 15/23

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
31 - 100	MODREF409888		EQUIPMENT INSTL-P6 CB PNL (FLIGHT INTERPHONE SYSTEM ONLY) MODULE NUMBER: 233A5220-11 REV U FOR OTHER SYS DETAILS SEE: 11-31-01-53A 21-25-02-02A 21-31-00-02 24-34-11-03 24-51-11-01A 24-52-00-02 24-61-00-03 28-21-21-01A 28-21-81-03 31-11-98-09 33-11-00-04A 33-18-00-03 33-25-00-02A 33-29-00-03A	202337	RF
- 100	MODREF551308		EQUIPMENT INSTL-P6 CB PNL (FLIGHT INTERPHONE SYSTEM ONLY) MODULE NUMBER: 233A5220-11 REV W FOR OTHER SYS DETAILS SEE: 11-31-01-53A 21-25-02-02A 21-31-00-02 24-34-11-03 24-51-11-01A 24-52-00-02 24-61-00-03 28-21-21-01A 28-21-81-03 31-11-98-09 33-11-00-04A 33-18-00-03 33-25-00-02A 33-29-00-03A	338348	RF
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

— ITEM NOT ILLUSTRATED

RYR

23-51-00-31

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

23-51-00
 FIG. 31
 PAGE 5
 JUN 15/23

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7 NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
31 - 103	MODREF624969	EQUIPMENT INSTL-P6 CB PNL (FLIGHT INTERPHONE SYSTEM ONLY) MODULE NUMBER: 233A5220-11 REV AD FOR OTHER SYS DETAILS SEE: 11-31-01-53A 21-25-02-02A 21-31-00-02 24-34-11-03 24-51-11-01A 24-52-00-02 24-61-00-03 28-21-21-01A 28-21-81-03 31-11-98-09 33-11-00-04A 33-18-00-03 33-25-00-02A 33-29-00-03A	349450	RF
- 103	MODREF725426	EQUIPMENT INSTL-P6 CB PNL (FLIGHT INTERPHONE SYSTEM ONLY) MODULE NUMBER: 233A5220-11 REV AE FOR OTHER SYS DETAILS SEE: 11-31-01-53A 21-25-02-02A 21-31-00-02 24-34-11-03 24-51-11-01A 24-52-00-02 24-61-00-03 28-21-21-01A 28-21-81-03 31-11-98-09 33-11-00-04A 33-18-00-03 33-25-00-02A 33-29-00-03A	451466	RF
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE				

- ITEM NOT ILLUSTRATED

RYR

23-51-00-31

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

23-51-00
 FIG. 31
 PAGE 6
 JUN 15/23

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7 NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
31 - 103	MODREF737792	EQUIPMENT INSTL-P6 CB PNL (FLIGHT INTERPHONE SYSTEM ONLY) MODULE NUMBER: 233A5220-11 REV AE1 FOR OTHER SYS DETAILS SEE: 11-31-01-53A 21-25-02-02A 21-31-00-02 24-34-11-03 24-51-11-01A 24-52-00-02 24-61-00-03 28-21-21-01A 28-21-81-03 31-11-98-09 33-11-00-04A 33-18-00-03 33-25-00-02A 33-29-00-03A	467999	RF
105	69-76658-7	.DIODE ASSY- ELECTRICAL EQUIP NUMBER: M00544 M00545 ATTACHING PARTS	083999	2
107	BACS12GX06H6	.SCREW	467999	2
110	BACS12GX06H6	.SCREW	083466	4
113	BACS12GX06H7	.SCREW	467999	2
		-----*-----		
115	4729	..KIT-MTG SUPPLIER CODE: V91833	083999	1
120	JANTX1N1206A	..DIODE	083999	1
125	MF53050-06CD	..NUTPLATE SUPPLIER CODE: V15653 SPECIFICATION NUMBER: BACN10JN06CD OPTIONAL PART: T8301C632CD V11815 102F9201M62 V72962 NS202487-62 V80539 MF51637-06 V15653 BRFM20C06LD V52828	083999	2
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE				

— ITEM NOT ILLUSTRATED

RYR

23-51-00-31

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

23-51-00
FIG. 31
PAGE 7
JUN 15/23

BOEING
 737-600/700/800/900
 PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
31			ATTACHING PARTS		
- 130	BACR15BA3D		..RIVET-	083999	4
			SIZE DETERMINED ON INSTL.		
			-----*-----		
135	69-76658-6		..TEE	083999	1
140	69-76658-9		.DIODE ASSY-	083999	2
			ELECTRICAL EQUIP NUMBER:		
			M00542		
			M00543		
150	JANTX1N1206A		..DIODE	083999	1
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

- ITEM NOT ILLUSTRATED


R Y R

23-51-00-31

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

23-51-00
 FIG. 31
 PAGE 8
 JUN 15/23

BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

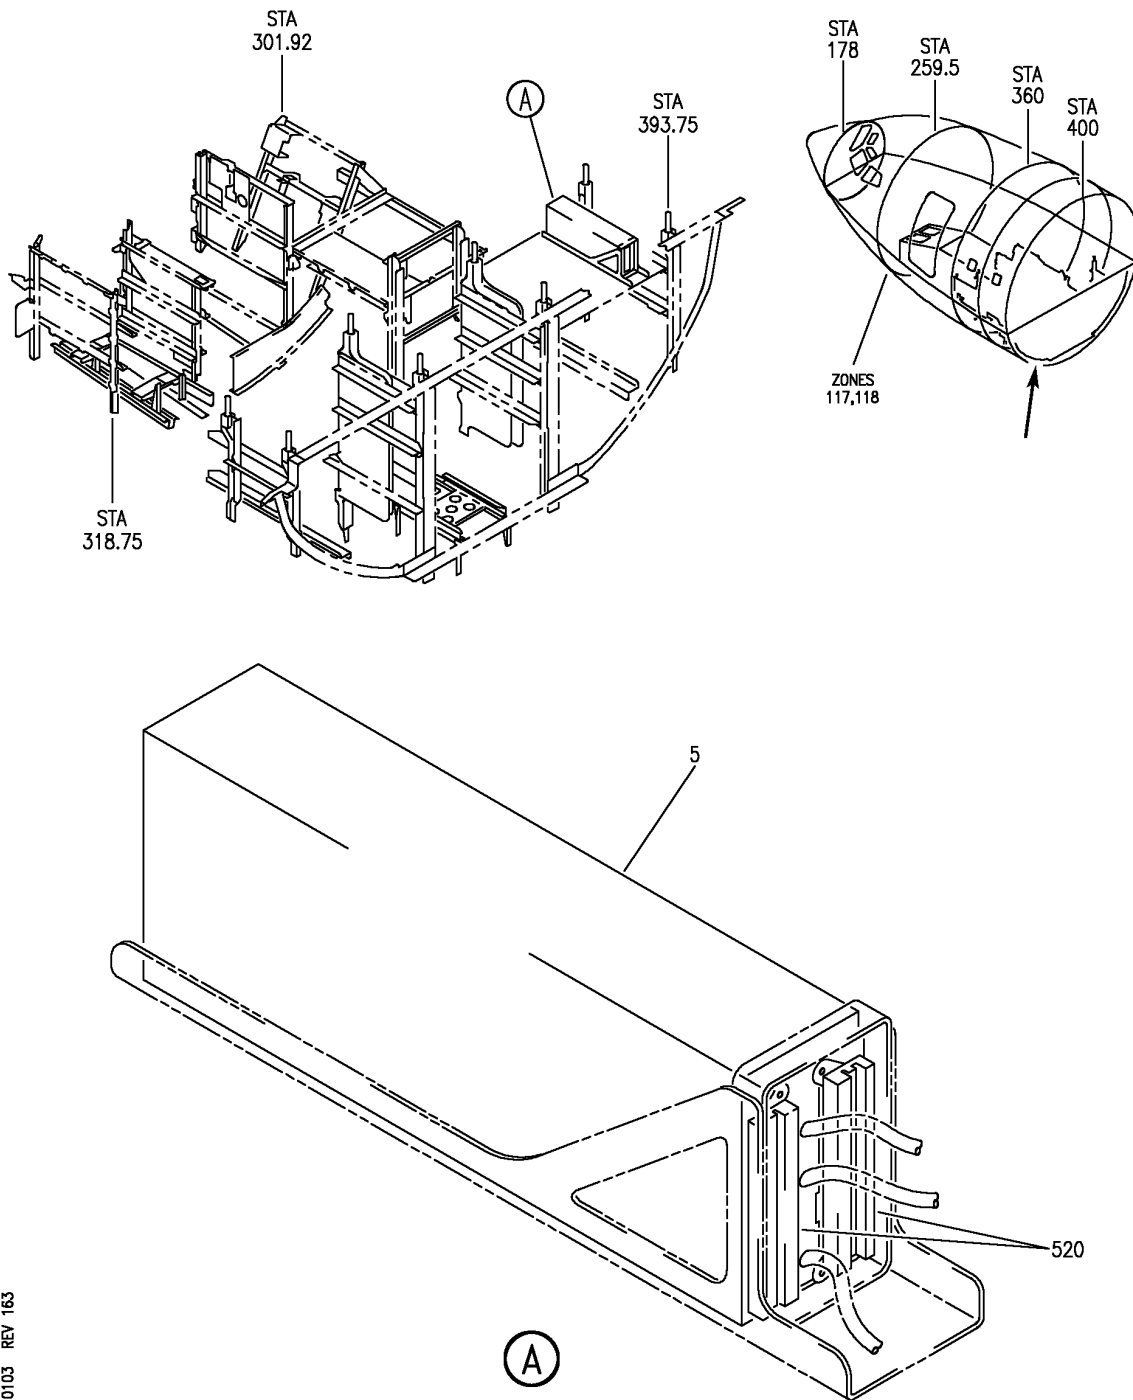

E 23510103 REV 163

EQUIPMENT INSTL-E4 RACK (COMMUNICATIONS ONLY)
FIGURE 3

23-51-01-03

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

R Y R
F E B 15 / 10

23-51-01-03
PAGE 0

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
3					
- 1	MODREF702847		EQUIPMENT INSTL-E4 RACK (COMMUNICATIONS ONLY) EQUIPMENT INSTL-E4 RACK (COMMUNICATIONS ONLY) MODULE NUMBER: 284A0441-19 REV B FOR OTHER SYS DETAILS SEE: 21-51-02-02 24-21-81-03A 24-32-11-02 24-41-21-02 27-62-35-02 30-41-11-03	056168 174999 417999	RF
- 2	MODREF202978		EQUIPMENT INSTL-E4 RACK (COMMUNICATIONS ONLY) MODULE NUMBER: 284A0441-16 REV A FOR OTHER SYS DETAILS SEE: 21-51-02-02 24-21-81-03A 24-32-11-02 24-41-21-02 27-62-35-02 30-41-11-03	056168 174342	RF
- 2	MODREF518610		EQUIPMENT INSTL-E4 RACK (COMMUNICATIONS ONLY) MODULE NUMBER: 284A0441-16 REV B FOR OTHER SYS DETAILS SEE: 21-51-02-02 24-21-81-03A 24-32-11-02 24-41-21-02 27-62-35-02 30-41-11-03	343355	RF
- 2	MODREF640172		EQUIPMENT INSTL-E4 RACK (COMMUNICATIONS ONLY) MODULE NUMBER: 284A0441-19 REV A FOR OTHER SYS DETAILS SEE: 21-51-02-02 24-21-81-03A 24-32-11-02 24-41-21-02 27-62-35-02 30-41-11-03	397416	RF
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

- ITEM NOT ILLUSTRATED

RYR

23-51-01-03

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

23-51-01
 FIG. 03
 PAGE 1
 JUN 15/23

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
3					
- 2	MODREF652171		EQUIPMENT INSTL-E4 RACK (COMMUNICATIONS ONLY) MODULE NUMBER: 284A0441-16 REV D FOR OTHER SYS DETAILS SEE: 21-51-02-02 24-21-81-03A 24-32-11-02 24-41-21-02 27-62-35-02 30-41-11-03	356396	RF
5	5340-1-1		.UNIT ASSY-REMOTE ELECT. SUPPLIER CODE: V30242 FUNCTIONAL DESCRIPTION: CONTROLS MICROPHONE SELECTION AND THE ROUTING OF AUDIO SIGNALS FOR HEADPHONE OR SPEAKER MONITORING BASED ON AUDIO CONTROL PANEL SELECTIONS. SPECIFICATION NUMBER: 10-62090-121 MISCELLANEOUS DATA: PORTABLE ELECTRONIC DEVICE (PED) TOLERANT PER GUIDELINES IN DRAWING 222A4006 ELECTRICAL EQUIP NUMBER: M01353 COMPONENT MAINT MANUAL REF: 23-50-84 MAINTENANCE MANUAL REF: 23-51-01 QUALIFIED I/W DATA: 5340-1-1 MAY REPLACE 5340-1 IF THE AIRPLANE HAS NO WIRES CONNECTED TO THE 'C' (BOTTOM) INSERT ON THE LRU TRAY. SET AW MUTE SWITCH TO MATCH UNIT BEING REMOVED. 5340-1 MAY REPLACE 5340-1-1 IF THE AIRPLANE TRAY CONNECTOR IS COMPATIBLE WITH THE LRU CONNECTOR. SET AW MUTE	056168 174999	1
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

- ITEM NOT ILLUSTRATED

RYR

23-51-01-03

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

23-51-01
 FIG. 03
 PAGE 2
 APR 15/25

BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
3			SWITCH TO HORIZONTAL POSITION WHEN AW MUTE SWITCH SET VERTICAL AND/OR REU PROGRAM PIN IS CONFIGURED TO NOT SEND AURAL WARNINGS TO THE HEADPHONES. 5340-1-1 CAN REPLACE BUT NOT BE REPLACED BY 5140-1-4. 5340-1-1 CAN REPLACE BUT NOT BE REPLACED BY 5140-1-7. 5340-1-1 CAN REPLACE BUT NOT BE REPLACED BY 5140-1-8. 5340-1-1 CAN REPLACE BUT NOT BE REPLACED BY 5140-1-9. 5340-1-1 (10-62090-121) CAN REPLACE BUT NOT BE REPLACED BY 5140-1-1 (10-62090-12) ONLY WHEN THE AURAL WARNING (AW) MUTE SWITCH ON 5340-1-1 IS SET TO THE VERTICAL POSITION. 5340-1-1 (10-62090-121) CAN REPLACE OR BE REPLACED BY 5140-1-10 (10-62090-113) EXCEPT 5340-1-1 MUST BE CONFIGURED WITH THE AURAL WARNING MUTE SWITCH ON THE FRONT PANEL OF THE REU SET TO PLACE THE SLOT IN A VERTICAL POSITION. 5140-1-10 SHOULD NOT BE INSTALLED ON AIRCRAFT EQUIPPED WITH SATCOM. 5340-1-1 (10-62090-121)		
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

— ITEM NOT ILLUSTRATED

R Y R

23-51-01-03

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

23-51-01
 FIG. 03
 PAGE 3
 APR 15/25

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
3			CAN REPLACE BUT NOT BE REPLACED BY 5140-1-6 (10-62090-112) ONLY WHEN THE AURAL WARNING (AW) MUTE SWITCH ON 5340-1-1 IS SET TO THE VERTICAL POSITION. 5340-1-1 (10-62090-121) CAN REPLACE BUT NOT BE REPLACED BY 5140-1 (10-62090-10) ONLY WHEN THE AURAL WARNING (AW) MUTE SWITCH ON 5340-1-1 IS SET TO THE VERTICAL POSITION.		
- 503	286A0411-146		WIRE BUNDLE ASSY- ELECTRICAL EQUIP NUMBER: W00411	056168 174176	RF
520	RBGP48-116N		.BLOCK- SUPPLIER CODE: V09922 SPECIFICATION NUMBER: S280W601-116 ELECTRICAL EQUIP NUMBER: D02501T D02501U WIRING DIAGRAM REF: 235151	056168 174176	2
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

— ITEM NOT ILLUSTRATED


RYR

23-51-01-03

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

23-51-01
 FIG. 03
 PAGE 4
 APR 15/25

BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

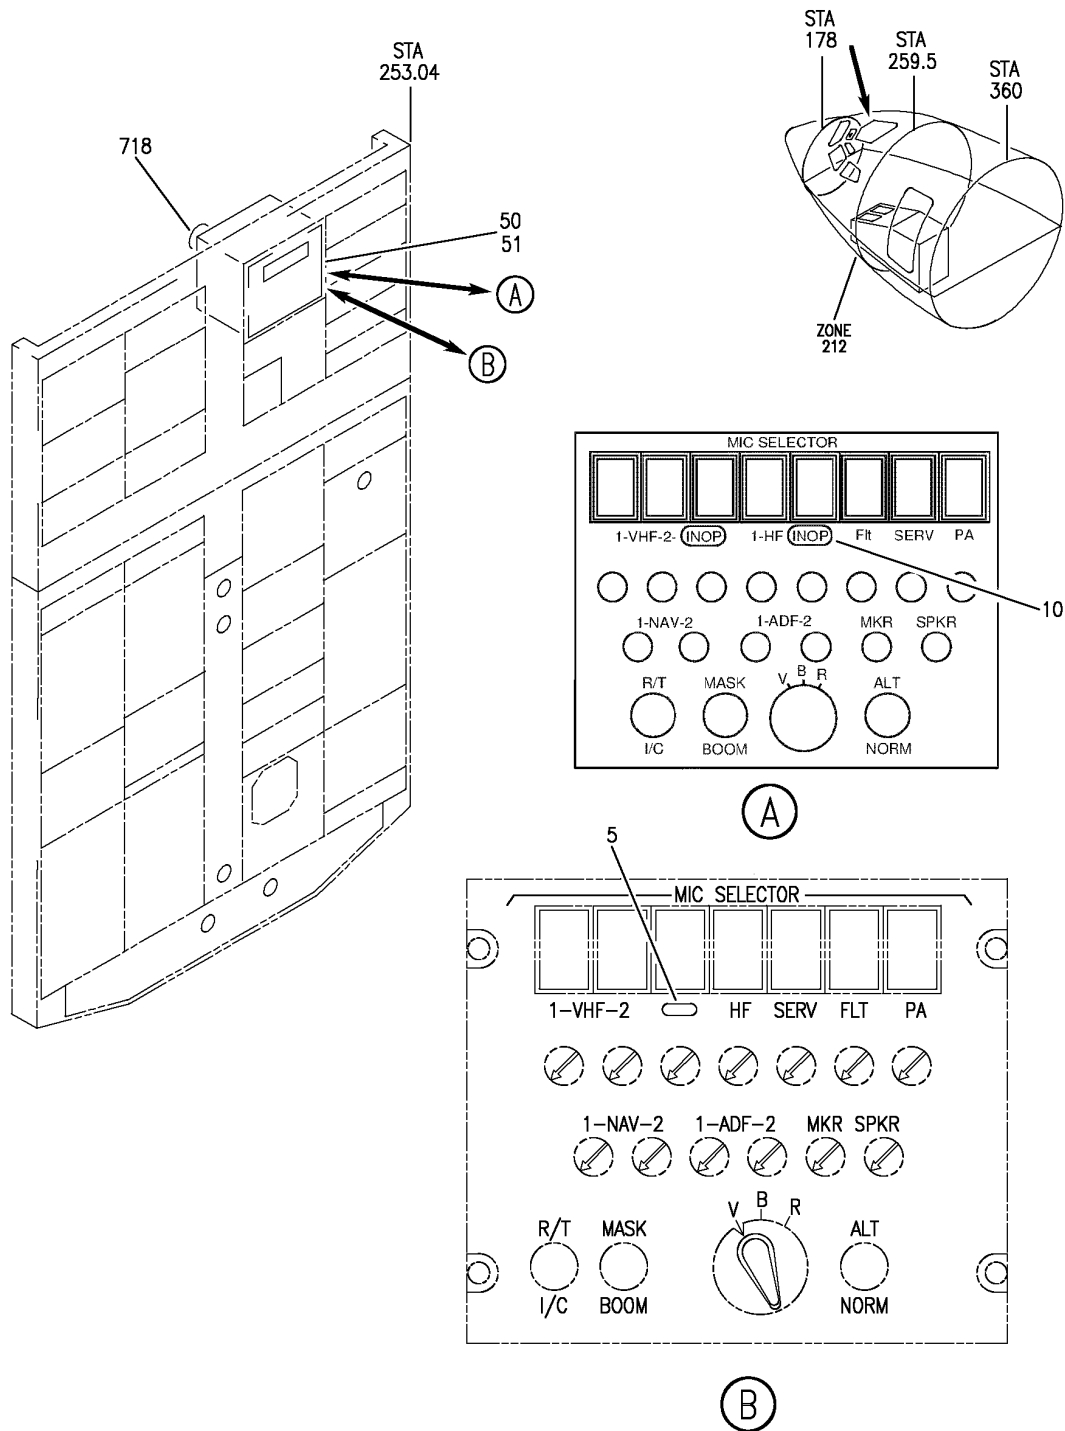

MODULE INSTL-P5-15 OVHD AUDIO SELECTOR PNL (COMMUNICATIONS ONLY)

FIGURE 4

23-51-02-04

R/YR
AUG 15/17

23-51-02-04
PAGE 0

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

E 23510204 REV 253

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
4			MODULE INSTL-P5-15 OVHD AUDIO SELECTOR PNL (COMMUNICATIONS ONLY)	056168 174999	
- 1	MODREF82419		MODULE INSTL-P5-15 OVHD AUDIO SELECTOR PNL (COMMUNICATIONS ONLY) MODULE NUMBER: 233A3104-235064 REV A FOR OTHER SYS DETAILS SEE: 31-11-95-07M 33-11-52-04	056110	RF
- 2	MODREF309553		MODULE INSTL-P5-15 OVHD AUDIO SELECTOR PNL (COMMUNICATIONS ONLY) MODULE NUMBER: 233A3104-235082 REV A FOR OTHER SYS DETAILS SEE: 31-11-95-05D 31-11-95-07M 33-11-52-04 33-11-52-08D	111168 174376	RF
- 2	MODREF664265		MODULE INSTL-P5-15 OVHD AUDIO SELECTOR PNL (COMMUNICATIONS ONLY) MODULE NUMBER: 233A3104-235088 REV B FOR OTHER SYS DETAILS SEE: 31-11-95-05D 33-11-52-08D	377999	RF
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

- ITEM NOT ILLUSTRATED

RYR

23-51-02-04

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

23-51-02
 FIG. 04
 PAGE 1
 JUN 15/23

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
4					
50	5145-1-64		.PANEL ASSY-OBSERVER CONT SUPPLIER CODE: V30242 FUNCTIONAL DESCRIPTION: ALLOWS THE FLIGHT CREW TO SELECT THE AUDIO SYSTEM (VHF,HF,ETC.) FOR TRANSMISSION AND RECEPTION SPECIFICATION NUMBER: 10-62090-64 MISCELLANEOUS DATA: PORTABLE ELECTRONIC DEVICE (PED) TOLERANT PER GUIDELINES IN DRAWING 222A4006 ELECTRICAL EQUIP NUMBER: P00515 COMPONENT MAINT MANUAL REF: 23-51-23 MAINTENANCE MANUAL REF: 23-51-02 FUNCTIONAL REFERENCE: COMMUNICATIONS FOR DETAILS SEE 23-51-02-50B PLACARDS AND MARKINGS FOR DETAILS SEE 11-32-02-33V	056110	1
50	5145-1-82		.PANEL ASSY-OBSERVER CONT SUPPLIER CODE: V30242 FUNCTIONAL DESCRIPTION: ALLOWS THE FLIGHT CREW TO SELECT THE AUDIO SYSTEM (VHF,HF,ETC...) FOR TRANSMISSION AND RECEPTION SPECIFICATION NUMBER: 10-62090-82 ELECTRICAL EQUIP NUMBER: P00515 COMPONENT MAINT MANUAL REF: 23-51-02 MAINTENANCE MANUAL REF: 23-51-02	111168 174369 373527	1
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

— ITEM NOT ILLUSTRATED

RYR

23-51-02-04

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

23-51-02
 FIG. 04
 PAGE 2
 JUN 15/23

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
4 50	5145-1-77		.PANEL ASSY-OBSERVER CONT SUPPLIER CODE: V30242 FUNCTIONAL DESCRIPTION: ALLOWS THE FLIGHT CREW TO SELECT THE AUDIO SYSTEM (VHF,HF,ETC.) FOR TRANSMISSION AND RECEPTION SPECIFICATION NUMBER: 10-62090-77 MISCELLANEOUS DATA: PORTABLE ELECTRONIC DEVICE (PED) TOLERANT PER GUIDELINES IN DRAWING 222A4006 ELECTRICAL EQUIP NUMBER: P00515 COMPONENT MAINT MANUAL REF: 23-50-74 MAINTENANCE MANUAL REF: 23-51-02	111168 174188 373378	1
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

— ITEM NOT ILLUSTRATED

R Y R

23-51-02-04

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

23-51-02
 FIG. 04
 PAGE 3
 JUN 15/23

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
4 50	5145-1-86		.PANEL ASSY-OBSERVER CONT SUPPLIER CODE: V30242 FUNCTIONAL DESCRIPTION: ALLOWS THE FLIGHT CREW TO SELECT THE AUDIO SYSTEM (VHF,HF,ETC...)) FOR TRANSMISSION AND RECEPTION SPECIFICATION NUMBER: 10-62090-86 MISCELLANEOUS DATA: PORTABLE ELECTRONIC DEVICE (PED) TOLERANT PER GUIDELINES IN DRAWING 222A4006 ELECTRICAL EQUIP NUMBER: P00515 COMPONENT MAINT MANUAL REF: 23-44-01 MAINTENANCE MANUAL REF: 23-51-02 FUNCTIONAL REFERENCE: COMMUNICATIONS FOR DETAILS SEE 23-51-02-50 PLACARDS AND MARKINGS FOR DETAILS SEE 11-32-02-33T	111168 174188 373378	1
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

— ITEM NOT ILLUSTRATED

R Y R

23-51-02-04

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

23-51-02
 FIG. 04
 PAGE 4
 JUN 15/23

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
4 50	5145-1-64		.PANEL ASSY-OBSERVER CONT SUPPLIER CODE: V30242 FUNCTIONAL DESCRIPTION: ALLOWS THE FLIGHT CREW TO SELECT THE AUDIO SYSTEM (VHF,HF,ETC.) FOR TRANSMISSION AND RECEPTION SPECIFICATION NUMBER: 10-62090-64 MISCELLANEOUS DATA: PORTABLE ELECTRONIC DEVICE (PED) TOLERANT PER GUIDELINES IN DRAWING 222A4006 ELECTRICAL EQUIP NUMBER: P00515 COMPONENT MAINT MANUAL REF: 23-51-23 MAINTENANCE MANUAL REF: 23-51-02 FUNCTIONAL REFERENCE: COMMUNICATIONS FOR DETAILS SEE 23-51-02-50B PLACARDS AND MARKINGS FOR DETAILS SEE 11-32-02-33V	111168 174369 373527	1
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

— ITEM NOT ILLUSTRATED

R Y R

23-51-02-04

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

23-51-02
 FIG. 04
 PAGE 5
 JUN 15/23

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
4					
50	5145-1-88		.PANEL ASSY-OBSERVER CONT SUPPLIER CODE: V30242 FUNCTIONAL DESCRIPTION: ALLOWS THE FLIGHT CREW TO SELECT THE AUDIO SYSTEM (VHF,HF,ETC...) FOR TRANSMISSION AND RECEPTION SPECIFICATION NUMBER: 10-62090-88 MISCELLANEOUS DATA: PORTABLE ELECTRONIC DEVICE (PED) TOLERANT PER GUIDELINES IN DRAWING 222A4006 ELECTRICAL EQUIP NUMBER: P00515 COMPONENT MAINT MANUAL REF: 23-44-02 MAINTENANCE MANUAL REF: 23-51-02 FUNCTIONAL REFERENCE: COMMUNICATIONS FOR DETAILS SEE 23-51-02-08E PLACARDS AND MARKINGS FOR DETAILS SEE 11-31-01-50	111168 174369 377999	1
50	5145-1-82		.PANEL ASSY-OBSERVER CONT SUPPLIER CODE: V30242 FUNCTIONAL DESCRIPTION: ALLOWS THE FLIGHT CREW TO SELECT THE AUDIO SYSTEM (VHF,HF,ETC...) FOR TRANSMISSION AND RECEPTION SPECIFICATION NUMBER: 10-62090-82 ELECTRICAL EQUIP NUMBER: P00515 COMPONENT MAINT MANUAL REF: 23-51-02 MAINTENANCE MANUAL REF: 23-51-02	056110 370372	1
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

— ITEM NOT ILLUSTRATED

RYR

23-51-02-04

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

23-51-02
 FIG. 04
 PAGE 6
 AUG 15/23

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
4 51	5145-1-88		.PANEL ASSY-OBSERVER CONT SUPPLIER CODE: V30242 FUNCTIONAL DESCRIPTION: ALLOWS THE FLIGHT CREW TO SELECT THE AUDIO SYSTEM (VHF,HF,ETC...)) FOR TRANSMISSION AND RECEPTION SPECIFICATION NUMBER: 10-62090-88 MISCELLANEOUS DATA: PORTABLE ELECTRONIC DEVICE (PED) TOLERANT PER GUIDELINES IN DRAWING 222A4006 ELECTRICAL EQUIP NUMBER: P00515 COMPONENT MAINT MANUAL REF: 23-44-02 MAINTENANCE MANUAL REF: 23-51-02 FUNCTIONAL REFERENCE: COMMUNICATIONS FOR DETAILS SEE 23-51-02-08E PLACARDS AND MARKINGS FOR DETAILS SEE 11-31-01-50	056110 370372	1
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

— ITEM NOT ILLUSTRATED


R Y R

23-51-02-04

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

23-51-02
 FIG. 04
 PAGE 7
 AUG 15/23

BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

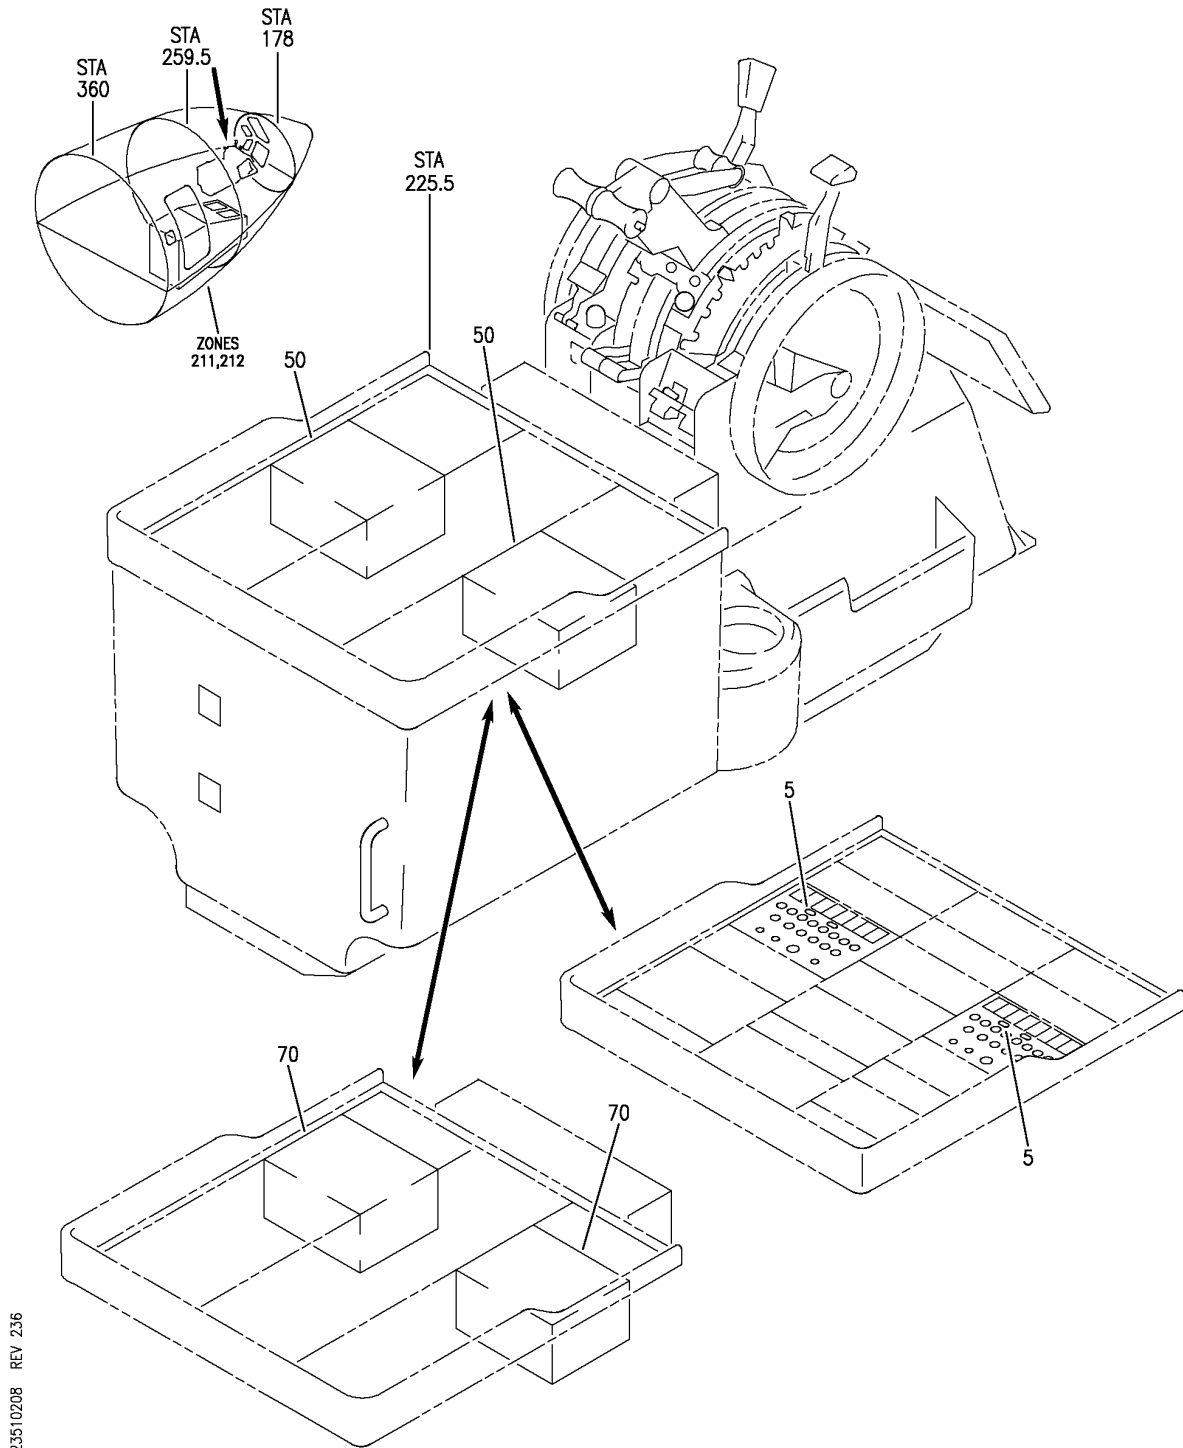

E 23510208 REV 236

MODULE INSTL-P8 AISLE STAND (COMMUNICATIONS ONLY)
FIGURE 8

23-51-02-08

R Y R
APR 15/16

23-51-02-08
PAGE 0

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
8					
- 1	MODREF214189		MODULE INSTL-P8 AISLE STAND (COMMUNICATIONS ONLY) MODULE INSTL-P8 AISLE STAND AUDIO SELECTOR (COMMUNICATIONS ONLY) MODULE NUMBER: 233A6104-235064 REV A FOR OTHER SYS DETAILS SEE: 31-11-91-79H 33-11-50-02F	056062	RF
- 1	MODREF233536		MODULE INSTL-P8 AISLE STAND AUDIO SELECTOR (COMMUNICATIONS ONLY) MODULE NUMBER: 233A6104-235064 REV B FOR OTHER SYS DETAILS SEE: 31-11-91-79H 33-11-50-02F	063110	RF
- 1	MODREF309559		MODULE INSTL-P8 AISLE STAND AUDIO SELECTOR (COMMUNICATIONS ONLY) MODULE NUMBER: 233A6104-235082 REV A FOR OTHER SYS DETAILS SEE: 31-11-91-79H 31-11-91-85Z 31-11-91-88F 33-11-50-02K	111353	RF
- 1	MODREF645663		MODULE INSTL-P8 AISLE STAND AUDIO SELECTOR (COMMUNICATIONS ONLY) MODULE NUMBER: 233A6104-235082 REV B FOR OTHER SYS DETAILS SEE: 31-11-91-88F 33-11-50-02K	354376	RF
- 2	MODREF662054		MODULE INSTL-P8 AISLE STAND AUDIO SELECTOR (COMMUNICATIONS ONLY) MODULE NUMBER: 233A6104-235088 REV A FOR OTHER SYS DETAILS SEE: 31-11-91-88F 33-11-50-02K	377530	RF
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

- ITEM NOT ILLUSTRATED

RYR

23-51-02-08

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

23-51-02
 FIG. 08
 PAGE 1
 JUN 15/23

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
8 - 2	MODREF791932		MODULE INSTL-P8 AISLE STAND AUDIO SELECTOR (COMMUNICATIONS ONLY) MODULE NUMBER: 233A6104-235188 REV A FOR OTHER SYS DETAILS SEE: 31-11-91-88F 33-11-50-02K	531999	RF
50	5145-1-64		. PANEL ASSY-CAPT AND FIRST OFFICER CONT SUPPLIER CODE: V30242 FUNCTIONAL DESCRIPTION: ALLOWS THE FLIGHT CREW TO SELECT THE AUDIO SYSTEM (VHF,HF,ETC.) FOR TRANSMISSION AND RECEPTION SPECIFICATION NUMBER: 10-62090-64 MISCELLANEOUS DATA: PORTABLE ELECTRONIC DEVICE (PED) TOLERANT PER GUIDELINES IN DRAWING 222A4006 ELECTRICAL EQUIP NUMBER: P00806 P00807 COMPONENT MAINT MANUAL REF: 23-51-23 MAINTENANCE MANUAL REF: 23-51-02 FUNCTIONAL REFERENCE: COMMUNICATIONS FOR DETAILS SEE 23-51-02-50B PLACARDS AND MARKINGS FOR DETAILS SEE 11-32-02-33V		2
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

- ITEM NOT ILLUSTRATED

RYR

23-51-02-08

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

23-51-02
 FIG. 08
 PAGE 2
 JUN 15/23

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
8 50	5145-1-82		.PANEL ASSY-CAPT AND FIRST OFFICER CONT SUPPLIER CODE: V30242 FUNCTIONAL DESCRIPTION: ALLOWS THE FLIGHT CREW TO SELECT THE AUDIO SYSTEM (VHF,HF,ETC,...) FOR TRANSMISSION AND RECEPTION SPECIFICATION NUMBER: 10-62090-82 ELECTRICAL EQUIP NUMBER: P00806 P00807 COMPONENT MAINT MANUAL REF: 23-51-02 MAINTENANCE MANUAL REF: 23-51-02		2
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

— ITEM NOT ILLUSTRATED

R Y R

23-51-02-08

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

23-51-02
 FIG. 08
 PAGE 3
 AUG 15/23

BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
8					
50	5145-1-88		.PANEL ASSY-CAPT AND FIRST OFFICER CONT SUPPLIER CODE: V30242 FUNCTIONAL DESCRIPTION: ALLOWS THE FLIGHT CREW TO SELECT THE AUDIO SYSTEM (VHF,HF,ETC...) FOR TRANSMISSION AND RECEPTION SPECIFICATION NUMBER: 10-62090-88 MISCELLANEOUS DATA: PORTABLE ELECTRONIC DEVICE (PED) TOLERANT PER GUIDELINES IN DRAWING 222A4006 ELECTRICAL EQUIP NUMBER: P00806 P00807 COMPONENT MAINT MANUAL REF: 23-44-02 MAINTENANCE MANUAL REF: 23-51-02 FUNCTIONAL REFERENCE: COMMUNICATIONS FOR DETAILS SEE 23-51-02-08E PLACARDS AND MARKINGS FOR DETAILS SEE 11-31-01-50		2
50	5145-1-101		.PANEL ASSY-CAPT AND FIRST OFFICER CONT SUPPLIER CODE: V30242 ELECTRICAL EQUIP NUMBER: P00806 P00807 COMPONENT MAINT MANUAL REF: 23-44-03 MAINTENANCE MANUAL REF: 23-51-02 FUNCTIONAL REFERENCE: COMMUNICATIONS FOR DETAILS SEE 23-51-02-50C PLACARDS AND MARKINGS FOR DETAILS SEE 11-31-01-50A	377530	2
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

— ITEM NOT ILLUSTRATED


RYR

23-51-02-08

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

23-51-02
 FIG. 08
 PAGE 4
 AUG 15/23

BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

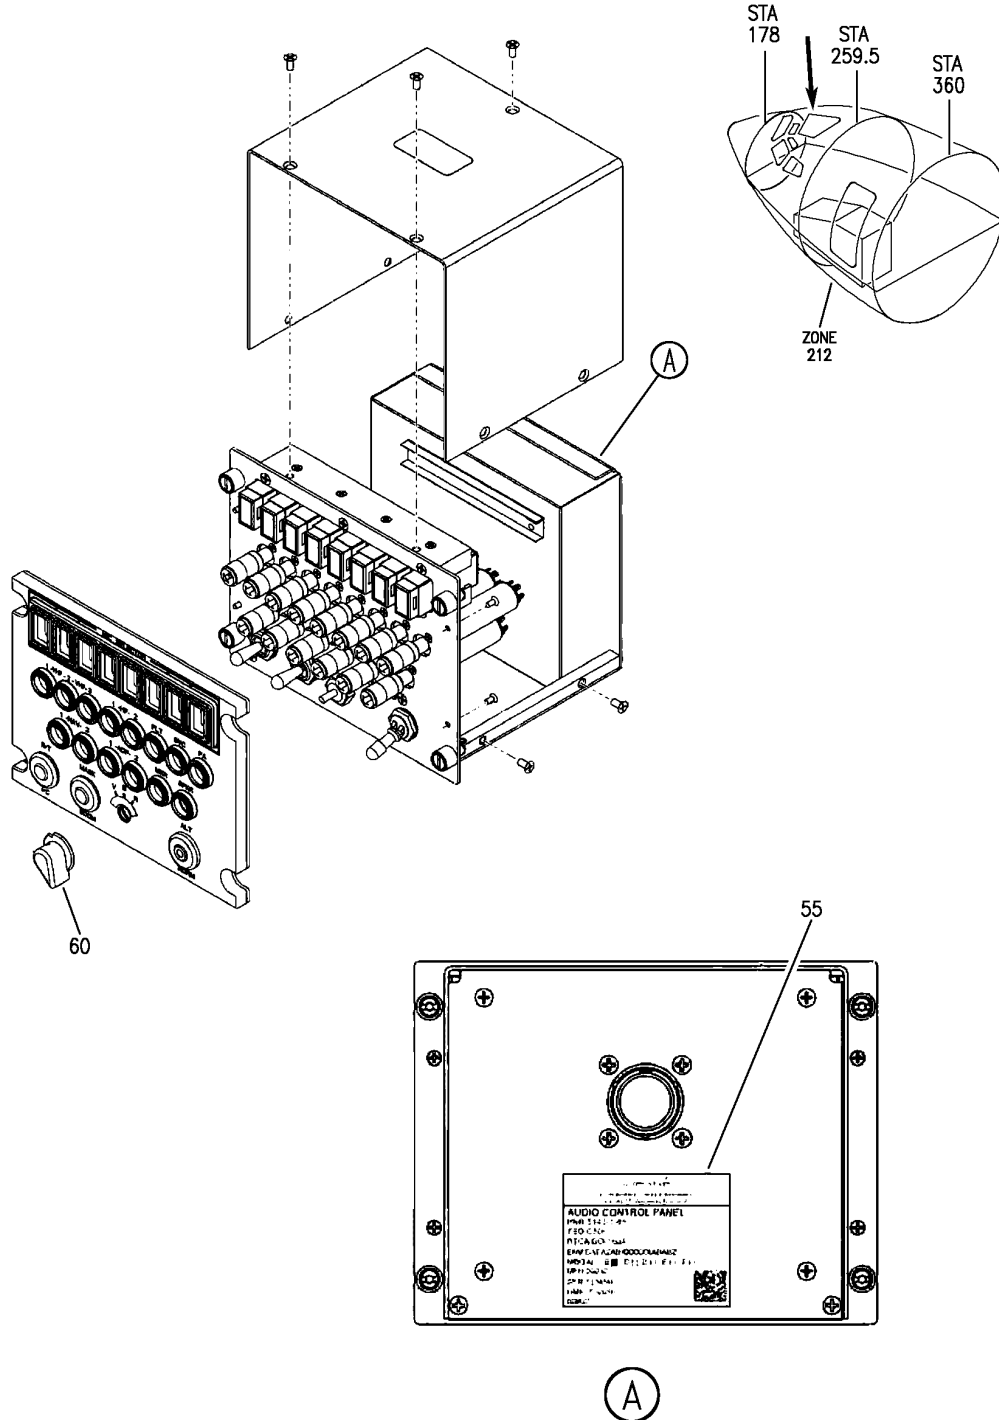

E 23510208E REV 325

PANEL ASSY-AUDIO SELECTOR CONT
FIGURE 8E

23-51-02-08E

R/YR
AUG 15/23

23-51-02-08E
PAGE 0

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
8E					
- 1	5145-1-88		PANEL ASSY-AUDIO SELECTOR CONT PANEL ASSY-AUDIO SELECTOR CONT SUPPLIER CODE: V30242 FUNCTIONAL DESCRIPTION: ALLOWS THE FLIGHT CREW TO SELECT THE AUDIO SYSTEM (VHF,HF,ETC...) FOR TRANSMISSION AND RECEPTION SPECIFICATION NUMBER: 10-62090-88 MISCELLANEOUS DATA: PORTABLE ELECTRONIC DEVICE (PED) TOLERANT PER GUIDELINES IN DRAWING 222A4006 COMPONENT MAINT MANUAL REF: 23-44-02 FOR NHA/OTHER SYS DET SEE: 23-51-02-04 23-51-02-08		RF
- 50	250-22774		.LABEL-POLY, THERM SUPPLIER CODE: V51074 CONFIG CHG DATA FROM A CMM: SUPSD BY LAB5145-1-88 MISCELLANEOUS DATA: NON PROCURABLE		RF
55	LAB5145-1-88		ORDER LAB5145-1-88 .LABEL-NAMEPLATE, SERIAL NO. SUPPLIER CODE: V30242 CONFIG CHG DATA FROM A CMM: SUPERSEDES 250-22774		1
60	SCD240-15-1		.KNOB-GRAY, PLASTIC SUPPLIER CODE: V30242		1
60	BP394M03		.KNOB-GRAY SUPPLIER CODE: V15084 TRUE PART NUMBER: BP394-M03		1
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

- ITEM NOT ILLUSTRATED


RYR

23-51-02-08E

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

23-51-02
 FIG. 08E
 PAGE 1
 AUG 15/23

BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

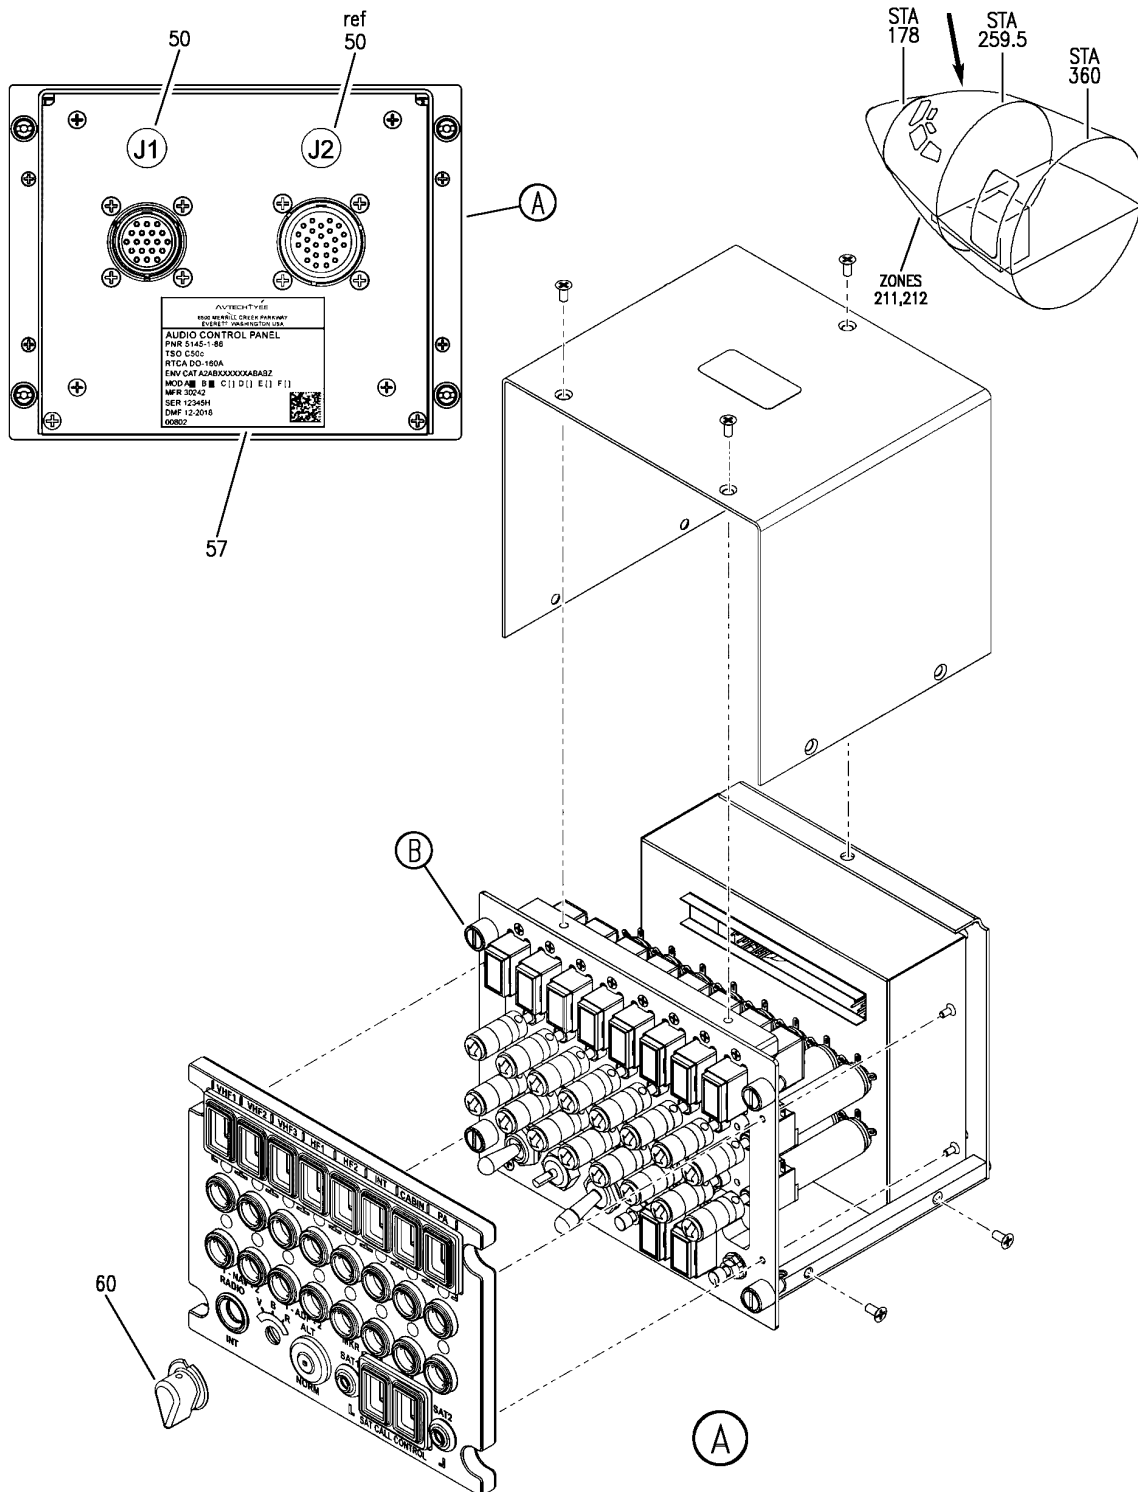

E 23510250 SHT 1 REV 323

PANEL ASSY-AUDIO CONT (COMMUNICATIONS ONLY)
FIGURE 50 (SHEET 1)


23-51-02-50

RJR
JUN 15/23

23-51-02-50
PAGE 0

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

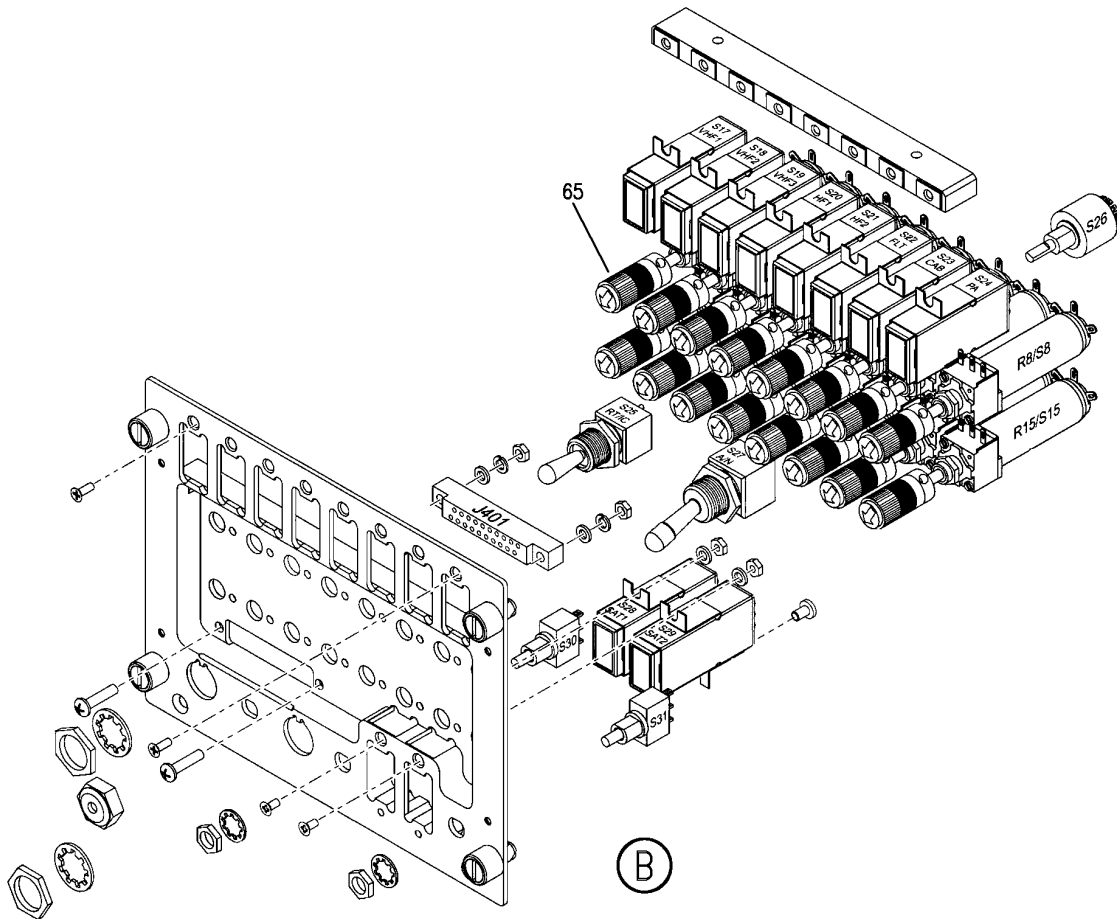

E 23510250 SHT 2 REV 283

PANEL ASSY-AUDIO CONT (COMMUNICATIONS ONLY)
FIGURE 50 (SHEET 2)

23-51-02-50

R Y R
F E B 15 / 20

23-51-02-50
PAGE 0A

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

BOEING
 737-600/700/800/900
 PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
50			PANEL ASSY-AUDIO CONT (COMMUNICATIONS ONLY)	111168 174188 373378	
- 5	5145-1-86		PANEL ASSY-AUDIO CONT (COMMUNICATIONS ONLY) SUPPLIER CODE: V30242 FUNCTIONAL DESCRIPTION: ALLOWS THE FLIGHT CREW TO SELECT THE AUDIO SYSTEM (VHF,HF,ETC...) FOR TRANSMISSION AND RECEPTION SPECIFICATION NUMBER: 10-62090-86 MISCELLANEOUS DATA: PORTABLE ELECTRONIC DEVICE (PED) TOLERANT PER GUIDELINES IN DRAWING 222A4006 ELECTRICAL EQUIP NUMBER: P00515 P00806 P00807 COMPONENT MAINT MANUAL REF: 23-44-01 FOR NHA/OTHER SYS DET SEE: 23-51-02-04	111168 174188 373378	RF
50	7777-10		.LABEL-KIT SUPPLIER CODE: V30242	111168 174188 373378	1
- 55	LAB5145-1-86		.LABEL- SUPPLIER CODE: V30242 CONFIG CHG DATA FROM A CMM: SUPSD BY 000246	111168 174188 373378	1
57	000246		.LABEL-NAMEPLATE SUPPLIER CODE: V30242 CONFIG CHG DATA FROM A CMM: SUPSRDES LAB5145-1-86	111168 174188 373378	1
60	SCD240-15-1		.KNOB-GRAY, PLASTIC SUPPLIER CODE: V30242	111168 174188 373378	1
60	BP394M03		.KNOB-GRAY, PLASTIC SUPPLIER CODE: V15084 TRUE PART NUMBER: BP394-M03	111168 174188 373378	1
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

- ITEM NOT ILLUSTRATED

RYR

23-51-02-50

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

23-51-02
 FIG. 50
 PAGE 1
 JUN 15/23

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
50					
65	SCD240-7-2		.KNOB-ILLUM ARROW SUPPLIER CODE: V30242 MISCELLANEOUS DATA: BLACK37038, 0.128" ID, KNURLED ATTACHING PARTS	111168 174188 373378	16
- 70	SCD280-64-15		.SETSCREW- SUPPLIER CODE: V30242 MISCELLANEOUS DATA: 4-40 X 1/8, WITH THREADLOCK -----*-----	111168 174188 373378	32
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

— ITEM NOT ILLUSTRATED


R Y R

23-51-02-50

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

23-51-02
 FIG. 50
 PAGE 2
 OCT 15/20

BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

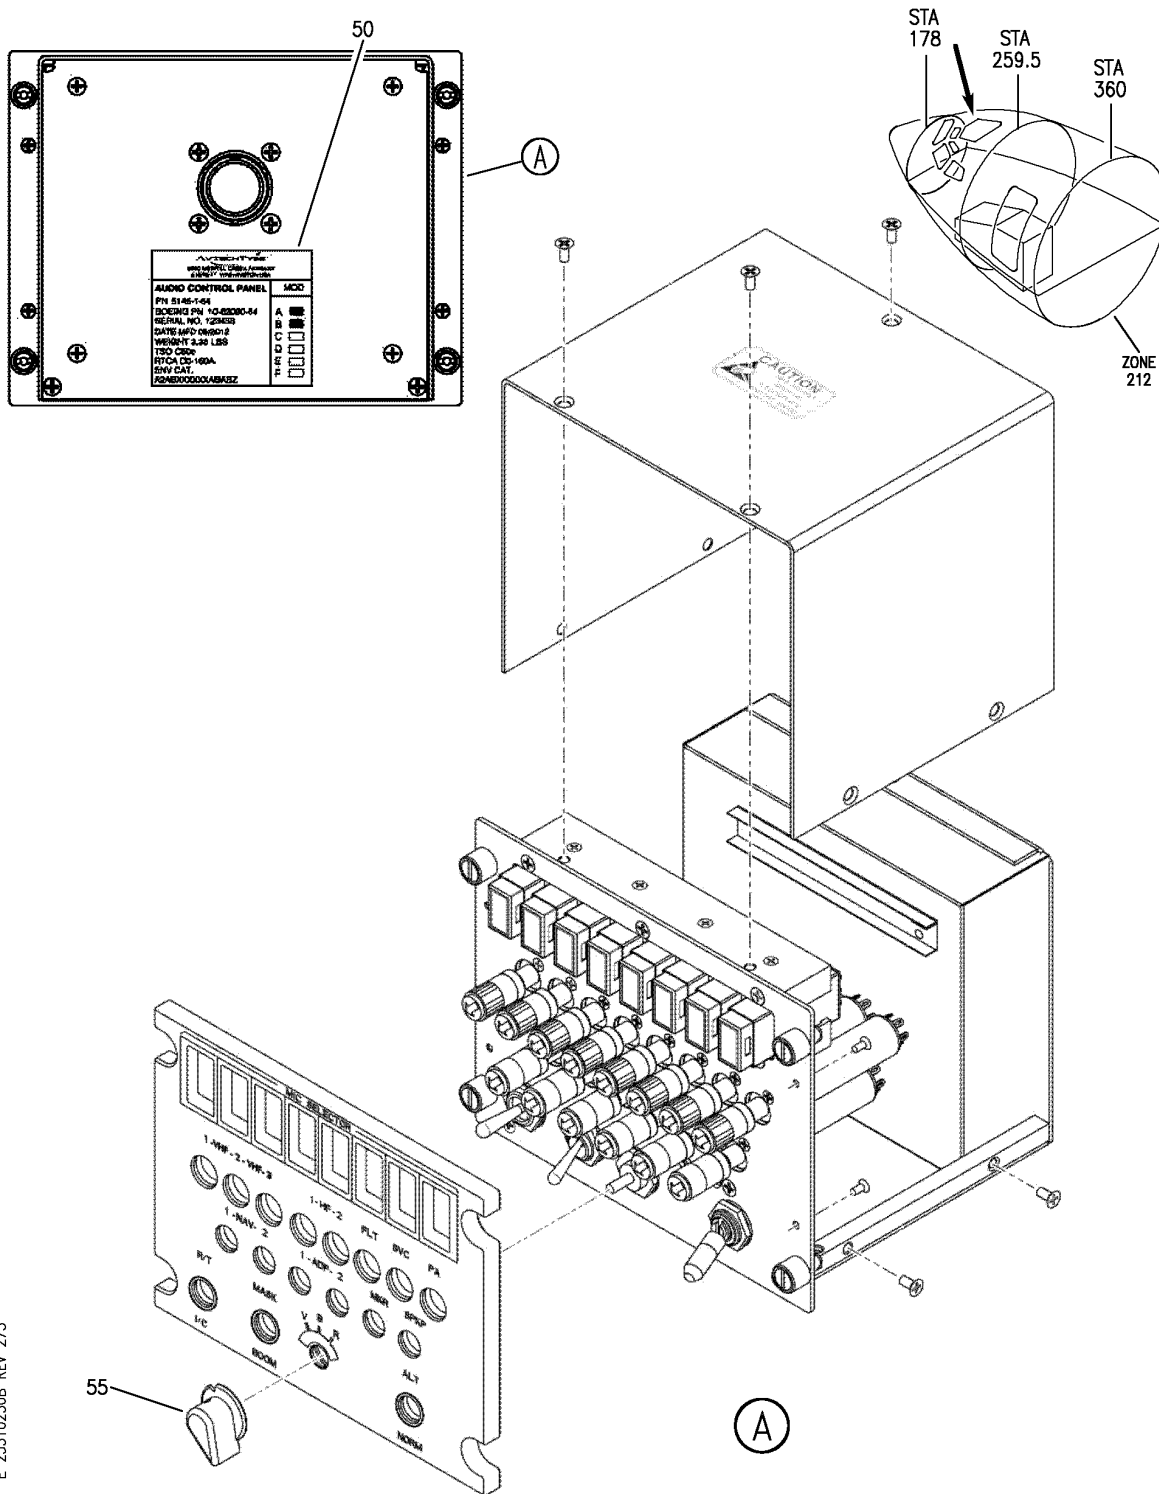

E 23510250B REV 273

PANEL ASSY-AUDIO CONT (COMMUNICATIONS ONLY)
FIGURE 50B

23-51-02-50B

R/YR
APR 15/19

23-51-02-50B
PAGE 0

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
50B					
- 1	5145-1-64		PANEL ASSY-AUDIO CONT (COMMUNICATIONS ONLY) PANEL ASSY-AUDIO CONT (COMMUNICATIONS ONLY) MOD A SUPPLIER CODE: V30242 FUNCTIONAL DESCRIPTION: ALLOWS THE FLIGHT CREW TO SELECT THE AUDIO SYSTEM (VHF, HF, ETC.) FOR TRANSMISSION AND RECEPTION SPECIFICATION NUMBER: 10-62090-64 SB DATA FROM A CMM: POST SB 5145-23-907 POST SB 5145-23-931 MISCELLANEOUS DATA: PORTABLE ELECTRONIC DEVICE (PED) TOLERANT PER GUIDELINES IN DRAWING 222A4006 COMPONENT MAINT MANUAL REF: 23-51-23 FOR NHA/OTHER SYS DET SEE: 23-51-02-04 23-51-02-08	056530 056530	RF
50	LAB5145-1		. LABEL-NAMEPLATE SUPPLIER CODE: V30242	056530	1
55	SCD240-15-1		. KNOB-GRAY, PLASTIC SUPPLIER CODE: V30242	056530	1
55	BP394M03		. KNOB-GRAY SUPPLIER CODE: V15084 TRUE PART NUMBER: BP394-M03	056530	1
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

- ITEM NOT ILLUSTRATED


RYR

23-51-02-50B

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

23-51-02
 FIG. 50B
 PAGE 1
 JUN 15/23

BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

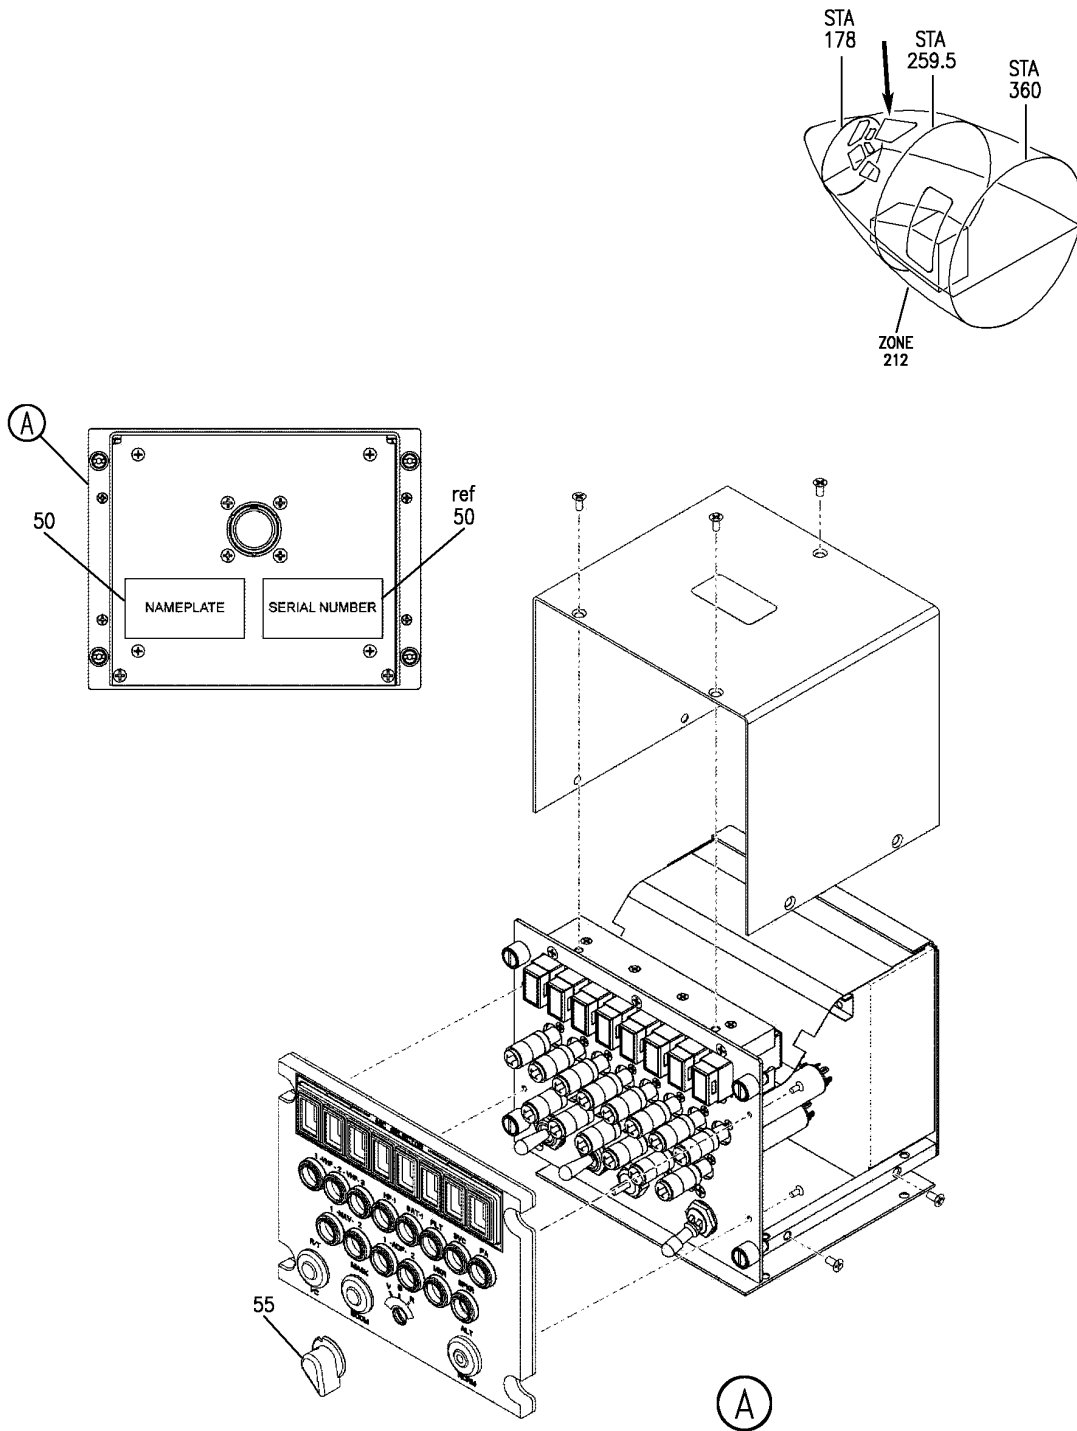

E 23510250C REV 283

PANEL ASSY-AUDIO CONT (COMMUNICATIONS ONLY)
FIGURE 50C

23-51-02-50C

R Y R
F E B 15 / 20

23-51-02-50C
PAGE 0

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
50C					
- 1	5145-1-101		PANEL ASSY-AUDIO CONT (COMMUNICATIONS ONLY) PANEL ASSY-AUDIO CONT (COMMUNICATIONS ONLY) SUPPLIER CODE: V30242 COMPONENT MAINT MANUAL REF: 23-44-03 FOR NHA/OTHER SYS DET SEE: 23-51-02-08	377530 377530	RF
50	LAB5145-1-101		.NAMEPLATE-NAMEPLATE, SERIAL NUMBER SUPPLIER CODE: V30242	377530	1
55	SCD240-15-1		.KNOB-GRAY, PLASTIC SUPPLIER CODE: V30242	377530	1
55	BP394M03		.KNOB-GRAY, PLASTIC SUPPLIER CODE: V15084 TRUE PART NUMBER: BP394-M03	377530	1
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

— ITEM NOT ILLUSTRATED




RYR

23-51-02-50C

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

23-51-02
 FIG. 50C
 PAGE 1
 OCT 15/22

BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

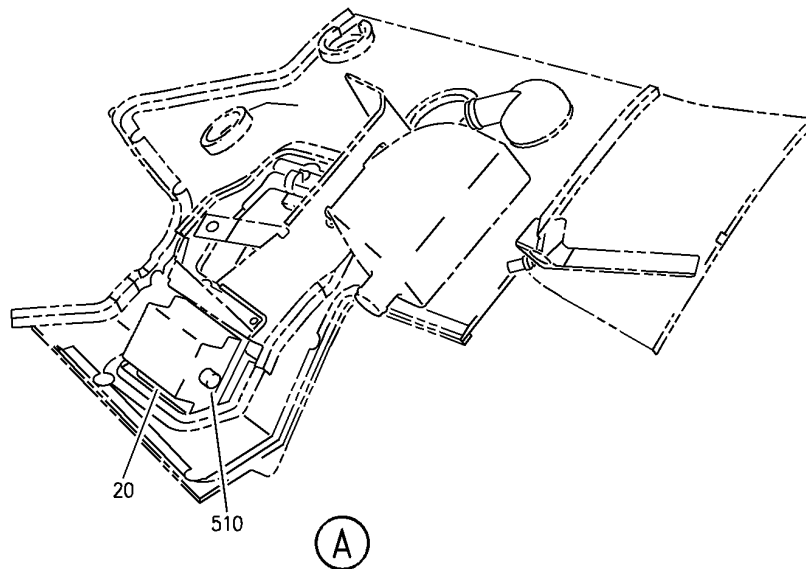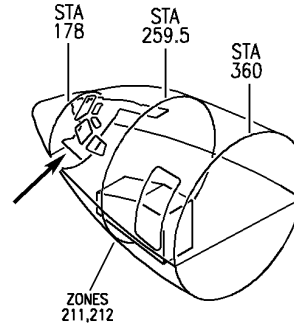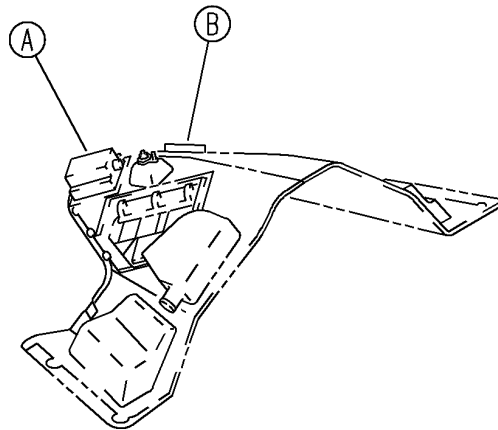

E 23510302 SHT 1 REV 123

LINING ASSY-FWD CLG (COMMUNICATIONS ONLY)
FIGURE 2 (SHEET 1)


23-51-03-02

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

RYP
FEB 10/07

23-51-03-02
PAGE 0

BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

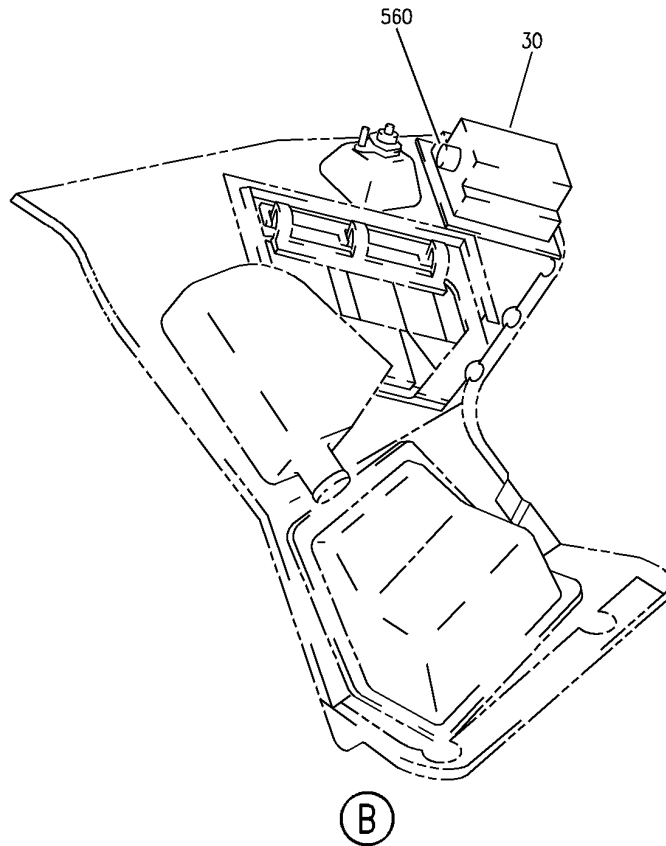

E 23510302 SHT 2 REV 123

LINING ASSY-FWD CLG (COMMUNICATIONS ONLY)
FIGURE 2 (SHEET 2)

23-51-03-02

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

R Y R
F E B 10 / 07

23-51-03-02
PAGE 0A

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
2					
- 1	232A1401-41		LINING ASSY-FWD CLG (COMMUNICATIONS ONLY) LINING ASSY-CLG (COMMUNICATIONS ONLY) POSITION DATA: L FWD FOR NHA/OTHER SYS DET SEE: 25-11-21-04	056168 174999 056071	RF
- 1	232A1401-60		LINING ASSY-CLG (COMMUNICATIONS ONLY) POSITION DATA: L FWD FOR NHA/OTHER SYS DET SEE: 25-11-21-04	072094	RF
- 1	232A1401-62		LINING ASSY-CLG (COMMUNICATIONS ONLY) POSITION DATA: L FWD FOR NHA/OTHER SYS DET SEE: 25-11-21-04	072168 174314	RF
- 1	232A1401-69		LINING ASSY-CLG (COMMUNICATIONS ONLY) POSITION DATA: L FWD FOR NHA/OTHER SYS DET SEE: 25-11-21-04	315508	RF
- 1	232A1401-97		LINING ASSY-CLG (COMMUNICATIONS ONLY) POSITION DATA: L FWD FOR NHA/OTHER SYS DET SEE: 25-11-21-04	509999	RF
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

- ITEM NOT ILLUSTRATED

RYR

23-51-03-02

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

23-51-03
 FIG. 02
 PAGE 1
 JUN 15/23

BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
2 - 5	232A1401-49		LINING ASSY-CLG (COMMUNICATIONS ONLY) POSITION DATA: R FWD QUALIFIED I/W DATA: 232A1401-92 CAN REPLACE BUT NOT BE REPLACED BY 232A1401-49 IN ACCORDANCE WITH SERVICE BULLETIN 737-21-1178 MODIFICATIONS. 232A1401-70 CAN REPLACE BUT NOT BE REPLACED BY 232A1401-49 IN ACCORDANCE WITH SERVICE BULLETIN 737-21-1178 MODIFICATIONS 232A1401-49 CAN REPLACE BUT NOT BE REPLACED BY 232A1401-30 IN ACCORDANCE WITH SERVICE BULLETIN 737-25-1440 MODIFICATIONS. FOR NHA/OTHER SYS DET SEE: 25-11-21-03	056071	RF
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

- ITEM NOT ILLUSTRATED

RYR

23-51-03-02

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

23-51-03
 FIG. 02
 PAGE 2
 JUN 15/23

BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
2 - 5	232A1401-61		LINING ASSY-CLG (COMMUNICATIONS ONLY) POSITION DATA: R FWD QUALIFIED I/W DATA: 232A1401-92 CAN REPLACE BUT NOT BE REPLACED BY 232A1401-61 IN ACCORDANCE WITH SERVICE BULLETIN 737-21-1178 MODIFICATIONS. 232A1401-70 CAN REPLACE BUT NOT BE REPLACED BY 232A1401-61 IN ACCORDANCE WITH SERVICE BULLETIN 737-21-1178 MODIFICATIONS 232A1401-61 CAN REPLACE BUT NOT BE REPLACED BY 232A1401-30 IN ACCORDANCE WITH SERVICE BULLETIN 737-25-1440 MODIFICATIONS. FOR NHA/OTHER SYS DET SEE: 25-11-21-03	056094	RF
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

- ITEM NOT ILLUSTRATED

RYR

23-51-03-02

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

23-51-03
 FIG. 02
 PAGE 3
 JUN 15/23

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
2 - 5	232A1401-63		LINING ASSY-CLG (COMMUNICATIONS ONLY) POSITION DATA: R FWD QUALIFIED I/W DATA: 232A1401-92 CAN REPLACE BUT NOT BE REPLACED BY 232A1401-63 IN ACCORDANCE WITH SERVICE BULLETIN 737-21-1178 MODIFICATIONS. 232A1401-70 CAN REPLACE BUT NOT BE REPLACED BY 232A1401-63 IN ACCORDANCE WITH SERVICE BULLETIN 737-21-1178 MODIFICATIONS TO ACCOMMODATE THE 214A1140-10 PLENUM ASSEMBLY. 232A1401-63 CAN REPLACE BUT NOT BE REPLACED BY 232A1401-30 IN ACCORDANCE WITH SERVICE BULLETIN 737-25-1440 MODIFICATIONS. FOR NHA/OTHER SYS DET SEE: 25-11-21-03	056168 174314	RF
- 5	232A1401-70		LINING ASSY-CLG (COMMUNICATIONS ONLY) POSITION DATA: R FWD QUALIFIED I/W DATA: 232A1401-70 CAN REPLACE BUT NOT BE REPLACED BY 232A1401-63 IN ACCORDANCE WITH SERVICE BULLETIN 737-21-1178 MODIFICATIONS TO ACCOMMODATE THE 214A1140-10 PLENUM ASSEMBLY. 232A1401-70 CAN REPLACE BUT NOT BE REPLACED BY 232A1401-61 IN ACCORDANCE WITH SERVICE	315407	RF
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

- ITEM NOT ILLUSTRATED

RYR

23-51-03-02

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

23-51-03
 FIG. 02
 PAGE 4
 DEC 15/23

BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
2			BULLETIN 737-21-1178 MODIFICATIONS 232A1401-70 CAN REPLACE BUT NOT BE REPLACED BY 232A1401-49 IN ACCORDANCE WITH SERVICE BULLETIN 737-21-1178 MODIFICATIONS 232A1401-70 CAN REPLACE BUT NOT BE REPLACED BY 232A1401-48 IN ACCORDANCE WITH SERVICE BULLETIN 737-21-1178 MODIFICATIONS 232A1401-70 CAN REPLACE BUT NOT BE REPLACED BY 232A1401-40 IN ACCORDANCE WITH SERVICE BULLETIN 737-21-1178 MODIFICATIONS 232A1401-70 CAN REPLACE BUT NOT BE REPLACED BY 232A1401-38 IN ACCORDANCE WITH SERVICE BULLETIN 737-21-1178 MODIFICATIONS 232A1401-70 CAN REPLACE BUT NOT BE REPLACED BY 232A1401-30 IN ACCORDANCE WITH SERVICE BULLETIN 737-21-1178 AND 737-25-1440 MODIFICATIONS		
- 5	232A1401-92		FOR NHA/OTHER SYS DET SEE: 25-11-21-03 LINING ASSY-CLG (COMMUNICATIONS ONLY) POSITION DATA: R FWD QUALIFIED I/W DATA: 232A1401-92 CAN REPLACE BUT NOT BE REPLACED BY 232A1401-63 IN ACCORDANCE WITH SERVICE	315508	RF
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

- ITEM NOT ILLUSTRATED

RYR

23-51-03-02

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

23-51-03
 FIG. 02
 PAGE 5
 DEC 15/23

BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
2			BULLETIN 737-21-1178 MODIFICATIONS. 232A1401-92 CAN REPLACE BUT NOT BE REPLACED BY 232A1401-61 IN ACCORDANCE WITH SERVICE BULLETIN 737-21-1178 MODIFICATIONS. 232A1401-92 CAN REPLACE BUT NOT BE REPLACED BY 232A1401-49 IN ACCORDANCE WITH SERVICE BULLETIN 737-21-1178 MODIFICATIONS. 232A1401-92 CAN REPLACE BUT NOT BE REPLACED BY 232A1401-48 IN ACCORDANCE WITH SERVICE BULLETIN 737-21-1178 MODIFICATIONS. 232A1401-92 CAN REPLACE BUT NOT BE REPLACED BY 232A1401-40 IN ACCORDANCE WITH SERVICE BULLETIN 737-21-1178 MODIFICATIONS. 232A1401-92 CAN REPLACE BUT NOT BE REPLACED BY 232A1401-38 IN ACCORDANCE WITH SERVICE BULLETIN 737-21-1178 MODIFICATIONS. 232A1401-92 CAN REPLACE BUT NOT BE REPLACED BY 232A1401-30 IN ACCORDANCE WITH SERVICE BULLETIN 737-21-1178 AND 737-25-1440 MODIFICATIONS. FOR NHA/OTHER SYS DET SEE: 25-11-21-03		
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

— ITEM NOT ILLUSTRATED

R Y R

23-51-03-02

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

23-51-03
 FIG. 02
 PAGE 6
 DEC 15/23

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
2					
- 5	232A1401-96		LINING ASSY-CLG (COMMUNICATIONS ONLY) POSITION DATA: R FWD FOR NHA/OTHER SYS DET SEE: 25-11-21-03	509999	RF
- 5	232A1401-104		LINING ASSY-CLG (COMMUNICATIONS ONLY) POSITION DATA: R FWD FOR NHA/OTHER SYS DET SEE: 25-11-21-03	509999	RF
- 5	232A1401-114		LINING ASSY-CLG (COMMUNICATIONS ONLY) POSITION DATA: R FWD FOR NHA/OTHER SYS DET SEE: 25-11-21-03	509999	RF
20	5142-1		.SPEAKER- SUPPLIER CODE: V30242 POSITION DATA: L SIDE FWD SPECIFICATION NUMBER: 10-62090-30 ATTACHING PARTS	056168 174999	1
- 25	NAS602-22P		.BOLT STANDARD SUBSTITUTION: BACS12CK08-22	056071	4
- 25	BACS12CK08-22		.SCREW- USED ON: 232A1401-60 232A1401-62 232A1401-69 232A1401-97 -----*-----	072168 174999	4
30	5142-1		.SPEAKER- SUPPLIER CODE: V30242 POSITION DATA: R SIDE FWD SPECIFICATION NUMBER: 10-62090-30 ATTACHING PARTS	056168 174999	1
- 35	NAS603-22P		.SCREW- STANDARD SUBSTITUTION: BACS12CK3-22	056071 095168 174314	4
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

- ITEM NOT ILLUSTRATED

RYR

23-51-03-02

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

23-51-03
 FIG. 02
 PAGE 7
 DEC 15/23

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
2 - 35	BACS12CK3-22		. SCREW- USED ON: 232A1401-49 232A1401-61 232A1401-63 232A1401-70 232A1401-92 232A1401-96 232A1401-104 -----*-----	315999	4
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

- ITEM NOT ILLUSTRATED


R Y R

23-51-03-02

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

23-51-03
 FIG. 02
 PAGE 8
 DEC 15/23

BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

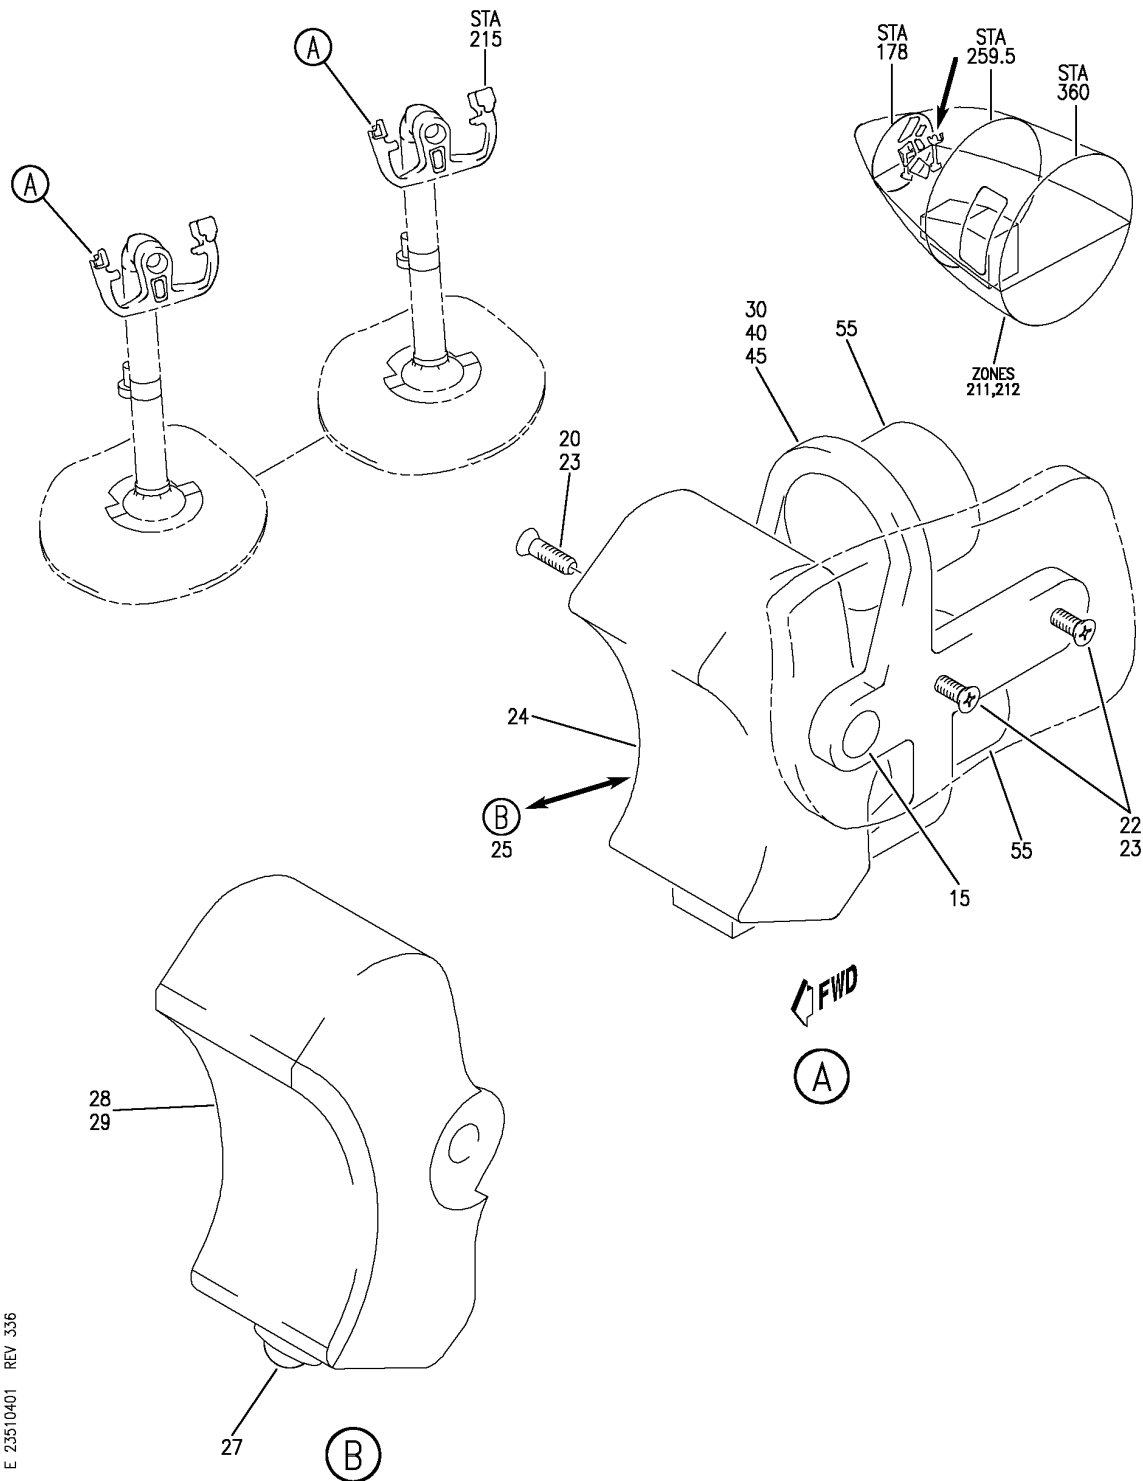

E 23510401 REV 336

WHEEL ASSY-CONT COLUMN (COMMUNICATIONS ONLY)
FIGURE 1

23-51-04-01

R/YR
AUG 15/24

23-51-04-01
PAGE 0

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
1					
- 5	65-45123-75		WHEEL ASSY-CONT COLUMN (COMMUNICATIONS ONLY)	056168 174999	RF
- 5	65-45123-67		WHEEL ASSY-CONT COLUMN (COMMUNICATIONS ONLY) POSITION DATA: CAPT SIDE FOR NHA/OTHER SYS DET SEE: 27-11-41-02	056168 174999	
- 5	65-45123-71		WHEEL ASSY-CONT COLUMN (COMMUNICATIONS ONLY) POSITION DATA: CAPT SIDE QUALIFIED I/W DATA: 65-45123-59 WHICH DOES NOT CONTAIN AN ALTITUDE CLEARANCE REMINDER IS I/W -61 OR -67 OR -71 WHICH CONTAINS AN ALTITUDE CLEARANCE REMINDER ACCORDING TO CUSTOMER PREFERENCE. FOR NHA/OTHER SYS DET SEE: 27-11-41-02	056168 174999	RF
- 5	65-45123-61		WHEEL ASSY-CONT COLUMN (COMMUNICATIONS ONLY) POSITION DATA: CAPT SIDE FOR NHA/OTHER SYS DET SEE: 27-11-41-02	056168 174999	RF
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

- ITEM NOT ILLUSTRATED

RYR

23-51-04-01

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

23-51-04
 FIG. 01
 PAGE 1
 JUN 15/23

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
1					
- 5	65-45123-95		WHEEL ASSY-CONT COLUMN (COMMUNICATIONS ONLY) MISCELLANEOUS DATA: CAPTAINS, FAA MIC/INT SWITCH CONFIGURATION FOR NHA/OTHER SYS DET SEE: 27-11-41-02	056168 174999	RF
- 10	65-45123-68		WHEEL ASSY-CONT COLUMN (COMMUNICATIONS ONLY) POSITION DATA: FIRST OFFICERS SIDE FOR NHA/OTHER SYS DET SEE: 27-11-41-02	056168 174999	RF
- 10	65-45123-72		WHEEL ASSY-CONT COLUMN (COMMUNICATIONS ONLY) POSITION DATA: FIRST OFFICERS SIDE FOR NHA/OTHER SYS DET SEE: 27-11-41-02	056168 174999	RF
- 10	65-45123-76		WHEEL ASSY-CONT COLUMN (COMMUNICATIONS ONLY) POSITION DATA: FIRST OFFICERS SIDE FOR NHA/OTHER SYS DET SEE: 27-11-41-02	056168 174999	RF
- 10	65-45123-62		WHEEL ASSY-CONT COLUMN (COMMUNICATIONS ONLY) POSITION DATA: FIRST OFFICERS SIDE FOR NHA/OTHER SYS DET SEE: 27-11-41-02	056168 174999	RF
- 10	65-45123-96		WHEEL ASSY-CONT COLUMN (COMMUNICATIONS ONLY) POSITION DATA: FIRST OFFICER SIDE MISCELLANEOUS DATA: FIRST OFFICERS, FAA/INT SWITCH CONFIGURATION FOR NHA/OTHER SYS DET SEE: 27-11-41-02	056168 174999	RF
15	251N1283-1		.PIN	056168 174999	1
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

- ITEM NOT ILLUSTRATED

RYR

23-51-04-01

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

23-51-04
 FIG. 01
 PAGE 2
 JUN 15/23

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7 NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
1				
20	NAS514P440-7B	.SCREW- STANDARD SUBSTITUTION: BACS12GX04H7 USED ON: 65-45123-61 65-45123-62 65-45123-67 65-45123-68 65-45123-71 65-45123-72	056168 174999	1
22	NAS514P440-6B	.SCREW- STANDARD SUBSTITUTION: BACS12GX04H6 USED ON: 65-45123-61 65-45123-62 65-45123-67 65-45123-68 65-45123-71 65-45123-72	056168 174999	2
23	BACS12GX04H6	.SCREW- USED ON: 65-45123-75 65-45123-76 65-45123-95 65-45123-96	056168 174999	3
24	251N1241-7	.TRIGGER-SWITCH ACTUATING USED ON: 65-45123-61 65-45123-62 65-45123-67 65-45123-68 65-45123-71 65-45123-72 65-45123-75 65-45123-76 65-45123-95 65-45123-96	056168 174999	1
24	251N1241-6	.TRIGGER ASSY-SWITCH ACTUATING USED ON: 65-45123-61 65-45123-62 65-45123-67 65-45123-68 65-45123-71 65-45123-72 65-45123-75 65-45123-76	523999	1
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE				

— ITEM NOT ILLUSTRATED

R Y R

23-51-04-01

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

23-51-04
 FIG. 01
 PAGE 3
 JUN 15/23

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7 NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
1				
25	251N1241-6	.TRIGGER ASSY-SWITCH ACTUATING USED ON: 65-45123-61 65-45123-62 65-45123-67 65-45123-68 65-45123-71 65-45123-72 65-45123-75 65-45123-76 65-45123-95 65-45123-96	523999	1
25	66-9828-2	.TRIGGER ASSY-SWITCH ACTUATING	523999	1
27	H3-1242-1	..CATCH- SUPPLIER CODE: V34941 SPECIFICATION NUMBER: BACC12C3 OPTIONAL PART: 3066-1 V14608 LS3066 V14608	523999	1
27	3066-1	..CATCH- SUPPLIER CODE: V14608	523999	1
28	251N1241-7	..TRIGGER- USED ON: 251N1241-6	523999	1
29	66-9828-3	..TRIGGER- USED ON: 66-9828-2	523999	1
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE				

— ITEM NOT ILLUSTRATED

R Y R

23-51-04-01

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

23-51-04
 FIG. 01
 PAGE 4
 JUN 15/20

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7 NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
1				
30	69-70179-7	.CLAMP-SWITCH MTG POSITION DATA: CAPT SIDE QUALIFIED I/W DATA: 69-63433-15 CAN REPLACE BUT CANNOT BE REPLACED BY 69-70179-7 WITH SB-737-23-1456 OR 737-23-1400, OR 737-23-1405, OR 737-23-1460, OR 737-23-1437, OR 737-23-1395, OR 737-23-1392, OR 737-23-1383, OR 737-23-1347 INCORPORATION. USED ON: 65-45123-61 65-45123-67 65-45123-71 65-45123-75 65-45123-95	056168 174377 523999	1
- 35	69-70179-8	.CLAMP-SWITCH MTG POSITION DATA: FIRST OFFICER SIDE QUALIFIED I/W DATA: 69-63433-16 CAN REPLACE BUT CANNOT BE REPLACED BY 69-70179-8 WITH SB-737-23-1456 OR 737-23-1400, OR 737-23-1405, OR 737-23-1460, OR 737-23-1437, OR 737-23-1395, OR 737-23-1392, OR 737-23-1383, OR 737-23-1347 INCORPORATION. USED ON: 65-45123-62 65-45123-68 65-45123-72 65-45123-76 65-45123-96	056168 174999	1
40	69-63433-11	.CLAMP-SWITCH POSITION DATA: CAPT SIDE	523999	1
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE				

- ITEM NOT ILLUSTRATED

RYR

23-51-04-01

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

23-51-04
 FIG. 01
 PAGE 5
 JUN 15/23

BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7 NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
1				
40	69-63433-13	.CLAMP-SWITCH POSITION DATA: CAPT SIDE	523999	1
40	69-63433-15	.CLAMP-SWITCH POSITION DATA: CAPT SIDE ALTERED FROM PART NUMBER: 69-63433-17 QUALIFIED I/W DATA: 69-63433-15 CAN REPLACE BUT CANNOT BE REPLACED BY 69-70179-7 WITH SB-737-23-1456 OR 737-23-1400, OR 737-23-1405, OR 737-23-1460, OR 737-23-1437, OR 737-23-1395, OR 737-23-1392, OR 737-23-1383, OR 737-23-1347 INCORPORATION. USED ON: 65-45123-61 65-45123-67 65-45123-71 65-45123-75 65-45123-95	523999	1
45	69-63433-12	.CLAMP-SWITCH POSITION DATA: FIRST OFFICER SIDE	523999	1
45	69-63433-14	.CLAMP-SWITCH POSITION DATA: FIRST OFFICER SIDE	523999	1
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE				

— ITEM NOT ILLUSTRATED

R Y R

23-51-04-01

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

23-51-04
 FIG. 01
 PAGE 6
 OCT 15/22

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
1					
45	69-63433-16		.CLAMP-SWITCH POSITION DATA: FIRST OFFICER SIDE ALTERED FROM PART NUMBER: 69-63433-17 QUALIFIED I/W DATA: 69-63433-16 CAN REPLACE BUT CANNOT BE REPLACED BY 69-70179-8 WITH SB-737-23-1456 OR 737-23-1400, OR 737-23-1405, OR 737-23-1460, OR 737-23-1437, OR 737-23-1395, OR 737-23-1392, OR 737-23-1383, OR 737-23-1347 INCORPORATION. USED ON: 65-45123-62 65-45123-68 65-45123-72 65-45123-76 65-45123-96	523999	1
55	P8-4000003		.SWITCH-PUSH TO TALK SUPPLIER CODE: V21649 ELECTRICAL EQUIP NUMBER: S00161 S00214 S00519 S00520 MAINTENANCE MANUAL REF: 23-51-04	056168 174999	2
55	C2006		.SWITCH-PUSH TO TALK SUPPLIER CODE: V81640 ELECTRICAL EQUIP NUMBER: S00161 S00214 S00519 S00520 MAINTENANCE MANUAL REF: 23-51-04	056168 174999	2
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

— ITEM NOT ILLUSTRATED


R Y R

23-51-04-01

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

23-51-04
 FIG. 01
 PAGE 7
 JUN 15/23

BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

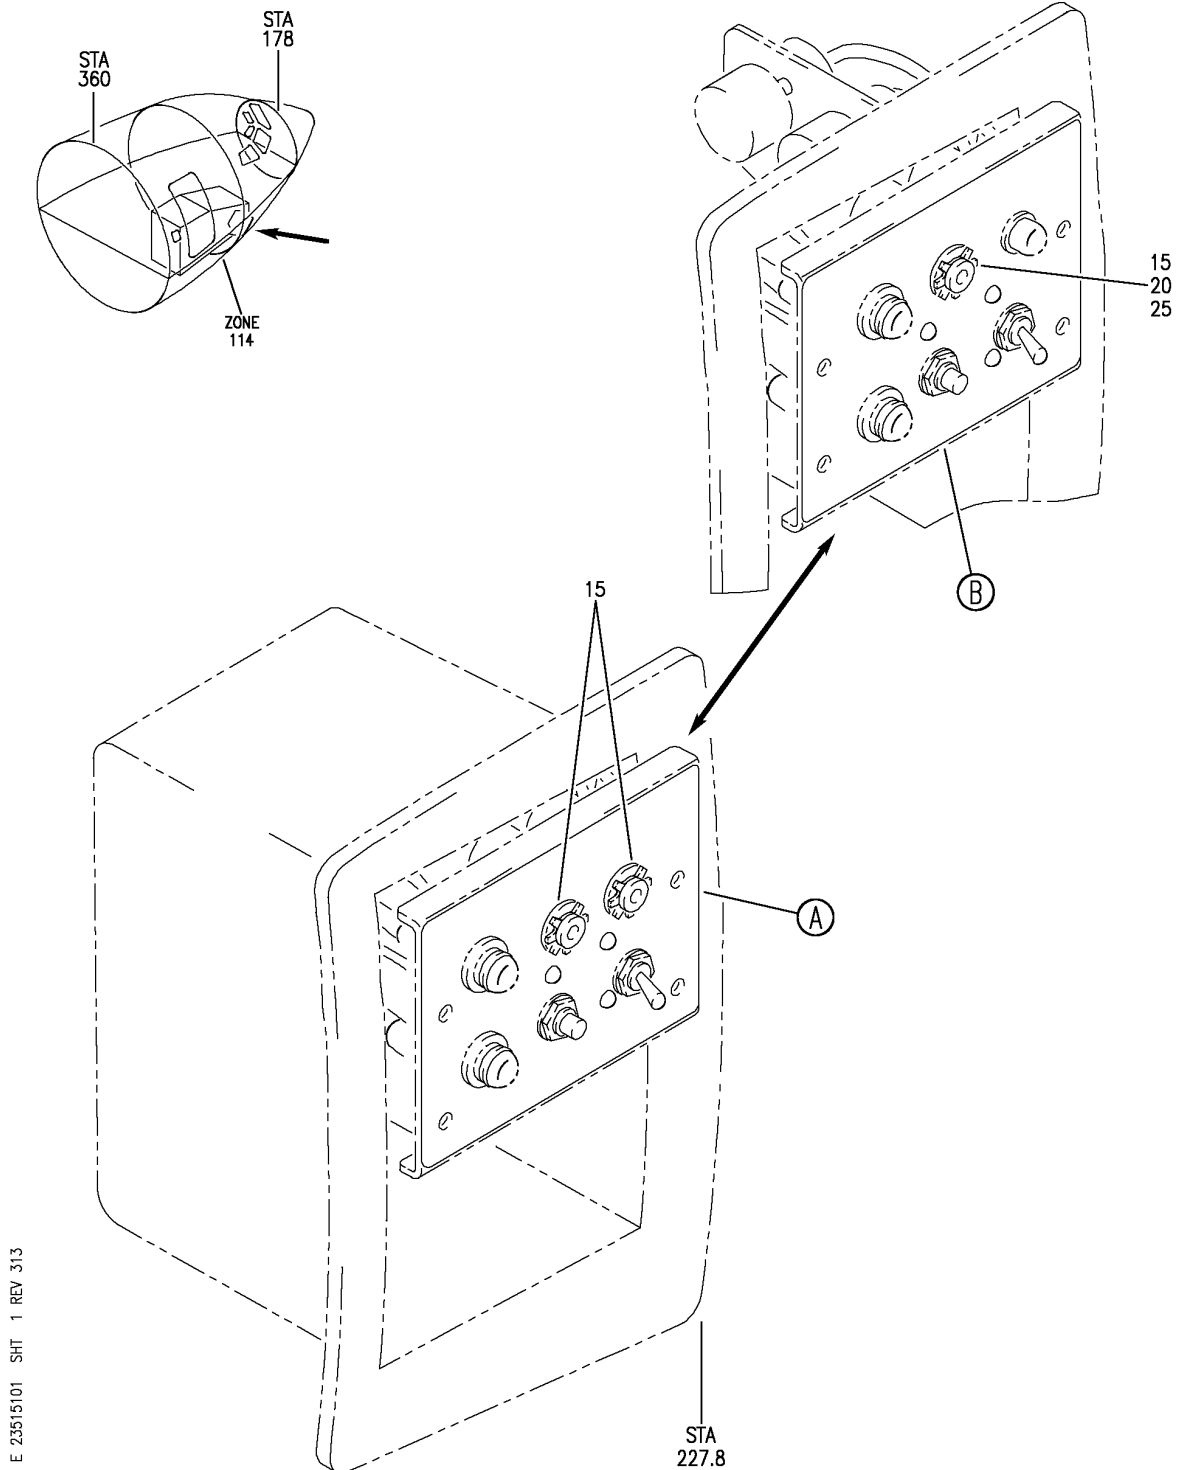

E 23515101 SHT 1 REV 313

RECEPTACLE INSTL-EXT PWR (FLIGHT INTERPHONE SYSTEM ONLY)
FIGURE 1 (SHEET 1)


23-51-51-01

R/YR
AUG 15/22


23-51-51-01
PAGE 0

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

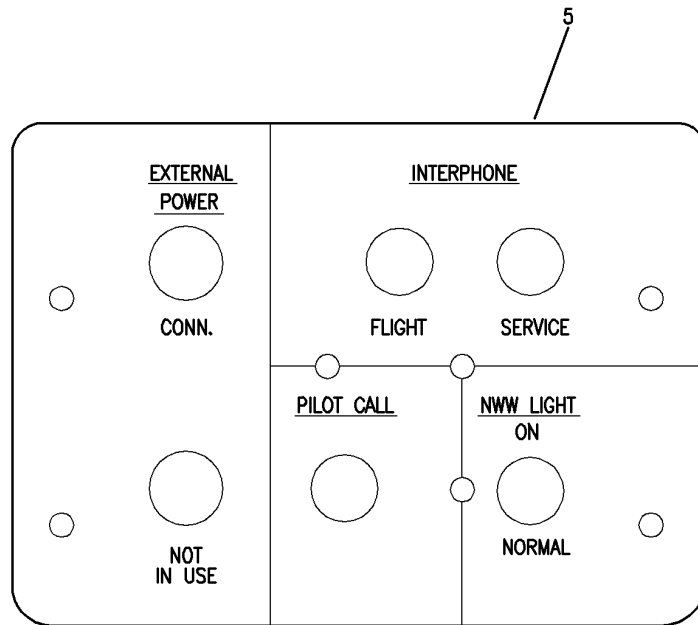

(A)

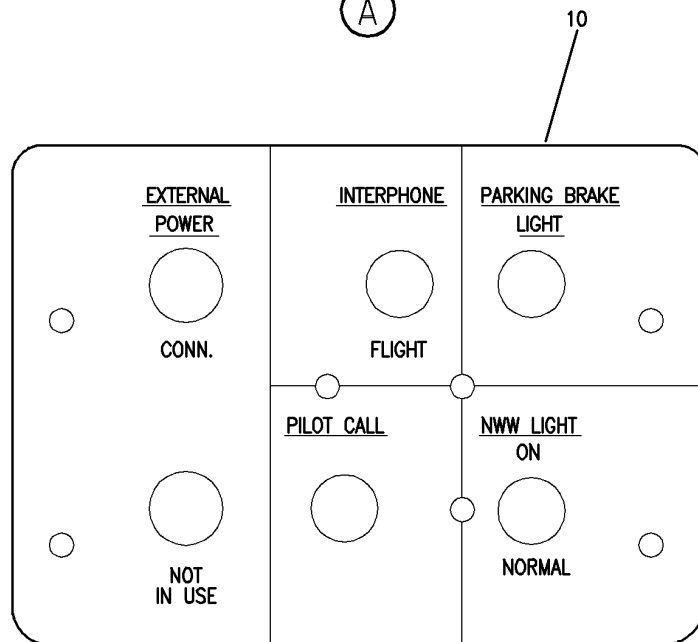

(B)

RECEPTACLE INSTL-EXT PWR (FLIGHT INTERPHONE SYSTEM ONLY)
FIGURE 1 (SHEET 2)

23-51-51-01

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
1			RECEPTACLE INSTL-EXT PWR (FLIGHT INTERPHONE SYSTEM ONLY)	056211	
- 1	MODREF86261		RECEPTACLE INSTL-EXT PWR (FLIGHT INTERPHONE SYSTEM ONLY) MODULE NUMBER: 284A1807-102 REV A FOR OTHER SYS DETAILS SEE: 23-41-51-02 23-43-51-02 24-41-11-03 33-32-51-01	056062	RF
- 1	MODREF240184		RECEPTACLE INSTL-EXT PWR (FLIGHT INTERPHONE SYSTEM ONLY) MODULE NUMBER: 284A1807-102 REV C FOR OTHER SYS DETAILS SEE: 23-41-51-02 23-43-51-02 24-41-11-03 33-32-51-01	063211	RF
5	BAC27DEX6600		.MARKER-	056211	RF
15	BACW10CR7		.WASHER	056211	1
20	BACW10P236L		.WASHER	056211	1
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

- ITEM NOT ILLUSTRATED


R Y R

23-51-51-01

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

23-51-51
 FIG. 01
 PAGE 1
 JUN 15/23

BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

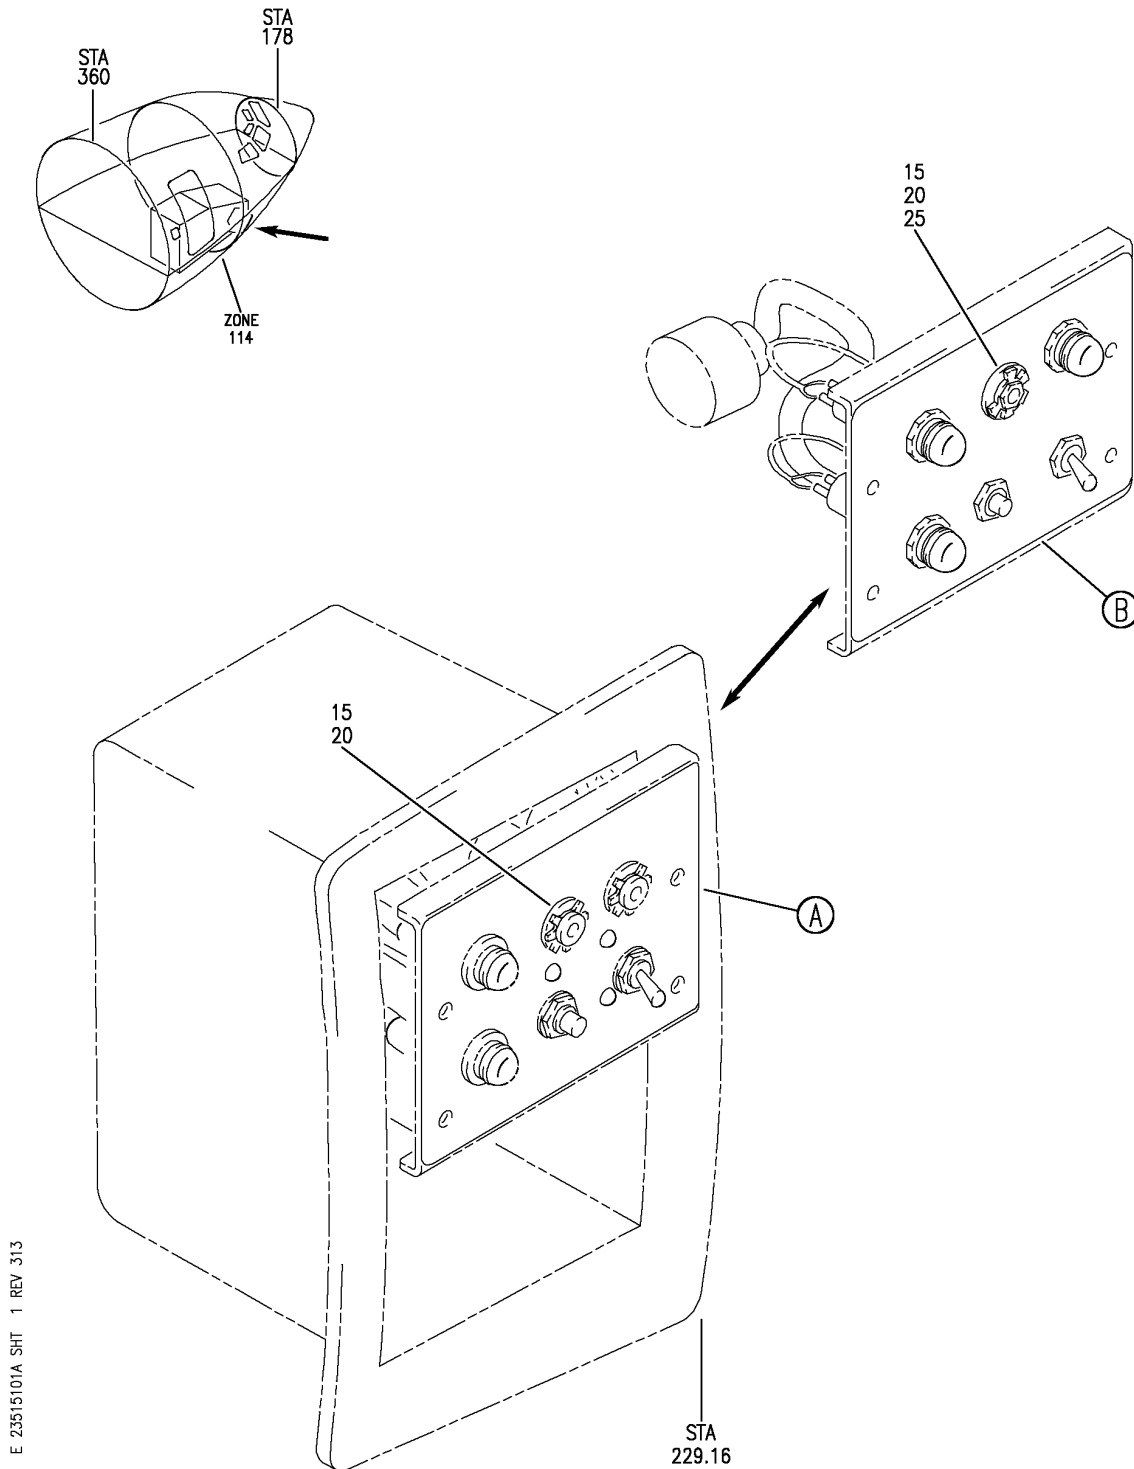

E 23515101A SHT 1 REV 313

RECEPTACLE INSTL-EXT PWR (FLIGHT INTERPHONE SYSTEM ONLY)
FIGURE 1A (SHEET 1)


23-51-51-01A

R Y R
AUG 15/22


23-51-51-01A
PAGE 0

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

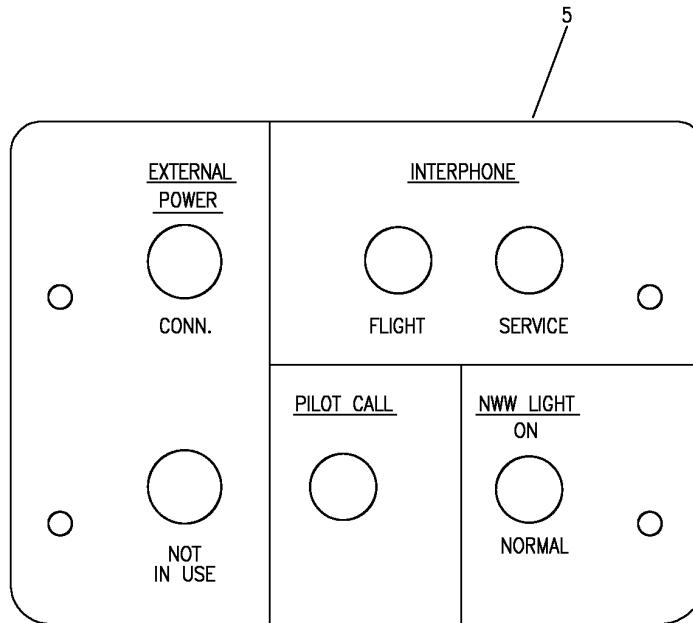

(A)

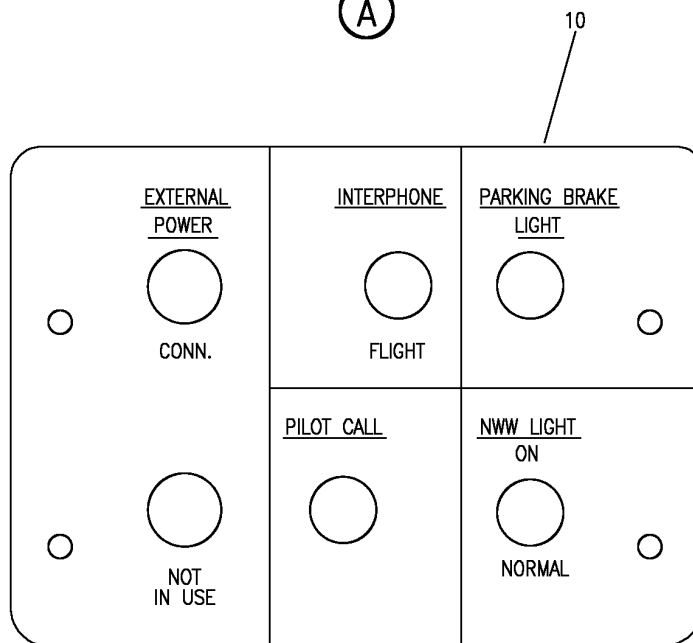

(B)

E 23515101A SHT 2 REV 147

RECEPTACLE INSTL-EXT PWR (FLIGHT INTERPHONE SYSTEM ONLY)
FIGURE 1A (SHEET 2)

23-51-51-01A

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

R Y R
O C T 15 / 08

23-51-51-01A
PAGE 0A

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
1 A			RECEPTACLE INSTL-EXT PWR (FLIGHT INTERPHONE SYSTEM ONLY)	212999	
- 1	MODREF389892		RECEPTACLE INSTL-EXT PWR (FLIGHT INTERPHONE SYSTEM ONLY) MODULE NUMBER: 284A1807-104 REV A FOR OTHER SYS DETAILS SEE: 23-41-51-02A 23-43-51-02A 24-41-11-03A 33-32-51-01A	212281	RF
- 1	MODREF484254		RECEPTACLE INSTL-EXT PWR (FLIGHT INTERPHONE SYSTEM ONLY) MODULE NUMBER: 284A1807-104 REV B FOR OTHER SYS DETAILS SEE: 23-41-51-02A 23-43-51-02A 24-41-11-03A 33-32-51-01A	282323	RF
- 1	MODREF533878		RECEPTACLE INSTL-EXT PWR (FLIGHT INTERPHONE SYSTEM ONLY) MODULE NUMBER: 284A1807-104 REV C FOR OTHER SYS DETAILS SEE: 23-41-51-02A 23-43-51-02A 24-41-11-03A 33-32-51-01A	324445	RF
- 1	MODREF720598		RECEPTACLE INSTL-EXT PWR (FLIGHT INTERPHONE SYSTEM ONLY) MODULE NUMBER: 284A1807-104 REV D FOR OTHER SYS DETAILS SEE: 23-41-51-02A 23-43-51-02A 24-41-11-03A 33-32-51-01A	446999	RF
5	BAC27DEX7340		.DECAL	212999	RF
15	BACW10CR7		.WASHER	212999	1
20	BACW10P236L		.WASHER	212999	1
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

- ITEM NOT ILLUSTRATED


RYR

23-51-51-01A

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

23-51-51
 FIG. 01A
 PAGE 1
 JUN 15/21

BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

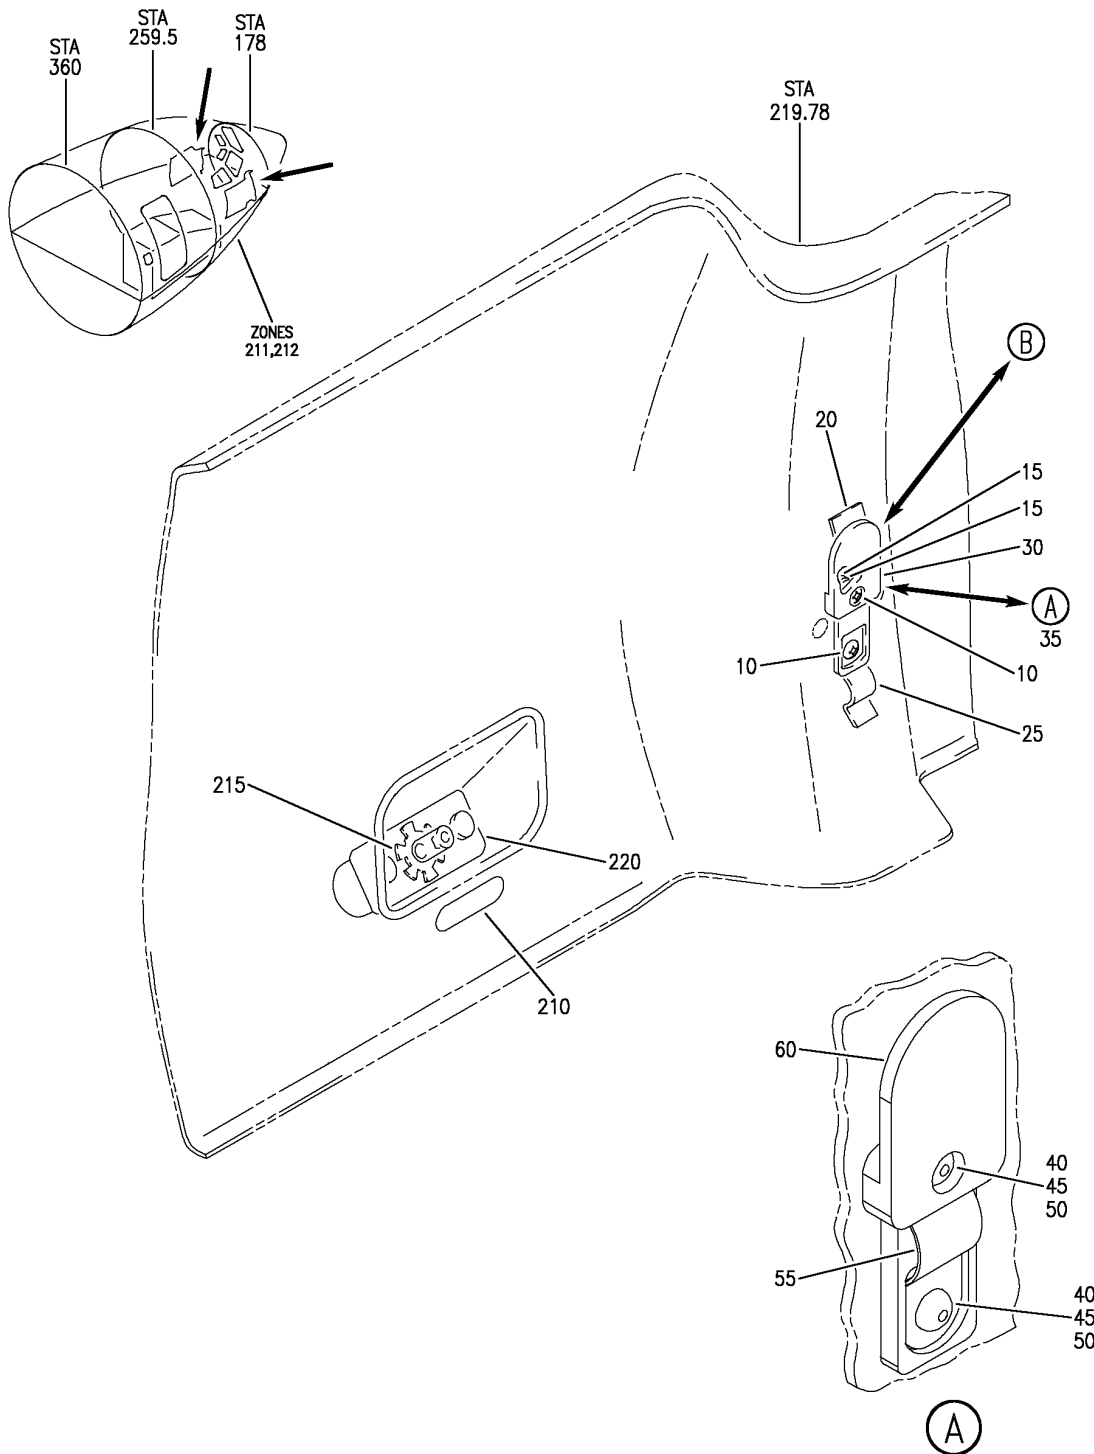

E 23515103 SHT 1 REV 299

HOLDER AND JACK INSTL-CAPT AND FIRST OFFICER HAND MIC
FIGURE 3 (SHEET 1)


23-51-51-03

RJR
JUN 15/21

23-51-51-03
PAGE 0

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

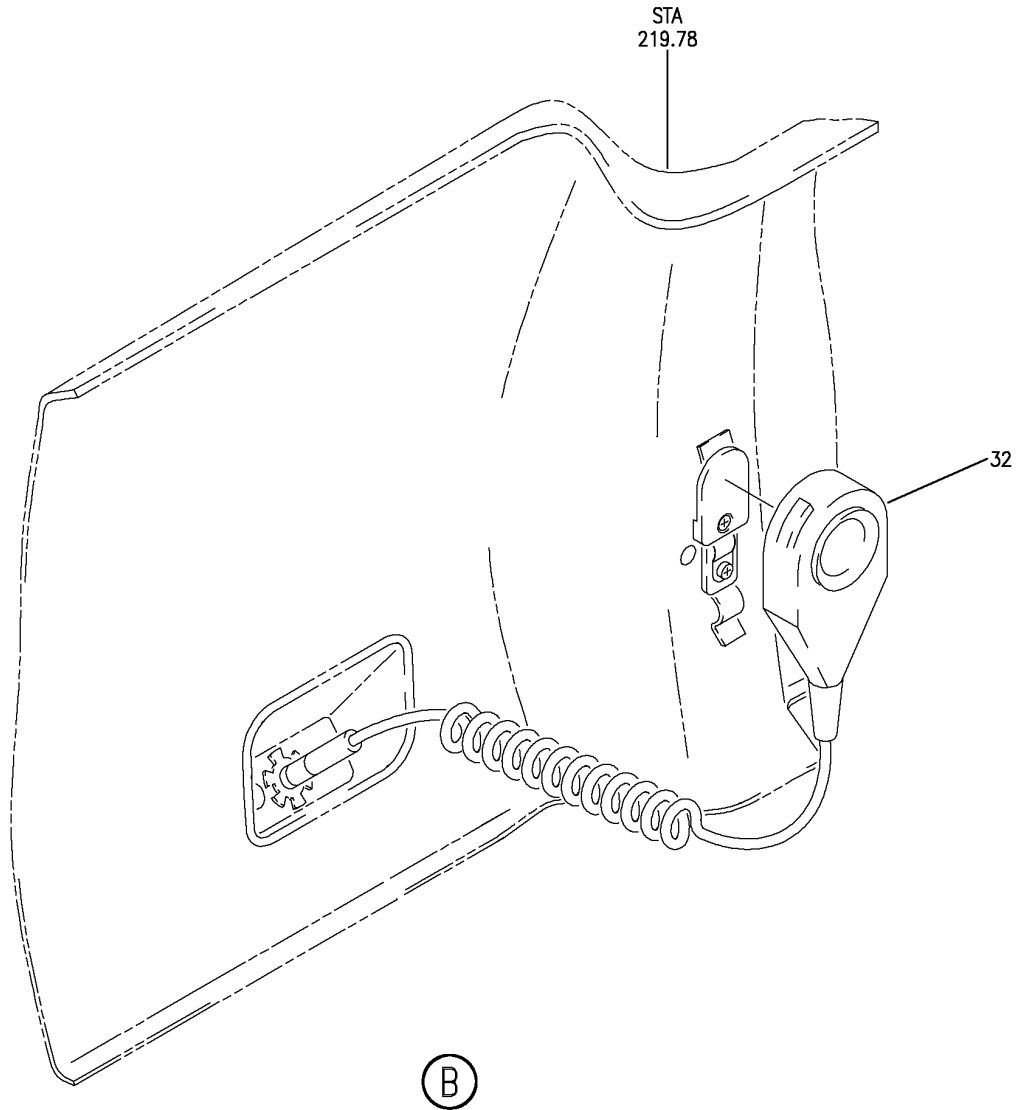

E 23515103 SHT 2 REV 299

HOLDER AND JACK INSTL-CAPT AND FIRST OFFICER HAND MIC
FIGURE 3 (SHEET 2)

23-51-51-03

RJR
JUN 15/21

23-51-51-03
PAGE 0A

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
3			HOLDER AND JACK INSTL- CAPT AND FIRST OFFICER HAND MIC		
- 1	MODREF82013		HOLDER INSTL-ELECTROVOICE SIDEWALL CAPT HAND MIC MODULE NUMBER: 232A4400-361 REV A	056120	RF
- 1	MODREF313817		HOLDER INSTL-ELECTROVOICE SIDEWALL CAPT HAND MIC MODULE NUMBER: 232A4400-361 REV C	121999	RF
- 5	MODREF82014		HOLDER INSTL-ELECTROVOICE SIDEWALL FIRST OFFICER HAND MIC MODULE NUMBER: 232A4400-362 REV A	056120	RF
- 5	MODREF313818		HOLDER INSTL-ELECTROVOICE SIDEWALL FIRST OFFICER HAND MIC MODULE NUMBER: 232A4400-362 REV C	121999	RF
10	BACS12HK06-10	.SCREW-		121999	2
10	BACS12HK06-10	.SCREW		056120	2
10	NAS1101-06-10	.SCREW-		121999	2
			STANDARD SUBSTITUTION: BACS12HK06-10		
10	NAS8201A10	.SCREW-		121999	2
			STANDARD SUBSTITUTION: BACS12HJ06K10		
15	NAS1149DN632K	.WASHER			2
			STANDARD SUBSTITUTION: NAS1149DN632J		
20	RCS5402-1	.SPRING-			1
			SUPPLIER CODE: V08205		
			MISCELLANEOUS DATA: 659A4100-1 IS BOEING PREFERRED SPARE PART.		
20	659A4100-1	.SPRING-			1
			MISCELLANEOUS DATA: 659A4100-1 IS BOEING PREFERRED SPARE PART		
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

- ITEM NOT ILLUSTRATED

RYR

23-51-51-03

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

23-51-51
 FIG. 03
 PAGE 1
 FEB 15/24

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
3					
25	22WC500312	.CLIP-	SUPPLIER CODE: V13764 QUALIFIED I/W DATA: 22WC500312B CAN REPLACE OR BE REPLACED BY 22WC500312 SUBJECT TO CUSTOMER COLOR PREFERENCE: 22WC500312 IS COLOR NATURAL (OPTIONAL COLOR WHITE), 22WC500312B IS COLOR BLACK.		1
25	22WC500312B	.CLIP-	SUPPLIER CODE: V13764 QUALIFIED I/W DATA: 22WC500312B CAN REPLACE OR BE REPLACED BY 22WC500312 SUBJECT TO CUSTOMER COLOR PREFERENCE: 22WC500312 IS COLOR NATURAL (OPTIONAL COLOR WHITE), 22WC500312B IS COLOR BLACK.		1
30	8474	.HOLDER-	SUPPLIER CODE: V81134 MISCELLANEOUS DATA: 659A4890-1 IS BOEING PREFERRED SPARE PART.		1
35	659A4890-1	.HOLDER ASSY-MIC	MISCELLANEOUS DATA: 659A4890-1 IS BOEING PREFERRED SPARE PART		1
40	BACS12HJ06K10	..SCREW-	USED ON: 659A4890-1		2
45	MS35333-37	..WASHER-	USED ON: 659A4890-1		2
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

— ITEM NOT ILLUSTRATED

RYR

23-51-51-03

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

23-51-51
 FIG. 03
 PAGE 2
 APR 15/24

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
3					
50	PLH506CD	..NUT-	SUPPLIER CODE: VF0224 SPECIFICATION NUMBER: BACN10YR06CD OPTIONAL PART: H52732-06CD V15653 USED ON: 659A4890-1		2
55	659A4891-2	..CLIP-	USED ON: 659A4890-1		1
60	659A4891-1	..BRACKET-	USED ON: 659A4890-1		1
- 200	MODREF81997	JACK INSTL-2J	SIDEWALL CAPT HAND MIC PROVISIONS MODULE NUMBER: 232A4400-261 REV A		RF
- 205	MODREF81998	JACK INSTL-2J	SIDEWALL FIRST OFFICER HAND MIC PROVISIONS MODULE NUMBER: 232A4400-262 REV A		RF
210	BAC27DCC2778	.MARKER-	PLACARD CONTENT: HAND MIKE		1
210	BAC27DCC2778	.MARKER-	PLACARD CONTENT: HAND MIKE		1
215	BACW10CR6	.WASHER			1
220	232A4255-28	.PLATE-COVER			1
220	232A4255-28	.PLATE-COVER			1
- 225	WHS8C7TPKL16GY	ATTACHING PARTS .SCREW-	SUPPLIER CODE: V12324		2
- 225	BACS12FA08K7	.SCREW-	-----*-----		2
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					


— ITEM NOT ILLUSTRATED

R Y R

23-51-51-03

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

23-51-51
 FIG. 03
 PAGE 3
 APR 15/24

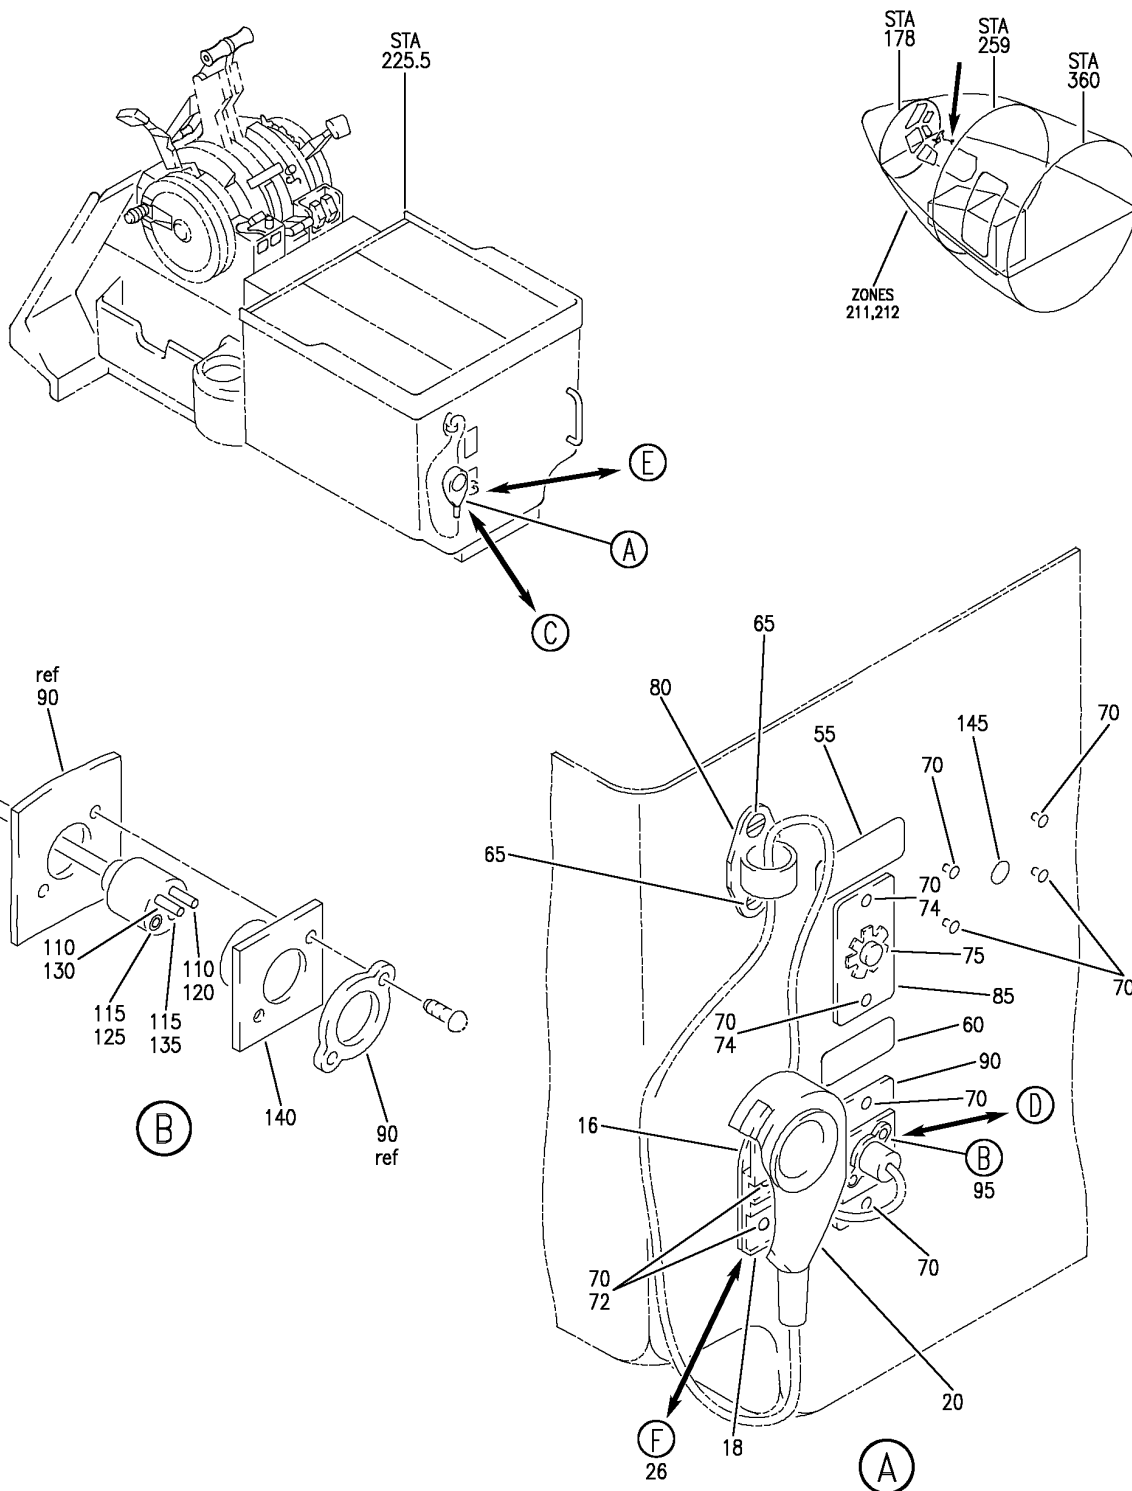

ECCN 9E991 BOEING PROPRIETARY – See title page for details.



23-51-51-04

23-51-51-04
PAGE 0A

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
4			JACK AND HAND MIC INSTL-END OF AISLE STAND		
- 50	MODREF81984		JACK INSTL-HAND MIC END OF AISLE STAND MODULE NUMBER: 232A4400-187 REV A POSITION DATA: AFT	056094	RF
- 50	MODREF282434		JACK INSTL-HAND MIC END OF AISLE STAND MODULE NUMBER: 232A4400-187 REV B POSITION DATA: AFT	095137	RF
- 50	MODREF342480		JACK INSTL-HAND MIC END OF AISLE STAND MODULE NUMBER: 232A4400-187 REV C POSITION DATA: AFT	138999	RF
55	BAC27DCC2782		.MARKER- PLACARD CONTENT: INTERPHONE		1
60	BAC27DCC2780		.MARKER- PLACARD CONTENT: PASS ADDRESS		1
65	NAS514P1032-8		.SCREW-		2
67	BACS12HJ06K8		.SCREW-	095999	2
70	S6C6TPKL16GY		.SCREW- SUPPLIER CODE: V12324	056094	10
73	S6C6TPKL16GY		.SCREW- SUPPLIER CODE: V12324	095137	8
74	S6C6TPKL16GY		.SCREW- SUPPLIER CODE: V12324	138999	4
75	BACW10CR7		.WASHER		1
80	66-18897-3		.SUPPORT-CORD		1
85	232A4255-18		.PLATE		1
90	232A4255-23		.PLATE		1
95	66-16842-15		.JACK ASSY- ELECTRICAL EQUIP NUMBER: D06001 WIRING DIAGRAM REF: 233101		1
- 100	NAS514P440-6		ATTACHING PARTS .SCREW		2
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

- ITEM NOT ILLUSTRATED

RYR

23-51-51-04

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

23-51-51
 FIG. 04
 PAGE 1
 JUN 15/23

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
4 - 105	BRH10C04D		.NUT SUPPLIER CODE: V52828 SPECIFICATION NUMBER: BACN10JC04CD OPTIONAL PART: H51650-04BAC V15653 102LH9075-40W V72962 NS202486-40 V80539 T6C440JCD V11815 -----*-----		2
110	48-1825-02		..PIN SUPPLIER CODE: V77820 SPECIFICATION NUMBER: BACC47CN2 OPTIONAL PART: ZZL4016-36LT V49367 48-1825-02 V02660 417-1616-902 V92069 LRM16M15F74 V09922 STANDARD SUBSTITUTION: BACC47CN2S		2
115	418-1616-902		..CONTACT SUPPLIER CODE: V55104 SPECIFICATION NUMBER: BACC47CP2T OPTIONAL PART: ZZL4116-36LT V49367 248-136-1600S02 V77820 LRC16M15F74 V09922 STANDARD SUBSTITUTION: BACC47CP2S		2
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

— ITEM NOT ILLUSTRATED

R Y R

23-51-51-04

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

23-51-51
 FIG. 04
 PAGE 2
 APR 15/23

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
4					
120	48-7190		..CONNECTOR-BLUE SUPPLIER CODE: V77820 ELECTRICAL EQUIP NUMBER: D07019		1
125	48-7191		..CONNECTOR-BLUE SUPPLIER CODE: V77820 ELECTRICAL EQUIP NUMBER: D07021		1
130	48-7190-1		..CONNECTOR-RED SUPPLIER CODE: V77820 ELECTRICAL EQUIP NUMBER: D07015		1
135	48-7191-1		..RECEPTACLE-RED SUPPLIER CODE: V77820 ELECTRICAL EQUIP NUMBER: D07017		1
140	XLR4-31		..JACK- SUPPLIER CODE: V71468 TRUE PART NUMBER: XLR-4-31		1
140	XLR4-31A176		..JACK- SUPPLIER CODE: V71468 TRUE PART NUMBER: XLR-4-31-A176		1
145	BACP20B65P		.PLUG	056137	1
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

— ITEM NOT ILLUSTRATED


R Y R

23-51-51-04

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

23-51-51
 FIG. 04
 PAGE 3
 JUN 15/23

BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

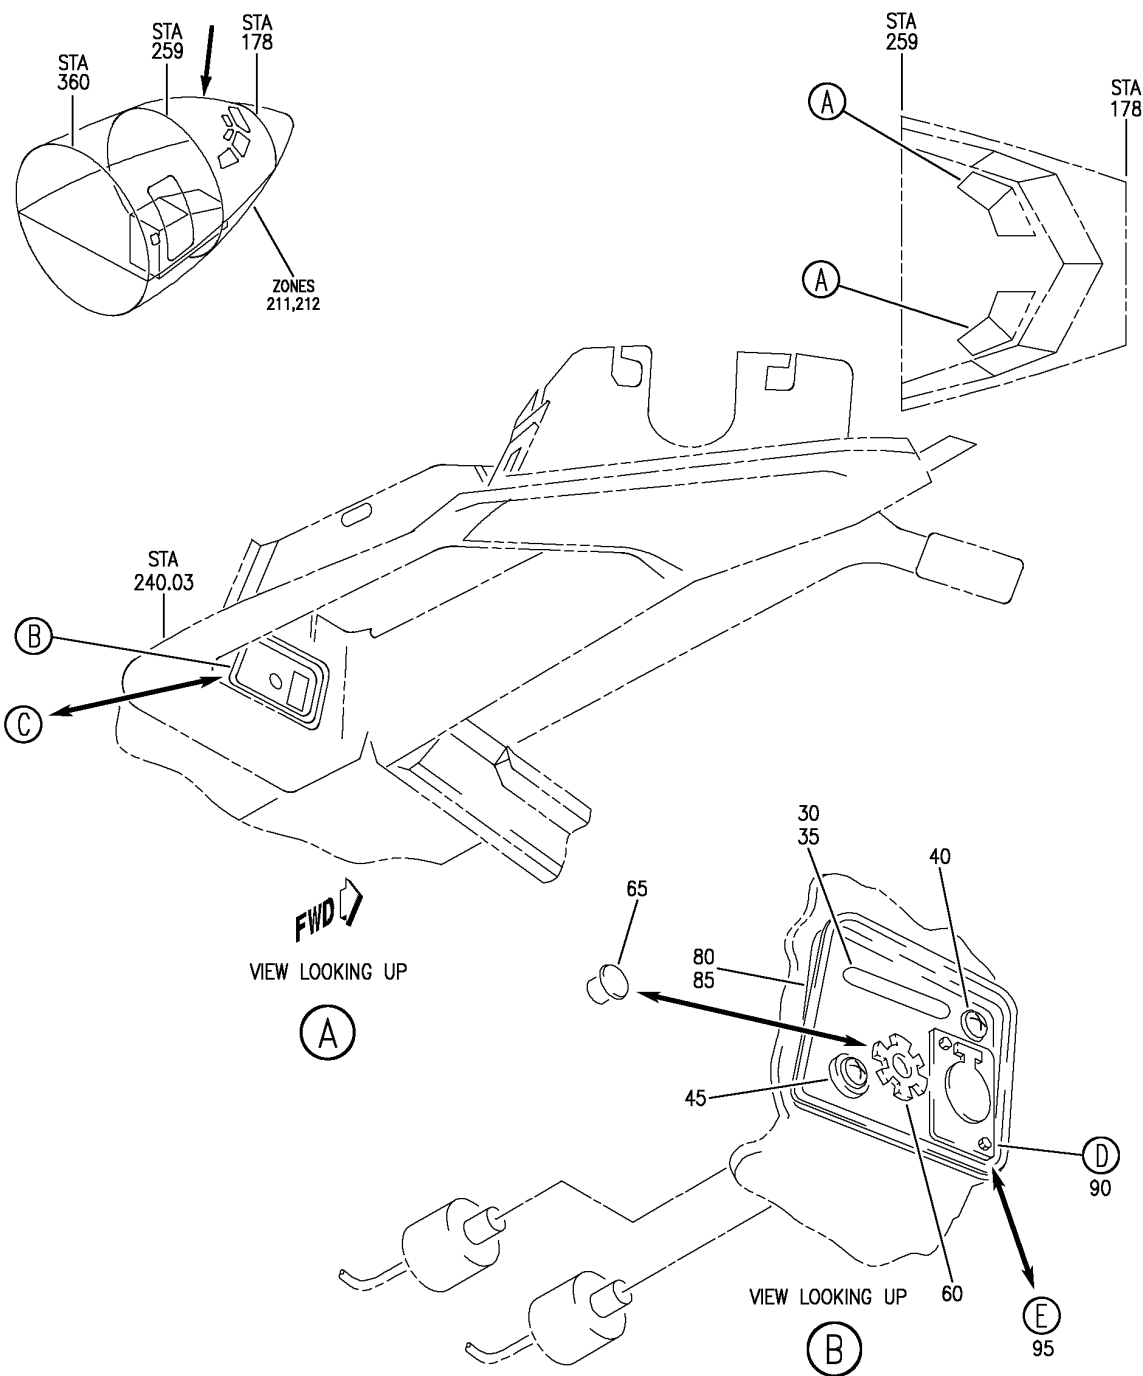

E 23515107 SHT 1 REV 307

INTERPHONE AND JACK INSTL-CONT CAB. CAPT AND FIRST OFFICER HEADSET/BOOM MIC
FIGURE 7 (SHEET 1)


23-51-51-07

RJR
FEB 15/22

23-51-51-07
PAGE 0

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

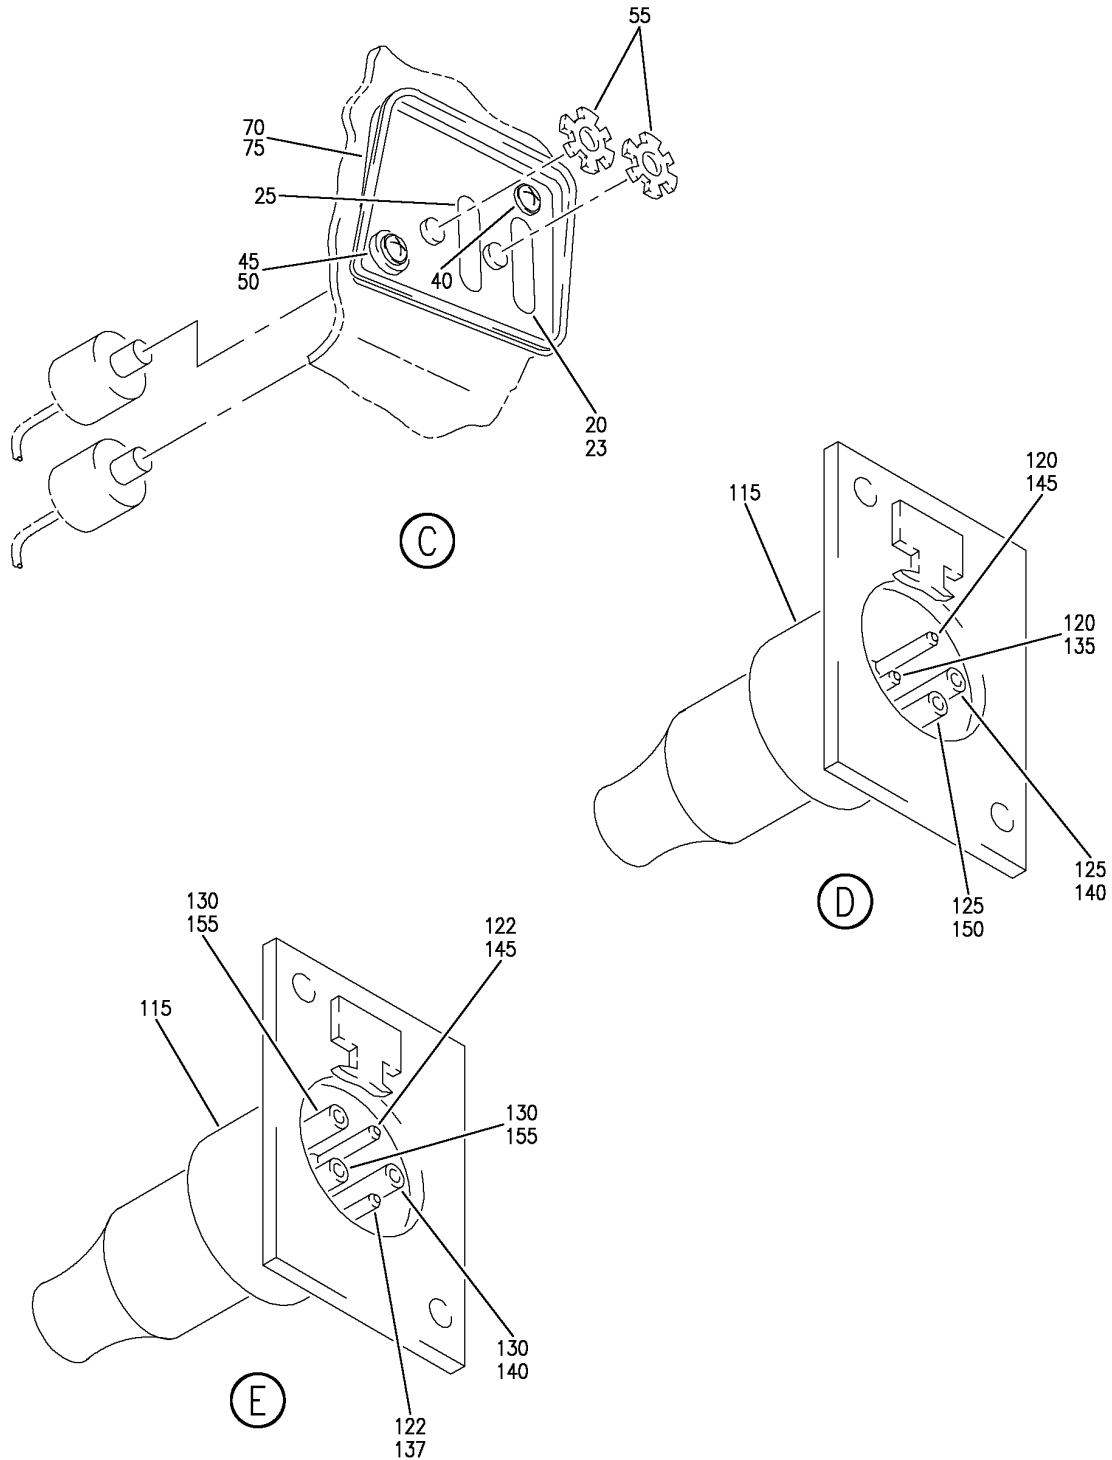

E 23515107 SHT 2 REV 339

INTERPHONE AND JACK INSTL-CONT CAB. CAPT AND FIRST OFFICER HEADSET/BOOM MIC
FIGURE 7 (SHEET 2)

RJR
OCT 15/24

23-51-51-07

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

23-51-51-07
PAGE 0A

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
7			INTERPHONE AND JACK INSTL- CONT CAB. CAPT AND FIRST OFFICER HEADSET/BOOM MIC		
- 5	MODREF81985		JACK INSTL-CAPT BOOM MIC HEADSET PROVISIONS MODULE NUMBER: 232A4400-201 REV A	056173	RF
- 5	MODREF349161		INTERPHONE INSTL-CAPT BOOM MIC HEADSET PROVISIONS MODULE NUMBER: 232A4400-201 REV B	174999	RF
- 15	MODREF81993		JACK INSTL-FIRST OFFICER BOOM MIC HEADSET PROVISIONS MODULE NUMBER: 232A4400-251 REV A	056173	RF
- 15	MODREF349163		INTERPHONE INSTL-FIRST OFFICER BOOM MIC HEADSET PROVISIONS MODULE NUMBER: 232A4400-251 REV B	174999	RF
20	BAC27DCC2774		.MARKER- PLACARD CONTENT: BOOM MIKE		1
25	BAC27DCC2775		.MARKER- PLACARD CONTENT: HEAD PHONE		1
40	BACS12FA08K7		.SCREW-		1
40	WHS8C7TPKL10GY		.SCREW- SUPPLIER CODE: V12324		1
45	BACS12FA08K10		.SCREW-		1
45	WHS8C9TPKL10GY		.SCREW- SUPPLIER CODE: V12324		1
50	BACW10P295L		.WASHER		1
55	BACW10CR6		.WASHER-		2
70	232A4280-1		.COVER- USED ON: MODREF349161 MODREF81985		1
75	232A4280-2		.COVER- USED ON: MODREF349163 MODREF81993		1
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

- ITEM NOT ILLUSTRATED


RYR

23-51-51-07

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

23-51-51
 FIG. 07
 PAGE 1
 JUN 15/23

BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

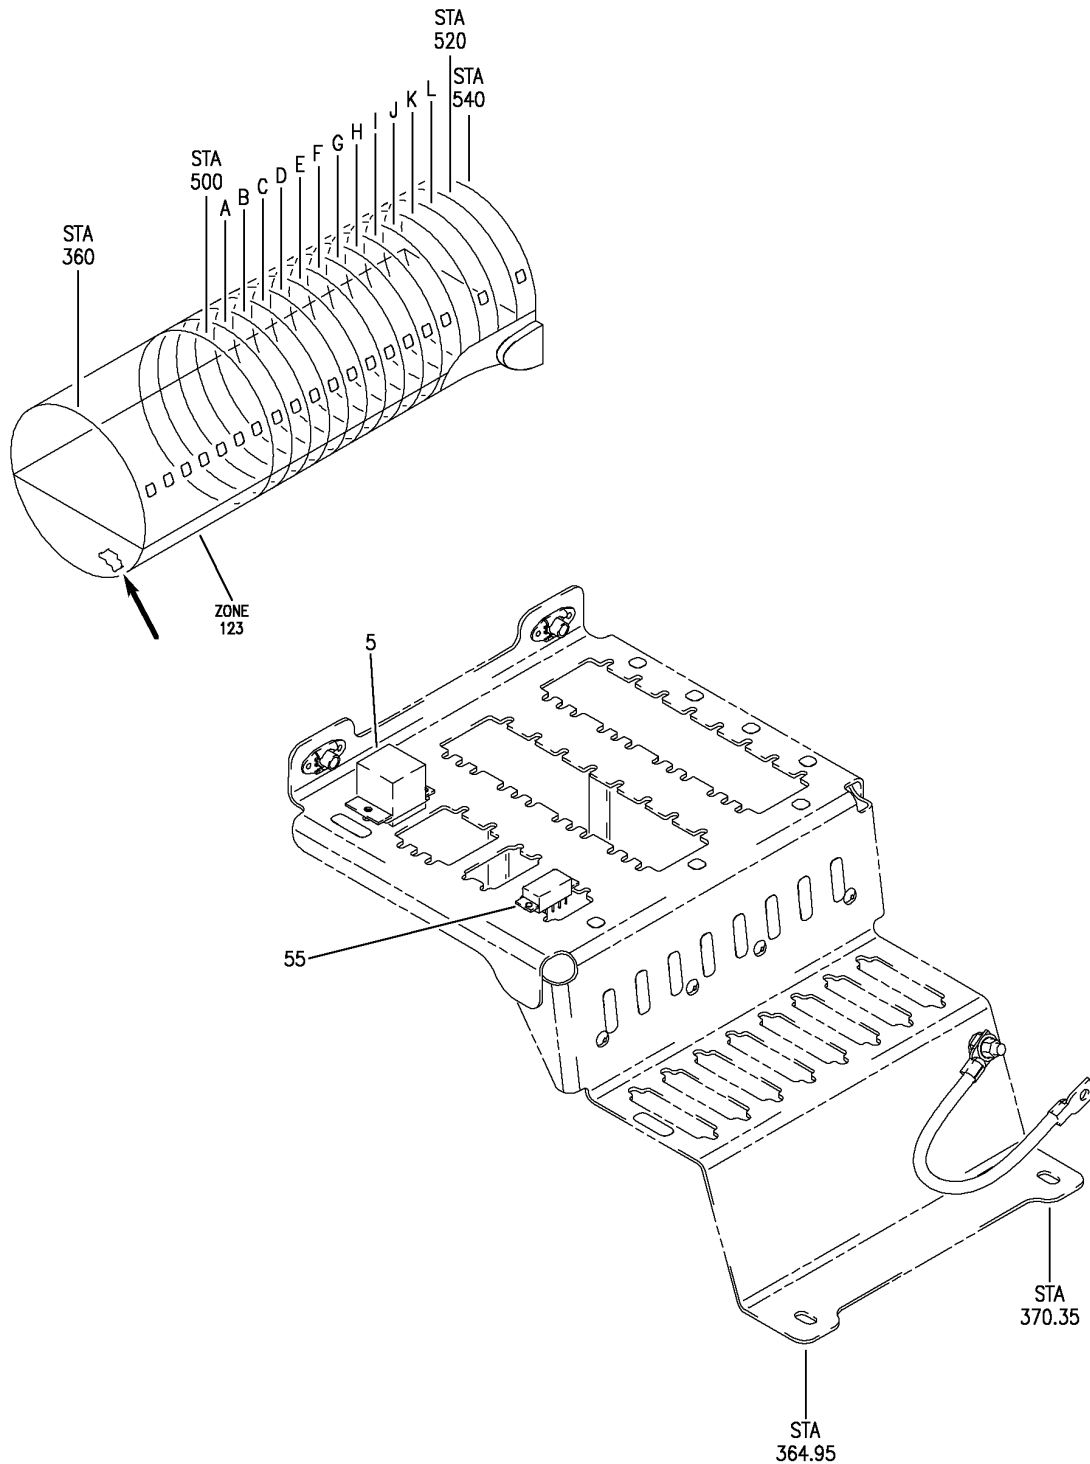

E 23515112 REV 177

JUNCTION BOX INSTL-J39 PLATE B
FIGURE 12

23-51-51-12

R Y R
O C T 15 / 15

23-51-51-12
PAGE 0

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
12			JUNCTION BOX INSTL-J39 PLATE B	378999	
- 1	MODREF464694		JUNCTION BOX INSTL-J39 PLATE B MODULE NUMBER: 284A1239-13 REV A	378526	RF
- 1	MODREF789223		JUNCTION BOX INSTL-J39 PLATE B MODULE NUMBER: 284A1239-13 REV B	527999	RF
5	YD4N		.RELAY-ACP D.L SUPPLIER CODE: V58657 TRUE PART NUMBER: Y-D4N ELECTRICAL EQUIP NUMBER: R01066	378999	1
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

- ITEM NOT ILLUSTRATED

RYR

23-51-51-12

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

23-51-51
 FIG. 12
 PAGE 1
 DEC 15/18