


## LAVATORIES

R Y R  
OCT 10/06

25-40-00  
SECTION TITLE  
PAGE 1

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

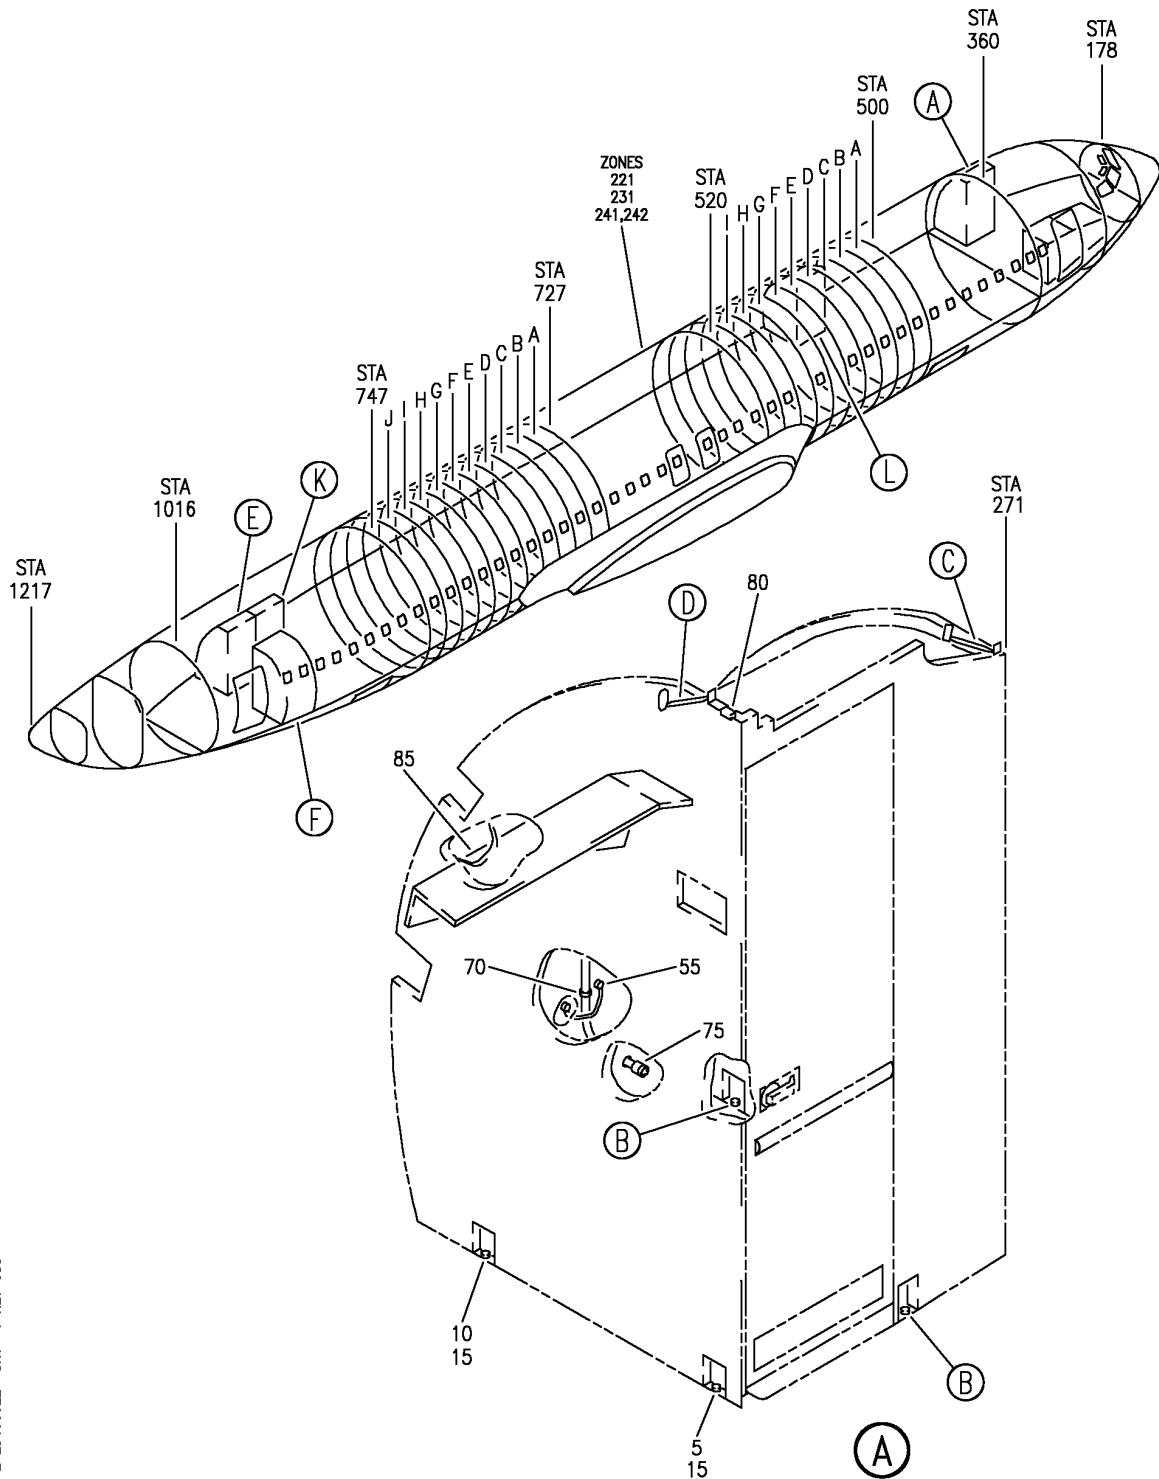

E 25400022 SHT 1 REV 088

HARDWARE INSTL-LAV (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 22 (SHEET 1)


**25-40-00-22**

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

R/YR  
OCT 10/06

25-40-00-22  
PAGE 0

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

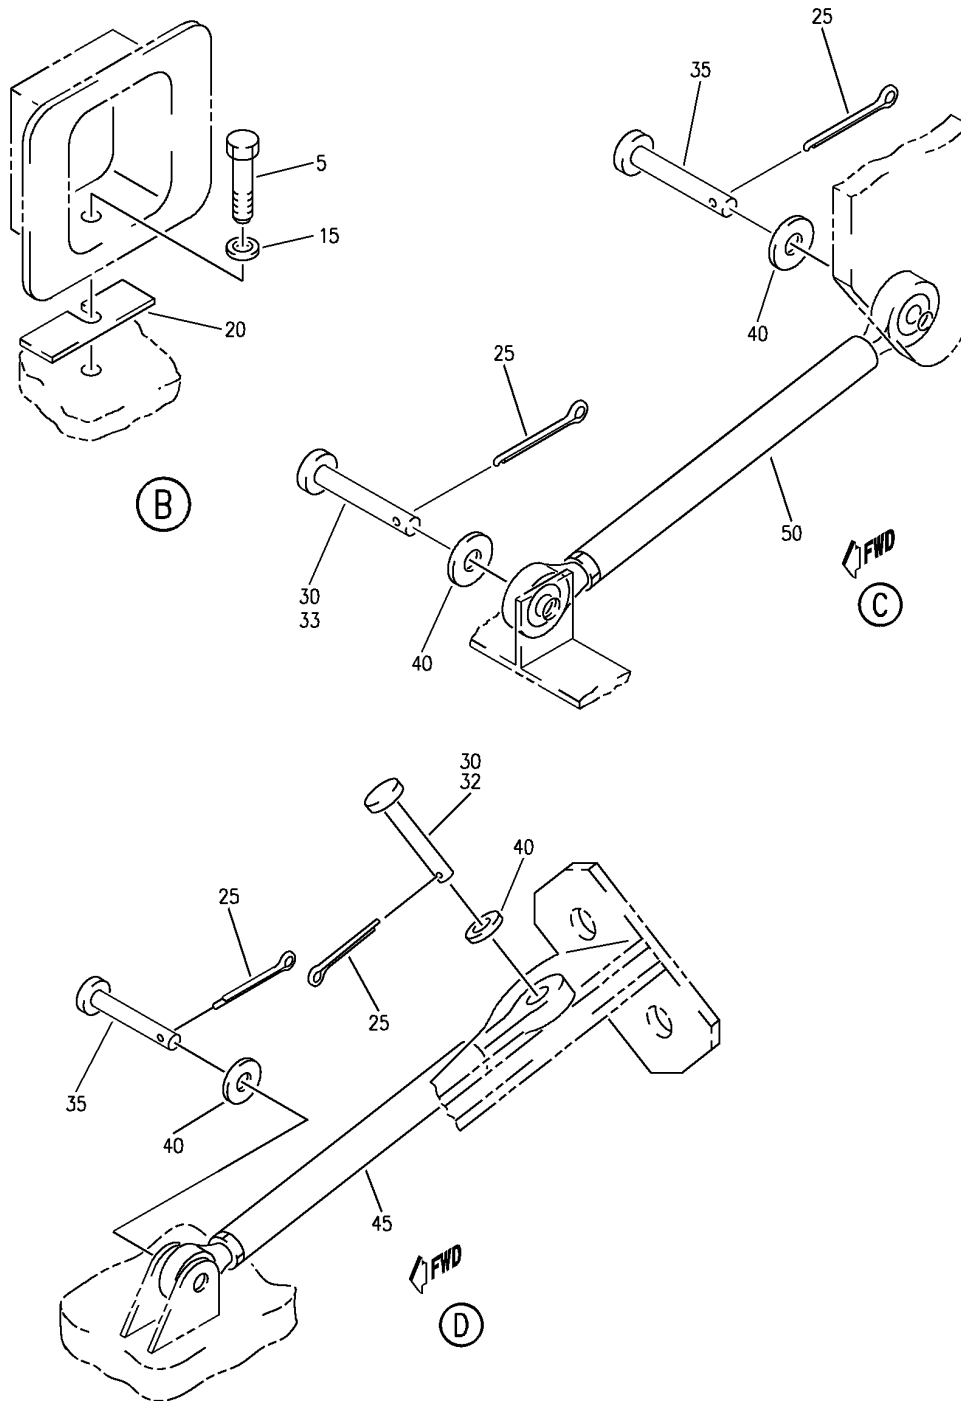

E 25-40-00-22 SHT 2 REV 134

HARDWARE INSTL-LAV (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 22 (SHEET 2)


**25-40-00-22**

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

RJR  
OCT 10/07

25-40-00-22  
PAGE 0A

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

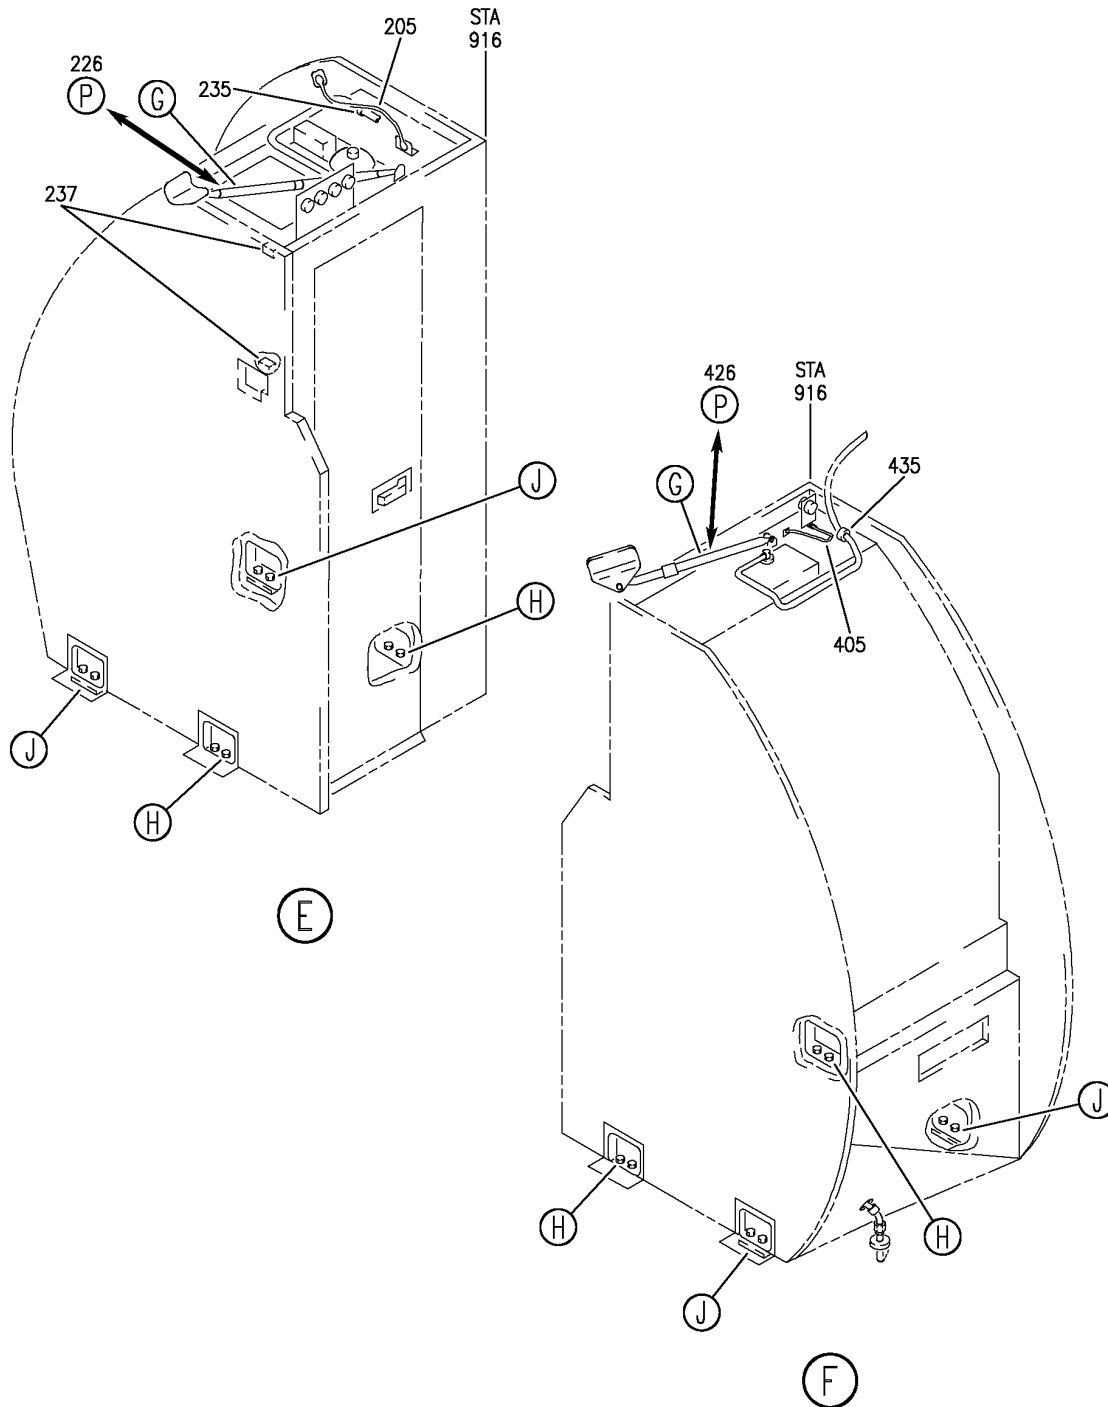

E 25400022 SHT 3 REV 265

HARDWARE INSTL-LAV (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 22 (SHEET 3)


**25-40-00-22**

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

R Y R  
AUG 15/18


25-40-00-22  
PAGE 0B



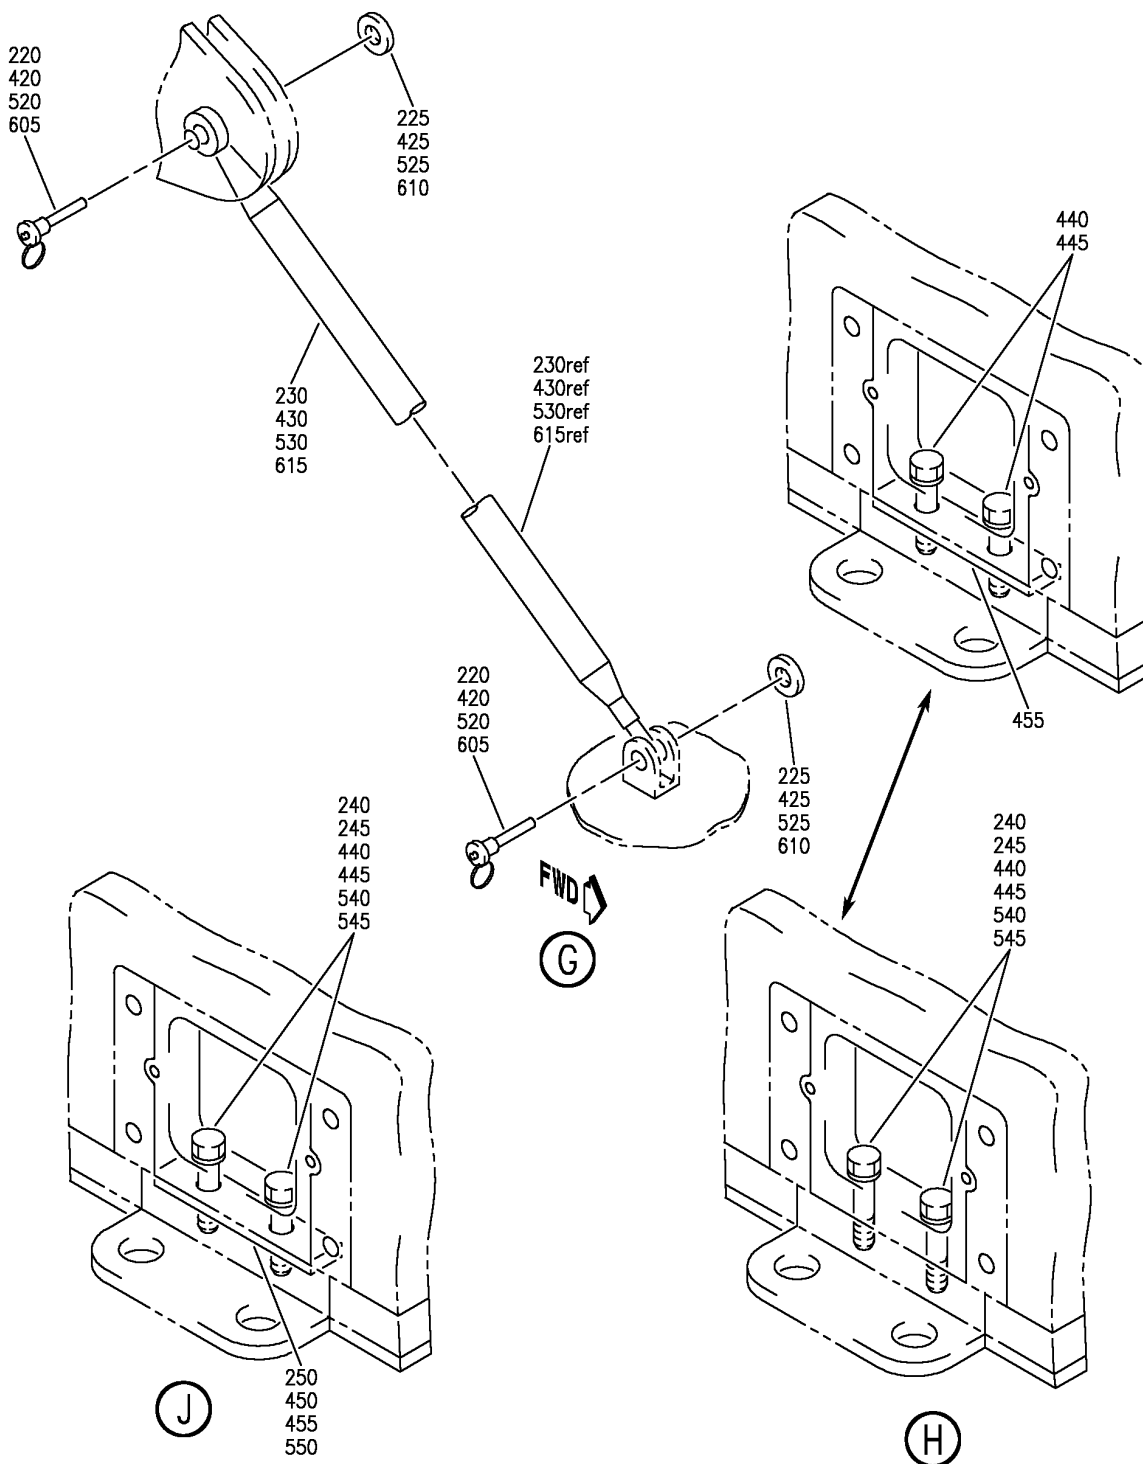

25-40-00-22  
PAGE 00

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

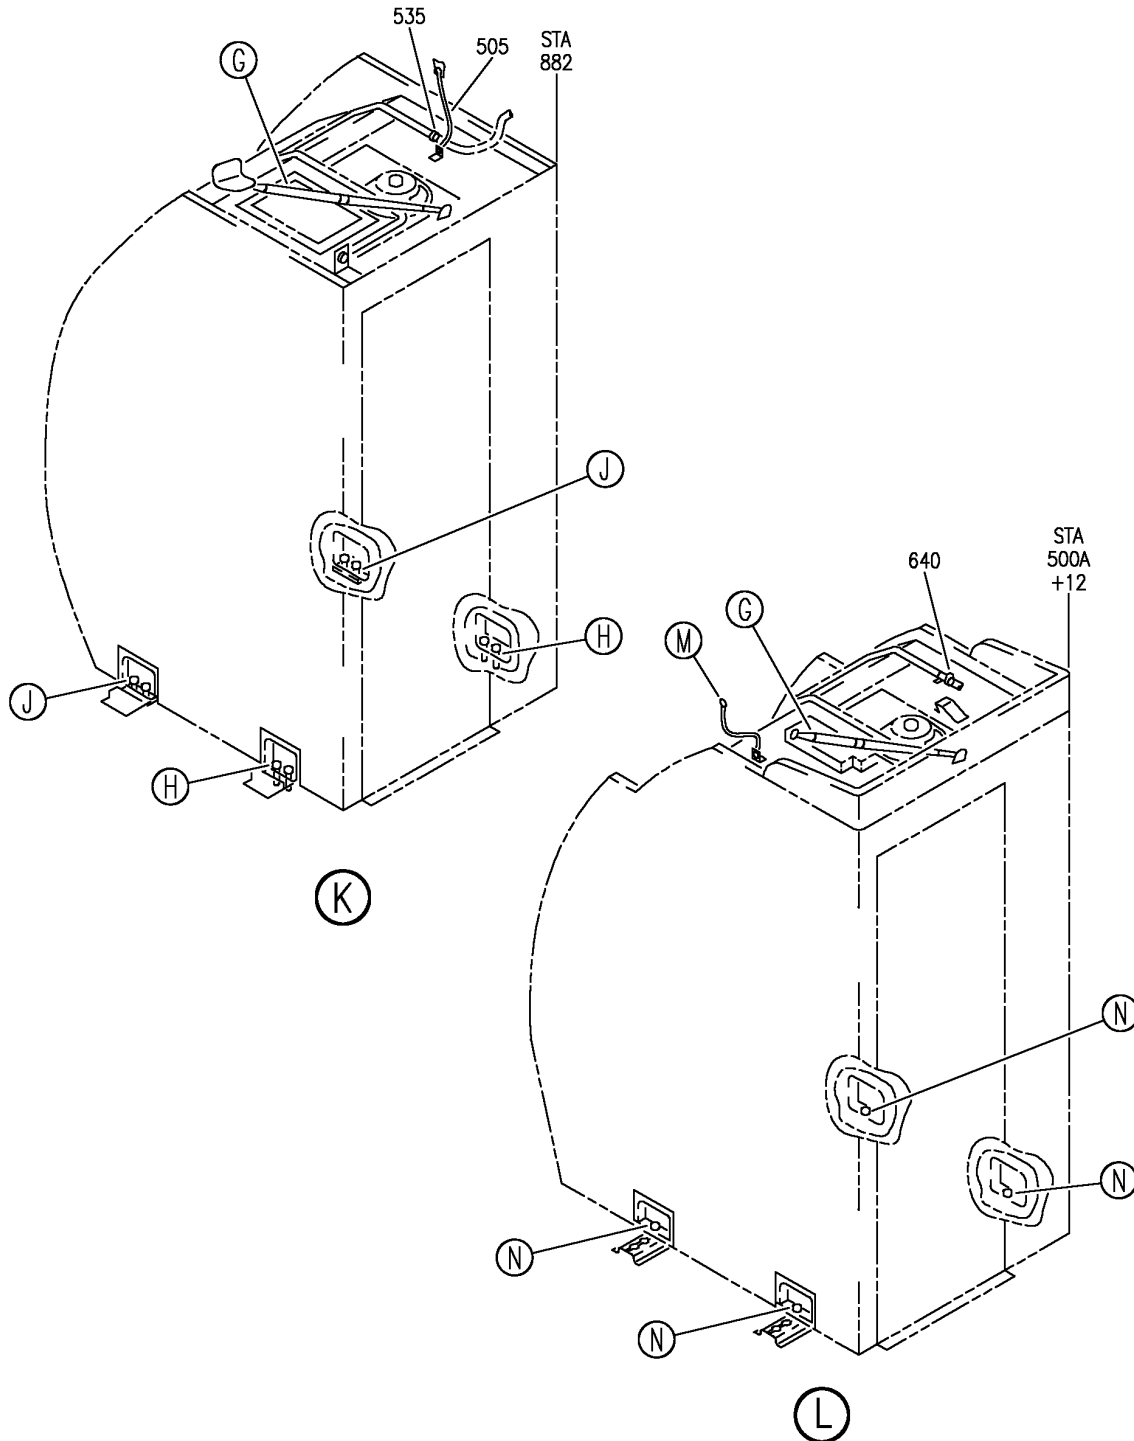

E 25400022 SHT 5 REV 088



HARDWARE INSTL-LAV (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 22 (SHEET 5)

**25-40-00-22**

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

RJR  
OCT 10/06

25-40-00-22  
PAGE 00

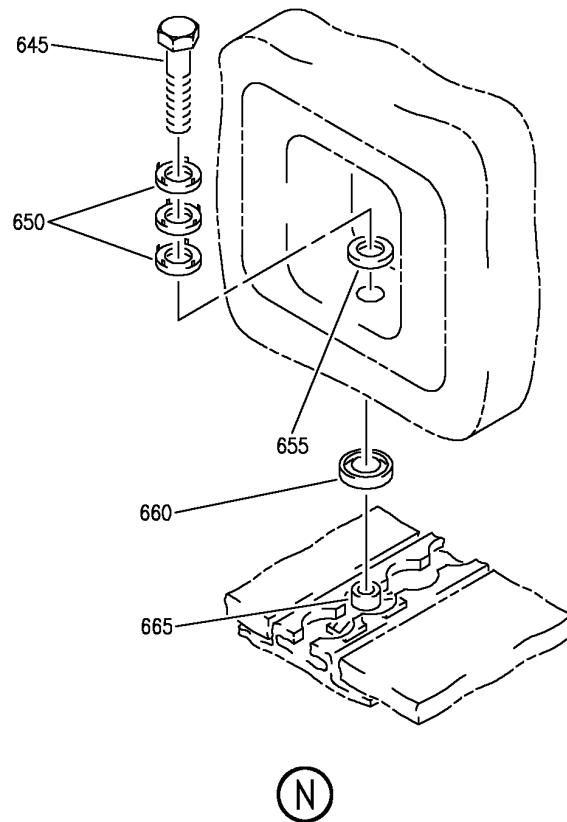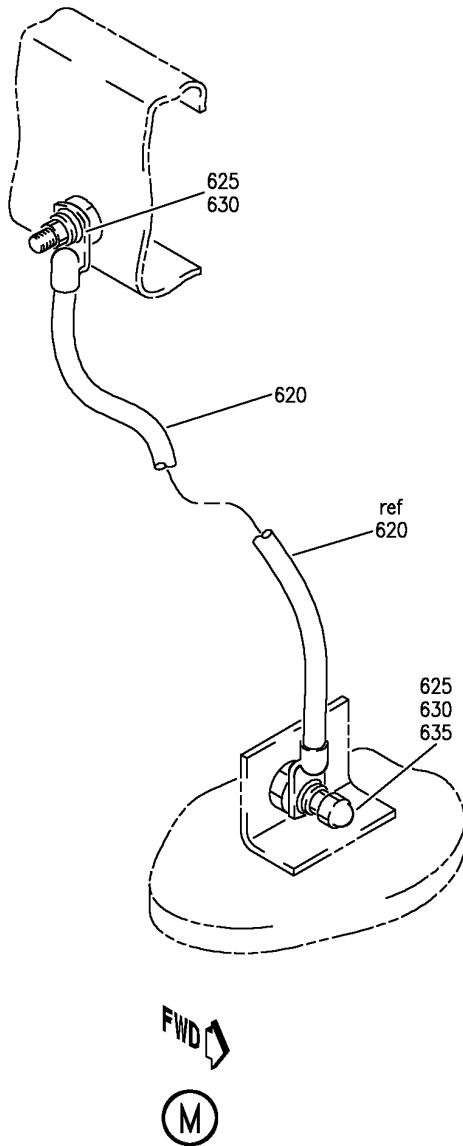

E 25400022 SH 6 REV 088


HARDWARE INSTL-LAV (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 22 (SHEET 6)

**25-40-00-22**

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

RJR  
OCT 10/06

25-40-00-22  
PAGE 0E

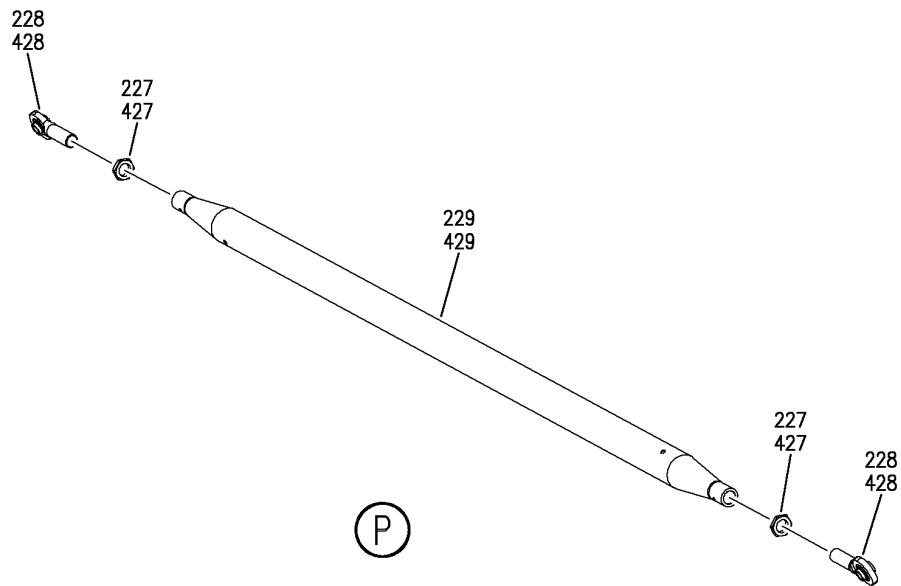

E 25400022 SH7 7 REV 265

HARDWARE INSTL-LAV (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 22 (SHEET 7)

**25-40-00-22**

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

R Y R  
AUG 15/18

25-40-00-22  
PAGE 0F

 **BOEING**  
737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 | NOMENCLATURE                                                                                                                                              | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|---------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 22                                                      |                |               | HARDWARE INSTL-LAV<br>(EQUIPMENT/FURNISHINGS<br>ONLY)                                                                                                     | 056416            |                      |
| - 1                                                     | MODREF216852   |               | HARDWARE INSTL-LAV A<br>(EQUIPMENT/FURNISHINGS<br>ONLY)<br>MODULE NUMBER:<br>417A1158-1 REV C<br>FOR OTHER SYS DETAILS SEE:<br>21-23-00-13<br>38-31-00-01 | 056082            | RF                   |
| - 1                                                     | MODREF233914   |               | HARDWARE INSTL-LAV A<br>(EQUIPMENT/FURNISHINGS<br>ONLY)<br>MODULE NUMBER:<br>417A1158-1 REV D<br>FOR OTHER SYS DETAILS SEE:<br>21-23-00-13<br>38-31-00-01 | 083137            | RF                   |
| - 1                                                     | MODREF347416   |               | HARDWARE INSTL-LAV A<br>(EQUIPMENT/FURNISHINGS<br>ONLY)<br>MODULE NUMBER:<br>417A1158-1 REV E<br>FOR OTHER SYS DETAILS SEE:<br>21-23-00-13<br>38-31-00-01 | 138173            | RF                   |
| - 1                                                     | MODREF359409   |               | HARDWARE INSTL-LAV A<br>(EQUIPMENT/FURNISHINGS<br>ONLY)<br>MODULE NUMBER:<br>417A1158-1 REV G<br>FOR OTHER SYS DETAILS SEE:<br>21-23-00-13<br>38-31-00-01 | 174223            | RF                   |
| 5                                                       | BACB30NM5K18   | .BOLT-        |                                                                                                                                                           | 056223            | 3                    |
| 10                                                      | BACB30NM5K20   | .BOLT-        |                                                                                                                                                           | 056223            | 1                    |
| 15                                                      | NAS1149C0532R  | .WASHER-      |                                                                                                                                                           | 056223            | 4                    |
| 20                                                      | 417A1130-6     | .SHIM-        |                                                                                                                                                           | 056223            | AR                   |
| 20                                                      | 417A1130-64    | .SHIM-        |                                                                                                                                                           | 056223            | AR                   |
| 25                                                      | BACP18BC02C06P | .PIN-         |                                                                                                                                                           | 056223            | 4                    |
| 30                                                      | BACP18T4-33    | .PIN          |                                                                                                                                                           | 056137            | 2                    |
| 32                                                      | BACP18T4-27    | .PIN-         |                                                                                                                                                           | 138223            | 1                    |
| 33                                                      | BACP18T4-33    | .PIN-         |                                                                                                                                                           | 138223            | 1                    |
| 35                                                      | BACP18T4-41    | .PIN-         |                                                                                                                                                           | 056223            | 2                    |
| 40                                                      | NAS1149D0463J  | .WASHER-      |                                                                                                                                                           | 056223            | 4                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |               |                                                                                                                                                           |                   |                      |

- ITEM NOT ILLUSTRATED

R Y R

25-40-00-22

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-00  
FIG. 22  
PAGE 1  
JUN 15/23

 **BOEING**  
737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER     | 1 2 3 4 5 6 7                                           | NOMENCLATURE                                                                                                              | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|-----------------|---------------------------------------------------------|---------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 22                                                      |                 |                                                         |                                                                                                                           |                   |                      |
| 45                                                      | USC737-003-652  | .ROD-TIE                                                | SUPPLIER CODE:<br>V31293<br>SPECIFICATION NUMBER:<br>S401W121-652                                                         | 056223            | 1                    |
| 50                                                      | USC737-004-654  | .ROD-TIE                                                | SUPPLIER CODE:<br>V34742<br>SPECIFICATION NUMBER:<br>S401W121-654                                                         | 056173            | 1                    |
| 50                                                      | 777050-654      | .ROD-TIE                                                | SUPPLIER CODE:<br>V31293<br>SPECIFICATION NUMBER:<br>S401W121-654                                                         | 056173            | 1                    |
| 55                                                      | BACJ40A30-8     | .JUMPER-                                                | ATTACHING PARTS                                                                                                           | 056223            | 1                    |
| - 60                                                    | NAS1149D0416H   | .WASHER                                                 |                                                                                                                           | 056223            | 2                    |
| - 65                                                    | PLH54CD         | .NUT                                                    | SUPPLIER CODE:<br>VF0224<br>SPECIFICATION NUMBER:<br>BACN10YR4CD<br>OPTIONAL PART:<br>H52732-4CD<br>V15653<br>-----*----- | 056223            | 2                    |
| 70                                                      | NAS1922-0075-3  | .CLAMP-                                                 |                                                                                                                           | 056223            | 1                    |
| 75                                                      | BACC10JB018C026 | .CLAMP-                                                 |                                                                                                                           | 056223            | 1                    |
| 80                                                      | 417A1130-7      | .PLUG-                                                  |                                                                                                                           | 056223            | 1                    |
| 85                                                      | 411A4901-3149   | .BLANKET ASSY-INSULATION                                |                                                                                                                           | 056223            | 1                    |
| 85                                                      | 411A4907-3149   | .BLANKET ASSY-INSULATION                                |                                                                                                                           | 056223            | 1                    |
| - 200                                                   | MODREF216856    | HARDWARE INSTL-LAV D<br>(EQUIPMENT/FURNISHINGS<br>ONLY) | MODULE NUMBER:<br>417A1158-4 REV C<br>FOR OTHER SYS DETAILS SEE:<br>38-11-51-24<br>38-31-00-04                            | 056110            | RF                   |
| - 200                                                   | MODREF283740    | HARDWARE INSTL-LAV D<br>(EQUIPMENT/FURNISHINGS<br>ONLY) | MODULE NUMBER:<br>417A1158-4 REV D<br>FOR OTHER SYS DETAILS SEE:<br>38-11-51-24<br>38-31-00-04                            | 111337            | RF                   |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                 |                                                         |                                                                                                                           |                   |                      |

- ITEM NOT ILLUSTRATED

R Y R

25-40-00-22

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-00  
FIG. 22  
PAGE 2  
JUN 15/23


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER   | 1 2 3 4 5 6 7<br>NOMENCLATURE                                                                                                                                                                     | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|---------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 22                                                      |               |                                                                                                                                                                                                   |                   |                      |
| - 200                                                   | MODREF553263  | HARDWARE INSTL-LAV D<br>(EQUIPMENT/FURNISHINGS<br>ONLY)<br>MODULE NUMBER:<br>417A1158-32 REV D<br>FOR OTHER SYS DETAILS SEE:<br>38-11-51-24<br>38-31-00-04                                        | 378416            | RF                   |
| - 200                                                   | MODREF553264  | HARDWARE INSTL-LAV D<br>(EQUIPMENT/FURNISHINGS<br>ONLY)<br>MODULE NUMBER:<br>417A1158-4 REV E<br>FOR OTHER SYS DETAILS SEE:<br>38-11-51-24<br>38-31-00-04                                         | 338377            | RF                   |
| 205                                                     | 1002CC15      | .JUMPER ASSY<br>SUPPLIER CODE:<br>V1FF12<br>SPECIFICATION NUMBER:<br>BACJ40A30-15<br>ATTACHING PARTS                                                                                              | 056416            | 1                    |
| - 210                                                   | NAS1149D0416H | .WASHER                                                                                                                                                                                           | 056416            | 2                    |
| - 215                                                   | PLH54CD       | .NUT<br>SUPPLIER CODE:<br>VF0224<br>SPECIFICATION NUMBER:<br>BACN10YR4CD<br>OPTIONAL PART:<br>H52732-4CD<br>V15653                                                                                | 056416            | 2                    |
| 220                                                     | SLC4B8        | -----*-----<br>.PIN-<br>SUPPLIER CODE:<br>V16258<br>SPECIFICATION NUMBER:<br>BACP18AM4B8HC<br>OPTIONAL PART:<br>LG4CB8<br>V83014<br>BLC4B8S<br>V84256<br>STANDARD SUBSTITUTION:<br>BACP18AM4B08HC | 056377            | 2                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |               |                                                                                                                                                                                                   |                   |                      |

— ITEM NOT ILLUSTRATED

RYR

25-40-00-22

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

25-40-00  
 FIG. 22  
 PAGE 3  
 DEC 15/23


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 | NOMENCLATURE                                                                                                                                                             | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|---------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 22                                                      |                |               |                                                                                                                                                                          |                   |                      |
| 220                                                     | BLC4B9S        | .PIN-         | SUPPLIER CODE:<br>V84256<br>SPECIFICATION NUMBER:<br>BACP18AM4B9HC<br>OPTIONAL PART:<br>LG4CB9<br>V83014<br>SLC4B9<br>V16258<br>STANDARD SUBSTITUTION:<br>BACP18AM4B09HC | 056377            | 2                    |
| 220                                                     | BLC4B08S       | .PIN-         | SUPPLIER CODE:<br>V84256<br>SPECIFICATION NUMBER:<br>BACP18AM4B08HC<br>OPTIONAL PART:<br>LG4CB08<br>V83014<br>SLC4B08<br>V16258                                          | 378416            | 2                    |
| 220                                                     | BLC4B09S       | .PIN-         | SUPPLIER CODE:<br>V84256<br>SPECIFICATION NUMBER:<br>BACP18AM4B09HC<br>OPTIONAL PART:<br>LG4CB09<br>V83014<br>SLC4B09<br>V16258                                          | 378416            | 2                    |
| 225                                                     | NAS1149E0463P  | .WASHER       |                                                                                                                                                                          | 056416            | 2                    |
| 226                                                     | 401W1290-272   | .ROD ASSY-TIE |                                                                                                                                                                          | 056416            | 1                    |
| 227                                                     | BACN11U6CD2N   | ..NUT         |                                                                                                                                                                          | 056416            | 2                    |
| 228                                                     | 411A1290-207   | ..ROD END     |                                                                                                                                                                          | 056416            | 2                    |
| 229                                                     | 401W1291-272   | ..TIE ROD     |                                                                                                                                                                          | 056416            | 1                    |
| 230                                                     | 1454-3         | .ROD-TIE      | SUPPLIER CODE:<br>V34742                                                                                                                                                 | 056110            | 1                    |
| 230                                                     | 1587-1         | .ROD-TIE      | SUPPLIER CODE:<br>V34742<br>MISCELLANEOUS DATA:<br>401W1290-272 IS BOEING<br>PREFERRED SPARE PART.                                                                       | 056416            | 1                    |
| 235                                                     | NAS1922-0100-3 | .CLAMP        |                                                                                                                                                                          | 056416            | 1                    |
| 240                                                     | BACB30NM3K9    | .BOLT         |                                                                                                                                                                          | 056416            | 8                    |
| 245                                                     | NAS1149C0332R  | .WASHER       |                                                                                                                                                                          | 056416            | 8                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |               |                                                                                                                                                                          |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R

25-40-00-22

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

25-40-00  
 FIG. 22  
 PAGE 4  
 DEC 15/23




**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER   | 1 2 3 4 5 6 7<br>NOMENCLATURE                                                                                                                             | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|---------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 22                                                      |               |                                                                                                                                                           |                   |                      |
| 250                                                     | 417A1130-8    | .SHIM                                                                                                                                                     | 056416            | AR                   |
| - 400                                                   | MODREF216857  | HARDWARE INSTL-LAV E<br>(EQUIPMENT/FURNISHINGS<br>ONLY)<br>MODULE NUMBER:<br>417A1158-5 REV C<br>FOR OTHER SYS DETAILS SEE:<br>38-11-51-25<br>38-31-00-05 | 056110            | RF                   |
| - 400                                                   | MODREF283741  | HARDWARE INSTL-LAV E<br>(EQUIPMENT/FURNISHINGS<br>ONLY)<br>MODULE NUMBER:<br>417A1158-5 REV D<br>FOR OTHER SYS DETAILS SEE:<br>38-11-51-25<br>38-31-00-05 | 111155            | RF                   |
| - 400                                                   | MODREF362683  | HARDWARE INSTL-LAV E<br>(EQUIPMENT/FURNISHINGS<br>ONLY)<br>MODULE NUMBER:<br>417A1158-5 REV E<br>FOR OTHER SYS DETAILS SEE:<br>38-11-51-25<br>38-31-00-05 | 156337            | RF                   |
| - 400                                                   | MODREF553262  | HARDWARE INSTL-LAV E<br>(EQUIPMENT/FURNISHINGS<br>ONLY)<br>MODULE NUMBER:<br>417A1158-5 REV F<br>FOR OTHER SYS DETAILS SEE:<br>38-11-51-25<br>38-31-00-05 | 338416            | RF                   |
| 405                                                     | 1002CC15      | .JUMPER ASSY-<br>SUPPLIER CODE:<br>V1FF12<br>SPECIFICATION NUMBER:<br>BACJ40A30-15<br>ATTACHING PARTS                                                     | 056416            | 1                    |
| - 410                                                   | NAS1149D0416H | .WASHER                                                                                                                                                   | 056416            | 2                    |
| - 415                                                   | PLH54CD       | .NUT<br>SUPPLIER CODE:<br>VF0224<br>SPECIFICATION NUMBER:<br>BACN10YR4CD<br>OPTIONAL PART:<br>H52732-4CD<br>V15653<br>-----*-----                         | 056416            | 2                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |               |                                                                                                                                                           |                   |                      |

- ITEM NOT ILLUSTRATED

RYR

25-40-00-22

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-00  
 FIG. 22  
 PAGE 5  
 DEC 15/23


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 | NOMENCLATURE                                                                                                                                                              | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|---------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 22<br>420                                               | SLC4B8         | .PIN-         | SUPPLIER CODE:<br>V16258<br>SPECIFICATION NUMBER:<br>BACP18AM4B8HC<br>OPTIONAL PART:<br>LG4CB8<br>V83014<br>BLC4B8S<br>V84256<br>STANDARD SUBSTITUTION:<br>BACP18AM4B08HC | 056416            | 2                    |
| 420                                                     | BLC4B9S        | .PIN-         | SUPPLIER CODE:<br>V84256<br>SPECIFICATION NUMBER:<br>BACP18AM4B9HC<br>OPTIONAL PART:<br>LG4CB9<br>V83014<br>SLC4B9<br>V16258<br>STANDARD SUBSTITUTION:<br>BACP18AM4B09HC  | 056416            | 2                    |
| 425                                                     | NAS1149E0463P  | .WASHER-      |                                                                                                                                                                           | 056416            | 2                    |
| 426                                                     | 401W1290-272   | .ROD ASSY-TIE |                                                                                                                                                                           | 056416            | 1                    |
| 427                                                     | BACN11U6CD2N   | ..NUT         |                                                                                                                                                                           | 056416            | 2                    |
| 428                                                     | 411A1290-207   | ..ROD END     |                                                                                                                                                                           | 056416            | 2                    |
| 429                                                     | 401W1291-272   | ..TIE ROD     |                                                                                                                                                                           | 056416            | 1                    |
| 430                                                     | 1454-3         | .ROD-TIE      | SUPPLIER CODE:<br>V34742                                                                                                                                                  | 056110            | 1                    |
| 430                                                     | 1587-1         | .ROD-TIE      | SUPPLIER CODE:<br>V34742<br>MISCELLANEOUS DATA:<br>401W1290-272 IS BOEING<br>PREFERRED SPARE PART.                                                                        | 056416            | 1                    |
| 435                                                     | NAS1922-0100-3 | .CLAMP-       |                                                                                                                                                                           | 056416            | 1                    |
| 440                                                     | BACB30NM3K9    | .BOLT-        |                                                                                                                                                                           | 056416            | 8                    |
| 445                                                     | NAS1149C0332R  | .WASHER-      |                                                                                                                                                                           | 056416            | 8                    |
| 450                                                     | 417A1130-8     | .SHIM-        |                                                                                                                                                                           | 056416            | AR                   |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |               |                                                                                                                                                                           |                   |                      |

— ITEM NOT ILLUSTRATED


RYR

25-40-00-22

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

25-40-00  
 FIG. 22  
 PAGE 6  
 DEC 15/23

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

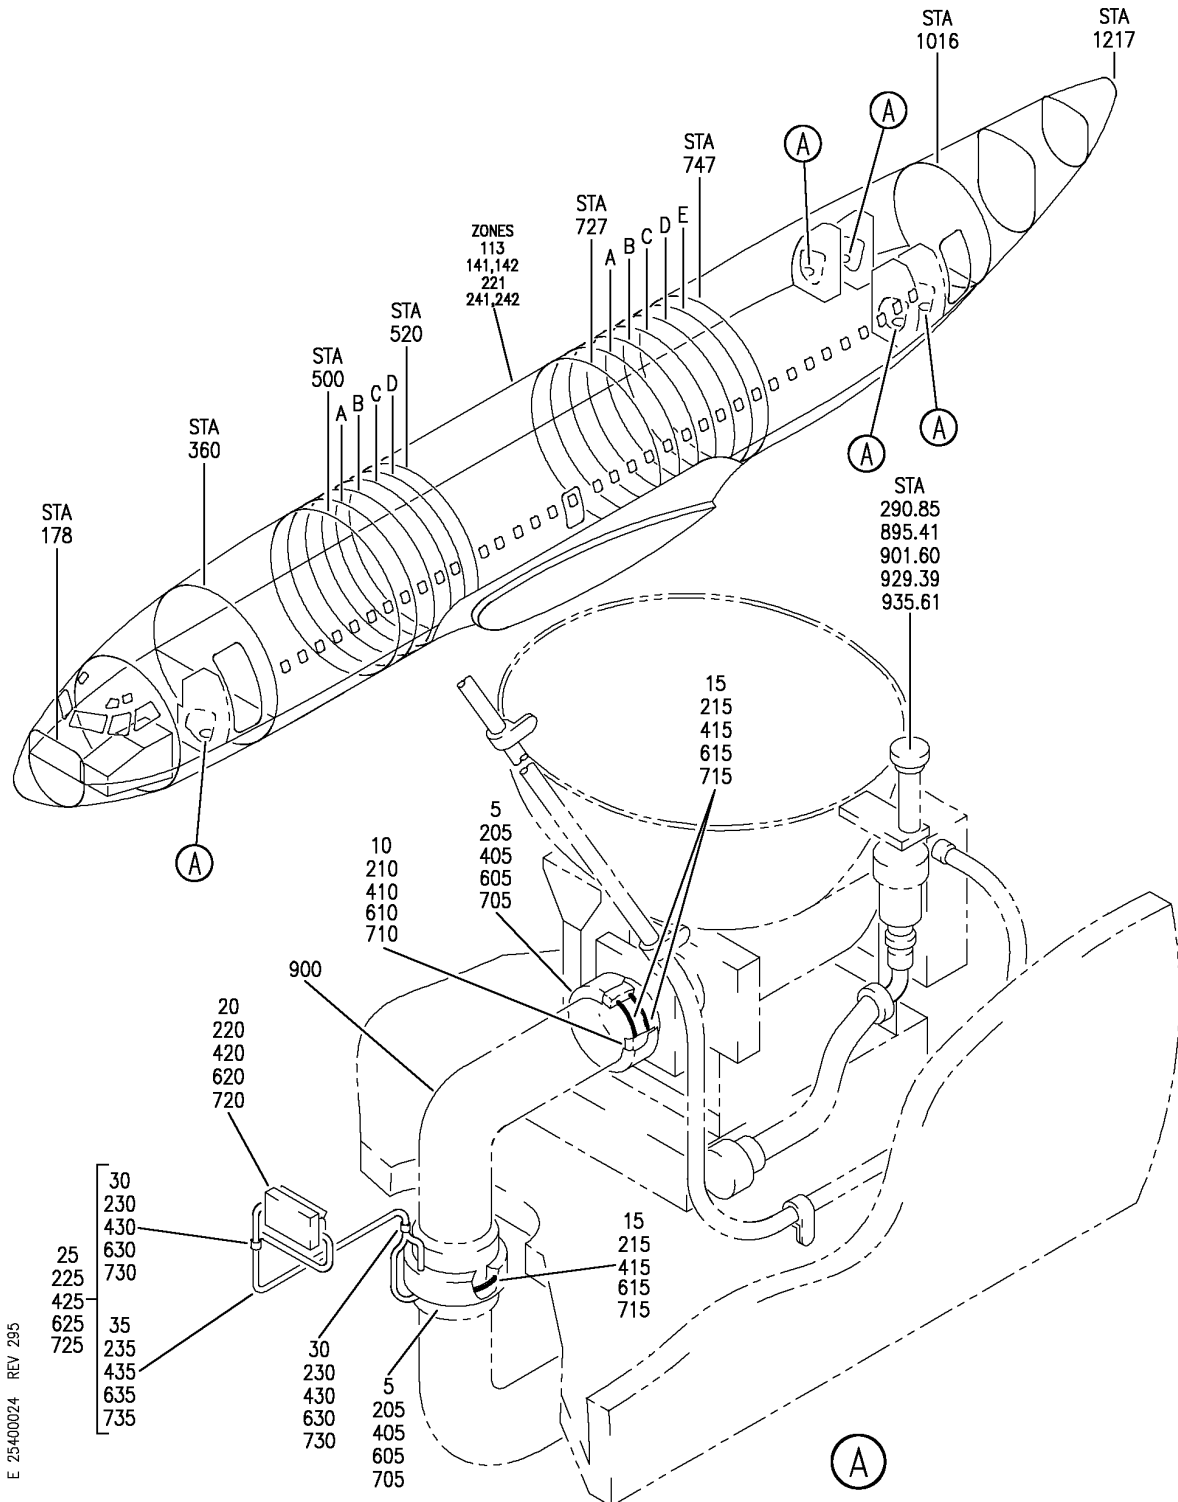

E 25400024 REV 295

TOILET INSTL-LAV A, D, E, G AND H (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 24

**25-40-00-24**

R/YR  
FEB 15/21

25-40-00-24  
PAGE 0

ECCN 9E991 BOEING PROPRIETARY - See title page for details.


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER  | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                                                                                                               | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|--------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 24                                                      |              | TOILET INSTL-LAV A, D, E,<br>G AND H<br>(EQUIPMENT/FURNISHINGS<br>ONLY)                                                                                                                                  | 056416            |                      |
| - 1                                                     | MODREF186045 | TOILET INSTL-LAV A<br>(EQUIPMENT/FURNISHINGS<br>ONLY)<br>MODULE NUMBER:<br>417A1159-31 REV A<br>FOR OTHER SYS DETAILS SEE:<br>38-32-00-11<br>38-32-01-01                                                 | 056178            | RF                   |
| - 1                                                     | MODREF394933 | TOILET INSTL-LAV A<br>(EQUIPMENT/FURNISHINGS<br>ONLY)<br>MODULE NUMBER:<br>417A1159-31 REV B<br>FOR OTHER SYS DETAILS SEE:<br>38-32-00-11<br>38-32-01-01                                                 | 179348            | RF                   |
| - 1                                                     | MODREF581237 | TOILET INSTL-LAV A<br>(EQUIPMENT/FURNISHINGS<br>ONLY)<br>MODULE NUMBER:<br>417A1159-31 REV C<br>FOR OTHER SYS DETAILS SEE:<br>38-32-00-11<br>38-32-01-01                                                 | 349416            | RF                   |
| 5                                                       | 14C02-32A    | .COUPLING-<br>SUPPLIER CODE:<br>V24984<br>SPECIFICATION NUMBER:<br>AS1655A32                                                                                                                             | 056416            | 2                    |
| 10                                                      | 14R02-32T    | .SLEEVE-<br>SUPPLIER CODE:<br>V24984<br>SPECIFICATION NUMBER:<br>AS1654T32                                                                                                                               | 056416            | 1                    |
| 15                                                      | MS29513-226  | .PACKING-<br>MISCELLANEOUS DATA:<br>THE PACKING INSTALLED ON<br>TOILET ASSY BY SUPPLIER<br>WAS REPLACED WITH THIS<br>PACKING UPON<br>INSTALLATION ON<br>AIRCRAFT.<br>MAINTENANCE MANUAL REF:<br>38-32-01 | 056416            | 3                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |              |                                                                                                                                                                                                          |                   |                      |

- ITEM NOT ILLUSTRATED

RYR

25-40-00-24

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-00  
 FIG. 24  
 PAGE 1  
 AUG 15/24


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER  | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                                                                                                                                                                                              | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|--------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 24                                                      |              |                                                                                                                                                                                                                                                                                         |                   |                      |
| 15                                                      | M83461-1-226 | .PACKING-<br>STANDARD SUBSTITUTION:<br>M83461/1-226<br>TRUE PART NUMBER:<br>M83461/1-226<br>MISCELLANEOUS DATA:<br>THE PACKING INSTALLED ON<br>TOILET ASSY BY SUPPLIER<br>WAS REPLACED WITH THIS<br>PACKING UPON<br>INSTALLATION ON<br>AIRCRAFT.<br>MAINTENANCE MANUAL REF:<br>38-32-01 | 056416            | 3                    |
| 20                                                      | 022-0188     | .CLIP-<br>SUPPLIER CODE:<br>V53421                                                                                                                                                                                                                                                      | 056416            | 1                    |
| 20                                                      | MSS021-0188  | .CLIP-<br>SUPPLIER CODE:<br>VOYXX6                                                                                                                                                                                                                                                      | 056416            | 1                    |
| 25                                                      | 478W3160-1   | .LANYARD ASSY-                                                                                                                                                                                                                                                                          | 056416            | 1                    |
| 30                                                      | GSB156       | ..SLEEVE<br>SUPPLIER CODE:<br>V59730<br>SPECIFICATION NUMBER:<br>BACS13S156B<br>OPTIONAL PART:<br>YIC156<br>V12357                                                                                                                                                                      | 056416<br>056416  | 2                    |
| 35                                                      | 478W3160-2   | ..CORD                                                                                                                                                                                                                                                                                  | 056416            | 1                    |
| - 200                                                   | MODREF186046 | TOILET INSTL-LAV D<br>(EQUIPMENT/FURNISHINGS<br>ONLY)<br>MODULE NUMBER:<br>417A1159-34 REV A<br>FOR OTHER SYS DETAILS SEE:<br>38-32-00-13<br>38-32-01-07                                                                                                                                | 056178            | RF                   |
| - 200                                                   | MODREF394932 | TOILET INSTL-LAV D<br>(EQUIPMENT/FURNISHINGS<br>ONLY)<br>MODULE NUMBER:<br>417A1159-34 REV B<br>FOR OTHER SYS DETAILS SEE:<br>38-32-00-13<br>38-32-01-07                                                                                                                                | 179348            | RF                   |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |              |                                                                                                                                                                                                                                                                                         |                   |                      |

— ITEM NOT ILLUSTRATED

RYR

25-40-00-24

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

25-40-00  
 FIG. 24  
 PAGE 2  
 AUG 15/24


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER  | 1 2 3 4 5 6 7<br>NOMENCLATURE                                                                                                                                                                                                                                                           | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|--------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 24<br>- 200                                             | MODREF581235 | TOILET INSTL-LAV D<br>(EQUIPMENT/FURNISHINGS<br>ONLY)<br>MODULE NUMBER:<br>417A1159-34 REV C<br>FOR OTHER SYS DETAILS SEE:<br>38-32-00-13<br>38-32-01-07                                                                                                                                | 349416            | RF                   |
| 205                                                     | 14C02-32A    | .COUPLING<br>SUPPLIER CODE:<br>V24984<br>SPECIFICATION NUMBER:<br>AS1655A32                                                                                                                                                                                                             | 056416            | 2                    |
| 210                                                     | 14R02-32T    | .SLEEVE<br>SUPPLIER CODE:<br>V24984<br>SPECIFICATION NUMBER:<br>AS1654T32                                                                                                                                                                                                               | 056416            | 1                    |
| 215                                                     | MS29513-226  | .PACKING-<br>MISCELLANEOUS DATA:<br>THE PACKING INSTALLED ON<br>TOILET ASSY BY SUPPLIER<br>WAS REPLACED WITH THIS<br>PACKING UPON<br>INSTALLATION ON<br>AIRCRAFT.<br>MAINTENANCE MANUAL REF:<br>38-32-01                                                                                | 056416            | 3                    |
| 215                                                     | M83461-1-226 | .PACKING-<br>STANDARD SUBSTITUTION:<br>M83461/1-226<br>TRUE PART NUMBER:<br>M83461/1-226<br>MISCELLANEOUS DATA:<br>THE PACKING INSTALLED ON<br>TOILET ASSY BY SUPPLIER<br>WAS REPLACED WITH THIS<br>PACKING UPON<br>INSTALLATION ON<br>AIRCRAFT.<br>MAINTENANCE MANUAL REF:<br>38-32-01 | 056416            | 3                    |
| 220                                                     | 022-0188     | .CLIP-<br>SUPPLIER CODE:<br>V53421                                                                                                                                                                                                                                                      | 056416            | 1                    |
| 220                                                     | MSS021-0188  | .CLIP-<br>SUPPLIER CODE:<br>VOYXX6                                                                                                                                                                                                                                                      | 056416            | 1                    |
| 225                                                     | 478W3160-1   | .LANYARD ASSY                                                                                                                                                                                                                                                                           | 056416            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |              |                                                                                                                                                                                                                                                                                         |                   |                      |

- ITEM NOT ILLUSTRATED

RYR

25-40-00-24

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-00  
 FIG. 24  
 PAGE 3  
 AUG 15/24


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER                | 1 2 3 4 5 6 7<br>NOMENCLATURE                                                                                                                                       | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 24<br>230                                               | GSB156                     | ..SLEEVE<br>SUPPLIER CODE:<br>V59730<br>SPECIFICATION NUMBER:<br>BACS13S156B<br>OPTIONAL PART:<br>YIC156<br>V12357                                                  | 056416            | 2                    |
| 235<br>- 400                                            | 478W3160-2<br>MODREF186047 | ..CORD<br>TOILET INSTL-LAV E<br>(EQUIPMENT/FURNISHINGS<br>ONLY)<br>MODULE NUMBER:<br>417A1159-35 REV A<br>FOR OTHER SYS DETAILS SEE:<br>38-32-00-14<br>38-32-01-07A | 056416<br>056178  | 1<br>RF              |
| - 400                                                   | MODREF394931               | TOILET INSTL-LAV E<br>(EQUIPMENT/FURNISHINGS<br>ONLY)<br>MODULE NUMBER:<br>417A1159-35 REV B<br>FOR OTHER SYS DETAILS SEE:<br>38-32-00-14<br>38-32-01-07A           | 179348            | RF                   |
| - 400                                                   | MODREF581236               | TOILET INSTL-LAV E<br>(EQUIPMENT/FURNISHINGS<br>ONLY)<br>MODULE NUMBER:<br>417A1159-35 REV C<br>FOR OTHER SYS DETAILS SEE:<br>38-32-00-14<br>38-32-01-07A           | 349416            | RF                   |
| 405                                                     | 14C02-32A                  | .COUPLING-<br>SUPPLIER CODE:<br>V24984<br>SPECIFICATION NUMBER:<br>AS1655A32                                                                                        | 056416            | 2                    |
| 410                                                     | 14R02-32T                  | .SLEEVE-<br>SUPPLIER CODE:<br>V24984<br>SPECIFICATION NUMBER:<br>AS1654T32                                                                                          | 056416            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                            |                                                                                                                                                                     |                   |                      |

- ITEM NOT ILLUSTRATED

RYR

25-40-00-24

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-00  
 FIG. 24  
 PAGE 4  
 JUN 15/23


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER          | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                                                                                                                                                                                              | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 24<br>415                                               | MS29513-226          | .PACKING-<br>MISCELLANEOUS DATA:<br>THE PACKING INSTALLED ON<br>TOILET ASSY BY SUPPLIER<br>WAS REPLACED WITH THIS<br>PACKING UPON<br>INSTALLATION ON<br>AIRCRAFT.<br>MAINTENANCE MANUAL REF:<br>38-32-01                                                                                | 056416            | 3                    |
| 415                                                     | M83461-1-226         | .PACKING-<br>STANDARD SUBSTITUTION:<br>M83461/1-226<br>TRUE PART NUMBER:<br>M83461/1-226<br>MISCELLANEOUS DATA:<br>THE PACKING INSTALLED ON<br>TOILET ASSY BY SUPPLIER<br>WAS REPLACED WITH THIS<br>PACKING UPON<br>INSTALLATION ON<br>AIRCRAFT.<br>MAINTENANCE MANUAL REF:<br>38-32-01 | 056416            | 3                    |
| 420                                                     | 022-0188             | .CLIP-<br>SUPPLIER CODE:<br>V53421                                                                                                                                                                                                                                                      | 056416            | 1                    |
| 420                                                     | MSS021-0188          | .CLIP-<br>SUPPLIER CODE:<br>VOYXX6                                                                                                                                                                                                                                                      | 056416            | 1                    |
| 425<br>430                                              | 478W3160-1<br>GSB156 | .LANYARD ASSY-<br>..SLEEVE<br>SUPPLIER CODE:<br>V59730<br>SPECIFICATION NUMBER:<br>BACS13S156B<br>OPTIONAL PART:<br>YIC156<br>V12357                                                                                                                                                    | 056416<br>056416  | 1<br>2               |
| 435<br>900                                              | 478W3160-2           | ..CORD<br>ILLUSTRATION REFERENCE:<br>TOILET ASSY-LAV A VACUUM<br>38-32-01-60                                                                                                                                                                                                            | 056416<br>056416  | 1<br>RF              |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                      |                                                                                                                                                                                                                                                                                         |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R


25-40-00-24

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

25-40-00  
 FIG. 24  
 PAGE 5  
 AUG 15/24



**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

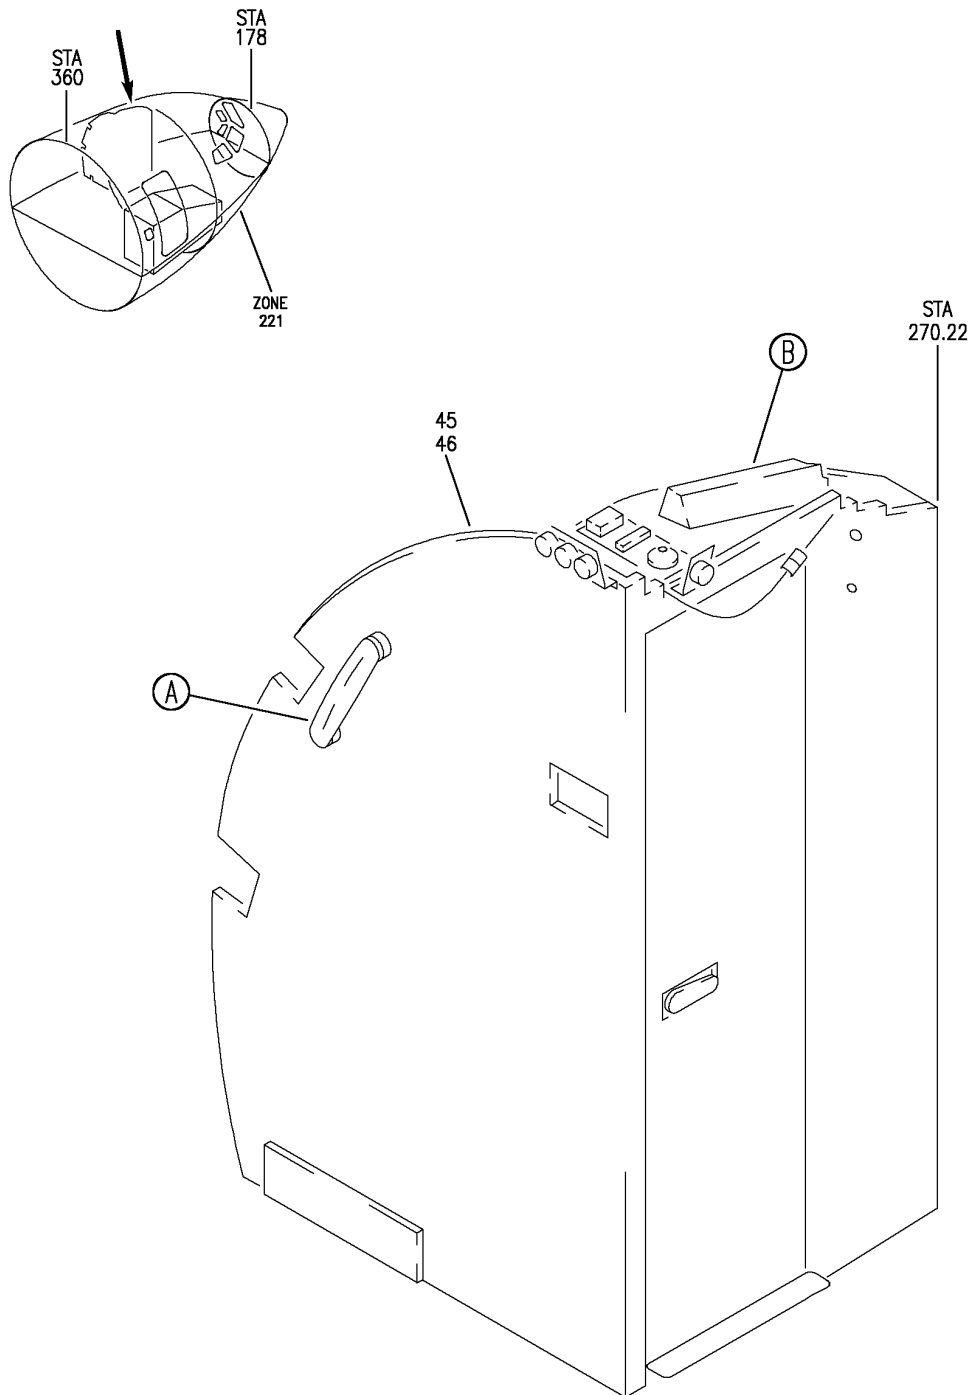

E 25400026 SHT 1 REV 283




LAVATORY INSTL-LAV A  
FIGURE 26 (SHEET 1)

**25-40-00-26**

R Y R  
F E B 15 / 20

25-40-00-26  
PAGE 0

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

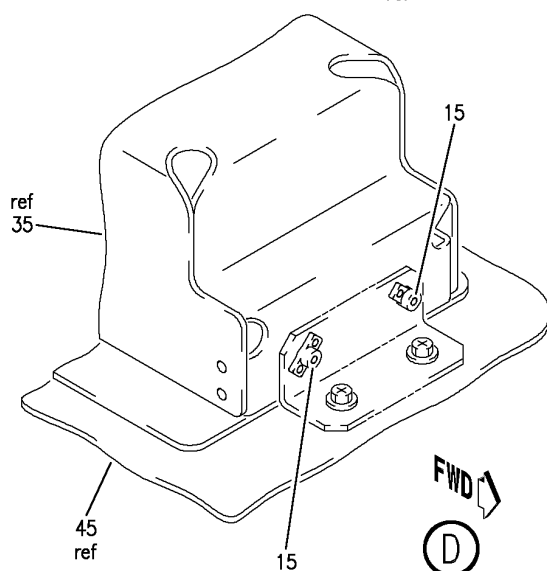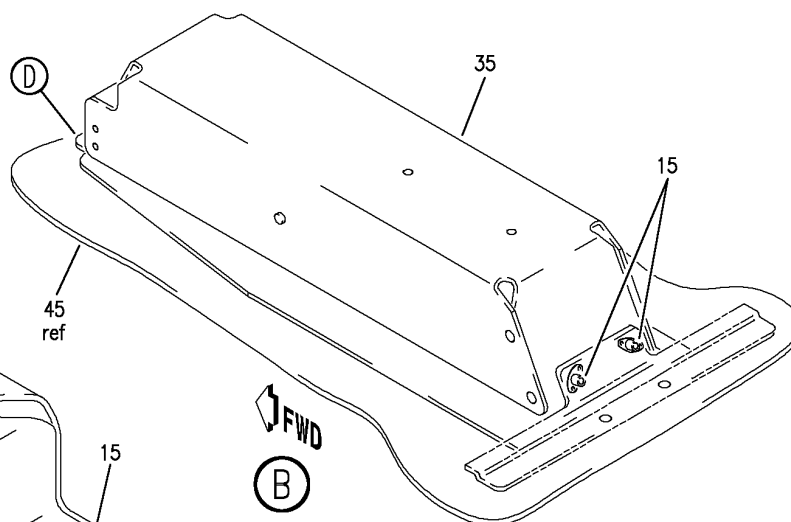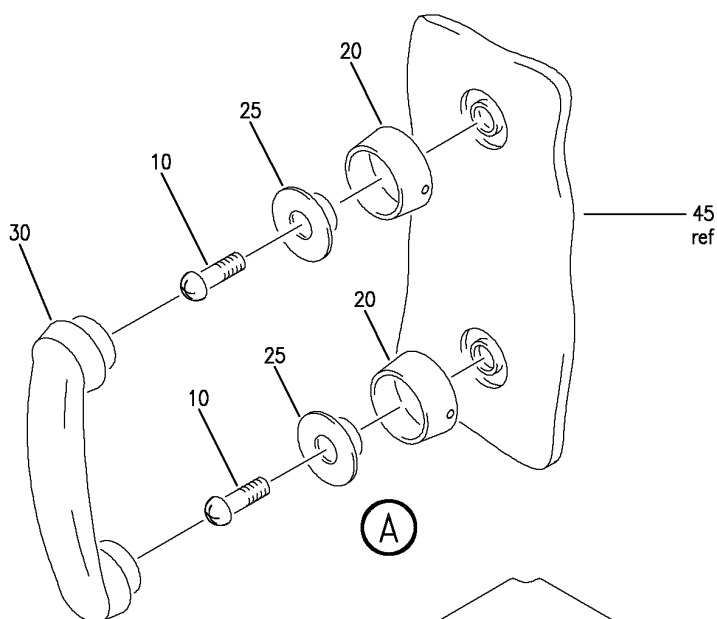

25-40-00-26

25-40-00-26  
PAGE 0A

ECCN 9E991 BOEING PROPRIETARY – See title page for details.


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 | NOMENCLATURE                                                                                                                                                                                                                                                                                                                                                                                       | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|---------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 26                                                      |                |               |                                                                                                                                                                                                                                                                                                                                                                                                    |                   |                      |
| - 1                                                     | MODREF202179   |               | LAVATORY INSTL-LAV A<br>LAVATORY INSTL-LAV A<br>MODULE NUMBER:<br>417A1158-113C REV A                                                                                                                                                                                                                                                                                                              | 056057<br>056057  | RF                   |
| 10                                                      | BACB30LK3-4    |               | .BOLT                                                                                                                                                                                                                                                                                                                                                                                              | 056057            | 2                    |
| 15                                                      | BACS12FA08K8   |               | .SCREW-                                                                                                                                                                                                                                                                                                                                                                                            | 056057            | 4                    |
| 20                                                      | 65-5458-21E    |               | .NUT                                                                                                                                                                                                                                                                                                                                                                                               | 056057            | 2                    |
| 25                                                      | 66-4302        |               | .COLLAR                                                                                                                                                                                                                                                                                                                                                                                            | 056057            | 2                    |
| 30                                                      | 65-5458-20E    |               | .HANDLE-SPRT                                                                                                                                                                                                                                                                                                                                                                                       | 056057            | 1                    |
| 35                                                      | 417N3810-127K  |               | .BOX ASSY-                                                                                                                                                                                                                                                                                                                                                                                         | 056057            | 1                    |
|                                                         |                |               | MISCELLANEOUS DATA:<br>AFFECTED BY<br>AD2012-11-09. READ AD<br>FOR FULL COMPLIANCE.<br>COMPONENT MAINT MANUAL REF:<br>35-21-34<br>FOR DETAILS SEE:<br>35-22-11-02<br>35-22-21-02<br>35-22-31-25                                                                                                                                                                                                    |                   |                      |
| 45                                                      | D72000003-111A |               | .MODULE ASSY-LAV A<br>SUPPLIER CODE:<br>VJ4577<br>SPECIFICATION NUMBER:<br>S417A180-0003A<br>ELECTRICAL EQUIP NUMBER:<br>M01415<br>COMPONENT MAINT MANUAL REF:<br>25-42-91<br>FUNCTIONAL REFERENCE:<br>AIR CONDITIONING<br>FOR DETAILS SEE<br>21-24-51-60G<br>21-45-51-56A<br>EQUIPMENT/FURNISHINGS<br>FOR DETAILS SEE<br>25-40-01-51G<br>PLACARDS AND MARKINGS<br>FOR DETAILS SEE<br>11-32-05-56D | 056057            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |               |                                                                                                                                                                                                                                                                                                                                                                                                    |                   |                      |

- ITEM NOT ILLUSTRATED


RYR

25-40-00-26

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-00  
 FIG. 26  
 PAGE 1  
 OCT 15/24

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

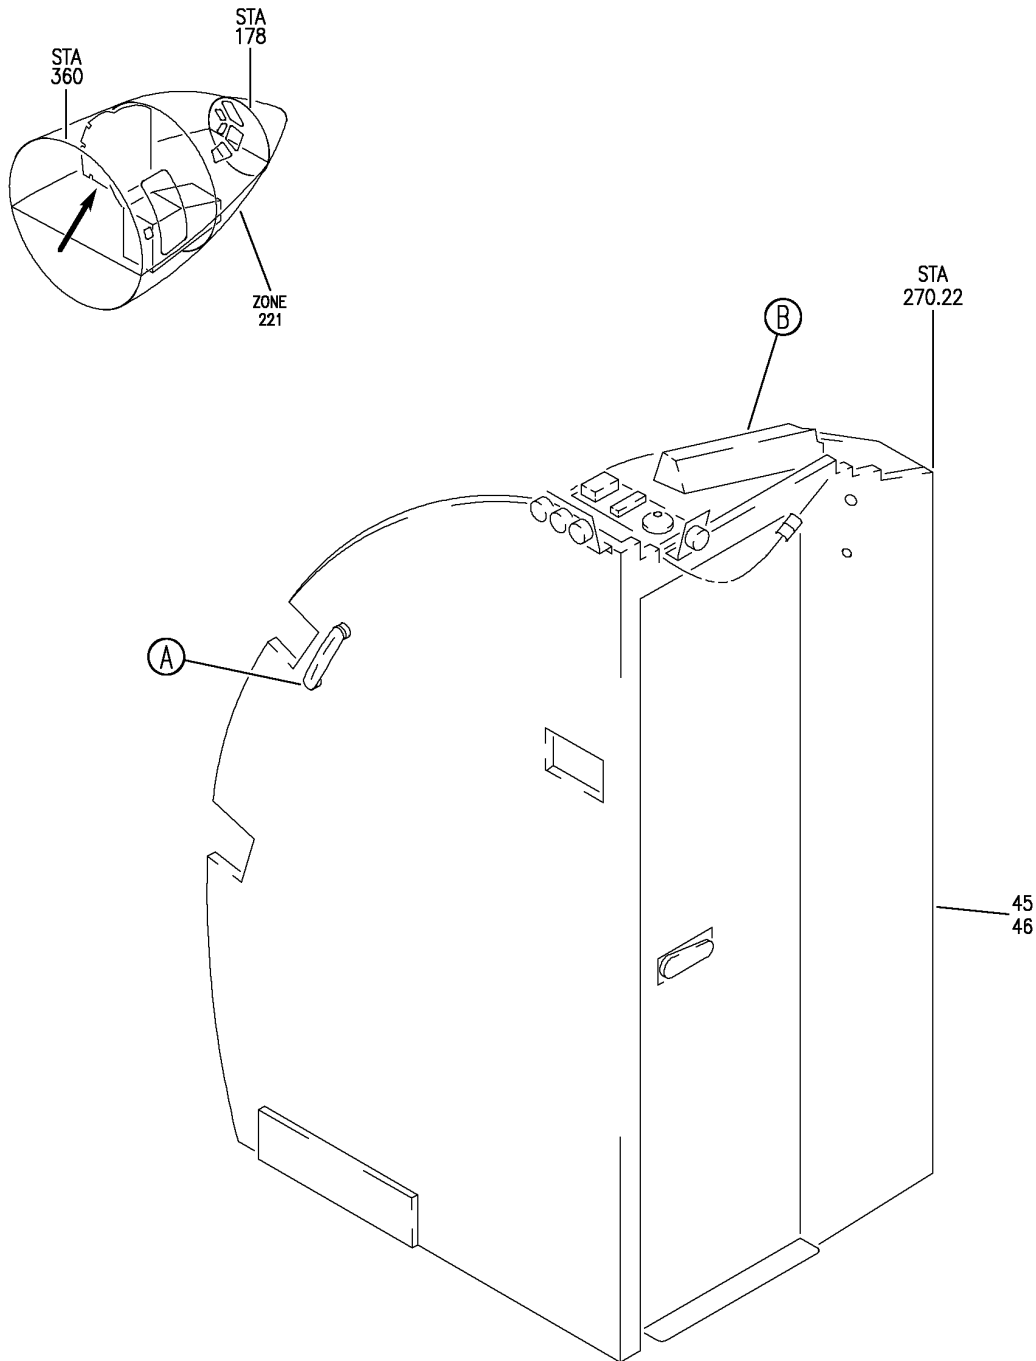

E 25400026A SHT 1 REV 283

LAVATORY INSTL-LAV A  
FIGURE 26A (SHEET 1)


**25-40-00-26A**

R Y R  
F E B 15 / 20

25-40-00-26A  
PAGE 0

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

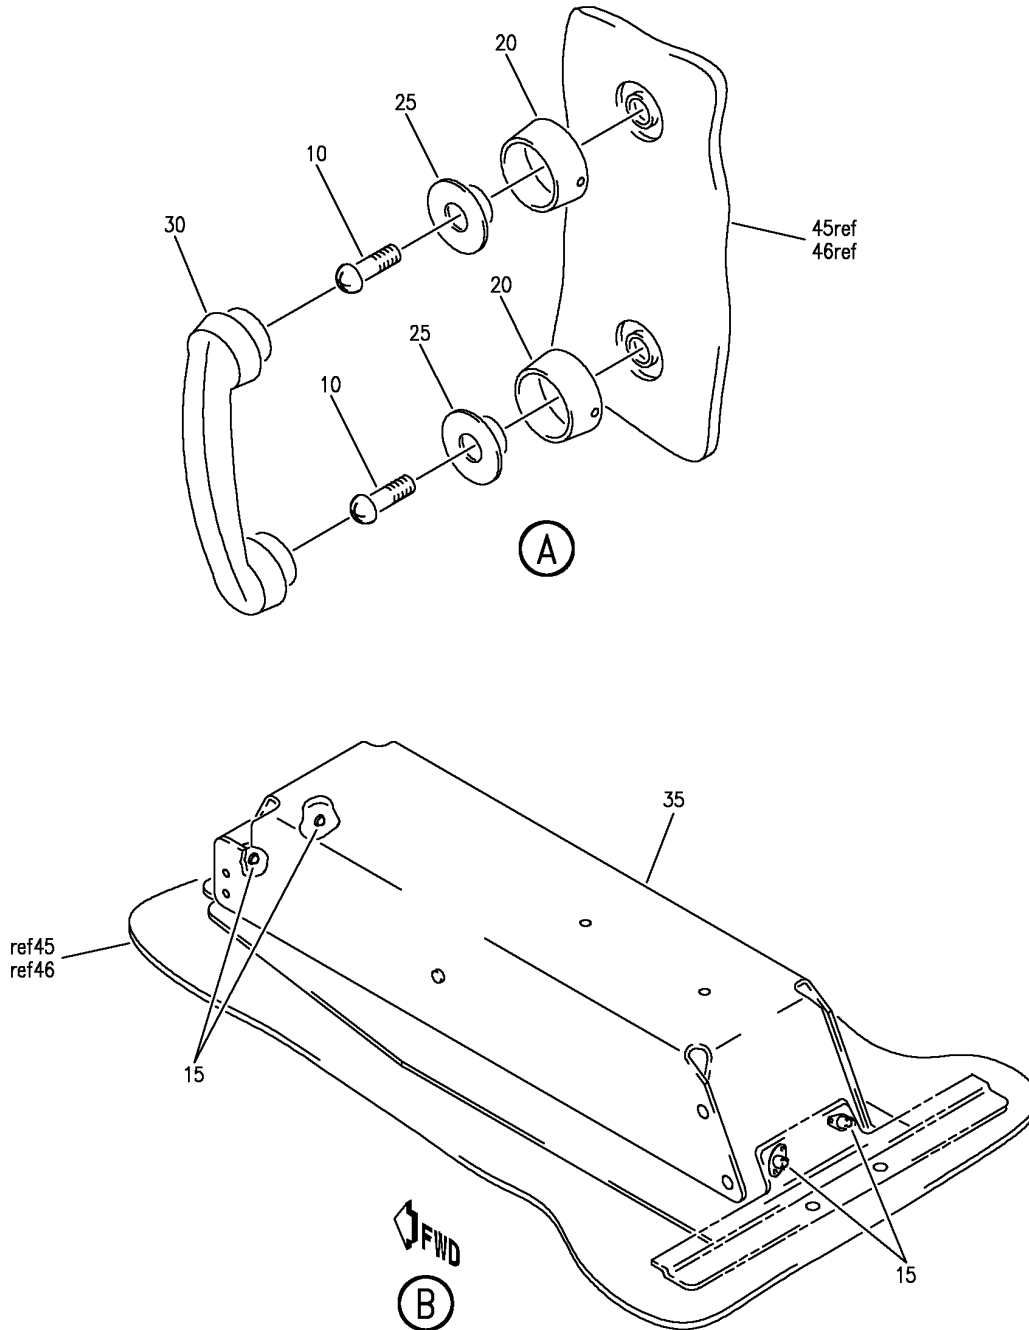

E 25400026A SHT 2 REV 098

LAVATORY INSTL-LAV A  
FIGURE 26A (SHEET 2)

**25-40-00-26A**

R Y R  
O C T 10 / 06

25-40-00-26A  
PAGE 0A

ECCN 9E991 BOEING PROPRIETARY - See title page for details.


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER   | 1 2 3 4 5 6 7 | NOMENCLATURE                                                                                                                                                                                                  | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|---------------|---------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 26A                                                     |               |               |                                                                                                                                                                                                               |                   |                      |
| - 1                                                     | MODREF224736  |               | LAVATORY INSTL-LAV A<br>LAVATORY INSTL-LAV A<br>MODULE NUMBER:<br>417A1158-113C REV B                                                                                                                         | 058204<br>058204  | R F                  |
| 10                                                      | BACB30LK3-4   |               | .BOLT                                                                                                                                                                                                         | 058204            | 2                    |
| 15                                                      | BACS12FA08K8  |               | .SCREW                                                                                                                                                                                                        | 058204            | 4                    |
| 20                                                      | 65-5458-21E   |               | .NUT                                                                                                                                                                                                          | 058204            | 2                    |
| 25                                                      | 66-4302       |               | .COLLAR                                                                                                                                                                                                       | 058204            | 2                    |
| 30                                                      | 65-5458-20E   |               | .HANDLE-SPRT                                                                                                                                                                                                  | 058204            | 1                    |
| 35                                                      | 417N3810-127P |               | .BOX ASSY-<br>MISCELLANEOUS DATA:<br>AFFECTED BY<br>AD2012-11-09. READ AD<br>FOR FULL COMPLIANCE.<br>COMPONENT MAINT MANUAL REF:<br>35-21-34<br>FOR DETAILS SEE:<br>35-22-11-02<br>35-22-21-02<br>35-22-31-25 | 058204            | 1                    |
| 35                                                      | 417N3810-179B |               | .BOX ASSY-<br>MISCELLANEOUS DATA:<br>AFFECTED BY<br>AD2012-11-09. READ AD<br>FOR FULL COMPLIANCE.<br>FOR DETAILS SEE:<br>35-22-11-05B<br>35-22-21-02B<br>35-22-31-26B                                         | 058204            | 1                    |
| 35                                                      | 417N3810-195P |               | .BOX ASSY-SVCE UNIT OXY<br>FUNCTIONAL DESCRIPTION:<br>THIS PART PROVIDES<br>OXYGEN FOR THE LAVATORY.<br>FOR DETAILS SEE:<br>35-21-00-03<br>35-22-21-03E<br>35-22-31-27K<br>35-22-51-05L                       | 058204            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |               |               |                                                                                                                                                                                                               |                   |                      |

- ITEM NOT ILLUSTRATED

R Y R

25-40-00-26A

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-00  
FIG. 26A  
PAGE 1  
JUN 15/24


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                                                                                                                                                                                                                                                                                                        | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 26A<br>45                                               | D72000053-111A | .MODULE ASSY-LAV A<br>SUPPLIER CODE:<br>VJ4577<br>SPECIFICATION NUMBER:<br>S417A180-0053A<br>ELECTRICAL EQUIP NUMBER:<br>M01415<br>COMPONENT MAINT MANUAL REF:<br>25-42-38<br>FUNCTIONAL REFERENCE:<br>AIR CONDITIONING<br>FOR DETAILS SEE<br>21-24-51-60F<br>21-45-51-56<br>EQUIPMENT/FURNISHINGS<br>FOR DETAILS SEE<br>25-40-01-56D<br>PLACARDS AND MARKINGS<br>FOR DETAILS SEE<br>11-32-05-56C | 058204            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |                                                                                                                                                                                                                                                                                                                                                                                                   |                   |                      |

— ITEM NOT ILLUSTRATED


R Y R

25-40-00-26A

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

25-40-00  
 FIG. 26A  
 PAGE 2  
 AUG 15/24

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

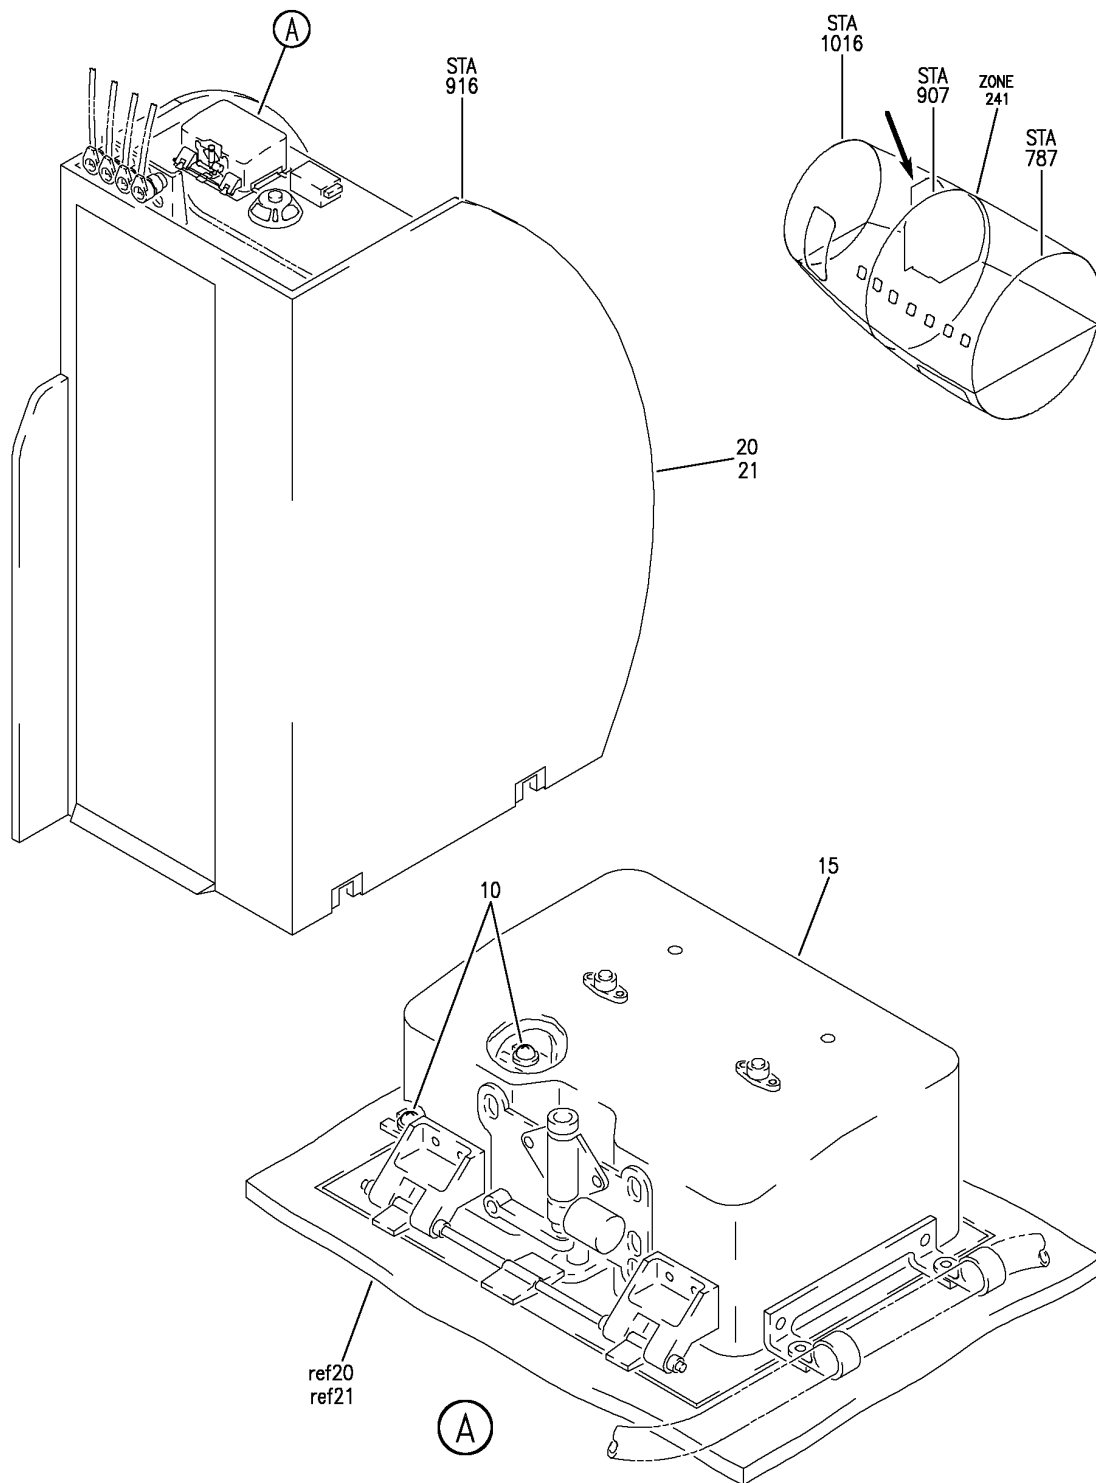

E 25400027 REV 299

LAVATORY INSTL-LAV D  
FIGURE 27

**25-40-00-27**

R Y R  
JUN 15/21

25-40-00-27  
PAGE 0

ECCN 9E991 BOEING PROPRIETARY – See title page for details.




**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 | NOMENCLATURE                                                                                                                                                                                                                                                                                                                                                                       | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|---------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 27                                                      |                |               |                                                                                                                                                                                                                                                                                                                                                                                    |                   |                      |
| - 1                                                     | MODREF202180   |               | LAVATORY INSTL-LAV D<br>LAVATORY INSTL-LAV D<br>MODULE NUMBER:<br>417A1158-114C REV A                                                                                                                                                                                                                                                                                              | 056230<br>056230  | RF                   |
| 10                                                      | BACS12FA3K4    |               | .SCREW                                                                                                                                                                                                                                                                                                                                                                             | 056230            | 2                    |
| 15                                                      | 417N3810-137W  |               | .BOX ASSY-OXY<br>MISCELLANEOUS DATA:<br>AFFECTED BY<br>AD2012-11-09. READ AD<br>FOR FULL COMPLIANCE.<br>COMPONENT MAINT MANUAL REF:<br>35-21-34<br>FOR DETAILS SEE:<br>35-22-11-05D<br>35-22-21-02D<br>35-22-31-26D                                                                                                                                                                | 056230<br>056230  | 1                    |
| 15                                                      | 417N3810-196W  |               | .BOX ASSY-OXY<br>FUNCTIONAL DESCRIPTION:<br>THIS PART PROVIDES<br>OXYGEN FOR THE LAVATORY.<br>FOR DETAILS SEE:<br>35-21-00-02<br>35-22-21-03D<br>35-22-31-27H<br>35-22-51-05K                                                                                                                                                                                                      | 056230            | 1                    |
| 20                                                      | D72000701-111A |               | .MODULE ASSY-LAV D<br>SUPPLIER CODE:<br>VJ4577<br>SPECIFICATION NUMBER:<br>S417A180-0701A<br>ELECTRICAL EQUIP NUMBER:<br>M01418<br>COMPONENT MAINT MANUAL REF:<br>25-42-92<br>FUNCTIONAL REFERENCE:<br>AIR CONDITIONING<br>FOR DETAILS SEE<br>21-24-51-60H<br>EQUIPMENT/FURNISHINGS<br>FOR DETAILS SEE<br>25-40-01-51H<br>PLACARDS AND MARKINGS<br>FOR DETAILS SEE<br>11-32-05-56E | 056230            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |               |                                                                                                                                                                                                                                                                                                                                                                                    |                   |                      |

- ITEM NOT ILLUSTRATED


RYR

25-40-00-27

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-00  
 FIG. 27  
 PAGE 1  
 AUG 15/24

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

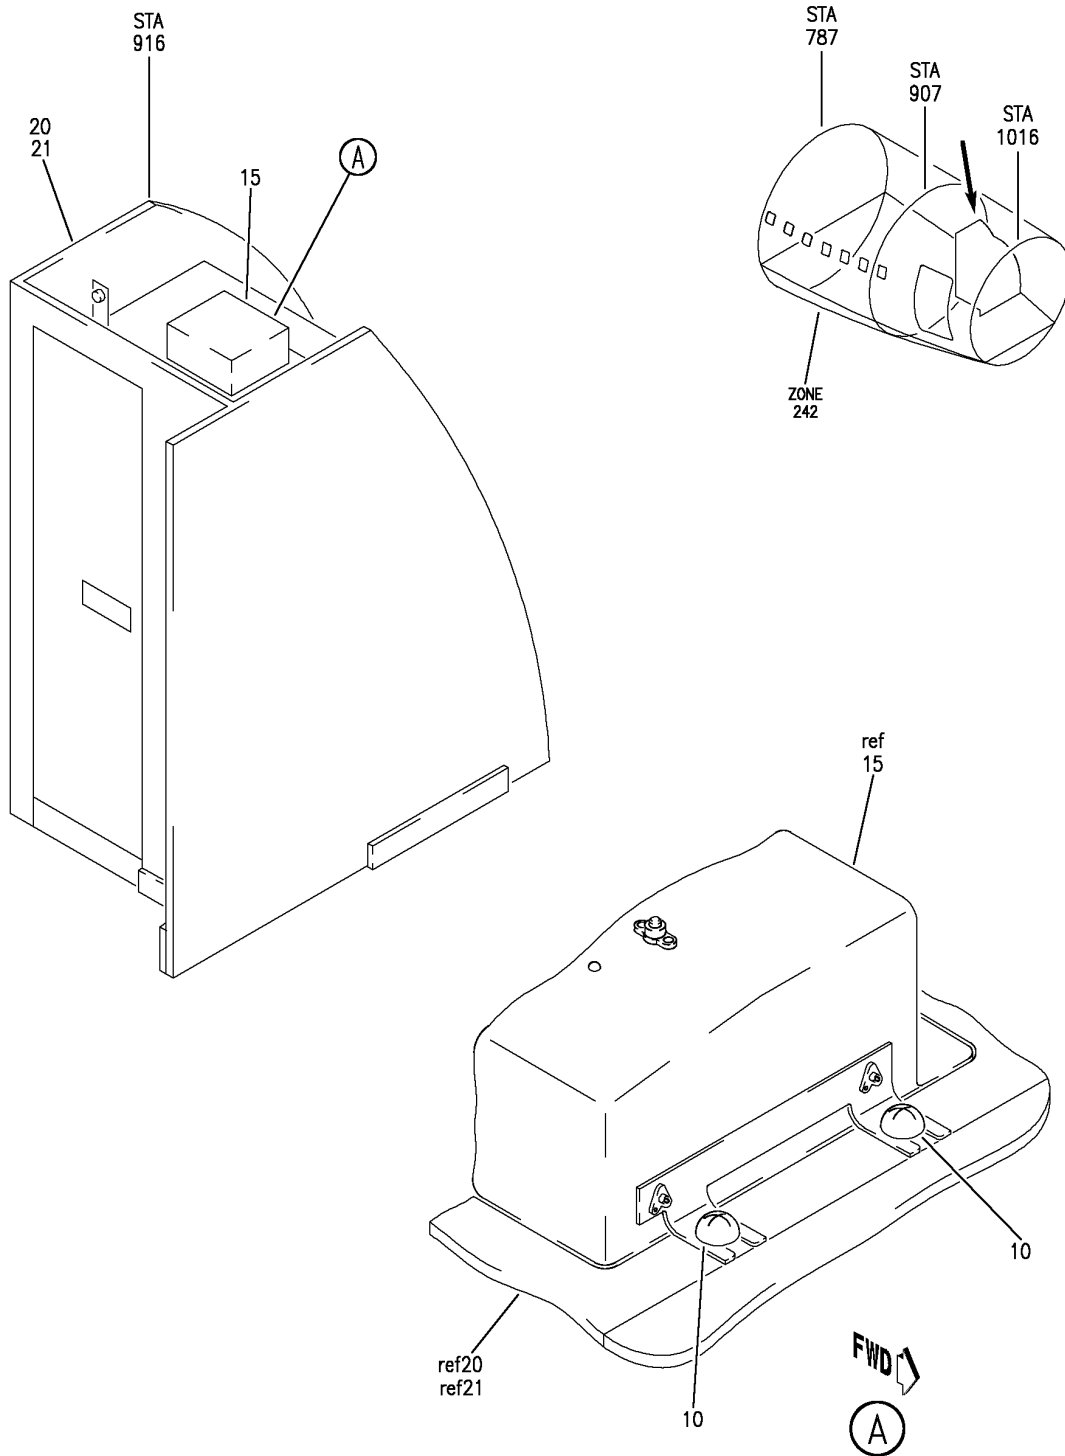

E 25400028 REV 299

LAVATORY INSTL-LAV E  
FIGURE 28

**25-40-00-28**

RJR  
JUN 15/21

25-40-00-28  
PAGE 0

ECCN 9E991 BOEING PROPRIETARY – See title page for details.


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 | NOMENCLATURE                                                                                                                                                                                                                                                                                                                                                                       | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|---------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 28                                                      |                |               |                                                                                                                                                                                                                                                                                                                                                                                    |                   |                      |
| - 1                                                     | MODREF202181   |               | LAVATORY INSTL-LAV E<br>LAVATORY INSTL-LAV E<br>MODULE NUMBER:<br>417A1158-117C REV A                                                                                                                                                                                                                                                                                              | 056230<br>056230  | RF                   |
| 10                                                      | BACS12FA3K4    |               | .SCREW                                                                                                                                                                                                                                                                                                                                                                             | 056230            | 2                    |
| 15                                                      | 417N3810-137W  |               | .BOX ASSY-OXY<br>MISCELLANEOUS DATA:<br>AFFECTED BY<br>AD2012-11-09. READ AD<br>FOR FULL COMPLIANCE.<br>COMPONENT MAINT MANUAL REF:<br>35-21-34<br>FOR DETAILS SEE:<br>35-22-11-05E<br>35-22-21-02E<br>35-22-31-26E                                                                                                                                                                | 056230<br>056230  | 1                    |
| 15                                                      | 417N3810-196W  |               | .BOX ASSY-OXY<br>FUNCTIONAL DESCRIPTION:<br>THIS PART PROVIDES<br>OXYGEN FOR THE LAVATORY.<br>FOR DETAILS SEE:<br>35-21-00-02<br>35-22-21-03D<br>35-22-31-27H<br>35-22-51-05K                                                                                                                                                                                                      | 056230            | 1                    |
| 20                                                      | D72001201-111A |               | .MODULE ASSY-LAV E<br>SUPPLIER CODE:<br>VJ4577<br>SPECIFICATION NUMBER:<br>S417A180-1201A<br>ELECTRICAL EQUIP NUMBER:<br>M01419<br>COMPONENT MAINT MANUAL REF:<br>25-42-51<br>FUNCTIONAL REFERENCE:<br>AIR CONDITIONING<br>FOR DETAILS SEE<br>21-24-51-58E<br>EQUIPMENT/FURNISHINGS<br>FOR DETAILS SEE<br>25-40-01-50C<br>PLACARDS AND MARKINGS<br>FOR DETAILS SEE<br>11-32-05-58C | 056230            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |               |                                                                                                                                                                                                                                                                                                                                                                                    |                   |                      |

- ITEM NOT ILLUSTRATED


RYR

25-40-00-28

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-00  
 FIG. 28  
 PAGE 1  
 AUG 15/24

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

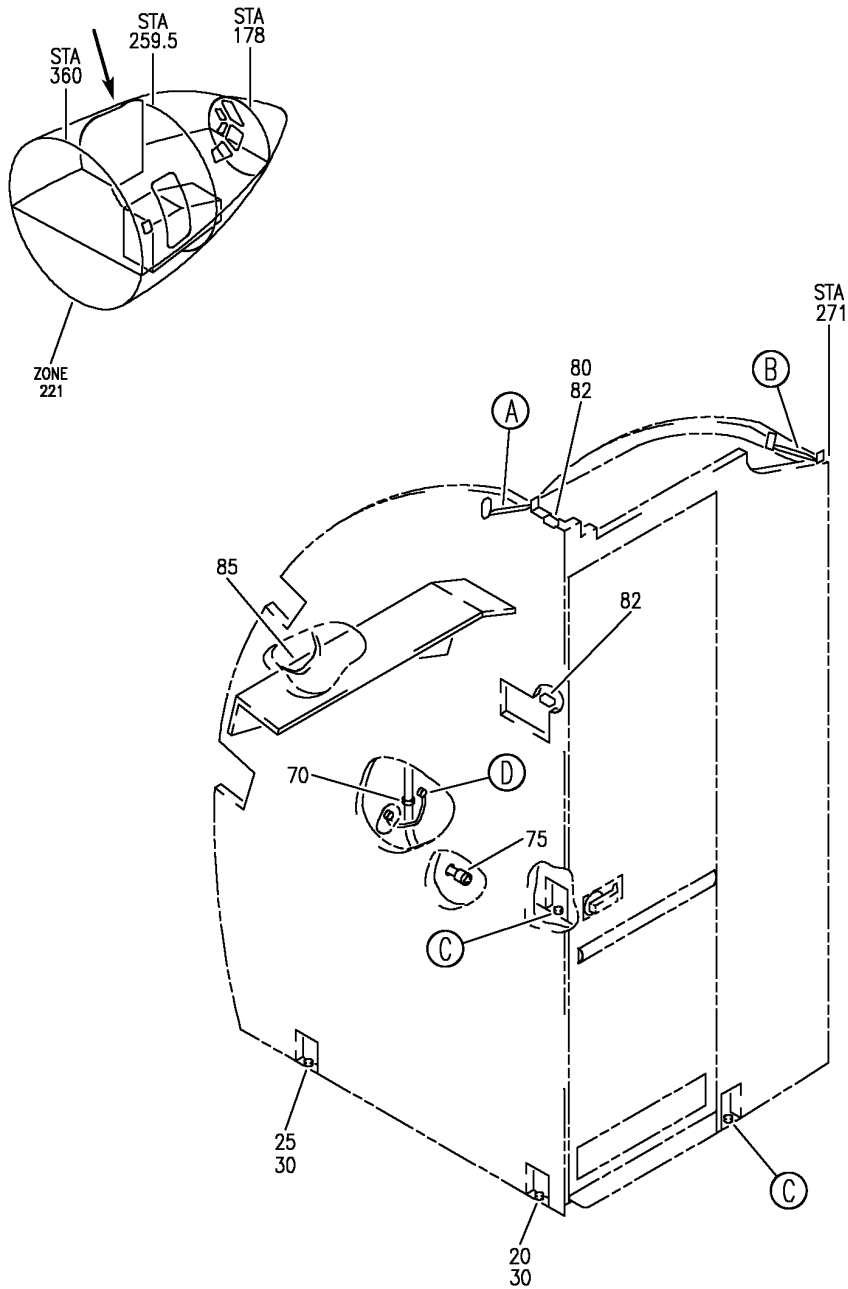

E 25400036 SHT 1 REV 160

HARDWARE INSTL-LAV A (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 36 (SHEET 1)


**25-40-00-36**

R Y R  
F E B 15 / 10

25-40-00-36  
PAGE 0

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

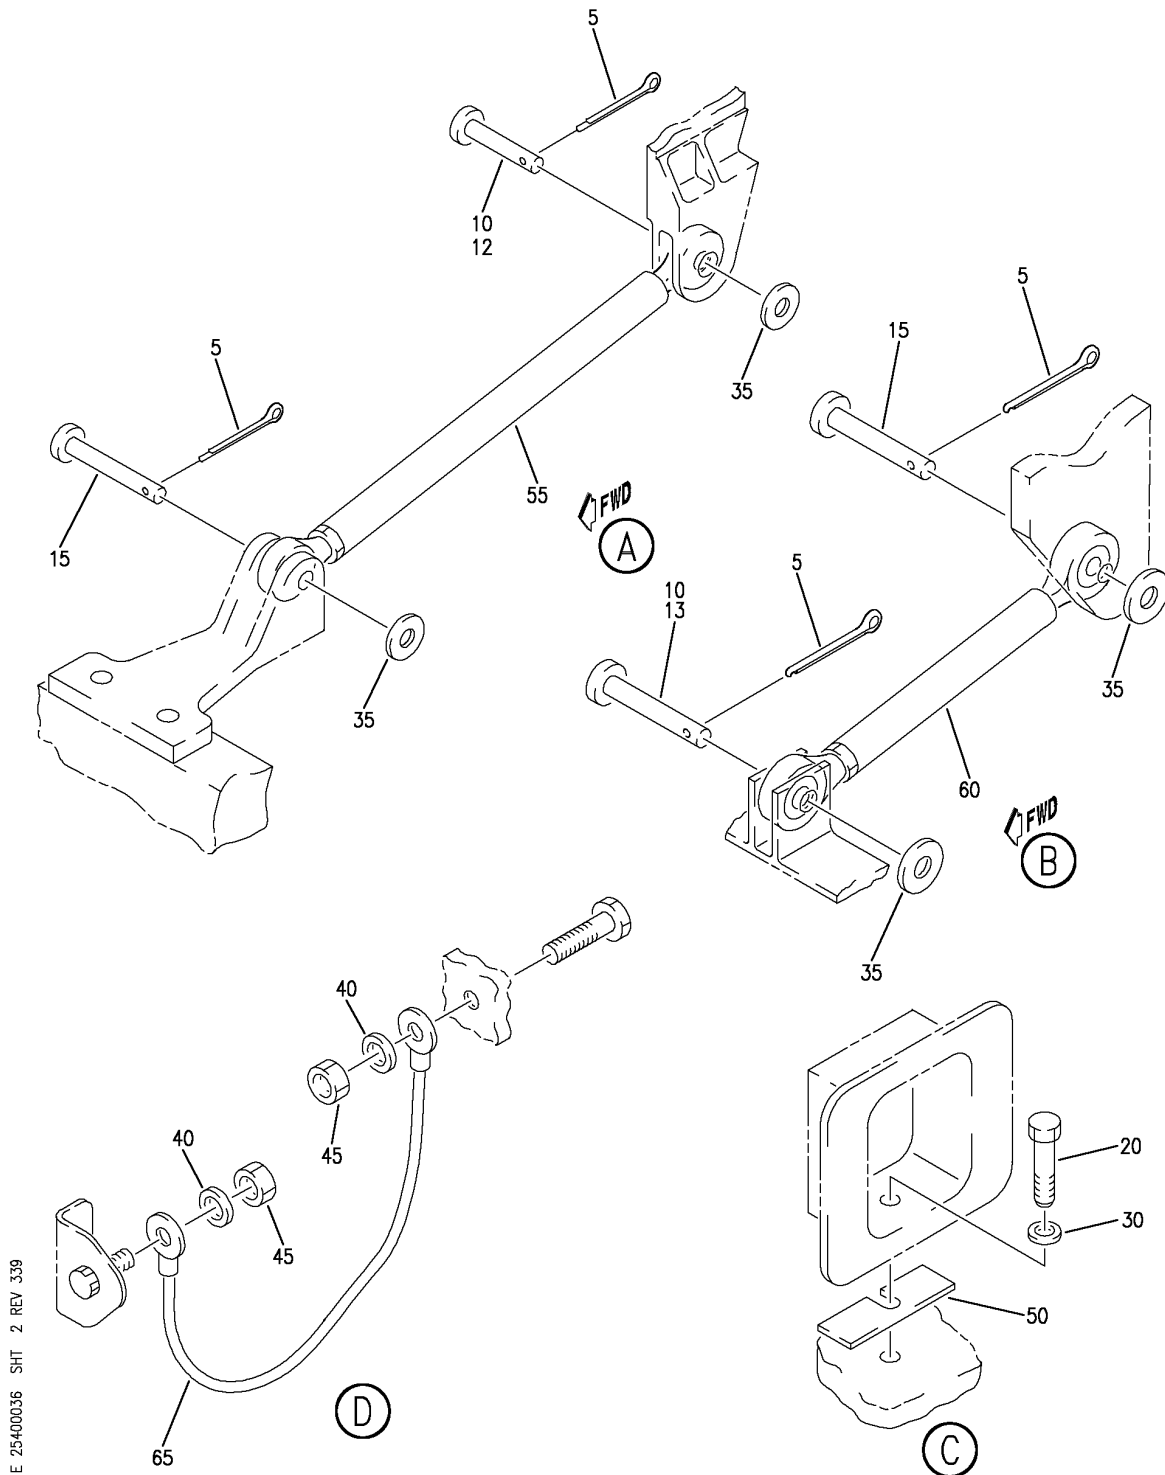

E 25400036 SHT 2 REV 339

HARDWARE INSTL-LAV A (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 36 (SHEET 2)

**25-40-00-36**

RYR  
OCT 15/24

25-40-00-36  
PAGE 0A

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

 **BOEING**  
737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 | NOMENCLATURE                                                                                                                                               | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|---------------|------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 36                                                      |                |               | HARDWARE INSTL-LAV A<br>(EQUIPMENT/FURNISHINGS<br>ONLY)                                                                                                    | 224416            |                      |
| - 1                                                     | MODREF553259   |               | HARDWARE INSTL-LAV A<br>(EQUIPMENT/FURNISHINGS<br>ONLY)<br>MODULE NUMBER:<br>417A1158-1 REV K<br>FOR OTHER SYS DETAILS SEE:<br>21-23-00-13<br>38-31-00-01  | 338377            | RF                   |
| - 1                                                     | MODREF409919   |               | HARDWARE INSTL-LAV A<br>(EQUIPMENT/FURNISHINGS<br>ONLY)<br>MODULE NUMBER:<br>417A1158-1 REV H<br>FOR OTHER SYS DETAILS SEE:<br>21-23-00-13<br>38-31-00-01  | 224314            | RF                   |
| - 2                                                     | MODREF512043   |               | HARDWARE INSTL-LAV A<br>(EQUIPMENT/FURNISHINGS<br>ONLY)<br>MODULE NUMBER:<br>417A1158-1 REV J<br>FOR OTHER SYS DETAILS SEE:<br>21-23-00-13<br>38-31-00-01  | 315337            | RF                   |
| - 2                                                     | MODREF553261   |               | HARDWARE INSTL-LAV A<br>(EQUIPMENT/FURNISHINGS<br>ONLY)<br>MODULE NUMBER:<br>417A1158-30 REV D<br>FOR OTHER SYS DETAILS SEE:<br>21-23-00-13<br>38-31-00-01 | 378416            | RF                   |
| 5                                                       | BACP18BC02C06P | .PIN          |                                                                                                                                                            | 224416            | 4                    |
| 12                                                      | BACP18T4-27    | .PIN          |                                                                                                                                                            | 224416            | 1                    |
| 13                                                      | BACP18T4-33    | .PIN          |                                                                                                                                                            | 224416            | 1                    |
| 15                                                      | BACP18T4-41    | .PIN          |                                                                                                                                                            | 224416            | 2                    |
| 20                                                      | BACB30NM5K18   | .BOLT         |                                                                                                                                                            | 224416            | 3                    |
| 25                                                      | BACB30NM5K20   | .BOLT         |                                                                                                                                                            | 224416            | 1                    |
| 30                                                      | NAS1149C0532R  | .WASHER       |                                                                                                                                                            | 224416            | 4                    |
| 35                                                      | NAS1149D0463J  | .WASHER       |                                                                                                                                                            | 224416            | 4                    |
| 40                                                      | NAS1149D0416H  | .WASHER       |                                                                                                                                                            | 224416            | 2                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |               |                                                                                                                                                            |                   |                      |

- ITEM NOT ILLUSTRATED

RYR

25-40-00-36

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-00  
FIG. 36  
PAGE 1  
OCT 15/23


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER     | 1 2 3 4 5 6 7<br>NOMENCLATURE                                                                                      | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|-----------------|--------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 36                                                      |                 |                                                                                                                    |                   |                      |
| 45                                                      | PLH54CD         | .NUT<br>SUPPLIER CODE:<br>VF0224<br>SPECIFICATION NUMBER:<br>BACN10YR4CD<br>OPTIONAL PART:<br>H52732-4CD<br>V15653 | 224416            | 2                    |
| 50                                                      | 417A1130-6      | .SHIM-                                                                                                             | 224416            | AR                   |
| 50                                                      | 417A1130-64     | .SHIM-                                                                                                             | 224416            | AR                   |
| 55                                                      | USC737-003-652  | .ROD-TIE<br>SUPPLIER CODE:<br>V31293<br>SPECIFICATION NUMBER:<br>S401W121-652                                      | 224416            | 1                    |
| 60                                                      | USC737-004-654  | .ROD-TIE<br>SUPPLIER CODE:<br>V34742<br>SPECIFICATION NUMBER:<br>S401W121-654                                      | 224416            | 1                    |
| 60                                                      | 777050-654      | .ROD-TIE<br>SUPPLIER CODE:<br>V31293<br>SPECIFICATION NUMBER:<br>S401W121-654                                      | 224416            | 1                    |
| 65                                                      | BACJ40A30-8     | .JUMPER                                                                                                            | 224416            | 1                    |
| 70                                                      | NAS1922-0100-3  | .CLAMP                                                                                                             | 224416            | 1                    |
| 75                                                      | BACC10JB018C026 | .CLAMP                                                                                                             | 224416            | 1                    |
| 80                                                      | 417A1130-7      | .PLUG                                                                                                              | 224377            | 1                    |
| 85                                                      | 411A4907-3149   | .BLANKET ASSY-INSULATION                                                                                           | 224416            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                 |                                                                                                                    |                   |                      |

— ITEM NOT ILLUSTRATED


R Y R

25-40-00-36

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

25-40-00  
 FIG. 36  
 PAGE 2  
 FEB 15/21

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

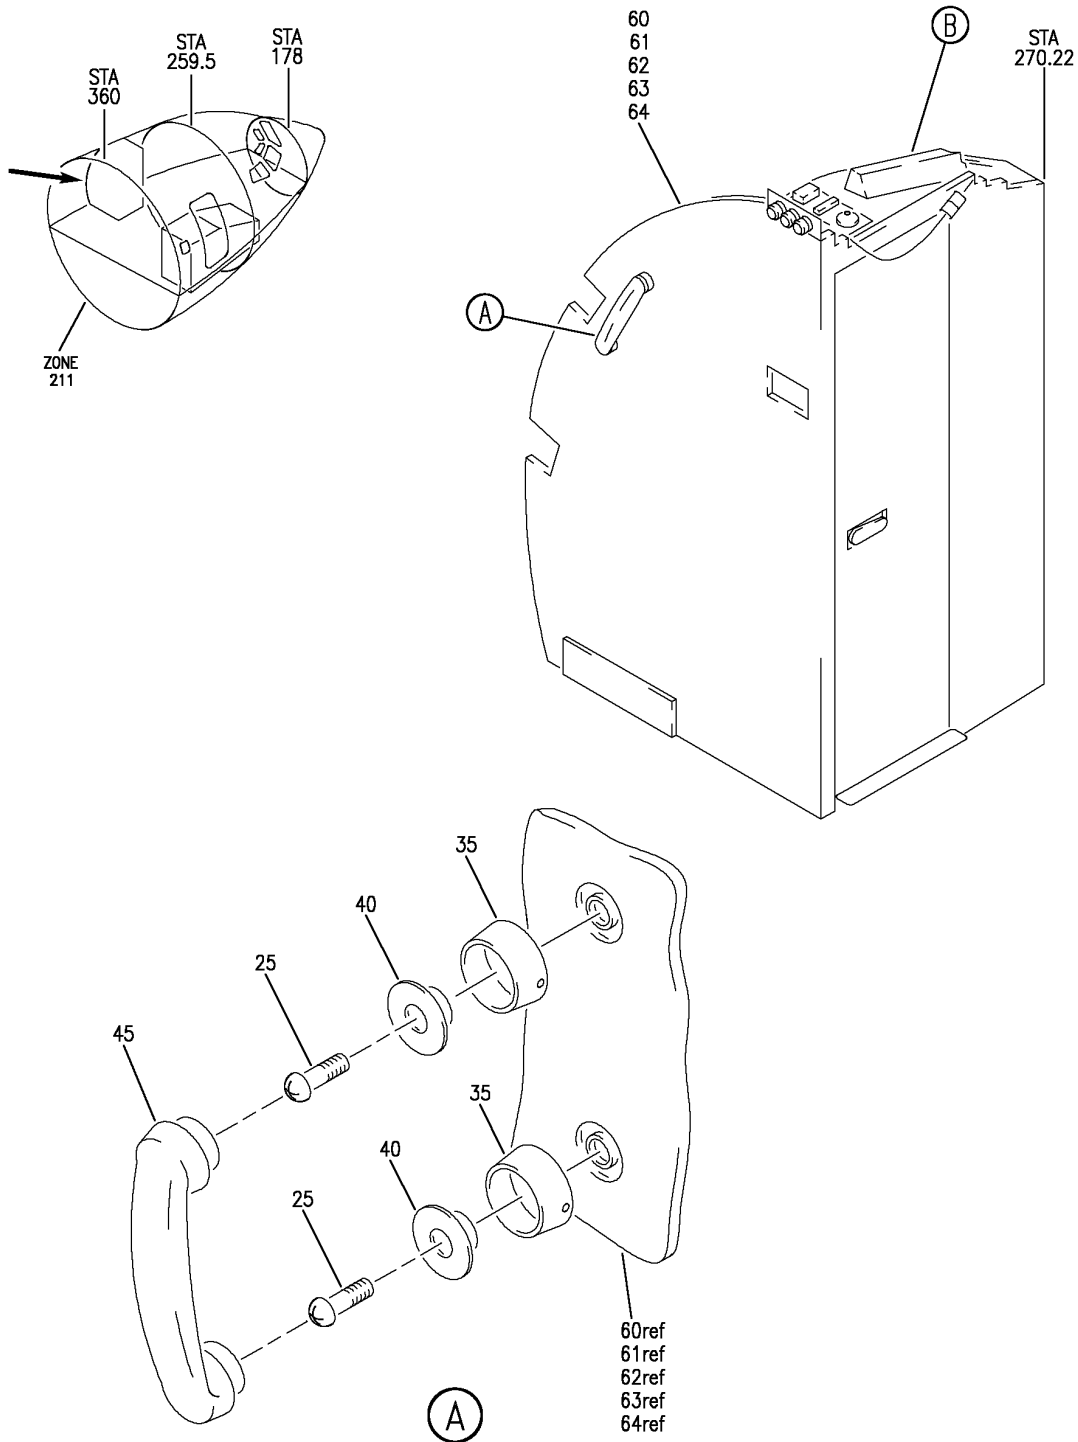

E 25400101T SHT 1 REV 283

LAVATORY INSTL-LAV A  
FIGURE 1T (SHEET 1)

**25-40-01-01T**



R Y R  
F E B 15 / 20

25-40-01-01T  
PAGE 0

ECCN 9E991 BOEING PROPRIETARY - See title page for details.



**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

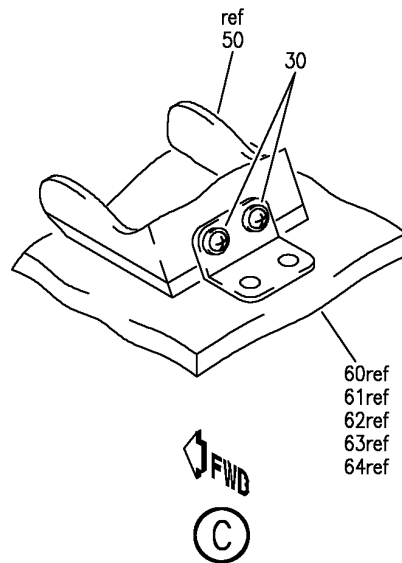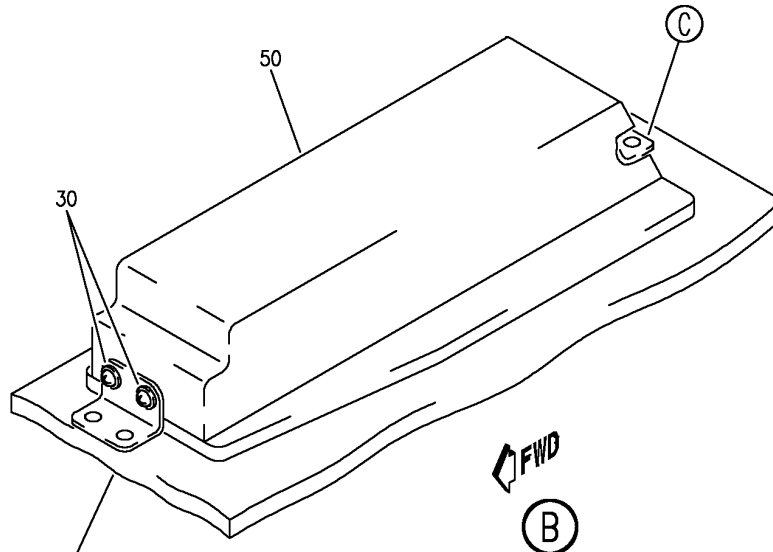

E 25400101T SHT 2 REV 164

LAVATORY INSTL-LAV A  
FIGURE 1T (SHEET 2)

**25-40-01-01T**

R Y R  
JUN 15/10

25-40-01-01T  
PAGE 0A


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7<br>NOMENCLATURE                                                                                                                                                                                                                                                                                                                                                                | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 1 T                                                     |                |                                                                                                                                                                                                                                                                                                                                                                                              |                   |                      |
| - 3                                                     | MODREF407378   | LAVATORY INSTL-LAV A<br>LAVATORY INSTL-LAV A<br>MODULE NUMBER:<br>417A1158-113C REV C                                                                                                                                                                                                                                                                                                        | 205335<br>205335  | R F                  |
| 25                                                      | BACB30LK3-4    | .BOLT-                                                                                                                                                                                                                                                                                                                                                                                       | 205335            | 2                    |
| 35                                                      | 65-5458-21E    | .NUT-                                                                                                                                                                                                                                                                                                                                                                                        | 205335            | 2                    |
| 40                                                      | 66-4302        | .COLLAR-                                                                                                                                                                                                                                                                                                                                                                                     | 205335            | 2                    |
| 45                                                      | 65-5458-20E    | .HANDLE-SPRT                                                                                                                                                                                                                                                                                                                                                                                 | 205335            | 1                    |
| 62                                                      | D72000053-111A | .MODULE ASSY-<br>SUPPLIER CODE:<br>VJ4577<br>SPECIFICATION NUMBER:<br>S417A180-0053A<br>ELECTRICAL EQUIP NUMBER:<br>M01415<br>COMPONENT MAINT MANUAL REF:<br>25-42-38<br>FUNCTIONAL REFERENCE:<br>AIR CONDITIONING<br>FOR DETAILS SEE<br>21-24-51-60F<br>21-45-51-56<br>EQUIPMENT/FURNISHINGS<br>FOR DETAILS SEE<br>25-40-01-56D<br>PLACARDS AND MARKINGS<br>FOR DETAILS SEE<br>11-32-05-56C | 205335            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |                                                                                                                                                                                                                                                                                                                                                                                              |                   |                      |

- ITEM NOT ILLUSTRATED


R Y R

25-40-01-01T

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-01  
 FIG. 01T  
 PAGE 1  
 AUG 15/24

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

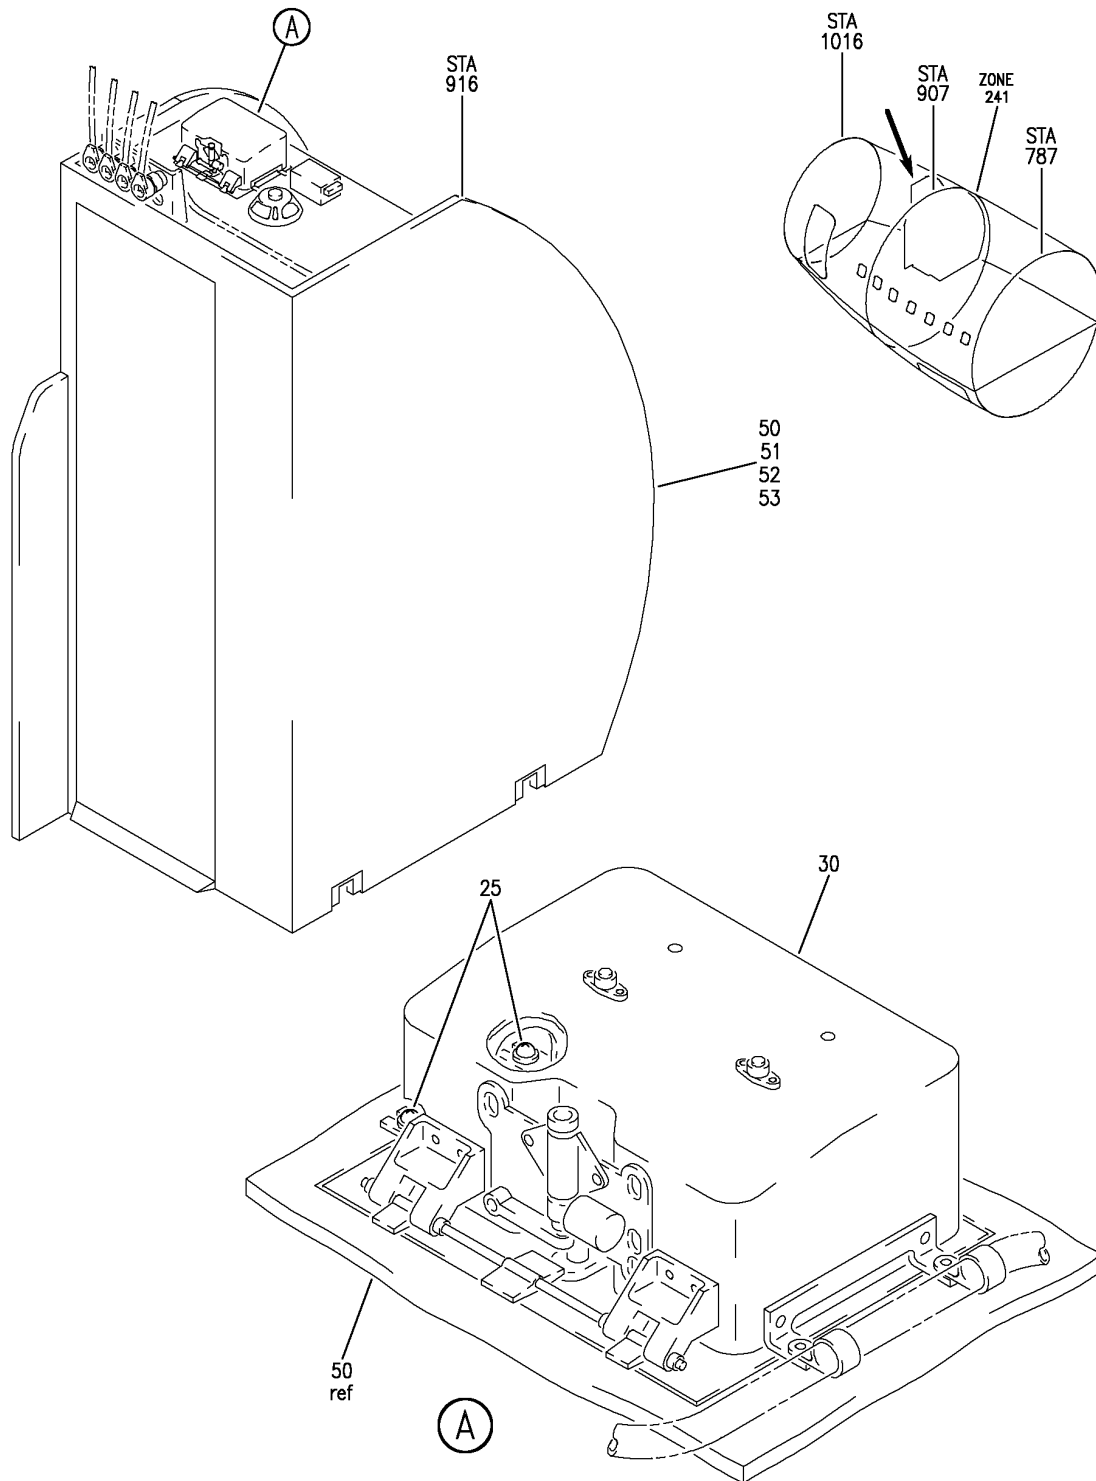

E 25400101U REV 299

LAVATORY INSTL-LAV D  
FIGURE 1U

**25-40-01-01U**

R Y R  
JUN 15/21

25-40-01-01U  
PAGE 0

ECCN 9E991 BOEING PROPRIETARY – See title page for details.


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 | NOMENCLATURE                                                                                                                                                                                                                                                                                                                                                                  | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|---------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 1U                                                      |                |               |                                                                                                                                                                                                                                                                                                                                                                               |                   |                      |
| - 4                                                     | MODREF430407   |               | LAVATORY INSTL-LAV D<br>LAVATORY INSTL-LAV D<br>MODULE NUMBER:<br>417A1158-114C REV B                                                                                                                                                                                                                                                                                         | 231335<br>231335  | R F                  |
| 52                                                      | D72000701-111A |               | .MODULE ASSY-<br>SUPPLIER CODE:<br>VJ4577<br>SPECIFICATION NUMBER:<br>S417A180-0701A<br>ELECTRICAL EQUIP NUMBER:<br>M01418<br>COMPONENT MAINT MANUAL REF:<br>25-42-92<br>FUNCTIONAL REFERENCE:<br>AIR CONDITIONING<br>FOR DETAILS SEE<br>21-24-51-60H<br>EQUIPMENT/FURNISHINGS<br>FOR DETAILS SEE<br>25-40-01-51H<br>PLACARDS AND MARKINGS<br>FOR DETAILS SEE<br>11-32-05-56E | 231335            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |               |                                                                                                                                                                                                                                                                                                                                                                               |                   |                      |

- ITEM NOT ILLUSTRATED


R Y R

25-40-01-01U

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-01  
FIG. 01U  
PAGE 1  
AUG 15/24

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

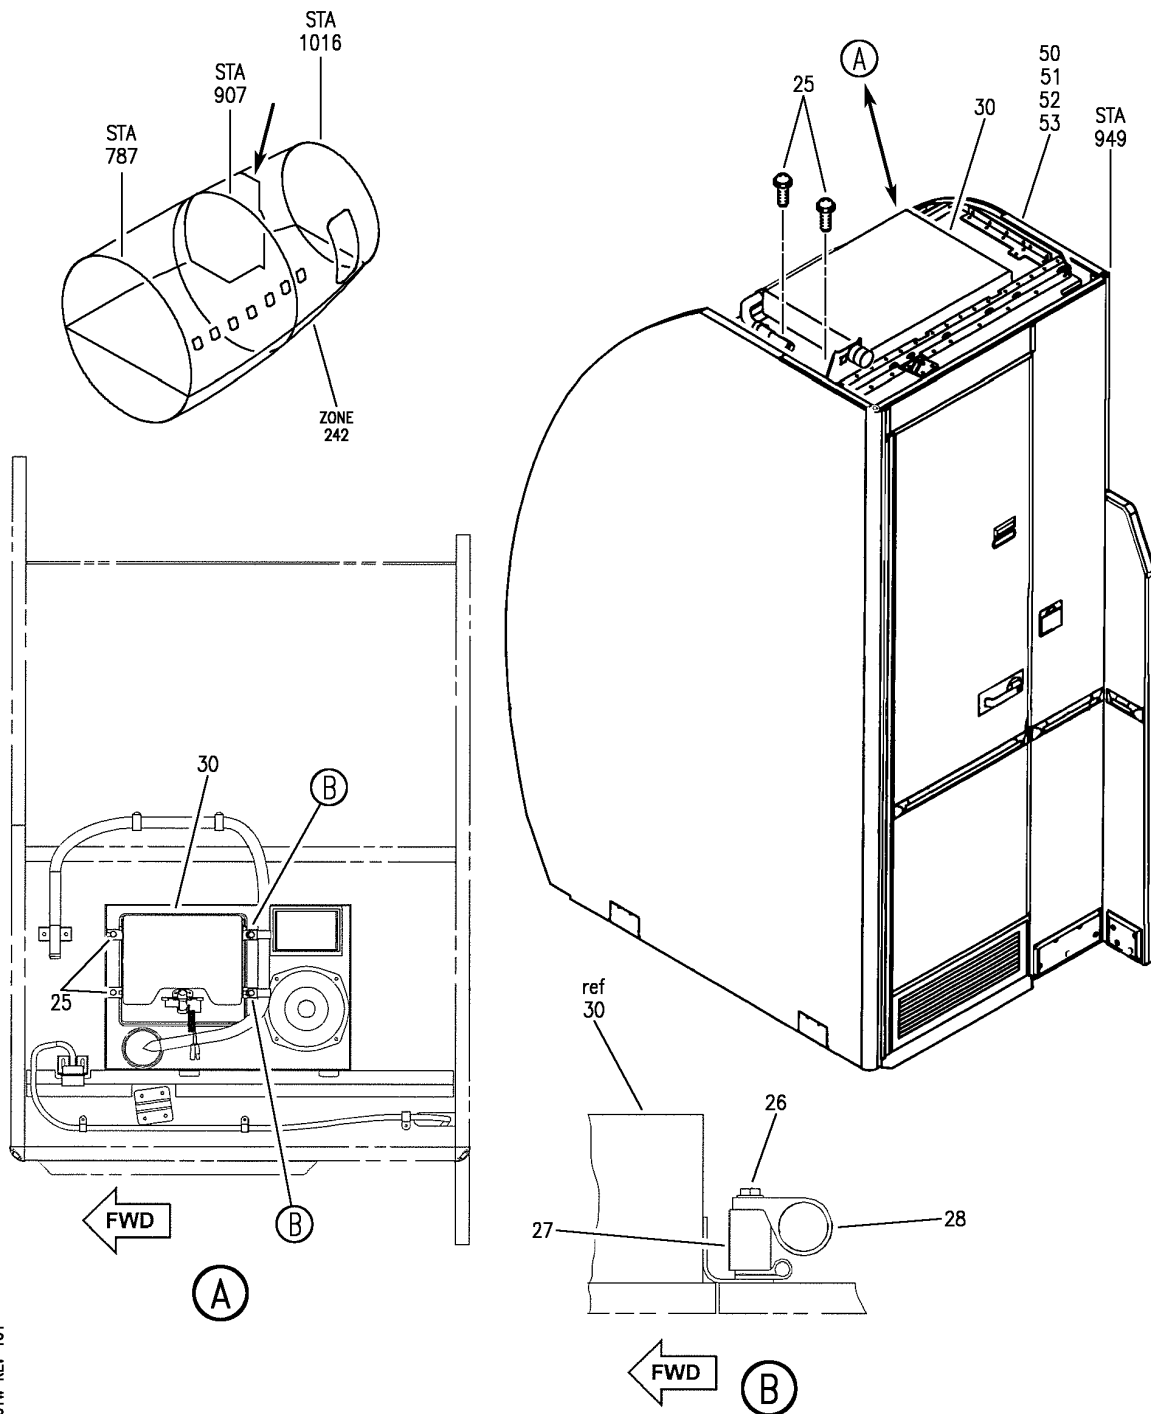

E 25400101W REV 161

LAVATORY INSTL-LAV E  
FIGURE 1W

**25-40-01-01W**

R Y R  
F E B 15 / 10

25-40-01-01W  
PAGE 0

ECCN 9E991 BOEING PROPRIETARY – See title page for details.


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 | NOMENCLATURE                                                                                                                                                                                                                                                                                                                                                                  | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|---------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 1W                                                      |                |               |                                                                                                                                                                                                                                                                                                                                                                               |                   |                      |
| - 4                                                     | MODREF431539   |               | LAVATORY INSTL-LAV E<br>LAVATORY INSTL-LAV E<br>MODULE NUMBER:<br>417A1158-117C REV B                                                                                                                                                                                                                                                                                         | 231335<br>231335  | R F                  |
| 52                                                      | D72001201-111A |               | .MODULE ASSY-<br>SUPPLIER CODE:<br>VJ4577<br>SPECIFICATION NUMBER:<br>S417A180-1201A<br>ELECTRICAL EQUIP NUMBER:<br>M01419<br>COMPONENT MAINT MANUAL REF:<br>25-42-51<br>FUNCTIONAL REFERENCE:<br>AIR CONDITIONING<br>FOR DETAILS SEE<br>21-24-51-58E<br>EQUIPMENT/FURNISHINGS<br>FOR DETAILS SEE<br>25-40-01-50C<br>PLACARDS AND MARKINGS<br>FOR DETAILS SEE<br>11-32-05-58C | 231335            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |               |                                                                                                                                                                                                                                                                                                                                                                               |                   |                      |

- ITEM NOT ILLUSTRATED


R Y R

25-40-01-01W

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-01  
 FIG. 01W  
 PAGE 1  
 AUG 15/24

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

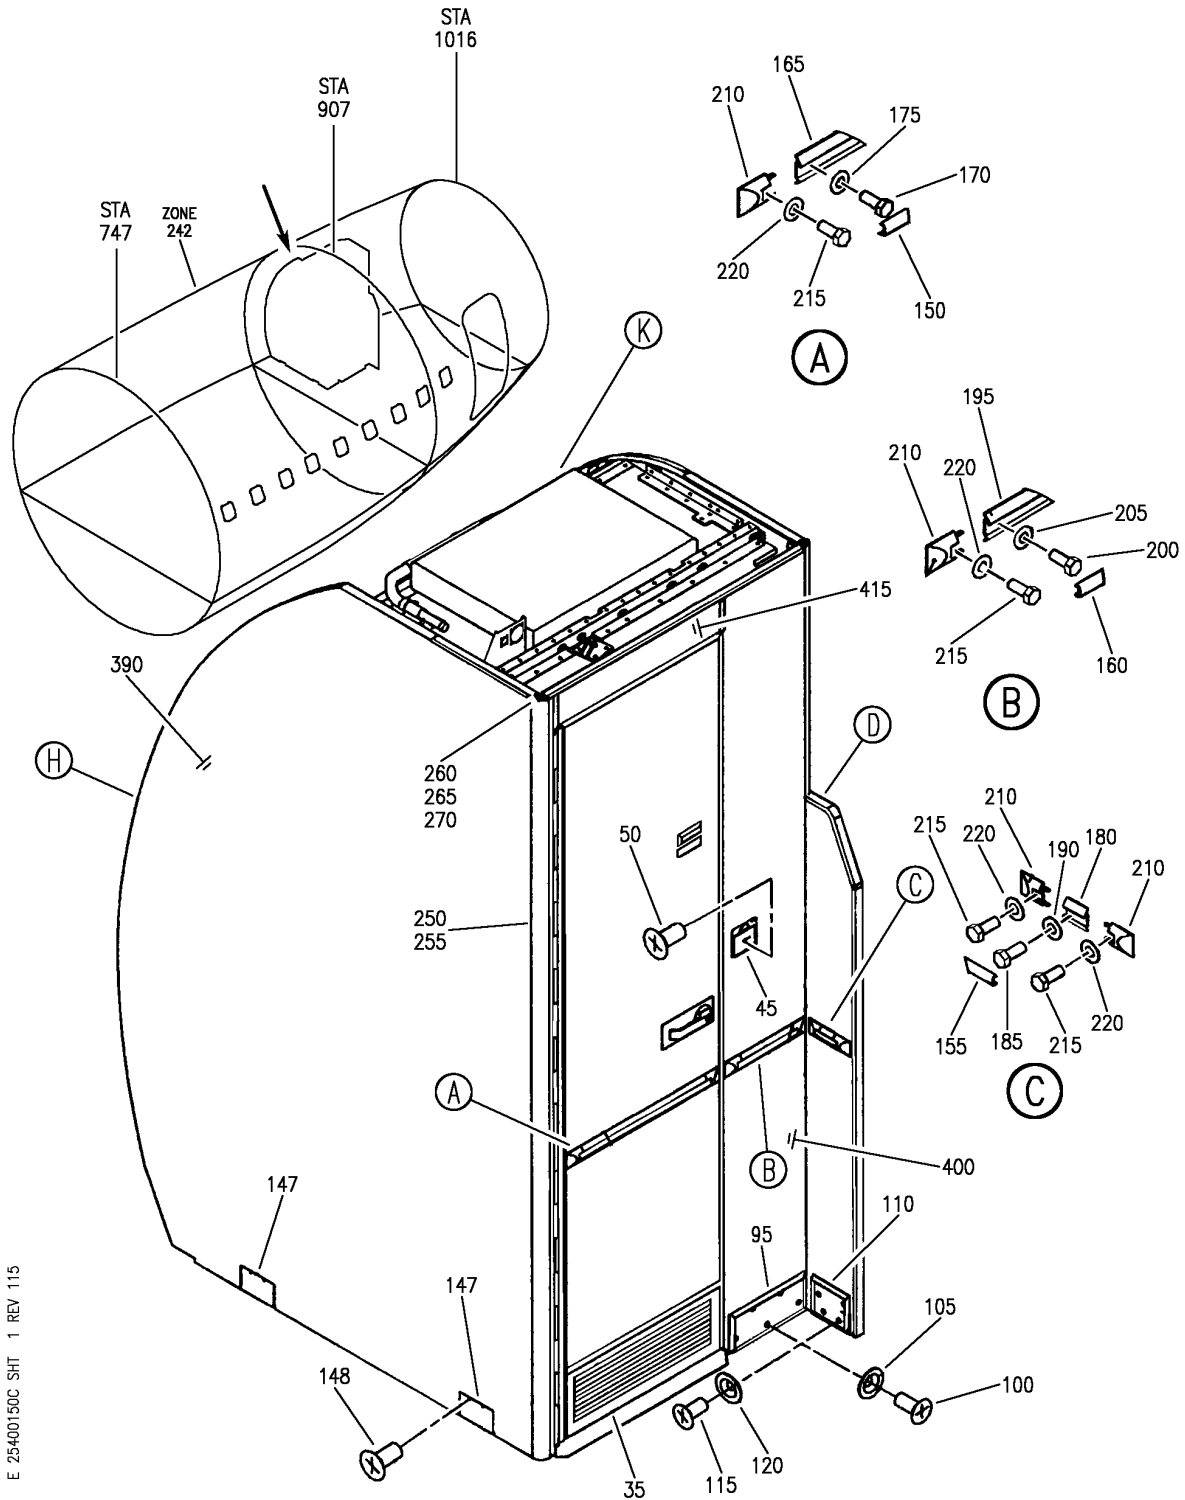

E 25400150C SHT 1 REV 115

MODULE ASSY-LAV E (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 50C (SHEET 1)


**25-40-01-50C**

RJR  
OCT 10/06

25-40-01-50C  
PAGE 0

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

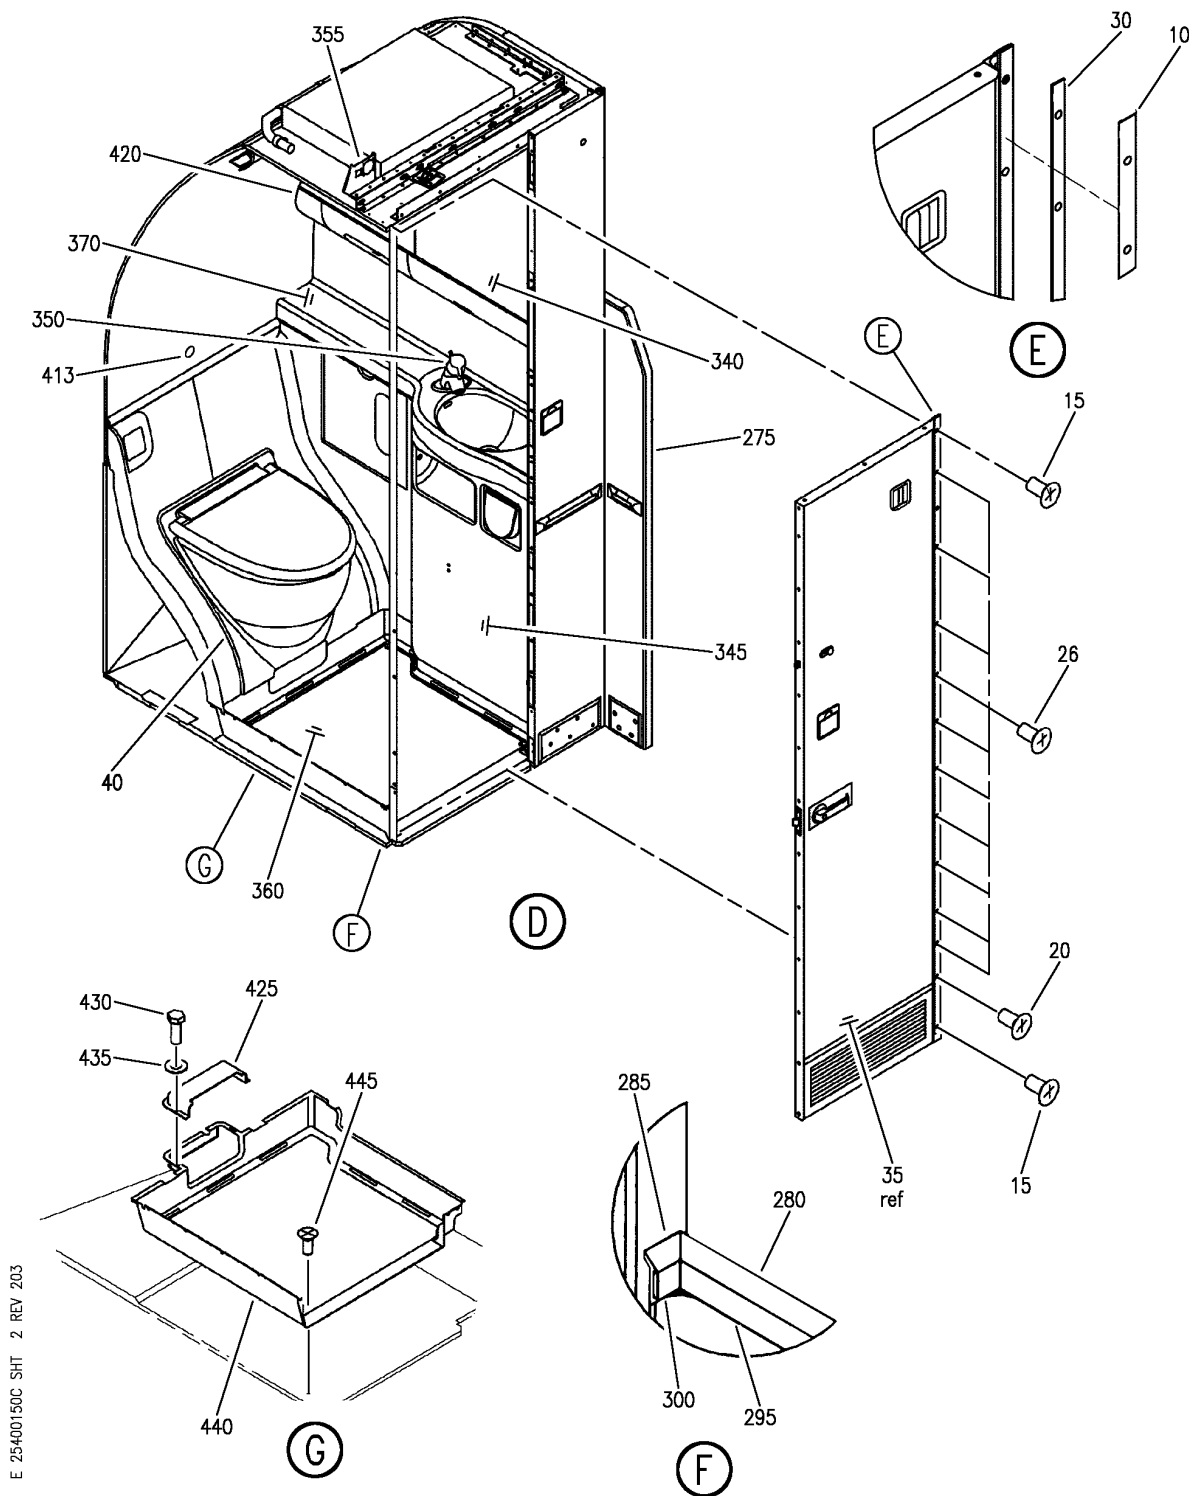

E 25400150C SHT 2 REV 203

MODULE ASSY-LAV E (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 50C (SHEET 2)


**25-40-01-50C**

RJR  
JUN 15/13

25-40-01-50C  
PAGE 0A

ECCN 9E991 BOEING PROPRIETARY - See title page for details.



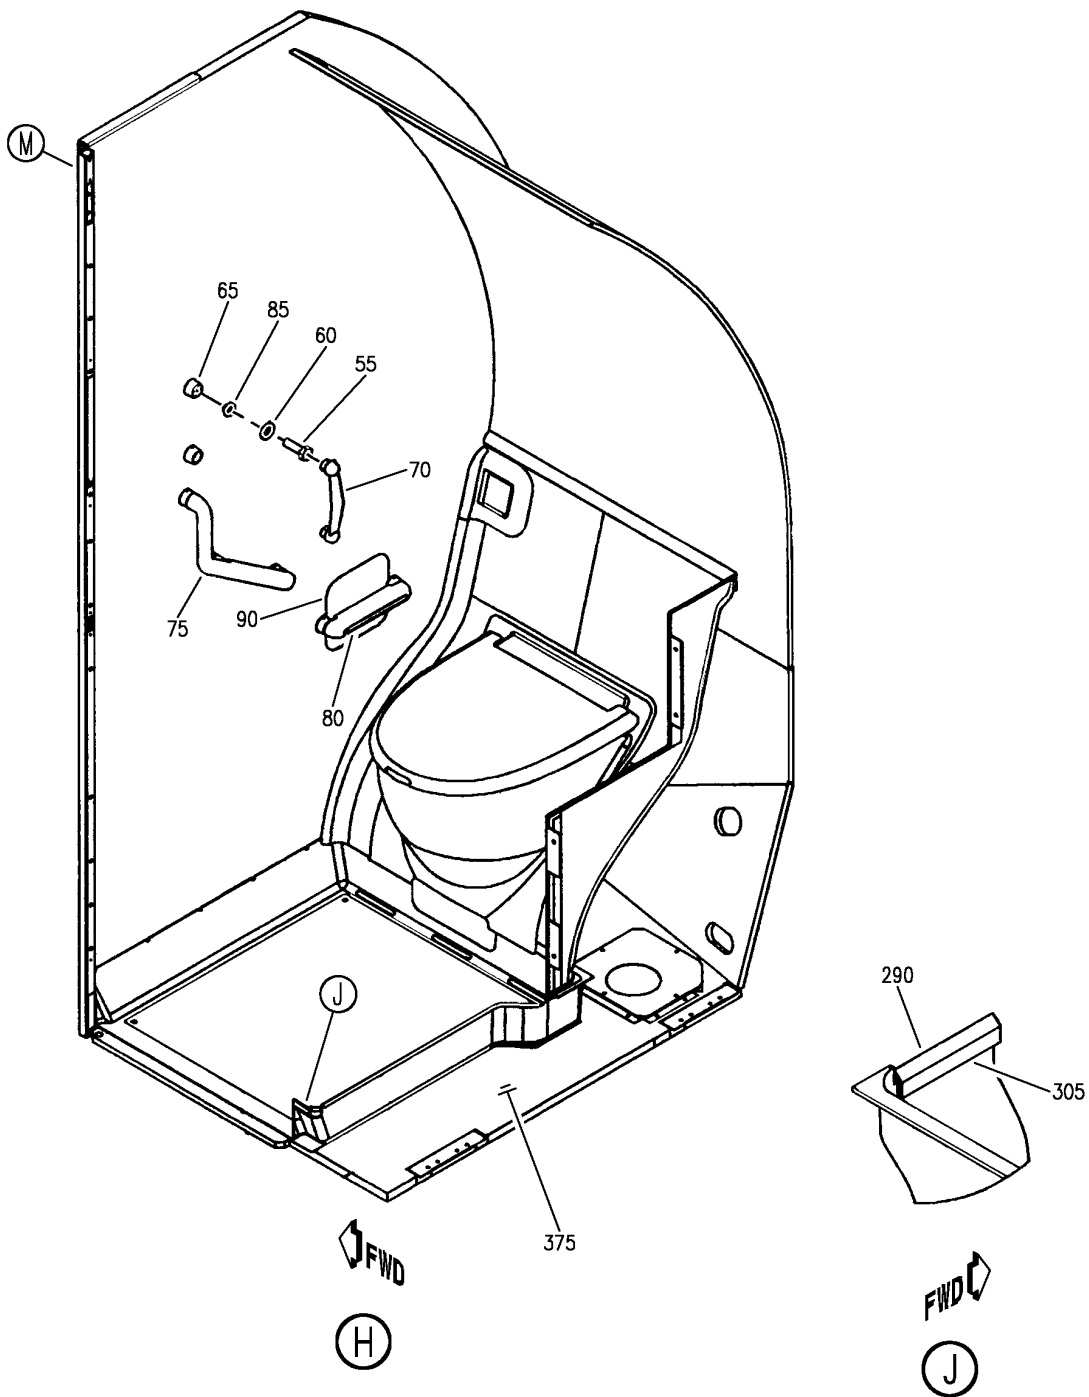

MODULE ASSY-LAV E (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 50C (SHEET 3)


25-40-01-50C

R Y R  
O C T 15 / 14

25-40-01-50C  
PAGE 0B

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

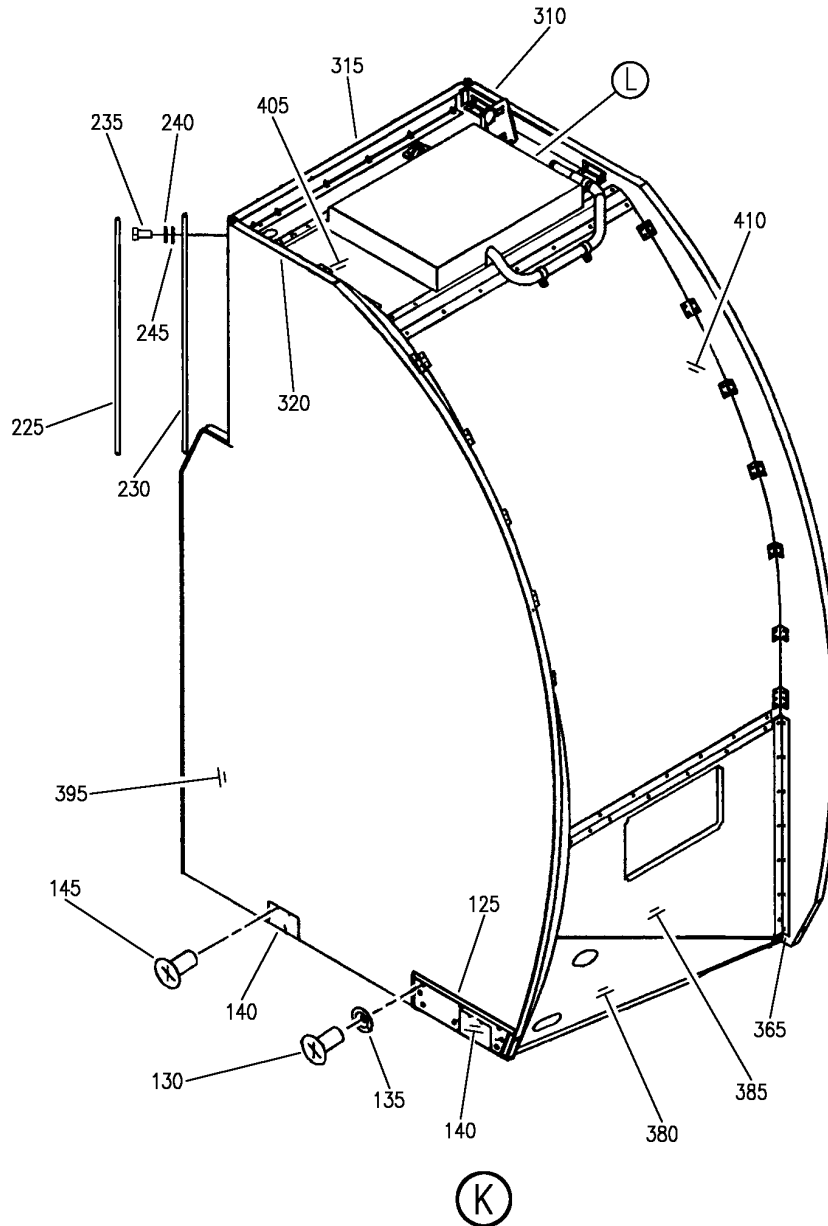

E 25400150C SHT 4 REV 106

MODULE ASSY-LAV E (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 50C (SHEET 4)


**25-40-01-50C**

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

R Y R  
O C T 10 / 06

25-40-01-50C  
PAGE 0C

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

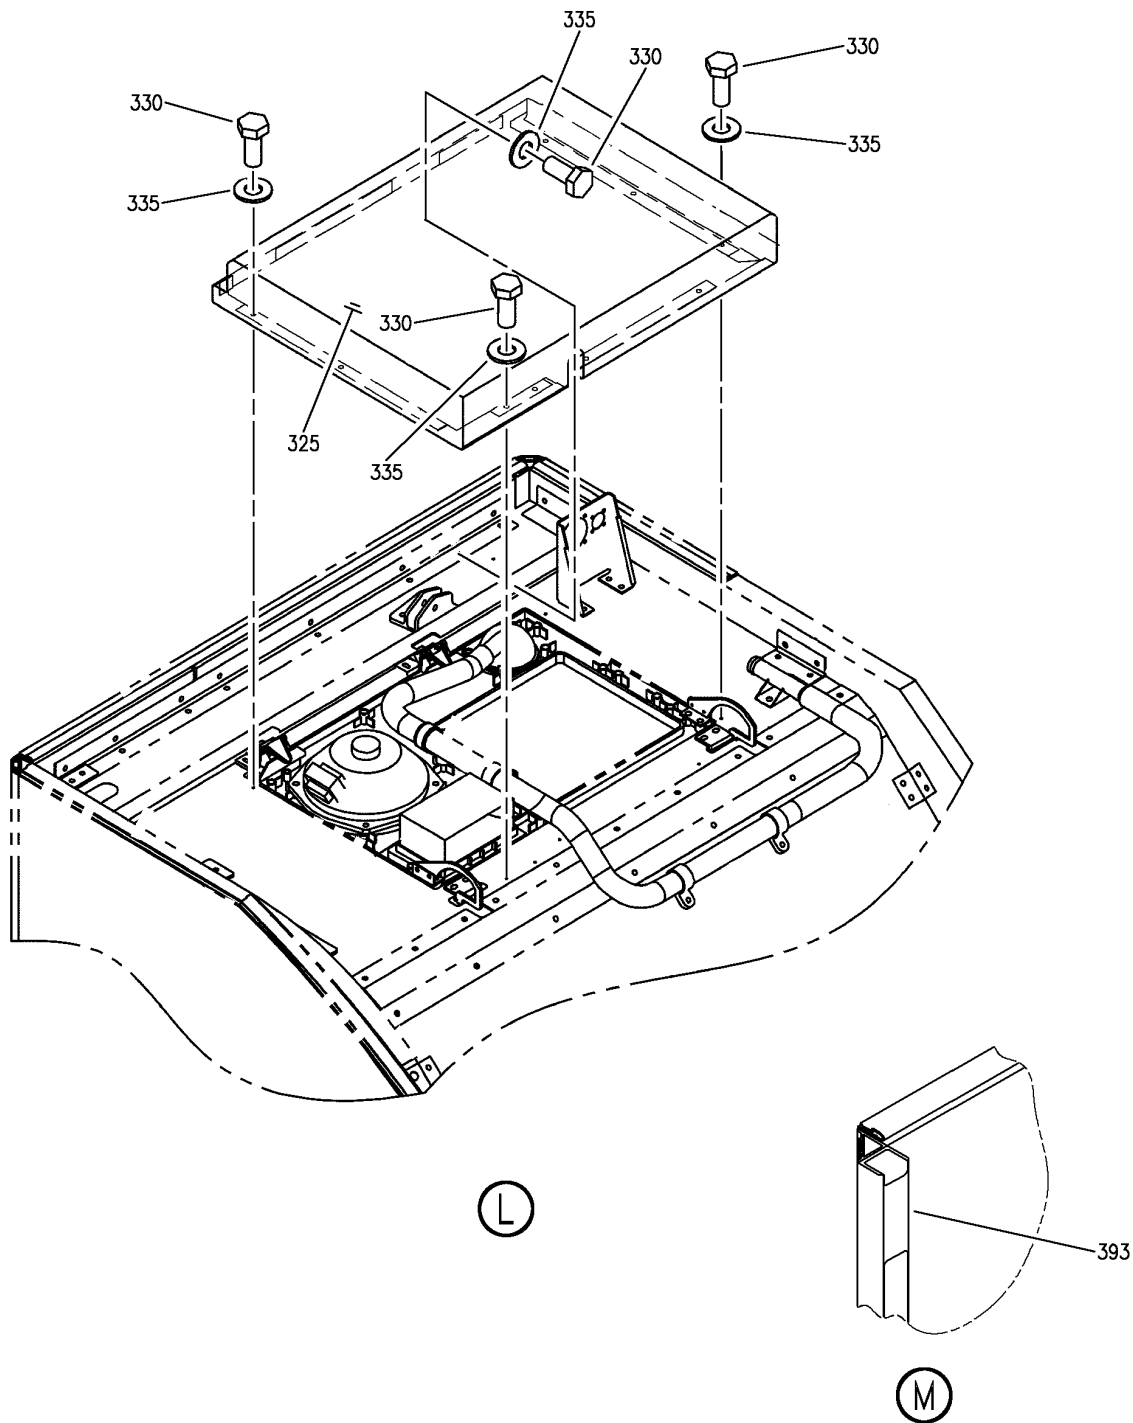

E 25400150C SHT 5 REV 219

MODULE ASSY-LAV E (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 50C (SHEET 5)

**25-40-01-50C**

R Y R  
O C T 15 / 14

25-40-01-50C  
PAGE 00

ECCN 9E991 BOEING PROPRIETARY - See title page for details.


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7<br>NOMENCLATURE                                                                                                                                                                                                                                             | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 50C                                                     |                | MODULE ASSY-LAV E<br>(EQUIPMENT/FURNISHINGS<br>ONLY)                                                                                                                                                                                                                      | 056335            |                      |
| - 1                                                     | D72001201-111A | MODULE ASSY-LAV E<br>(EQUIPMENT/FURNISHINGS<br>ONLY)<br>SUPPLIER CODE:<br>VJ4577<br>SPECIFICATION NUMBER:<br>S417A180-1201A<br>ELECTRICAL EQUIP NUMBER:<br>M01419<br>COMPONENT MAINT MANUAL REF:<br>25-42-51<br>FOR NHA/OTHER SYS DET SEE:<br>25-40-00-28<br>25-40-01-01W | 056335            | RF                   |
| 10                                                      | D72D70987-211  | .RETAINER-SEAL RUBBER<br>SUPPLIER CODE:<br>VS5825<br>ATTACHING PARTS                                                                                                                                                                                                      | 056335            | 1                    |
| 15                                                      | NAS514P1032-12 | .SCREW                                                                                                                                                                                                                                                                    | 056335            | 2                    |
| 20                                                      | NAS514P1032-8  | .SCREW                                                                                                                                                                                                                                                                    | 056335            | 1                    |
| 26                                                      | NAS514P1032-7  | .SCREW                                                                                                                                                                                                                                                                    | 056335            | 10                   |
|                                                         |                | -----*-----                                                                                                                                                                                                                                                               |                   |                      |
| 30                                                      | D72D70988-111  | .SEAL-RUBBER<br>SUPPLIER CODE:<br>VS5825                                                                                                                                                                                                                                  | 056335            | 1                    |
| 35                                                      | D72W13011-211A | .DOOR ASSY-SLAB<br>SUPPLIER CODE:<br>VS5825<br>FOR DETAILS SEE:<br>25-41-17-58E                                                                                                                                                                                           | 056335            | 1                    |
| 40                                                      | D72W15003-111  | .PAN INSTL-<br>SUPPLIER CODE:<br>VS5825<br>FOR DETAILS SEE:<br>25-41-21-58A                                                                                                                                                                                               | 056335            | RF                   |
| 45                                                      | D72D70434-111  | .ASHTRAY-<br>SUPPLIER CODE:<br>VS5825<br>ATTACHING PARTS                                                                                                                                                                                                                  | 056335            | 1                    |
| 50                                                      | NAS514P1032-4P | .SCREW                                                                                                                                                                                                                                                                    | 056335            | 2                    |
|                                                         |                | -----*-----                                                                                                                                                                                                                                                               |                   |                      |
| 55                                                      | NAS1801-3-10   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-10                                                                                                                                                                                                                          | 056335            | 7                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |                                                                                                                                                                                                                                                                           |                   |                      |

- ITEM NOT ILLUSTRATED

RYR

25-40-01-50C

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-01  
FIG. 50C  
PAGE 1  
AUG 15/24


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 | NOMENCLATURE                                                | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|---------------|-------------------------------------------------------------|-------------------|----------------------|
| 50C                                                     |                |               |                                                             |                   |                      |
| 60                                                      | NAS1149D0332K  |               | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0332J          | 056335            | 7                    |
| 65                                                      | 65-5458-21N    |               | .NUT                                                        | 056335            | 7                    |
| 70                                                      | 65-5458-20N    |               | .HANDLE-ASSIST                                              | 056335            | 1                    |
| 75                                                      | 65C22388-13    |               | .HANDLE-ASSIST                                              | 056335            | 1                    |
| 80                                                      | 69-72416-5     |               | .HANDLE-ASSIST<br>SUPPLIER CODE:<br>V26835                  | 056335            | 1                    |
| 85                                                      | 66-4302-1      |               | .COLLAR                                                     | 056335            | 7                    |
| 90                                                      | D75D70952-163  |               | .PAN-<br>SUPPLIER CODE:<br>VS5825                           | 056335            | 1                    |
| 95                                                      | D72D80015-111G |               | .KICKSTRIP-<br>SUPPLIER CODE:<br>VS5825<br>ATTACHING PARTS  | 056335            | 1                    |
| 100                                                     | NAS514P1032-6P |               | .SCREW                                                      | 056335            | 5                    |
| 105                                                     | NAS1169DD10    |               | .WASHER<br>-----*-----                                      | 056335            | 5                    |
| 110                                                     | D72D80020-211F |               | .KICKSTRIP-<br>SUPPLIER CODE:<br>VS5825<br>ATTACHING PARTS  | 056335            | 1                    |
| 115                                                     | NAS514P1032-6P |               | .SCREW                                                      | 056335            | 4                    |
| 120                                                     | NAS1169DD10    |               | .WASHER<br>-----*-----                                      | 056335            | 4                    |
| 125                                                     | D72D80021-211F |               | .KICKSTRIP-<br>SUPPLIER CODE:<br>VS5825<br>ATTACHING PARTS  | 056335            | 1                    |
| 130                                                     | NAS514P1032-6P |               | .SCREW                                                      | 056335            | 8                    |
| 135                                                     | NAS1169DD10    |               | .WASHER<br>-----*-----                                      | 056335            | 8                    |
| 140                                                     | D72D70947-111B |               | .PLATE-COVER<br>SUPPLIER CODE:<br>VS5825<br>ATTACHING PARTS | 056335            | 2                    |
| 145                                                     | NAS514P632-4   |               | .SCREW<br>-----*-----                                       | 056335            | 4                    |
| 147                                                     | D72D70947-111S |               | .PLATE-COVER<br>SUPPLIER CODE:<br>VS5825<br>ATTACHING PARTS | 056335            | 2                    |
| 148                                                     | NAS514P632-4   |               | .SCREW<br>-----*-----                                       | 056335            | 4                    |
| 150                                                     | D72D80025-911A |               | .RUBSTRIP-<br>SUPPLIER CODE:<br>VS5825                      | 056335            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |               |                                                             |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R

25-40-01-50C

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-01  
FIG. 50C  
PAGE 2  
OCT 15/24


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 | NOMENCLATURE                                                        | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|---------------|---------------------------------------------------------------------|-------------------|----------------------|
| 50C                                                     |                |               |                                                                     |                   |                      |
| 150                                                     | BCREF135895    |               | .RUBSTRIP-<br>OVERLENGTH PART NUMBER:<br>BAC1522-547-70229          | 056335            | 1                    |
| 155                                                     | D72D80025-912A |               | .RUBSTRIP-<br>SUPPLIER CODE:<br>VS5825                              | 056335            | 1                    |
| 155                                                     | BCREF135895    |               | .RUBSTRIP-<br>OVERLENGTH PART NUMBER:<br>BAC1522-547-70229          | 056335            | 1                    |
| 160                                                     | D72D80025-913A |               | .RUBSTRIP-<br>SUPPLIER CODE:<br>VS5825                              | 056335            | 1                    |
| 160                                                     | BCREF135895    |               | .RUBSTRIP-<br>OVERLENGTH PART NUMBER:<br>BAC1522-547-70229          | 056335            | 1                    |
| 165                                                     | D72D80024-111B |               | .RETAINER-RUBSTRIP<br>SUPPLIER CODE:<br>VS5825                      | 056335            | 1                    |
| 170                                                     | NAS1801-08-6   |               | ATTACHING PARTS<br>.SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN08-6 | 056335            | 3                    |
| 175                                                     | NAS1149DN816K  |               | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149DN816J                  | 056335            | 3                    |
| 180                                                     | D72D80023-111B |               | -----*-----<br>.RETAINER-RUBSTRIP<br>SUPPLIER CODE:<br>VS5825       | 056335            | 1                    |
| 185                                                     | NAS1801-08-6   |               | ATTACHING PARTS<br>.SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN08-6 | 056335            | 1                    |
| 190                                                     | NAS1149DN816K  |               | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149DN816J                  | 056335            | 1                    |
| 195                                                     | D72D80022-111B |               | -----*-----<br>.RETAINER-RUBSTRIP<br>SUPPLIER CODE:<br>VS5825       | 056335            | 1                    |
| 200                                                     | NAS1801-08-6   |               | ATTACHING PARTS<br>.SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN08-6 | 056335            | 2                    |
| 205                                                     | NAS1149DN816K  |               | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149DN816J                  | 056335            | 2                    |
| 210                                                     | 432W7101-6J    |               | -----*-----<br>.ENDCAP-END                                          | 056335            | 6                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |               |                                                                     |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R

25-40-01-50C

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-01  
 FIG. 50C  
 PAGE 3  
 OCT 15/24


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                                                                                                                     | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 50C                                                     |                |                                                                                                                                                                                                                |                   |                      |
| 210                                                     | 413N3165-33C   | .CAP-END<br>ATTACHING PARTS                                                                                                                                                                                    | 056335            | 6                    |
| 215                                                     | NAS1801-08-6   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN08-6                                                                                                                                                               | 056335            | 6                    |
| 220                                                     | NAS1149DN816K  | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149DN816J<br>-----*-----                                                                                                                                              | 056335            | 6                    |
| 225                                                     | D72D80018-911B | .RUBSTRIP-<br>SUPPLIER CODE:<br>VS5825                                                                                                                                                                         | 056335            | 1                    |
| 225                                                     | BCREF101367    | .RUBSTRIP-<br>OVERLENGTH PART NUMBER:<br>BAC1522-547-7802                                                                                                                                                      | 056335            | 1                    |
| 230                                                     | D72D80011-111B | .RETAINER-<br>SUPPLIER CODE:<br>VS5825<br>ATTACHING PARTS                                                                                                                                                      | 056335            | 1                    |
| 235                                                     | NAS1801-08-7   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN08-7                                                                                                                                                               | 056335            | 5                    |
| 240                                                     | NAS1149DN816K  | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149DN816J                                                                                                                                                             | 056335            | 5                    |
| 245                                                     | 130008         | .NUT<br>SUPPLIER CODE:<br>V60119<br>SPECIFICATION NUMBER:<br>BACN10FX84<br>OPTIONAL PART:<br>RM52LHA4972-6-8<br>V72962<br>SL211-08-1<br>V97393<br>A11330-6-82<br>V72962<br>A4972-6-82<br>V72962<br>-----*----- | 056335            | 5                    |
| 250                                                     | D72D80018-913B | .RUBSTRIP-<br>SUPPLIER CODE:<br>VS5825                                                                                                                                                                         | 056335            | 1                    |
| 250                                                     | BCREF101367    | .RUBSTRIP-<br>OVERLENGTH PART NUMBER:<br>BAC1522-547-7802                                                                                                                                                      | 056335            | 1                    |
| 255                                                     | D72D80012-111B | .RETAINER-<br>SUPPLIER CODE:<br>VS5825                                                                                                                                                                         | 056335            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |                                                                                                                                                                                                                |                   |                      |

— ITEM NOT ILLUSTRATED

RYR

25-40-01-50C

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-01  
FIG. 50C  
PAGE 4  
OCT 15/24


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7           | NOMENCLATURE                                                                                                                                                                                           | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|-------------------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 50C                                                     |                |                         | ATTACHING PARTS                                                                                                                                                                                        |                   |                      |
| 260                                                     | NAS1801-08-7   | .SCREW                  | STANDARD SUBSTITUTION:<br>BACS12HN08-7                                                                                                                                                                 | 056335            | 12                   |
| 265                                                     | NAS1149DN816K  | .WASHER                 | STANDARD SUBSTITUTION:<br>NAS1149DN816J                                                                                                                                                                | 056335            | 12                   |
| 270                                                     | 130008         | .NUT                    | SUPPLIER CODE:<br>V60119<br>SPECIFICATION NUMBER:<br>BACN10FX84<br>OPTIONAL PART:<br>RM52LHA4972-6-8<br>V72962<br>SL211-08-1<br>V97393<br>A11330-6-82<br>V72962<br>A4972-6-82<br>V72962<br>-----*----- | 056335            | 12                   |
| 275                                                     | D72D70548-211  | .TRIM-WALL EDGE         | SUPPLIER CODE:<br>VS5825                                                                                                                                                                               | 056335            | 1                    |
| 280                                                     | D72D71109-111B | .TRIM-RTNR, FLOOR PAN   | SUPPLIER CODE:<br>VS5825                                                                                                                                                                               | 056335            | 1                    |
| 285                                                     | D72D71110-111B | .TRIM-RTNR, FLOOR PAN   | SUPPLIER CODE:<br>VS5825                                                                                                                                                                               | 056335            | 1                    |
| 290                                                     | D72D71111-111B | .TRIM-RTNR, FLOOR PAN   | SUPPLIER CODE:<br>VS5825                                                                                                                                                                               | 056335            | 1                    |
| 295                                                     | D72D71112-911B | .TRIM-INSERT, FLOOR PAN | SUPPLIER CODE:<br>VS5825                                                                                                                                                                               | 056335            | 1                    |
| 300                                                     | D72D71112-912B | .TRIM-INSERT, FLOOR PAN | SUPPLIER CODE:<br>VS5825                                                                                                                                                                               | 056335            | 1                    |
| 305                                                     | D72D71112-913B | .TRIM-INSERT, FLOOR PAN | SUPPLIER CODE:<br>VS5825                                                                                                                                                                               | 056335            | 1                    |
| 310                                                     | D72D70301-911  | .SEAL-RTNR              | SUPPLIER CODE:<br>VS5825                                                                                                                                                                               | 056335            | 1                    |
| 315                                                     | D72D70301-913  | .SEAL-RTNR              | SUPPLIER CODE:<br>VS5825                                                                                                                                                                               | 056335            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |                         |                                                                                                                                                                                                        |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R

25-40-01-50C

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-01  
 FIG. 50C  
 PAGE 5  
 OCT 15/24




**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER   | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                                                                                                                       | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|---------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 50C                                                     |               |                                                                                                                                                                                                                  |                   |                      |
| 320                                                     | D72D70301-915 | .SEAL-RTNR<br>SUPPLIER CODE:<br>VS5825                                                                                                                                                                           | 056335            | 1                    |
| 325                                                     | D72D70795-111 | .BLANKET-FIRE<br>SUPPLIER CODE:<br>VS5825<br>ATTACHING PARTS                                                                                                                                                     | 056335            | 1                    |
| 330                                                     | NAS1801-3-5   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-5                                                                                                                                                                  | 056335            | 15                   |
| 335                                                     | NAS1149D0332K | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0332J<br>-----*-----                                                                                                                                                | 056335            | 15                   |
| 340                                                     | D72W16005-111 | .DISPENSER ASSY-<br>SUPPLIER CODE:<br>VS5825<br>POSITION DATA:<br>UPR<br>FOR DETAILS SEE:<br>25-41-51-56C                                                                                                        | 056335            | RF                   |
| 345                                                     | D72W17005-111 | .DISPENSER ASSY-<br>SUPPLIER CODE:<br>VS5825<br>POSITION DATA:<br>LWR<br>FUNCTIONAL REFERENCE:<br>EQUIPMENT/FURNISHINGS<br>FOR DETAILS SEE<br>25-41-51-60H<br>FIRE PROTECTION<br>FOR DETAILS SEE<br>26-24-01-58E | 056335            | RF                   |
| 350                                                     | D72W26014-111 | .PLUMBING ASSY-<br>SUPPLIER CODE:<br>VS5825<br>FUNCTIONAL REFERENCE:<br>AIR CONDITIONING<br>FOR DETAILS SEE<br>21-24-51-60K<br>WATER/WASTE<br>FOR DETAILS SEE<br>38-11-05-58C<br>38-11-51-58D<br>38-13-01-58B    | 056335            | RF                   |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |               |                                                                                                                                                                                                                  |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R

25-40-01-50C

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-01  
 FIG. 50C  
 PAGE 6  
 OCT 15/24


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                                                                                                                                                                                                                                                                   | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 50C<br>355                                              | D72W27037-111  | .ELECTRICAL ASSY-<br>SUPPLIER CODE:<br>VS5825<br>FUNCTIONAL REFERENCE:<br>COMMUNICATIONS<br>FOR DETAILS SEE<br>23-31-05-60A<br>EQUIPMENT/FURNISHINGS<br>FOR DETAILS SEE<br>25-41-60-58E<br>FIRE PROTECTION<br>FOR DETAILS SEE<br>26-14-01-60B<br>LIGHTS<br>FOR DETAILS SEE<br>33-26-03-60G<br>33-27-51-60E<br>WATER/WASTE<br>FOR DETAILS SEE<br>38-32-04-60E | 056335            | RF                   |
| 360                                                     | D72D80006-111B | .MAT-FL00R<br>SUPPLIER CODE:<br>VS5825                                                                                                                                                                                                                                                                                                                       | 056335            | 1                    |
| 365                                                     | D72W12014-111  | .OUTWALL ASSY-<br>SUPPLIER CODE:<br>VS5825<br>FOR DETAILS SEE:<br>25-41-40-58A                                                                                                                                                                                                                                                                               | 056335            | RF                   |
| 370                                                     | D72W59040-111A | .DECK-SINK SUB<br>SUPPLIER CODE:<br>VS5825                                                                                                                                                                                                                                                                                                                   | 056335            | 1                    |
| 375                                                     | D72D41012-111  | .PANEL-FL00R<br>SUPPLIER CODE:<br>VS5825                                                                                                                                                                                                                                                                                                                     | 056335            | 1                    |
| 380                                                     | D72D46016-111  | .PANEL-<br>SUPPLIER CODE:<br>VS5825<br>POSITION DATA:<br>OUTBD LWR                                                                                                                                                                                                                                                                                           | 056335            | 1                    |
| 385                                                     | D72D46017-111  | .PANEL-<br>SUPPLIER CODE:<br>VS5825<br>POSITION DATA:<br>OUTBD UPR                                                                                                                                                                                                                                                                                           | 056335            | 1                    |
| 390                                                     | D72W52024-111E | .PANEL-SIDEWALL<br>SUPPLIER CODE:<br>VS5825                                                                                                                                                                                                                                                                                                                  | 056335            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |                                                                                                                                                                                                                                                                                                                                                              |                   |                      |

— ITEM NOT ILLUSTRATED

RYR

25-40-01-50C

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-01  
 FIG. 50C  
 PAGE 7  
 OCT 15/24


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 NOMENCLATURE                                          | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|---------------------------------------------------------------------|-------------------|----------------------|
| 50C                                                     |                |                                                                     |                   |                      |
| 393                                                     | D72D70709-111  | ..TUBE-FRAME<br>SUPPLIER CODE:<br>VS5825                            | 056335            | 1                    |
| 395                                                     | D72W53022-111A | .PANEL-SINK WALL<br>SUPPLIER CODE:<br>VS5825                        | 056335            | 1                    |
| 400                                                     | D72W54016-111D | .PANEL-DOOR WALL<br>SUPPLIER CODE:<br>VS5825                        | 056335            | 1                    |
| 405                                                     | D72W55007-111A | .PANEL-CLG<br>SUPPLIER CODE:<br>VS5825                              | 056335            | 1                    |
| 410                                                     | D72W56013-111B | .PANEL-LINING<br>SUPPLIER CODE:<br>VS5825                           | 056335            | 1                    |
| 413                                                     | 4A114-0016-1   | ..BUMPER-<br>SUPPLIER CODE:<br>VS5825                               | 056335            | 1                    |
| 415                                                     | D72W57009-111B | .PANEL-HEADER, BIFOLD<br>SUPPLIER CODE:<br>VS5825                   | 056335            | 1                    |
| 420                                                     | D72W59041-111A | .PANEL-DISP CABINET<br>SUPPLIER CODE:<br>VS5825                     | 056335            | 1                    |
| 425                                                     | D72D70438-111B | .COVER-<br>SUPPLIER CODE:<br>VS5825                                 | 056335            | 1                    |
| 430                                                     | NAS1801-08-7   | ATTACHING PARTS<br>.SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN08-7 | 056335            | 2                    |
| 435                                                     | NAS1149DN816K  | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149DN816J                  | 056335            | 2                    |
| 440                                                     | D72D70699-111B | -----*-----<br>.PAN ASSY-FLOOR<br>SUPPLIER CODE:<br>VS5825          | 056335            | 1                    |
| 445                                                     | NAS514P1032-6P | ATTACHING PARTS<br>.SCREW<br>-----*-----                            | 056335            | 4                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |                                                                     |                   |                      |

— ITEM NOT ILLUSTRATED


R Y R

25-40-01-50C

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-01  
FIG. 50C  
PAGE 8  
OCT 15/24

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

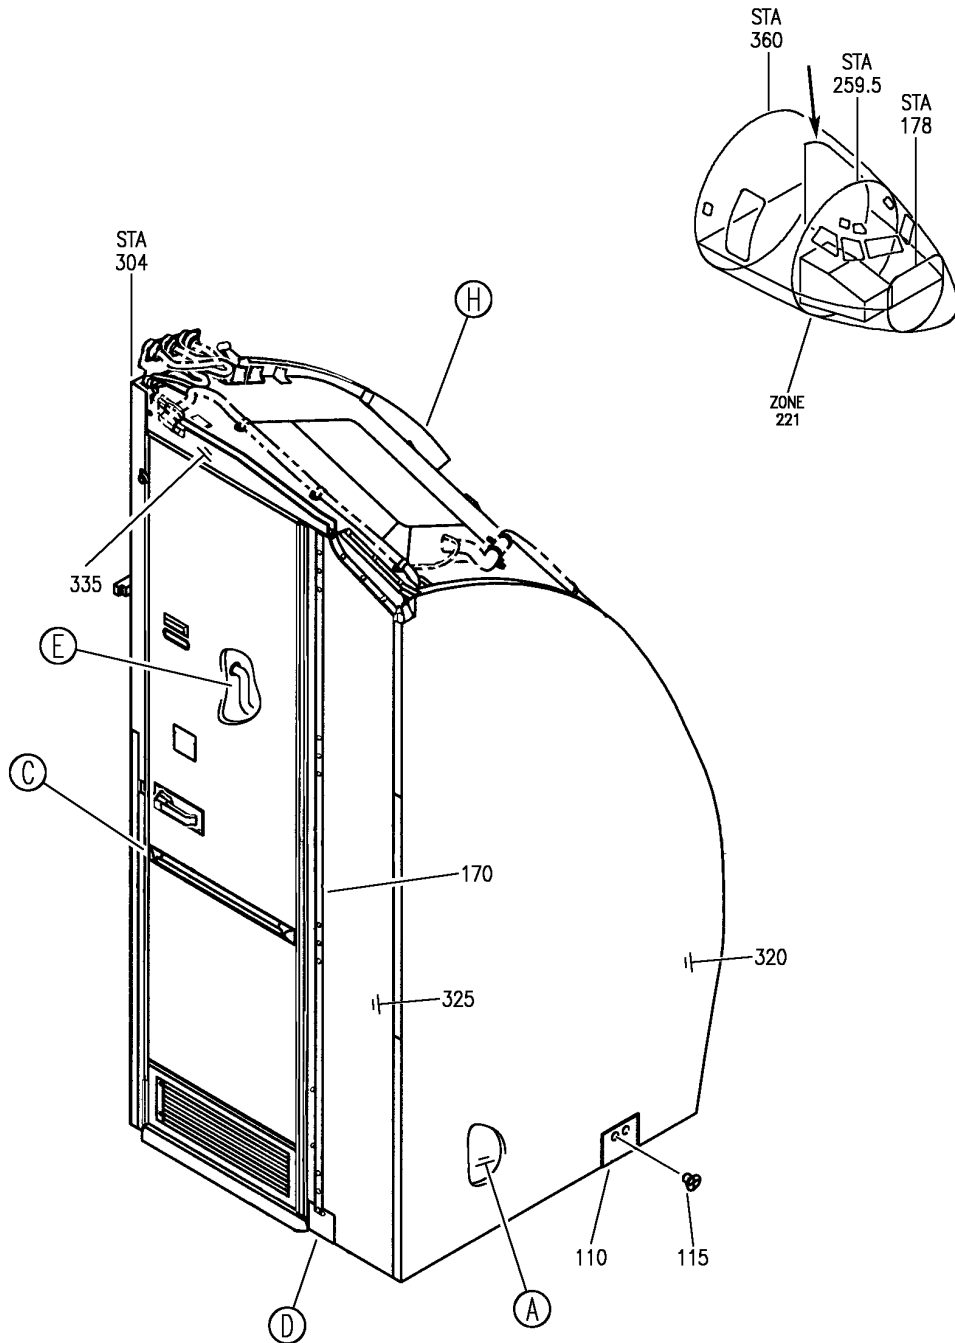

E 25400151G SHT 1 REV 113

MODULE ASSY-LAV A (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 51G (SHEET 1)


**25-40-01-51G**

RJR  
OCT 10/06

25-40-01-51G  
PAGE 0

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

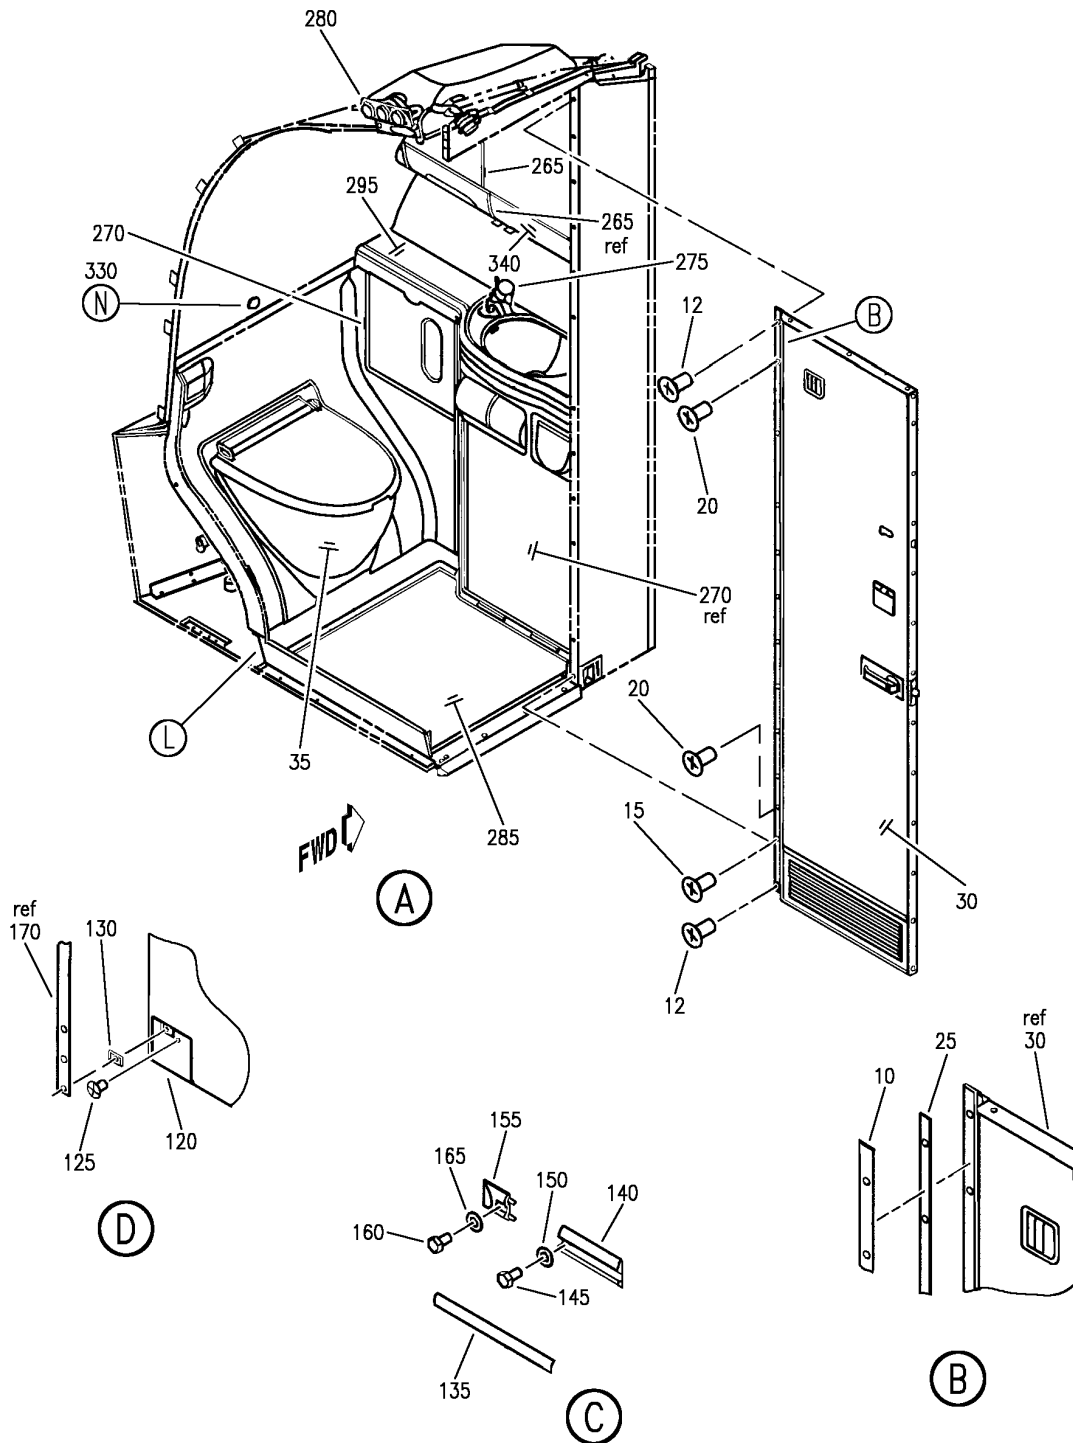

E 25400151G SHT 2 REV 170


MODULE ASSY-LAV A (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 51G (SHEET 2)

**25-40-01-51G**

R Y R  
O C T 15 / 10

25-40-01-51G  
PAGE 0A

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

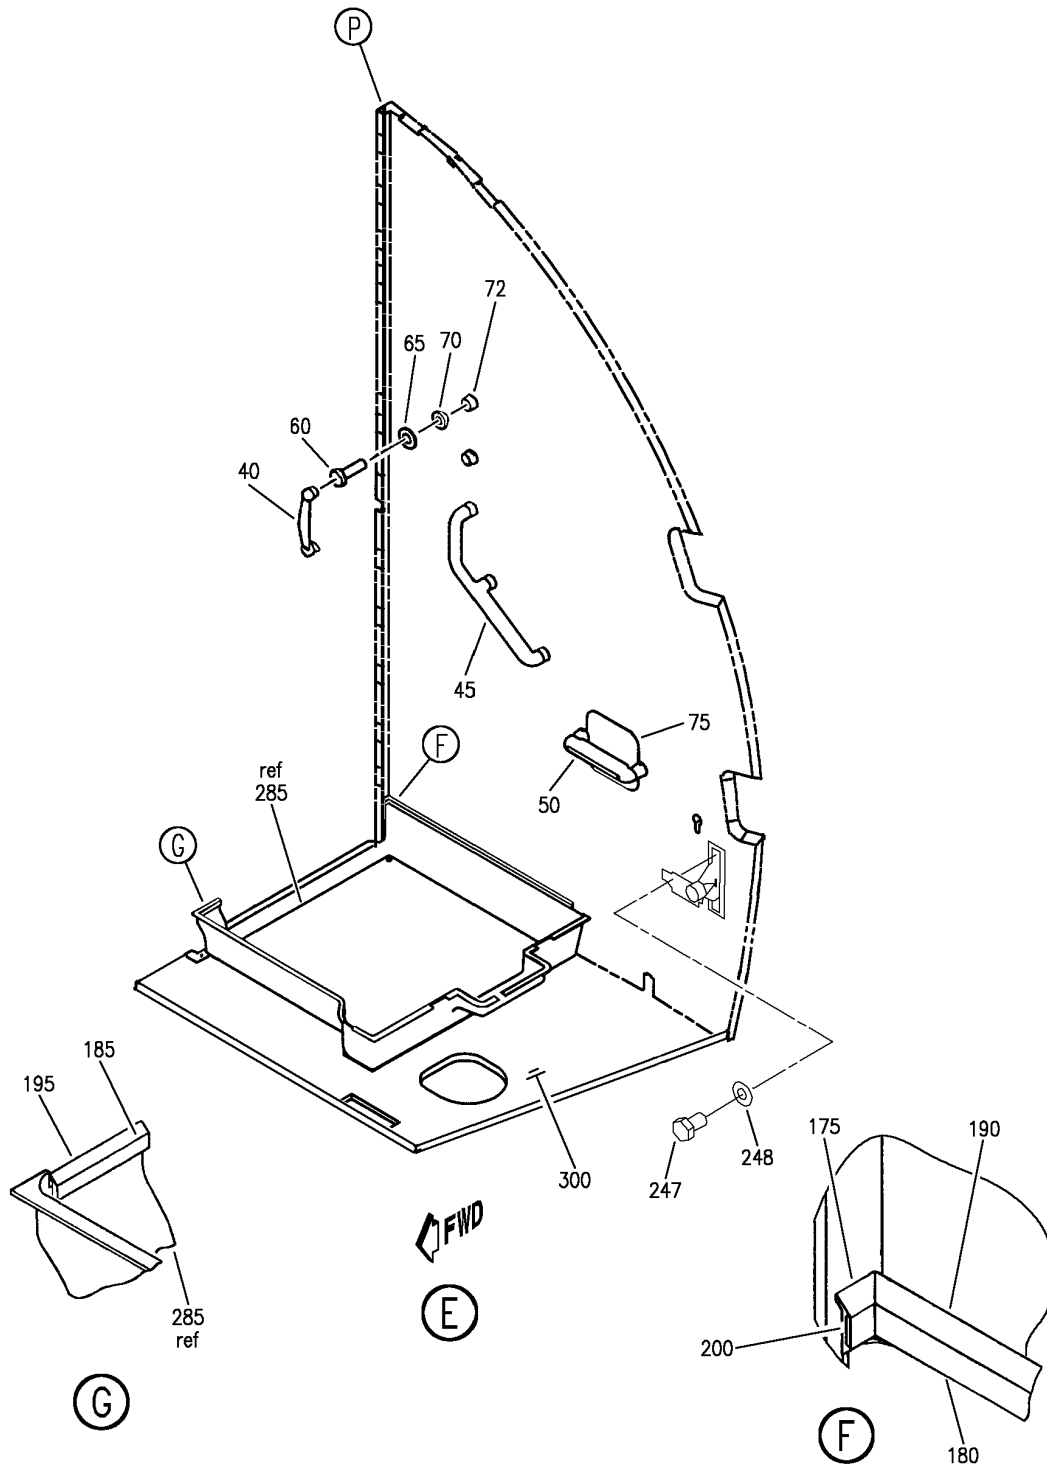

E 25400151G SHT 3 REV 219


MODULE ASSY-LAV A (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 51G (SHEET 3)

**25-40-01-51G**

RJR  
OCT 15/14


25-40-01-51G  
PAGE 0B

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

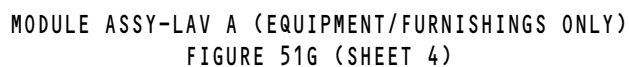

25-40-01-51G

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

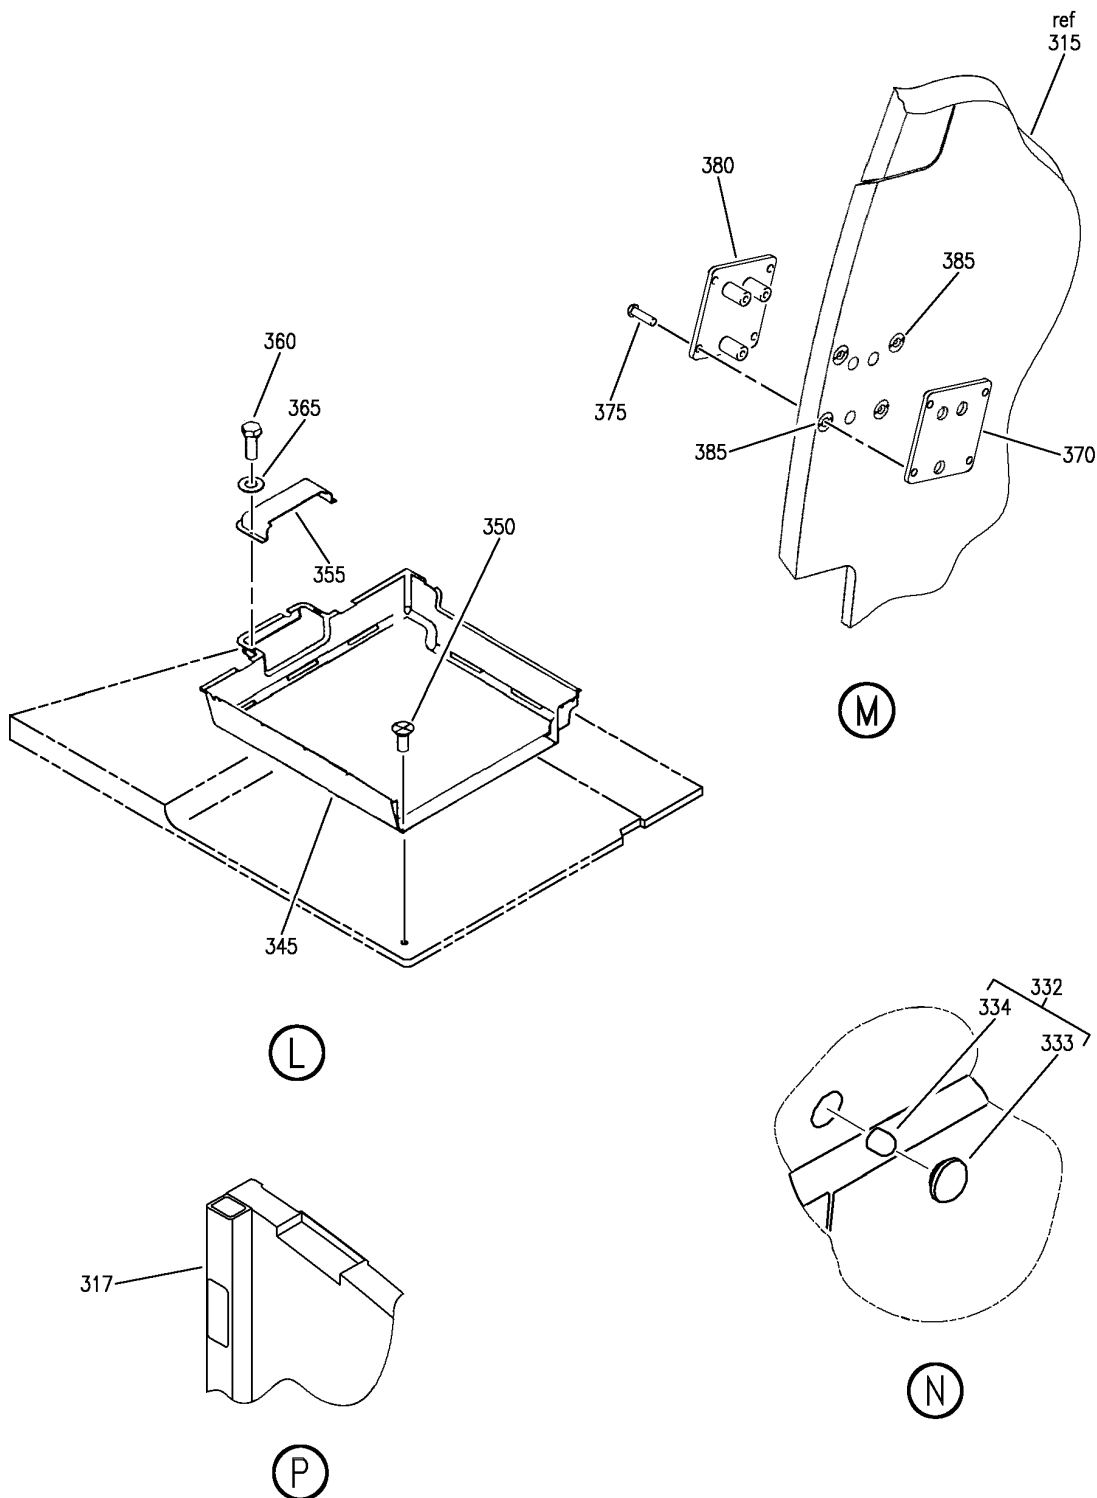

E 25400151G SHT 5 REV 219

25-40-01-51G

R Y R  
O C T 15 / 14

25-40-01-51G  
PAGE 0D

ECCN 9E991 BOEING PROPRIETARY – See title page for details.




**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7<br>NOMENCLATURE                                                                                                                                                                                                                             | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 51G                                                     |                | MODULE ASSY-LAV A<br>(EQUIPMENT/FURNISHINGS<br>ONLY)                                                                                                                                                                                                      | 056057            |                      |
| - 1                                                     | D72000003-111A | MODULE ASSY-LAV A<br>(EQUIPMENT/FURNISHINGS<br>ONLY)<br>SUPPLIER CODE:<br>VJ4577<br>SPECIFICATION NUMBER:<br>S417A180-0003A<br>ELECTRICAL EQUIP NUMBER:<br>M01415<br>COMPONENT MAINT MANUAL REF:<br>25-42-91<br>FOR NHA/OTHER SYS DET SEE:<br>25-40-00-26 | 056057            | RF                   |
| 10                                                      | D72D70987-111  | .RETAINER-SEAL RUBBER<br>SUPPLIER CODE:<br>VS5825<br>ATTACHING PARTS                                                                                                                                                                                      | 056057            | 1                    |
| 12                                                      | NAS514P1032-12 | .SCREW                                                                                                                                                                                                                                                    | 056057            | 2                    |
| 15                                                      | NAS514P1032-8  | .SCREW                                                                                                                                                                                                                                                    | 056057            | 1                    |
| 20                                                      | NAS514P1032-7  | .SCREW<br>-----*-----                                                                                                                                                                                                                                     | 056057            | 10                   |
| 25                                                      | D72D70988-111  | .SEAL-RUBBER<br>SUPPLIER CODE:<br>VS5825                                                                                                                                                                                                                  | 056057            | 1                    |
| 30                                                      | D72W13010-111A | .DOOR ASSY-SLAB<br>SUPPLIER CODE:<br>VS5825<br>FOR DETAILS SEE:<br>25-41-13-56A                                                                                                                                                                           | 056057            | 1                    |
| 35                                                      | D72W15002-111  | .TOILET AND FLOOR PAN ASSY-<br>SUPPLIER CODE:<br>VS5825<br>FOR DETAILS SEE:<br>25-41-21-56A                                                                                                                                                               | 056057            | RF                   |
| 40                                                      | 65-5458-20N    | .HANDLE-ASSIST                                                                                                                                                                                                                                            | 056057            | 1                    |
| 45                                                      | 65C22388-13    | .HANDLE-ASSIST                                                                                                                                                                                                                                            | 056057            | 1                    |
| 50                                                      | 69-72416-5     | .HANDLE-ASSIST<br>SUPPLIER CODE:<br>V26835                                                                                                                                                                                                                | 056057            | 1                    |
| 60                                                      | NAS1801-3-10   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-10                                                                                                                                                                                                          | 056057            | 7                    |
| 65                                                      | NAS1149D0332K  | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0332J                                                                                                                                                                                                        | 056057            | 7                    |
| 70                                                      | 65-5458-21N    | .NUT                                                                                                                                                                                                                                                      | 056057            | 7                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |                                                                                                                                                                                                                                                           |                   |                      |

- ITEM NOT ILLUSTRATED

RYR

25-40-01-51G

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-01  
FIG. 51G  
PAGE 1  
OCT 15/24


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 | NOMENCLATURE                            | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|---------------|-----------------------------------------|-------------------|----------------------|
| 51G                                                     |                |               |                                         |                   |                      |
| 72                                                      | 66-4302-1      | .             | COLLAR                                  | 056057            | 7                    |
| 75                                                      | D75D70952-163  | .             | PAN-                                    | 056057            | 1                    |
|                                                         |                |               | SUPPLIER CODE:<br>VS5825                |                   |                      |
| 80                                                      | D72D80019-111G | .             | KICKSTRIP-                              | 056057            | 1                    |
|                                                         |                |               | SUPPLIER CODE:<br>VS5825                |                   |                      |
|                                                         |                |               | ATTACHING PARTS                         |                   |                      |
| 85                                                      | NAS514P1032-6P | .             | SCREW                                   | 056057            | 6                    |
| 90                                                      | NAS1169DD10    | .             | WASHER                                  | 056057            | 6                    |
|                                                         |                |               | -----*-----                             |                   |                      |
| 95                                                      | D72D70833-111A | .             | PLATE-COVER                             | 056057            | 1                    |
|                                                         |                |               | SUPPLIER CODE:<br>VS5825                |                   |                      |
| 100                                                     | D72D70943-111A | .             | PLATE-COVER                             | 056057            | 1                    |
|                                                         |                |               | SUPPLIER CODE:<br>VS5825                |                   |                      |
|                                                         |                |               | ATTACHING PARTS                         |                   |                      |
| 105                                                     | NAS514P632-4   | .             | SCREW                                   | 056057            | 4                    |
|                                                         |                |               | -----*-----                             |                   |                      |
| 110                                                     | D72D70943-111B | .             | PLATE-COVER                             | 056057            | 1                    |
|                                                         |                |               | SUPPLIER CODE:<br>VS5825                |                   |                      |
|                                                         |                |               | ATTACHING PARTS                         |                   |                      |
| 115                                                     | NAS514P632-4   | .             | SCREW                                   | 056057            | 2                    |
|                                                         |                |               | -----*-----                             |                   |                      |
| 120                                                     | D72D70944-111A | .             | PLATE-COVER                             | 056057            | 1                    |
|                                                         |                |               | SUPPLIER CODE:<br>VS5825                |                   |                      |
|                                                         |                |               | ATTACHING PARTS                         |                   |                      |
| 125                                                     | NAS514P632-4   | .             | SCREW                                   | 056057            | 1                    |
|                                                         |                |               | -----*-----                             |                   |                      |
| 130                                                     | D72D71550-111  | .             | SPACER-                                 | 056057            | 1                    |
|                                                         |                |               | SUPPLIER CODE:<br>VS5825                |                   |                      |
| 135                                                     | D72D80025-911A | .             | RUBSTRIP-                               | 056057            | 1                    |
|                                                         |                |               | SUPPLIER CODE:<br>VS5825                |                   |                      |
| 140                                                     | D72D80024-111B | .             | RETAINER-                               | 056057            | 1                    |
|                                                         |                |               | SUPPLIER CODE:<br>VS5825                |                   |                      |
|                                                         |                |               | ATTACHING PARTS                         |                   |                      |
| 145                                                     | NAS1801-08-5   | .             | SCREW                                   | 056057            | 3                    |
|                                                         |                |               | STANDARD SUBSTITUTION:<br>BACS12HN08-5  |                   |                      |
| 150                                                     | NAS1149DN816K  | .             | WASHER                                  | 056057            | 3                    |
|                                                         |                |               | STANDARD SUBSTITUTION:<br>NAS1149DN816J |                   |                      |
|                                                         |                |               | -----*-----                             |                   |                      |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |               |                                         |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R

25-40-01-51G

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-01  
 FIG. 51G  
 PAGE 2  
 OCT 15/24


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7             | NOMENCLATURE | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|---------------------------|--------------|-------------------|----------------------|
| 51G                                                     |                |                           |              |                   |                      |
| 155                                                     | 432W7101-6J    | .ENDCAP-                  |              | 056057            | 2                    |
| 155                                                     | 413N3165-33C   | .CAP-END                  |              | 056057            | 2                    |
|                                                         |                | ATTACHING PARTS           |              |                   |                      |
| 160                                                     | NAS1801-08-5   | .SCREW                    |              | 056057            | 2                    |
|                                                         |                | STANDARD SUBSTITUTION:    |              |                   |                      |
|                                                         |                | BACS12HN08-5              |              |                   |                      |
| 165                                                     | NAS1149DN816K  | .WASHER                   |              | 056057            | 2                    |
|                                                         |                | STANDARD SUBSTITUTION:    |              |                   |                      |
|                                                         |                | NAS1149DN816J             |              |                   |                      |
|                                                         |                | -----*-----               |              |                   |                      |
| 170                                                     | D72D70668-111  | .DOUBLER-FLIGHT DECK DOOR |              | 056057            | 1                    |
|                                                         |                | SUPPLIER CODE:            |              |                   |                      |
|                                                         |                | VS5825                    |              |                   |                      |
| 175                                                     | D72D71110-111B | .TRIM-RTNR, FLOOR PAN     |              | 056057            | 1                    |
|                                                         |                | SUPPLIER CODE:            |              |                   |                      |
|                                                         |                | VS5825                    |              |                   |                      |
| 180                                                     | D72D71112-916B | .TRIM-INSERT, FLOOR PAN   |              | 056057            | 1                    |
|                                                         |                | SUPPLIER CODE:            |              |                   |                      |
|                                                         |                | VS5825                    |              |                   |                      |
| 185                                                     | D72D71112-917B | .TRIM-INSERT, FLOOR PAN   |              | 056057            | 1                    |
|                                                         |                | SUPPLIER CODE:            |              |                   |                      |
|                                                         |                | VS5825                    |              |                   |                      |
| 190                                                     | D72D71169-111B | .TRIM-RTNR, FLOOR PAN     |              | 056057            | 1                    |
|                                                         |                | SUPPLIER CODE:            |              |                   |                      |
|                                                         |                | VS5825                    |              |                   |                      |
| 195                                                     | D72D71171-111B | .TRIM-RTNR, FLOOR PAN     |              | 056057            | 1                    |
|                                                         |                | SUPPLIER CODE:            |              |                   |                      |
|                                                         |                | VS5825                    |              |                   |                      |
| 200                                                     | D72D71112-912B | .TRIM-INSERT, FLOOR PAN   |              | 056057            | 1                    |
|                                                         |                | SUPPLIER CODE:            |              |                   |                      |
|                                                         |                | VS5825                    |              |                   |                      |
| 225                                                     | D72D70518-111  | .BLANKET-FIRE             |              | 056057            | 1                    |
|                                                         |                | SUPPLIER CODE:            |              |                   |                      |
|                                                         |                | VS5825                    |              |                   |                      |
|                                                         |                | ATTACHING PARTS           |              |                   |                      |
| 230                                                     | NAS1801-06-4   | .SCREW                    |              | 056057            | 16                   |
|                                                         |                | STANDARD SUBSTITUTION:    |              |                   |                      |
|                                                         |                | BACS12HN06-4              |              |                   |                      |
| 235                                                     | NAS1801-06-6   | .SCREW                    |              | 056057            | 6                    |
|                                                         |                | STANDARD SUBSTITUTION:    |              |                   |                      |
|                                                         |                | BACS12HN06-6              |              |                   |                      |
| 240                                                     | NAS1149DN616K  | .WASHER                   |              | 056057            | 22                   |
|                                                         |                | STANDARD SUBSTITUTION:    |              |                   |                      |
|                                                         |                | NAS1149DN616J             |              |                   |                      |
|                                                         |                | -----*-----               |              |                   |                      |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |                           |              |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R

25-40-01-51G

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-01  
 FIG. 51G  
 PAGE 3  
 OCT 15/24


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7<br>NOMENCLATURE                                                                                       | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|---------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 51G<br>245                                              | D72W30009-111A | .DOOR-FLAP<br>SUPPLIER CODE:<br>VS5825<br>CONFIG CHG DATA FROM A CMM:<br>SUPSD BY D72W30049-111A                    | 056057            | 1                    |
| 245                                                     | D72W30049-111A | .DOOR ASSY-FLAP<br>SUPPLIER CODE:<br>VS5825<br>CONFIG CHG DATA FROM A CMM:<br>SUPERSEDES<br>D72W30009-111A          | 056057            | 1                    |
| - 246                                                   | D72W30009-111C | .DOOR-FLAP<br>SUPPLIER CODE:<br>VS5825<br>CONFIG CHG DATA FROM A CMM:<br>SUPSD BY D72W30049-111C<br>ATTACHING PARTS | 056057            | 1                    |
| 247                                                     | NAS1801-08-5   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN08-5                                                                    | 056057            | 3                    |
| 248                                                     | NAS1149DN816K  | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149DN816J<br>-----*-----                                                   | 056057            | 3                    |
| 250                                                     | D72W30010-111A | .DOOR-FLAP<br>SUPPLIER CODE:<br>VS5825<br>CONFIG CHG DATA FROM A CMM:<br>SUPSD BY D72W30050-111A                    | 056057            | 1                    |
| 250                                                     | D72W30050-111A | .DOOR ASSY-FLAP<br>SUPPLIER CODE:<br>VS5825<br>CONFIG CHG DATA FROM A CMM:<br>SUPERSEDES<br>D72W30010-111A          | 056057            | 1                    |
| - 252                                                   | D72W30010-111C | .DOOR-FLAP<br>SUPPLIER CODE:<br>VS5825<br>CONFIG CHG DATA FROM A CMM:<br>SUPSD BY D72W30050-111C<br>ATTACHING PARTS | 056057            | 1                    |
| 255                                                     | NAS1801-08-5   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN08-5                                                                    | 056057            | 3                    |
| 260                                                     | NAS1149DN816K  | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149DN816J<br>-----*-----                                                   | 056057            | 3                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |                                                                                                                     |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R

25-40-01-51G

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-01  
FIG. 51G  
PAGE 4  
OCT 15/24


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER   | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                                                                                                                                                                             | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|---------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 51G<br>265                                              | D72W16006-111 | .DISPENSER ASSY-UPR<br>SUPPLIER CODE:<br>VS5825<br>MISCELLANEOUS DATA:<br>NON PROCURABLE<br>FOR DETAILS SEE:<br>25-41-51-56D                                                                                                                                           | 056057            | RF                   |
| 270                                                     | D72W17006-111 | .DISPENSER ASSY-LWR<br>SUPPLIER CODE:<br>VS5825<br>MISCELLANEOUS DATA:<br>NON PROCURABLE<br>FUNCTIONAL REFERENCE:<br>EQUIPMENT/FURNISHINGS<br>FOR DETAILS SEE<br>25-41-51-60A<br>FIRE PROTECTION<br>FOR DETAILS SEE<br>26-24-01-03B                                    | 056057            | RF                   |
| 275                                                     | D72W26012-111 | .PLUMBING ASSY-<br>SUPPLIER CODE:<br>VS5825<br>MISCELLANEOUS DATA:<br>NON PROCURABLE<br>FUNCTIONAL REFERENCE:<br>AIR CONDITIONING<br>FOR DETAILS SEE<br>21-24-51-56A<br>WATER/WASTE<br>FOR DETAILS SEE<br>38-11-05-56A<br>38-11-06-73Q<br>38-11-51-56A<br>38-13-01-56A | 056057            | RF                   |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |               |                                                                                                                                                                                                                                                                        |                   |                      |

— ITEM NOT ILLUSTRATED

RYR

25-40-01-51G

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

25-40-01  
FIG. 51G  
PAGE 5  
OCT 15/24


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                                                                                                                                                                                                                                                                                                            | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 51G<br>280                                              | D72W27014-111  | .ELECTRICAL ASSY-<br>SUPPLIER CODE:<br>VS5825<br>MISCELLANEOUS DATA:<br>NON PROCURABLE<br>FUNCTIONAL REFERENCE:<br>COMMUNICATIONS<br>FOR DETAILS SEE<br>23-31-05-56A<br>EQUIPMENT/FURNISHINGS<br>FOR DETAILS SEE<br>25-41-60-56A<br>FIRE PROTECTION<br>FOR DETAILS SEE<br>26-14-01-56A<br>LIGHTS<br>FOR DETAILS SEE<br>33-26-03-56A<br>33-27-51-56A<br>WATER/WASTE<br>FOR DETAILS SEE<br>38-32-04-56A | 056057            | RF                   |
| 285                                                     | D72D80007-111B | .MAT-FL00R<br>SUPPLIER CODE:<br>VS5825                                                                                                                                                                                                                                                                                                                                                                | 056057            | 1                    |
| 290                                                     | D72W12002-111  | .OUTWALL ASSY-<br>SUPPLIER CODE:<br>VS5825<br>MISCELLANEOUS DATA:<br>NON PROCURABLE<br>FOR DETAILS SEE:<br>25-41-40-56A                                                                                                                                                                                                                                                                               | 056057            | RF                   |
| 295                                                     | D72W59045-111A | .DECK-SINK<br>SUPPLIER CODE:<br>VS5825                                                                                                                                                                                                                                                                                                                                                                | 056057            | 1                    |
| 300                                                     | D72D41002-111  | .PANEL-FL00R<br>SUPPLIER CODE:<br>VS5825                                                                                                                                                                                                                                                                                                                                                              | 056057            | 1                    |
| 305                                                     | D72D46006-111  | .PANEL-OUTBD LWR<br>SUPPLIER CODE:<br>VS5825                                                                                                                                                                                                                                                                                                                                                          | 056057            | 1                    |
| 310                                                     | D72D46007-111  | .PANEL-OUTBD UPR<br>SUPPLIER CODE:<br>VS5825                                                                                                                                                                                                                                                                                                                                                          | 056057            | 1                    |
| 315                                                     | D72W52027-111B | .PANEL-SIDEWALL<br>SUPPLIER CODE:<br>VS5825                                                                                                                                                                                                                                                                                                                                                           | 056057            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |                                                                                                                                                                                                                                                                                                                                                                                                       |                   |                      |

— ITEM NOT ILLUSTRATED

RYR

25-40-01-51G

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-01  
FIG. 51G  
PAGE 6  
OCT 15/24


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                                                               | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|----------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 51G<br>317                                              | D72D70451-1111 | ..FRAME ASSY-SIDEWALL<br>SUPPLIER CODE:<br>VS5825<br>MISCELLANEOUS DATA:<br>NO DECORATIVE LAMINATE<br>PART                                               | 056057            | 1                    |
| 320                                                     | D72W53011-111A | .PANEL-SINK WALL<br>SUPPLIER CODE:<br>VS5825                                                                                                             | 056057            | 1                    |
| 325                                                     | D72W54007-111B | .PANEL-DOOR WALL<br>SUPPLIER CODE:<br>VS5825                                                                                                             | 056057            | 1                    |
| 330                                                     | D72W56001-111A | .PANEL-LINING<br>SUPPLIER CODE:<br>VS5825                                                                                                                | 056057            | 1                    |
| 332                                                     | D72D70249-111  | ..CUSHION-RUBBER LID<br>SUPPLIER CODE:<br>VS5825<br>SB DATA FROM A CMM:<br>PRE SB D72K-25-114                                                            | 056057            | 1                    |
| 332                                                     | D72D72504-111  | ..CUSHION ASSY-RUBBER<br>SUPPLIER CODE:<br>VS5825<br>CONFIG CHG DATA FROM A CMM:<br>SUPERSEDES D72D72281-111                                             | 056057            | 1                    |
| 332                                                     | D72D72281-111  | ..CUSHION ASSY-RUBBER<br>SUPPLIER CODE:<br>VS5825<br>SB DATA FROM A CMM:<br>POST SB D72K-25-114<br>CONFIG CHG DATA FROM A CMM:<br>SUPSD BY D72D72504-111 | 056057            | 1                    |
| 333                                                     | D72D72375-111  | ...CUSHION-<br>SUPPLIER CODE:<br>VS5825<br>CONFIG CHG DATA FROM A CMM:<br>SUPERSEDES D72D72248-111                                                       | 056057            | 1                    |
| 333                                                     | D72D72248-111  | ...CUSHION-<br>SUPPLIER CODE:<br>VS5825<br>SB DATA FROM A CMM:<br>POST SB D72K-25-114<br>CONFIG CHG DATA FROM A CMM:<br>SUPSD BY D72D72375-111           | 056057            | 1                    |
| 334                                                     | D72D72287-111  | ...MAGNET-<br>SUPPLIER CODE:<br>VS5825<br>SB DATA FROM A CMM:<br>POST SB D72K-25-114                                                                     | 056057            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |                                                                                                                                                          |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R

25-40-01-51G

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

25-40-01  
FIG. 51G  
PAGE 7  
OCT 15/24


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER     | 1 2 3 4 5 6 7 NOMENCLATURE                                                     | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|-----------------|--------------------------------------------------------------------------------|-------------------|----------------------|
| 51G                                                     |                 |                                                                                |                   |                      |
| 335                                                     | D72W57003-111B  | .PANEL-HEADER<br>SUPPLIER CODE:<br>VS5825                                      | 056057            | 1                    |
| 340                                                     | D72W59046-111A  | .PANEL-DISP CABINET<br>SUPPLIER CODE:<br>VS5825                                | 056057            | 1                    |
| 345                                                     | D72D70435-111B  | .PAN-FLLOOR<br>SUPPLIER CODE:<br>VS5825<br>ATTACHING PARTS                     | 056057            | 1                    |
| 350                                                     | NAS514P1032-6P  | .SCREW<br>-----*-----                                                          | 056057            | 4                    |
| 355                                                     | D72D70438-111B  | .COVER-FLLOOR PAN<br>SUPPLIER CODE:<br>VS5825<br>ATTACHING PARTS               | 056057            | 1                    |
| 360                                                     | NAS1801-08-7    | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN08-7                               | 056057            | 2                    |
| 365                                                     | NAS1149DN816K   | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149DN816J<br>-----*-----              | 056057            | 2                    |
| 370                                                     | D72D72049-111   | .PLATE-<br>SUPPLIER CODE:<br>VS5825<br>POST SERVICE LETTER:<br>25-123          | 056057            | 1                    |
| 375                                                     | NAS514P1032-26P | .SCREW-<br>POST SERVICE LETTER:<br>25-123                                      | 056057            | 4                    |
| 380                                                     | D72D72047-111   | .PLATE ASSY-BRKT<br>SUPPLIER CODE:<br>VS5825<br>POST SERVICE LETTER:<br>25-123 | 056057            | 1                    |
| 385                                                     | D72D72048-111   | .INSERT-BRKT<br>SUPPLIER CODE:<br>VS5825<br>POST SERVICE LETTER:<br>25-123     | 056057            | 4                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                 |                                                                                |                   |                      |

— ITEM NOT ILLUSTRATED


R Y R

25-40-01-51G

ECCN 9E991 BOEING PROPRIETARY — See title page for details.


25-40-01  
 FIG. 51G  
 PAGE 8  
 OCT 15/24



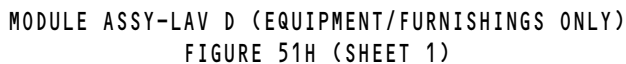

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

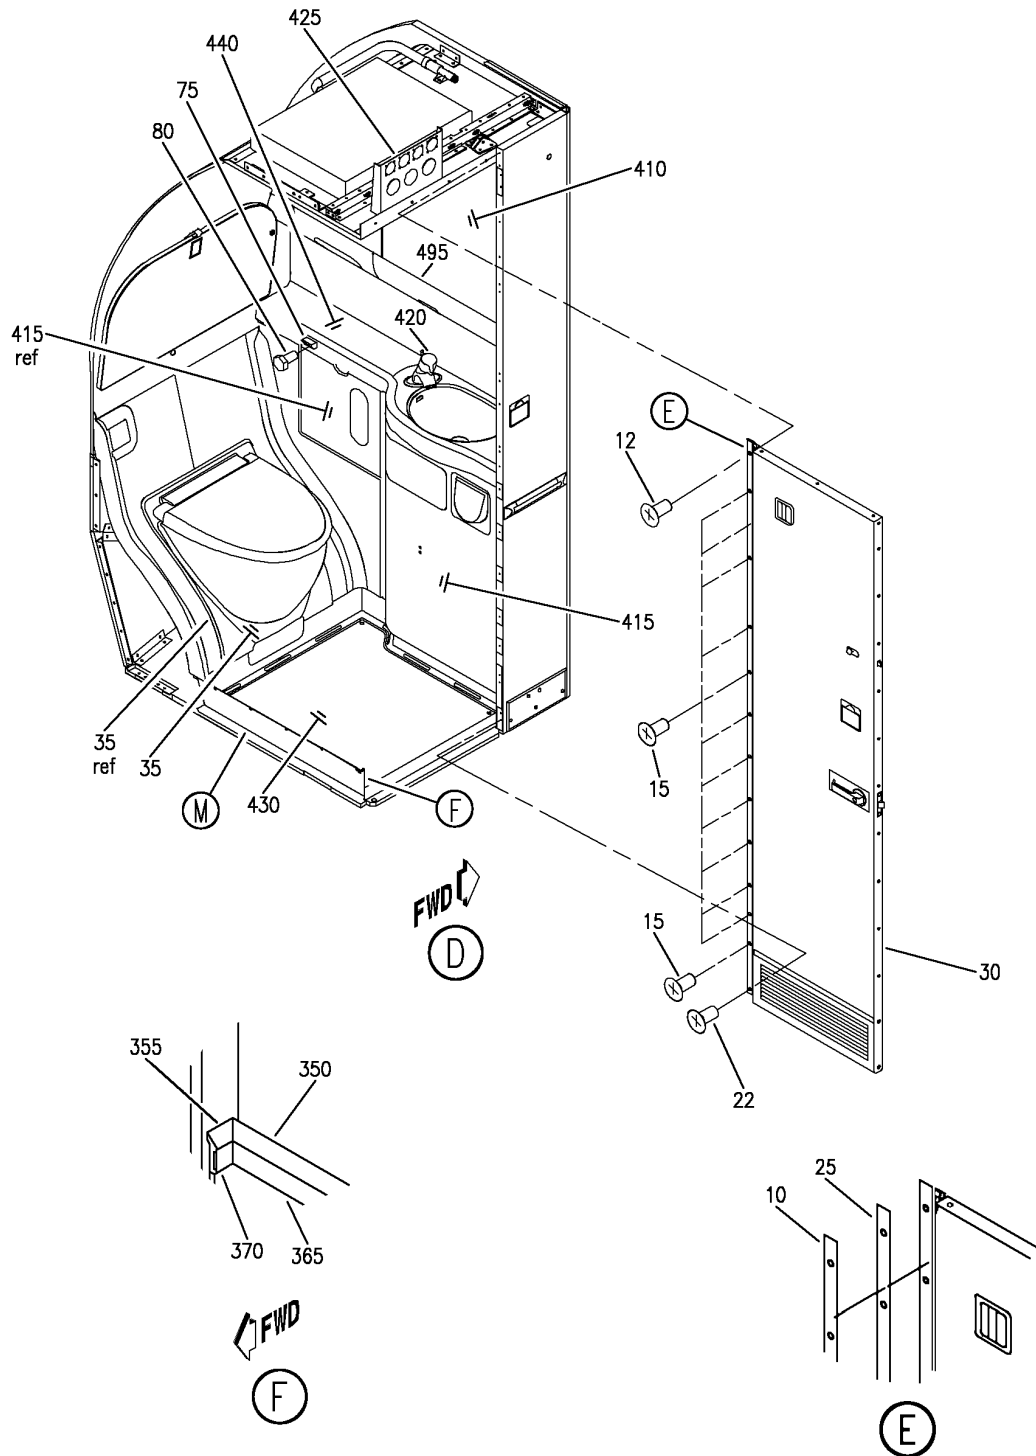

E 25400151H SHT 2 REV 339

MODULE ASSY-LAV D (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 51H (SHEET 2)


**25-40-01-51H**

R Y R  
O C T 15 / 24

25-40-01-51H  
PAGE 0A

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

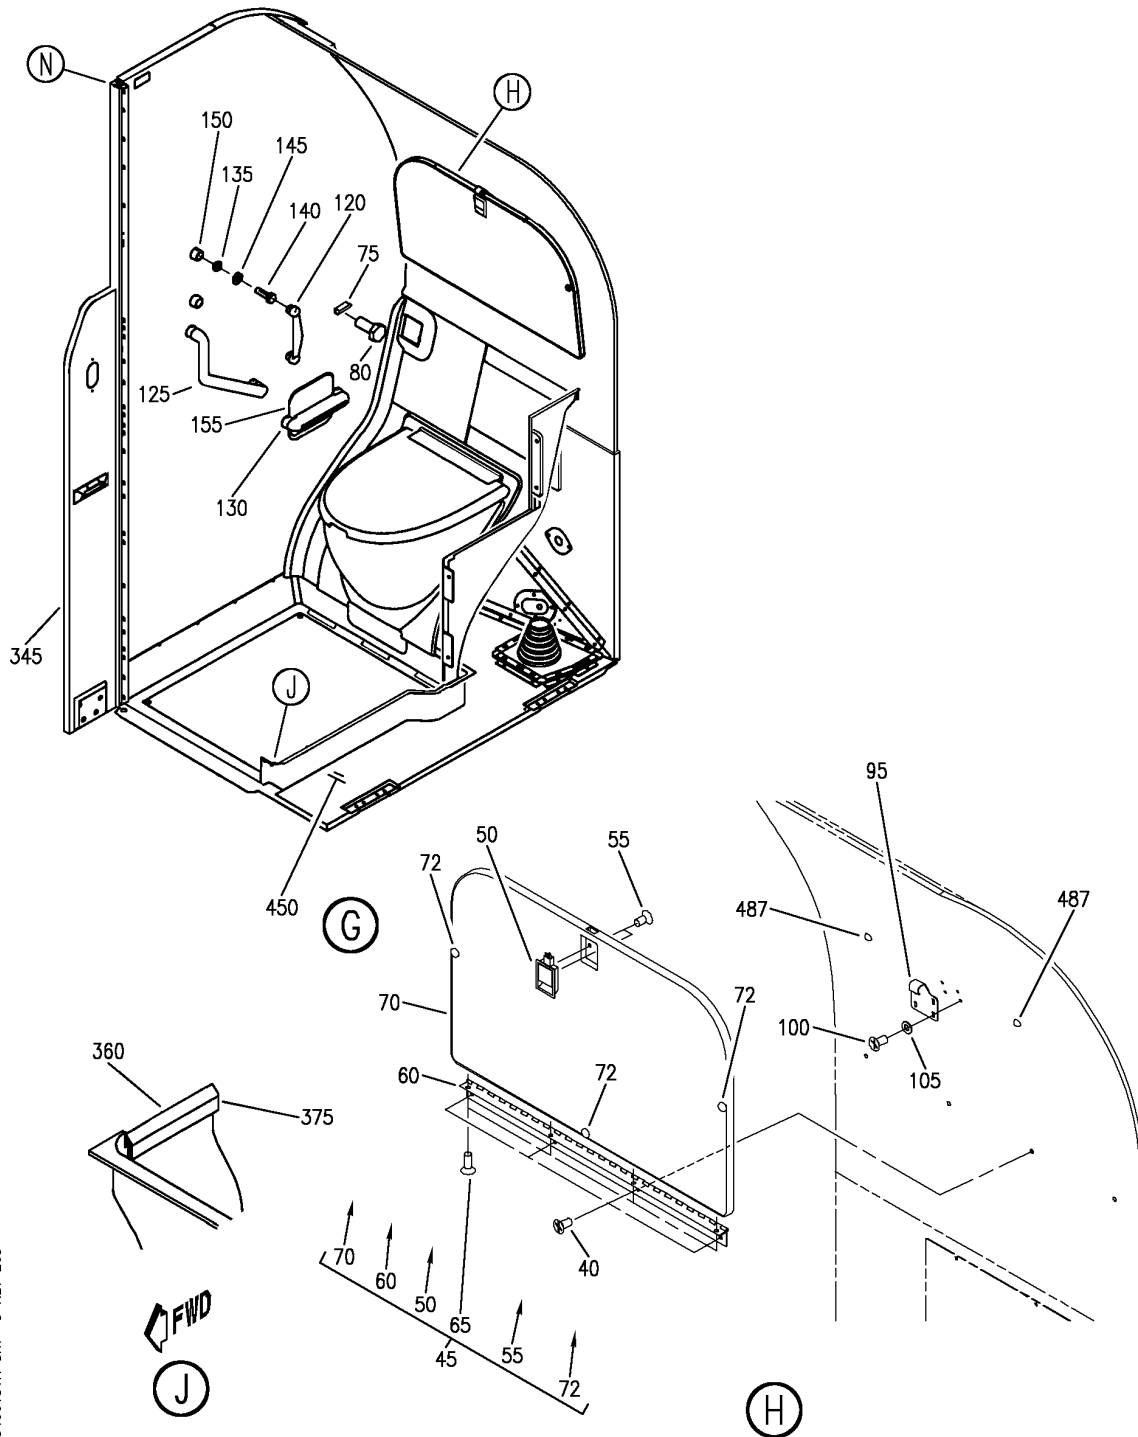

E 25400151H SHT 3 REV 265


MODULE ASSY-LAV D (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 51H (SHEET 3)

**25-40-01-51H**

RJR  
AUG 15/18


25-40-01-51H  
PAGE 0B

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

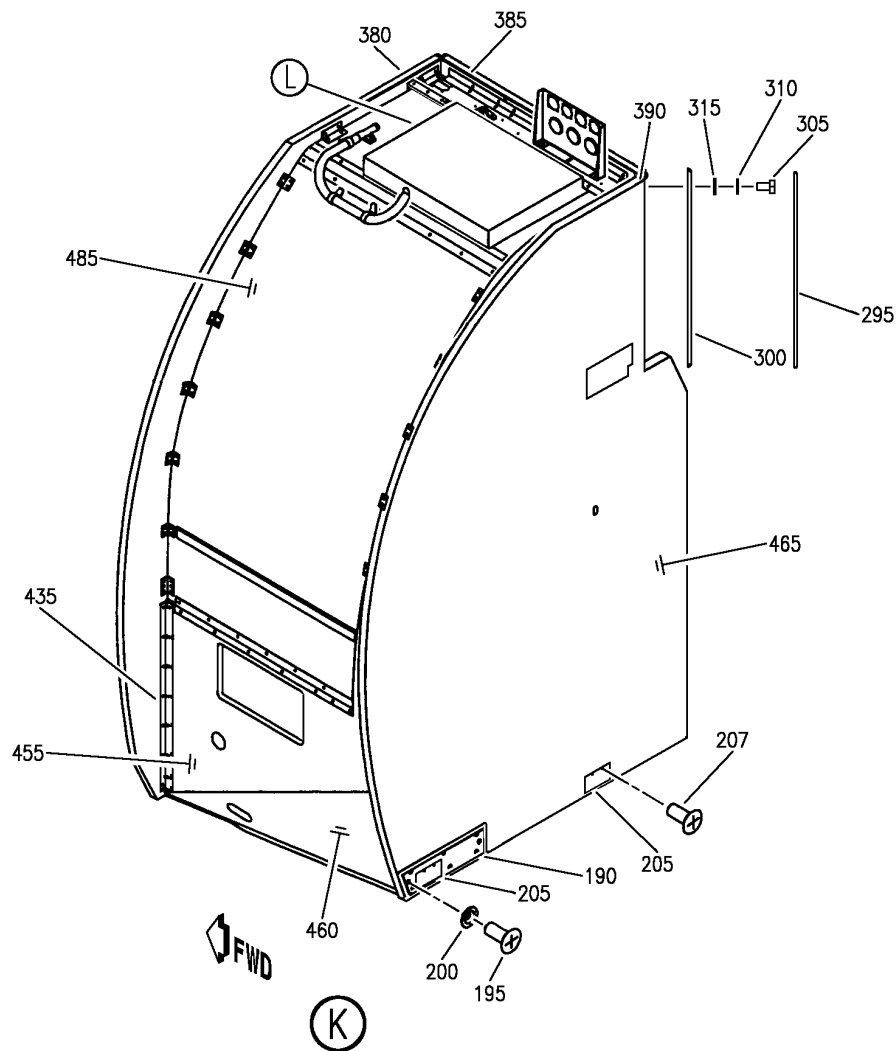

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

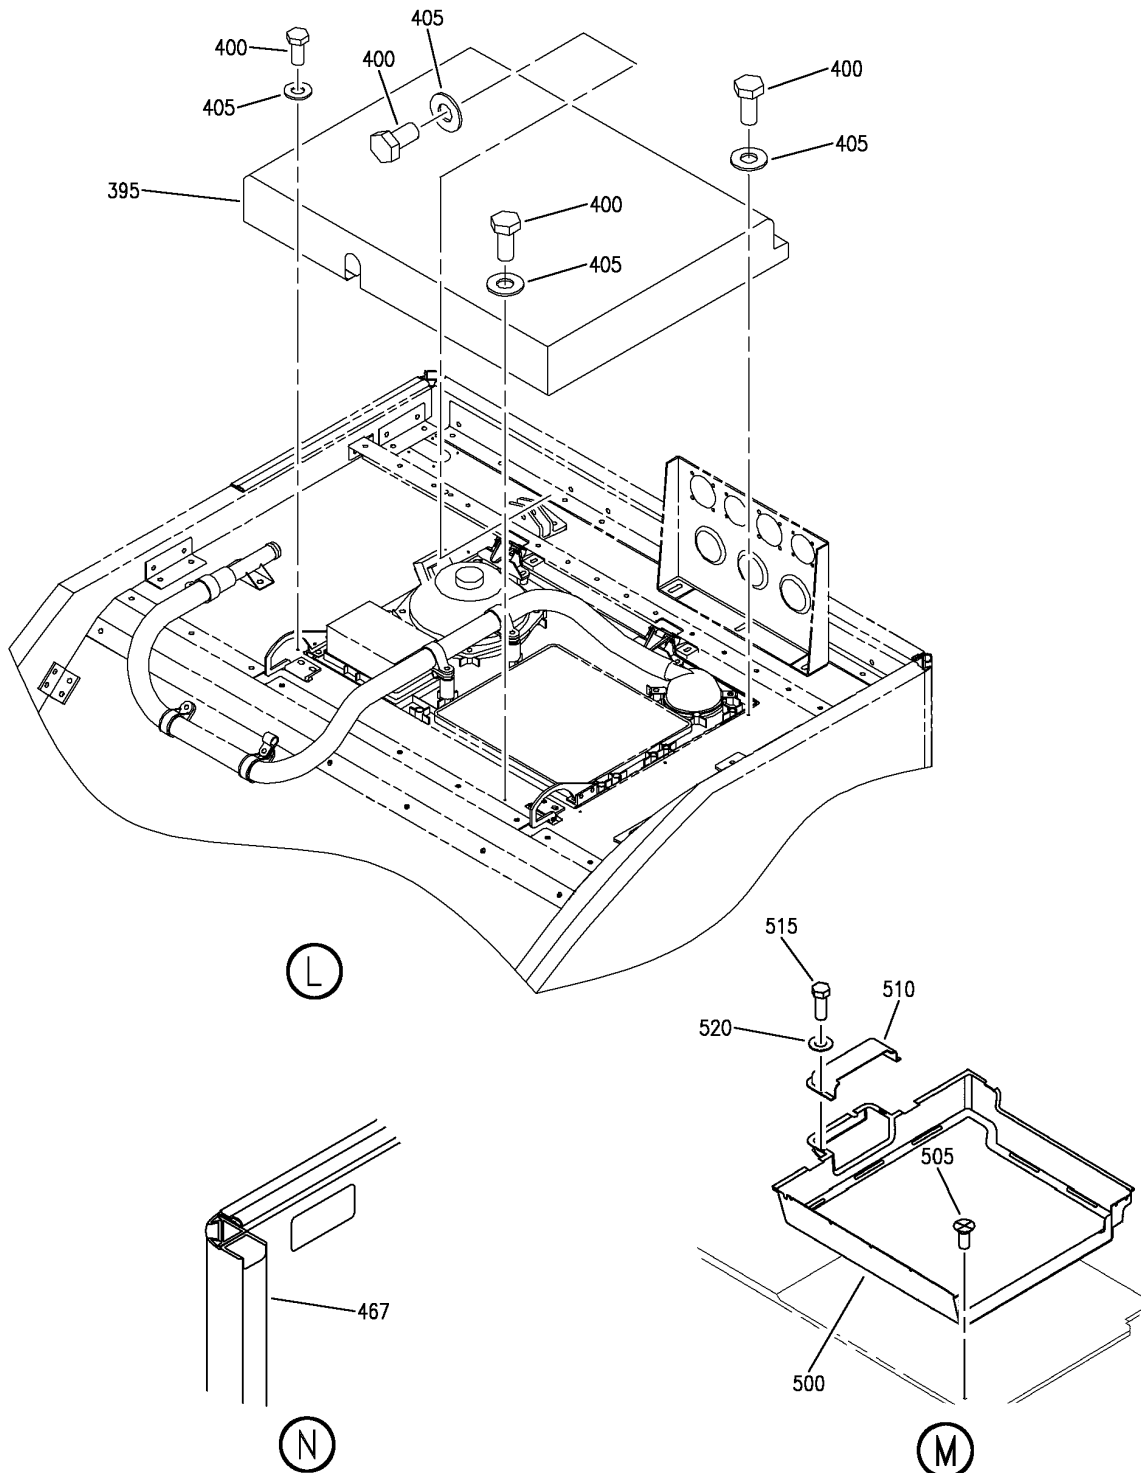

E 25400151H SHT 5 REV 215

MODULE ASSY-LAV D (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 51H (SHEET 5)

**25-40-01-51H**

RJR  
JUN 15/14

25-40-01-51H  
PAGE 0D

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

 **BOEING**  
737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                                                                                                                                                                                | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 51H                                                     |                | MODULE ASSY-LAV D<br>(EQUIPMENT/FURNISHINGS<br>ONLY)                                                                                                                                                                                                                      | 056335            |                      |
| - 1                                                     | D72000701-111A | MODULE ASSY-LAV D<br>(EQUIPMENT/FURNISHINGS<br>ONLY)<br>SUPPLIER CODE:<br>VJ4577<br>SPECIFICATION NUMBER:<br>S417A180-0701A<br>ELECTRICAL EQUIP NUMBER:<br>M01418<br>COMPONENT MAINT MANUAL REF:<br>25-42-92<br>FOR NHA/OTHER SYS DET SEE:<br>25-40-00-27<br>25-40-01-01U | 056335            | RF                   |
| 10                                                      | D72D70987-111  | .RETAINER-SEAL RUBBER<br>SUPPLIER CODE:<br>VS5825<br>ATTACHING PARTS                                                                                                                                                                                                      | 056335            | 1                    |
| 12                                                      | NAS514P1032-12 | .SCREW                                                                                                                                                                                                                                                                    | 056335            | 1                    |
| 15                                                      | NAS514P1032-8  | .SCREW                                                                                                                                                                                                                                                                    | 056335            | 12                   |
| 22                                                      | NAS514P1032-10 | .SCREW                                                                                                                                                                                                                                                                    | 056335            | 1                    |
|                                                         |                | -----*-----                                                                                                                                                                                                                                                               |                   |                      |
| 25                                                      | D72D70988-111  | .SEAL-RUBBER<br>SUPPLIER CODE:<br>VS5825                                                                                                                                                                                                                                  | 056335            | 1                    |
| 30                                                      | D72W13011-111A | .DOOR ASSY-SLAB<br>SUPPLIER CODE:<br>VS5825<br>FOR DETAILS SEE:<br>25-41-17-56                                                                                                                                                                                            | 056335            | 1                    |
| 35                                                      | D72W15001-111  | .TOILET AND FLOOR PAN ASSY-<br>SUPPLIER CODE:<br>VS5825<br>MISCELLANEOUS DATA:<br>NON PROCURABLE<br>FOR DETAILS SEE:<br>25-41-21-56B                                                                                                                                      | 056335            | RF                   |
| 40                                                      | NAS514P1032-5  | .SCREW                                                                                                                                                                                                                                                                    | 056335            | 4                    |
| 45                                                      | D72W30007-111A | .BOARD ASSY-DIAPER<br>SUPPLIER CODE:<br>VS5825                                                                                                                                                                                                                            | 056335            | 1                    |
| 50                                                      | C396           | ..LATCH-CABINET<br>SUPPLIER CODE:<br>VJ3034<br>TRUE PART NUMBER:<br>C-396                                                                                                                                                                                                 | 056335            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |                                                                                                                                                                                                                                                                           |                   |                      |

- ITEM NOT ILLUSTRATED

RYR

25-40-01-51H

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-01  
FIG. 51H  
PAGE 1  
OCT 15/24

 **BOEING**  
737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 NOMENCLATURE             | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|----------------------------------------|-------------------|----------------------|
| 51H                                                     |                | ATTACHING PARTS                        |                   |                      |
| 55                                                      | NAS514P1032-6P | ..SCREW                                | 056335            | 2                    |
|                                                         |                | -----*-----                            |                   |                      |
| 60                                                      | D72D70574-111  | ..HINGE-                               | 056335            | 1                    |
|                                                         |                | SUPPLIER CODE:<br>VS5825               |                   |                      |
|                                                         |                | ATTACHING PARTS                        |                   |                      |
| 65                                                      | NAS514P1032-5  | ..SCREW                                | 056335            | 4                    |
|                                                         |                | -----*-----                            |                   |                      |
| 70                                                      | D72W57301-111A | ..PANEL-                               | 056335            | 1                    |
|                                                         |                | SUPPLIER CODE:<br>VS5825               |                   |                      |
| 72                                                      | D75D80033-111  | ...BUMPER-                             | 056335            | 3                    |
|                                                         |                | SUPPLIER CODE:<br>VS5825               |                   |                      |
| 75                                                      | D75D80502-111A | .SUPPORT-DIAPER BOARD                  | 056335            | 2                    |
|                                                         |                | SUPPLIER CODE:<br>VS5825               |                   |                      |
|                                                         |                | ATTACHING PARTS                        |                   |                      |
| 80                                                      | NAS1801-3-10   | .SCREW                                 | 056335            | 4                    |
|                                                         |                | STANDARD SUBSTITUTION:<br>BACS12HN3-10 |                   |                      |
|                                                         |                | -----*-----                            |                   |                      |
| - 85                                                    | D72D71417-111  | .ANGLE-SPRT                            | 056335            | 1                    |
|                                                         |                | SUPPLIER CODE:<br>VS5825               |                   |                      |
|                                                         |                | ATTACHING PARTS                        |                   |                      |
| - 90                                                    | NAS1801-3-8    | .SCREW                                 | 056335            | 2                    |
|                                                         |                | STANDARD SUBSTITUTION:<br>BACS12HN3-8  |                   |                      |
|                                                         |                | -----*-----                            |                   |                      |
| 95                                                      | D72D71041-111  | .STRIKER-LATCH                         | 056335            | 1                    |
|                                                         |                | SUPPLIER CODE:<br>VS5825               |                   |                      |
|                                                         |                | ATTACHING PARTS                        |                   |                      |
| 100                                                     | NAS514P632-4   | .SCREW                                 | 056335            | 4                    |
| 105                                                     | D75D70052-111  | .WASHER-                               | 056335            | 4                    |
|                                                         |                | SUPPLIER CODE:<br>VS5825               |                   |                      |
|                                                         |                | -----*-----                            |                   |                      |
| 110                                                     | D72D70434-111  | .ASHTRAY-                              | 056335            | 1                    |
|                                                         |                | SUPPLIER CODE:<br>VS5825               |                   |                      |
|                                                         |                | ATTACHING PARTS                        |                   |                      |
| 115                                                     | NAS514P1032-4P | .SCREW                                 | 056335            | 2                    |
|                                                         |                | -----*-----                            |                   |                      |
| 120                                                     | 65-5458-20N    | .HANDLE                                | 056335            | 1                    |
| 125                                                     | 65C22388-13    | .HANDLE                                | 056335            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |                                        |                   |                      |

- ITEM NOT ILLUSTRATED

R Y R

25-40-01-51H

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-01  
FIG. 51H  
PAGE 2  
OCT 15/24


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 NOMENCLATURE                                  | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|-------------------------------------------------------------|-------------------|----------------------|
| 51H<br>130                                              | 69-72416-5     | .HANDLE-ASSIST<br>SUPPLIER CODE:<br>V26835                  | 056335            | 1                    |
| 135                                                     | 66-4302-1      | .COLLAR<br>ATTACHING PARTS                                  | 056335            | 7                    |
| 140                                                     | NAS1801-3-10   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-10            | 056335            | 7                    |
| 145                                                     | NAS1149D0332K  | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0332J          | 056335            | 7                    |
| 150                                                     | 65-5458-21N    | .NUT<br>-----*-----                                         | 056335            | 7                    |
| 155                                                     | D75D70952-163  | .PAN-<br>SUPPLIER CODE:<br>VS5825                           | 056335            | 1                    |
| 160                                                     | D72D80015-111G | .KICKSTRIP-<br>SUPPLIER CODE:<br>VS5825<br>ATTACHING PARTS  | 056335            | 1                    |
| 165                                                     | NAS514P1032-6P | .SCREW                                                      | 056335            | 5                    |
| 170                                                     | NAS1169DD10    | .WASHER<br>-----*-----                                      | 056335            | 5                    |
| 175                                                     | D72D80020-111F | .KICKSTRIP-<br>SUPPLIER CODE:<br>VS5825<br>ATTACHING PARTS  | 056335            | 1                    |
| 180                                                     | NAS514P1032-6P | .SCREW                                                      | 056335            | 4                    |
| 185                                                     | NAS1169DD10    | .WASHER<br>-----*-----                                      | 056335            | 4                    |
| 190                                                     | D72D80021-111F | .KICKSTRIP-<br>SUPPLIER CODE:<br>VS5825<br>ATTACHING PARTS  | 056335            | 1                    |
| 195                                                     | NAS514P1032-6P | .SCREW                                                      | 056335            | 8                    |
| 200                                                     | NAS1169DD10    | .WASHER<br>-----*-----                                      | 056335            | 8                    |
| 205                                                     | D72D70947-111B | .PLATE-COVER<br>SUPPLIER CODE:<br>VS5825<br>ATTACHING PARTS | 056335            | 2                    |
| 207                                                     | NAS514P632-4   | .SCREW<br>-----*-----                                       | 056335            | 4                    |
| 208                                                     | D72D70947-111M | .PLATE-COVER<br>SUPPLIER CODE:<br>VS5825<br>ATTACHING PARTS | 056335            | 2                    |
| 210                                                     | NAS514P632-4   | .SCREW<br>-----*-----                                       | 056335            | 4                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |                                                             |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R

25-40-01-51H

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-01  
 FIG. 51H  
 PAGE 3  
 OCT 15/24




**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 NOMENCLATURE                                                         | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|------------------------------------------------------------------------------------|-------------------|----------------------|
| 51H<br>220                                              | D72D80025-912A | .RUBSTRIP-<br>SUPPLIER CODE:<br>VS5825<br>MISCELLANEOUS DATA:<br>BAC1522-547-70229 | 056335            | 1                    |
| 225                                                     | D72D80025-911A | .RUBSTRIP-<br>SUPPLIER CODE:<br>VS5825<br>MISCELLANEOUS DATA:<br>BAC1522-547-70229 | 056335            | 1                    |
| 230                                                     | D72D80025-913A | .RUBSTRIP-<br>SUPPLIER CODE:<br>VS5825<br>MISCELLANEOUS DATA:<br>BAC1522-547-70229 | 056335            | 1                    |
| 235                                                     | D72D80024-111B | .RETAINER-RUBSTRIP<br>SUPPLIER CODE:<br>VS5825<br>ATTACHING PARTS                  | 056335            | 1                    |
| 240                                                     | NAS1801-08-6   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN08-6                                   | 056335            | 3                    |
| 245                                                     | NAS1149DN816K  | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149DN816J                                 | 056335            | 3                    |
| 250                                                     | D72D80023-111B | -----*-----<br>.RETAINER-RUBSTRIP<br>SUPPLIER CODE:<br>VS5825<br>ATTACHING PARTS   | 056335            | 1                    |
| 255                                                     | NAS1801-08-6   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN08-6                                   | 056335            | 1                    |
| 260                                                     | NAS1149DN816K  | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149DN816J                                 | 056335            | 1                    |
| 265                                                     | D72D80022-111B | -----*-----<br>.RETAINER-RUBSTRIP<br>SUPPLIER CODE:<br>VS5825<br>ATTACHING PARTS   | 056335            | 1                    |
| 270                                                     | NAS1801-08-6   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN08-6                                   | 056335            | 2                    |
| 275                                                     | NAS1149DN816K  | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149DN816J                                 | 056335            | 2                    |
| 280                                                     | 432W7101-6J    | -----*-----<br>.ENDCAP-                                                            | 056335            | 6                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |                                                                                    |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R

25-40-01-51H

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-01  
FIG. 51H  
PAGE 4  
OCT 15/24


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                                                                                                      | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 51H                                                     |                |                                                                                                                                                                                                 |                   |                      |
| 280                                                     | 413N3165-33C   | .CAP-<br>ATTACHING PARTS                                                                                                                                                                        | 056335            | 6                    |
| 285                                                     | NAS1801-08-6   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN08-6                                                                                                                                                | 056335            | 6                    |
| 290                                                     | NAS1149DN816K  | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149DN816J                                                                                                                                              | 056335            | 6                    |
|                                                         |                | -----*-----                                                                                                                                                                                     |                   |                      |
| 295                                                     | D72D80018-911B | .RUBSTRIP-<br>SUPPLIER CODE:<br>VS5825<br>MISCELLANEOUS DATA:<br>BAC1522-547-7802                                                                                                               | 056335            | 1                    |
| 300                                                     | D72D80011-111B | .RETAINER-RUBSTRIP<br>SUPPLIER CODE:<br>VS5825<br>ATTACHING PARTS                                                                                                                               | 056335            | 1                    |
| 305                                                     | NAS1801-08-7   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN08-7                                                                                                                                                | 056335            | 5                    |
| 310                                                     | NAS1149DN816K  | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149DN816J                                                                                                                                              | 056335            | 5                    |
| 315                                                     | 130008         | .NUT<br>SUPPLIER CODE:<br>V60119<br>SPECIFICATION NUMBER:<br>BACN10FX84<br>OPTIONAL PART:<br>RM52LHA4972-6-8<br>V72962<br>SL211-08-1<br>V97393<br>A11330-6-82<br>V72962<br>A4972-6-82<br>V72962 | 056335            | 5                    |
|                                                         |                | -----*-----                                                                                                                                                                                     |                   |                      |
| 320                                                     | D72D80018-913B | .RUBSTRIP-<br>SUPPLIER CODE:<br>VS5825<br>MISCELLANEOUS DATA:<br>BAC1522-547-7802                                                                                                               | 056335            | 1                    |
| 325                                                     | D72D80010-111B | .RETAINER-RUBSTRIP<br>SUPPLIER CODE:<br>VS5825                                                                                                                                                  | 056335            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |                                                                                                                                                                                                 |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R

25-40-01-51H

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-01  
 FIG. 51H  
 PAGE 5  
 OCT 15/24


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                                                                                                                     | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 51H                                                     |                |                                                                                                                                                                                                                |                   |                      |
| 330                                                     | NAS1801-08-7   | ATTACHING PARTS<br>.SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN08-7                                                                                                                                            | 056335            | 12                   |
| 335                                                     | NAS1149DN816K  | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149DN816J                                                                                                                                                             | 056335            | 12                   |
| 340                                                     | 130008         | .NUT<br>SUPPLIER CODE:<br>V60119<br>SPECIFICATION NUMBER:<br>BACN10FX84<br>OPTIONAL PART:<br>RM52LHA4972-6-8<br>V72962<br>SL211-08-1<br>V97393<br>A11330-6-82<br>V72962<br>A4972-6-82<br>V72962<br>-----*----- | 056335            | 12                   |
| 345                                                     | D72D70548-111  | .TRIM-WALL EDGE<br>SUPPLIER CODE:<br>VS5825                                                                                                                                                                    | 056335            | 1                    |
| 350                                                     | D72D71109-111B | .TRIM-RTNR FLOOR PAN<br>SUPPLIER CODE:<br>VS5825                                                                                                                                                               | 056335            | 1                    |
| 355                                                     | D72D71110-111B | .TRIM-RTNR FLOOR PAN<br>SUPPLIER CODE:<br>VS5825                                                                                                                                                               | 056335            | 1                    |
| 360                                                     | D72D71111-111B | .TRIM-RTNR FLOOR PAN<br>SUPPLIER CODE:<br>VS5825                                                                                                                                                               | 056335            | 1                    |
| 365                                                     | D72D71112-911B | .TRIM-INSERT FLOOR PAN<br>SUPPLIER CODE:<br>VS5825                                                                                                                                                             | 056335            | 1                    |
| 370                                                     | D72D71112-912B | .TRIM-INSERT FLOOR PAN<br>SUPPLIER CODE:<br>VS5825                                                                                                                                                             | 056335            | 1                    |
| 375                                                     | D72D71112-913B | .TRIM-INSERT FLOOR PAN<br>SUPPLIER CODE:<br>VS5825                                                                                                                                                             | 056335            | 1                    |
| 380                                                     | D72D70301-911  | .SEAL-RTNR<br>SUPPLIER CODE:<br>VS5825                                                                                                                                                                         | 056335            | 1                    |
| 385                                                     | D72D70301-913  | .SEAL-RTNR<br>SUPPLIER CODE:<br>VS5825                                                                                                                                                                         | 056335            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |                                                                                                                                                                                                                |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R

25-40-01-51H

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-01  
 FIG. 51H  
 PAGE 6  
 OCT 15/24


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER   | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                                                                                                                                                             | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|---------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 51H<br>390                                              | D72D70301-915 | .SEAL-RTNR<br>SUPPLIER CODE:<br>VS5825                                                                                                                                                                                                                 | 056335            | 1                    |
| 395                                                     | D72D70795-111 | .BLANKET-FIRE<br>SUPPLIER CODE:<br>VS5825<br>ATTACHING PARTS                                                                                                                                                                                           | 056335            | 1                    |
| 400                                                     | NAS1801-3-5   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-5                                                                                                                                                                                                        | 056335            | 14                   |
| 405                                                     | NAS1149D0332K | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0332J<br>-----*-----                                                                                                                                                                                      | 056335            | 14                   |
| 410                                                     | D72W16005-111 | .DISPENSER ASSY-UPR<br>SUPPLIER CODE:<br>VS5825<br>MISCELLANEOUS DATA:<br>NON PROCURABLE<br>FOR DETAILS SEE:<br>25-41-51-56B                                                                                                                           | 056335            | RF                   |
| 415                                                     | D72W17005-111 | .DISPENSER ASSY-LWR<br>SUPPLIER CODE:<br>VS5825<br>MISCELLANEOUS DATA:<br>NON PROCURABLE<br>FUNCTIONAL REFERENCE:<br>EQUIPMENT/FURNISHINGS<br>FOR DETAILS SEE<br>25-41-51-60B<br>FIRE PROTECTION<br>FOR DETAILS SEE<br>26-24-01-03C                    | 056335            | RF                   |
| 420                                                     | D72W26010-111 | .PLUMBING ASSY-<br>SUPPLIER CODE:<br>VS5825<br>MISCELLANEOUS DATA:<br>NON PROCURABLE<br>FUNCTIONAL REFERENCE:<br>AIR CONDITIONING<br>FOR DETAILS SEE<br>21-24-51-56B<br>WATER/WASTE<br>FOR DETAILS SEE<br>38-11-05-56B<br>38-11-51-56B<br>38-13-01-56B | 056335            | RF                   |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |               |                                                                                                                                                                                                                                                        |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R

# 25-40-01-51H

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-01  
 FIG. 51H  
 PAGE 7  
 OCT 15/24


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                                                                                                                                                                                                                                                                                                            | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 51H<br>425                                              | D72W27034-111  | .ELECTRICAL ASSY-<br>SUPPLIER CODE:<br>VS5825<br>MISCELLANEOUS DATA:<br>NON PROCURABLE<br>FUNCTIONAL REFERENCE:<br>COMMUNICATIONS<br>FOR DETAILS SEE<br>23-31-05-56B<br>EQUIPMENT/FURNISHINGS<br>FOR DETAILS SEE<br>25-41-60-56B<br>FIRE PROTECTION<br>FOR DETAILS SEE<br>26-14-01-56B<br>LIGHTS<br>FOR DETAILS SEE<br>33-26-03-56B<br>33-27-51-56B<br>WATER/WASTE<br>FOR DETAILS SEE<br>38-32-04-56B | 056335            | RF                   |
| 430                                                     | D72D80006-111B | .MAT-FL00R<br>SUPPLIER CODE:<br>VS5825                                                                                                                                                                                                                                                                                                                                                                | 056335            | 1                    |
| 435                                                     | D72W12012-111  | .OUTWALL ASSY-<br>SUPPLIER CODE:<br>VS5825<br>MISCELLANEOUS DATA:<br>NON PROCURABLE<br>FOR DETAILS SEE:<br>25-41-40-56B                                                                                                                                                                                                                                                                               | 056335            | RF                   |
| 440                                                     | D72W59050-111A | .SUB ASSY-SINK DECK<br>SUPPLIER CODE:<br>VS5825                                                                                                                                                                                                                                                                                                                                                       | 056335            | 1                    |
| 450                                                     | D72D41009-111  | .PANEL-FL00R<br>SUPPLIER CODE:<br>VS5825                                                                                                                                                                                                                                                                                                                                                              | 056335            | 1                    |
| 455                                                     | D72D46005-111  | .PANEL-<br>SUPPLIER CODE:<br>VS5825<br>POSITION DATA:<br>OUTBD UPR                                                                                                                                                                                                                                                                                                                                    | 056335            | 1                    |
| 460                                                     | D72D46004-111  | .PANEL-<br>SUPPLIER CODE:<br>VS5825<br>POSITION DATA:<br>OUTBD LWR                                                                                                                                                                                                                                                                                                                                    | 056335            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |                                                                                                                                                                                                                                                                                                                                                                                                       |                   |                      |

— ITEM NOT ILLUSTRATED

RYR

25-40-01-51H

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-01  
 FIG. 51H  
 PAGE 8  
 OCT 15/24


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 NOMENCLATURE                                                                             | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|--------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 51H<br>465                                              | D72W52017-111D | .PANEL-SIDEWALL<br>SUPPLIER CODE:<br>VS5825                                                            | 056335            | 1                    |
| 467                                                     | D72D71213-111  | ..FRAME ASSY-TUBE<br>SUPPLIER CODE:<br>VS5825<br>MISCELLANEOUS DATA:<br>NO DECORATIVE LAMINATE<br>PART | 056335            | 1                    |
| 470                                                     | D72W53015-111D | .PANEL-SINK WALL<br>SUPPLIER CODE:<br>VS5825                                                           | 056335            | 1                    |
| 475                                                     | D72W54014-111A | .PANEL-DOOR WALL<br>SUPPLIER CODE:<br>VS5825                                                           | 056335            | 1                    |
| 480                                                     | D72W55000-111A | .PANEL-CLG<br>SUPPLIER CODE:<br>VS5825                                                                 | 056335            | 1                    |
| 485                                                     | D72W56000-111B | .PANEL-LINING<br>SUPPLIER CODE:<br>VS5825                                                              | 056335            | 1                    |
| 487                                                     | 4A114-0016-1   | ..BUMPER-<br>SUPPLIER CODE:<br>VS5825                                                                  | 056335            | 2                    |
| 490                                                     | D72W57009-111B | .PANEL-HEADER BIFOLD<br>SUPPLIER CODE:<br>VS5825                                                       | 056335            | 1                    |
| 495                                                     | D72W59041-111A | .PANEL-DISP CABINET<br>SUPPLIER CODE:<br>VS5825                                                        | 056335            | 1                    |
| 500                                                     | D72D70699-111B | .PAN ASSY-FLOOR<br>SUPPLIER CODE:<br>VS5825<br>ATTACHING PARTS                                         | 056335            | 1                    |
| 505                                                     | NAS514P1032-6P | .SCREW<br>-----*-----                                                                                  | 056335            | 4                    |
| 510                                                     | D72D70438-111B | .COVER-FLLOOR PAN<br>SUPPLIER CODE:<br>VS5825<br>ATTACHING PARTS                                       | 056335            | 1                    |
| 515                                                     | NAS1801-08-7   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN08-7                                                       | 056335            | 2                    |
| 520                                                     | NAS1149DN816K  | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149DN816J<br>-----*-----                                      | 056335            | 2                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |                                                                                                        |                   |                      |

— ITEM NOT ILLUSTRATED


R Y R

25-40-01-51H

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-01  
 FIG. 51H  
 PAGE 9  
 OCT 15/24

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

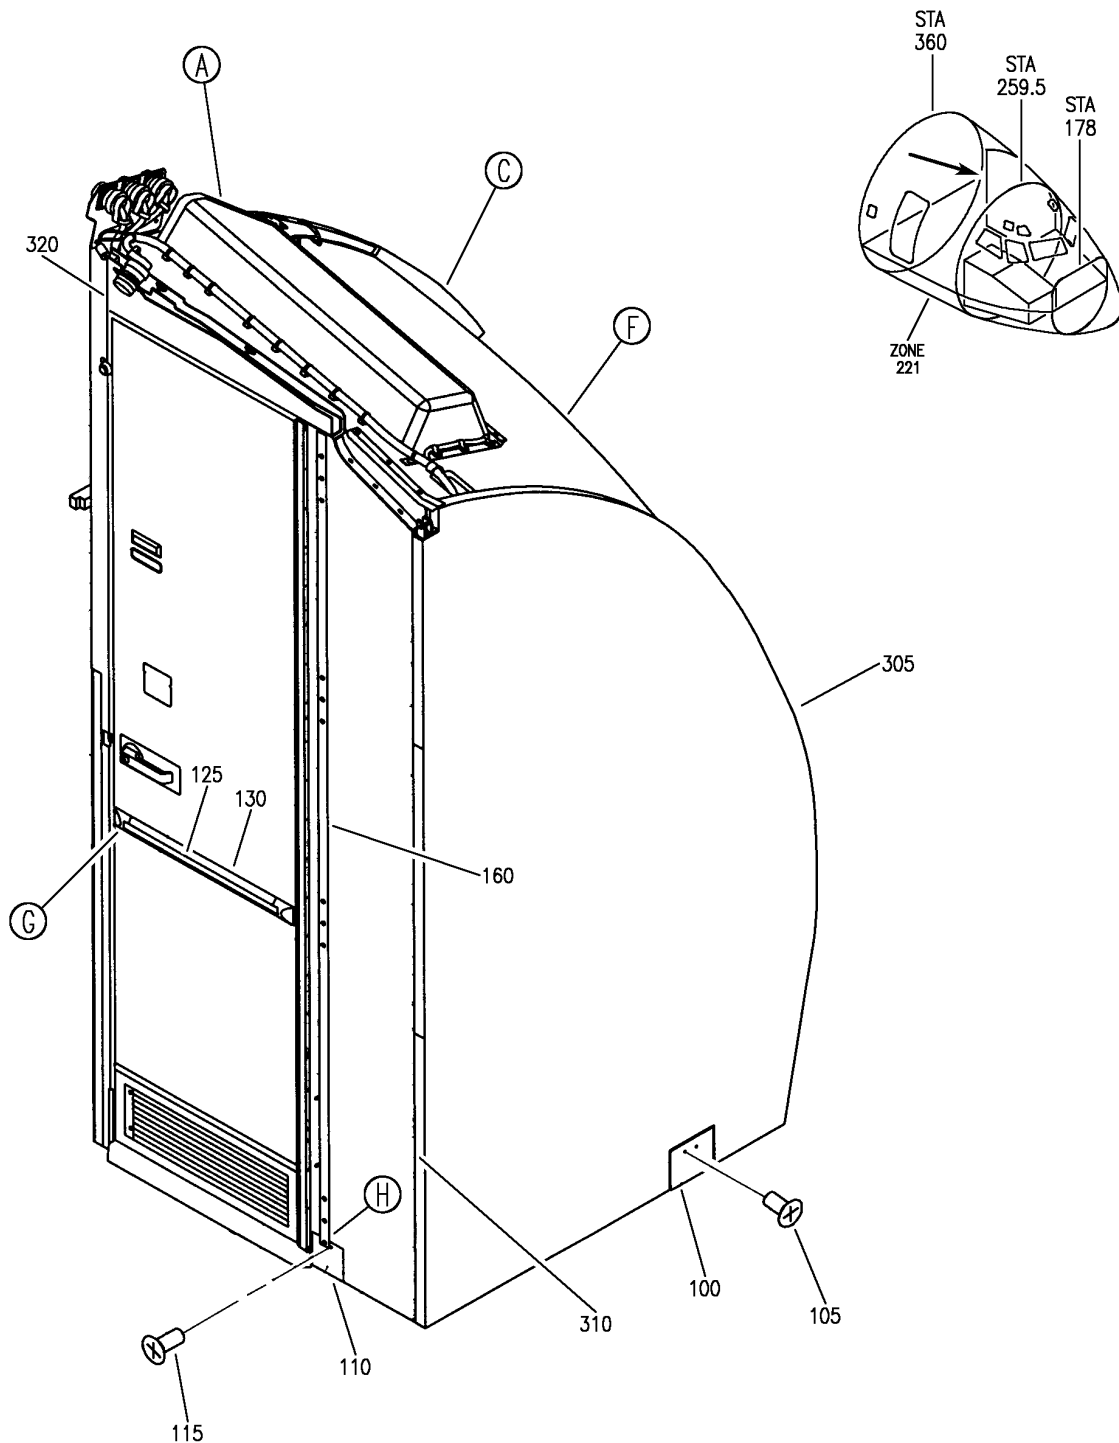

E 25400156D SHT 1 REV 115

MODULE ASSY-LAV A (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 56D (SHEET 1)


**25-40-01-56D**

RJR  
OCT 10/06

25-40-01-56D  
PAGE 0

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

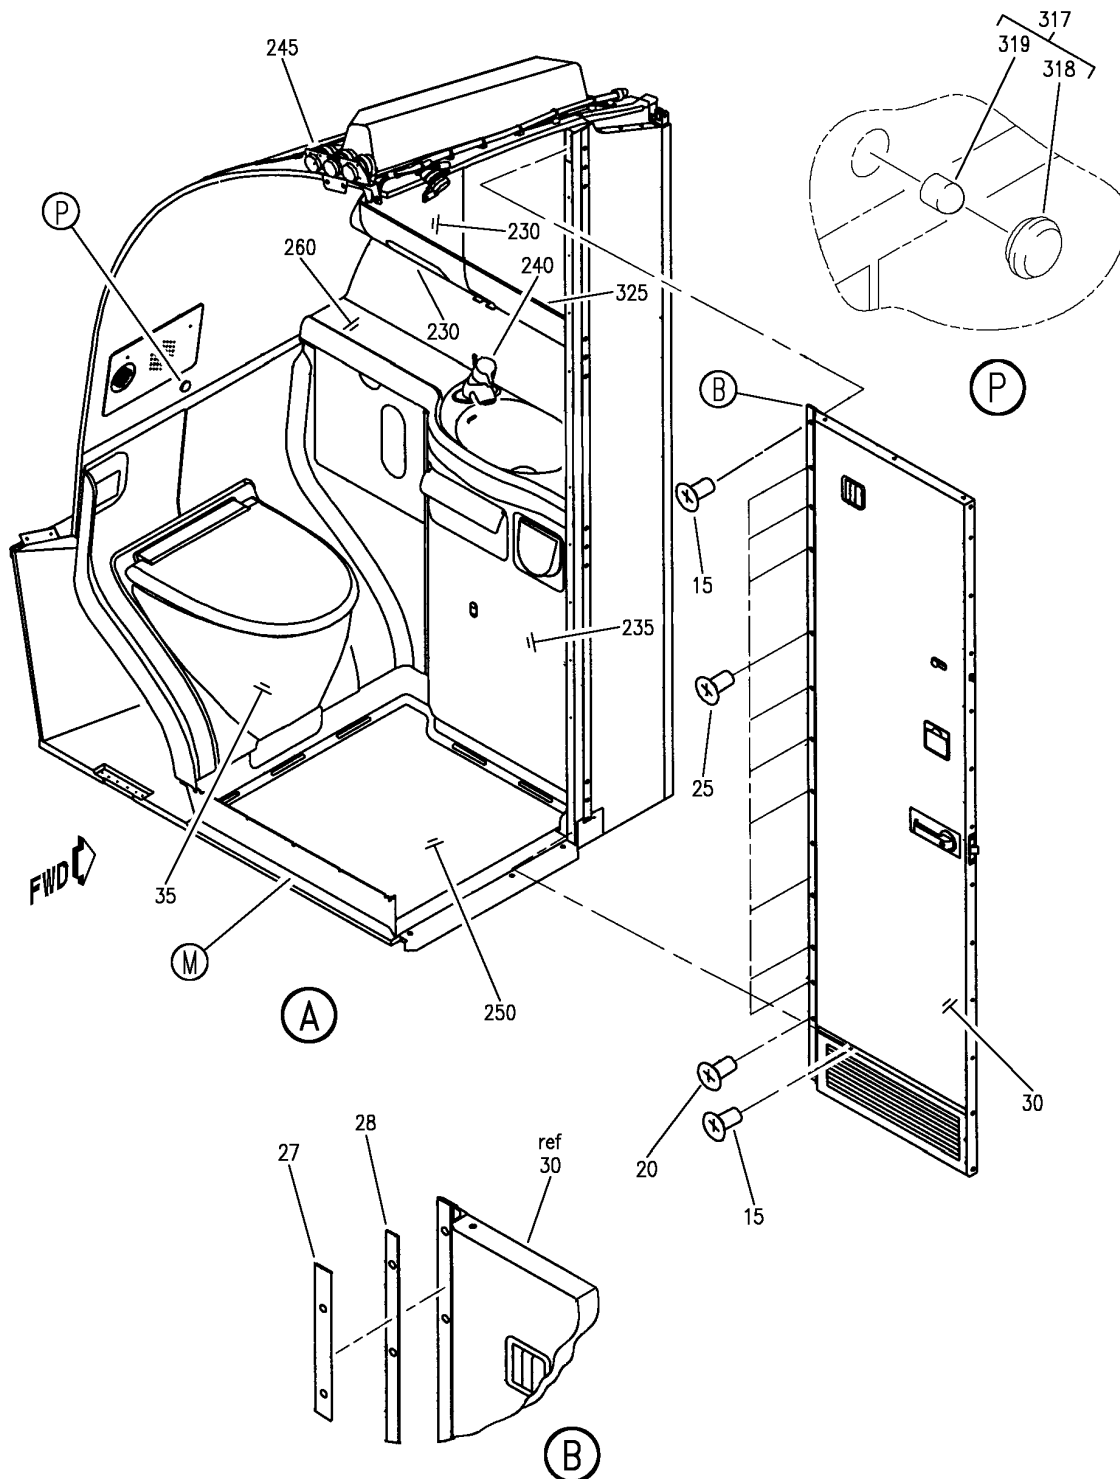

E 25400156D SHT 2 REV 142

MODULE ASSY-LAV A (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 56D (SHEET 2)

**25-40-01-56D**


R Y R  
JUN 15/08

25-40-01-56D  
PAGE 0A

ECCN 9E991 BOEING PROPRIETARY – See title page for details.



**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

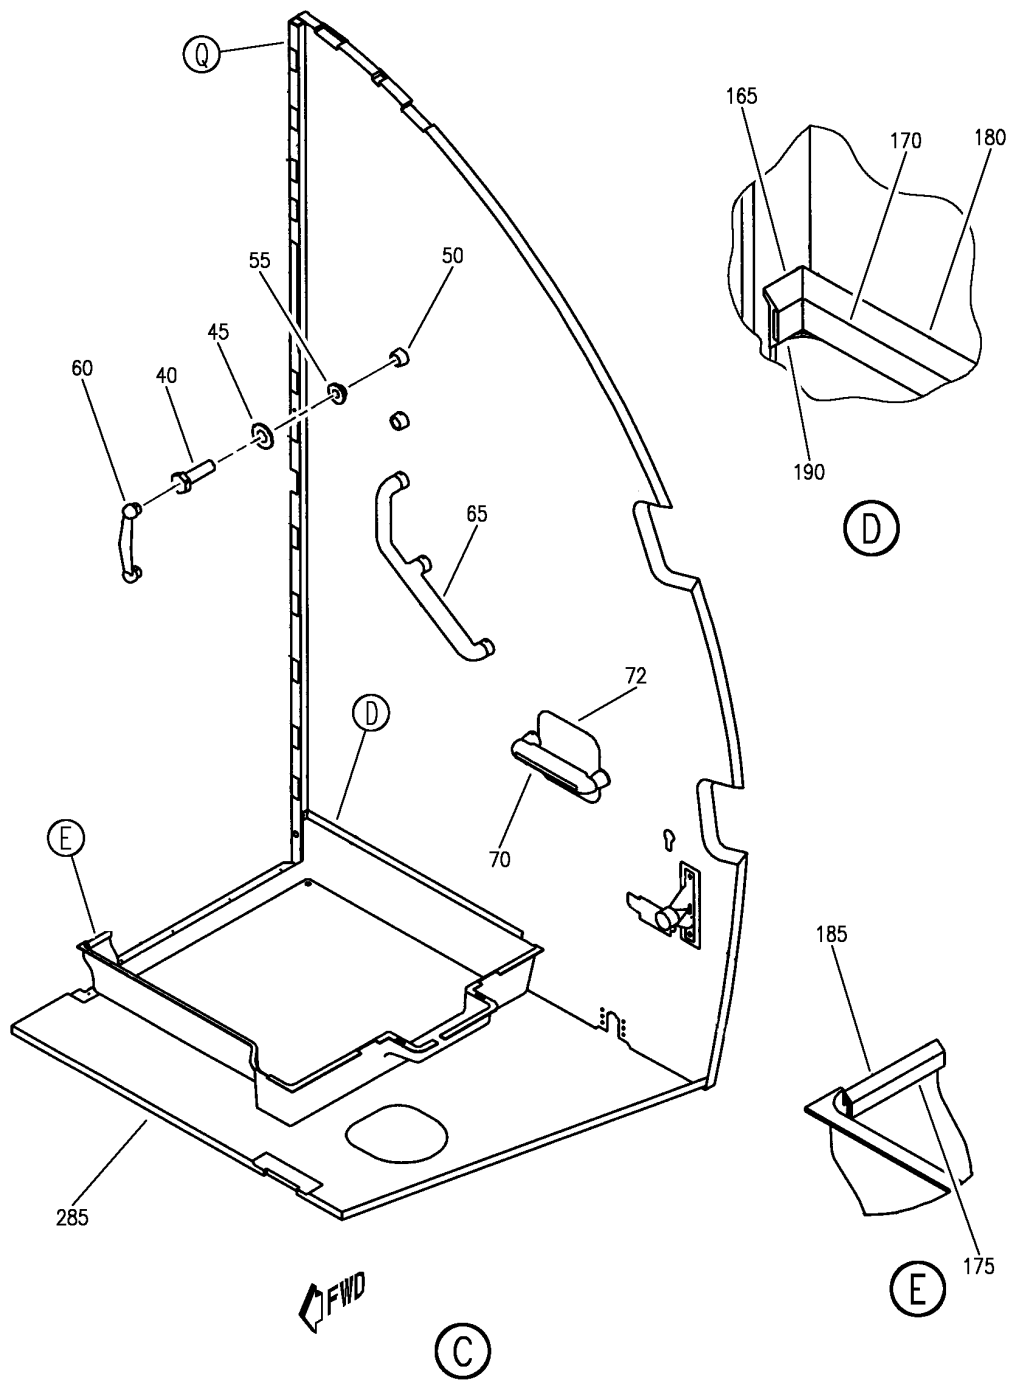

E 25400156D SHT 3 REV 215

MODULE ASSY-LAV A (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 56D (SHEET 3)


**25-40-01-56D**

RJR  
JUN 15/14

25-40-01-56D  
PAGE 08

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

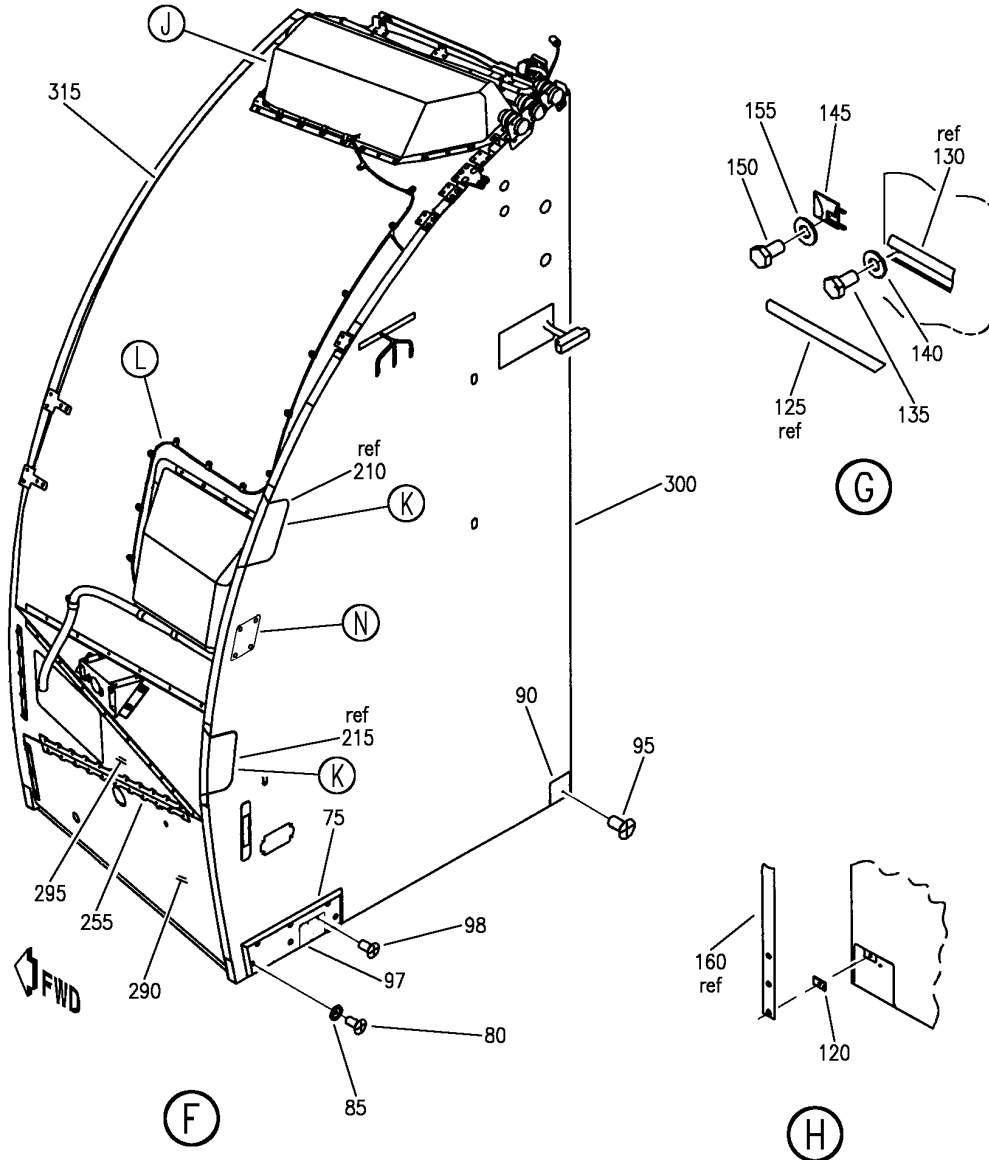

E 25400156D SHT 4 REV 122


MODULE ASSY-LAV A (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 56D (SHEET 4)

**25-40-01-56D**

R/YR  
OCT 10/06

25-40-01-56D  
PAGE 0C

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

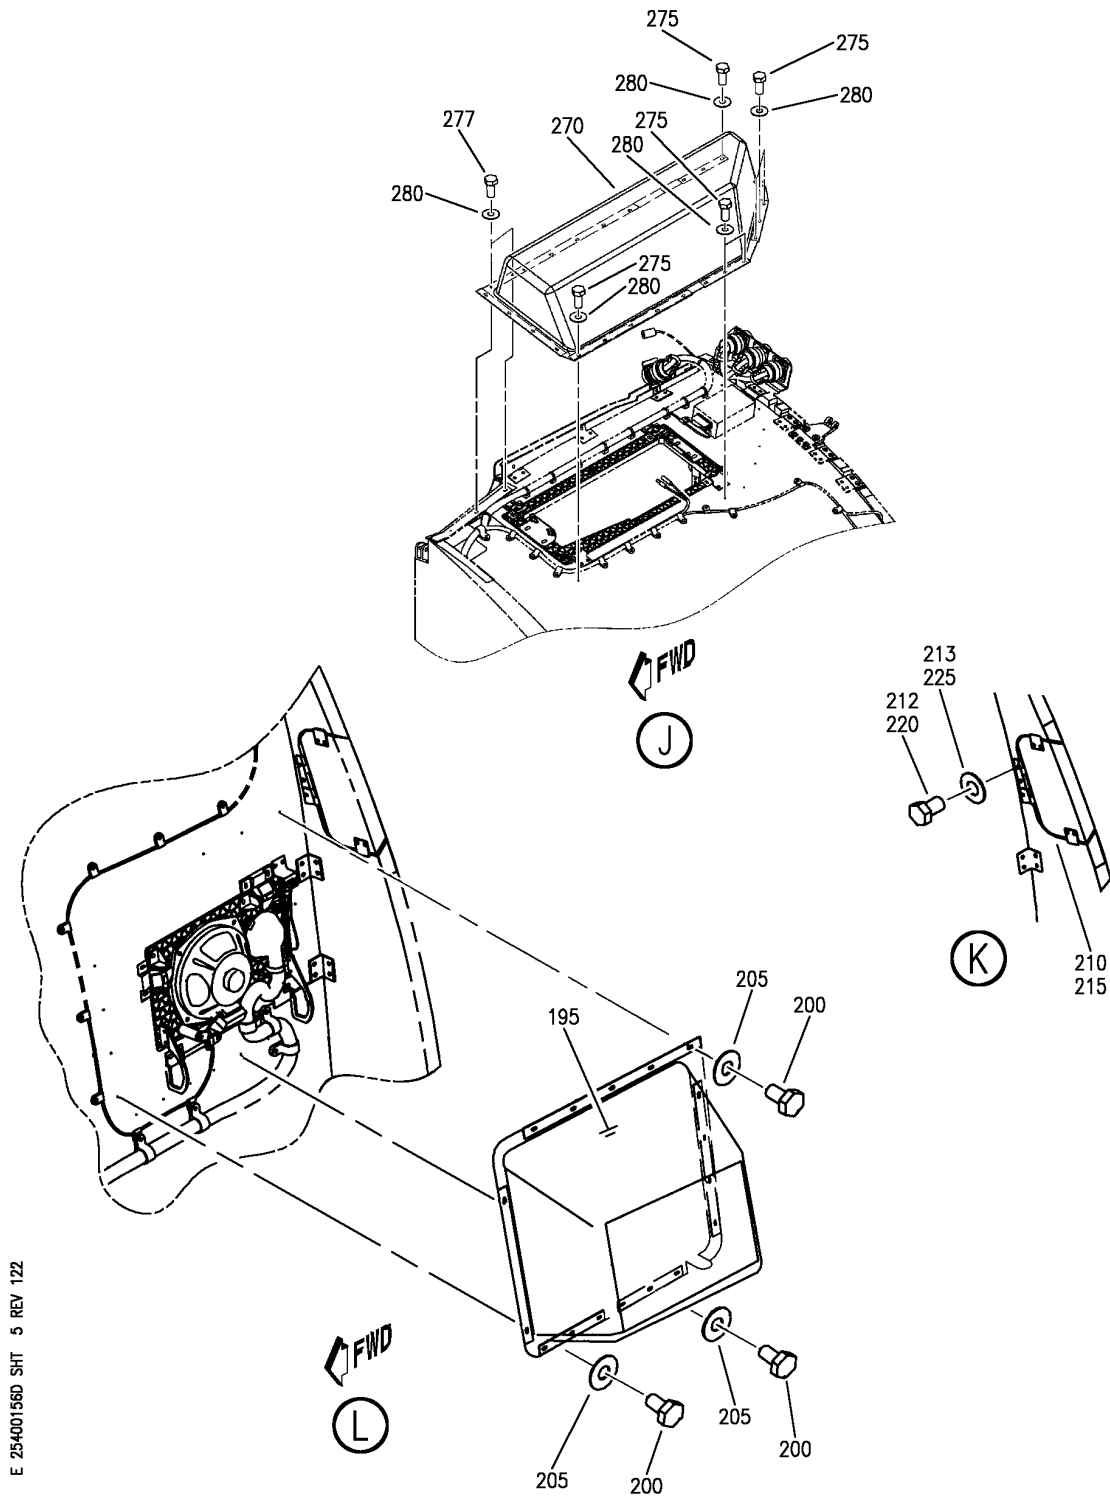

E 25400156D SHT 5 REV 122

MODULE ASSY-LAV A (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 56D (SHEET 5)


**25-40-01-56D**

R/YR  
OCT 10/06

25-40-01-56D  
PAGE 0D

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

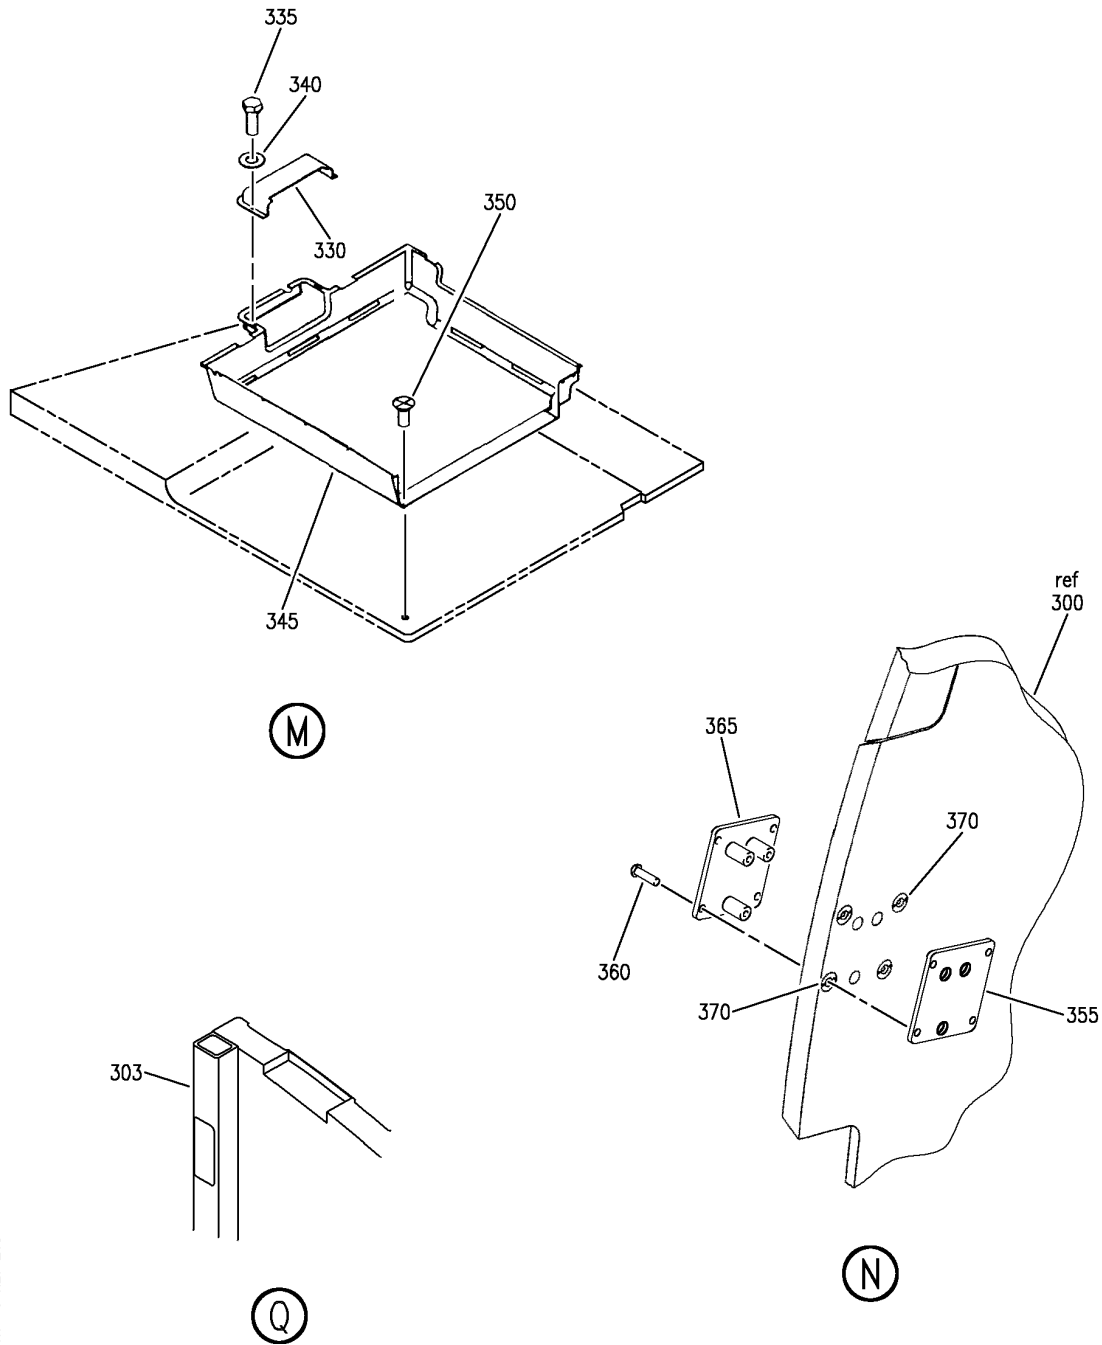

E 25400156D SHT 6 REV 215

MODULE ASSY-LAV A (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 56D (SHEET 6)

**25-40-01-56D**

RJR  
JUN 15/14

25-40-01-56D  
PAGE 0E

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

 **BOEING**  
737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                                                                                                                                                                                 | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 56D                                                     |                | MODULE ASSY-LAV A<br>(EQUIPMENT/FURNISHINGS<br>ONLY)                                                                                                                                                                                                                       | 058335            |                      |
| - 1                                                     | D72000053-111A | MODULE ASSY-LAV A<br>(EQUIPMENT/FURNISHINGS<br>ONLY)<br>SUPPLIER CODE:<br>VJ4577<br>SPECIFICATION NUMBER:<br>S417A180-0053A<br>ELECTRICAL EQUIP NUMBER:<br>M01415<br>COMPONENT MAINT MANUAL REF:<br>25-42-38<br>FOR NHA/OTHER SYS DET SEE:<br>25-40-00-26A<br>25-40-01-01T | 058335            | RF                   |
| 15                                                      | NAS514P1032-12 | .SCREW                                                                                                                                                                                                                                                                     | 058335            | 2                    |
| 20                                                      | NAS514P1032-8  | .SCREW                                                                                                                                                                                                                                                                     | 058335            | 1                    |
| 25                                                      | NAS514P1032-7  | .SCREW                                                                                                                                                                                                                                                                     | 058335            | 10                   |
| 27                                                      | D72D70987-111  | .RETAINER-SEAL RUBBER<br>SUPPLIER CODE:<br>VS5825                                                                                                                                                                                                                          | 058335            | 1                    |
| 28                                                      | D72D70988-111  | .SEAL-RUBBER<br>SUPPLIER CODE:<br>VS5825                                                                                                                                                                                                                                   | 058335            | 1                    |
| 30                                                      | D72W13010-111A | .DOOR ASSY-SLAB<br>SUPPLIER CODE:<br>VS5825<br>FOR DETAILS SEE:<br>25-41-13-56                                                                                                                                                                                             | 058335            | 1                    |
| 35                                                      | D72W15002-111  | .TOILET AND FLOOR PAN ASSY-<br>SUPPLIER CODE:<br>VS5825<br>MISCELLANEOUS DATA:<br>NON PROCURABLE<br>FOR DETAILS SEE:<br>25-41-21-56                                                                                                                                        | 058335            | RF                   |
| 40                                                      | NAS1801-3-10   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-10                                                                                                                                                                                                                           | 058335            | 7                    |
| 45                                                      | NAS1149D0332K  | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0332J                                                                                                                                                                                                                         | 058335            | 7                    |
| 50                                                      | 65-5458-21N    | .NUT                                                                                                                                                                                                                                                                       | 058335            | 7                    |
| 55                                                      | 66-4302-1      | .COLLAR                                                                                                                                                                                                                                                                    | 058335            | 7                    |
| 60                                                      | 65-5458-20N    | .HANDLE-ASSIST                                                                                                                                                                                                                                                             | 058335            | 1                    |
| 65                                                      | 65C22388-13    | .HANDLE-ASSIST                                                                                                                                                                                                                                                             | 058335            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |                                                                                                                                                                                                                                                                            |                   |                      |

- ITEM NOT ILLUSTRATED

R Y R

25-40-01-56D

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-01  
FIG. 56D  
PAGE 1  
OCT 15/24


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 NOMENCLATURE                                  | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|-------------------------------------------------------------|-------------------|----------------------|
| 56D                                                     |                |                                                             |                   |                      |
| 70                                                      | 69-72416-5     | .HANDLE-ASSIST<br>SUPPLIER CODE:<br>V26835                  | 058335            | 1                    |
| 72                                                      | D72D70952-163  | .PAN-<br>SUPPLIER CODE:<br>VS5825                           | 058335            | 1                    |
| 75                                                      | D72D80019-111G | .KICKSTRIP-<br>SUPPLIER CODE:<br>VS5825<br>ATTACHING PARTS  | 058335            | 1                    |
| 80                                                      | NAS514P1032-6P | .SCREW                                                      | 058335            | 6                    |
| 85                                                      | NAS1169DD10    | .WASHER<br>-----*-----                                      | 058335            | 6                    |
| 90                                                      | D72D70833-111A | .PLATE-COVER<br>SUPPLIER CODE:<br>VS5825<br>ATTACHING PARTS | 058335            | 1                    |
| 95                                                      | NAS514P632-4   | .SCREW<br>-----*-----                                       | 058335            | 2                    |
| 97                                                      | D72D70943-111A | .PLATE-COVER<br>SUPPLIER CODE:<br>VS5825<br>ATTACHING PARTS | 058335            | 1                    |
| 98                                                      | NAS514P632-4   | .SCREW<br>-----*-----                                       | 058335            | 2                    |
| 100                                                     | D72D70943-111B | .PLATE-COVER<br>SUPPLIER CODE:<br>VS5825<br>ATTACHING PARTS | 058335            | 1                    |
| 105                                                     | NAS514P632-4   | .SCREW<br>-----*-----                                       | 058335            | 2                    |
| 110                                                     | D72D70944-111A | .PLATE-COVER<br>SUPPLIER CODE:<br>VS5825<br>ATTACHING PARTS | 058335            | 1                    |
| 115                                                     | NAS514P632-4   | .SCREW<br>-----*-----                                       | 058335            | 1                    |
| 120                                                     | D72D71550-111  | .SPACER-<br>SUPPLIER CODE:<br>VS5825                        | 058335            | 1                    |
| 125                                                     | D72D80025-911A | .RUBSTRIP-<br>SUPPLIER CODE:<br>VS5825                      | 058335            | 1                    |
| 130                                                     | D72D80024-111B | .RETAINER-RUBSTRIP<br>SUPPLIER CODE:<br>VS5825              | 058335            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |                                                             |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R

25-40-01-56D

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-01  
 FIG. 56D  
 PAGE 2  
 OCT 15/17


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 | NOMENCLATURE                                                       | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|---------------|--------------------------------------------------------------------|-------------------|----------------------|
| 56D                                                     |                |               | ATTACHING PARTS                                                    |                   |                      |
| 135                                                     | NAS1801-08-5   | .             | SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN08-5                    | 058335            | 3                    |
| 140                                                     | NAS1149DN816K  | .             | WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149DN816J<br>-----*-----   | 058335            | 3                    |
| 145                                                     | 432W7101-6J    | .             | ENDCAP-END                                                         | 058335            | 2                    |
| 145                                                     | 413N3165-33C   | .             | CAP-END<br>ATTACHING PARTS                                         | 058335            | 2                    |
| 150                                                     | NAS1801-08-5   | .             | SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN08-5                    | 058335            | 2                    |
| 155                                                     | NAS1149DN816K  | .             | WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149DN816J<br>-----*-----   | 058335            | 2                    |
| 160                                                     | D72D70668-111  | .             | DOUBLER-FLIGHT DECK DOOR<br>SUPPLIER CODE:<br>VS5825               | 058335            | 1                    |
| 165                                                     | D72D71110-111B | .             | TRIM-RETAINER, FLOOR PAN<br>SUPPLIER CODE:<br>VS5825               | 058335            | 1                    |
| 170                                                     | D72D71112-916B | .             | TRIM-INSERT, FLOOR PAN<br>SUPPLIER CODE:<br>VS5825                 | 058335            | 1                    |
| 175                                                     | D72D71112-917B | .             | TRIM-INSERT, FLOOR PAN<br>SUPPLIER CODE:<br>VS5825                 | 058335            | 1                    |
| 180                                                     | D72D71169-111B | .             | TRIM-RETAINER, FLOOR PAN<br>SUPPLIER CODE:<br>VS5825               | 058335            | 1                    |
| 185                                                     | D72D71171-111B | .             | TRIM-RETAINER, FLOOR PAN<br>SUPPLIER CODE:<br>VS5825               | 058335            | 1                    |
| 190                                                     | D72D71112-912B | .             | TRIM-INSERT, FLOOR PAN<br>SUPPLIER CODE:<br>VS5825                 | 058335            | 1                    |
| 195                                                     | D72D71955-111  | .             | BLANKET-FIRE<br>SUPPLIER CODE:<br>VS5825                           | 058335            | 1                    |
| 200                                                     | NAS1801-06-4   | .             | ATTACHING PARTS<br>SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN06-4 | 058335            | 23                   |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |               |                                                                    |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R

25-40-01-56D

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-01  
 FIG. 56D  
 PAGE 3  
 APR 15/23


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 | NOMENCLATURE                                                                                                                 | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|---------------|------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 56D<br>205                                              | NAS1149DN616K  | .             | WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149DN616J<br>-----*-----                                                             | 058335            | 23                   |
| 210                                                     | D72W30009-111A | .             | DOOR-FLAP<br>SUPPLIER CODE:<br>VS5825<br>CONFIG CHG DATA FROM A CMM:<br>SUPSD BY D72W30049-111A                              | 058335            | 1                    |
| 210                                                     | D72W30049-111A | .             | DOOR ASSY-FLAP<br>SUPPLIER CODE:<br>VS5825<br>CONFIG CHG DATA FROM A CMM:<br>SUPERSEDES<br>D72W30009-111A<br>ATTACHING PARTS | 058335            | 1                    |
| 212                                                     | NAS1801-08-5   | .             | SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN08-5                                                                              | 058335            | 3                    |
| 213                                                     | NAS1149DN816K  | .             | WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149DN816J<br>-----*-----                                                             | 058335            | 3                    |
| 215                                                     | D72W30010-111A | .             | DOOR-FLAP<br>SUPPLIER CODE:<br>VS5825<br>CONFIG CHG DATA FROM A CMM:<br>SUPSD BY D72W30050-111A                              | 058335            | 1                    |
| 215                                                     | D72W30050-111A | .             | DOOR ASSY-FLAP<br>SUPPLIER CODE:<br>VS5825<br>CONFIG CHG DATA FROM A CMM:<br>SUPERSEDES<br>D72W30010-111A<br>ATTACHING PARTS | 058335            | 1                    |
| 220                                                     | NAS1801-08-5   | .             | SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN08-5                                                                              | 058335            | 3                    |
| 225                                                     | NAS1149DN816K  | .             | WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149DN816J<br>-----*-----                                                             | 058335            | 3                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |               |                                                                                                                              |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R

25-40-01-56D

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-01  
 FIG. 56D  
 PAGE 4  
 OCT 15/24




**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER   | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                                                                                                                                                                          | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|---------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 56D<br>230                                              | D72W16019-111 | .DISPENSER ASSY-<br>SUPPLIER CODE:<br>VS5825<br>POSITION DATA:<br>UPR<br>MISCELLANEOUS DATA:<br>NON PROCURABLE<br>FOR DETAILS SEE:<br>25-41-51-56E                                                                                                                  | 058335            | RF                   |
| 235                                                     | D72W17006-111 | .DISPENSER ASSY-<br>SUPPLIER CODE:<br>VS5825<br>POSITION DATA:<br>LWR<br>MISCELLANEOUS DATA:<br>NON PROCURABLE<br>FUNCTIONAL REFERENCE:<br>EQUIPMENT/FURNISHINGS<br>FOR DETAILS SEE<br>25-41-51-60<br>FIRE PROTECTION<br>FOR DETAILS SEE<br>26-24-51-56             | 058335            | RF                   |
| 240                                                     | D72W26012-111 | .PLUMBING ASSY-<br>SUPPLIER CODE:<br>VS5825<br>MISCELLANEOUS DATA:<br>NON PROCURABLE<br>FUNCTIONAL REFERENCE:<br>AIR CONDITIONING<br>FOR DETAILS SEE<br>21-24-51-56D<br>WATER/WASTE<br>FOR DETAILS SEE<br>38-11-05-56<br>38-11-06-73P<br>38-11-51-56<br>38-13-01-56 | 058335            | RF                   |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |               |                                                                                                                                                                                                                                                                     |                   |                      |

— ITEM NOT ILLUSTRATED

RYR

25-40-01-56D

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-01  
 FIG. 56D  
 PAGE 5  
 OCT 15/24


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                                                                                                                                                                                                                                                                                                      | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 56D<br>245                                              | D72W27043-111  | .ELECTRICAL ASSY-<br>SUPPLIER CODE:<br>VS5825<br>MISCELLANEOUS DATA:<br>NON PROCURABLE<br>FUNCTIONAL REFERENCE:<br>COMMUNICATIONS<br>FOR DETAILS SEE<br>23-31-05-56<br>EQUIPMENT/FURNISHINGS<br>FOR DETAILS SEE<br>25-41-60-56<br>FIRE PROTECTION<br>FOR DETAILS SEE<br>26-14-01-56<br>LIGHTS<br>FOR DETAILS SEE<br>33-26-03-56<br>33-27-51-56<br>WATER/WASTE<br>FOR DETAILS SEE<br>38-32-04-56 | 058335            | RF                   |
| 250                                                     | D72D80007-111B | .MAT-FLOOR<br>SUPPLIER CODE:<br>VS5825                                                                                                                                                                                                                                                                                                                                                          | 058335            | 1                    |
| 255                                                     | D72W12030-111  | .OUTWALL ASSY-LAV A<br>SUPPLIER CODE:<br>VS5825<br>MISCELLANEOUS DATA:<br>NON PROCURABLE<br>FOR DETAILS SEE:<br>25-41-40-56                                                                                                                                                                                                                                                                     | 058335            | RF                   |
| 260                                                     | D72W59045-111A | .DECK-SINK<br>SUPPLIER CODE:<br>VS5825                                                                                                                                                                                                                                                                                                                                                          | 058335            | 1                    |
| 270                                                     | D72D71958-111  | .BLANKET-FIRE<br>SUPPLIER CODE:<br>VS5825<br>ATTACHING PARTS                                                                                                                                                                                                                                                                                                                                    | 058335            | 1                    |
| 275                                                     | NAS1801-06-4   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN06-4                                                                                                                                                                                                                                                                                                                                                | 058335            | 8                    |
| 277                                                     | NAS1801-06-5   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN06-5                                                                                                                                                                                                                                                                                                                                                | 058335            | 2                    |
| 280                                                     | NAS1149DN616K  | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149DN616J<br>-----*-----                                                                                                                                                                                                                                                                                                                               | 058335            | 10                   |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |                                                                                                                                                                                                                                                                                                                                                                                                 |                   |                      |

— ITEM NOT ILLUSTRATED

RYR

25-40-01-56D

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-01  
FIG. 56D  
PAGE 6  
OCT 15/24


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                                                               | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|----------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 56D                                                     |                |                                                                                                                                                          |                   |                      |
| 285                                                     | D72D41002-111  | .PANEL-FL00R<br>SUPPLIER CODE:<br>VS5825                                                                                                                 | 058335            | 1                    |
| 290                                                     | D72D46006-111  | .PANEL-<br>SUPPLIER CODE:<br>VS5825<br>POSITION DATA:<br>OUTBD LWR                                                                                       | 058335            | 1                    |
| 295                                                     | D72D46007-111  | .PANEL-<br>SUPPLIER CODE:<br>VS5825<br>POSITION DATA:<br>OUTBD UPR                                                                                       | 058335            | 1                    |
| 300                                                     | D72W52070-111A | .PANEL-SIDEWALL<br>SUPPLIER CODE:<br>VS5825                                                                                                              | 058335            | 1                    |
| 303                                                     | D72D70451-111  | ..FRAME ASSY-<br>SUPPLIER CODE:<br>VS5825<br>MISCELLANEOUS DATA:<br>(NO DECORATIVE LAMINATE<br>PART)                                                     | 058335            | 1                    |
| 305                                                     | D72W53044-111A | .PANEL-SINK WALL<br>SUPPLIER CODE:<br>VS5825                                                                                                             | 058335            | 1                    |
| 310                                                     | D72W54007-111B | .PANEL-DOOR WALL<br>SUPPLIER CODE:<br>VS5825                                                                                                             | 058335            | 1                    |
| 315                                                     | D72W56036-111A | .PANEL ASSY-LINING<br>SUPPLIER CODE:<br>VS5825                                                                                                           | 058335            | 1                    |
| - 316                                                   | D72D70249-111  | ..CUSHION-RUBBER, LID<br>SUPPLIER CODE:<br>VS5825<br>SB DATA FROM A CMM:<br>PRE SB D72K-25-114                                                           | 058335            | 1                    |
| 317                                                     | D72D72281-111  | ..CUSHION ASSY-RUBBER<br>SUPPLIER CODE:<br>VS5825<br>SB DATA FROM A CMM:<br>POST SB D72K-25-114<br>CONFIG CHG DATA FROM A CMM:<br>SUPSD BY D72D72504-111 | 058335            | 1                    |
| 317                                                     | D72D72504-111  | ..CUSHION ASSY-RUBBER<br>SUPPLIER CODE:<br>VS5825<br>CONFIG CHG DATA FROM A CMM:<br>SUPERSEDES D72D72281-111                                             | 058335            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |                                                                                                                                                          |                   |                      |

- ITEM NOT ILLUSTRATED

R Y R

25-40-01-56D

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-01  
 FIG. 56D  
 PAGE 7  
 OCT 15/24


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER     | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                                                        | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|-----------------|---------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 56D<br>318                                              | D72D72248-111   | ...CUSHION-LID<br>SUPPLIER CODE:<br>VS5825<br>SB DATA FROM A CMM:<br>POST SB D72K-25-114<br>CONFIG CHG DATA FROM A CMM:<br>SUPSD BY D72D72375-111 | 058335            | 1                    |
| 318                                                     | D72D72375-111   | ...CUSHION-LID<br>SUPPLIER CODE:<br>VS5825<br>CONFIG CHG DATA FROM A CMM:<br>SUPERSEDES D72D72248-111                                             | 058335            | 1                    |
| 319                                                     | D72D72287-111   | ...MAGNET-<br>SUPPLIER CODE:<br>VS5825<br>SB DATA FROM A CMM:<br>POST SB D72K-25-114                                                              | 058335            | 1                    |
| 320                                                     | D72W57003-111B  | .PANEL-HEADER<br>SUPPLIER CODE:<br>VS5825                                                                                                         | 058335            | 1                    |
| 325                                                     | D72W59046-111A  | .PANEL-DISP CABINET<br>SUPPLIER CODE:<br>VS5825                                                                                                   | 058335            | 1                    |
| 330                                                     | D72D70438-111B  | .COVER-FLLOOR PAN<br>SUPPLIER CODE:<br>VS5825                                                                                                     | 058335            | 1                    |
| 335                                                     | NAS1801-08-7    | ATTACHING PARTS<br>.SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN08-7                                                                               | 058335            | 2                    |
| 340                                                     | NAS1149DN816K   | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149DN816J                                                                                                | 058335            | 2                    |
| 345                                                     | D72D70435-111B  | -----*-----<br>.PAN-FLLOOR<br>SUPPLIER CODE:<br>VS5825<br>ATTACHING PARTS                                                                         | 058335            | 1                    |
| 350                                                     | NAS514P1032-6P  | .SCREW<br>-----*-----                                                                                                                             | 058335            | 4                    |
| 355                                                     | D72D72049-111   | .PLATE-<br>SUPPLIER CODE:<br>VS5825<br>POST SERVICE LETTER:<br>25-123                                                                             | 058089            | 1                    |
| 360                                                     | NAS514P1032-26P | .SCREW-<br>POST SERVICE LETTER:<br>25-123                                                                                                         | 058089            | 4                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                 |                                                                                                                                                   |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R

25-40-01-56D

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-01  
FIG. 56D  
PAGE 8  
OCT 15/24


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER   | 1 2 3 4 5 6 7 | NOMENCLATURE                                                                   | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|---------------|---------------|--------------------------------------------------------------------------------|-------------------|----------------------|
| 56D<br>365                                              | D72D72047-111 |               | .PLATE ASSY-BRKT<br>SUPPLIER CODE:<br>VS5825<br>POST SERVICE LETTER:<br>25-123 | 058089            | 1                    |
| 370                                                     | D72D72048-111 |               | .INSERT-BRKT<br>SUPPLIER CODE:<br>VS5825<br>POST SERVICE LETTER:<br>25-123     | 058089            | 4                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |               |               |                                                                                |                   |                      |

— ITEM NOT ILLUSTRATED


R Y R

25-40-01-56D

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

25-40-01  
 FIG. 56D  
 PAGE 9  
 OCT 15/24

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

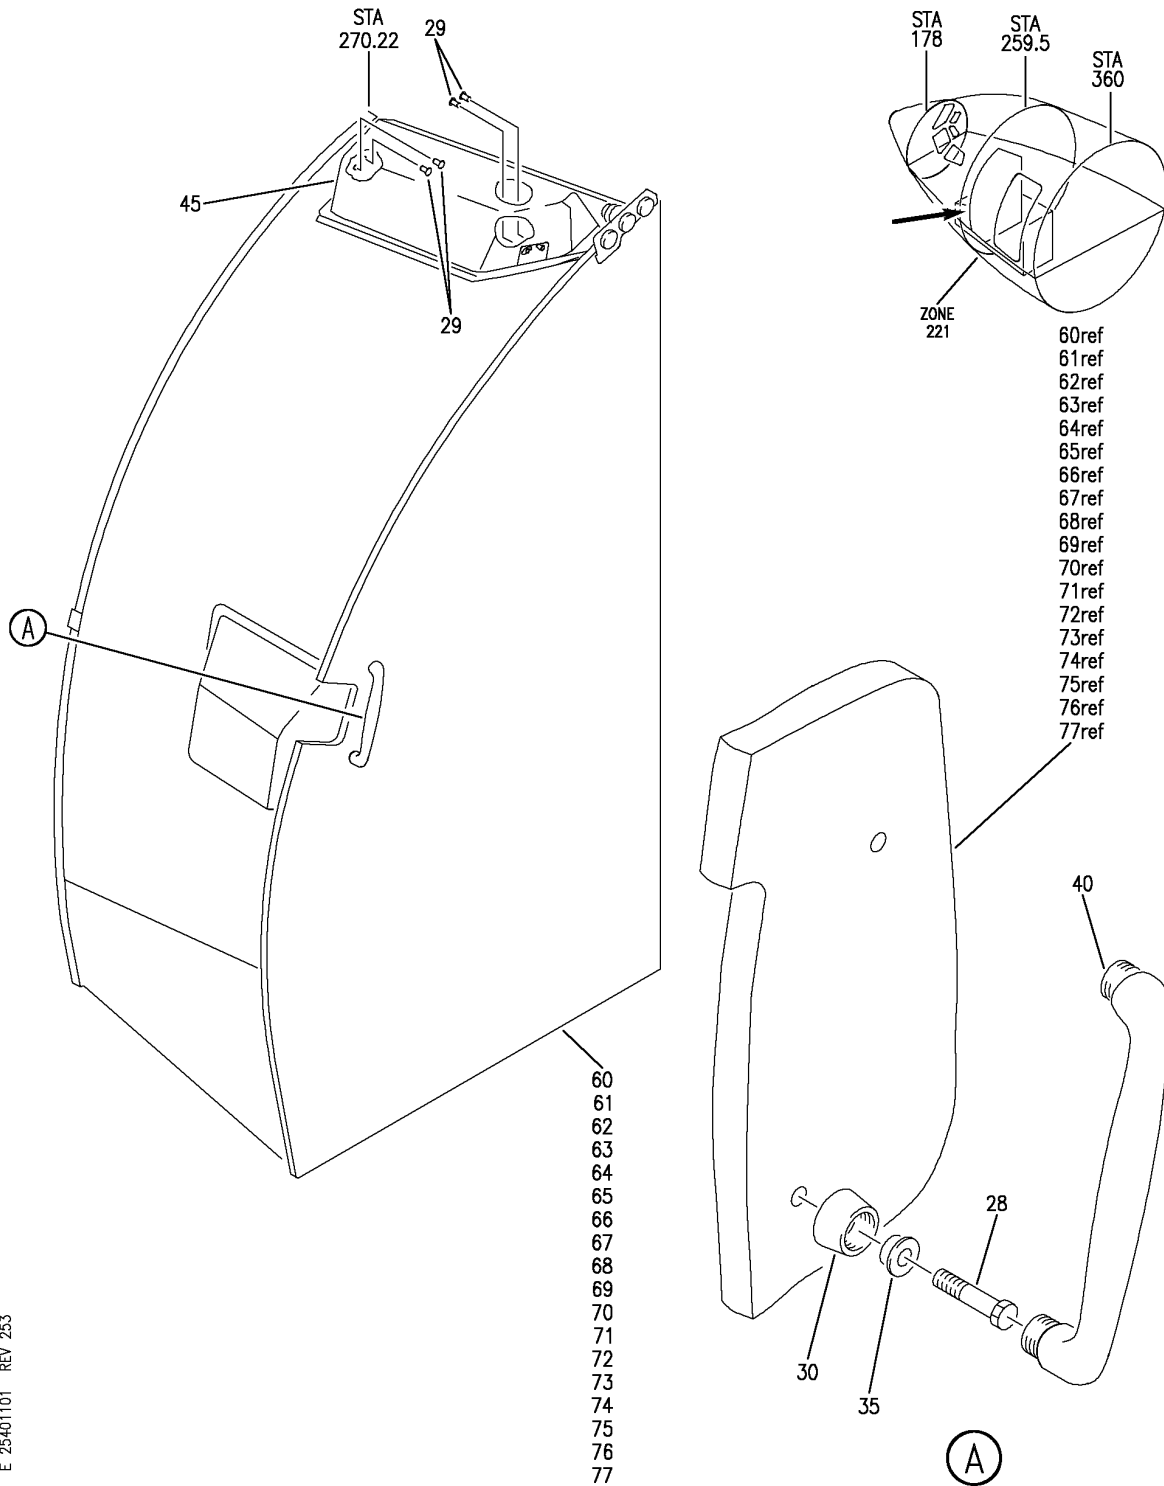

E 25401101 REV 253

LAVATORY INSTL-LAV A  
FIGURE 1

**25-40-11-01**

R/YR  
AUG 15/17

25-40-11-01  
PAGE 0


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 | NOMENCLATURE                                                                                 | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|---------------|----------------------------------------------------------------------------------------------|-------------------|----------------------|
| 1                                                       |                |               | LAVATORY INSTL-LAV A                                                                         | 336475            |                      |
| - 7                                                     | MODREF530922   |               | LAVATORY INSTL-LAV A                                                                         | 336353            | RF                   |
|                                                         |                |               | MODULE NUMBER:<br>417A1158-113C REV D                                                        |                   |                      |
| - 13                                                    | MODREF653587   |               | LAVATORY INSTL-LAV A                                                                         | 354377            | RF                   |
|                                                         |                |               | MODULE NUMBER:<br>417A1158-113C REV E                                                        |                   |                      |
| - 14                                                    | MODREF677535   |               | LAVATORY INSTL-LAV A                                                                         | 378416            | RF                   |
|                                                         |                |               | MODULE NUMBER:<br>417A1158-1026D REV A                                                       |                   |                      |
| - 17                                                    | MODREF706079   |               | LAVATORY INSTL-LAV A                                                                         | 417475            | RF                   |
|                                                         |                |               | MODULE NUMBER:<br>417A1160-238B REV A                                                        |                   |                      |
| 28                                                      | BACB30LK3-4    |               | .BOLT                                                                                        | 336475            | 2                    |
| 30                                                      | 65-5458-21E    |               | .NUT                                                                                         | 336416            | 2                    |
| 30                                                      | 65-5458-21N    |               | .NUT                                                                                         | 378475            | 2                    |
| 35                                                      | 66-4302        |               | .COLLAR                                                                                      | 336475            | 2                    |
| 40                                                      | 65-5458-20E    |               | .HANDLE-SPRT                                                                                 | 336377            | 1                    |
| 40                                                      | 65-5458-20N    |               | .HANDLE-SPRT                                                                                 | 378475            | 1                    |
| 67                                                      | D72000253-111A |               | .MODULE ASSY-LAV A                                                                           | 336353            | 1                    |
|                                                         |                |               | SUPPLIER CODE:<br>VJ4577                                                                     |                   |                      |
|                                                         |                |               | FUNCTIONAL DESCRIPTION:<br>THIS PART PROVIDES A<br>RESTROOM FOR PASSENGERS<br>AND CREW.      |                   |                      |
|                                                         |                |               | ELECTRICAL EQUIP NUMBER:<br>M01415                                                           |                   |                      |
|                                                         |                |               | COMPONENT MAINT MANUAL REF:<br>25-48-29                                                      |                   |                      |
|                                                         |                |               | FUNCTIONAL REFERENCE:<br>AIR CONDITIONING<br>FOR DETAILS SEE<br>21-24-51-01V<br>21-45-51-01V |                   |                      |
|                                                         |                |               | EQUIPMENT/FURNISHINGS<br>FOR DETAILS SEE<br>25-40-11-01V                                     |                   |                      |
|                                                         |                |               | PLACARDS AND MARKINGS<br>FOR DETAILS SEE<br>11-32-05-01V                                     |                   |                      |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |               |                                                                                              |                   |                      |

- ITEM NOT ILLUSTRATED

R Y R

# 25-40-11-01

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-11  
 FIG. 01  
 PAGE 1  
 OCT 15/24


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                                                                                                                                                                                                                                                                                                                                                         | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 1                                                       |                |                                                                                                                                                                                                                                                                                                                                                                                                                                                    |                   |                      |
| 71                                                      | D72000253-111F | .MODULE ASSY-LAV A<br>SUPPLIER CODE:<br>VJ4577<br>FUNCTIONAL DESCRIPTION:<br>THIS PART PROVIDES A<br>RESTROOM FOR PASSENGERS<br>AND CREW.<br>ELECTRICAL EQUIP NUMBER:<br>M01415<br>COMPONENT MAINT MANUAL REF:<br>25-48-29<br>FUNCTIONAL REFERENCE:<br>AIR CONDITIONING<br>FOR DETAILS SEE<br>21-24-51-01V<br>21-45-51-01V<br>EQUIPMENT/FURNISHINGS<br>FOR DETAILS SEE<br>25-40-11-01V<br>PLACARDS AND MARKINGS<br>FOR DETAILS SEE<br>11-32-05-01V | 354377            | 1                    |
| 72                                                      | D72004165-111C | .MODULE ASSY-LAV A<br>SUPPLIER CODE:<br>VJ4577<br>FUNCTIONAL DESCRIPTION:<br>PROVIDES A RESTROOM<br>FACILITY FOR PASSENGERS<br>AND CREW.<br>ELECTRICAL EQUIP NUMBER:<br>M01415<br>COMPONENT MAINT MANUAL REF:<br>25-48-63<br>FUNCTIONAL REFERENCE:<br>AIR CONDITIONING<br>FOR DETAILS SEE<br>21-24-51-19Q<br>21-45-51-19M<br>EQUIPMENT/FURNISHINGS<br>FOR DETAILS SEE<br>25-40-11-10D<br>PLACARDS AND MARKINGS<br>FOR DETAILS SEE<br>11-32-05-19N  | 378416            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |                                                                                                                                                                                                                                                                                                                                                                                                                                                    |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R

# 25-40-11-01

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

25-40-11  
 FIG. 01  
 PAGE 2  
 OCT 15/24




**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                                                                                                                                                                                                                                                                                                                                                                                                           | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 1<br>74                                                 | 1L300010-0040A | .MODULE ASSY-LAV A<br>SUPPLIER CODE:<br>V6S8D7<br>FUNCTIONAL DESCRIPTION:<br>PROVIDES LAVATORY<br>FACILITIES FOR<br>PASSENGERS AND CREW<br>ELECTRICAL EQUIP NUMBER:<br>M01415<br>COMPONENT MAINT MANUAL REF:<br>25-40-40<br>FUNCTIONAL REFERENCE:<br>COMMUNICATIONS<br>FOR DETAILS SEE<br>23-31-05-05L<br>EQUIPMENT/FURNISHINGS<br>FOR DETAILS SEE<br>25-40-11-21S<br>FIRE PROTECTION<br>FOR DETAILS SEE<br>26-14-01-04C<br>26-24-01-05A<br>PLACARDS AND MARKINGS<br>FOR DETAILS SEE<br>11-32-05-05Q | 417475            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                      |                   |                      |

— ITEM NOT ILLUSTRATED


R Y R

# 25-40-11-01

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

25-40-11  
 FIG. 01  
 PAGE 3  
 OCT 15/17

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

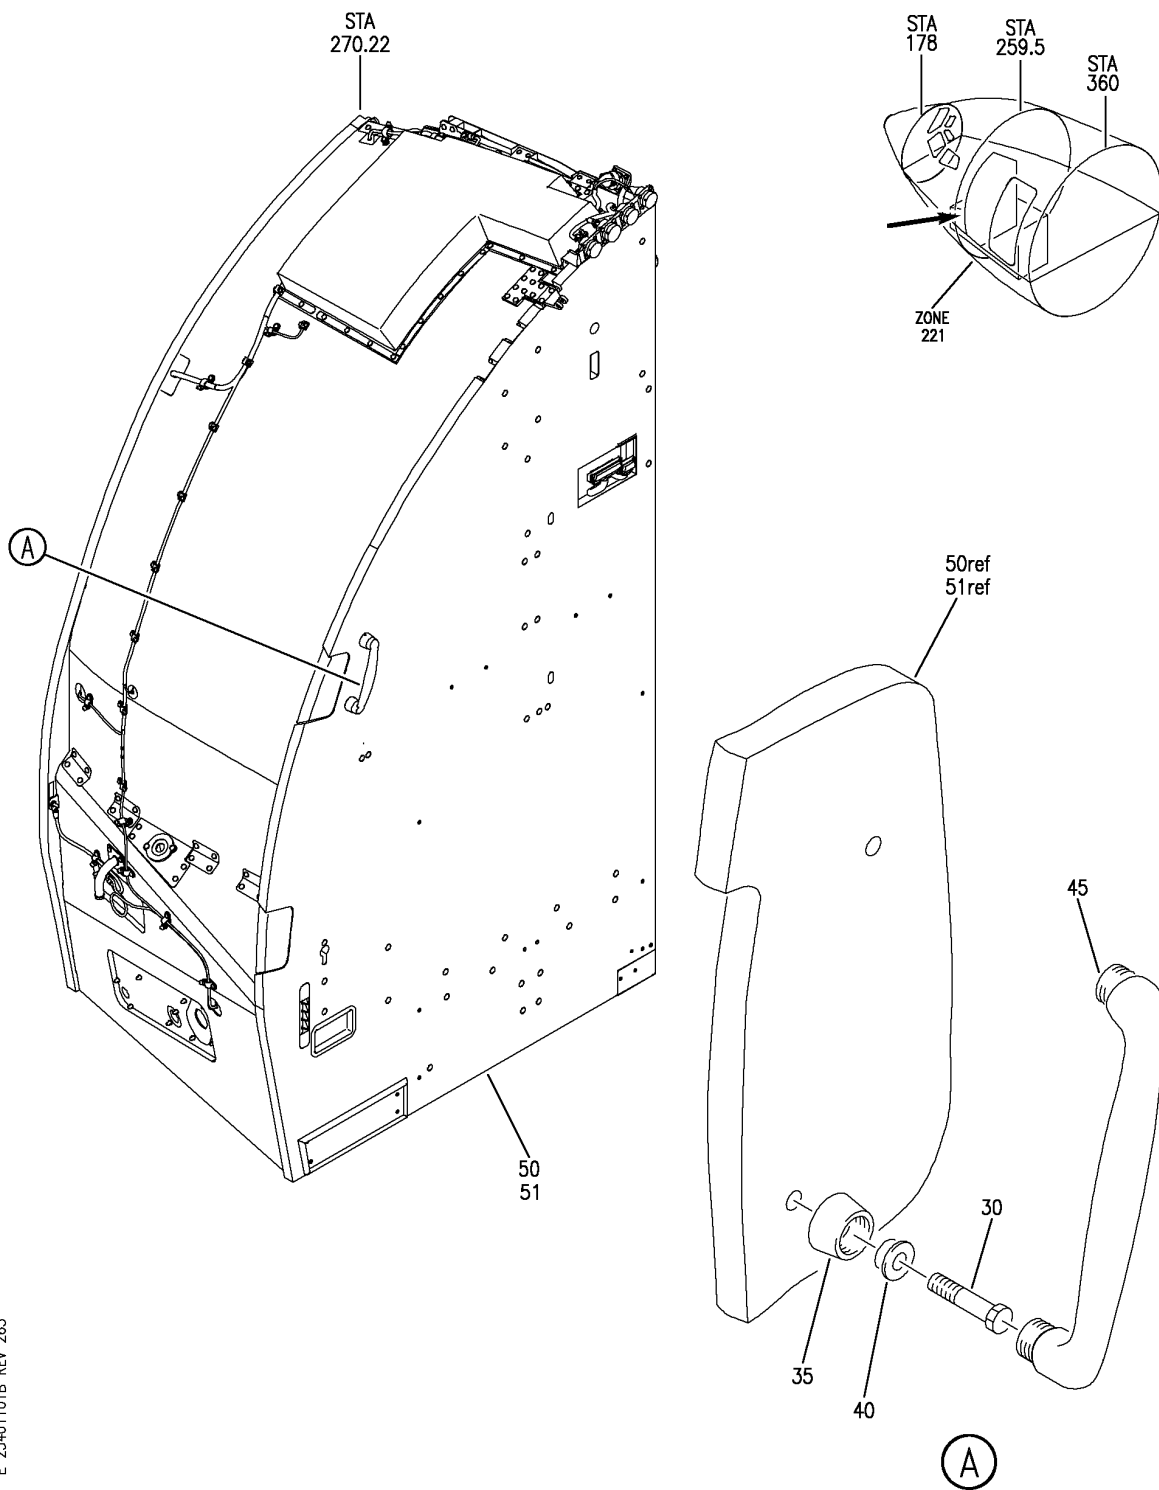

E 25401101B REV 263

LAVATORY INSTL-LAV A  
FIGURE 1B

**25-40-11-01B**

R Y R  
JUN 15/18

25-40-11-01B  
PAGE 0

ECCN 9E991 BOEING PROPRIETARY – See title page for details.


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 | NOMENCLATURE                | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|---------------|-----------------------------|-------------------|----------------------|
| 1B                                                      |                |               |                             |                   |                      |
| - 1                                                     | MODREF746541   |               | LAVATORY INSTL-LAV A        | 476999            |                      |
|                                                         |                |               | LAVATORY INSTL-LAV A        | 476508            | RF                   |
|                                                         |                |               | MODULE NUMBER:              |                   |                      |
|                                                         |                |               | 417A1160-459B REV A         |                   |                      |
| - 1                                                     | MODREF763053   |               | LAVATORY INSTL-LAV A        | 509999            | RF                   |
|                                                         |                |               | MODULE NUMBER:              |                   |                      |
|                                                         |                |               | 417A1160-537B REV A         |                   |                      |
| 30                                                      | BACB30LK3-4    |               | .BOLT                       | 476999            | 2                    |
| 35                                                      | 65-5458-21N    |               | .NUT                        | 476999            | 2                    |
| 40                                                      | 66-4302        |               | .COLLAR                     | 476999            | 2                    |
| 45                                                      | 65-5458-20N    |               | .HANDLE-SPRT                | 476999            | 1                    |
| 50                                                      | 1L300010-0081A |               | .MODULE ASSY-LAV A          | 476508            | 1                    |
|                                                         |                |               | SUPPLIER CODE:              |                   |                      |
|                                                         |                |               | V6S8D7                      |                   |                      |
|                                                         |                |               | FUNCTIONAL DESCRIPTION:     |                   |                      |
|                                                         |                |               | PROVIDES LAVATORY           |                   |                      |
|                                                         |                |               | FACILITIES FOR              |                   |                      |
|                                                         |                |               | PASSENGERS AND CREW         |                   |                      |
|                                                         |                |               | ELECTRICAL EQUIP NUMBER:    |                   |                      |
|                                                         |                |               | M01415                      |                   |                      |
|                                                         |                |               | COMPONENT MAINT MANUAL REF: |                   |                      |
|                                                         |                |               | 25-40-54                    |                   |                      |
|                                                         |                |               | FUNCTIONAL REFERENCE:       |                   |                      |
|                                                         |                |               | COMMUNICATIONS              |                   |                      |
|                                                         |                |               | FOR DETAILS SEE             |                   |                      |
|                                                         |                |               | 23-31-05-15B                |                   |                      |
|                                                         |                |               | EQUIPMENT/FURNISHINGS       |                   |                      |
|                                                         |                |               | FOR DETAILS SEE             |                   |                      |
|                                                         |                |               | 25-40-11-11H                |                   |                      |
|                                                         |                |               | FIRE PROTECTION             |                   |                      |
|                                                         |                |               | FOR DETAILS SEE             |                   |                      |
|                                                         |                |               | 26-14-01-13N                |                   |                      |
|                                                         |                |               | 26-24-01-13E                |                   |                      |
|                                                         |                |               | PLACARDS AND MARKINGS       |                   |                      |
|                                                         |                |               | FOR DETAILS SEE             |                   |                      |
|                                                         |                |               | 11-32-05-17K                |                   |                      |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |               |                             |                   |                      |

— ITEM NOT ILLUSTRATED

RYR

# 25-40-11-01B

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-11  
 FIG. 01B  
 PAGE 1  
 APR 15/18


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 | NOMENCLATURE                                                                                                                                                                                                                                                                                                                                                                                                                                                                                         | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|---------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 1B<br>50                                                | 1L300010-0171A |               | .MODULE ASSY-LAV A<br>SUPPLIER CODE:<br>V6S8D7<br>FUNCTIONAL DESCRIPTION:<br>PROVIDES LAVATORY<br>FACILITIES FOR<br>PASSENGERS AND CREW<br>ELECTRICAL EQUIP NUMBER:<br>M01415<br>COMPONENT MAINT MANUAL REF:<br>25-40-49<br>FUNCTIONAL REFERENCE:<br>COMMUNICATIONS<br>FOR DETAILS SEE<br>23-31-05-15G<br>EQUIPMENT/FURNISHINGS<br>FOR DETAILS SEE<br>25-40-11-11N<br>FIRE PROTECTION<br>FOR DETAILS SEE<br>26-14-01-13T<br>26-24-01-14H<br>PLACARDS AND MARKINGS<br>FOR DETAILS SEE<br>11-32-05-17P | 509999            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |               |                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                      |                   |                      |

— ITEM NOT ILLUSTRATED


R Y R

25-40-11-01B

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

25-40-11  
 FIG. 01B  
 PAGE 2  
 APR 15/18

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

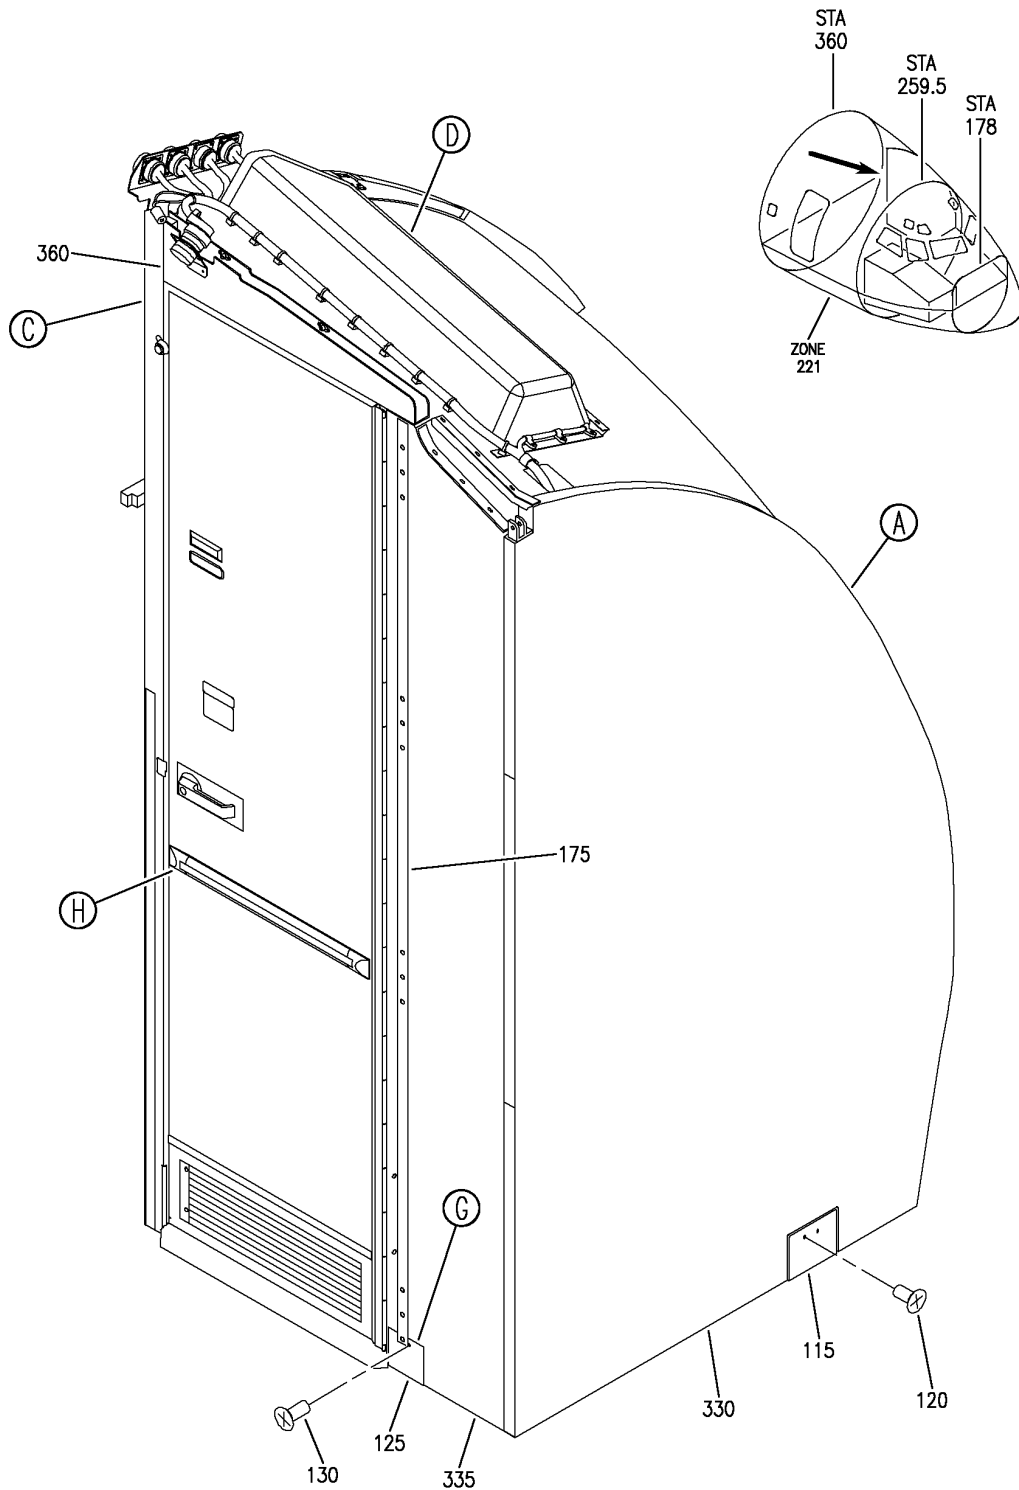

E 25401101V SHT 1 REV 265

MODULE ASSY-LAV A (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 1V (SHEET 1)


**25-40-11-01V**

R/YR  
AUG 15/18

25-40-11-01V  
PAGE 0

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

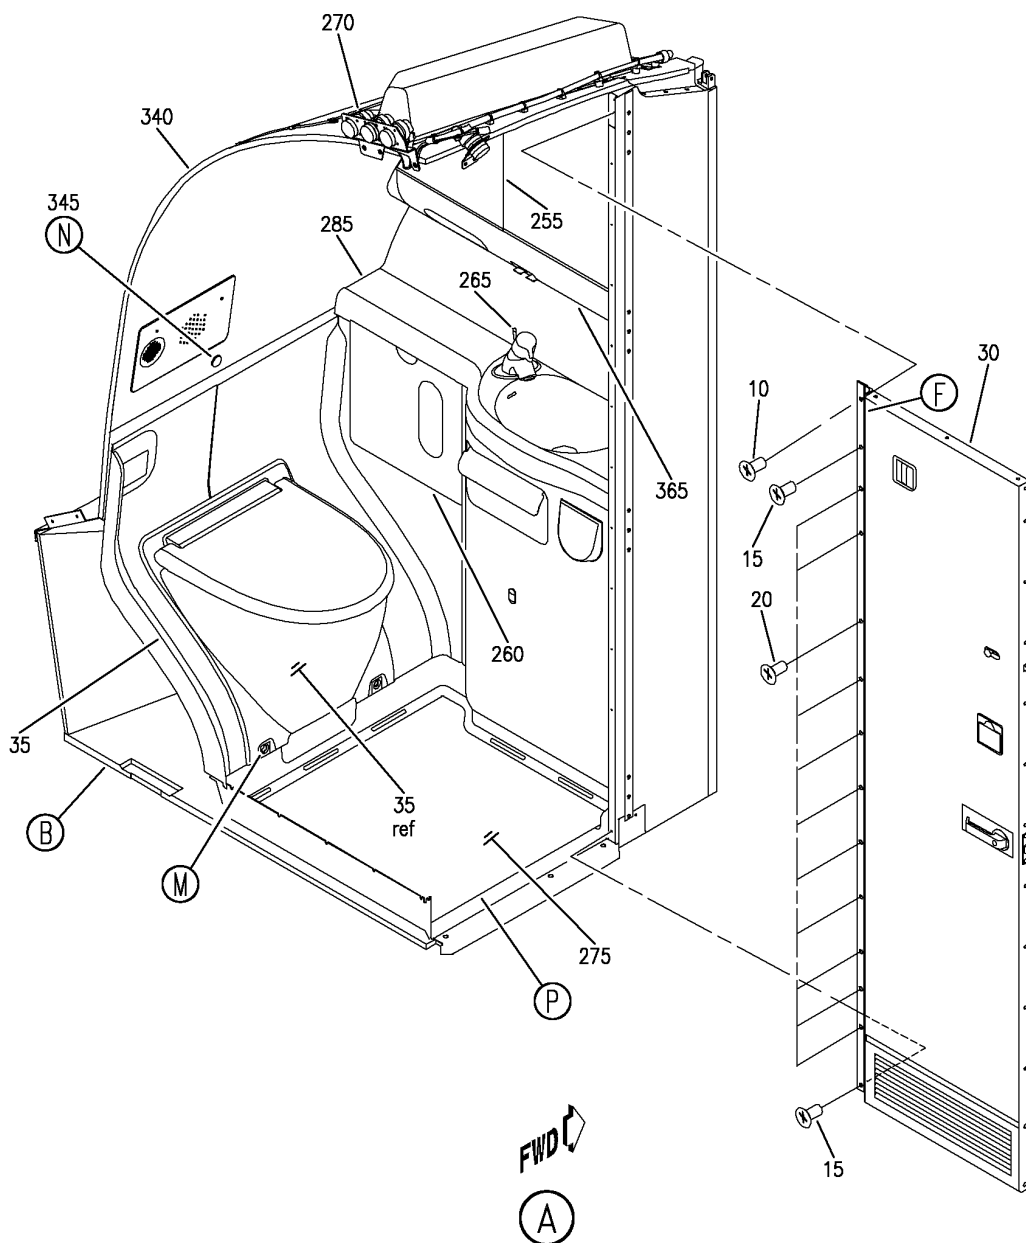

E 25401101V SHT 2 REV 265

MODULE ASSY-LAV A (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 1V (SHEET 2)


**25-40-11-01V**

R/YR  
AUG 15/18

25-40-11-01V  
PAGE 0A

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

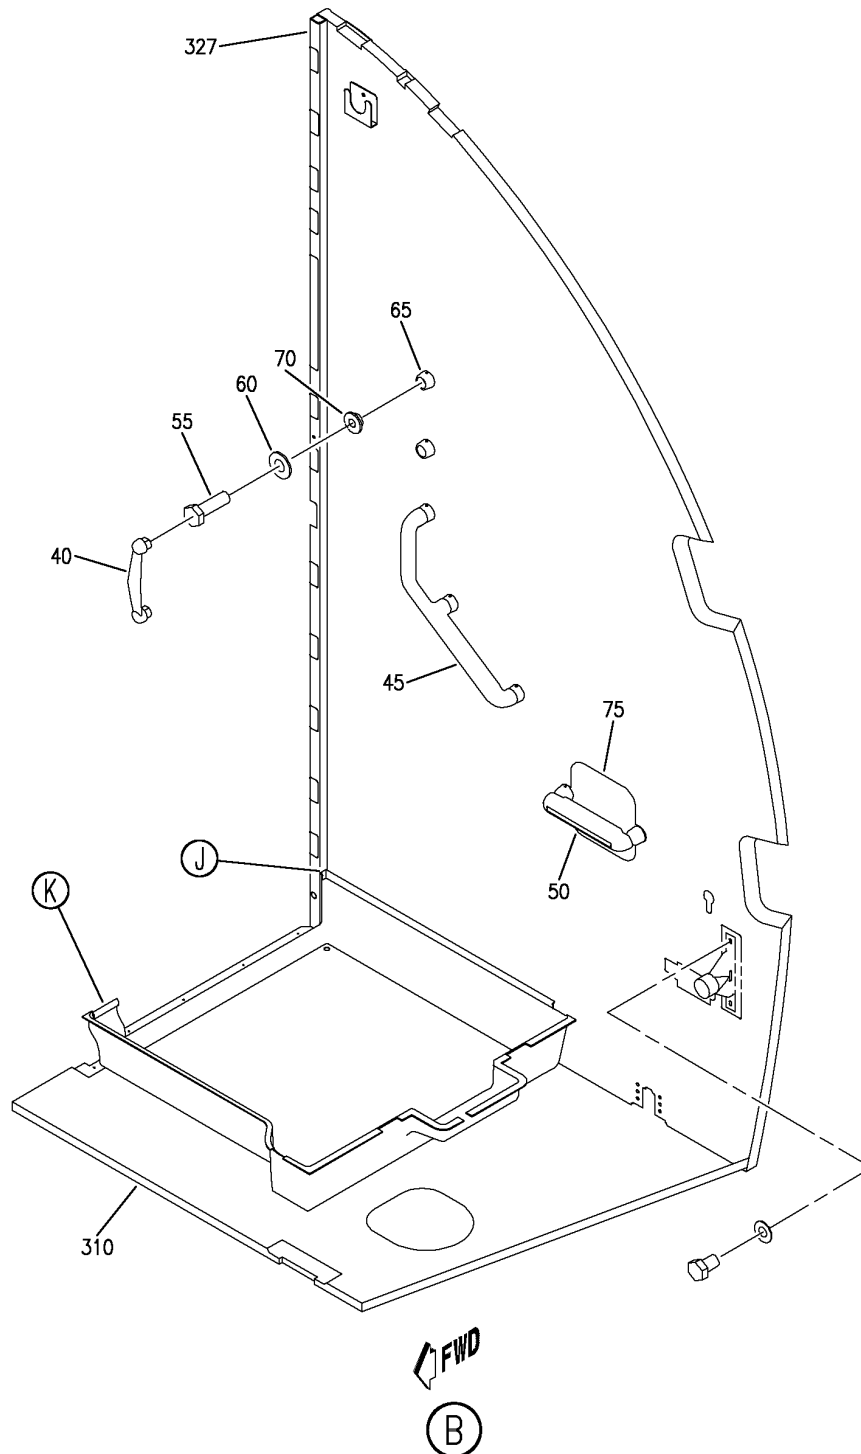

E 25401101V SHT 3 REV 265

MODULE ASSY-LAV A (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 1V (SHEET 3)


**25-40-11-01V**

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

R/YR  
AUG 15/18

25-40-11-01V  
PAGE 0B

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

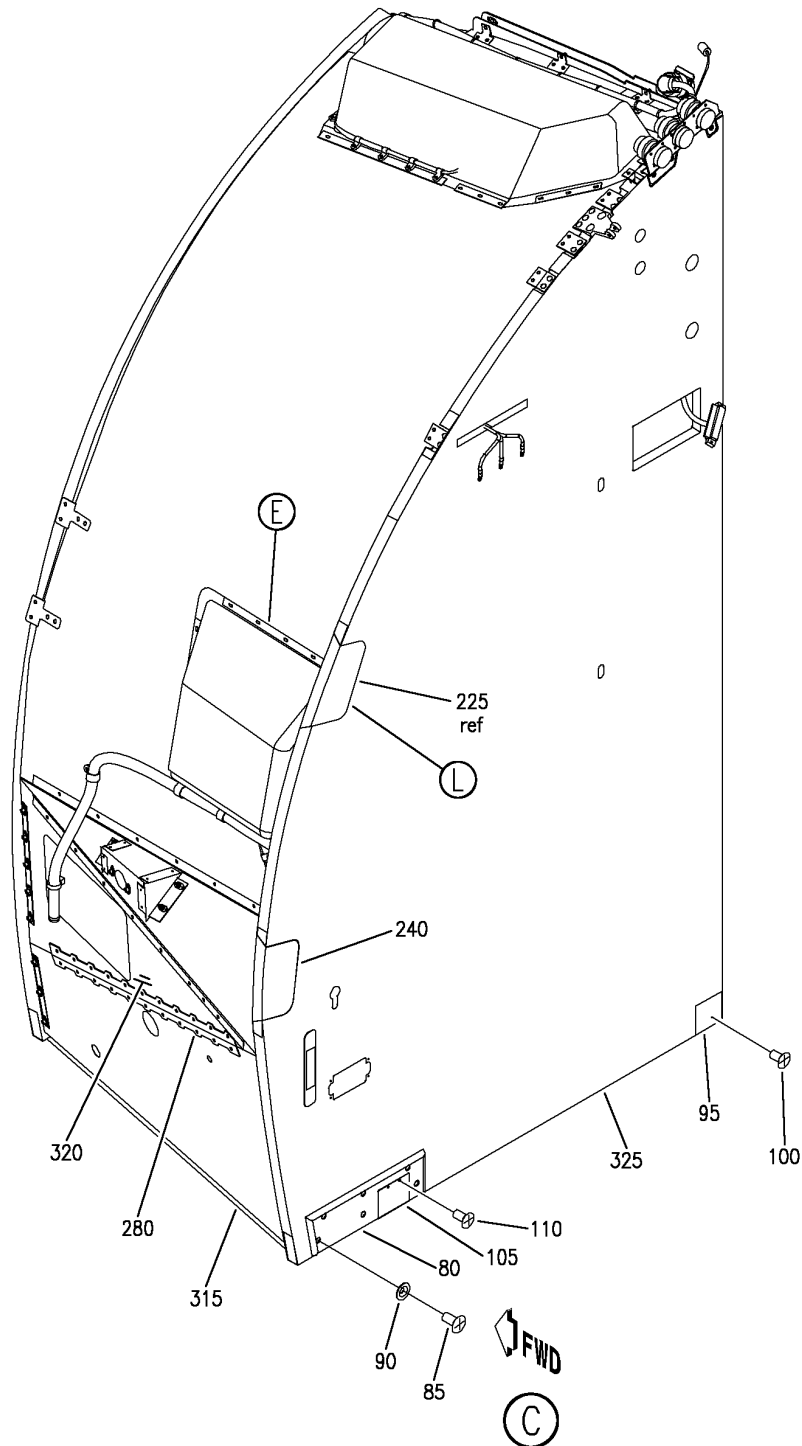

E 25401101V SHT 4 REV 191

MODULE ASSY-LAV A (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 1V (SHEET 4)

**25-40-11-01V**


ECCN 9E991 BOEING PROPRIETARY – See title page for details.

RJR  
JUN 15/12

25-40-11-01V  
PAGE 0C



**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

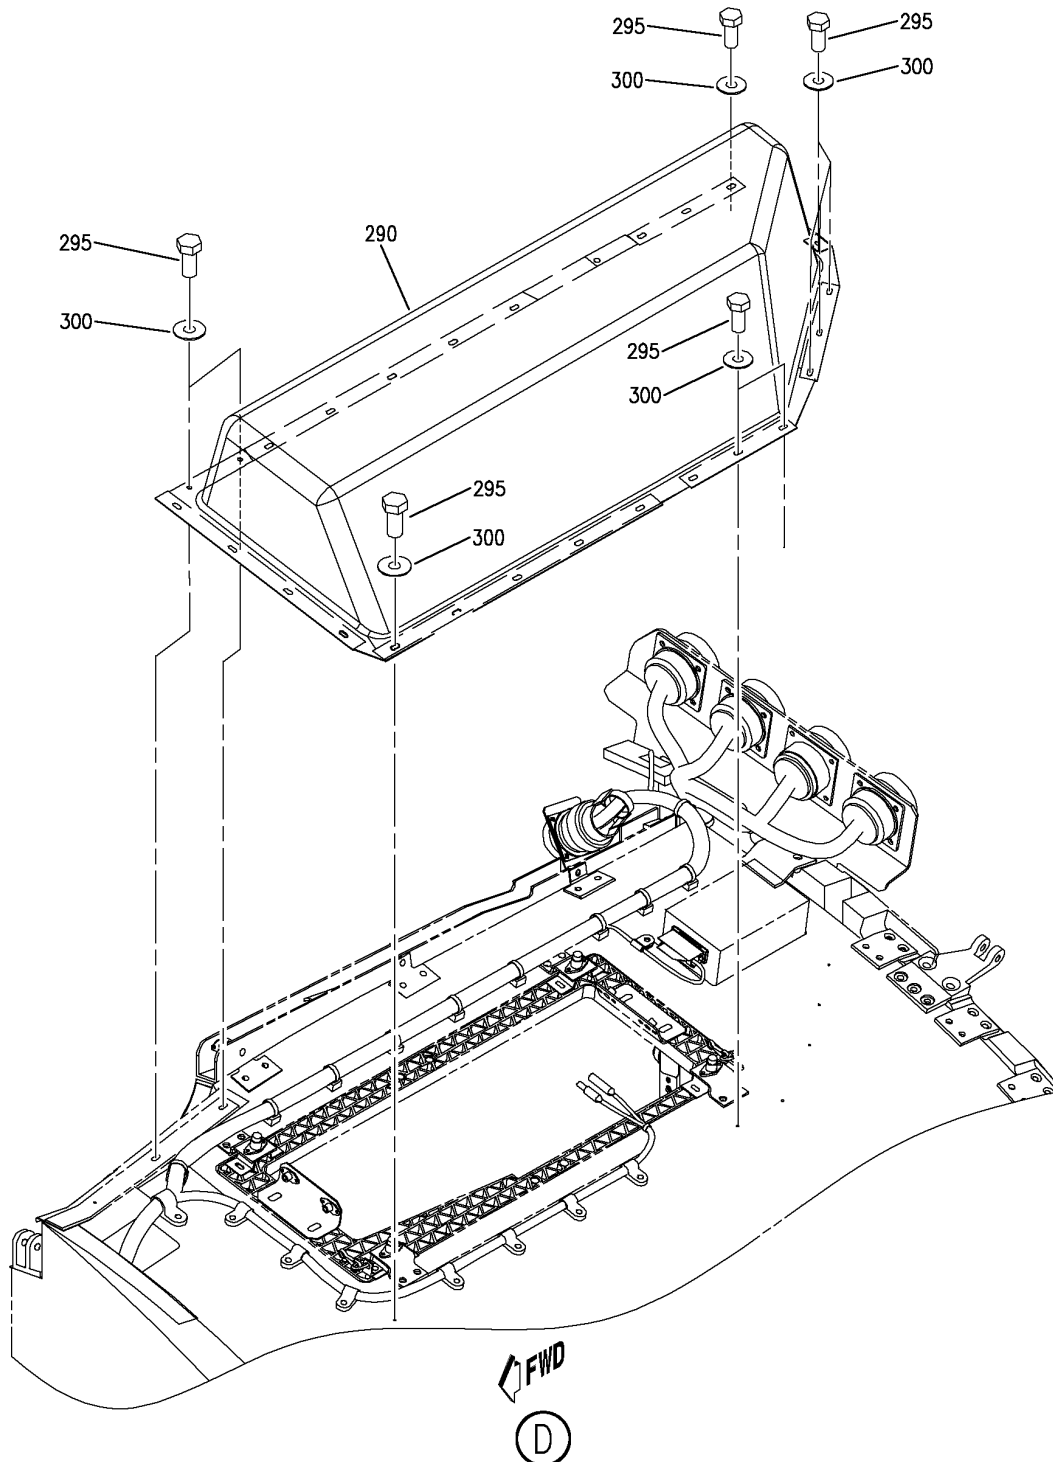

E 25401101V SHT 5 REV 191

MODULE ASSY-LAV A (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 1V (SHEET 5)


**25-40-11-01V**

RJR  
JUN 15/12

25-40-11-01V  
PAGE 0D

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

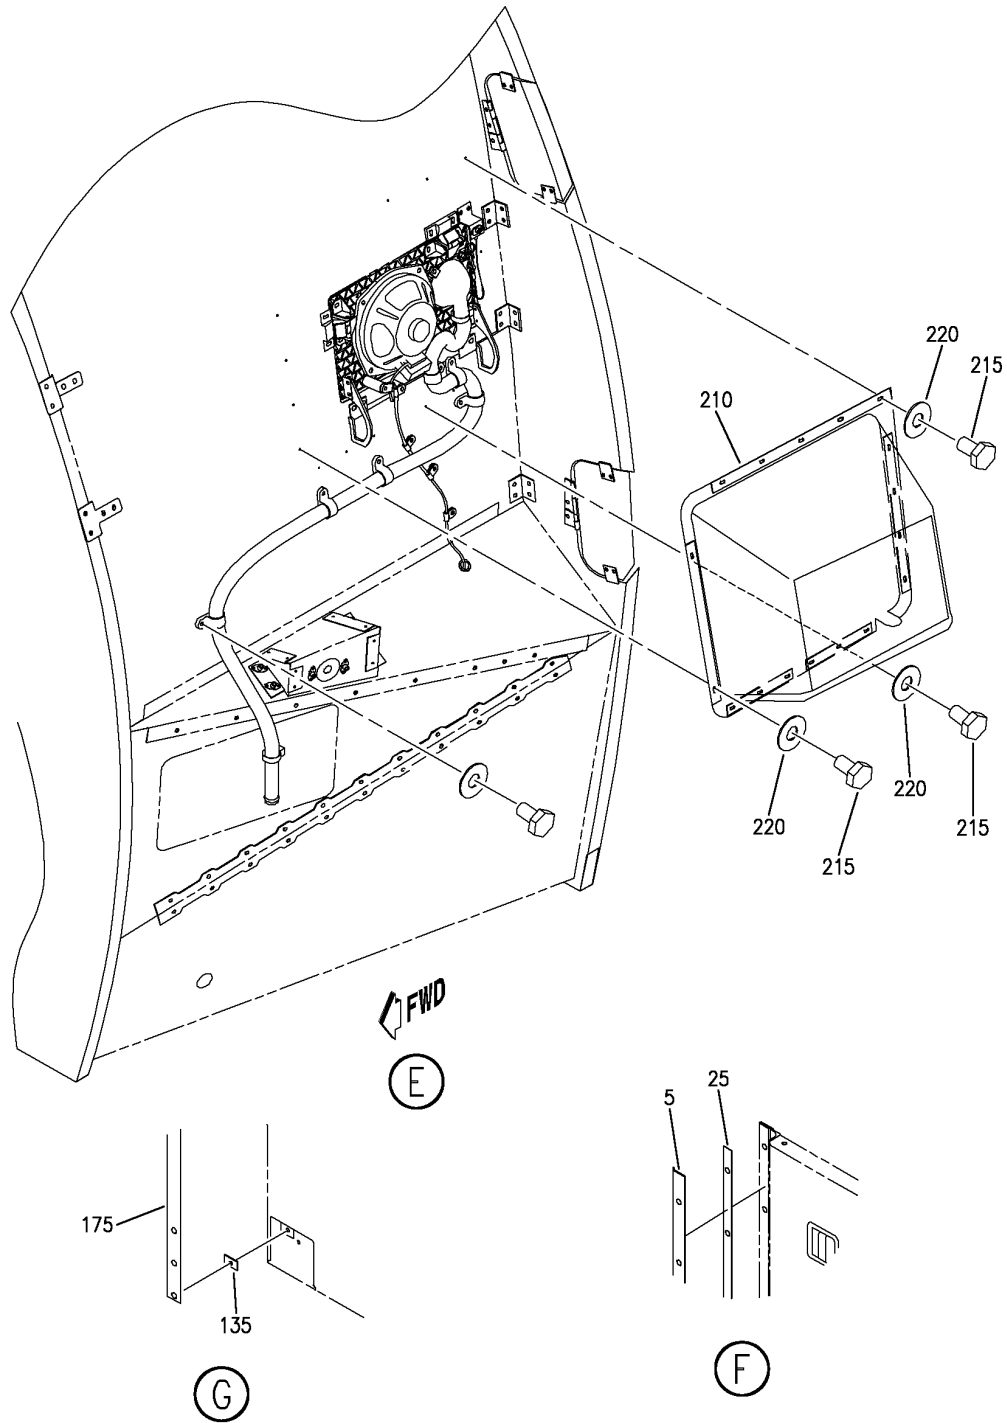

E 25401101V SHT 6 REV 191

MODULE ASSY-LAV A (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 1V (SHEET 6)


**25-40-11-01V**

RJR  
JUN 15/12

25-40-11-01V  
PAGE 0E

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

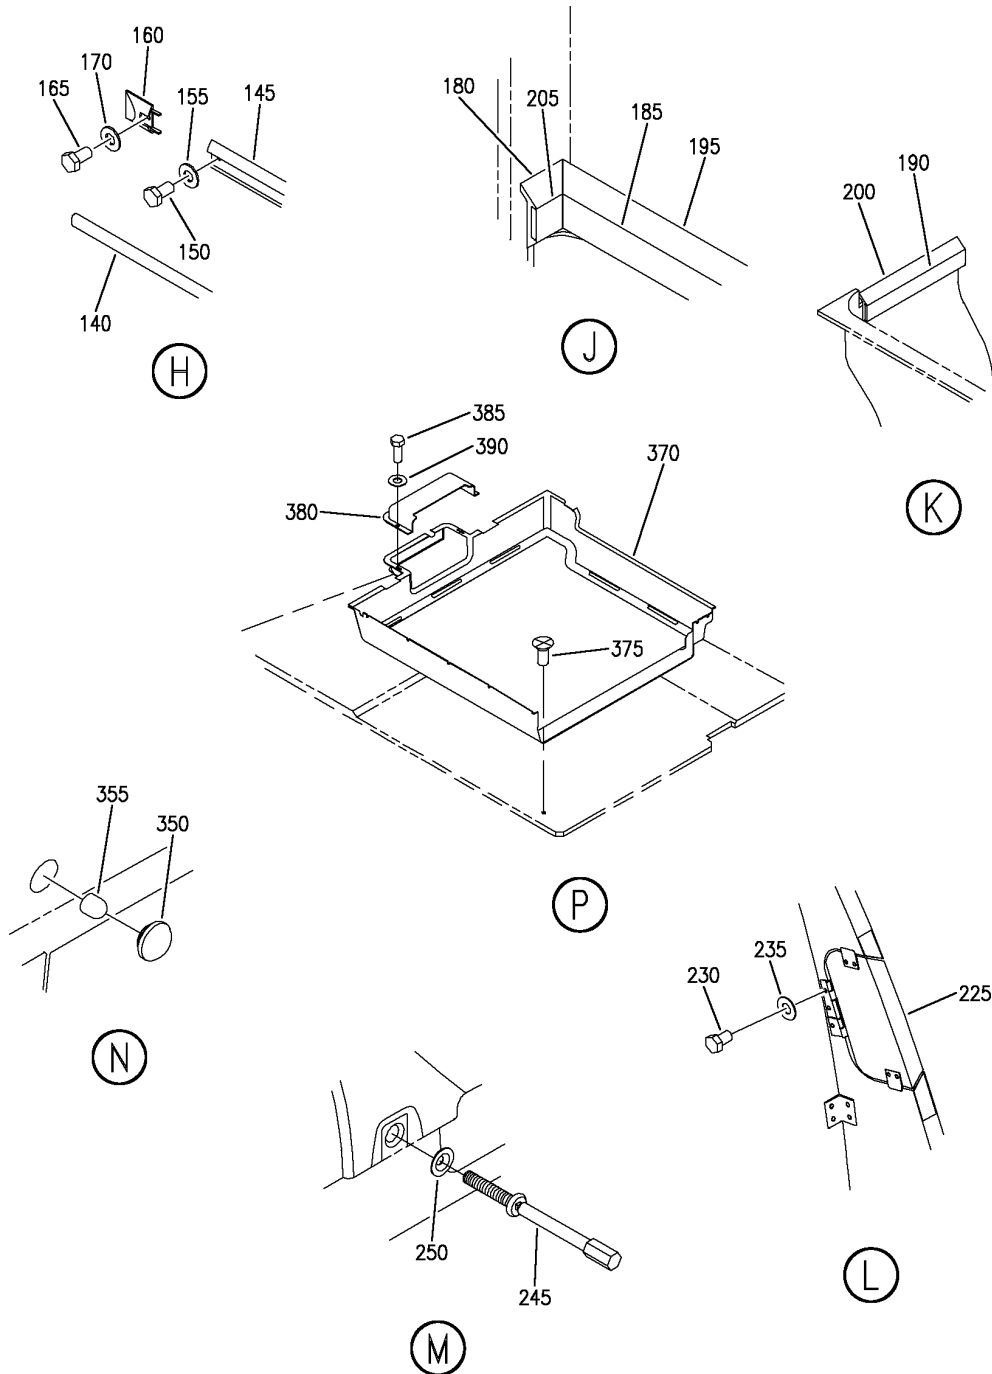

E 25401101V SHT 7 REV 191

MODULE ASSY-LAV A (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 1V (SHEET 7)

**25-40-11-01V**

RJR  
JUN 15/12

25-40-11-01V  
PAGE OF

ECCN 9E991 BOEING PROPRIETARY – See title page for details.


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                                                                                                                                                                                                               | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 1 V                                                     |                | MODULE ASSY-LAV A<br>(EQUIPMENT/FURNISHINGS<br>ONLY)                                                                                                                                                                                                                                                     | 336377            |                      |
| - 1                                                     | D72000253-111A | MODULE ASSY-LAV A<br>(EQUIPMENT/FURNISHINGS<br>ONLY)<br>SUPPLIER CODE:<br>VJ4577<br>FUNCTIONAL DESCRIPTION:<br>THIS PART PROVIDES A<br>RESTROOM FOR PASSENGERS<br>AND CREW<br>ELECTRICAL EQUIP NUMBER:<br>M01415<br>COMPONENT MAINT MANUAL REF:<br>25-48-29<br>FOR NHA/OTHER SYS DET SEE:<br>25-40-11-01 | 336353            | RF                   |
| - 1                                                     | D72000253-111F | MODULE ASSY-LAV A<br>(EQUIPMENT/FURNISHINGS<br>ONLY)<br>SUPPLIER CODE:<br>VJ4577<br>FUNCTIONAL DESCRIPTION:<br>THIS PART PROVIDES A<br>RESTROOM FOR PASSENGERS<br>AND CREW<br>ELECTRICAL EQUIP NUMBER:<br>M01415<br>COMPONENT MAINT MANUAL REF:<br>25-48-29<br>FOR NHA/OTHER SYS DET SEE:<br>25-40-11-01 | 354377            | RF                   |
| 5                                                       | D72D70987-111  | .RETAINER-SEAL RUBBER<br>SUPPLIER CODE:<br>VS5825<br>ATTACHING PARTS                                                                                                                                                                                                                                     | 336377            | 1                    |
| 10                                                      | NAS514P1032-12 | .SCREW                                                                                                                                                                                                                                                                                                   | 336377            | 1                    |
| 15                                                      | NAS514P1032-8  | .SCREW                                                                                                                                                                                                                                                                                                   | 336377            | 2                    |
| 20                                                      | NAS514P1032-10 | .SCREW                                                                                                                                                                                                                                                                                                   | 336377            | 11                   |
|                                                         |                | -----*-----                                                                                                                                                                                                                                                                                              |                   |                      |
| 25                                                      | D72D70988-111  | .SEAL-RUBBER<br>SUPPLIER CODE:<br>VS5825                                                                                                                                                                                                                                                                 | 336377            | 1                    |
| 30                                                      | D72W13510-111E | .DOOR ASSY-SLAB<br>SUPPLIER CODE:<br>VS5825<br>FOR DETAILS SEE:<br>25-41-13-01V                                                                                                                                                                                                                          | 336377            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |                                                                                                                                                                                                                                                                                                          |                   |                      |

- ITEM NOT ILLUSTRATED

RYR

25-40-11-01V

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-11  
FIG. 01V  
PAGE 1  
OCT 15/24


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 NOMENCLATURE                                                                  | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|---------------------------------------------------------------------------------------------|-------------------|----------------------|
| 1V                                                      |                |                                                                                             |                   |                      |
| 35                                                      | D72W15502-111  | .TOILET AND FLOOR PAN ASSY-<br>SUPPLIER CODE:<br>VS5825<br>FOR DETAILS SEE:<br>25-41-21-01V | 336377            | RF                   |
| 40                                                      | 65-5458-20N    | .HANDLE-ASSIST                                                                              | 336377            | 1                    |
| 45                                                      | 65C22388-13    | .HANDLE-ASSIST                                                                              | 336377            | 1                    |
| 50                                                      | 69-72416-5     | .HANDLE-ASSIST<br>SUPPLIER CODE:<br>V26835                                                  | 336377            | 1                    |
| 55                                                      | NAS1801-3-10   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-10                                            | 336377            | 7                    |
| 60                                                      | NAS1149D0332K  | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0332J                                          | 336377            | 7                    |
| 65                                                      | 65-5458-21N    | .NUT                                                                                        | 336377            | 7                    |
| 70                                                      | 66-4302-1      | .COLLAR                                                                                     | 336377            | 7                    |
| 75                                                      | D75D70952-163  | .PAN-<br>SUPPLIER CODE:<br>VS5825                                                           | 336377            | 1                    |
| 80                                                      | D72D80019-111G | .KICKSTRIP-<br>SUPPLIER CODE:<br>VS5825<br>ATTACHING PARTS                                  | 336377            | 1                    |
| 85                                                      | NAS514P1032-6P | .SCREW                                                                                      | 336377            | 6                    |
| 90                                                      | NAS1169DD10    | .WASHER<br>-----*-----                                                                      | 336377            | 6                    |
| 95                                                      | D72D70833-111A | .PLATE-COVER<br>SUPPLIER CODE:<br>VS5825<br>ATTACHING PARTS                                 | 336377            | 1                    |
| 100                                                     | NAS514P632-4   | .SCREW<br>-----*-----                                                                       | 336377            | 2                    |
| 105                                                     | D72D70943-111A | .PLATE-COVER<br>SUPPLIER CODE:<br>VS5825<br>ATTACHING PARTS                                 | 336377            | 1                    |
| 110                                                     | NAS514P632-4   | .SCREW<br>-----*-----                                                                       | 336377            | 2                    |
| 115                                                     | D72D70943-111B | .PLATE-COVER<br>SUPPLIER CODE:<br>VS5825<br>ATTACHING PARTS                                 | 336377            | 1                    |
| 120                                                     | NAS514P632-4   | .SCREW<br>-----*-----                                                                       | 336377            | 2                    |
| 125                                                     | D72D70944-111A | .PLATE-COVER<br>SUPPLIER CODE:<br>VS5825                                                    | 336377            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |                                                                                             |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R

25-40-11-01V

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-11  
 FIG. 01V  
 PAGE 2  
 OCT 15/24


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 | NOMENCLATURE             | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|---------------|--------------------------|-------------------|----------------------|
| 1V                                                      |                |               | ATTACHING PARTS          |                   |                      |
| 130                                                     | NAS514P632-4   | .             | SCREW                    | 336377            | 1                    |
|                                                         |                | -----*        |                          |                   |                      |
| 135                                                     | D72D71550-111  | .             | SPACER-                  | 336377            | 1                    |
|                                                         |                |               | SUPPLIER CODE:           |                   |                      |
|                                                         |                |               | VS5825                   |                   |                      |
| 140                                                     | D72D80025-911A | .             | RUBSTRIP-                | 336377            | 1                    |
|                                                         |                |               | SUPPLIER CODE:           |                   |                      |
|                                                         |                |               | VS5825                   |                   |                      |
| 145                                                     | D72D80024-111B | .             | RETAINER-RUBSTRIP        | 336377            | 1                    |
|                                                         |                |               | SUPPLIER CODE:           |                   |                      |
|                                                         |                |               | VS5825                   |                   |                      |
|                                                         |                |               | ATTACHING PARTS          |                   |                      |
| 150                                                     | NAS1801-08-5   | .             | SCREW                    | 336377            | 3                    |
|                                                         |                |               | STANDARD SUBSTITUTION:   |                   |                      |
|                                                         |                |               | BACS12HN08-5             |                   |                      |
| 155                                                     | NAS1149DN832K  | .             | WASHER                   | 336377            | 3                    |
|                                                         |                |               | STANDARD SUBSTITUTION:   |                   |                      |
|                                                         |                |               | NAS1149DN832J            |                   |                      |
|                                                         |                | -----*        |                          |                   |                      |
| 160                                                     | 432W7101-6J    | .             | CAP                      | 336377            | 2                    |
|                                                         |                |               | ATTACHING PARTS          |                   |                      |
| 165                                                     | NAS1801-08-5   | .             | SCREW                    | 336377            | 2                    |
|                                                         |                |               | STANDARD SUBSTITUTION:   |                   |                      |
|                                                         |                |               | BACS12HN08-5             |                   |                      |
| 170                                                     | NAS1149DN832K  | .             | WASHER                   | 336377            | 2                    |
|                                                         |                |               | STANDARD SUBSTITUTION:   |                   |                      |
|                                                         |                |               | NAS1149DN832J            |                   |                      |
|                                                         |                | -----*        |                          |                   |                      |
| 175                                                     | D72D70668-111  | .             | DOUBLER-FLIGHT DECK DOOR | 336377            | 1                    |
|                                                         |                |               | SUPPLIER CODE:           |                   |                      |
|                                                         |                |               | VS5825                   |                   |                      |
| 180                                                     | D72D71110-111B | .             | TRIM-RTNR, FLOOR PAN     | 336377            | 1                    |
|                                                         |                |               | SUPPLIER CODE:           |                   |                      |
|                                                         |                |               | VS5825                   |                   |                      |
| 185                                                     | D72D71112-916B | .             | TRIM-INSERT, FLOOR PAN   | 336377            | 1                    |
|                                                         |                |               | SUPPLIER CODE:           |                   |                      |
|                                                         |                |               | VS5825                   |                   |                      |
| 190                                                     | D72D71112-917B | .             | TRIM-INSERT, FLOOR PAN   | 336377            | 1                    |
|                                                         |                |               | SUPPLIER CODE:           |                   |                      |
|                                                         |                |               | VS5825                   |                   |                      |
| 195                                                     | D72D71169-111B | .             | TRIM-RTNR, FLOOR PAN     | 336377            | 1                    |
|                                                         |                |               | SUPPLIER CODE:           |                   |                      |
|                                                         |                |               | VS5825                   |                   |                      |
| 200                                                     | D72D71171-111B | .             | TRIM-RTNR, FLOOR PAN     | 336377            | 1                    |
|                                                         |                |               | SUPPLIER CODE:           |                   |                      |
|                                                         |                |               | VS5825                   |                   |                      |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |               |                          |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R

25-40-11-01V

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-11  
 FIG. 01V  
 PAGE 3  
 OCT 15/24


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                 | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 1V                                                      |                |                                                                                                            |                   |                      |
| 205                                                     | D72D71112-912B | .TRIM-INSERT, FLOOR PAN<br>SUPPLIER CODE:<br>VS5825                                                        | 336377            | 1                    |
| 210                                                     | D72D71955-111  | .BLANKET-FIRE<br>SUPPLIER CODE:<br>VS5825<br>ATTACHING PARTS                                               | 336377            | 1                    |
| 215                                                     | NAS1801-06-4   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN06-4                                                           | 336377            | 23                   |
| 220                                                     | NAS1149DN616K  | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149DN616J<br>-----*-----                                          | 336377            | 23                   |
| 225                                                     | D72W30049-111A | .DOOR ASSY-FLAP<br>SUPPLIER CODE:<br>VS5825<br>ATTACHING PARTS                                             | 336377            | 1                    |
| 230                                                     | NAS1801-08-5   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN08-5                                                           | 336377            | 3                    |
| 235                                                     | NAS1149DN816K  | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149DN816J<br>-----*-----                                          | 336377            | 3                    |
| 240                                                     | D72W30050-111A | .DOOR ASSY-FLAP<br>SUPPLIER CODE:<br>VS5825                                                                | 336377            | 1                    |
| 245                                                     | D72D72683-111  | .SCREW-TAMPER PROOF<br>SUPPLIER CODE:<br>VS5825<br>CONFIG CHG DATA FROM A CMM:<br>SUPSD BY D72D72683-913   | 336377            | 2                    |
| 245                                                     | D72D72683-913  | .SCREW-TAMPER PROOF<br>SUPPLIER CODE:<br>VS5825<br>CONFIG CHG DATA FROM A CMM:<br>SUPERSEDES D72D72683-111 | 336377            | 2                    |
| 250                                                     | NAS1149C0332R  | .WASHER                                                                                                    | 336377            | 2                    |
| 255                                                     | D72W16523-111  | .DISPENSER ASSY-UPR<br>SUPPLIER CODE:<br>VS5825<br>FOR DETAILS SEE:<br>25-41-51-01V                        | 336377            | RF                   |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |                                                                                                            |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R

25-40-11-01V

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-11  
FIG. 01V  
PAGE 4  
OCT 15/24


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                                                                                                                                                                                                                                                                   | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 1V<br>260                                               | D72W17506-111  | .DISPENSER ASSY-LWR<br>SUPPLIER CODE:<br>VS5825<br>FUNCTIONAL REFERENCE:<br>EQUIPMENT/FURNISHINGS<br>FOR DETAILS SEE<br>25-41-51-10V<br>FIRE PROTECTION<br>FOR DETAILS SEE<br>26-24-01-01V                                                                                                                                                                   | 336377            | RF                   |
| 265                                                     | D72W26512-111  | .PLUMBING ASSY-<br>SUPPLIER CODE:<br>VS5825<br>FUNCTIONAL REFERENCE:<br>AIR CONDITIONING<br>FOR DETAILS SEE<br>21-24-51-10V<br>WATER/WASTE<br>FOR DETAILS SEE<br>38-11-05-01V<br>38-11-06-20<br>38-11-51-01V<br>38-13-01-01V                                                                                                                                 | 336377            | RF                   |
| 270                                                     | D72W27543-111  | .ELECTRICAL ASSY-<br>SUPPLIER CODE:<br>VS5825<br>FUNCTIONAL REFERENCE:<br>COMMUNICATIONS<br>FOR DETAILS SEE<br>23-31-05-01V<br>EQUIPMENT/FURNISHINGS<br>FOR DETAILS SEE<br>25-41-60-01V<br>FIRE PROTECTION<br>FOR DETAILS SEE<br>26-14-01-01V<br>LIGHTS<br>FOR DETAILS SEE<br>33-26-03-01V<br>33-27-51-01V<br>WATER/WASTE<br>FOR DETAILS SEE<br>38-32-04-01V | 336377            | RF                   |
| 275                                                     | D72D80007-111B | .MAT-FLOR<br>SUPPLIER CODE:<br>VS5825                                                                                                                                                                                                                                                                                                                        | 336377            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |                                                                                                                                                                                                                                                                                                                                                              |                   |                      |

— ITEM NOT ILLUSTRATED

RYR

25-40-11-01V

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

25-40-11  
FIG. 01V  
PAGE 5  
OCT 15/17




**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 NOMENCLATURE                                                                         | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|----------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 1V<br>280                                               | D72W12530-111  | .OUTWALL ASSY-<br>SUPPLIER CODE:<br>VS5825<br>FOR DETAILS SEE:<br>25-41-40-01V                     | 336377            | RF                   |
| 285                                                     | D72W59245-111A | .SUB ASSY-SINK DECK<br>SUPPLIER CODE:<br>VS5825                                                    | 336377            | 1                    |
| 290                                                     | D72D71958-111  | .BLANKET-FIRE<br>SUPPLIER CODE:<br>VS5825                                                          | 336377            | 1                    |
| 295                                                     | NAS1801-06-4   | ATTACHING PARTS<br>.SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HNO6-4                                | 336377            | 9                    |
| 300                                                     | NAS1149DN616K  | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149DN616J<br>-----*-----                                  | 336377            | 9                    |
| 310                                                     | D72D74002-111  | .PANEL-FLLOOR<br>SUPPLIER CODE:<br>VS5825                                                          | 336377            | 1                    |
| 315                                                     | D72D46506-111  | .PANEL-OUTBD. LWR<br>SUPPLIER CODE:<br>VS5825                                                      | 336377            | 1                    |
| 320                                                     | D72D46507-111  | .PANEL-OUTBD. UPR<br>SUPPLIER CODE:<br>VS5825                                                      | 336377            | 1                    |
| 325                                                     | D72W52570-111A | .PANEL-SIDE WALL<br>SUPPLIER CODE:<br>VS5825                                                       | 336377            | 1                    |
| 327                                                     | D72D70451-111  | ..FRAME ASSY-<br>SUPPLIER CODE:<br>VS5825<br>MISCELLANEOUS DATA:<br>NO DECORATIVE LAMINATE<br>PART | 336377            | 1                    |
| 330                                                     | D72W53544-111A | .PANEL-SINK WALL<br>SUPPLIER CODE:<br>VS5825                                                       | 336377            | 1                    |
| 335                                                     | D72W54507-111D | .PANEL-DOOR WALL<br>SUPPLIER CODE:<br>VS5825                                                       | 336377            | 1                    |
| 340                                                     | D72W56536-111A | .PANEL-LINING<br>SUPPLIER CODE:<br>VS5825                                                          | 336377            | 1                    |
| 345                                                     | D72D72504-111  | ..CUSHION ASSY-RUBBER<br>SUPPLIER CODE:<br>VS5825                                                  | 336377            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |                                                                                                    |                   |                      |

— ITEM NOT ILLUSTRATED

RYR

25-40-11-01V

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-11  
 FIG. 01V  
 PAGE 6  
 APR 15/23


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 | NOMENCLATURE                                                       | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|---------------|--------------------------------------------------------------------|-------------------|----------------------|
| 1V                                                      |                |               |                                                                    |                   |                      |
| 350                                                     | D72D72375-111  | ...           | CUSHION-<br>SUPPLIER CODE:<br>VS5825                               | 336377            | 1                    |
| 355                                                     | D72D72287-111  | ...           | MAGNET-<br>SUPPLIER CODE:<br>VS5825                                | 336377            | 1                    |
| 360                                                     | D72W57003-111B | .             | PANEL-HEADER<br>SUPPLIER CODE:<br>VS5825                           | 336377            | 1                    |
| 365                                                     | D72W59260-111A | .             | PANEL-DISP. CABINET<br>SUPPLIER CODE:<br>VS5825                    | 336377            | 1                    |
| 370                                                     | D72D70435-111B | .             | PAN-FLOOR<br>SUPPLIER CODE:<br>VS5825                              | 336377            | 1                    |
| 375                                                     | NAS514P1032-6P | .             | ATTACHING PARTS<br>SCREW<br>-----*-----                            | 336377            | 4                    |
| 380                                                     | D72D70438-111B | .             | COVER-FLOOR<br>SUPPLIER CODE:<br>VS5825                            | 336377            | 1                    |
| 385                                                     | NAS1801-08-7   | .             | ATTACHING PARTS<br>SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN08-7 | 336377            | 2                    |
| 390                                                     | NAS1149DN816K  | .             | WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149DN816J<br>-----*-----   | 336377            | 2                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |               |                                                                    |                   |                      |

— ITEM NOT ILLUSTRATED


R Y R

25-40-11-01V

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-11  
 FIG. 01V  
 PAGE 7  
 APR 15/23

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

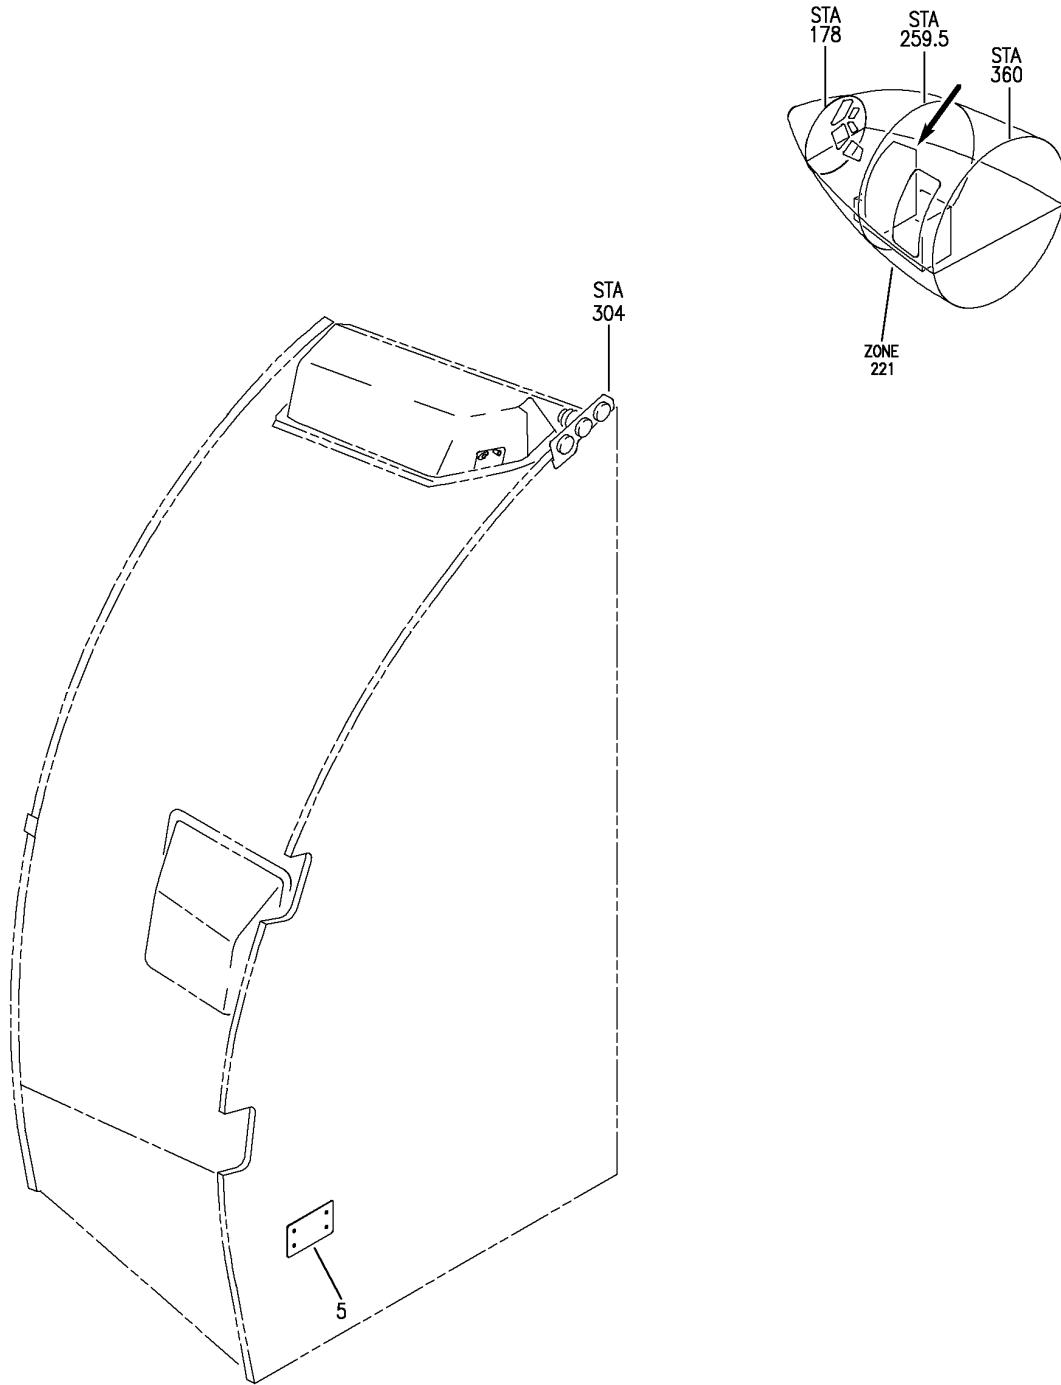

E 25401103 REV 199

LAVATORY INSTL-STRIKE PLATE, LAV A  
FIGURE 3

**25-40-11-03**

RJR  
JUN 15/14

25-40-11-03  
PAGE 0

ECCN 9E991 BOEING PROPRIETARY – See title page for details.


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 | NOMENCLATURE                                                        | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|---------------|---------------------------------------------------------------------|-------------------|----------------------|
| 3                                                       |                |               | LAVATORY INSTL-STRIKE<br>PLATE, LAV A                               | 349416            |                      |
| - 1                                                     | MODREF576530   |               | LAVATORY INSTL-STRIKE PLATE<br>MODULE NUMBER:<br>417A1158-163 REV A | 349416            | RF                   |
| 5                                                       | 417A1150-1     |               | .PLATE                                                              | 349416            | 1                    |
| - 10                                                    | BACS12ER06K6BE |               | .ATTACHING PARTS<br>.SCREW<br>-----*-----                           | 349416            | 4                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |               |                                                                     |                   |                      |

— ITEM NOT ILLUSTRATED


RYR

25-40-11-03

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

25-40-11  
 FIG. 03  
 PAGE 1  
 JUN 15/16

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

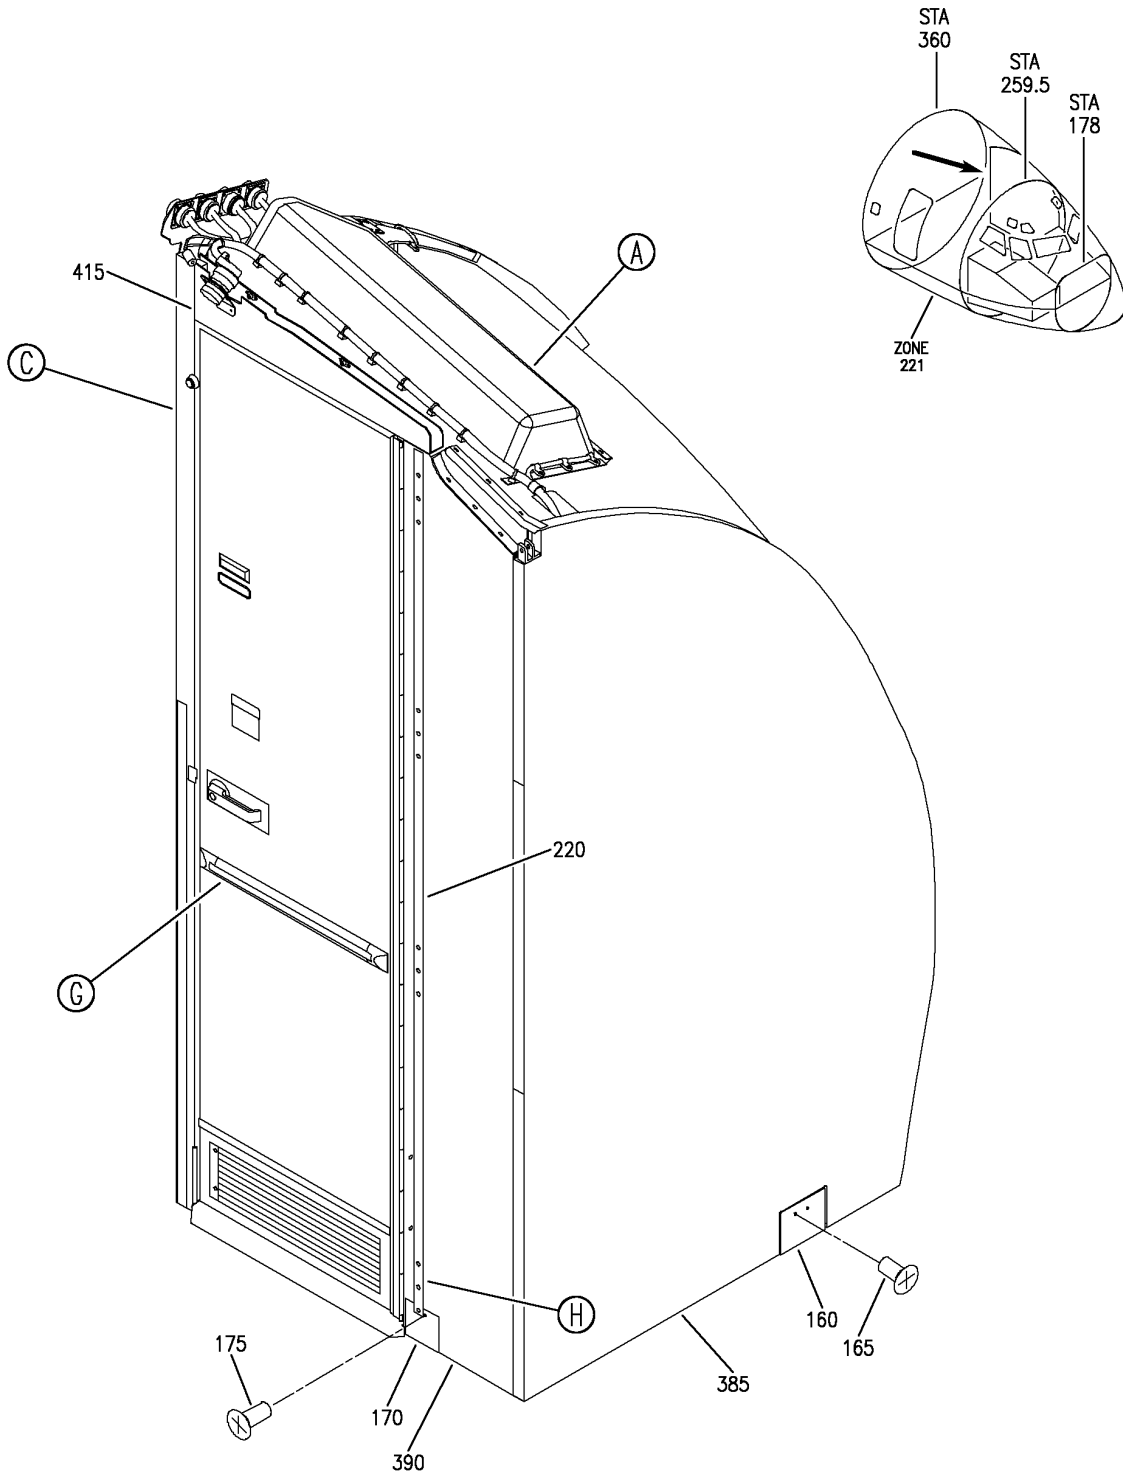

E 25401110D SHT 1 REV 191

MODULE ASSY-LAV A (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 10D (SHEET 1)


**25-40-11-10D**

R/YR  
AUG 15/19

25-40-11-10D  
PAGE 0

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

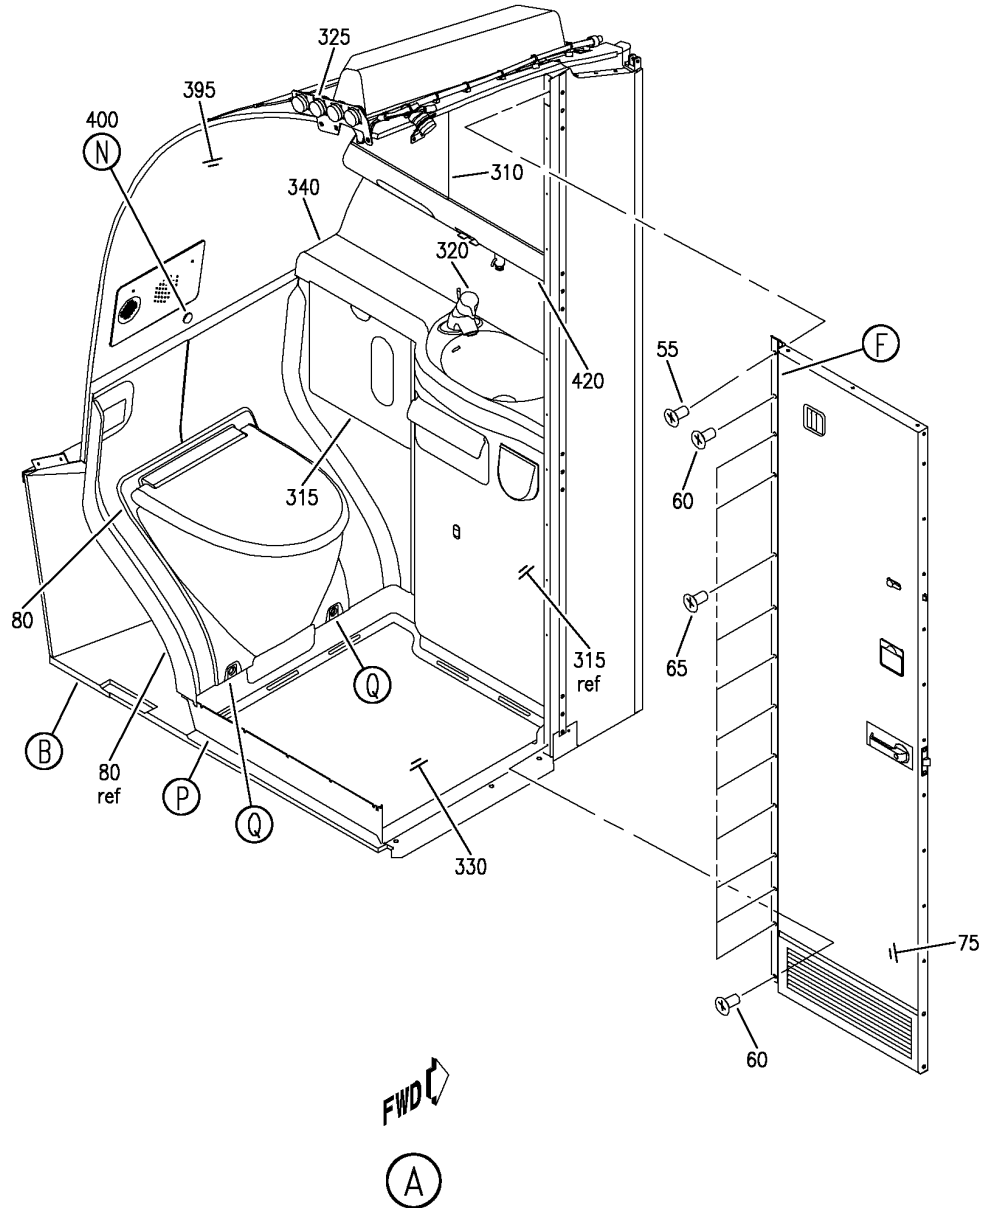

E 25401110D SHT 2 REV 233

MODULE ASSY-LAV A (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 10D (SHEET 2)


**25-40-11-10D**

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

R/YR  
AUG 15/19

25-40-11-10D  
PAGE 0A

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

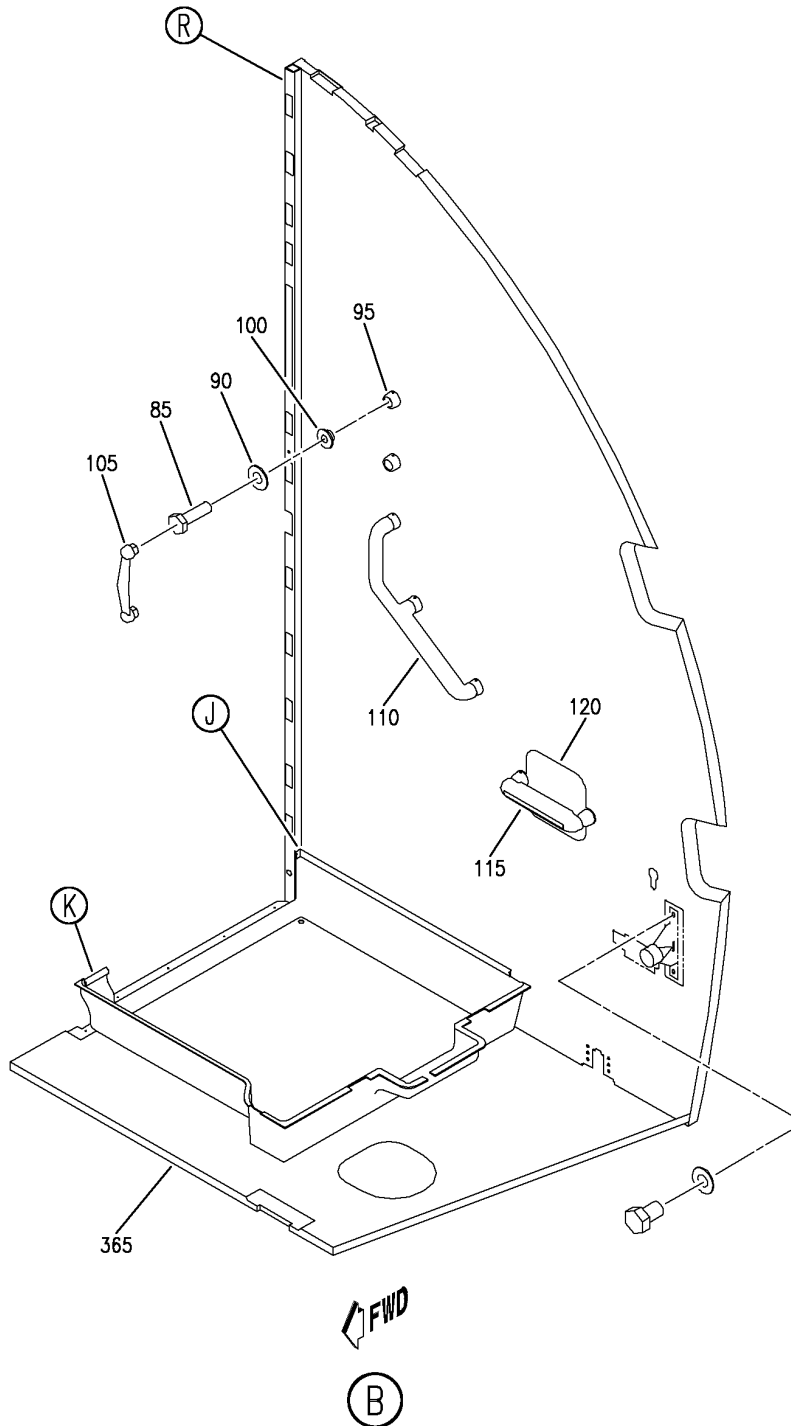

E 25401110D SHT 3 REV 339

MODULE ASSY-LAV A (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 10D (SHEET 3)


**25-40-11-10D**

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

R/YR  
OCT 15/24

25-40-11-10D  
PAGE 0B

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

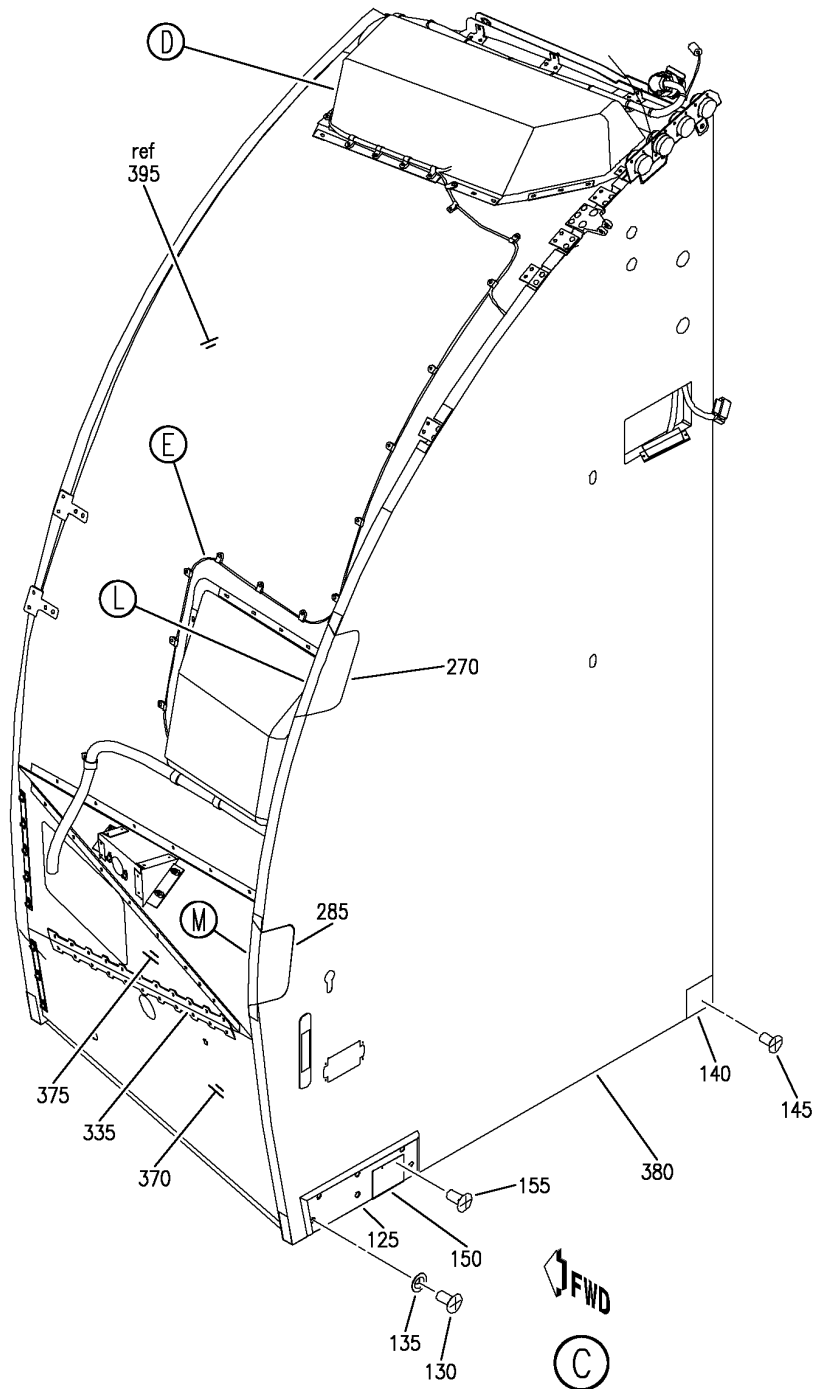

E 25401110D SHT 4 REV 191

MODULE ASSY-LAV A (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 10D (SHEET 4)

**25-40-11-10D**


ECCN 9E991 BOEING PROPRIETARY – See title page for details.

R/YR  
AUG 15/19

25-40-11-10D  
PAGE 0C



**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

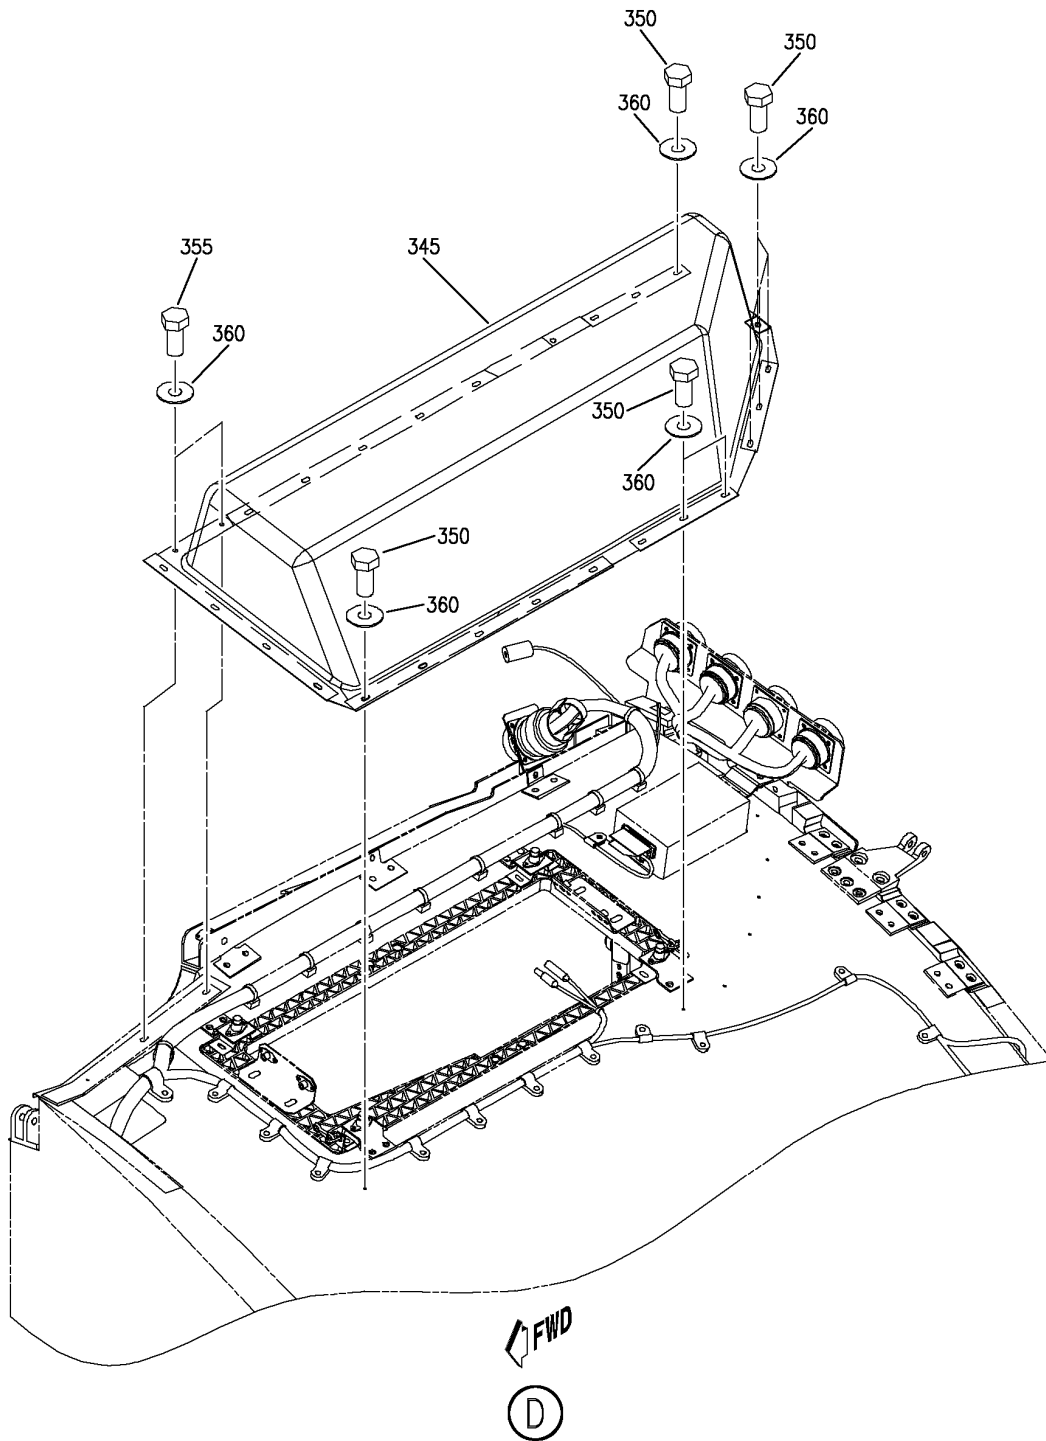

E 25401110D SHT 5 REV 191

MODULE ASSY-LAV A (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 10D (SHEET 5)


**25-40-11-10D**

R/YR  
AUG 15/19

25-40-11-10D  
PAGE 0D

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

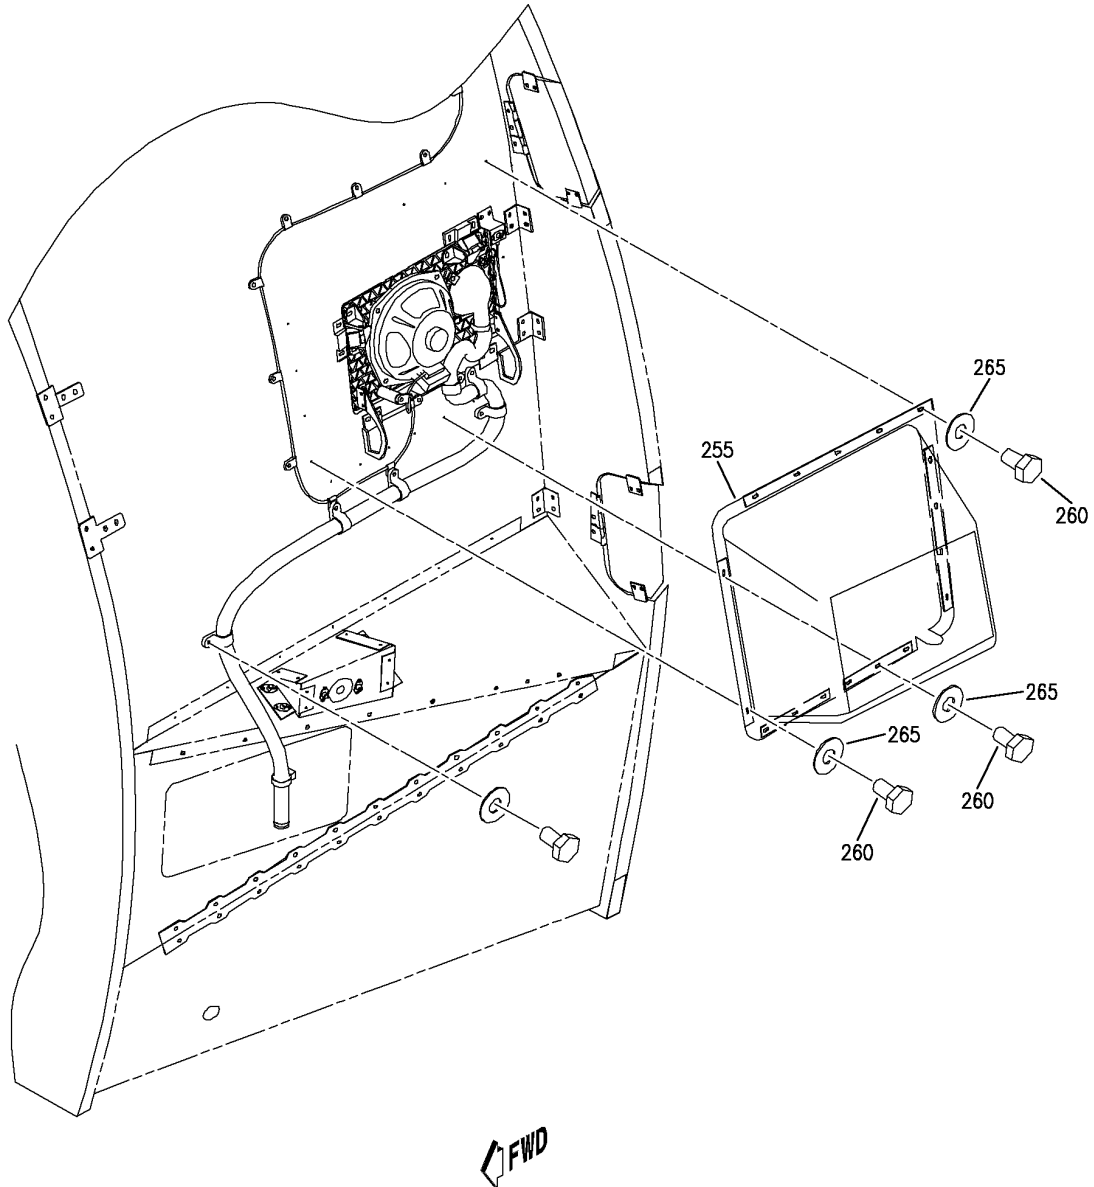

(E)

MODULE ASSY-LAV A (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 10D (SHEET 6)

**25-40-11-10D**






ECCN 9E991 BOEING PROPRIETARY – See title page for details.

RJR  
AUG 15/19

25-40-11-10D  
PAGE 0E

E 25401110D SHT 6 REV 191

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

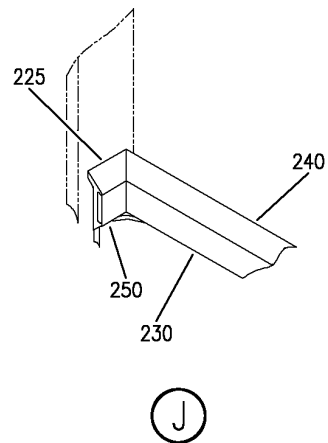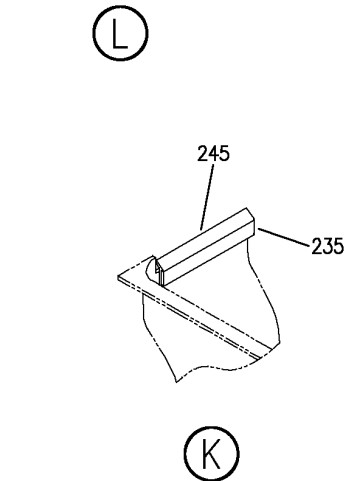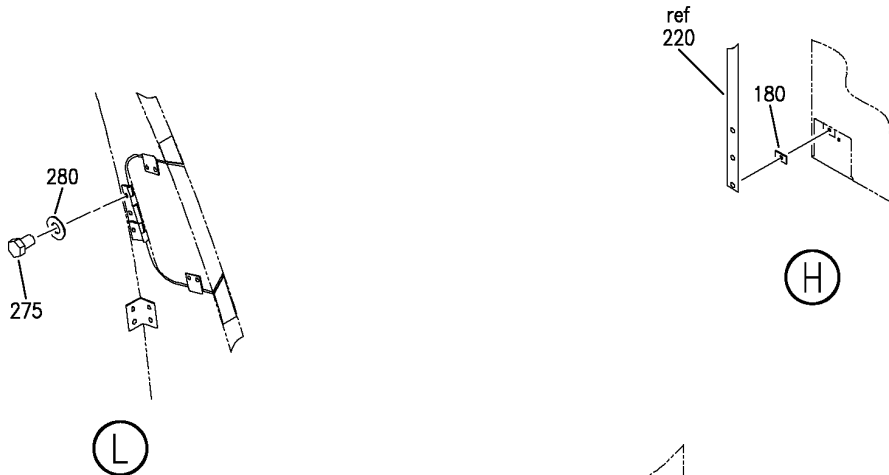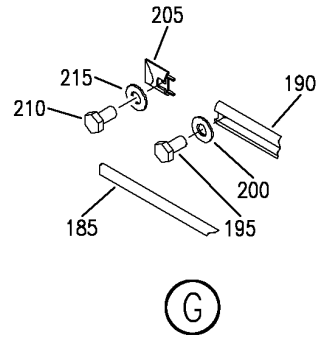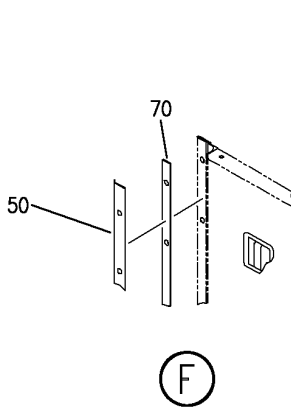

E 25401110D SHT 7 REV 191

MODULE ASSY-LAV A (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 10D (SHEET 7)


**25-40-11-10D**

R Y R  
AUG 15/19

25-40-11-10D  
PAGE OF

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

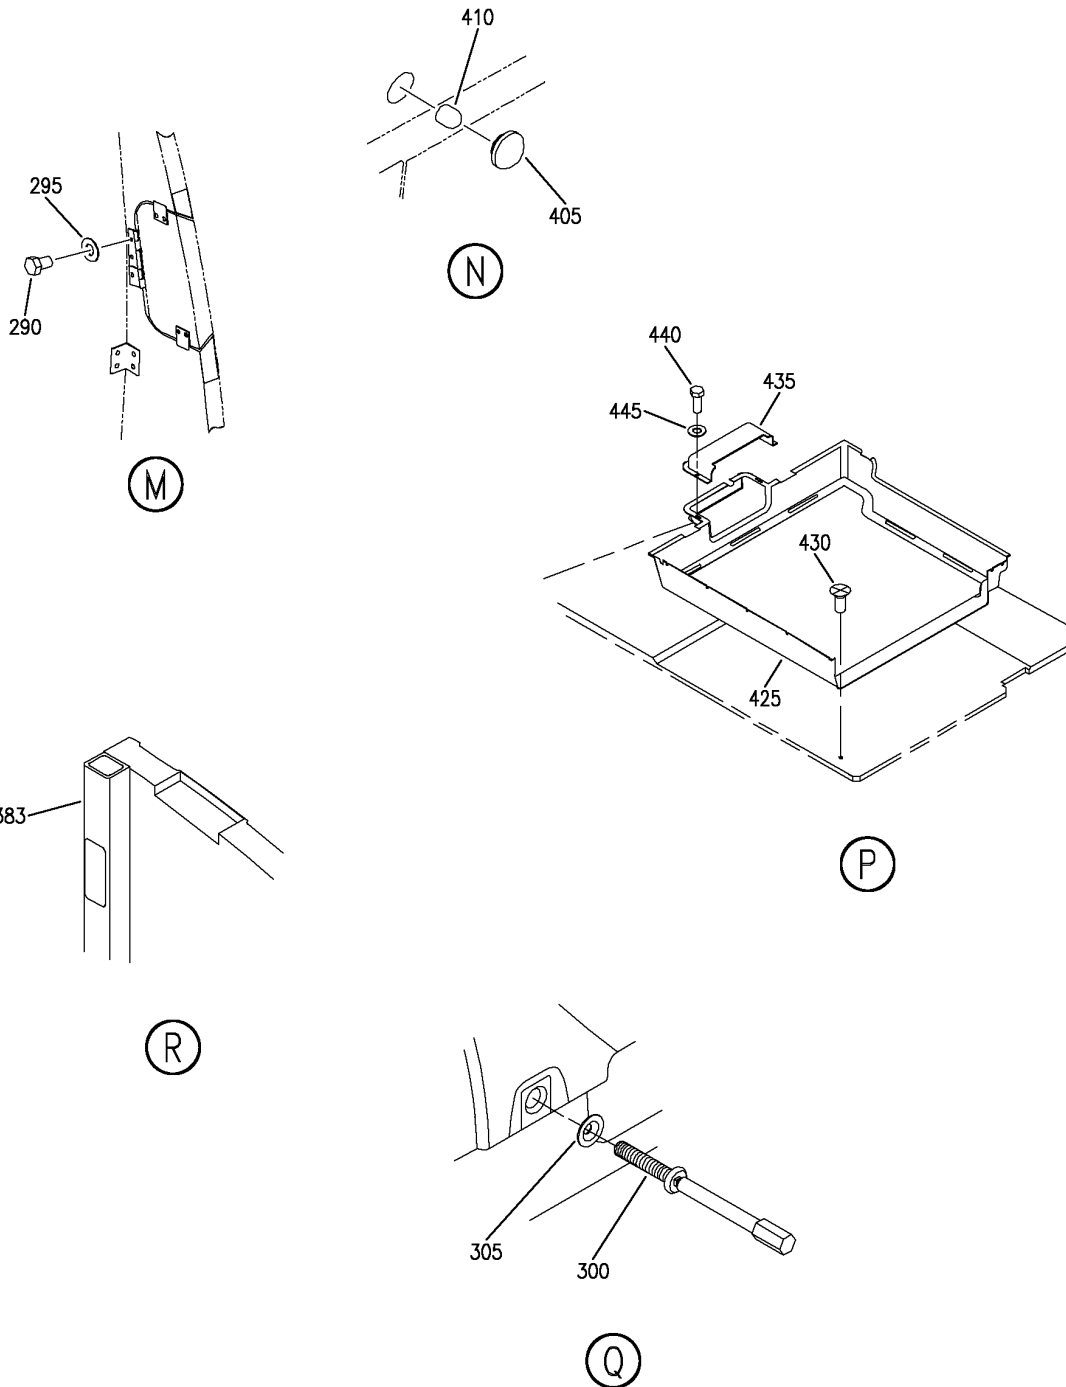

E 25401110D SHT 8 REV 339

MODULE ASSY-LAV A (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 10D (SHEET 8)

**25-40-11-10D**

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

R Y R  
O C T 15 / 24

25-40-11-10D  
PAGE 0G


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 | NOMENCLATURE                                                                                                                                                                                                                                                                                             | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|---------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 10D                                                     |                |               | MODULE ASSY-LAV A<br>(EQUIPMENT/FURNISHINGS<br>ONLY)                                                                                                                                                                                                                                                     | 378416            |                      |
| - 1                                                     | D72004165-111C |               | MODULE ASSY-LAV A<br>(EQUIPMENT/FURNISHINGS<br>ONLY)<br>SUPPLIER CODE:<br>VJ4577<br>FUNCTIONAL DESCRIPTION:<br>PROVIDES A RESTROOM<br>FACILITY FOR PASSENGERS<br>AND CREW.<br>ELECTRICAL EQUIP NUMBER:<br>M01415<br>COMPONENT MAINT MANUAL REF:<br>25-48-63<br>FOR NHA/OTHER SYS DET SEE:<br>25-40-11-01 | 378416            | RF                   |
| 50                                                      | D72D70987-111  |               | .RETAINER-SEAL RUBBER<br>SUPPLIER CODE:<br>VS5825<br>ATTACHING PARTS                                                                                                                                                                                                                                     | 378416            | 1                    |
| 55                                                      | NAS514P1032-12 |               | .SCREW                                                                                                                                                                                                                                                                                                   | 378416            | 1                    |
| 60                                                      | NAS514P1032-8  |               | .SCREW                                                                                                                                                                                                                                                                                                   | 378416            | 2                    |
| 65                                                      | NAS514P1032-10 |               | .SCREW                                                                                                                                                                                                                                                                                                   | 378416            | 11                   |
|                                                         |                |               | -----*-----                                                                                                                                                                                                                                                                                              |                   |                      |
| 70                                                      | D72D70988-111  |               | .SEAL-RUBBER<br>SUPPLIER CODE:<br>VS5825                                                                                                                                                                                                                                                                 | 378416            | 1                    |
| 75                                                      | D72W13510-111E |               | .DOOR ASSY-SLAB<br>SUPPLIER CODE:<br>VS5825<br>FOR DETAILS SEE:<br>25-41-13-16B                                                                                                                                                                                                                          | 378416            | 1                    |
| 80                                                      | D72W15502-111  |               | .TOILET AND FLOOR PAN ASSY-<br>SUPPLIER CODE:<br>VS5825<br>MISCELLANEOUS DATA:<br>NON PROCURABLE<br>FOR DETAILS SEE:<br>25-41-21-19M                                                                                                                                                                     | 378416            | RF                   |
| 85                                                      | NAS1801-3-10   |               | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-10                                                                                                                                                                                                                                                         | 378416            | 7                    |
| 90                                                      | NAS1149D0332K  |               | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0332J                                                                                                                                                                                                                                                       | 378416            | 7                    |
| 95                                                      | 65-5458-21N    |               | .NUT                                                                                                                                                                                                                                                                                                     | 378416            | 7                    |
| 100                                                     | 66-4302-1      |               | .COLLAR                                                                                                                                                                                                                                                                                                  | 378416            | 7                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |               |                                                                                                                                                                                                                                                                                                          |                   |                      |

- ITEM NOT ILLUSTRATED

RYR

25-40-11-10D

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-11  
FIG. 10D  
PAGE 1  
OCT 15/24


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7<br>NOMENCLATURE                                                      | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|------------------------------------------------------------------------------------|-------------------|----------------------|
| 10D                                                     |                |                                                                                    |                   |                      |
| 105                                                     | 65-5458-20N    | .HANDLE                                                                            | 378416            | 1                    |
| 110                                                     | 65C22388-13    | .HANDLE                                                                            | 378416            | 1                    |
| 115                                                     | 69-72416-5     | .HANDLE-ASSIST<br>SUPPLIER CODE:<br>V26835                                         | 378416            | 1                    |
| 120                                                     | D75D70952-163  | .PAN-<br>SUPPLIER CODE:<br>VS5825                                                  | 378416            | 1                    |
| 125                                                     | D72D80019-111G | .KICKSTRIP-<br>SUPPLIER CODE:<br>VS5825<br>ATTACHING PARTS                         | 378416            | 1                    |
| 130                                                     | NAS514P1032-6P | .SCREW                                                                             | 378416            | 6                    |
| 135                                                     | NAS1169DD10    | .WASHER<br>-----*-----                                                             | 378416            | 6                    |
| 140                                                     | D72D70833-111A | .PLATE-COVER<br>SUPPLIER CODE:<br>VS5825<br>ATTACHING PARTS                        | 378416            | 1                    |
| 145                                                     | NAS514P632-4   | .SCREW<br>-----*-----                                                              | 378416            | 2                    |
| 150                                                     | D72D70943-111A | .PLATE-COVER<br>SUPPLIER CODE:<br>VS5825<br>ATTACHING PARTS                        | 378416            | 1                    |
| 155                                                     | NAS514P632-4   | .SCREW<br>-----*-----                                                              | 378416            | 2                    |
| 160                                                     | D72D70943-111B | .PLATE-COVER<br>SUPPLIER CODE:<br>VS5825<br>ATTACHING PARTS                        | 378416            | 1                    |
| 165                                                     | NAS514P632-4   | .SCREW<br>-----*-----                                                              | 378416            | 2                    |
| 170                                                     | D72D70944-111A | .PLATE-COVER<br>SUPPLIER CODE:<br>VS5825<br>ATTACHING PARTS                        | 378416            | 1                    |
| 175                                                     | NAS514P632-4   | .SCREW<br>-----*-----                                                              | 378416            | 1                    |
| 180                                                     | D72D71550-111  | .SPACER-<br>SUPPLIER CODE:<br>VS5825                                               | 378416            | 1                    |
| 185                                                     | D72D80025-911A | .RUBSTRIP-<br>SUPPLIER CODE:<br>VS5825<br>MISCELLANEOUS DATA:<br>BAC1522-547-70229 | 378416            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |                                                                                    |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R

25-40-11-10D

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-11  
 FIG. 10D  
 PAGE 2  
 OCT 15/24


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 NOMENCLATURE                                        | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|-------------------------------------------------------------------|-------------------|----------------------|
| 10D<br>190                                              | D72D80024-111B | .RETAINER-RUBSTRIP<br>SUPPLIER CODE:<br>VS5825<br>ATTACHING PARTS | 378416            | 1                    |
| 195                                                     | NAS1801-08-5   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN08-5                  | 378416            | 3                    |
| 200                                                     | NAS1149DN832K  | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149DN832J<br>-----*----- | 378416            | 3                    |
| 205                                                     | 432W7101-6J    | .ENDCAP<br>ATTACHING PARTS                                        | 378416            | 2                    |
| 210                                                     | NAS1801-08-5   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN08-5                  | 378416            | 2                    |
| 215                                                     | NAS1149DN832K  | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149DN832J<br>-----*----- | 378416            | 2                    |
| 220                                                     | D72D70668-111  | .DOUBLER-FLIGHT DECK DOOR<br>SUPPLIER CODE:<br>VS5825             | 378416            | 1                    |
| 225                                                     | D72D71110-111B | .TRIM-RTNR, FLOOR PAN<br>SUPPLIER CODE:<br>VS5825                 | 378416            | 1                    |
| 230                                                     | D72D71112-916B | .TRIM-INSERT, FLOOR PAN<br>SUPPLIER CODE:<br>VS5825               | 378416            | 1                    |
| 235                                                     | D72D71112-917B | .TRIM-INSERT, FLOOR PAN<br>SUPPLIER CODE:<br>VS5825               | 378416            | 1                    |
| 240                                                     | D72D71169-111B | .TRIM-RTNR, FLOOR PAN<br>SUPPLIER CODE:<br>VS5825                 | 378416            | 1                    |
| 245                                                     | D72D71171-111B | .TRIM-RTNR, FLOOR PAN<br>SUPPLIER CODE:<br>VS5825                 | 378416            | 1                    |
| 250                                                     | D72D71112-912B | .TRIM-INSERT, FLOOR PAN<br>SUPPLIER CODE:<br>VS5825               | 378416            | 1                    |
| 255                                                     | D72D71955-111  | .BLANKET-FIRE<br>SUPPLIER CODE:<br>VS5825<br>ATTACHING PARTS      | 378416            | 1                    |
| 260                                                     | NAS1801-06-4   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN06-4                  | 378416            | 23                   |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |                                                                   |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R

25-40-11-10D

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-11  
FIG. 10D  
PAGE 3  
OCT 15/24


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER                    | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                                              | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|--------------------------------|-----------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 10D<br>265                                              | NAS1149DN616K                  | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149DN616J<br>-----*-----                                                                       | 378416            | 23                   |
| 270                                                     | D72W30049-111A                 | .DOOR ASSY-FLAP<br>SUPPLIER CODE:<br>VS5825<br>ATTACHING PARTS                                                                          | 378416            | 1                    |
| 275                                                     | NAS1801-08-5                   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN08-5                                                                                        | 378416            | 3                    |
| 280                                                     | NAS1149DN816K                  | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149DN816J<br>-----*-----                                                                       | 378416            | 3                    |
| 285                                                     | D72W30050-111A                 | .DOOR ASSY-FLAP<br>SUPPLIER CODE:<br>VS5825<br>ATTACHING PARTS                                                                          | 378416            | 1                    |
| 290                                                     | NAS1801-08-5                   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN08-5                                                                                        | 378416            | 3                    |
| 295                                                     | NAS1149DN816K                  | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149DN816J<br>-----*-----                                                                       | 378416            | 3                    |
| 300                                                     | D72D72683-111                  | .SCREW-TAMPER PROOF<br>SUPPLIER CODE:<br>VS5825<br>CONFIG CHG DATA FROM A CMM:<br>SUPSD BY D72D72683-913                                | 378416            | 2                    |
| 300                                                     | D72D72683-913                  | .SCREW-TAMPER PROOF<br>SUPPLIER CODE:<br>VS5825<br>CONFIG CHG DATA FROM A CMM:<br>SUPERSEDES<br>D72D72683-111                           | 378416            | 2                    |
| 305<br>310                                              | NAS1149C0332R<br>D72W16523-111 | .WASHER<br>.DISPENSER ASSY-UPR<br>SUPPLIER CODE:<br>VS5825<br>MISCELLANEOUS DATA:<br>NON PROCURABLE<br>FOR DETAILS SEE:<br>25-41-51-19Q | 378416<br>378416  | 2<br>RF              |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                                |                                                                                                                                         |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R

25-40-11-10D

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-11  
 FIG. 10D  
 PAGE 4  
 OCT 15/24




**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER   | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                                                                                                                                                                                                                                                                                                            | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|---------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 10D<br>315                                              | D72W17506-111 | .DISPENSER ASSY-LWR<br>SUPPLIER CODE:<br>VS5825<br>MISCELLANEOUS DATA:<br>NON PROCURABLE<br>FUNCTIONAL REFERENCE:<br>EQUIPMENT/FURNISHINGS<br>FOR DETAILS SEE<br>25-41-51-19R<br>FIRE PROTECTION<br>FOR DETAILS SEE<br>26-24-01-19M                                                                                                                                                                   | 378416            | RF                   |
| 320                                                     | D72W26512-111 | .PLUMBING ASSY-<br>SUPPLIER CODE:<br>VS5825<br>MISCELLANEOUS DATA:<br>NON PROCURABLE<br>FUNCTIONAL REFERENCE:<br>AIR CONDITIONING<br>FOR DETAILS SEE<br>21-24-51-19R<br>WATER/WASTE<br>FOR DETAILS SEE<br>38-11-05-19M<br>38-11-06-70F<br>38-11-51-19M<br>38-13-01-19M                                                                                                                                | 378416            | RF                   |
| 325                                                     | D72W27603-111 | .ELECTRICAL ASSY-<br>SUPPLIER CODE:<br>VS5825<br>MISCELLANEOUS DATA:<br>NON PROCURABLE<br>FUNCTIONAL REFERENCE:<br>COMMUNICATIONS<br>FOR DETAILS SEE<br>23-31-05-19M<br>EQUIPMENT/FURNISHINGS<br>FOR DETAILS SEE<br>25-41-60-19M<br>FIRE PROTECTION<br>FOR DETAILS SEE<br>26-14-01-19M<br>LIGHTS<br>FOR DETAILS SEE<br>33-26-03-19R<br>33-27-51-19M<br>WATER/WASTE<br>FOR DETAILS SEE<br>38-32-04-19M | 378416            | RF                   |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |               |                                                                                                                                                                                                                                                                                                                                                                                                       |                   |                      |

— ITEM NOT ILLUSTRATED

RYR

25-40-11-10D

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

25-40-11  
 FIG. 10D  
 PAGE 5  
 OCT 15/24


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                              | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|-------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 10D                                                     |                |                                                                                                                         |                   |                      |
| 330                                                     | D72D80007-111B | .MAT-FLOOR<br>SUPPLIER CODE:<br>VS5825                                                                                  | 378416            | 1                    |
| 335                                                     | D72W12530-111  | .OUTWALL ASSY-<br>SUPPLIER CODE:<br>VS5825<br>MISCELLANEOUS DATA:<br>NON PROCURABLE<br>FOR DETAILS SEE:<br>25-41-40-19M | 378416            | RF                   |
| 340                                                     | D72W59245-111A | .SUB ASSY-SINK DECK<br>SUPPLIER CODE:<br>VS5825                                                                         | 378416            | 1                    |
| 345                                                     | D72D71958-111  | .BLANKET-FIRE<br>SUPPLIER CODE:<br>VS5825<br>ATTACHING PARTS                                                            | 378416            | 1                    |
| 350                                                     | NAS1801-06-4   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN06-4                                                                        | 378416            | 7                    |
| 355                                                     | NAS1801-06-4   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN06-4                                                                        | 378416            | 2                    |
| 360                                                     | NAS1149DN616K  | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149DN616J<br>-----*-----                                                       | 378416            | 9                    |
| 365                                                     | D72D41002-111  | .PANEL-FLLOOR<br>SUPPLIER CODE:<br>VS5825                                                                               | 378416            | 1                    |
| 370                                                     | D72D46506-111  | .PANEL-OUTBD, LWR<br>SUPPLIER CODE:<br>VS5825                                                                           | 378416            | 1                    |
| 375                                                     | D72D46507-111  | .PANEL-OUTBD, UPR<br>SUPPLIER CODE:<br>VS5825                                                                           | 378416            | 1                    |
| 380                                                     | D72W52684-111D | .PANEL-SIDE WALL<br>SUPPLIER CODE:<br>VS5825                                                                            | 378416            | 1                    |
| 383                                                     | D72D70451-111  | ..FRAME ASSY-<br>SUPPLIER CODE:<br>VS5825<br>MISCELLANEOUS DATA:<br>NO DECORATIVE LAMINATE<br>PART                      | 378416            | 1                    |
| 385                                                     | D72W53544-111A | .PANEL-SINK WALL<br>SUPPLIER CODE:<br>VS5825                                                                            | 378416            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |                                                                                                                         |                   |                      |

— ITEM NOT ILLUSTRATED

RYR

25-40-11-10D

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-11  
FIG. 10D  
PAGE 6  
OCT 15/24


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 NOMENCLATURE                                          | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|---------------------------------------------------------------------|-------------------|----------------------|
| 10D                                                     |                |                                                                     |                   |                      |
| 390                                                     | D72W54507-111D | .PANEL-DOOR WALL<br>SUPPLIER CODE:<br>VS5825                        | 378416            | 1                    |
| 395                                                     | D72W56536-111A | .PANEL-LINING<br>SUPPLIER CODE:<br>VS5825                           | 378416            | 1                    |
| 400                                                     | D72D72504-111  | ..CUSHION ASSY-RUBBER<br>SUPPLIER CODE:<br>VS5825                   | 378416            | 1                    |
| 405                                                     | D72D72375-111  | ...CUSHION-LID<br>SUPPLIER CODE:<br>VS5825                          | 378416            | 1                    |
| 410                                                     | D72D72287-111  | ...MAGNET-<br>SUPPLIER CODE:<br>VS5825                              | 378416            | 1                    |
| 415                                                     | D72W57003-111B | .PANEL-HEADER<br>SUPPLIER CODE:<br>VS5825                           | 378416            | 1                    |
| 420                                                     | D72W59260-111A | .PANEL-DISP CABINET<br>SUPPLIER CODE:<br>VS5825                     | 378416            | 1                    |
| 425                                                     | D72D70435-111B | .PAN-FLLOOR<br>SUPPLIER CODE:<br>VS5825                             | 378416            | 1                    |
| 430                                                     | NAS514P1032-6P | ATTACHING PARTS<br>.SCREW<br>-----*-----                            | 378416            | 4                    |
| 435                                                     | D72D70438-111B | .COVER-FLLOOR PAN<br>SUPPLIER CODE:<br>VS5825                       | 378416            | 1                    |
| 440                                                     | NAS1801-08-7   | ATTACHING PARTS<br>.SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN08-7 | 378416            | 2                    |
| 445                                                     | NAS1149DN816K  | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149DN816J<br>-----*-----   | 378416            | 2                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |                                                                     |                   |                      |

— ITEM NOT ILLUSTRATED


R Y R

25-40-11-10D

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

25-40-11  
FIG. 10D  
PAGE 7  
OCT 15/24

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

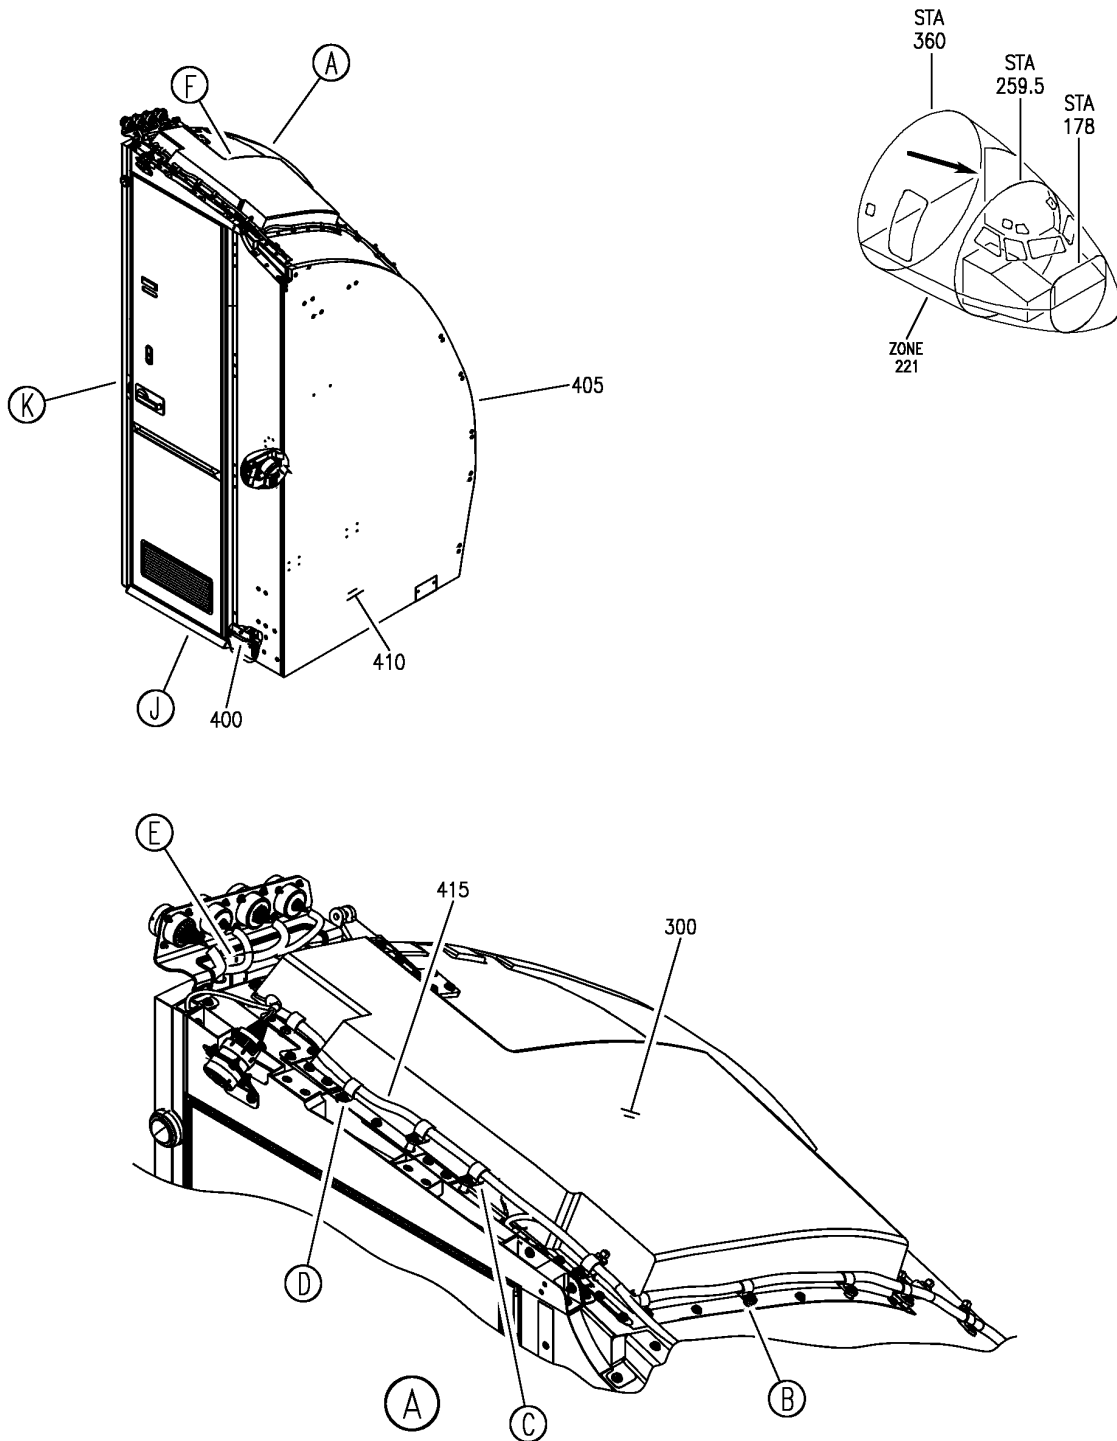

E 2540111H SHT 1 REV 255

MODULE ASSY-LAV A (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 11H (SHEET 1)


**25-40-11-11H**

RJR  
OCT 15/17


25-40-11-11H  
PAGE 0

ECCN 9E991 BOEING PROPRIETARY – See title page for details.


**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

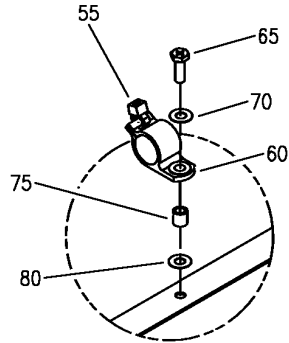


(B)

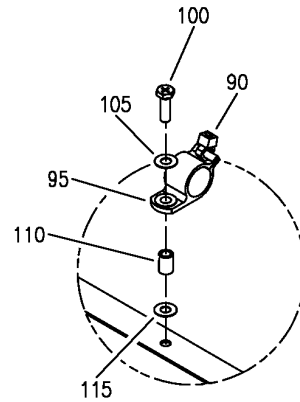

(C)

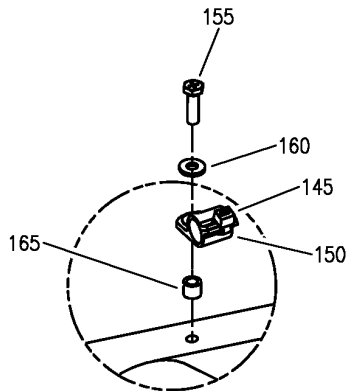

(E)

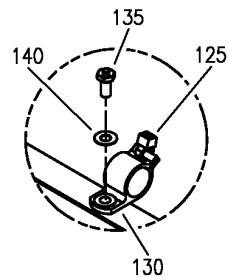

(D)

E 2540111H SHT 2 REV 255

MODULE ASSY-LAV A (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 11H (SHEET 2)


**25-40-11-11H**

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

R/YR  
OCT 15/17

25-40-11-11H  
PAGE 0A

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

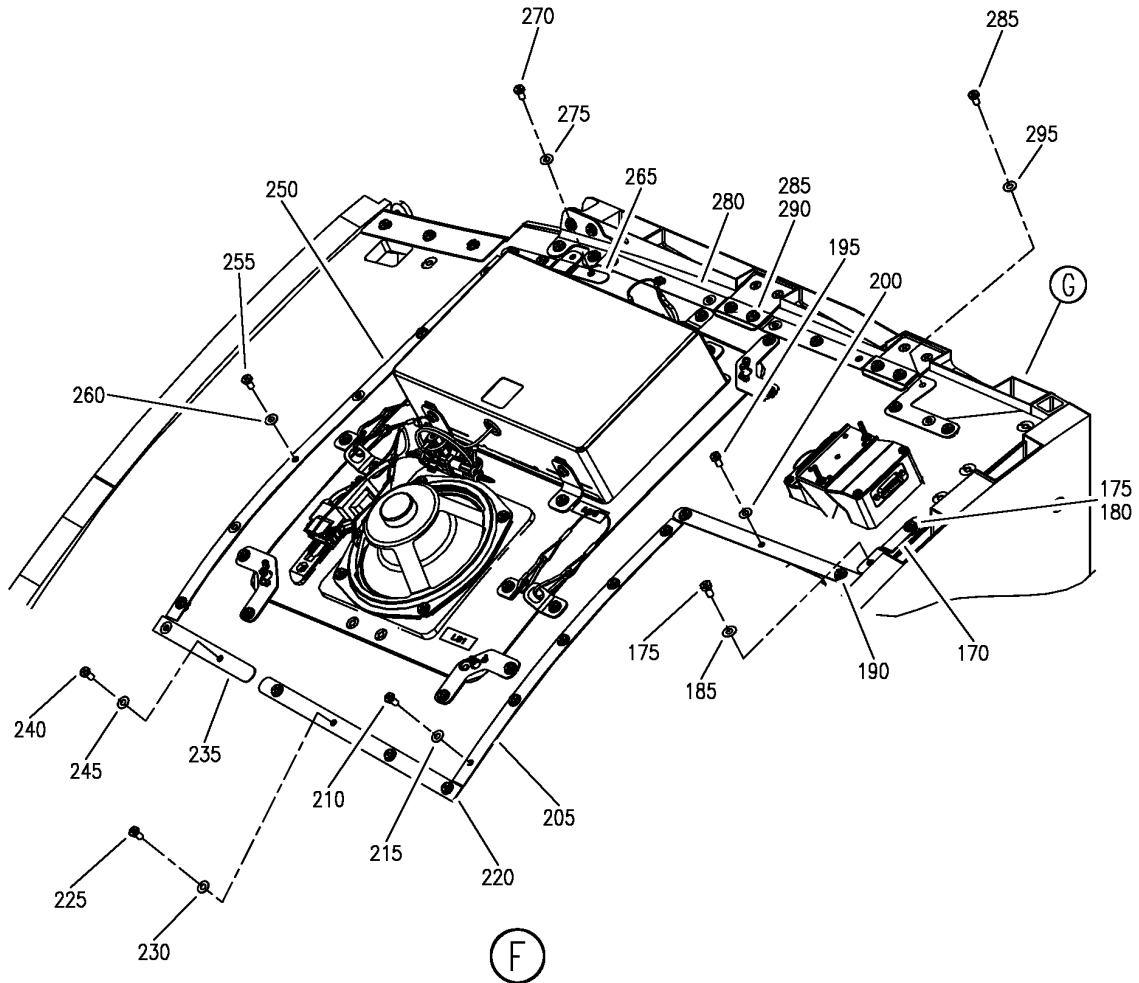

E 2540111H SHT 3 REV 255

MODULE ASSY-LAV A (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 11H (SHEET 3)




**25-40-11-11H**

R Y R  
O C T 15 / 17

25-40-11-11H  
PAGE 0B

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

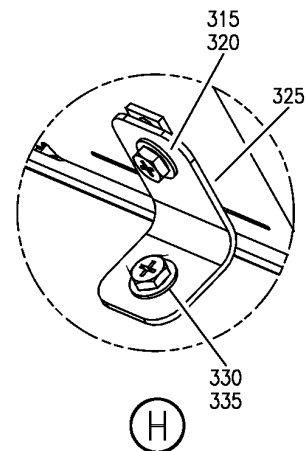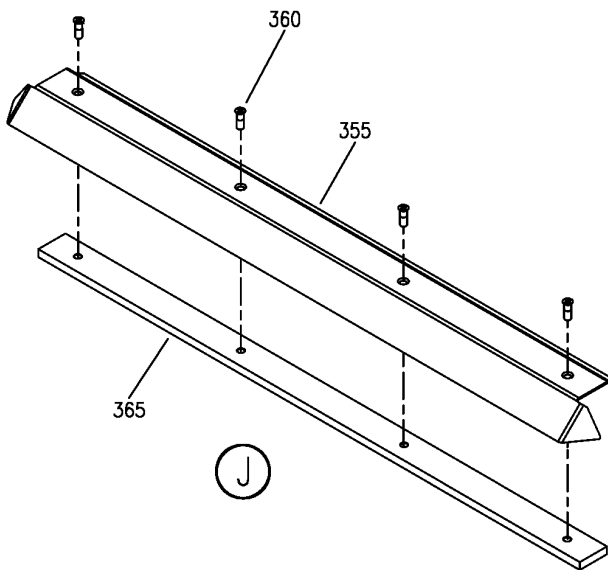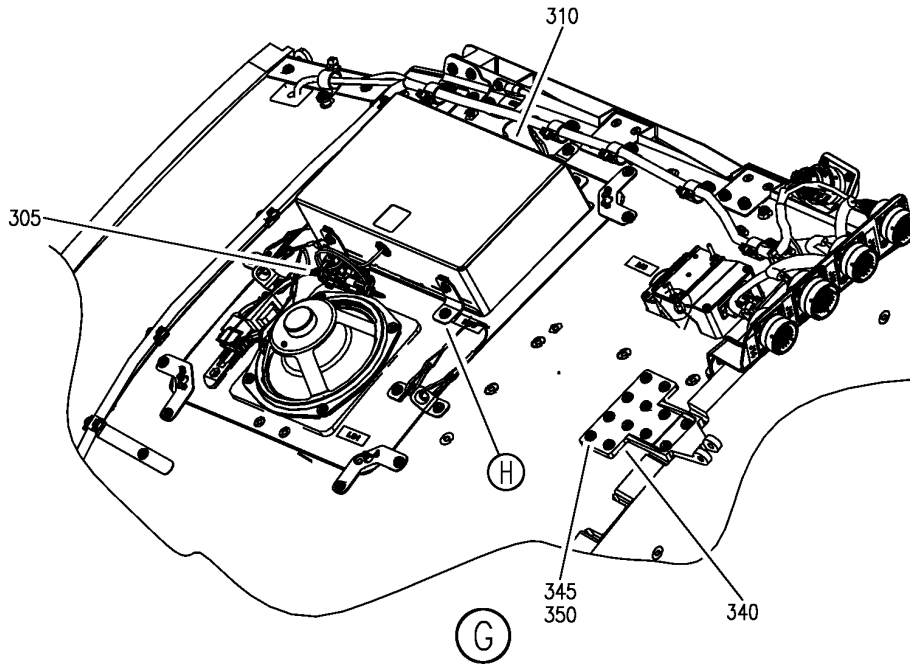

E 2540111H SHT 4 REV 255

MODULE ASSY-LAV A (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 11H (SHEET 4)


**25-40-11-11H**

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

R Y R  
O C T 15 / 17

25-40-11-11H  
PAGE 0C

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

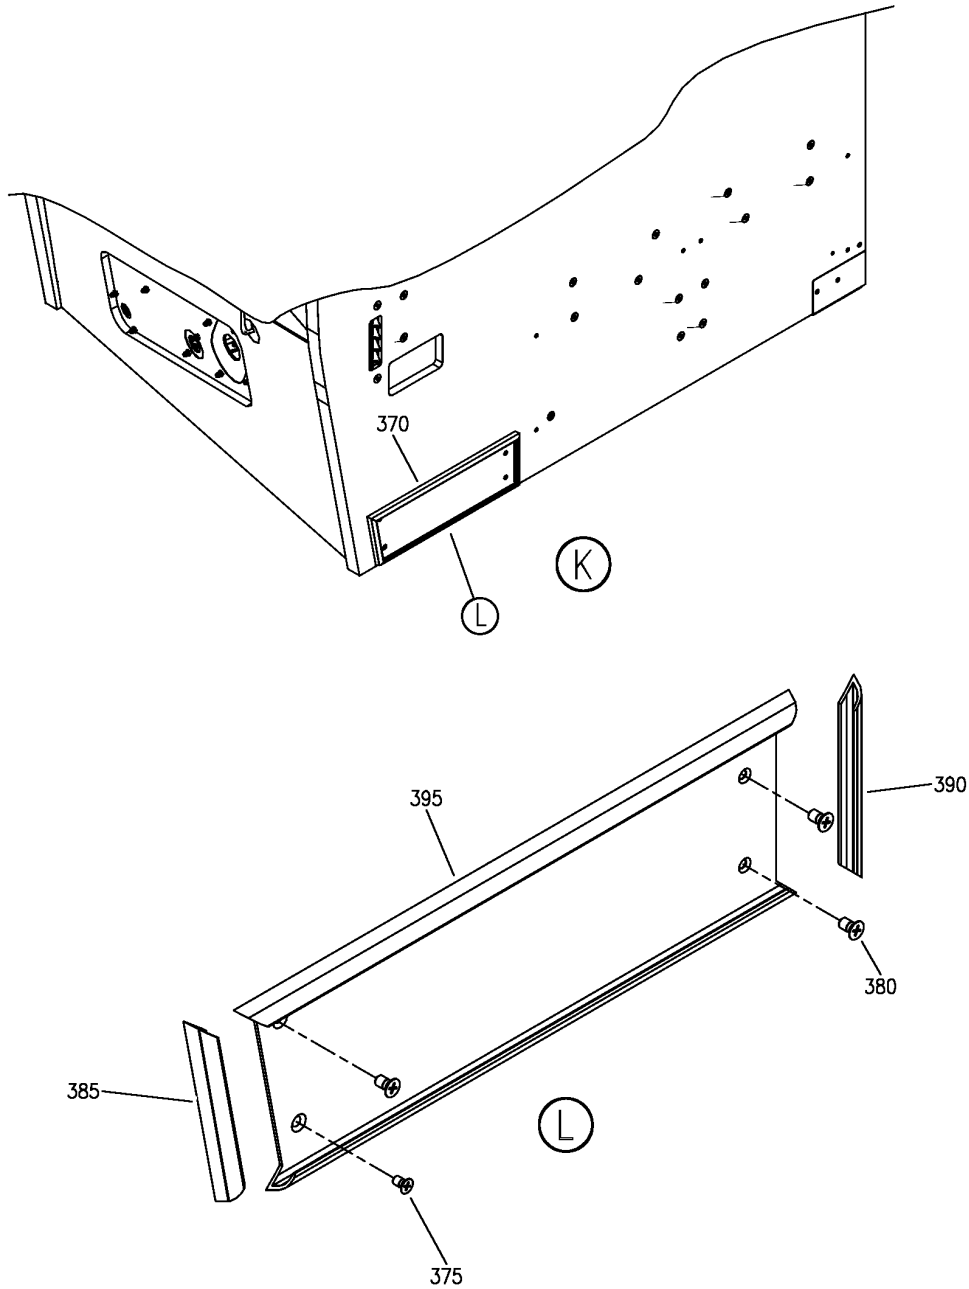

E 2540111H SHT 5 REV 255

MODULE ASSY-LAV A (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 11H (SHEET 5)

**25-40-11-11H**

RJR  
OCT 15/17

25-40-11-11H  
PAGE 0D

ECCN 9E991 BOEING PROPRIETARY – See title page for details.




**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 | NOMENCLATURE                                                                                                                                                                                                                                                                                              | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|---------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 11H                                                     |                |               | MODULE ASSY-LAV A<br>(EQUIPMENT/FURNISHINGS<br>ONLY)                                                                                                                                                                                                                                                      | 476508            |                      |
| - 1                                                     | 1L300010-0081A |               | MODULE ASSY-LAV A<br>(EQUIPMENT/FURNISHINGS<br>ONLY)<br>SUPPLIER CODE:<br>V6S8D7<br>FUNCTIONAL DESCRIPTION:<br>PROVIDES LAVATORY<br>FACILITIES FOR<br>PASSENGERS AND CREW.<br>ELECTRICAL EQUIP NUMBER:<br>M01415<br>COMPONENT MAINT MANUAL REF:<br>25-40-54<br>FOR NHA/OTHER SYS DET SEE:<br>25-40-11-01B | 476508            | RF                   |
| - 50                                                    | 9L500001-107   |               | .CLAMP INSTL-ELECTRICAL<br>SUPPLIER CODE:<br>V6S8D7                                                                                                                                                                                                                                                       | 476508            | 4                    |
| 55                                                      | MS3367-5-9     |               | ..STRAP<br>STANDARD SUBSTITUTION:<br>BACS38K5                                                                                                                                                                                                                                                             | 476508            | 1                    |
| 60                                                      | CA2030-3       |               | ..CLAMP-<br>SUPPLIER CODE:<br>V03296<br>ATTACHING PARTS                                                                                                                                                                                                                                                   | 476508            | 1                    |
| 65                                                      | NAS1801-3-10   |               | ..SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-10                                                                                                                                                                                                                                                         | 476508            | 1                    |
| 70                                                      | NAS1149D0316K  |               | ..WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J                                                                                                                                                                                                                                                       | 476508            | 1                    |
| 75                                                      | NAS43DD3-16N   |               | ..SPACER<br>STANDARD SUBSTITUTION:<br>NAS43DD3-16FC<br>-----*-----                                                                                                                                                                                                                                        | 476508            | 1                    |
| 80                                                      | NAS1149D0316K  |               | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J                                                                                                                                                                                                                                                        | 476508            | 4                    |
| - 85                                                    | 9L500001-115   |               | .CLAMP INSTL-ELECTRICAL<br>SUPPLIER CODE:<br>V6S8D7                                                                                                                                                                                                                                                       | 476508            | 2                    |
| 90                                                      | MS3367-5-9     |               | ..STRAP<br>STANDARD SUBSTITUTION:<br>BACS38K5                                                                                                                                                                                                                                                             | 476508            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |               |                                                                                                                                                                                                                                                                                                           |                   |                      |

- ITEM NOT ILLUSTRATED

RYR

25-40-11-11H

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-11  
FIG. 11H  
PAGE 1  
APR 15/23


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER   | 1 2 3 4 5 6 7 | NOMENCLATURE                                                     | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|---------------|---------------|------------------------------------------------------------------|-------------------|----------------------|
| 11H<br>95                                               | CA2030-3      | ..            | CLAMP-<br>SUPPLIER CODE:<br>V03296<br>ATTACHING PARTS            | 476508            | 1                    |
| 100                                                     | NAS1801-3-14  | ..            | SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-14                  | 476508            | 1                    |
| 105                                                     | NAS1149D0316K | ..            | WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J                | 476508            | 1                    |
| 110                                                     | NAS43DD3-32N  | ..            | SPACER<br>STANDARD SUBSTITUTION:<br>NAS43DD3-32FC<br>-----*----- | 476508            | 1                    |
| 115                                                     | NAS1149D0316K | .             | WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J                | 476508            | 2                    |
| - 120                                                   | 9L500001-103  | .             | CLAMP INSTL-ELECTRICAL<br>SUPPLIER CODE:<br>V6S8D7               | 476508            | 2                    |
| 125                                                     | MS3367-5-9    | ..            | STRAP<br>STANDARD SUBSTITUTION:<br>BACS38K5                      | 476508            | 1                    |
| 130                                                     | CA2030-3      | ..            | CLAMP-<br>SUPPLIER CODE:<br>V03296<br>ATTACHING PARTS            | 476508            | 1                    |
| 135                                                     | NAS1801-3-6   | ..            | SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                   | 476508            | 1                    |
| 140                                                     | NAS1149D0316K | ..            | WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J<br>-----*----- | 476508            | 1                    |
| 145                                                     | MS3367-5-9    | .             | STRAP<br>STANDARD SUBSTITUTION:<br>BACS38K5                      | 476508            | 1                    |
| 150                                                     | CA2030-1      | .             | CLAMP-<br>SUPPLIER CODE:<br>V03296<br>ATTACHING PARTS            | 476508            | 1                    |
| 155                                                     | NAS1801-3-10  | .             | SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-10                  | 476508            | 1                    |
| 160                                                     | NAS1149D0316K | .             | WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J                | 476508            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |               |               |                                                                  |                   |                      |

- ITEM NOT ILLUSTRATED

R Y R

25-40-11-11H

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-11  
FIG. 11H  
PAGE 2  
APR 15/23


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER   | 1 2 3 4 5 6 7       | NOMENCLATURE                                           | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|---------------|---------------------|--------------------------------------------------------|-------------------|----------------------|
| 11H<br>165                                              | NAS43DD3-16N  | .SPACER             | STANDARD SUBSTITUTION:<br>NAS43DD3-16FC<br>-----*----- | 476508            | 1                    |
| 170                                                     | 1L500109-905  | .STRAP-FIRE BLANKET | SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS            | 476508            | 1                    |
| 175                                                     | NAS1801-3-6   | .SCREW              | STANDARD SUBSTITUTION:<br>BACS12HN3-6                  | 476508            | 2                    |
| 180                                                     | NAS1149D0316K | .WASHER             | STANDARD SUBSTITUTION:<br>NAS1149D0316J                | 476508            | 1                    |
| 185                                                     | NAS1149D0332K | .WASHER             | STANDARD SUBSTITUTION:<br>NAS1149D0332J<br>-----*----- | 476508            | 1                    |
| 190                                                     | 1L500109-901  | .STRAP-FIRE BLANKET | SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS            | 476508            | 1                    |
| 195                                                     | NAS1801-3-6   | .SCREW              | STANDARD SUBSTITUTION:<br>BACS12HN3-6                  | 476508            | 3                    |
| 200                                                     | NAS1149D0316K | .WASHER             | STANDARD SUBSTITUTION:<br>NAS1149D0316J<br>-----*----- | 476508            | 3                    |
| 205                                                     | 1L500109-311  | .STRAP-FIRE BLANKET | SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS            | 476508            | 1                    |
| 210                                                     | NAS1801-3-6   | .SCREW              | STANDARD SUBSTITUTION:<br>BACS12HN3-6                  | 476508            | 5                    |
| 215                                                     | NAS1149D0316K | .WASHER             | STANDARD SUBSTITUTION:<br>NAS1149D0316J<br>-----*----- | 476508            | 5                    |
| 220                                                     | 1L500109-313  | .STRAP-FIRE BLANKET | SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS            | 476508            | 1                    |
| 225                                                     | NAS1801-3-6   | .SCREW              | STANDARD SUBSTITUTION:<br>BACS12HN3-6                  | 476508            | 4                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |               |                     |                                                        |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R

25-40-11-11H

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-11  
 FIG. 11H  
 PAGE 3  
 APR 15/23


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER   | 1 2 3 4 5 6 7 | NOMENCLATURE                                                      | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|---------------|---------------|-------------------------------------------------------------------|-------------------|----------------------|
| 11H<br>230                                              | NAS1149D0316K | .             | WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J<br>-----*-----  | 476508            | 4                    |
| 235                                                     | 1L500109-315  | .             | STRAP-FIRE BLANKET<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS | 476508            | 1                    |
| 240                                                     | NAS1801-3-6   | .             | SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                    | 476508            | 1                    |
| 245                                                     | NAS1149D0316K | .             | WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J<br>-----*-----  | 476508            | 1                    |
| 250                                                     | 1L500109-317  | .             | STRAP-FIRE BLANKET<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS | 476508            | 1                    |
| 255                                                     | NAS1801-3-6   | .             | SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                    | 476508            | 3                    |
| 260                                                     | NAS1149D0316K | .             | WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J<br>-----*-----  | 476508            | 3                    |
| 265                                                     | 1L500109-903  | .             | STRAP-FIRE BLANKET<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS | 476508            | 1                    |
| 270                                                     | NAS1801-3-6   | .             | SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                    | 476508            | 3                    |
| 275                                                     | NAS1149D0316K | .             | WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J<br>-----*-----  | 476508            | 3                    |
| 280                                                     | 1L500109-305  | .             | STRAP-FIRE BLANKET<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS | 476508            | 1                    |
| 285                                                     | NAS1801-3-6   | .             | SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                    | 476508            | 10                   |
| 290                                                     | NAS1149D0332K | .             | WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0332J                 | 476508            | 4                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |               |               |                                                                   |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R

25-40-11-11H

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-11  
 FIG. 11H  
 PAGE 4  
 APR 15/23


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER   | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                                                                                                                                                                                                                           | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|---------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 11H<br>295                                              | NAS1149D0316K | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J<br>-----*-----                                                                                                                                                                                                                                                    | 476508            | 6                    |
| 300                                                     | 1L500109-335  | .BLANKET-FIRE<br>SUPPLIER CODE:<br>V6S8D7                                                                                                                                                                                                                                                                            | 476508            | 1                    |
| 305                                                     | MS3367-5-9    | .STRAP<br>STANDARD SUBSTITUTION:<br>BACS38K5                                                                                                                                                                                                                                                                         | 476508            | AR                   |
| 310                                                     | 4576001-101   | .BOX ASSY-OXY<br>SUPPLIER CODE:<br>V16827<br>FUNCTIONAL DESCRIPTION:<br>STORES OXYGEN AND MASK<br>ASSEMBLIES. CONTROLS THE<br>DELIVERY OF OXYGEN TO<br>EACH MASK AND<br>COMMUNICATES WITH THE<br>AIRPLANE NETWORK.<br>COMPONENT MAINT MANUAL REF:<br>25-23-68<br>FOR DETAILS SEE:<br>35-21-00-01A<br>ATTACHING PARTS | 476508            | 1                    |
| 315                                                     | NAS1801-3-6   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                                                                                                                                                                                                                                                                      | 476508            | 4                    |
| 320                                                     | NAS1149D0332J | .WASHER<br>-----*-----                                                                                                                                                                                                                                                                                               | 476508            | 4                    |
| 325                                                     | 4L500103-13   | .BRACKET-<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                                                                                                                                                                                                                                                             | 476508            | 4                    |
| 330                                                     | NAS1801-3-6   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                                                                                                                                                                                                                                                                      | 476508            | 4                    |
| 335                                                     | NAS1149D0332J | .WASHER<br>-----*-----                                                                                                                                                                                                                                                                                               | 476508            | 4                    |
| 340                                                     | 1L500109-693  | .FITTING-TIE-ROD<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                                                                                                                                                                                                                                                      | 476508            | 1                    |
| 345                                                     | NAS1801-3-8   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-8                                                                                                                                                                                                                                                                      | 476508            | 12                   |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |               |                                                                                                                                                                                                                                                                                                                      |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R

25-40-11-11H

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-11  
FIG. 11H  
PAGE 5  
APR 15/23


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 | NOMENCLATURE                                                                     | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|---------------|----------------------------------------------------------------------------------|-------------------|----------------------|
| 11H<br>350                                              | NAS1149D0332K  | .             | WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0332J<br>-----*-----                 | 476508            | 12                   |
| 355                                                     | 1L500105-15    | .             | THRESHOLD-<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                        | 476508            | 1                    |
| 360                                                     | NAS8703A4      | .             | BOLT<br>STANDARD SUBSTITUTION:<br>BACB30ZE3K4<br>-----*-----                     | 476508            | 4                    |
| 365                                                     | 1L500109-147   | .             | SPACER-THRESHOLD<br>SUPPLIER CODE:<br>V6S8D7                                     | 476508            | 1                    |
| 370                                                     | 1L400109-407BA | .             | KICKSTRIP ASSY-<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                   | 476508            | 1                    |
| 375                                                     | NAS514P832-5   | .             | SCREW                                                                            | 476508            | 2                    |
| 380                                                     | NAS514P632-5   | .             | SCREW<br>-----*-----                                                             | 476508            | 2                    |
| 385                                                     | 1L500109-467BA | .             | ENDCAP-<br>SUPPLIER CODE:<br>V6S8D7                                              | 476508            | 1                    |
| 390                                                     | 1L500109-463BA | .             | CAP-<br>SUPPLIER CODE:<br>V6S8D7                                                 | 476508            | 1                    |
| 395                                                     | 1L500109-469BA | .             | RETAINER-<br>SUPPLIER CODE:<br>V6S8D7                                            | 476508            | 1                    |
| 400                                                     | 1L500109-295   | .             | COVER-FTG<br>SUPPLIER CODE:<br>V6S8D7                                            | 476508            | 1                    |
| 405                                                     | 1L360010-0081A | .             | LAVATORY ASSY-<br>SUPPLIER CODE:<br>V6S8D7                                       | 476508            | 1                    |
| 410                                                     | 1L306010-221CH | .             | STRUCTURE INSTL-<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-40-11-28D | 476508            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |               |                                                                                  |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R

25-40-11-11H

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

25-40-11  
 FIG. 11H  
 PAGE 6  
 APR 15/23


**BOEING**  
 737-600/700/800/900  
 PARTS CATALOG (MAINTENANCE)

| FIG<br>ITEM                                             | PART NUMBER  | 1 2 3 4 5 6 7 | NOMENCLATURE                                                                                                                                                                                                                       | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|--------------|---------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 11H<br>415                                              | 3L306010-115 |               | .ELECTRICAL INSTL-<br>SUPPLIER CODE:<br>V6S8D7<br>FUNCTIONAL REFERENCE:<br>EQUIPMENT/FURNISHINGS<br>FOR DETAILS SEE<br>25-41-60-22W<br>LIGHTS<br>FOR DETAILS SEE<br>33-27-51-12N<br>WATER/WASTE<br>FOR DETAILS SEE<br>38-32-04-06E | 476508            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |              |               |                                                                                                                                                                                                                                    |                   |                      |

— ITEM NOT ILLUSTRATED


R Y R

25-40-11-11H

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

25-40-11  
 FIG. 11H  
 PAGE 7  
 FEB 15/18

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

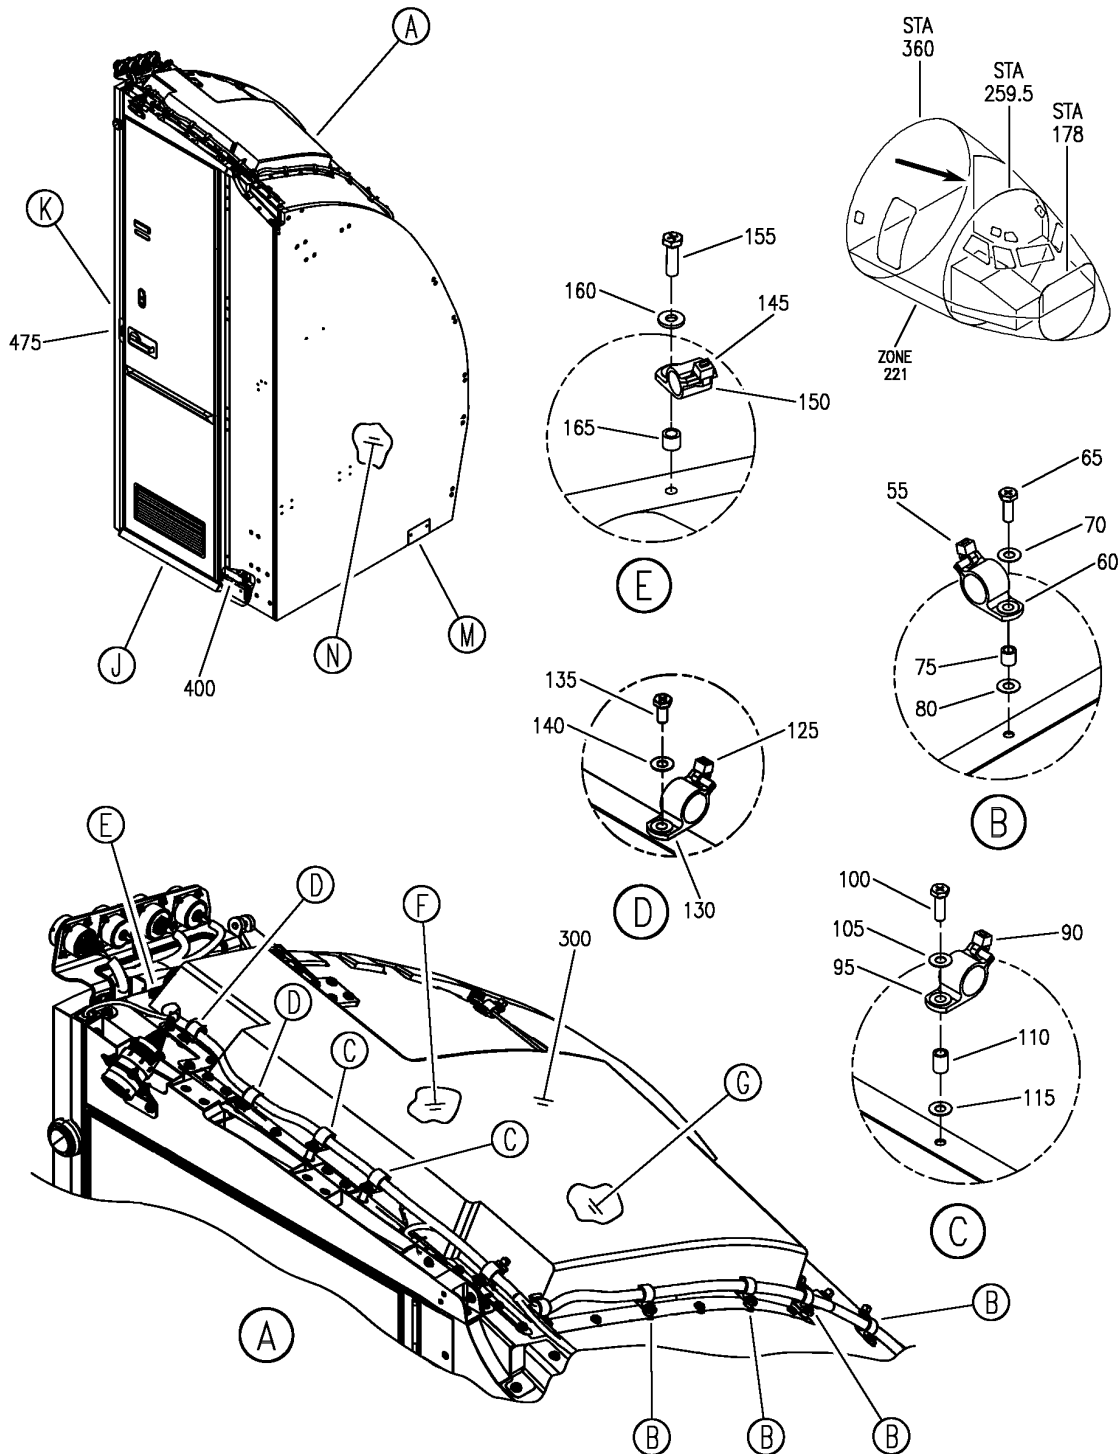

E 2540111N SHT 1 REV 261

MODULE ASSY-LAV A (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 11N (SHEET 1)

**25-40-11-11N**


R/YR  
AUG 15/19

25-40-11-11N  
PAGE 0

ECCN 9E991 BOEING PROPRIETARY - See title page for details.



**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

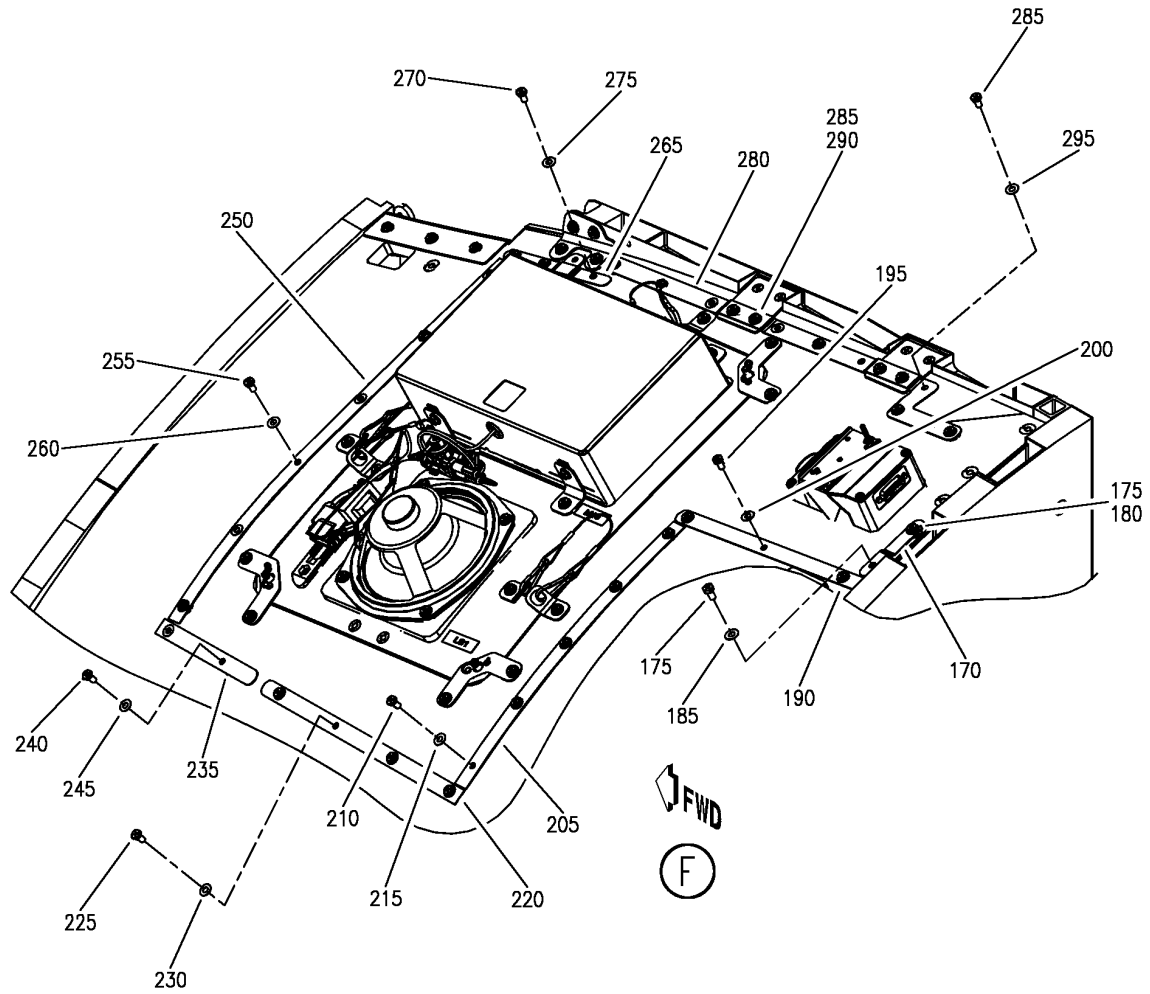

E 2540111N SHT 2 REV 261

MODULE ASSY-LAV A (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 11N (SHEET 2)


**25-40-11-11N**

RYR  
AUG 15/19

25-40-11-11N  
PAGE 0A

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

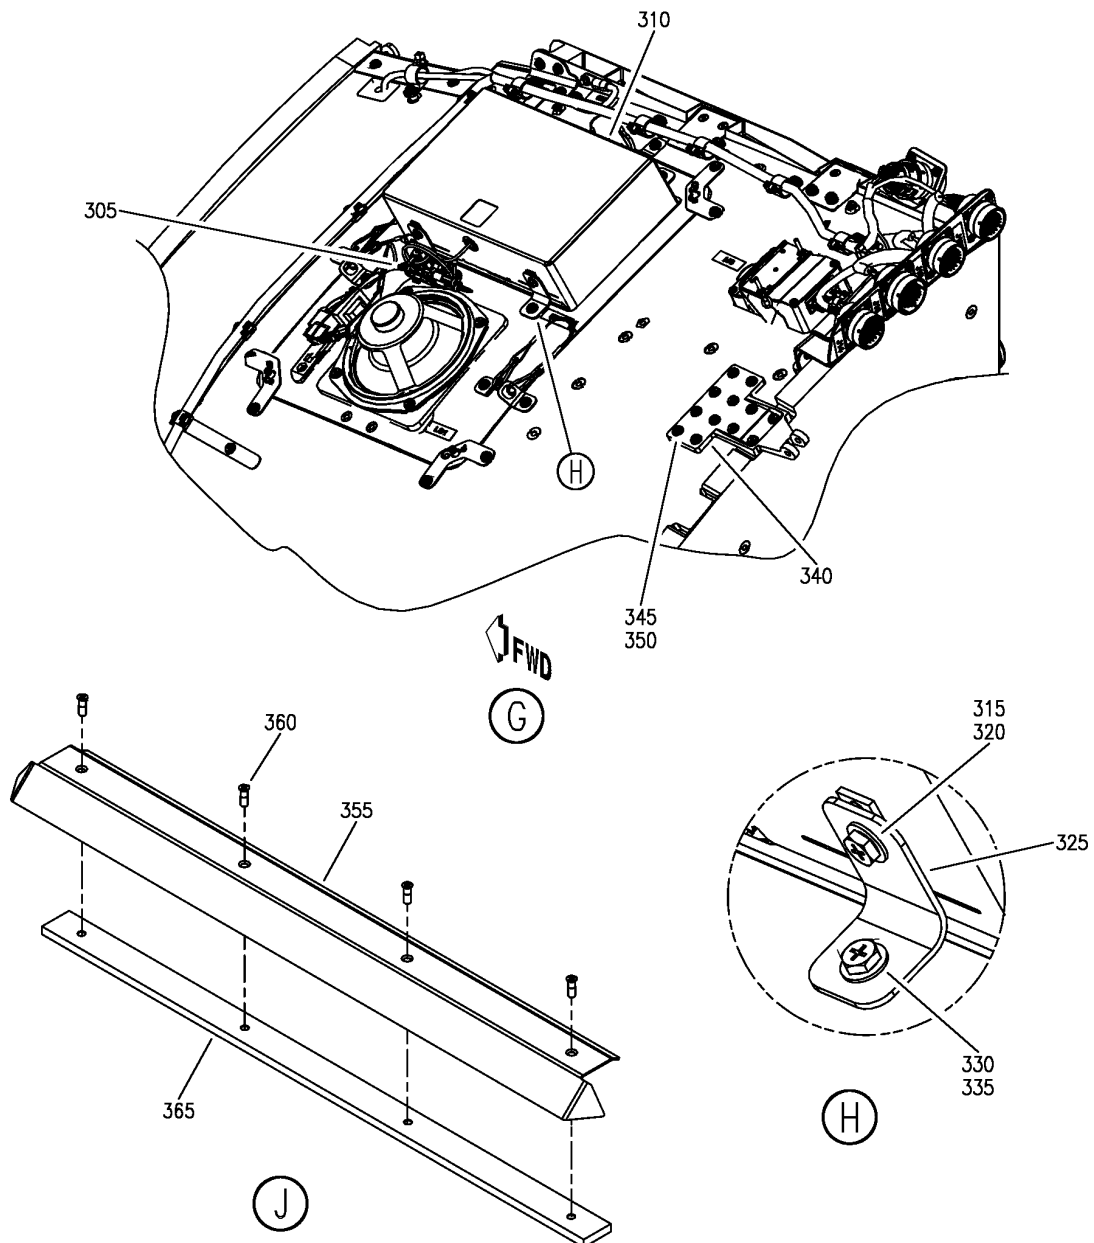

E 2540111N SHT 3 REV 261

MODULE ASSY-LAV A (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 11N (SHEET 3)


**25-40-11-11N**

R/YR  
AUG 15/19

25-40-11-11N  
PAGE 0B

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

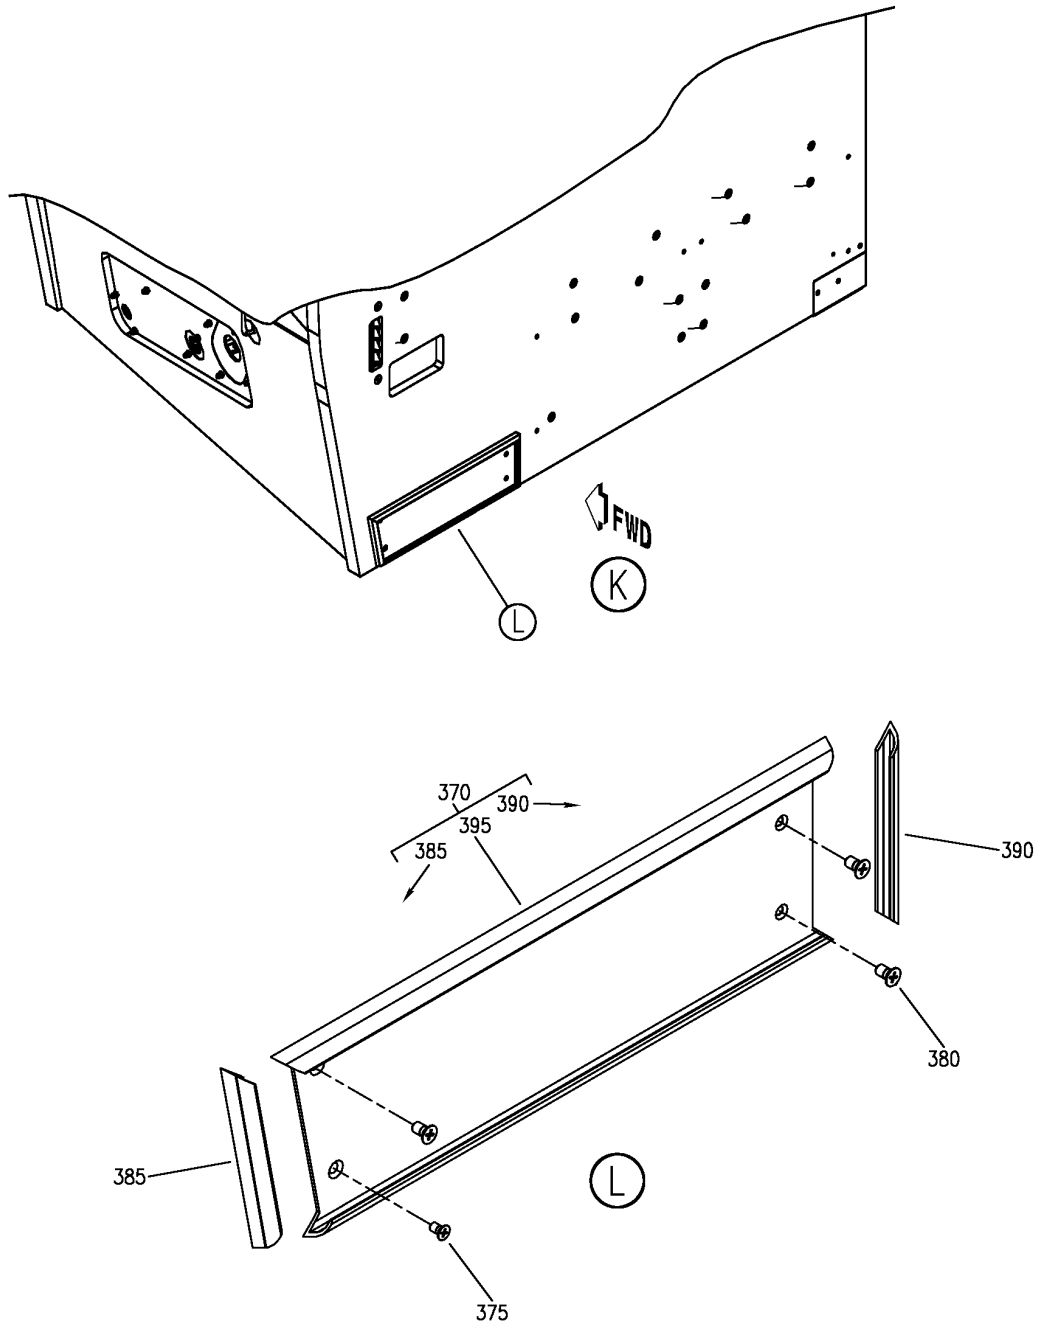

E 2540111N SHT 4 REV 261

MODULE ASSY-LAV A (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 11N (SHEET 4)


**25-40-11-11N**

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

R/YR  
AUG 15/19

25-40-11-11N  
PAGE 0C

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

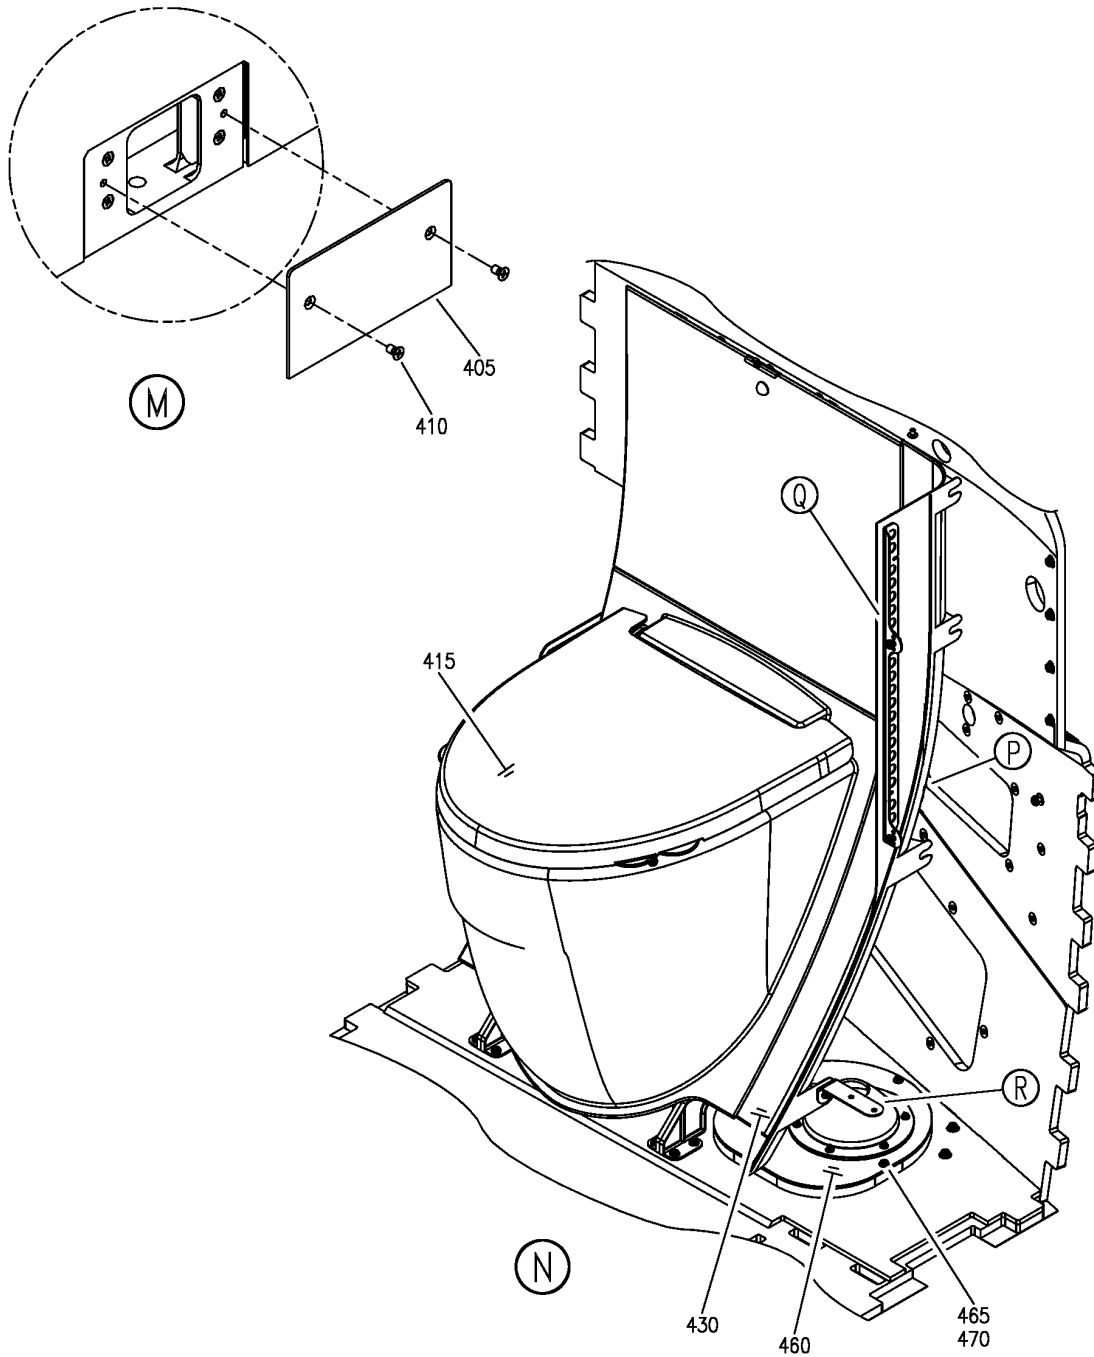

E 2540111N SHT 5 REV 261

MODULE ASSY-LAV A (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 11N (SHEET 5)




**25-40-11-11N**

R/YR  
AUG 15/19

25-40-11-11N  
PAGE 00

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

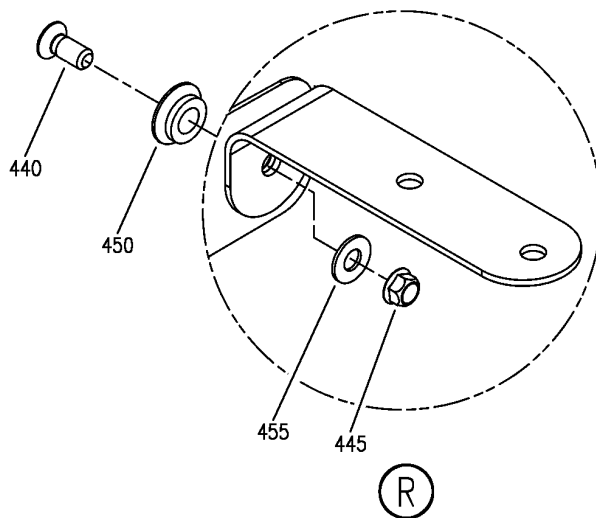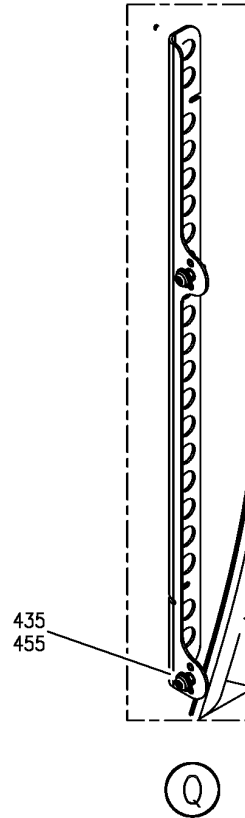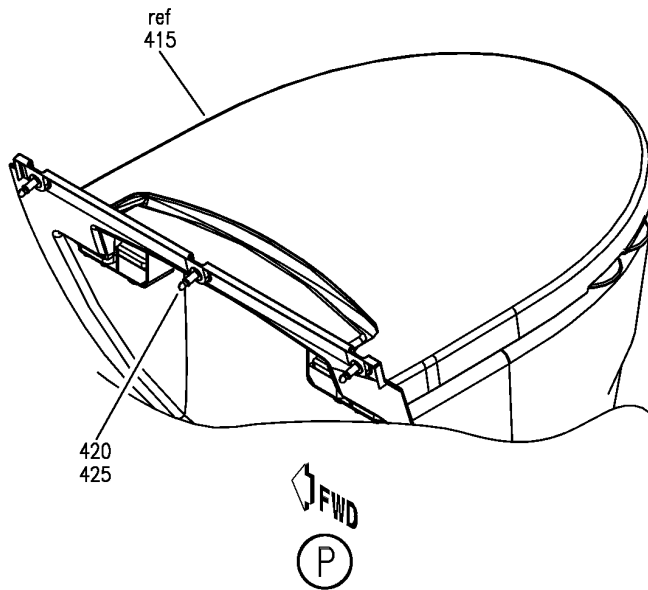

E 2540111N SHT 6 REV 261

MODULE ASSY-LAV A (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 11N (SHEET 6)

**25-40-11-11N**

R/YR  
AUG 15/19

25-40-11-11N  
PAGE 0E

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

 **BOEING**  
737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                                                                                                                                                                                                               | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 11N                                                     |                | MODULE ASSY-LAV A<br>(EQUIPMENT/FURNISHINGS<br>ONLY)                                                                                                                                                                                                                                                     | 509999            |                      |
| - 1                                                     | 1L300010-0171A | MODULE ASSY-LAV A<br>(EQUIPMENT/FURNISHINGS<br>ONLY)<br>SUPPLIER CODE:<br>V6S8D7<br>FUNCTIONAL DESCRIPTION:<br>PROVIDES LAVATORY<br>FACILITIES FOR<br>PASSENGERS AND CREW<br>ELECTRICAL EQUIP NUMBER:<br>M01415<br>COMPONENT MAINT MANUAL REF:<br>25-40-49<br>FOR NHA/OTHER SYS DET SEE:<br>25-40-11-01B | 509999            | RF                   |
| - 50                                                    | 9L500001-107   | .CLAMP INSTL-ELECTRICAL<br>SUPPLIER CODE:<br>V6S8D7                                                                                                                                                                                                                                                      | 509999            | 2                    |
| 55                                                      | MS3367-5-9     | ..STRAP<br>STANDARD SUBSTITUTION:<br>BACS38K5                                                                                                                                                                                                                                                            | 509999            | 1                    |
| 60                                                      | CA2030-3       | ..CLAMP-<br>SUPPLIER CODE:<br>V03296<br>ATTACHING PARTS                                                                                                                                                                                                                                                  | 509999            | 1                    |
| 65                                                      | NAS1801-3-10   | ..SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-10                                                                                                                                                                                                                                                        | 509999            | 1                    |
| 70                                                      | NAS1149D0316K  | ..WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J                                                                                                                                                                                                                                                      | 509999            | 1                    |
| 75                                                      | NAS43DD3-16N   | ..SPACER<br>STANDARD SUBSTITUTION:<br>NAS43DD3-16FC<br>-----*-----                                                                                                                                                                                                                                       | 509999            | 1                    |
| 80                                                      | NAS1149D0316K  | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J                                                                                                                                                                                                                                                       | 509999            | 4                    |
| - 85                                                    | 9L500001-115   | .CLAMP INSTL-ELECTRICAL<br>SUPPLIER CODE:<br>V6S8D7                                                                                                                                                                                                                                                      | 509999            | 2                    |
| 90                                                      | MS3367-5-9     | ..STRAP<br>STANDARD SUBSTITUTION:<br>BACS38K5                                                                                                                                                                                                                                                            | 509999            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |                                                                                                                                                                                                                                                                                                          |                   |                      |

- ITEM NOT ILLUSTRATED

RYR

25-40-11-11N

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-11  
FIG. 11N  
PAGE 1  
APR 15/23

 **BOEING**  
737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER   | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                 | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|---------------|------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 11N<br>95                                               | CA2030-3      | ..CLAMP-<br>SUPPLIER CODE:<br>V03296<br>ATTACHING PARTS                                                    | 509999            | 1                    |
| 100                                                     | NAS1801-3-14  | ..SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-14                                                          | 509999            | 1                    |
| 105                                                     | NAS1149D0316K | ..WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J                                                        | 509999            | 1                    |
| 110                                                     | NAS43DD3-32N  | ..SPACER<br>STANDARD SUBSTITUTION:<br>NAS43DD3-32FC<br>-----*-----                                         | 509999            | 1                    |
| 115                                                     | NAS1149D0316K | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J                                                         | 509999            | 2                    |
| - 120                                                   | 9L500001-103  | .CLAMP INSTL-ELECTRICAL<br>SUPPLIER CODE:<br>V6S8D7                                                        | 509999            | 2                    |
| 125                                                     | MS3367-5-9    | ..STRAP<br>STANDARD SUBSTITUTION:<br>BACS38K5                                                              | 509999            | 1                    |
| 130                                                     | CA2030-3      | ..CLAMP-<br>SUPPLIER CODE:<br>V03296<br>ATTACHING PARTS                                                    | 509999            | 1                    |
| 135                                                     | NAS1801-3-6   | ..SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                                                           | 509999            | 1                    |
| 140                                                     | NAS1149D0316K | ..WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J<br>-----*-----                                         | 509999            | 1                    |
| - 143                                                   | 9L500001-117  | .CLAMP INSTL-<br>SUPPLIER CODE:<br>V6S8D7                                                                  | 509999            | 1                    |
| 145                                                     | MS3367-5-9    | ..STRAP<br>STANDARD SUBSTITUTION:<br>BACS38K5                                                              | 509999            | 1                    |
| 150                                                     | CA2030-1      | ..CLAMP-<br>SUPPLIER CODE:<br>V03296<br>ATTACHING PARTS                                                    | 509999            | 1                    |
| 155                                                     | NAS1801-3-10  | ..SCREW-<br>STANDARD SUBSTITUTION:<br>BACS12HN3-10<br>CONFIG CHG DATA FROM A CMM:<br>SUPSD BY NAS1801-3-16 | 509999            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |               |                                                                                                            |                   |                      |

- ITEM NOT ILLUSTRATED

R Y R

25-40-11-11N

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-11  
FIG. 11N  
PAGE 2  
APR 15/23


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER   | 1 2 3 4 5 6 7 | NOMENCLATURE                                                                                                | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|---------------|---------------|-------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 11N<br>155                                              | NAS1801-3-16  | ..            | SCREW-<br>STANDARD SUBSTITUTION:<br>BACS12HN3-16<br>CONFIG CHG DATA FROM A CMM:<br>SUPERSEDES NAS1801-3-10  | 509999            | 1                    |
| 160                                                     | NAS1149D0316K | ..            | WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J                                                           | 509999            | 1                    |
| 165                                                     | NAS43DD3-16N  | ..            | SPACER-<br>STANDARD SUBSTITUTION:<br>NAS43DD3-16FC<br>CONFIG CHG DATA FROM A CMM:<br>SUPSD BY NAS43DD3-40FC | 509999            | 1                    |
| 165                                                     | NAS43DD3-40FC | ..            | SPACER-<br>CONFIG CHG DATA FROM A CMM:<br>SUPERSEDES NAS43DD3-16N<br>-----*-----                            | 509999            | 1                    |
| 170                                                     | 1L500109-905  | .             | STRAP-FIRE BLANKET<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                                           | 509999            | 1                    |
| 175                                                     | NAS1801-3-6   | .             | SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                                                              | 509999            | 2                    |
| 180                                                     | NAS1149D0316K | .             | WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J                                                           | 509999            | 1                    |
| 185                                                     | NAS1149D0332J | .             | WASHER<br>-----*-----                                                                                       | 509999            | 1                    |
| 190                                                     | 1L500109-901  | .             | STRAP-FIRE BLANKET<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                                           | 509999            | 1                    |
| 195                                                     | NAS1801-3-6   | .             | SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                                                              | 509999            | 3                    |
| 200                                                     | NAS1149D0316K | .             | WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J<br>-----*-----                                            | 509999            | 3                    |
| 205                                                     | 1L500109-311  | .             | STRAP-FIRE BLANKET<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                                           | 509999            | 1                    |
| 210                                                     | NAS1801-3-6   | .             | SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                                                              | 509999            | 5                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |               |               |                                                                                                             |                   |                      |

— ITEM NOT ILLUSTRATED

RYR

25-40-11-11N

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-11  
FIG. 11N  
PAGE 3  
APR 15/23




**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER   | 1 2 3 4 5 6 7 | NOMENCLATURE                                                      | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|---------------|---------------|-------------------------------------------------------------------|-------------------|----------------------|
| 11N<br>215                                              | NAS1149D0316K | .             | WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J<br>-----*-----  | 509999            | 5                    |
| 220                                                     | 1L500109-313  | .             | STRAP-FIRE BLANKET<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS | 509999            | 1                    |
| 225                                                     | NAS1801-3-6   | .             | SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                    | 509999            | 4                    |
| 230                                                     | NAS1149D0316K | .             | WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J<br>-----*-----  | 509999            | 4                    |
| 235                                                     | 1L500109-315  | .             | STRAP-FIRE BLANKET<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS | 509999            | 1                    |
| 240                                                     | NAS1801-3-6   | .             | SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                    | 509999            | 1                    |
| 245                                                     | NAS1149D0316K | .             | WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J<br>-----*-----  | 509999            | 1                    |
| 250                                                     | 1L500109-317  | .             | STRAP-FIRE BLANKET<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS | 509999            | 1                    |
| 255                                                     | NAS1801-3-6   | .             | SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                    | 509999            | 3                    |
| 260                                                     | NAS1149D0316K | .             | WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J<br>-----*-----  | 509999            | 3                    |
| 265                                                     | 1L500109-903  | .             | STRAP-FIRE BLANKET<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS | 509999            | 1                    |
| 270                                                     | NAS1801-3-6   | .             | SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                    | 509999            | 3                    |
| 275                                                     | NAS1149D0316K | .             | WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J<br>-----*-----  | 509999            | 3                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |               |               |                                                                   |                   |                      |

— ITEM NOT ILLUSTRATED

RYR

25-40-11-11N

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-11  
 FIG. 11N  
 PAGE 4  
 APR 15/23


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER   | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                                                                                                                                                                                                                           | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|---------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 11N<br>280                                              | 1L500109-305  | .STRAP-FIRE BLANKET<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                                                                                                                                                                                                                                                   | 509999            | 1                    |
| 285                                                     | NAS1801-3-6   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                                                                                                                                                                                                                                                                      | 509999            | 10                   |
| 290                                                     | NAS1149D0332K | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0332J                                                                                                                                                                                                                                                                   | 509999            | 4                    |
| 295                                                     | NAS1149D0316K | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J<br>-----*-----                                                                                                                                                                                                                                                    | 509999            | 6                    |
| 300                                                     | 1L500109-335  | .BLANKET-FIRE<br>SUPPLIER CODE:<br>V6S8D7                                                                                                                                                                                                                                                                            | 509999            | 1                    |
| 305                                                     | MS3367-5-9    | .STRAP<br>STANDARD SUBSTITUTION:<br>BACS38K5                                                                                                                                                                                                                                                                         | 509999            | AR                   |
| 310                                                     | 4576001-101   | .BOX ASSY-OXY<br>SUPPLIER CODE:<br>V16827<br>FUNCTIONAL DESCRIPTION:<br>STORES OXYGEN AND MASK<br>ASSEMBLIES. CONTROLS THE<br>DELIVERY OF OXYGEN TO<br>EACH MASK AND<br>COMMUNICATES WITH THE<br>AIRPLANE NETWORK.<br>COMPONENT MAINT MANUAL REF:<br>25-23-68<br>FOR DETAILS SEE:<br>35-21-00-01A<br>ATTACHING PARTS | 509999            | 1                    |
| 315                                                     | NAS1801-3-6   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                                                                                                                                                                                                                                                                      | 509999            | 4                    |
| 320                                                     | NAS1149D0332J | .WASHER<br>-----*-----                                                                                                                                                                                                                                                                                               | 509999            | 4                    |
| 325                                                     | 4L500103-13   | .BRACKET-<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                                                                                                                                                                                                                                                             | 509999            | 4                    |
| 330                                                     | NAS1801-3-6   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                                                                                                                                                                                                                                                                      | 509999            | 4                    |
| 335                                                     | NAS1149D0332J | .WASHER<br>-----*-----                                                                                                                                                                                                                                                                                               | 509999            | 4                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |               |                                                                                                                                                                                                                                                                                                                      |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R

25-40-11-11N

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-11  
FIG. 11N  
PAGE 5  
APR 15/23


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 | NOMENCLATURE                                                       | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|---------------|--------------------------------------------------------------------|-------------------|----------------------|
| 11N<br>340                                              | 1L500109-693   |               | . FITTING-TIE-ROD<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS   | 509999            | 1                    |
| 345                                                     | NAS1801-3-8    |               | . SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-8                   | 509999            | 12                   |
| 350                                                     | NAS1149D0332K  |               | . WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0332J<br>-----*----- | 509999            | 12                   |
| 355                                                     | 1L500105-15    |               | . THRESHOLD-<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS        | 509999            | 1                    |
| 360                                                     | NAS8703A4      |               | . BOLT<br>STANDARD SUBSTITUTION:<br>BACB30ZE3K4<br>-----*-----     | 509999            | 4                    |
| 365                                                     | 1L500109-147   |               | . SPACER-THRESHOLD<br>SUPPLIER CODE:<br>V6S8D7                     | 509999            | 1                    |
| 370                                                     | 1L400109-407BA |               | . KICKSTRIP ASSY-<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS   | 509999            | 1                    |
| 375                                                     | NAS514P832-5   |               | . SCREW                                                            | 509999            | 2                    |
| 380                                                     | NAS514P632-5   |               | . SCREW<br>-----*-----                                             | 509999            | 2                    |
| 385                                                     | 1L500109-467BA |               | . . ENDCAP-<br>SUPPLIER CODE:<br>V6S8D7                            | 509999            | 1                    |
| 390                                                     | 1L500109-463BA |               | . . CAP-<br>SUPPLIER CODE:<br>V6S8D7                               | 509999            | 1                    |
| 395                                                     | 1L500109-469BA |               | . . RETAINER-<br>SUPPLIER CODE:<br>V6S8D7                          | 509999            | 1                    |
| 400                                                     | 1L500109-295   |               | . COVER-FTG<br>SUPPLIER CODE:<br>V6S8D7                            | 509999            | 1                    |
| 405                                                     | 1L500109-581   |               | . PLATE-COVER<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS       | 509999            | 1                    |
| 410                                                     | NAS514P632-5   |               | . SCREW<br>-----*-----                                             | 509999            | 2                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |               |                                                                    |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R

25-40-11-11N

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-11  
 FIG. 11N  
 PAGE 6  
 APR 15/23


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 NOMENCLATURE                                                                              | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|---------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 11N<br>415                                              | 1L400407-51    | .SHROUD ASSY-TOILET LID<br>SEAT<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                          | 509999            | 1                    |
| 420                                                     | 85-99-541-20   | .FASTENER-QUARTER-TURN<br>SUPPLIER CODE:<br>V94222                                                      | 509999            | 3                    |
| 425                                                     | 85-34-301-12   | .RETAINER-QUARTER-TURN STUD<br>SUPPLIER CODE:<br>V94222                                                 | 509999            | 3                    |
| 430                                                     | 1L400109-259   | -----*-----<br>.SHROUD-RH-CORNER<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                         | 509999            | 1                    |
| 435                                                     | 09T305         | .SCREW-<br>SUPPLIER CODE:<br>V94222<br>TRUE PART NUMBER:<br>09-T-305                                    | 509999            | 2                    |
| 440                                                     | NAS514P1032-7  | .SCREW                                                                                                  | 509999            | 1                    |
| 445                                                     | MS21042L3      | .NUT<br>STANDARD SUBSTITUTION:<br>BACN11AG3                                                             | 509999            | 1                    |
| 450                                                     | 1L500407-203   | .FASTENER-SNAP<br>SUPPLIER CODE:<br>V6S8D7                                                              | 509999            | 1                    |
| 455                                                     | NAS1149D0332J  | .WASHER<br>-----*-----                                                                                  | 509999            | 3                    |
| 460                                                     | 4L400401-21    | .PLATE ASSY-CLOSEOUT<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-41-11-46E<br>ATTACHING PARTS | 509999            | 1                    |
| 465                                                     | NAS1801-3-16   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-16                                                        | 509999            | 4                    |
| 470                                                     | NAS1149D0332J  | .WASHER<br>-----*-----                                                                                  | 509999            | 4                    |
| 475                                                     | 1L360010-0171A | .LAVATORY ASSY-<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-40-11-23D                         | 509999            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |                                                                                                         |                   |                      |

— ITEM NOT ILLUSTRATED


R Y R

25-40-11-11N

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-11  
FIG. 11N  
PAGE 7  
APR 15/23

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

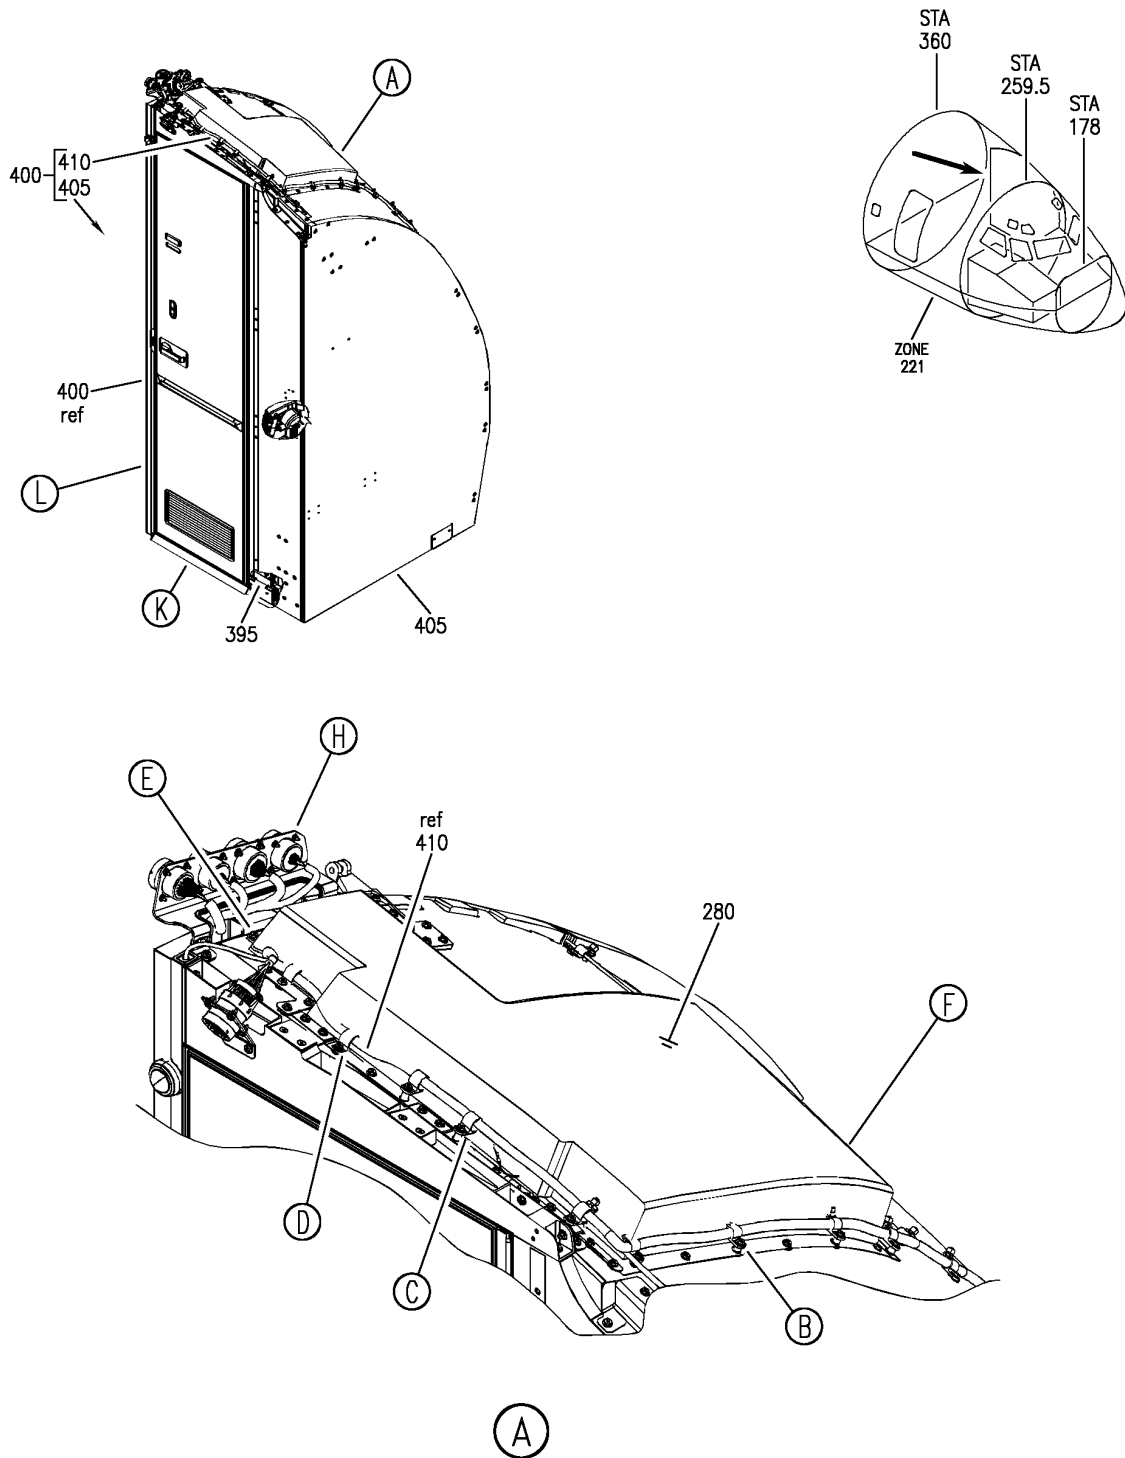

E 25401121S SHT 1 REV 259

MODULE ASSY-LAV A (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 21S (SHEET 1)





**25-40-11-21S**

R Y R  
AUG 15 / 19

25-40-11-21S  
PAGE 0

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

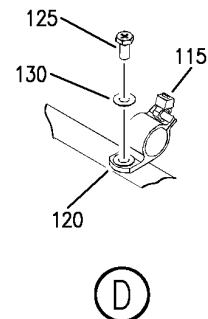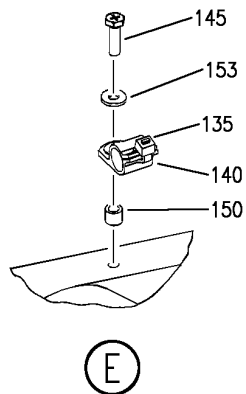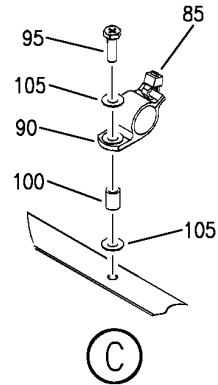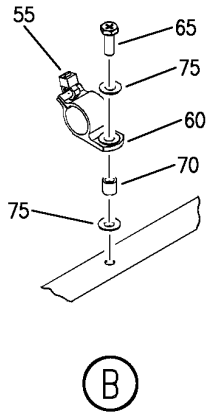

E 25401121S SHT 2 REV 259

MODULE ASSY-LAV A (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 21S (SHEET 2)


**25-40-11-21S**

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

R Y R  
AUG 15 / 19

25-40-11-21S  
PAGE 0A

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

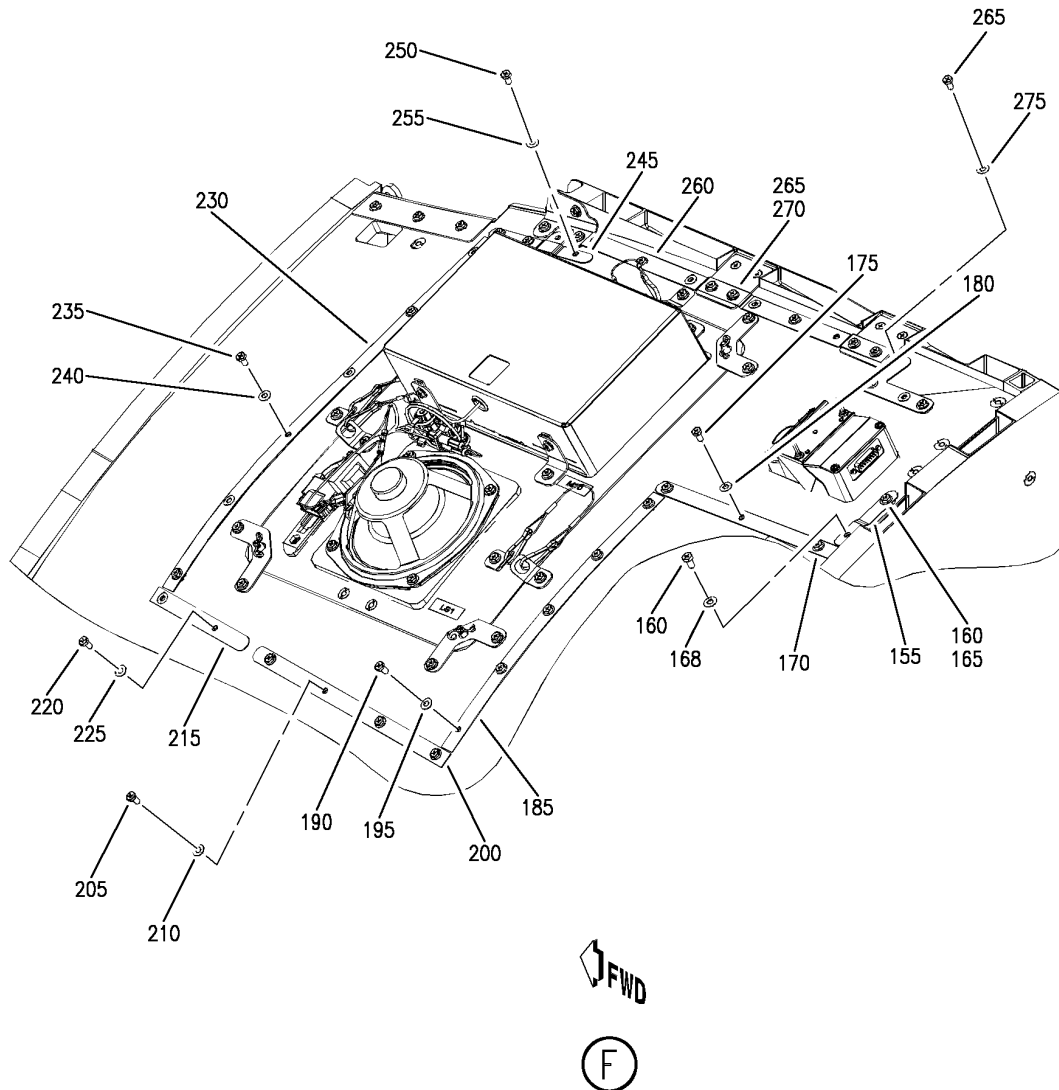

E 25401121S SHT 3 REV 259

MODULE ASSY-LAV A (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 21S (SHEET 3)


**25-40-11-21S**

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

R/YR  
AUG 15/19

25-40-11-21S  
PAGE 0B

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

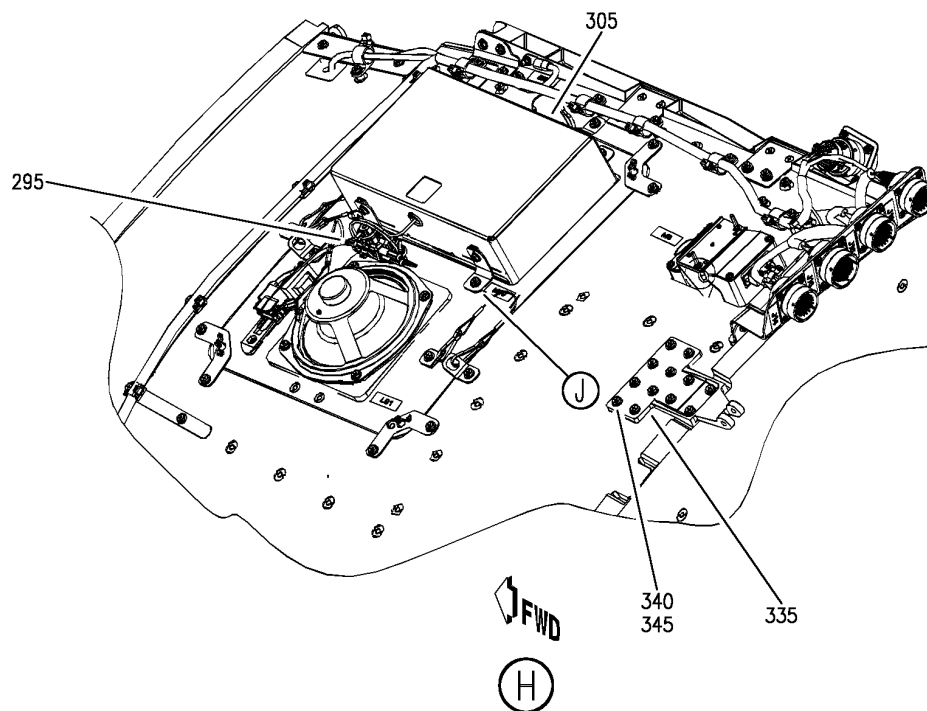

E 25401121S SHT 4 REV 259

MODULE ASSY-LAV A (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 21S (SHEET 4)

**25-40-11-21S**


ECCN 9E991 BOEING PROPRIETARY - See title page for details.

R/YR  
AUG 15/19

25-40-11-21S  
PAGE 0C



**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

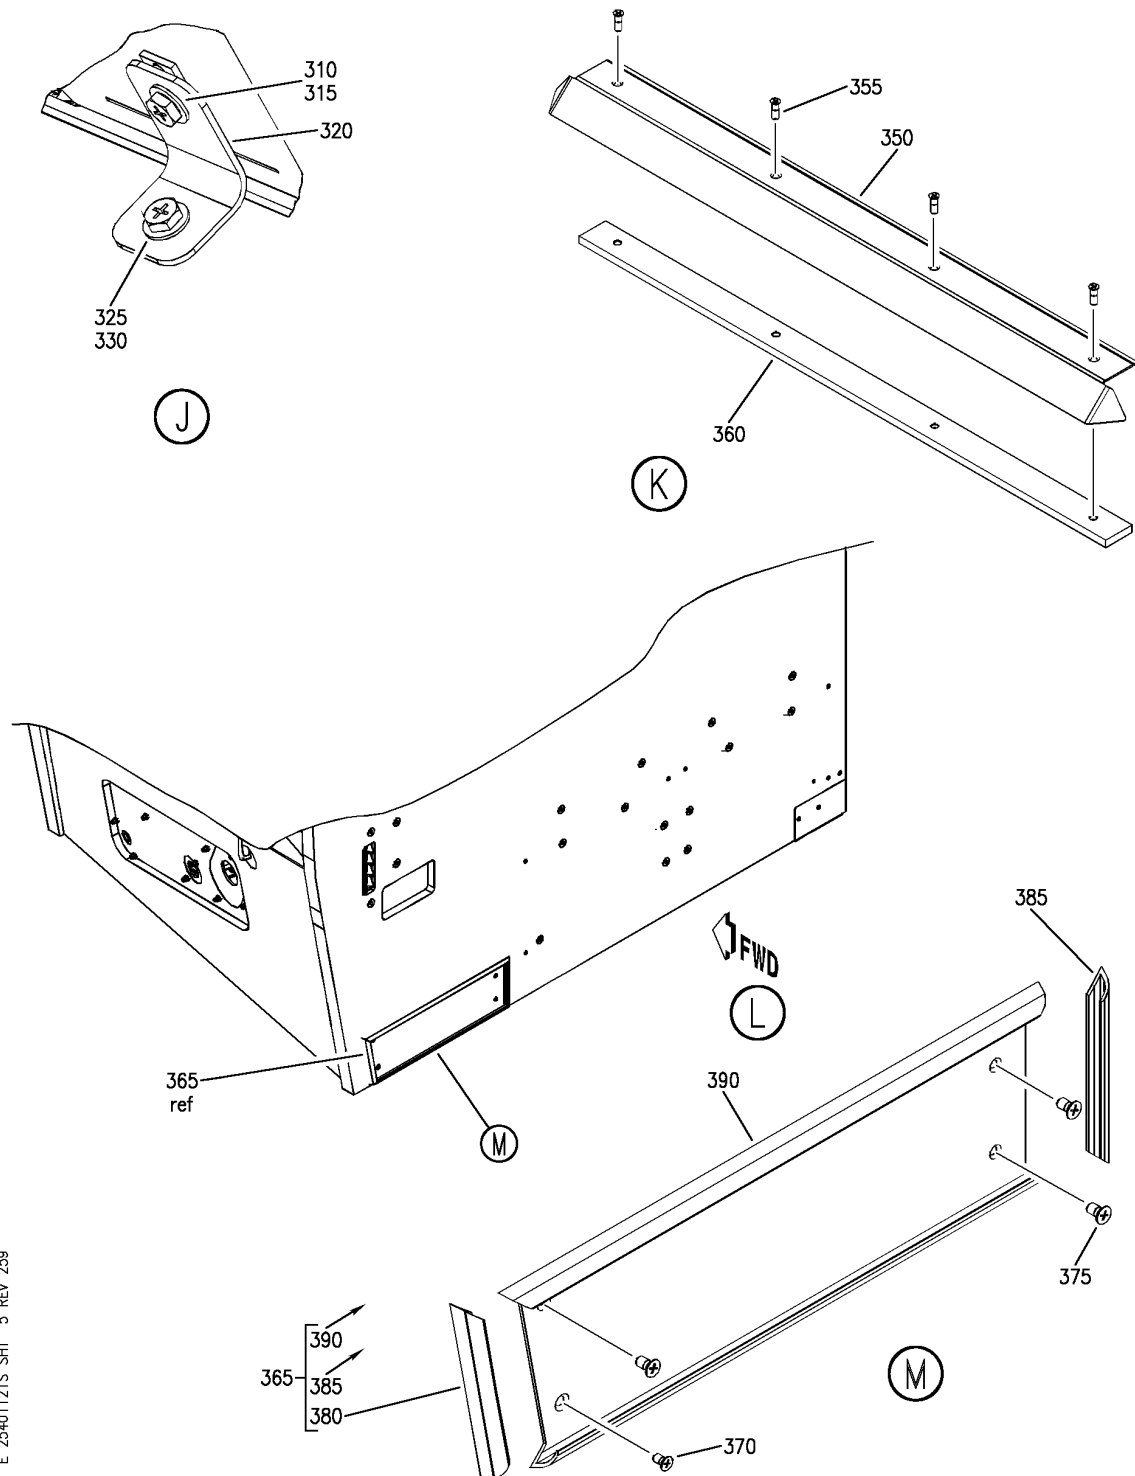

E 25401121S SHT 5 REV 259

MODULE ASSY-LAV A (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 21S (SHEET 5)

**25-40-11-21S**

R/YR  
AUG 15/19

25-40-11-21S  
PAGE 00


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 | NOMENCLATURE                                                                                                                                                                                                                                                                                            | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|---------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 21S                                                     |                |               | MODULE ASSY-LAV A<br>(EQUIPMENT/FURNISHINGS<br>ONLY)                                                                                                                                                                                                                                                    | 417475            |                      |
| - 1                                                     | 1L300010-0040A |               | MODULE ASSY-LAV A<br>(EQUIPMENT/FURNISHINGS<br>ONLY)<br>SUPPLIER CODE:<br>V6S8D7<br>FUNCTIONAL DESCRIPTION:<br>PROVIDES LAVATORY<br>FACILITIES FOR<br>PASSENGERS AND CREW<br>ELECTRICAL EQUIP NUMBER:<br>M01415<br>COMPONENT MAINT MANUAL REF:<br>25-40-40<br>FOR NHA/OTHER SYS DET SEE:<br>25-40-11-01 | 417475            | RF                   |
| - 50                                                    | 9L500001-107   |               | .CLAMP INSTL-ELECTRICAL<br>SUPPLIER CODE:<br>V6S8D7                                                                                                                                                                                                                                                     | 417475            | 4                    |
| 55                                                      | MS3367-5-9     |               | ..STRAP<br>STANDARD SUBSTITUTION:<br>BACS38K5                                                                                                                                                                                                                                                           | 417475            | 1                    |
| 60                                                      | CA2030-3       |               | ..CLAMP-<br>SUPPLIER CODE:<br>V03296<br>ATTACHING PARTS                                                                                                                                                                                                                                                 | 417475            | 1                    |
| 65                                                      | NAS1801-3-10   |               | ..SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-10                                                                                                                                                                                                                                                       | 417475            | 1                    |
| 70                                                      | NAS43DD3-16N   |               | ..SPACER<br>STANDARD SUBSTITUTION:<br>NAS43DD3-16FC                                                                                                                                                                                                                                                     | 417475            | 1                    |
| 75                                                      | NAS1149D0316K  |               | ..WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J<br>-----*-----                                                                                                                                                                                                                                      | 417475            | 2                    |
| - 80                                                    | 9L500001-115   |               | .CLAMP INSTL-ELECTRICAL<br>SUPPLIER CODE:<br>V6S8D7                                                                                                                                                                                                                                                     | 417475            | 2                    |
| 85                                                      | MS3367-5-9     |               | ..STRAP<br>STANDARD SUBSTITUTION:<br>BACS38K5                                                                                                                                                                                                                                                           | 417475            | 1                    |
| 90                                                      | CA2030-3       |               | ..CLAMP-<br>SUPPLIER CODE:<br>V03296                                                                                                                                                                                                                                                                    | 417475            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |               |                                                                                                                                                                                                                                                                                                         |                   |                      |

- ITEM NOT ILLUSTRATED

RYR

25-40-11-21S

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-11  
FIG. 21S  
PAGE 1  
APR 15/23


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER   | 1 2 3 4 5 6 7 NOMENCLATURE                                         | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|---------------|--------------------------------------------------------------------|-------------------|----------------------|
| 21S                                                     |               | ATTACHING PARTS                                                    |                   |                      |
| 95                                                      | NAS1801-3-14  | ..SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-14                  | 417475            | 1                    |
| 100                                                     | NAS43DD3-32N  | ..SPACER<br>STANDARD SUBSTITUTION:<br>NAS43DD3-32FC                | 417475            | 1                    |
| 105                                                     | NAS1149D0316K | ..WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J<br>-----*----- | 417475            | 2                    |
| - 110                                                   | 9L500001-103  | .CLAMP INSTL-ELECTRICAL<br>SUPPLIER CODE:<br>V6S8D7                | 417475            | 2                    |
| 115                                                     | MS3367-5-9    | ..STRAP<br>STANDARD SUBSTITUTION:<br>BACS38K5                      | 417475            | 1                    |
| 120                                                     | CA2030-3      | ..CLAMP-<br>SUPPLIER CODE:<br>V03296<br>ATTACHING PARTS            | 417475            | 1                    |
| 125                                                     | NAS1801-3-6   | ..SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                   | 417475            | 1                    |
| 130                                                     | NAS1149D0316K | ..WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J<br>-----*----- | 417475            | 1                    |
| 135                                                     | MS3367-5-9    | .STRAP<br>STANDARD SUBSTITUTION:<br>BACS38K5                       | 417475            | 1                    |
| 140                                                     | CA2030-1      | .CLAMP-<br>SUPPLIER CODE:<br>V03296<br>ATTACHING PARTS             | 417475            | 1                    |
| 145                                                     | NAS1801-3-10  | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-10                   | 417475            | 1                    |
| 150                                                     | NAS43DD3-16N  | .SPACER<br>STANDARD SUBSTITUTION:<br>NAS43DD3-16FC                 | 417475            | 1                    |
| 153                                                     | NAS1149D0316K | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J<br>-----*-----  | 417475            | 1                    |
| 155                                                     | 1L500109-905  | .STRAP-FIRE BLANKET<br>SUPPLIER CODE:<br>V6S8D7                    | 417475            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |               |                                                                    |                   |                      |

- ITEM NOT ILLUSTRATED

R Y R

25-40-11-21S

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-11  
 FIG. 21S  
 PAGE 2  
 APR 15/23


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER   | 1 2 3 4 5 6 7 NOMENCLATURE                                         | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|---------------|--------------------------------------------------------------------|-------------------|----------------------|
| 21S                                                     |               |                                                                    |                   |                      |
| 160                                                     | NAS1801-3-6   | ATTACHING PARTS<br>.SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6 | 417475            | 2                    |
| 165                                                     | NAS1149D0316K | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J                 | 417475            | 1                    |
| 168                                                     | NAS1149D0332K | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0332J                 | 417475            | 1                    |
| 170                                                     | 1L500109-901  | -----*-----<br>.STRAP-FIRE BLANKET<br>SUPPLIER CODE:<br>V6S8D7     | 417475            | 1                    |
| 175                                                     | NAS1801-3-6   | ATTACHING PARTS<br>.SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6 | 417475            | 3                    |
| 180                                                     | NAS1149D0316K | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J                 | 417475            | 3                    |
| 185                                                     | 1L500109-311  | -----*-----<br>.STRAP-FIRE BLANKET<br>SUPPLIER CODE:<br>V6S8D7     | 417475            | 1                    |
| 190                                                     | NAS1801-3-6   | ATTACHING PARTS<br>.SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6 | 417475            | 5                    |
| 195                                                     | NAS1149D0316K | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J                 | 417475            | 5                    |
| 200                                                     | 1L500109-313  | -----*-----<br>.STRAP-FIRE BLANKET<br>SUPPLIER CODE:<br>V6S8D7     | 417475            | 1                    |
| 205                                                     | NAS1801-3-6   | ATTACHING PARTS<br>.SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6 | 417475            | 4                    |
| 210                                                     | NAS1149D0316K | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J                 | 417475            | 4                    |
| 215                                                     | 1L500109-315  | -----*-----<br>.STRAP-FIRE BLANKET<br>SUPPLIER CODE:<br>V6S8D7     | 417475            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |               |                                                                    |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R

25-40-11-21S

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-11  
 FIG. 21S  
 PAGE 3  
 APR 15/23


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER   | 1 2 3 4 5 6 7       | NOMENCLATURE                            | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|---------------|---------------------|-----------------------------------------|-------------------|----------------------|
| 21 S                                                    |               |                     | ATTACHING PARTS                         |                   |                      |
| 220                                                     | NAS1801-3-6   | .SCREW              | STANDARD SUBSTITUTION:<br>BACS12HN3-6   | 417475            | 1                    |
| 225                                                     | NAS1149D0316K | .WASHER             | STANDARD SUBSTITUTION:<br>NAS1149D0316J | 417475            | 1                    |
|                                                         |               | -----*-----         |                                         |                   |                      |
| 230                                                     | 1L500109-317  | .STRAP-FIRE BLANKET | SUPPLIER CODE:<br>V6S8D7                | 417475            | 1                    |
|                                                         |               |                     | ATTACHING PARTS                         |                   |                      |
| 235                                                     | NAS1801-3-6   | .SCREW              | STANDARD SUBSTITUTION:<br>BACS12HN3-6   | 417475            | 3                    |
| 240                                                     | NAS1149D0316K | .WASHER             | STANDARD SUBSTITUTION:<br>NAS1149D0316J | 417475            | 3                    |
|                                                         |               | -----*-----         |                                         |                   |                      |
| 245                                                     | 1L500109-903  | .STRAP-FIRE BLANKET | SUPPLIER CODE:<br>V6S8D7                | 417475            | 1                    |
|                                                         |               |                     | ATTACHING PARTS                         |                   |                      |
| 250                                                     | NAS1801-3-6   | .SCREW              | STANDARD SUBSTITUTION:<br>BACS12HN3-6   | 417475            | 3                    |
| 255                                                     | NAS1149D0316K | .WASHER             | STANDARD SUBSTITUTION:<br>NAS1149D0316J | 417475            | 3                    |
|                                                         |               | -----*-----         |                                         |                   |                      |
| 260                                                     | 1L500109-305  | .STRAP-FIRE BLANKET | SUPPLIER CODE:<br>V6S8D7                | 417475            | 1                    |
|                                                         |               |                     | ATTACHING PARTS                         |                   |                      |
| 265                                                     | NAS1801-3-6   | .SCREW              | STANDARD SUBSTITUTION:<br>BACS12HN3-6   | 417475            | 10                   |
| 270                                                     | NAS1149D0332K | .WASHER             | STANDARD SUBSTITUTION:<br>NAS1149D0332J | 417475            | 4                    |
| 275                                                     | NAS1149D0316K | .WASHER             | STANDARD SUBSTITUTION:<br>NAS1149D0316J | 417475            | 6                    |
|                                                         |               | -----*-----         |                                         |                   |                      |
| 280                                                     | 1L500109-335  | .BLANKET-FIRE       | SUPPLIER CODE:<br>V6S8D7                | 417475            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |               |                     |                                         |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R

25-40-11-21S

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-11  
 FIG. 21S  
 PAGE 4  
 APR 15/23


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER   | 1 2 3 4 5 6 7<br>NOMENCLATURE                                                                                                                                                                                                                                                                                        | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|---------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 21S<br>295                                              | MS3367-5-9    | .STRAP<br>STANDARD SUBSTITUTION:<br>BACS38K5                                                                                                                                                                                                                                                                         | 417475            | AR                   |
| - 300                                                   | MS3367-4-9    | .STRAP-<br>STANDARD SUBSTITUTION:<br>BACS38K4<br>SUPPLIER SPEC NUMBER:<br>2504695-4<br>V07187                                                                                                                                                                                                                        | 417475            | AR                   |
| 305                                                     | 4576001-101   | .BOX ASSY-OXY<br>SUPPLIER CODE:<br>V16827<br>FUNCTIONAL DESCRIPTION:<br>STORES OXYGEN AND MASK<br>ASSEMBLIES. CONTROLS THE<br>DELIVERY OF OXYGEN TO<br>EACH MASK AND<br>COMMUNICATES WITH THE<br>AIRPLANE NETWORK.<br>COMPONENT MAINT MANUAL REF:<br>25-23-68<br>FOR DETAILS SEE:<br>35-21-00-01A<br>ATTACHING PARTS | 417475            | 1                    |
| 310                                                     | NAS1801-3-6   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                                                                                                                                                                                                                                                                      | 417475            | 4                    |
| 315                                                     | NAS1149D0332J | .WASHER<br>-----*-----                                                                                                                                                                                                                                                                                               | 417475            | 4                    |
| 320                                                     | 4L500103-13   | .BRACKET-<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                                                                                                                                                                                                                                                             | 417475            | 4                    |
| 325                                                     | NAS1801-3-6   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                                                                                                                                                                                                                                                                      | 417475            | 4                    |
| 330                                                     | NAS1149D0332J | .WASHER<br>-----*-----                                                                                                                                                                                                                                                                                               | 417475            | 4                    |
| 335                                                     | 1L500109-693  | .FITTING-TIE-ROD<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                                                                                                                                                                                                                                                      | 417475            | 1                    |
| 340                                                     | NAS1801-3-8   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-8                                                                                                                                                                                                                                                                      | 417475            | 12                   |
| 345                                                     | NAS1149D0332K | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0332J<br>-----*-----                                                                                                                                                                                                                                                    | 417475            | 12                   |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |               |                                                                                                                                                                                                                                                                                                                      |                   |                      |

- ITEM NOT ILLUSTRATED

RYR

25-40-11-21S

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-11  
 FIG. 21S  
 PAGE 5  
 AUG 15/23


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 NOMENCLATURE                                                        | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|-----------------------------------------------------------------------------------|-------------------|----------------------|
| 21S<br>350                                              | 1L500105-15    | .THRESHOLD-<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                        | 417475            | 1                    |
| 355                                                     | NAS8703A4      | .BOLT<br>STANDARD SUBSTITUTION:<br>BACB30ZE3K4<br>-----*-----                     | 417475            | 4                    |
| 360                                                     | 1L500109-147   | .SPACER-THRESHOLD<br>SUPPLIER CODE:<br>V6S8D7                                     | 417475            | 1                    |
| 365                                                     | 1L400109-407BA | .KICKSTRIP ASSY-<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                   | 417475            | 1                    |
| 370                                                     | NAS514P832-5   | .SCREW                                                                            | 417475            | 2                    |
| 375                                                     | NAS514P632-5   | .SCREW<br>-----*-----                                                             | 417475            | 2                    |
| 380                                                     | 1L500109-467BA | ..ENDCAP-<br>SUPPLIER CODE:<br>V6S8D7                                             | 417475            | 1                    |
| 385                                                     | 1L500109-463BA | ..CAP-<br>SUPPLIER CODE:<br>V6S8D7                                                | 417475            | 1                    |
| 390                                                     | 1L500109-469BA | ..RETAINER-<br>SUPPLIER CODE:<br>V6S8D7                                           | 417475            | 1                    |
| 395                                                     | 1L500109-295   | .COVER-FTG<br>SUPPLIER CODE:<br>V6S8D7                                            | 417475            | 1                    |
| 400                                                     | 1L360010-0040A | .LAVATORY ASSY-<br>SUPPLIER CODE:<br>V6S8D7                                       | 417475            | 1                    |
| 405                                                     | 1L306010-155CH | ..STRUCTURE ASSY-<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-40-11-24Q | 417475            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |                                                                                   |                   |                      |

— ITEM NOT ILLUSTRATED

RYR

25-40-11-21S

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

25-40-11  
 FIG. 21S  
 PAGE 6  
 AUG 15/23


**BOEING**  
 737-600/700/800/900  
 PARTS CATALOG (MAINTENANCE)

| FIG<br>ITEM                                             | PART NUMBER  | 1 2 3 4 5 6 7 | NOMENCLATURE                                                                                                                                                                                                                        | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|--------------|---------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 21S<br>410                                              | 3L306010-115 |               | ..ELECTRICAL INSTL-<br>SUPPLIER CODE:<br>V6S8D7<br>FUNCTIONAL REFERENCE:<br>EQUIPMENT/FURNISHINGS<br>FOR DETAILS SEE<br>25-41-60-05L<br>LIGHTS<br>FOR DETAILS SEE<br>33-27-51-18K<br>WATER/WASTE<br>FOR DETAILS SEE<br>38-32-04-06C | 417475            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |              |               |                                                                                                                                                                                                                                     |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R




25-40-11-21S

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

25-40-11  
 FIG. 21S  
 PAGE 7  
 AUG 15/23



**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

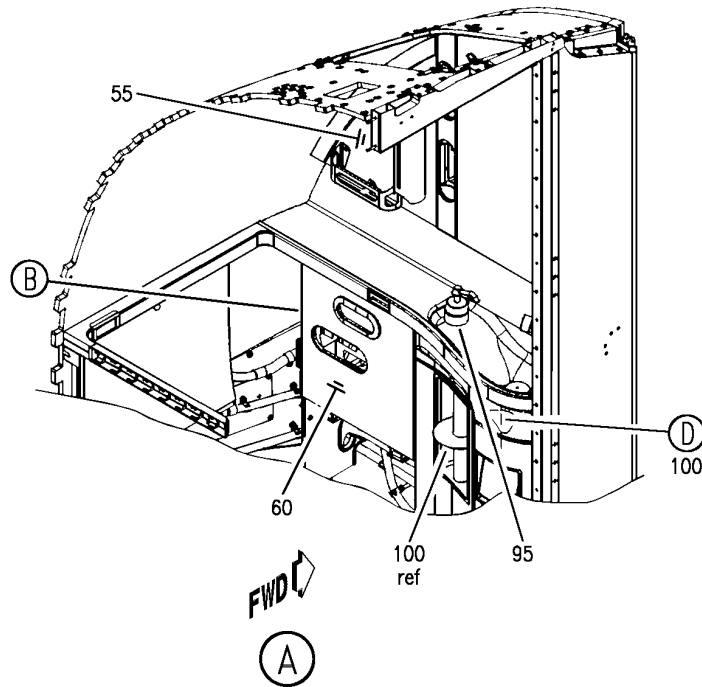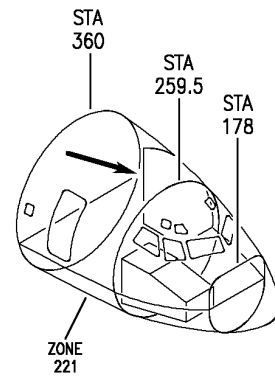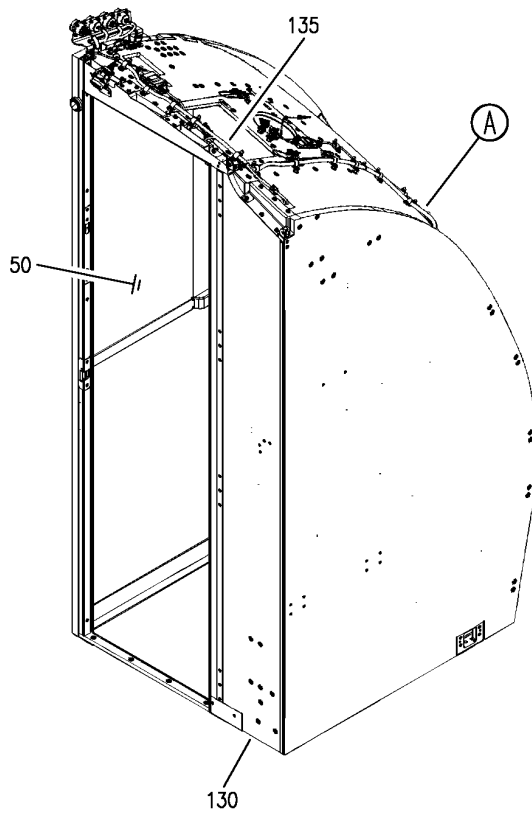

E 25401123D SHT 1 REV 261

LAVATORY ASSY-LAV  
FIGURE 23D (SHEET 1)



R Y R  
APR 15/18

**25-40-11-23D**

25-40-11-23D  
PAGE 0

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

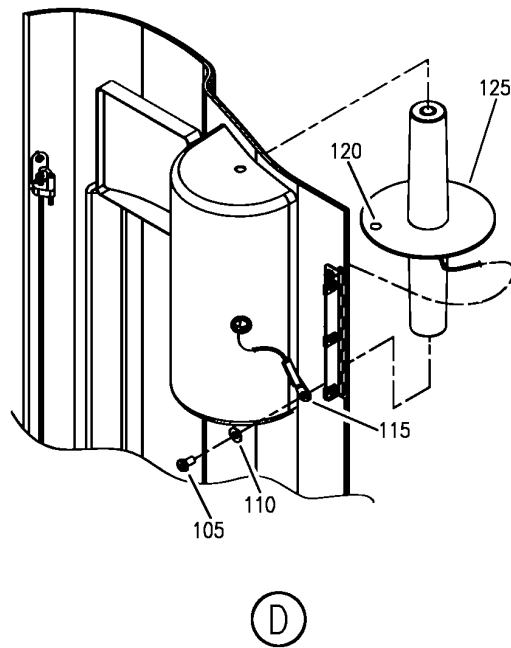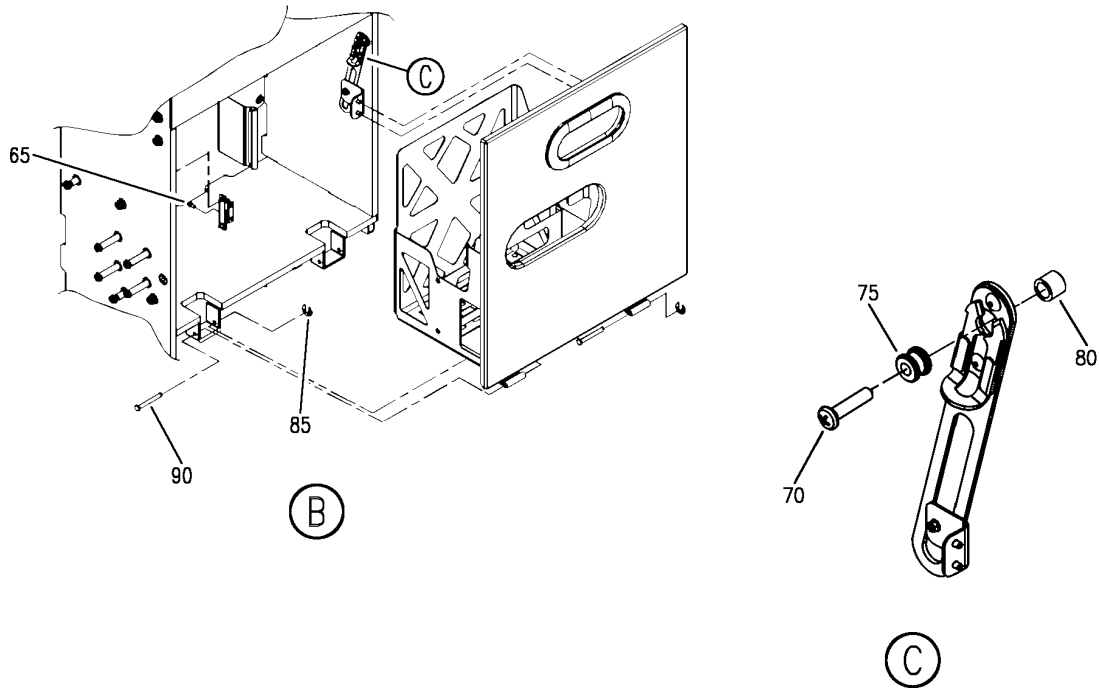

E 25401123D SHT 2 REV 261

LAVATORY ASSY-LAV  
FIGURE 23D (SHEET 2)

**25-40-11-23D**

RJR  
APR 15/18

25-40-11-23D  
PAGE 0A

ECCN 9E991 BOEING PROPRIETARY – See title page for details.


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|-----------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 23D                                                     |                |                                                                                                           |                   |                      |
| - 1                                                     | 1L360010-0171A | LAVATORY ASSY-LAV<br>LAVATORY ASSY-LAV A<br>SUPPLIER CODE:<br>V6S8D7<br>FOR NHA SEE:<br>25-40-11-11N      | 509999<br>509999  | RF                   |
| 50                                                      | 1L400103-73    | .MIRROR ASSY-AFT WALL<br>SUPPLIER CODE:<br>V6S8D7                                                         | 509999            | 1                    |
| 55                                                      | 1L400103-65    | .MIRROR ASSY-FIXED<br>SUPPLIER CODE:<br>V6S8D7                                                            | 509999            | 1                    |
| 60                                                      | 1L400201-109   | .DRAWER ASSY-AMENITIES<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-41-51-32H<br>ATTACHING PARTS | 509999            | 1                    |
| 65                                                      | NAS514P632-5   | .SCREW                                                                                                    | 509999            | 2                    |
| 70                                                      | NAS602-12P     | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12CK08-12<br>-----*-----                                          | 509999            | 1                    |
| 75                                                      | TL05-117-52    | .KEEPER-SLIDE LATCH<br>SUPPLIER CODE:<br>V94222<br>TRUE PART NUMBER:<br>TL-05-117-52                      | 509999            | 1                    |
| 80                                                      | NAS43DD3-16FC  | .SPACER                                                                                                   | 509999            | 1                    |
| 85                                                      | MS16633-1018   | .RING-RETAINING<br>STANDARD SUBSTITUTION:<br>MS16633-2018                                                 | 509999            | 2                    |
| 90                                                      | CPG3-151B      | .PIN-GROOVED CLEVIS<br>SUPPLIER CODE:<br>VOCUJ4<br>TRUE PART NUMBER:<br>CPG3-151-B                        | 509999            | 2                    |
| 95                                                      | 1L400401-211   | .SOAP DISPENSER ASSY-SOAP<br>DISP<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-41-51-03X         | 509999            | 1                    |
| 100                                                     | 1L400401-219   | .HOLDER ASSY-TOILET PAPER<br>SUPPLIER CODE:<br>V6S8D7                                                     | 509999            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |                                                                                                           |                   |                      |

- ITEM NOT ILLUSTRATED

RYR

25-40-11-23D

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-11  
FIG. 23D  
PAGE 1  
APR 15/23


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                                                                                                                                         | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 23D                                                     |                |                                                                                                                                                                                                                                    |                   |                      |
| 105                                                     | NAS1801-3-5    | ATTACHING PARTS<br>.SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-5                                                                                                                                                                 | 509999            | 1                    |
| 110                                                     | NAS1149D0332J  | .WASHER<br>-----*-----                                                                                                                                                                                                             | 509999            | 1                    |
| 115                                                     | L94B1000S3     | ..LANYARD-<br>SUPPLIER CODE:<br>VOCUJ4<br>TRUE PART NUMBER:<br>L94B-1000S-3<br>MISCELLANEOUS DATA:<br>B/E PART NO:<br>LCCS-5-3-BB-1000<br>ATTACHING PARTS                                                                          | 509999            | 1                    |
| 120                                                     | MS20470AD6-6   | ..RIVET-<br>STANDARD SUBSTITUTION:<br>BACR15BB6AD6C<br>CONFIG CHG DATA FROM A CMM:<br>SUPSD BY MS20470A6-6                                                                                                                         | 509999            | 1                    |
| 120                                                     | MS20470A6-6    | ..RIVET-<br>STANDARD SUBSTITUTION:<br>BACR15BB6A6C<br>CONFIG CHG DATA FROM A CMM:<br>SUPERSEDES MS20470AD6-6<br>-----*-----                                                                                                        | 509999            | 1                    |
| 125                                                     | 1L400401-145   | ..HOLDER-<br>SUPPLIER CODE:<br>V6S8D7                                                                                                                                                                                              | 509999            | 1                    |
| 130                                                     | 1L306010-437HF | .STRUCTURE ASSY-<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-40-11-28M                                                                                                                                                   | 509999            | 1                    |
| 135                                                     | 3L306010-143   | .ELECTRICAL INSTL-<br>SUPPLIER CODE:<br>V6S8D7<br>FUNCTIONAL REFERENCE:<br>EQUIPMENT/FURNISHINGS<br>FOR DETAILS SEE<br>25-41-60-29A<br>LIGHTS<br>FOR DETAILS SEE<br>33-27-51-13G<br>WATER/WASTE<br>FOR DETAILS SEE<br>38-32-04-12U | 509999            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |                                                                                                                                                                                                                                    |                   |                      |

— ITEM NOT ILLUSTRATED




RYR

25-40-11-23D

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-11  
FIG. 23D  
PAGE 2  
JUN 15/24

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

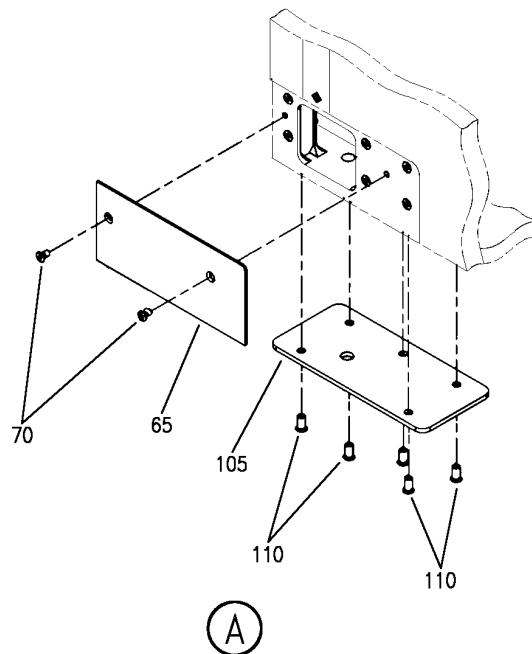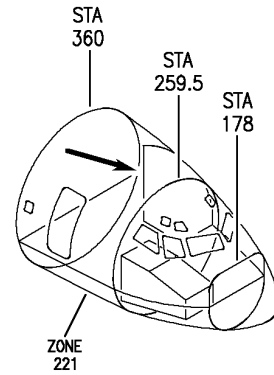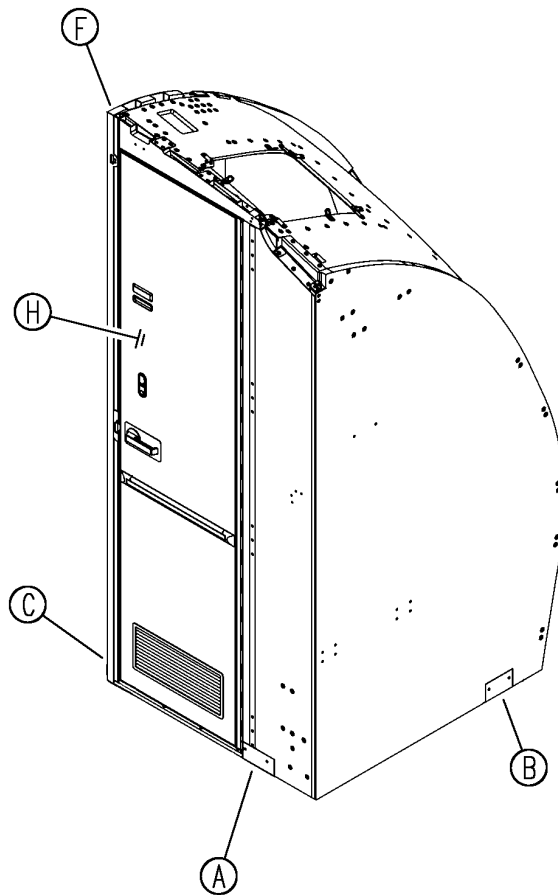

E 25401124Q SHT 1 REV 241

STRUCTURE ASSY-LAV  
FIGURE 24Q (SHEET 1)





**25-40-11-24Q**

R Y R  
O C T 15 / 16

25-40-11-24Q  
PAGE 0

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

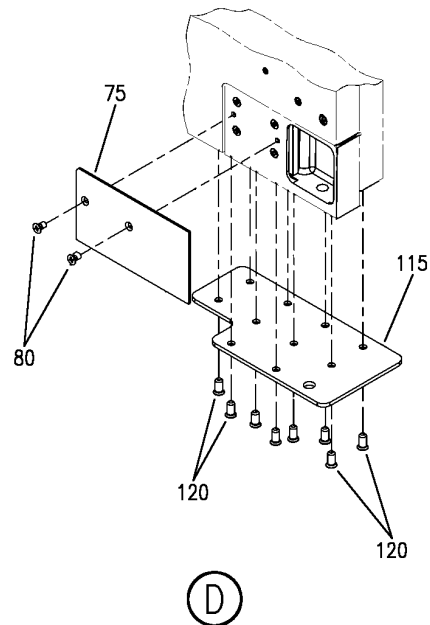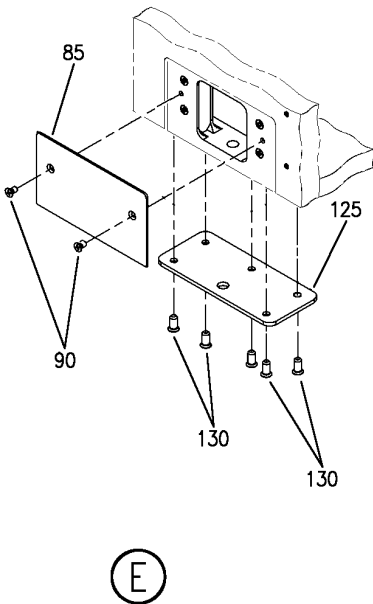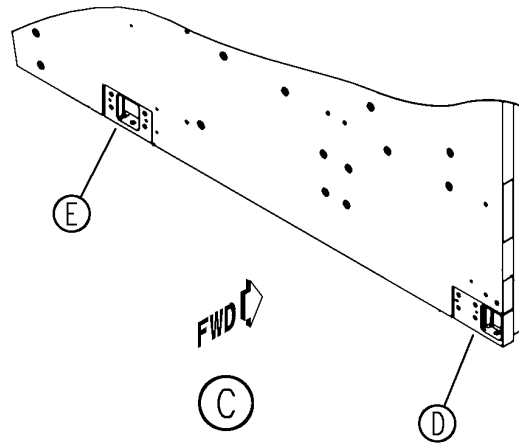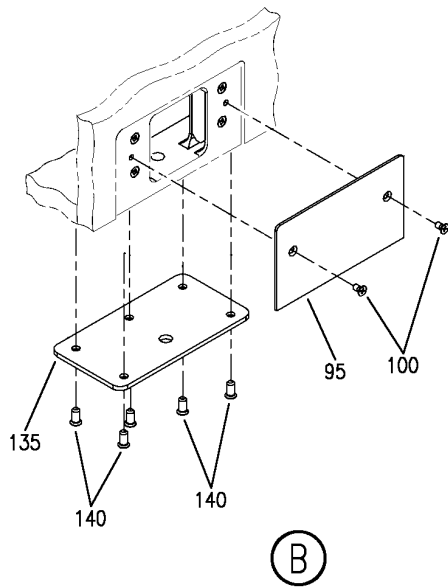

E 25401124Q SHT 2 REV 241

STRUCTURE ASSY-LAV  
FIGURE 24Q (SHEET 2)


**25-40-11-24Q**

R Y R  
O C T 15 / 16

25-40-11-24Q  
PAGE 0A

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

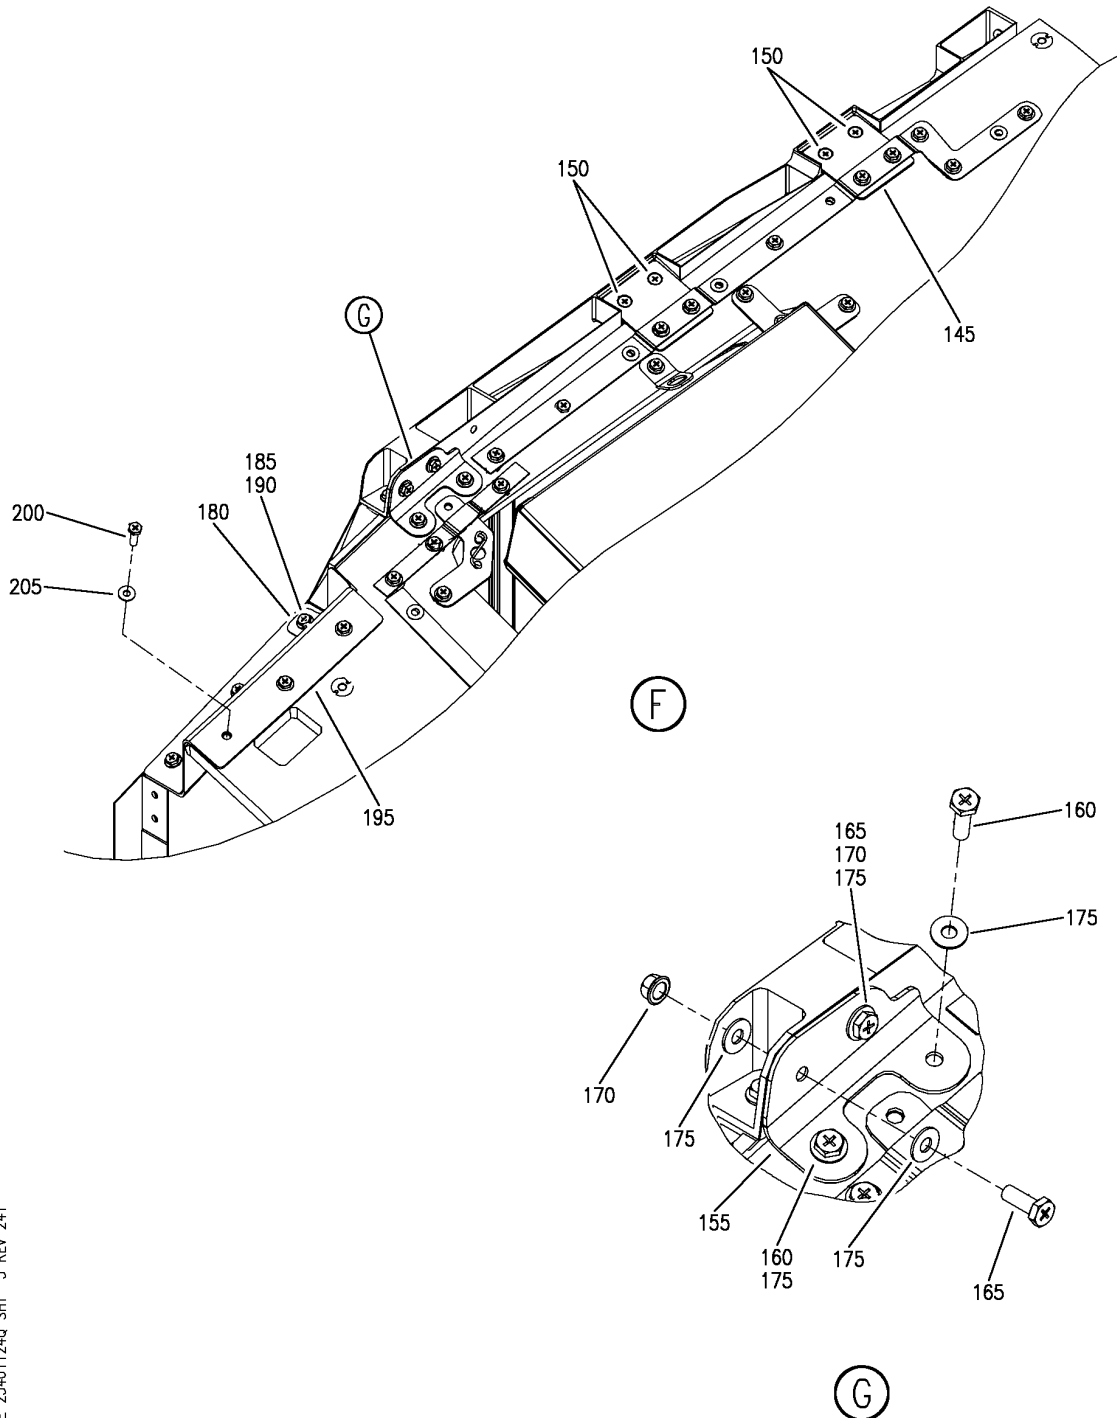

E 25401124Q SHT 3 REV 241

STRUCTURE ASSY-LAV  
FIGURE 24Q (SHEET 3)


**25-40-11-24Q**

R Y R  
O C T 15 / 16

25-40-11-24Q  
PAGE 0B

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

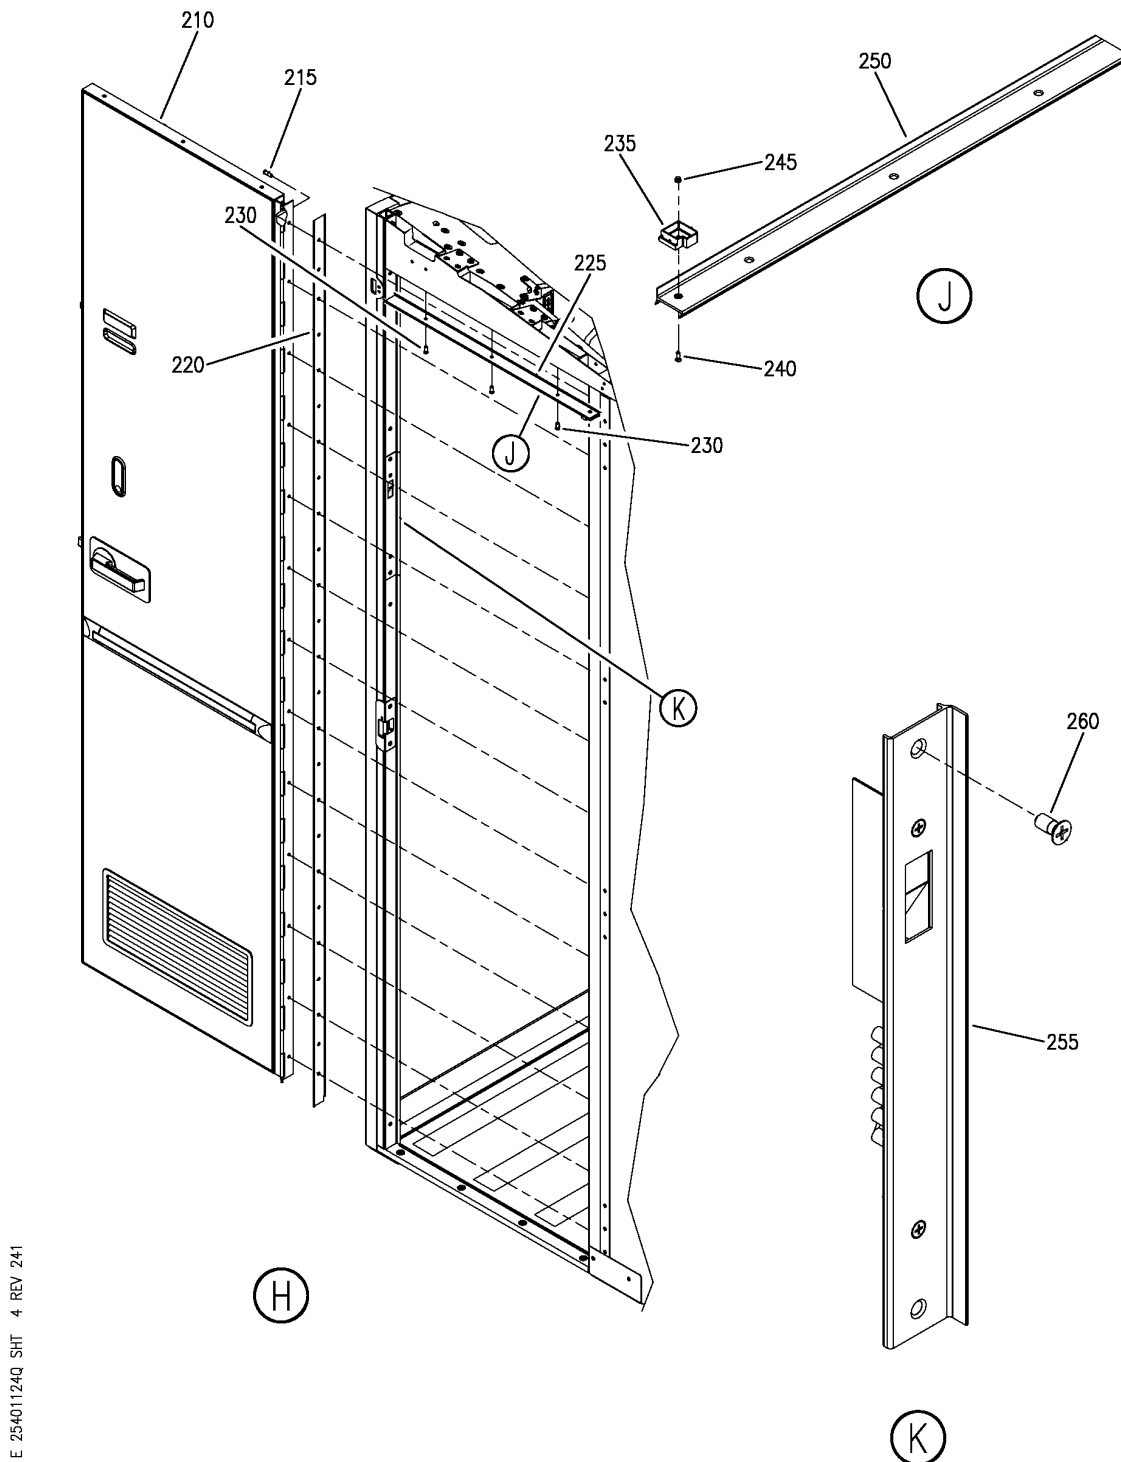

E 25401124Q SHT 4 REV 241

STRUCTURE ASSY-LAV  
FIGURE 24Q (SHEET 4)

**25-40-11-24Q**

RJR  
OCT 15/16

25-40-11-24Q  
PAGE 0C

ECCN 9E991 BOEING PROPRIETARY – See title page for details.




**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER     | 1 2 3 4 5 6 7<br>NOMENCLATURE                                                                                                                                                             | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|-----------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 24Q                                                     |                 |                                                                                                                                                                                           |                   |                      |
| - 1                                                     | 1L306010-155CH  | STRUCTURE ASSY-LAV<br>STRUCTURE ASSY-LAV A<br>SUPPLIER CODE:<br>V6S8D7<br>FOR NHA SEE:<br>25-40-11-21S                                                                                    | 417475<br>417475  | RF                   |
| - 50                                                    | 1L306010-155CH1 | .STRUCTURE INSTL-<br>SUPPLIER CODE:<br>V6S8D7<br>FUNCTIONAL REFERENCE:<br>EQUIPMENT/FURNISHINGS<br>FOR DETAILS SEE<br>25-41-21-16P<br>LIGHTS<br>FOR DETAILS SEE<br>33-26-03-33W           | 417475            | RF                   |
| - 55                                                    | 1L306010-155CH2 | .STRUCTURE INSTL-<br>SUPPLIER CODE:<br>V6S8D7<br>FUNCTIONAL REFERENCE:<br>EQUIPMENT/FURNISHINGS<br>FOR DETAILS SEE<br>25-40-11-24U<br>LIGHTS<br>FOR DETAILS SEE<br>33-26-03-33Y           | 417475            | RF                   |
| - 60                                                    | 1L306010-155CH3 | .STRUCTURE INSTL-<br>SUPPLIER CODE:<br>V6S8D7<br>FUNCTIONAL REFERENCE:<br>AIR CONDITIONING<br>FOR DETAILS SEE<br>21-45-51-14H<br>EQUIPMENT/FURNISHINGS<br>FOR DETAILS SEE<br>25-40-11-28B | 417475            | RF                   |
| 65                                                      | 1L500109-689CH  | .PLATE-COVER<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                                                                                                                               | 417475            | 1                    |
| 70                                                      | NAS514P632-5    | .SCREW<br>-----*-----                                                                                                                                                                     | 417475            | 2                    |
| 75                                                      | 1L500109-593CH  | .PLATE-COVER<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                                                                                                                               | 417475            | 1                    |
| 80                                                      | NAS514P632-5    | .SCREW<br>-----*-----                                                                                                                                                                     | 417475            | 2                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                 |                                                                                                                                                                                           |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R

25-40-11-24Q

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

25-40-11  
FIG. 24Q  
PAGE 1  
OCT 15/17


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 NOMENCLATURE                                   | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|--------------------------------------------------------------|-------------------|----------------------|
| 24Q<br>85                                               | 1L500109-685CH | .PLATE-COVER<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS  | 417475            | 1                    |
| 90                                                      | NAS514P632-5   | .SCREW<br>-----*-----                                        | 417475            | 2                    |
| 95                                                      | 1L500109-581   | .PLATE-COVER<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS  | 417475            | 1                    |
| 100                                                     | NAS514P632-5   | .SCREW<br>-----*-----                                        | 417475            | 2                    |
| 105                                                     | 1L500109-79    | .PLATE-SHEAR<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS  | 417475            | 1                    |
| 110                                                     | BACB30VF3K1    | .BOLT<br>-----*-----                                         | 417475            | 5                    |
| 115                                                     | 1L500109-749   | .PLATE-SHEAR<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS  | 417475            | 1                    |
| 120                                                     | BACB30VF3K1    | .BOLT<br>-----*-----                                         | 417475            | 10                   |
| 125                                                     | 1L500109-57    | .PLATE-SHEAR<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS  | 417475            | 1                    |
| 130                                                     | BACB30VF3K1    | .BOLT<br>-----*-----                                         | 417475            | 5                    |
| 135                                                     | 1L500109-81    | .SHEAR PLATE-<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS | 417475            | 1                    |
| 140                                                     | BACB30VF3K1    | .BOLT<br>-----*-----                                         | 417475            | 5                    |
| 145                                                     | 1L500109-151   | .BRACKET-<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS     | 417475            | 2                    |
| 150                                                     | NAS514P1032-8  | .SCREW<br>-----*-----                                        | 417475            | 4                    |
| 155                                                     | 1L500109-155   | .BRACKET-<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS     | 417475            | 1                    |
| 160                                                     | NAS1801-3-6    | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6              | 417475            | 2                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |                                                              |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R

25-40-11-24Q

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-11  
FIG. 24Q  
PAGE 2  
APR 15/23


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER   | 1 2 3 4 5 6 7 NOMENCLATURE                                                                     | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|---------------|------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 24Q<br>165                                              | NAS1801-3-8   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-8                                                | 417475            | 2                    |
| 170                                                     | MS21042L3     | .NUT<br>STANDARD SUBSTITUTION:<br>BACN11AG3                                                    | 417475            | 1                    |
| 175                                                     | NAS1149D0332K | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0332J<br>-----*-----                              | 417475            | 5                    |
| 180                                                     | 1L500109-403  | .BRACKET-CLOSEOUT<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                               | 417475            | 1                    |
| 185                                                     | NAS1801-3-6   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                                                | 417475            | 1                    |
| 190                                                     | NAS1149D0332K | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0332J<br>-----*-----                              | 417475            | 1                    |
| 195                                                     | 1L500109-101  | .BRACKET-CLG CLOSEOUT<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                           | 417475            | 1                    |
| 200                                                     | NAS1801-3-6   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                                                | 417475            | 5                    |
| 205                                                     | NAS1149D0332K | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0332J<br>-----*-----                              | 417475            | 5                    |
| 210                                                     | 1L400105-33CH | .DOOR ASSY-<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-41-13-14D<br>ATTACHING PARTS | 417475            | 1                    |
| 215                                                     | NAS8603-3     | .BOLT<br>-----*-----                                                                           | 417475            | 13                   |
| 220                                                     | 1L500109-161  | .TRIM-EDGE<br>SUPPLIER CODE:<br>V6S8D7                                                         | 417475            | 1                    |
| 225                                                     | 1L500109-461  | .TRIM ASSY-DOOR<br>SUPPLIER CODE:<br>V6S8D7                                                    | 417475            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |               |                                                                                                |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R

25-40-11-24Q

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-11  
 FIG. 24Q  
 PAGE 3  
 APR 15/23


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER  | 1 2 3 4 5 6 7 NOMENCLATURE                                                                           | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|--------------|------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 24Q                                                     |              |                                                                                                      |                   |                      |
| 230                                                     | NAS8703A1    | ATTACHING PARTS<br>.BOLT<br>STANDARD SUBSTITUTION:<br>BACB30ZE3K1<br>-----*-----                     | 417475            | 3                    |
| 235                                                     | 1L500105-169 | ..BLOCK-CLOSEOUT<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                                      | 417475            | 1                    |
| 240                                                     | NAS514P440-5 | ..SCREW                                                                                              | 417475            | 1                    |
| 245                                                     | MS21042-04   | ..NUT<br>STANDARD SUBSTITUTION:<br>MS21042L04<br>BACN11AG04<br>-----*-----                           | 417475            | 1                    |
| 250                                                     | 1L500109-459 | ..TRIM-OPENING<br>SUPPLIER CODE:<br>V6S8D7<br>CONFIG CHG DATA FROM A CMM:<br>SUPSD BY 1L500109-627   | 417475            | 1                    |
| 250                                                     | 1L500109-627 | ..TRIM-OPENING<br>SUPPLIER CODE:<br>V6S8D7<br>CONFIG CHG DATA FROM A CMM:<br>SUPERSEDES 1L500109-459 | 417475            | 1                    |
| 255                                                     | 1L400109-93  | .SWITCH ASSY-<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>33-26-03-14K<br>ATTACHING PARTS     | 417475            | 1                    |
| 260                                                     | NAS8703A1    | .BOLT<br>STANDARD SUBSTITUTION:<br>BACB30ZE3K1<br>-----*-----                                        | 417475            | 2                    |
| - 265                                                   | 1L500709-657 | .TRIM-HEADER<br>SUPPLIER CODE:<br>V6S8D7                                                             | 417475            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |              |                                                                                                      |                   |                      |

— ITEM NOT ILLUSTRATED



R Y R

25-40-11-24Q

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-11  
 FIG. 24Q  
 PAGE 4  
 APR 15/23

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

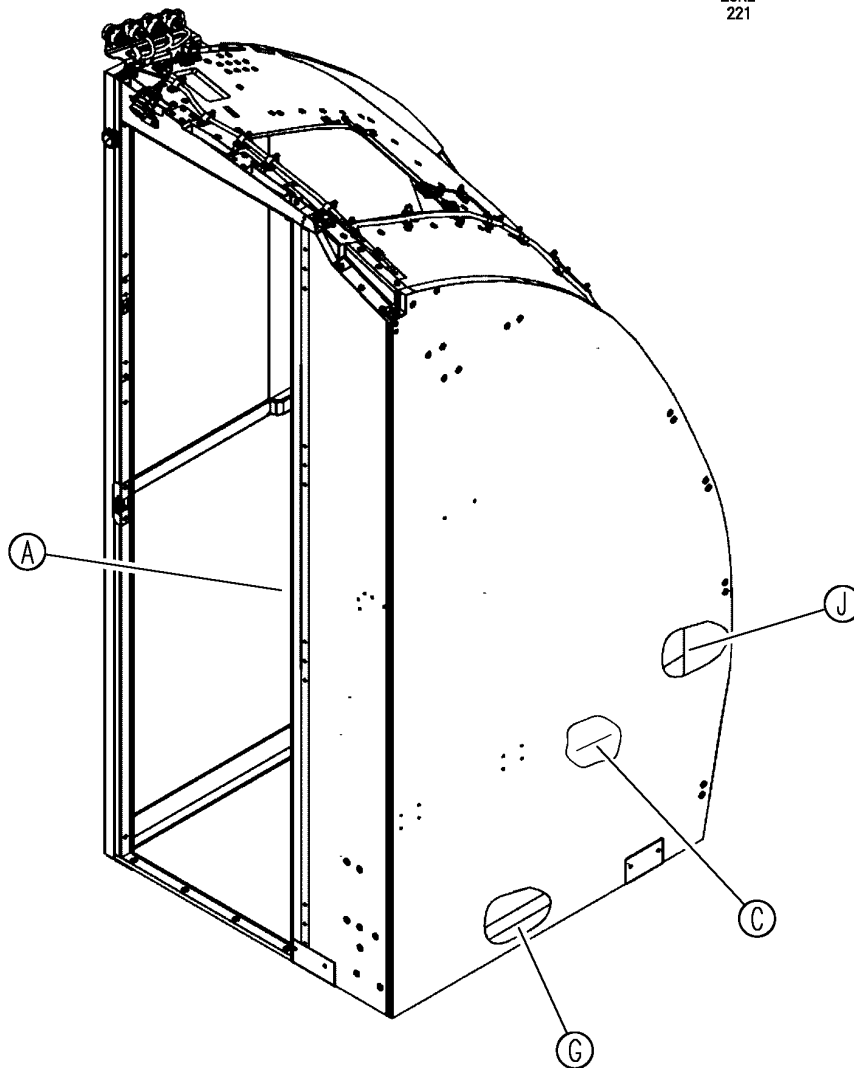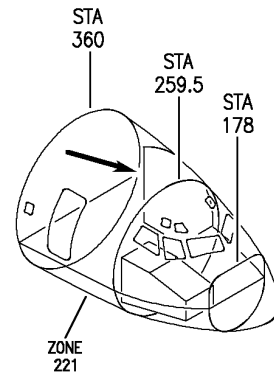

E 25401124U SHT 1 REV 273

STRUCTURE INSTL-LAV (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 24U (SHEET 1)


**25-40-11-24U**

R Y R  
A P R 15 / 19

25-40-11-24U  
PAGE 0

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

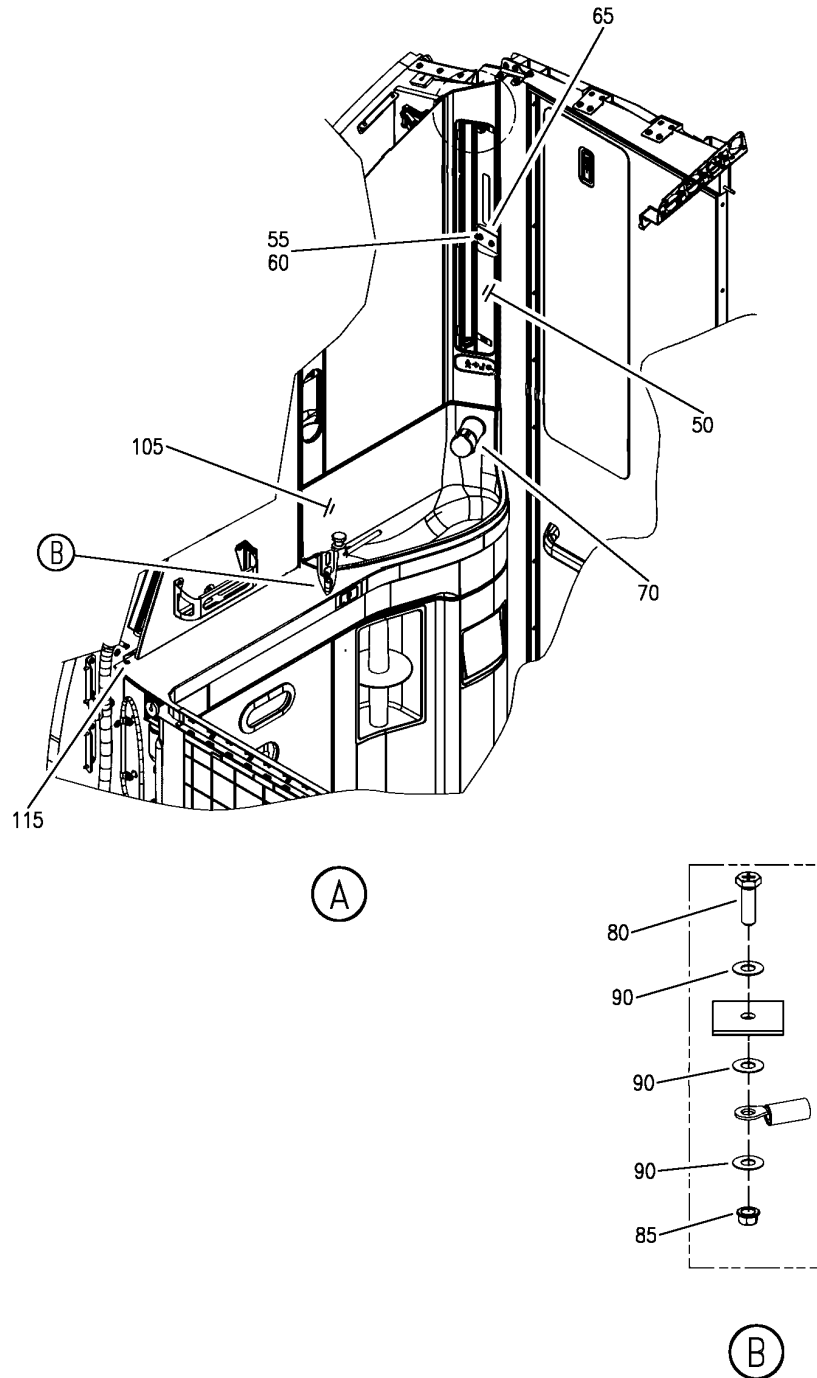

E 25401124U SHT 2 REV 241

STRUCTURE INSTL-LAV (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 24U (SHEET 2)



**25-40-11-24U**

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

R Y R  
O C T 15 / 16

25-40-11-24U  
PAGE 0A

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

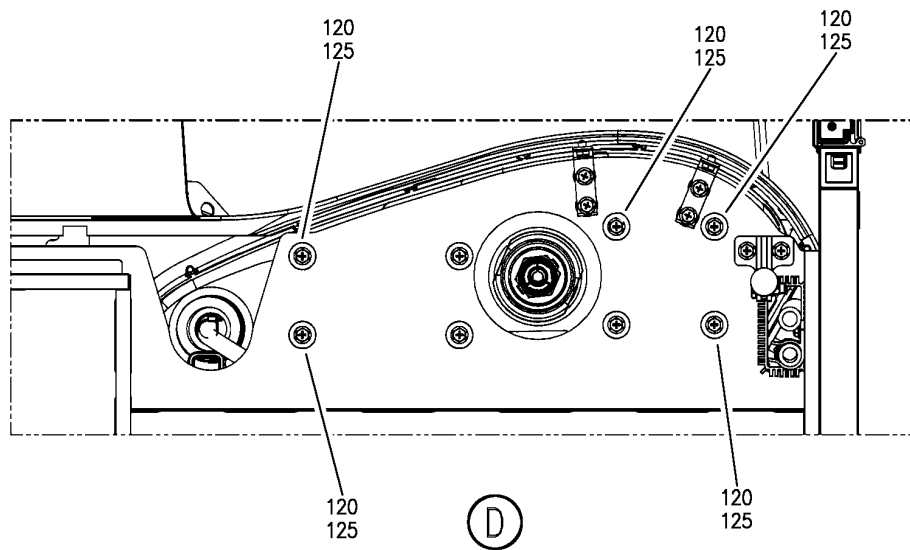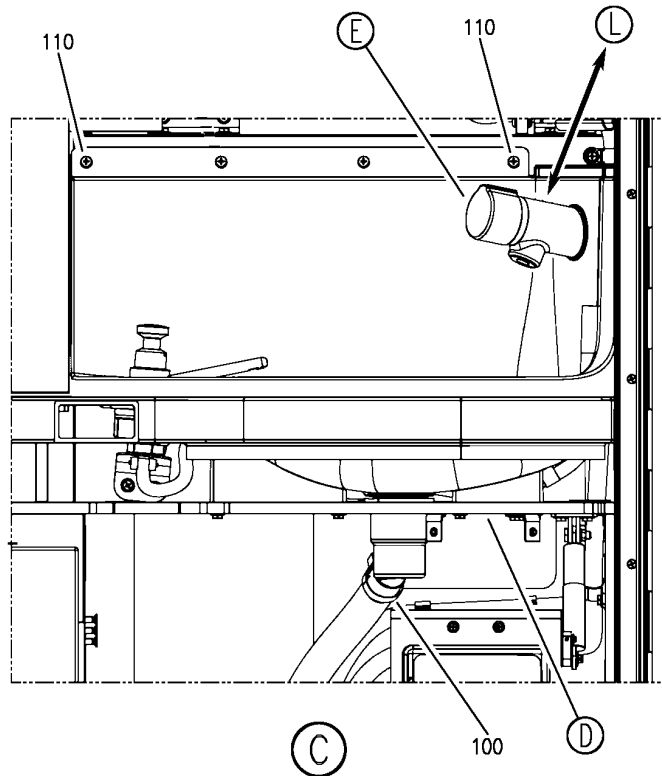

E 25401124U SHT 3 REV 273

STRUCTURE INSTL-LAV (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 24U (SHEET 3)



**25-40-11-24U**

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

R Y R  
A P R 15 / 19

25-40-11-24U  
PAGE 0B

**BOEING**  
 737-600/700/800/900  
 PARTS CATALOG (MAINTENANCE)

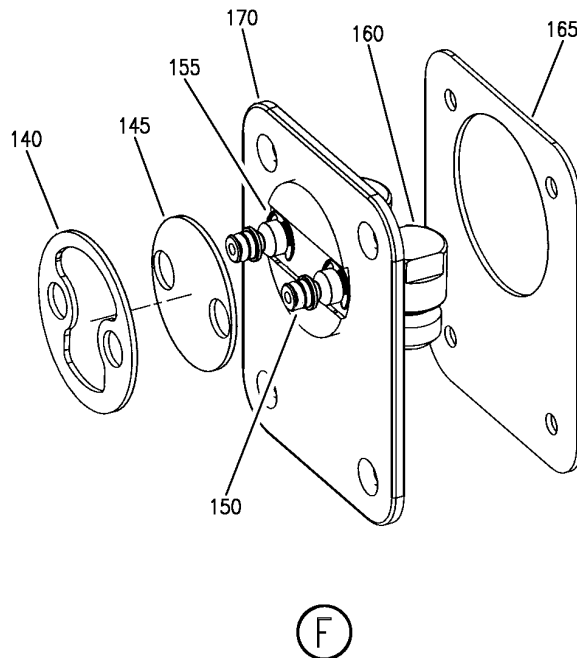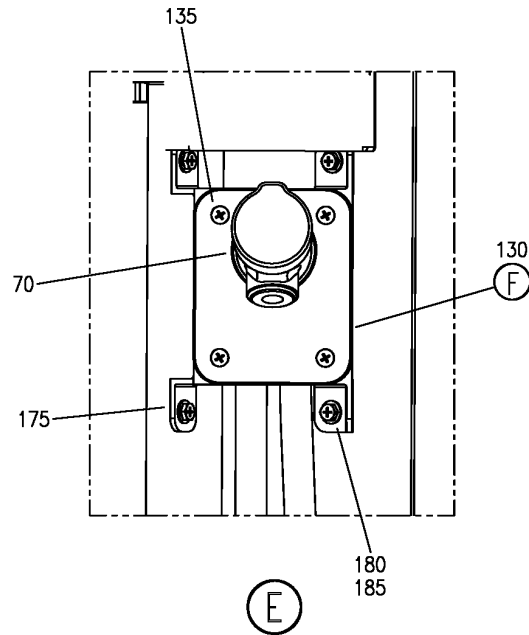

E 25401124U SHT 4 REV 273

STRUCTURE INSTL-LAV (EQUIPMENT/FURNISHINGS ONLY)  
 FIGURE 24U (SHEET 4)

**25-40-11-24U**



ECCN 9E991 BOEING PROPRIETARY – See title page for details.

R Y R  
 APR 15 / 19

25-40-11-24U  
 PAGE 0C



**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

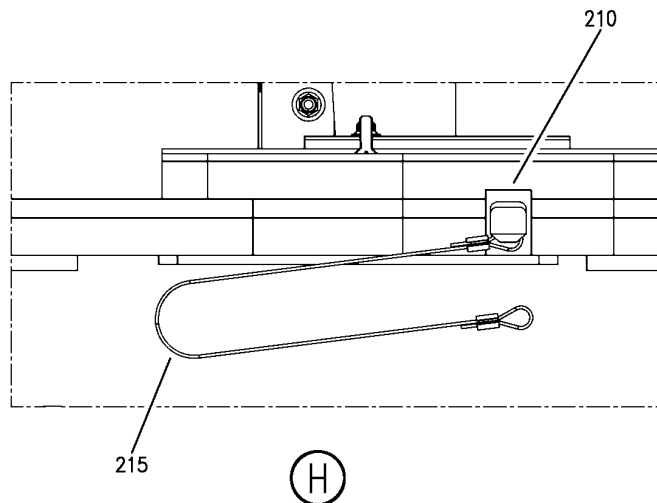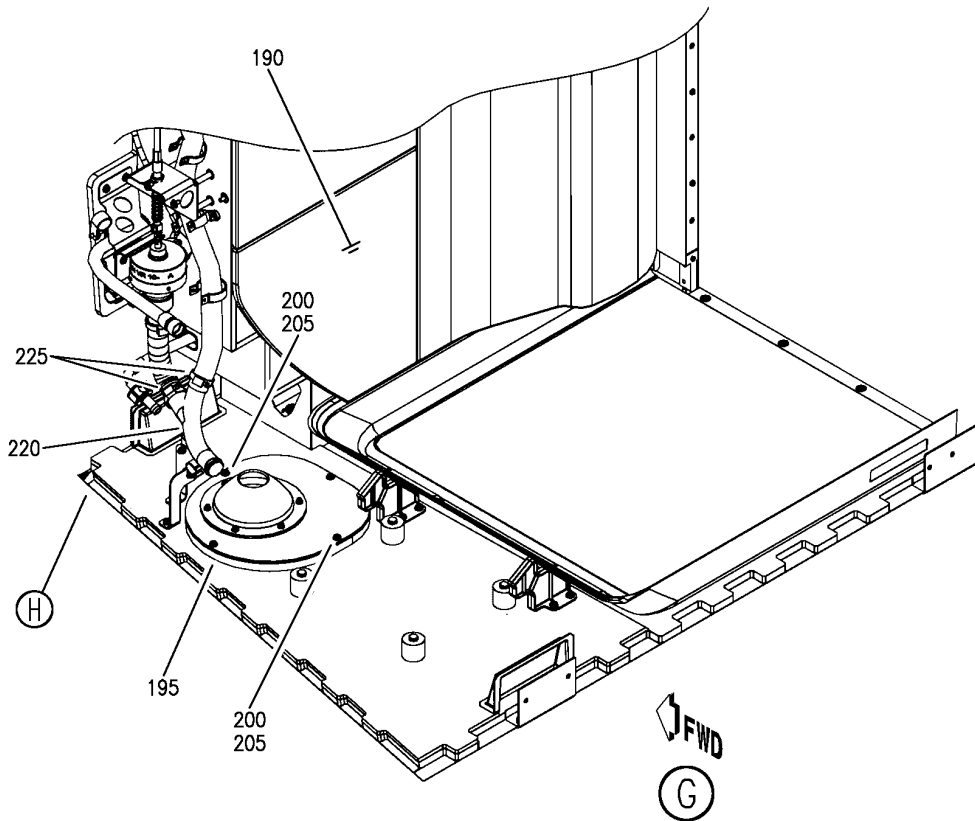

E 25401124U SHT 5 REV 241

STRUCTURE INSTL-LAV (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 24U (SHEET 5)


**25-40-11-24U**

R Y R  
O C T 15 / 16

25-40-11-24U  
PAGE 0D

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

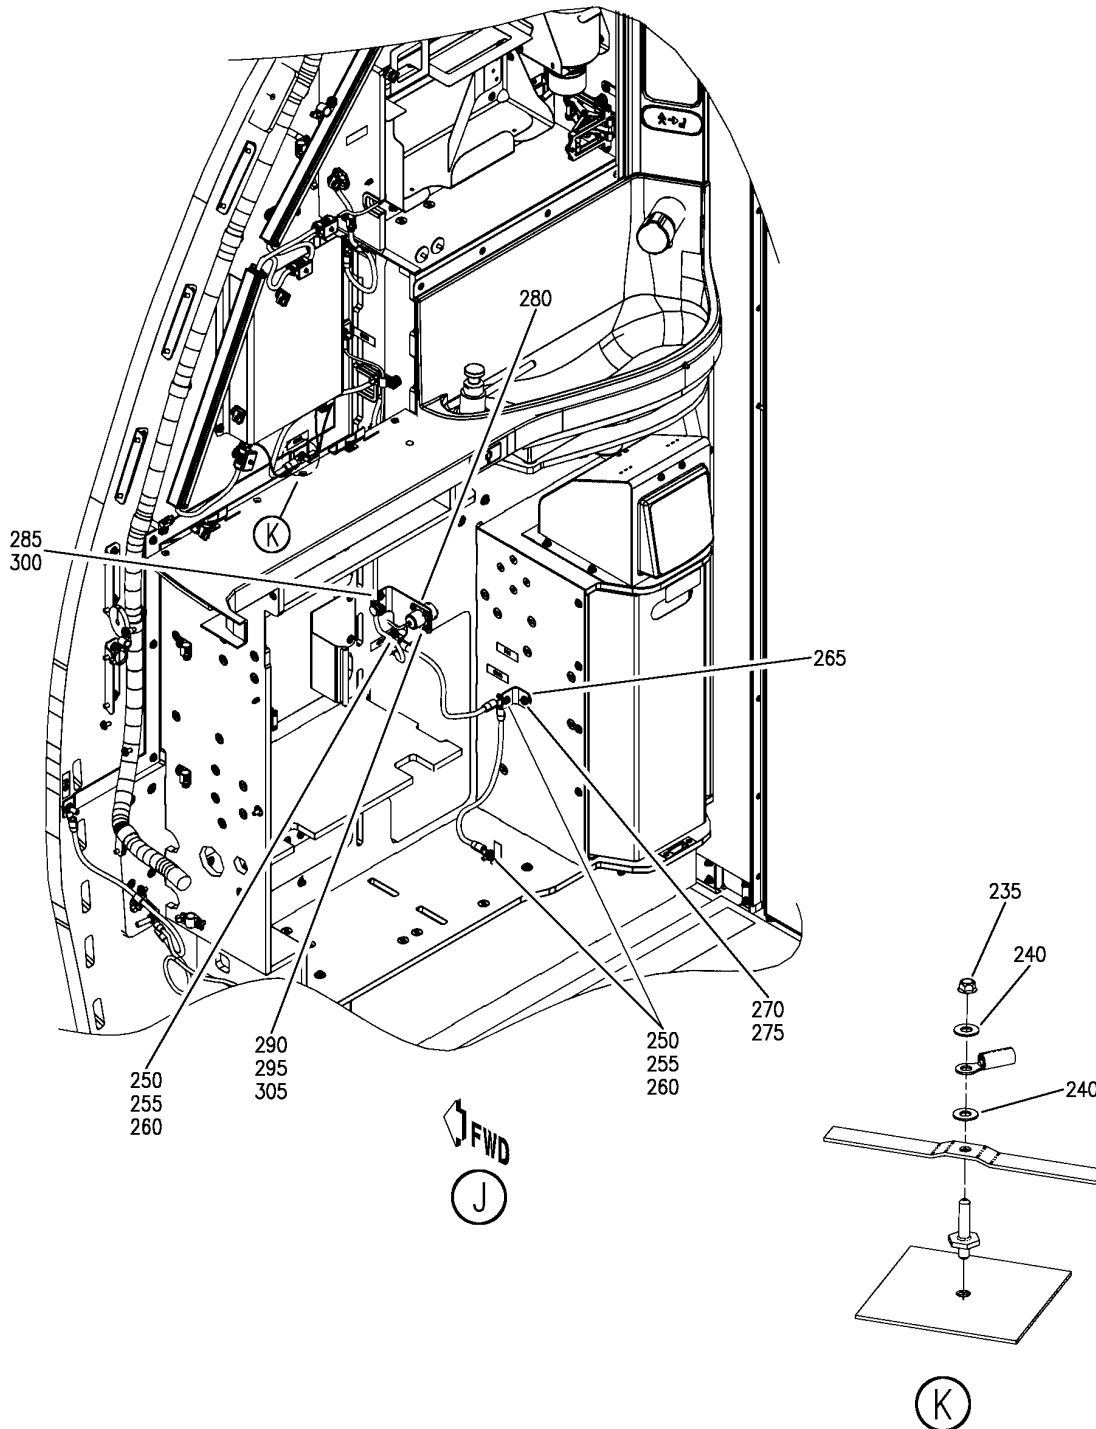

E 25401124U SHT 6 REV 241

STRUCTURE INSTL-LAV (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 24U (SHEET 6)



**25-40-11-24U**

R/YR  
OCT 15/16

25-40-11-24U  
PAGE 0E

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

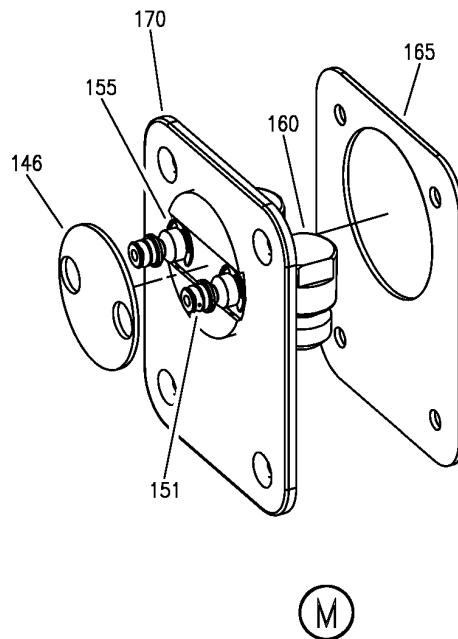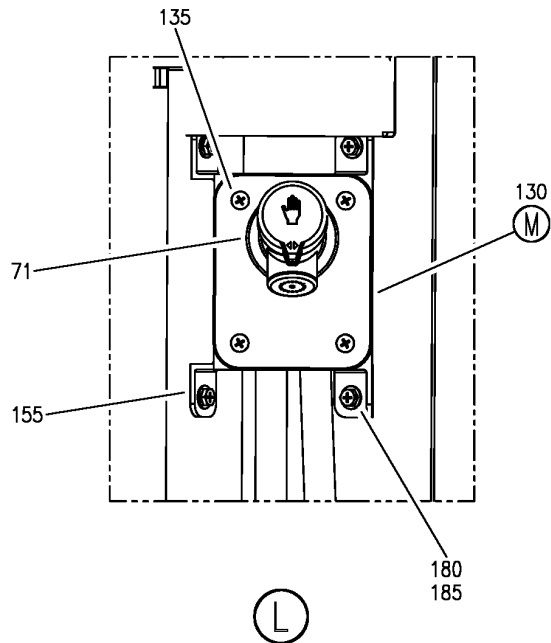

E 25401124U SHT 7 REV 273

STRUCTURE INSTL-LAV (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 24U (SHEET 7)

**25-40-11-24U**

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

R Y R  
A P R 15 / 19

25-40-11-24U  
PAGE OF


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER     | 1 2 3 4 5 6 7 | NOMENCLATURE                                                                                                                                                                                                                                                                | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|-----------------|---------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 24U                                                     |                 |               | STRUCTURE INSTL-LAV<br>(EQUIPMENT/FURNISHINGS<br>ONLY)                                                                                                                                                                                                                      | 417475            |                      |
| - 1                                                     | 1L306010-155CH2 |               | STRUCTURE INSTL-LAV A<br>(EQUIPMENT/FURNISHINGS<br>ONLY)<br>SUPPLIER CODE:<br>V6S8D7<br>FOR NHA/OTHER SYS DET SEE:<br>25-40-11-24Q                                                                                                                                          | 417475            | RF                   |
| 50                                                      | 1L460010-343    |               | .LIGHT ASSY-<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>33-26-03-14N<br>ATTACHING PARTS                                                                                                                                                                             | 417475            | 1                    |
| 55                                                      | NAS1801-3-6     |               | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                                                                                                                                                                                                                             | 417475            | 6                    |
| 60                                                      | NAS1149D0332J   |               | .WASHER<br>-----*-----                                                                                                                                                                                                                                                      | 417475            | 6                    |
| 65                                                      | 1L500403-89     |               | .SHIM-<br>SUPPLIER CODE:<br>V6S8D7                                                                                                                                                                                                                                          | 417475            | 1                    |
| 70                                                      | AR9472-3W1D492  |               | .FAUCET ASSY-<br>SUPPLIER CODE:<br>V80477<br>SB DATA FROM A CMM:<br>PRE SB 1L3-25-0072<br>PRE SB 1L3-25-0114<br>CONFIG CHG DATA FROM A CMM:<br>REPLD BY SC4L500301-4<br>SUPSD BY 4101800-001<br>COMPONENT MAINT MANUAL REF:<br>38-11-71<br>FOR DETAILS SEE:<br>38-11-05-18Y | 417475            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                 |               |                                                                                                                                                                                                                                                                             |                   |                      |

- ITEM NOT ILLUSTRATED

RYR

25-40-11-24U

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-11  
 FIG. 24U  
 PAGE 1  
 APR 15/23


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER  | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                                                                                                                                                                                                                                                                           | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|--------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 24U<br>70                                               | SC4L500002-2 | . FAUCET ASSY-<br>SUPPLIER CODE:<br>V6S8D7<br>SB DATA FROM A CMM:<br>PRE SB 1L3-25-0072<br>PRE SB 1L3-25-0114<br>CONFIG CHG DATA FROM A CMM:<br>SUPSD BY SC4L500301-5<br>MISCELLANEOUS DATA:<br>ORDER AR9472-3W1D492<br><br>REF TO ADAMS RITE<br>AEROSPACE PART NUMBER<br>AR9472-3W1D492                                                                             | 417475            | 1                    |
| 71                                                      | 4W200301-11  | . FAUCET ASSY-<br>SUPPLIER CODE:<br>V6S8D7<br>SB DATA FROM A CMM:<br>POST SB 1L3-25-0072<br>PRE SB 1L3-25-0114<br>CONFIG CHG DATA FROM A CMM:<br>SUPSD BY 4101800-001<br>COMPONENT MAINT MANUAL REF:<br>38-10-01<br>FOR DETAILS SEE:<br>38-11-05-60C                                                                                                                 | 417475            | 1                    |
| 71                                                      | SC4L500301-4 | . FAUCET ASSY-<br>SUPPLIER CODE:<br>V6S8D7<br>SB DATA FROM A CMM:<br>POST SB 1L3-25-0072<br>PRE SB 1L3-25-0114<br>CONFIG CHG DATA FROM A CMM:<br>REPLS AR9472-3W1D492<br>SUPSD BY SC4L500301-5<br>MISCELLANEOUS DATA:<br>ORDER 4W200301-11<br>COMPONENT MAINT MANUAL REF:<br>38-10-01<br>OPTIONAL PART:<br>4W200301-11<br>V6S8D7<br>FOR DETAILS SEE:<br>38-11-05-60C | 417475            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |              |                                                                                                                                                                                                                                                                                                                                                                      |                   |                      |

— ITEM NOT ILLUSTRATED

RYR

25-40-11-24U

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

25-40-11  
FIG. 24U  
PAGE 2  
FEB 15/22


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER  | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                     | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|--------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 24U<br>71                                               | 4101800-001  | . FAUCET ASSY-<br>SUPPLIER CODE:<br>V5E3E9<br>SB DATA FROM A CMM:<br>POST SB 1L3-25-0114<br>CONFIG CHG DATA FROM A CMM:<br>SUPERSEDES<br>AR9472-3W1D492<br>SUPERSEDES 4W200301-11<br>COMPONENT MAINT MANUAL REF:<br>38-10-03<br>FOR DETAILS SEE:<br>38-11-05-60E                                                                                                                                                                                                                                                                                                               | 417475            | 1                    |
| 71                                                      | SC4L500301-5 | . FAUCET ASSY-<br>SUPPLIER CODE:<br>V6S8D7<br>FUNCTIONAL DESCRIPTION:<br>ASSEMBLY ALLOWS<br>DISPENSING OF POTABLE<br>WATER IN THE LAVATORY<br>SINK.<br>SB DATA FROM A CMM:<br>POST SB 1L3-25-0114<br>CONFIG CHG DATA FROM A CMM:<br>SUPERSEDES SC4L500002-2<br>SUPERSEDES SC4L500301-4<br>MISCELLANEOUS DATA:<br>ORDER 4101800-001<br><br>SC4L500301-5 IS AN<br>EQUIVALENT P/N FOR THE<br>4101800-001 FAUCET WHICH<br>IS COVERED BY CMM<br>38-10-03.<br>COMPONENT MAINT MANUAL REF:<br>38-10-03<br>OPTIONAL PART:<br>4101800-001<br>V5E3E9<br>FOR DETAILS SEE:<br>38-11-05-60E | 417475            | 1                    |
| - 75                                                    | 9L500001-003 | . STUD INSTL-GND, ELECTRICAL<br>SUPPLIER CODE:<br>V6S8D7                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                       | 417475            | 1                    |
| 80                                                      | NAS1801-3-10 | .. SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-10                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                             | 417475            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |              |                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                |                   |                      |

- ITEM NOT ILLUSTRATED

R Y R

25-40-11-24U

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-11  
FIG. 24U  
PAGE 3  
DEC 15/24


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7<br>NOMENCLATURE                                                                                                                                              | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 24U<br>85                                               | MS21042L3      | ..NUT<br>STANDARD SUBSTITUTION:<br>BACN11AG3                                                                                                                               | 417475            | 1                    |
| 90                                                      | NAS1149D0316H  | ..WASHER                                                                                                                                                                   | 417475            | 3                    |
| 100                                                     | NAS1922-0125-3 | .CLAMP                                                                                                                                                                     | 417475            | 1                    |
| 105                                                     | 1L460010-303   | .SINK ASSY-<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-41-11-25F<br>ATTACHING PARTS                                                                             | 417475            | 1                    |
| 110                                                     | NAS514P1032-5  | .SCREW                                                                                                                                                                     | 417475            | 4                    |
| 115                                                     | NAS514P1032-6  | .SCREW                                                                                                                                                                     | 417475            | 2                    |
| 120                                                     | NAS1801-3-9    | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-9                                                                                                                            | 417475            | 8                    |
| 125                                                     | NAS1149D0332J  | .WASHER-<br>MISCELLANEOUS DATA:<br>USE AS REQUIRED TO<br>MAINTAIN FLUSHNESS WITH<br>THE REST OF THE VANITY.<br>-----*-----                                                 | 417475            | AR                   |
| 130                                                     | 77586-1        | .PLATE ASSY-FAUCET MTG<br>SUPPLIER CODE:<br>V80477<br>COMPONENT MAINT MANUAL REF:<br>38-11-80                                                                              | 417475            | 1                    |
| 130                                                     | SC4L500002-3   | .PLATE ASSY-FAUCET MTG<br>SUPPLIER CODE:<br>V6S8D7<br>MISCELLANEOUS DATA:<br>ORDER 77586-1<br><br>REF TO ADAMS RITE<br>AEROSPACE PART NUMBER<br>77586-1<br>ATTACHING PARTS | 417475            | 1                    |
| 135                                                     | NAS514P1032-9  | .SCREW<br>-----*-----                                                                                                                                                      | 417475            | 4                    |
| 140                                                     | 77593-1        | ..GASKET-<br>SUPPLIER CODE:<br>V80477<br>SB DATA FROM A CMM:<br>PRE SB 1L3-25-0072                                                                                         | 417475            | 1                    |
| 145                                                     | 77644-1        | ..GASKET-<br>SUPPLIER CODE:<br>V80477<br>SB DATA FROM A CMM:<br>PRE SB 1L3-25-0072                                                                                         | 417475            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |                                                                                                                                                                            |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R

25-40-11-24U

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-11  
FIG. 24U  
PAGE 4  
DEC 15/24


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER   | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                                | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|---------------|---------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 24U<br>146                                              | 4W500301-31   | ..GASKET-<br>SUPPLIER CODE:<br>V6S8D7<br>SB DATA FROM A CMM:<br>POST SB 1L3-25-0072                                       | 417475            | 1                    |
| 150                                                     | 20166-007     | ..PACKING-<br>SUPPLIER CODE:<br>V80477<br>SB DATA FROM A CMM:<br>PRE SB 1L3-25-0072                                       | 417475            | 2                    |
| 151                                                     | LCCS14-007B   | ..PACKING-<br>SUPPLIER CODE:<br>V6S8D7<br>TRUE PART NUMBER:<br>LCCS-14-007B<br>SB DATA FROM A CMM:<br>POST SB 1L3-25-0072 | 417475            | 2                    |
| 155                                                     | 20058-31      | ..RING-<br>SUPPLIER CODE:<br>V80477                                                                                       | 417475            | 2                    |
| 160                                                     | 77592-1       | ..FITTING-<br>SUPPLIER CODE:<br>V80477                                                                                    | 417475            | 2                    |
| 165                                                     | 77599-1       | ..GASKET-<br>SUPPLIER CODE:<br>V80477                                                                                     | 417475            | 1                    |
| 170                                                     | 77585-1       | ..PLATE-BACK<br>SUPPLIER CODE:<br>V80477                                                                                  | 417475            | 1                    |
| 175                                                     | 4W400101-5    | .BRACKET ASSY-FAUCET MTG<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                                                   | 417475            | 1                    |
| 180                                                     | NAS1801-3-6   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                                                                           | 417475            | 4                    |
| 185                                                     | NAS1149D0332J | .WASHER<br>-----*-----                                                                                                    | 417475            | 4                    |
| 190                                                     | 1L400101-15   | .DOOR ASSY-ACCESS<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-41-11-30                                          | 417475            | 1                    |
| 195                                                     | 4L400401-21   | .PLATE ASSY-CLOSEOUT<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-41-11-40                                       | 417475            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |               |                                                                                                                           |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R

25-40-11-24U

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-11  
FIG. 24U  
PAGE 5  
DEC 15/24




**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 NOMENCLATURE                                                            | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|---------------------------------------------------------------------------------------|-------------------|----------------------|
| 24U                                                     |                |                                                                                       |                   |                      |
| 200                                                     | NAS1801-3-16   | .ATTACHING PARTS<br>.SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-16                  | 417475            | 4                    |
| 205                                                     | NAS1149D0332J  | .WASHER<br>-----*-----                                                                | 417475            | 4                    |
| 210                                                     | LWC19AC14      | .CLIP-ADHESIVE BACKED<br>SUPPLIER CODE:<br>V06383<br>TRUE PART NUMBER:<br>LWC19-A-C14 | 417475            | 1                    |
| 215                                                     | 4595339-012    | .LANYARD-<br>SUPPLIER CODE:<br>V16827                                                 | 417475            | 1                    |
| 220                                                     | 4L500401-45    | .FITTING-<br>SUPPLIER CODE:<br>V6S8D7                                                 | 417475            | 1                    |
| 225                                                     | NAS1922-0125-3 | .CLAMP                                                                                | 417475            | 2                    |
| - 230                                                   | 9L500001-051   | .STRAP INSTL-GND,<br>ELECTRICAL<br>SUPPLIER CODE:<br>V6S8D7                           | 417475            | 1                    |
| 235                                                     | MS21042L3      | ..NUT<br>STANDARD SUBSTITUTION:<br>BACN11AG3                                          | 417475            | 1                    |
| 240                                                     | NAS1149D0332H  | ..WASHER                                                                              | 417475            | 2                    |
| - 245                                                   | 9L500001-003   | .STUD INSTL-GND, ELECTRICAL<br>SUPPLIER CODE:<br>V6S8D7                               | 417475            | 3                    |
| 250                                                     | NAS1801-3-10   | ..SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-10                                     | 417475            | 1                    |
| 255                                                     | MS21042L3      | ..NUT<br>STANDARD SUBSTITUTION:<br>BACN11AG3                                          | 417475            | 1                    |
| 260                                                     | NAS1149D0316H  | ..WASHER                                                                              | 417475            | 3                    |
| 265                                                     | 3L500101-31    | .BRACKET-GND, ELECTRICAL<br>SUPPLIER CODE:<br>V6S8D7                                  | 417475            | 1                    |
| 270                                                     | NAS1801-3-7    | .ATTACHING PARTS<br>.SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-7                   | 417475            | 1                    |
| 275                                                     | NAS1149D0332K  | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0332J<br>-----*-----                     | 417475            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |                                                                                       |                   |                      |

- ITEM NOT ILLUSTRATED

R Y R

25-40-11-24U

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-11  
FIG. 24U  
PAGE 6  
DEC 15/24


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER   | 1 2 3 4 5 6 7 NOMENCLATURE                                                 | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|---------------|----------------------------------------------------------------------------|-------------------|----------------------|
| 24U<br>280                                              | 3L500101-21   | .BRACKET-WATER HEATER DISC.<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS | 417475            | 1                    |
| 285                                                     | NAS1801-3-6   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                            | 417475            | 2                    |
| 290                                                     | NAS1801-04-6  | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN04-6                           | 417475            | 4                    |
| 295                                                     | MS21042L04    | .NUT<br>STANDARD SUBSTITUTION:<br>BACN11AG04                               | 417475            | 4                    |
| 300                                                     | NAS1149D0316K | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J                         | 417475            | 2                    |
| 305                                                     | NAS1149DN432J | .WASHER<br>-----*-----                                                     | 417475            | 8                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |               |                                                                            |                   |                      |

— ITEM NOT ILLUSTRATED


R Y R

25-40-11-24U

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-11  
 FIG. 24U  
 PAGE 7  
 DEC 15/24

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

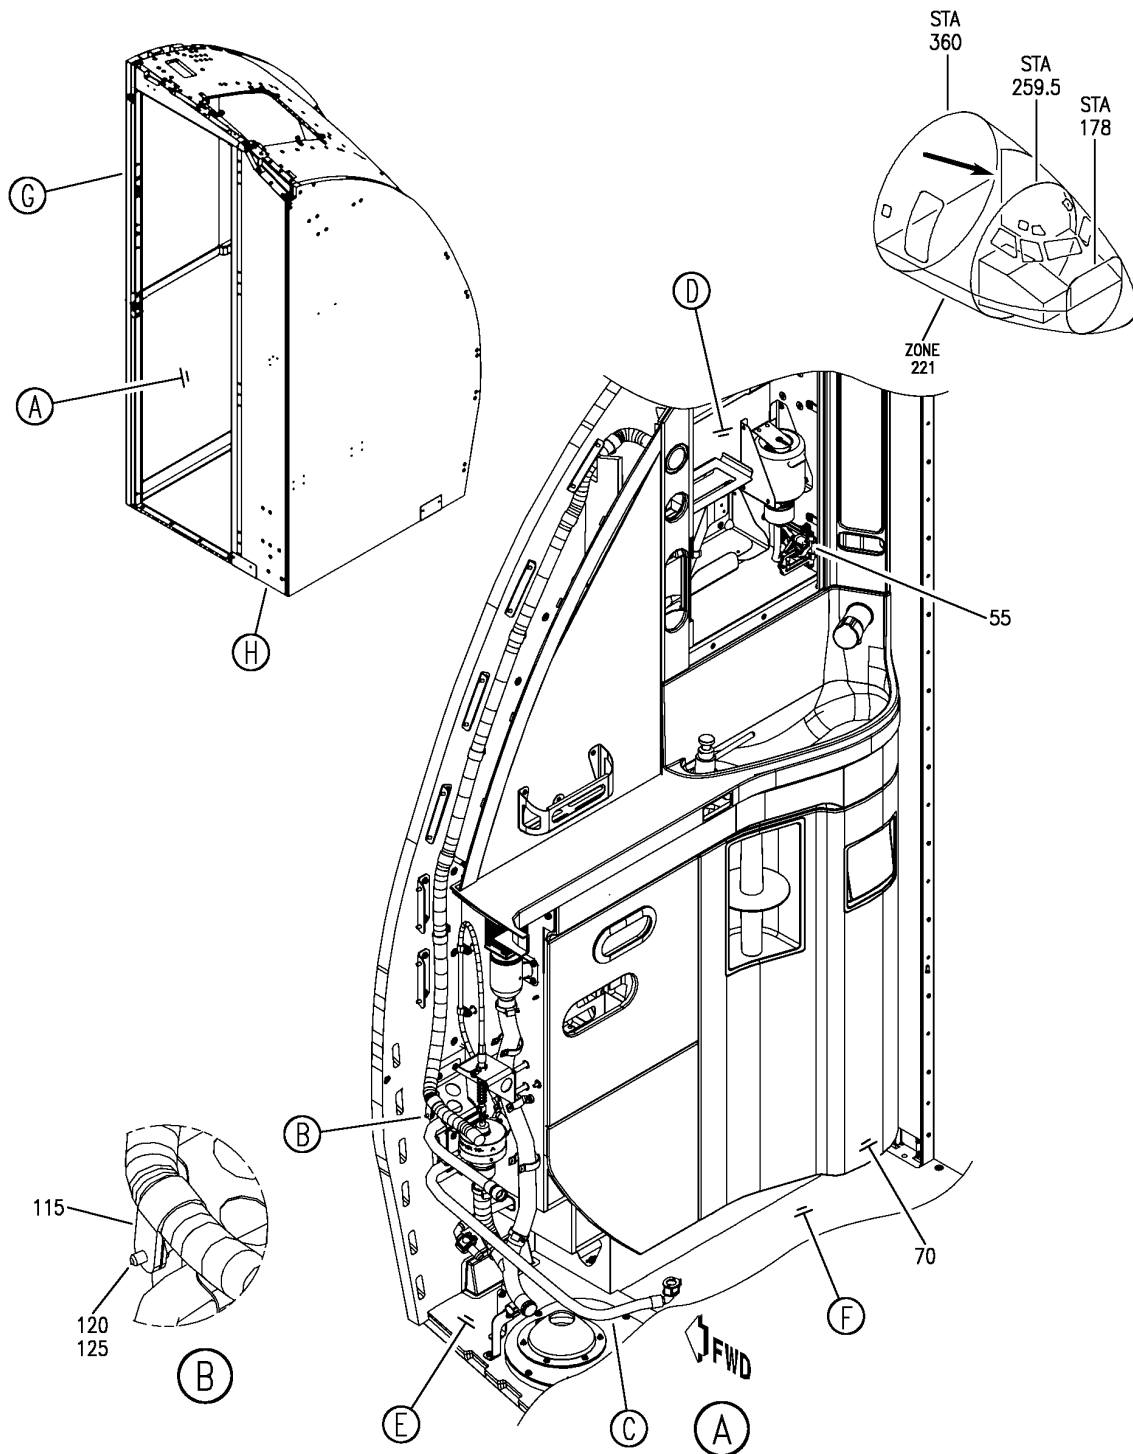

E 25401128B SHT 1 REV 241

STRUCTURE INSTL-LAV A (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 28B (SHEET 1)



**25-40-11-28B**

R/YR  
AUG 15/20

25-40-11-28B  
PAGE 0

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

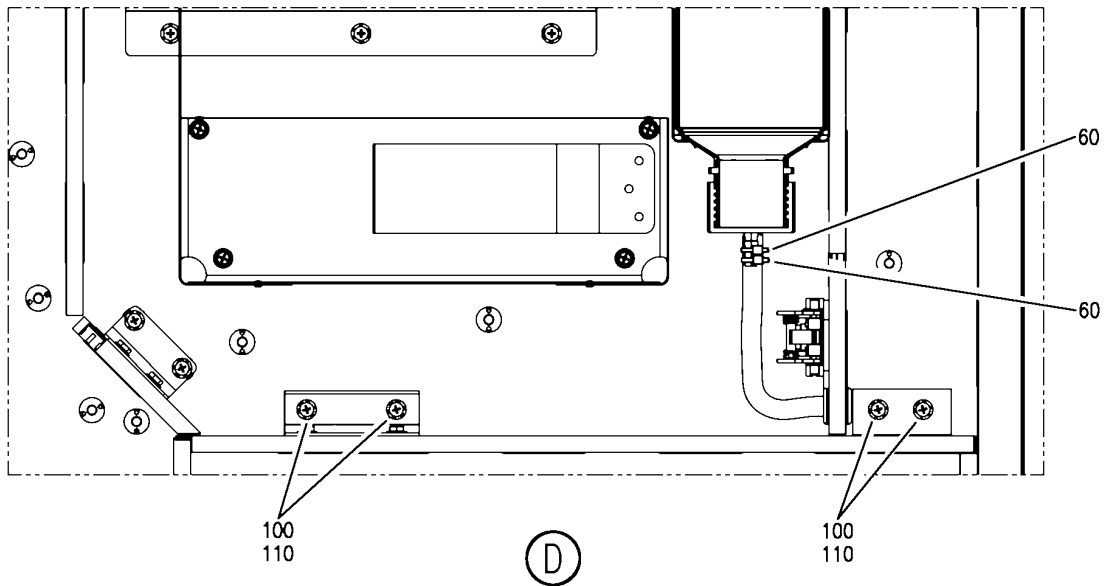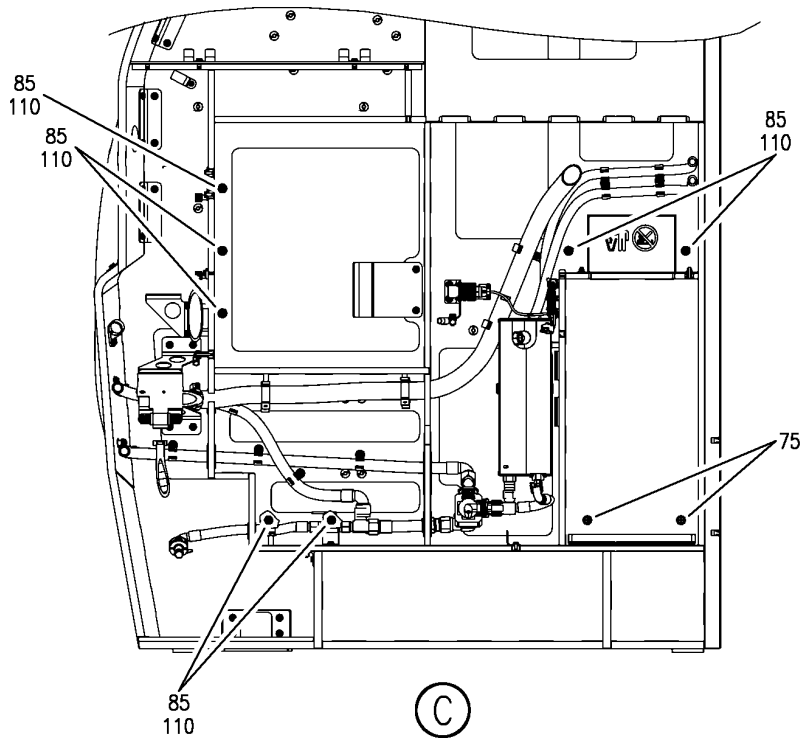

E 25401128B SHT 2 REV 289

STRUCTURE INSTL-LAV A (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 28B (SHEET 2)



**25-40-11-28B**

R/YR  
AUG 15/20

25-40-11-28B  
PAGE 0A

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

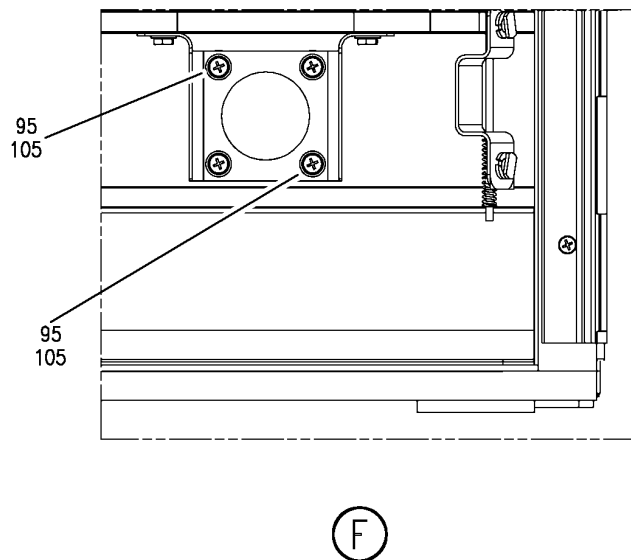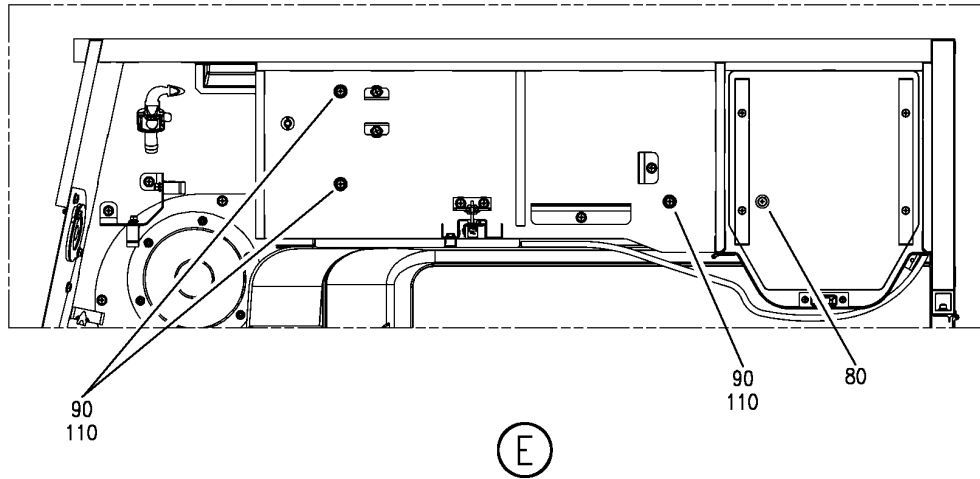

E 25401128B SHT 3 REV 241

STRUCTURE INSTL-LAV A (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 28B (SHEET 3)


**25-40-11-28B**

RJR  
AUG 15/20

25-40-11-28B  
PAGE 0B

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

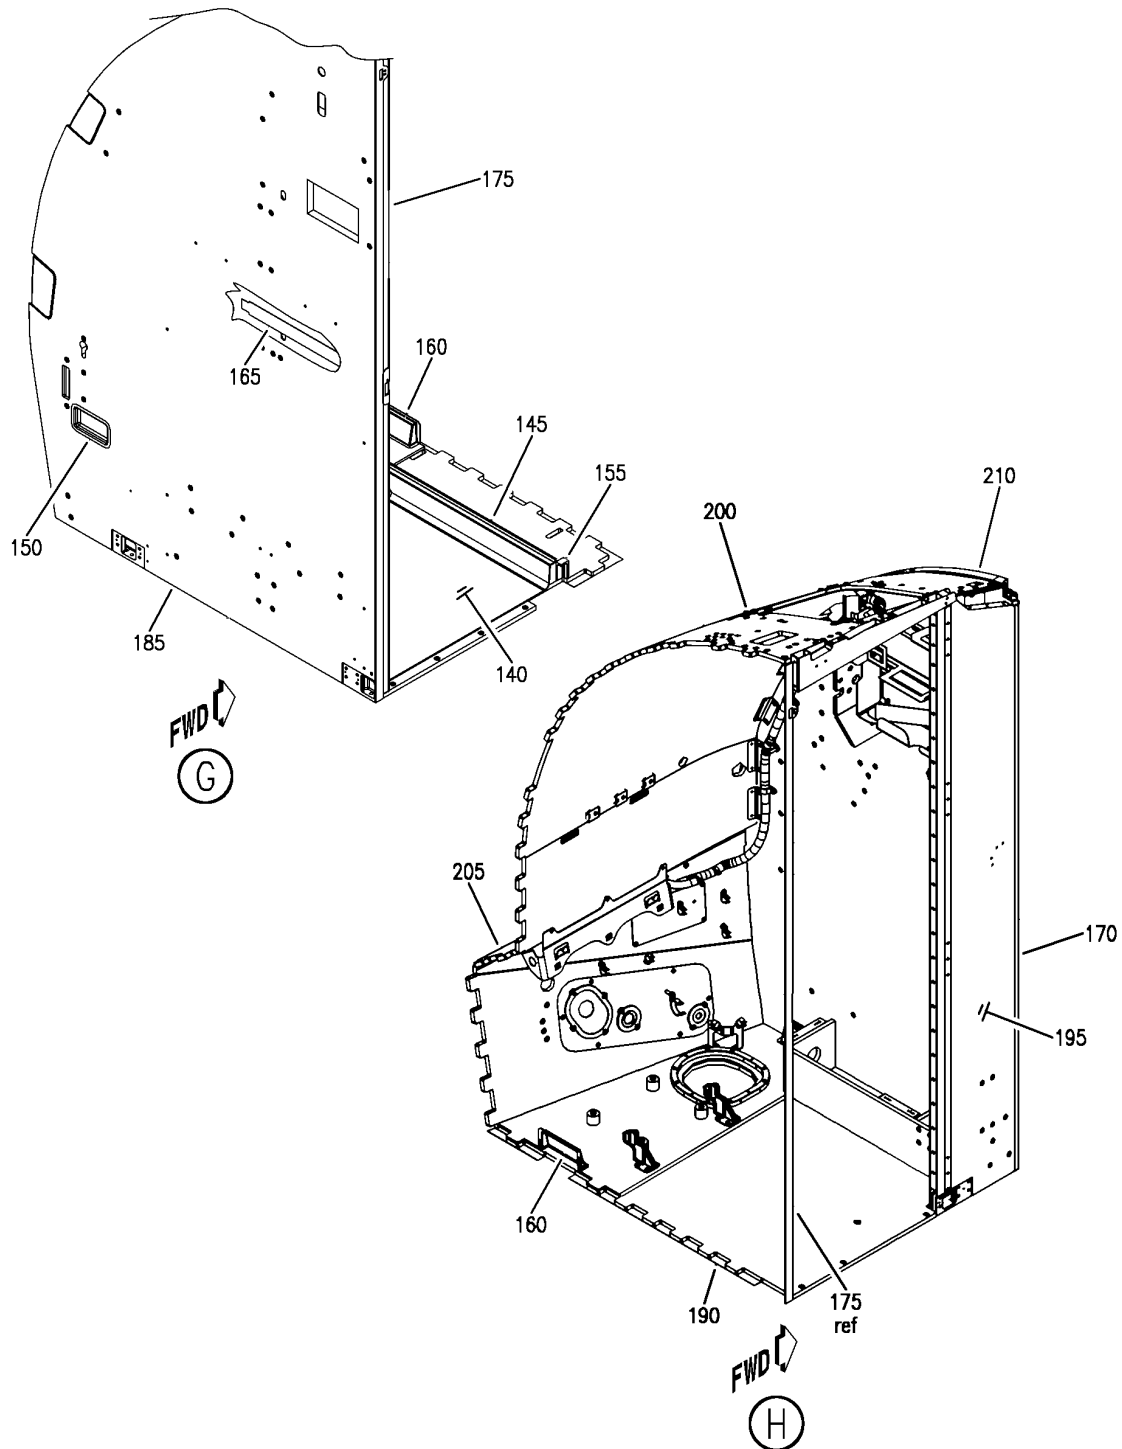

E 25401128B SHT 4 REV 241

STRUCTURE INSTL-LAV A (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 28B (SHEET 4)

**25-40-11-28B**

R/YR  
AUG 15/20

25-40-11-28B  
PAGE 0C

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

 **BOEING**  
737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER     | 1 2 3 4 5 6 7 | NOMENCLATURE                                                                                                                       | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|-----------------|---------------|------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 28B                                                     |                 |               | STRUCTURE INSTL-LAV A<br>(EQUIPMENT/FURNISHINGS<br>ONLY)                                                                           | 417475            |                      |
| - 1                                                     | 1L306010-155CH3 |               | STRUCTURE INSTL-LAV A<br>(EQUIPMENT/FURNISHINGS<br>ONLY)<br>SUPPLIER CODE:<br>V6S8D7<br>FOR NHA/OTHER SYS DET SEE:<br>25-40-11-24Q | 417475            | RF                   |
| - 50                                                    | 1L400101-65     |               | .CAN ASSY-WASTE<br>SUPPLIER CODE:<br>V6S8D7                                                                                        | 417475            | 1                    |
| - 52                                                    | SL00201         |               | ..GROMMET-<br>SUPPLIER CODE:<br>VOHES0<br>MISCELLANEOUS DATA:<br>B\E PART NO: LCEE000022                                           | 417475            | AR                   |
| 55                                                      | NAS1922-0050-3  |               | .CLAMP                                                                                                                             | 417475            | 1                    |
| - 65                                                    | MS3367-5-9      |               | .STRAP<br>STANDARD SUBSTITUTION:<br>BACS38K5                                                                                       | 417475            | AR                   |
| 70                                                      | 1L406100-209    |               | .VANITY ASSY-LWR<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-41-51-43X<br>ATTACHING PARTS                                | 417475            | 1                    |
| 75                                                      | NAS514P1032-10  |               | .SCREW                                                                                                                             | 417475            | 2                    |
| 80                                                      | NAS514P1032-12  |               | .SCREW                                                                                                                             | 417475            | 1                    |
| 85                                                      | NAS1801-3-11    |               | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-11                                                                                   | 417475            | 7                    |
| 90                                                      | NAS1801-3-13    |               | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-13                                                                                   | 417475            | 3                    |
| 95                                                      | NAS603-7B       |               | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12CK3H7                                                                                    | 417475            | 4                    |
| 100                                                     | NAS1801-3-6     |               | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                                                                                    | 417475            | 4                    |
| 105                                                     | NAS1149C0316R   |               | .WASHER                                                                                                                            | 417475            | 4                    |
| 110                                                     | NAS1149D0332J   |               | .WASHER<br>-----*-----                                                                                                             | 417475            | 14                   |
| 115                                                     | BACC10DK13      |               | .CLAMP                                                                                                                             | 417475            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                 |               |                                                                                                                                    |                   |                      |

- ITEM NOT ILLUSTRATED

RYR

25-40-11-28B

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-11  
FIG. 28B  
PAGE 1  
APR 15/23


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                                                    | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|-----------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 28B                                                     |                | ATTACHING PARTS                                                                                                                               |                   |                      |
| 120                                                     | NAS1801-3-8    | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-8                                                                                               | 417475            | 1                    |
| 125                                                     | NAS1149D0332J  | .WASHER<br>-----*-----                                                                                                                        | 417475            | 1                    |
| - 135                                                   | 1L400407-63    | .PAN ASSY-FLOOR<br>SUPPLIER CODE:<br>V6S8D7                                                                                                   | 417475            | 1                    |
| 140                                                     | 1L400107-119   | ..MAT-<br>SUPPLIER CODE:<br>V6S8D7                                                                                                            | 417475            | 1                    |
| 145                                                     | 1L500107-11    | ..PAN-<br>SUPPLIER CODE:<br>V6S8D7                                                                                                            | 417475            | 1                    |
| 150                                                     | 1L500109-139   | .COVER-<br>SUPPLIER CODE:<br>V6S8D7                                                                                                           | 417475            | 1                    |
| 155                                                     | 1L500109-333   | .CLOSEOUT-FLOOR<br>SUPPLIER CODE:<br>V6S8D7                                                                                                   | 417475            | 1                    |
| 160                                                     | 1L500109-347   | .CLOSEOUT-FLOOR<br>SUPPLIER CODE:<br>V6S8D7                                                                                                   | 417475            | 2                    |
| 165                                                     | 1L500113-11    | .TRIM-CLOSEOUT, AFT WALL<br>SUPPLIER CODE:<br>V6S8D7                                                                                          | 417475            | 1                    |
| 170                                                     | 1L500709-655   | .TRIM-EDGE<br>SUPPLIER CODE:<br>V6S8D7                                                                                                        | 417475            | 1                    |
| 175                                                     | 1L500709-669   | .TRIM-EDGE<br>SUPPLIER CODE:<br>V6S8D7                                                                                                        | 417475            | 1                    |
| 185                                                     | 1L460010-461CH | .WALL ASSY-AFT<br>SUPPLIER CODE:<br>V6S8D7<br>CONFIG CHG DATA FROM A CMM:<br>SUPSD BY 1L460010-485CH<br>FOR DETAILS SEE:<br>25-41-40-25W      | 417475            | 1                    |
| 185                                                     | 1L460010-485CH | .WALL ASSY-AFT<br>SUPPLIER CODE:<br>V6S8D7<br>CONFIG CHG DATA FROM A CMM:<br>SUPERSEDES<br>1L460010-461CH<br>FOR DETAILS SEE:<br>25-41-40-25W | 417475            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |                                                                                                                                               |                   |                      |

- ITEM NOT ILLUSTRATED

R Y R

25-40-11-28B

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-11  
 FIG. 28B  
 PAGE 2  
 APR 15/23




**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                                                                                              | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 28B<br>190                                              | 1L460010-397   | . FLOOR ASSY-<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-41-21-21M                                                                                                           | 417475            | 1                    |
| 195                                                     | 1L460010-361CH | . WALL ASSY-INBD<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-41-40-25P                                                                                                        | 417475            | 1                    |
| 200                                                     | 1L460010-325   | . CEILING ASSY-UPR<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-41-45-05C                                                                                                      | 417475            | 1                    |
| 205                                                     | 1L460010-305   | . WALL ASSY-OUTBD<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-41-40-23X                                                                                                       | 417475            | 1                    |
| 210                                                     | 1L460010-287   | . WALL ASSY-FWD<br>SUPPLIER CODE:<br>V6S8D7<br>FUNCTIONAL REFERENCE:<br>AIR CONDITIONING<br>FOR DETAILS SEE<br>21-24-51-28V<br>EQUIPMENT/FURNISHINGS<br>FOR DETAILS SEE<br>25-41-40-23R | 417475            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |                                                                                                                                                                                         |                   |                      |

— ITEM NOT ILLUSTRATED


RYR

25-40-11-28B

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

25-40-11  
 FIG. 28B  
 PAGE 3  
 AUG 15/20

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

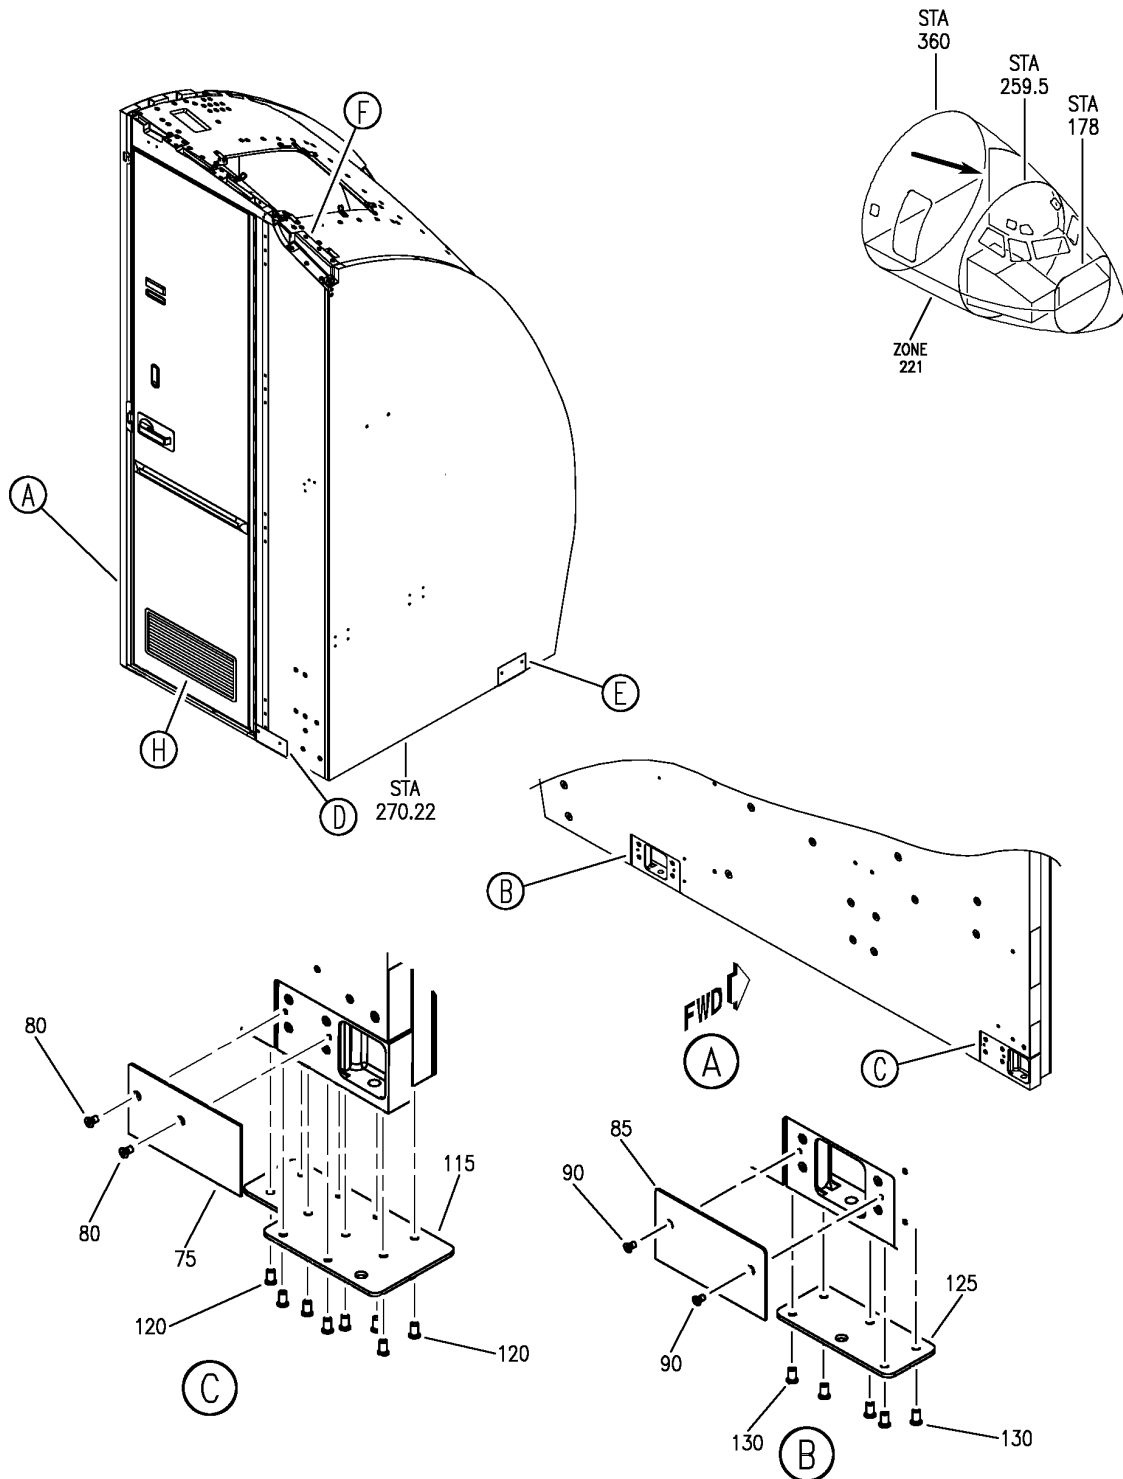

E 25401128D SHT 1 REV 253

STRUCTURE INSTL-LAV A  
FIGURE 28D (SHEET 1)


**25-40-11-28D**

R/YR  
FEB 15/20

25-40-11-28D  
PAGE 0

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

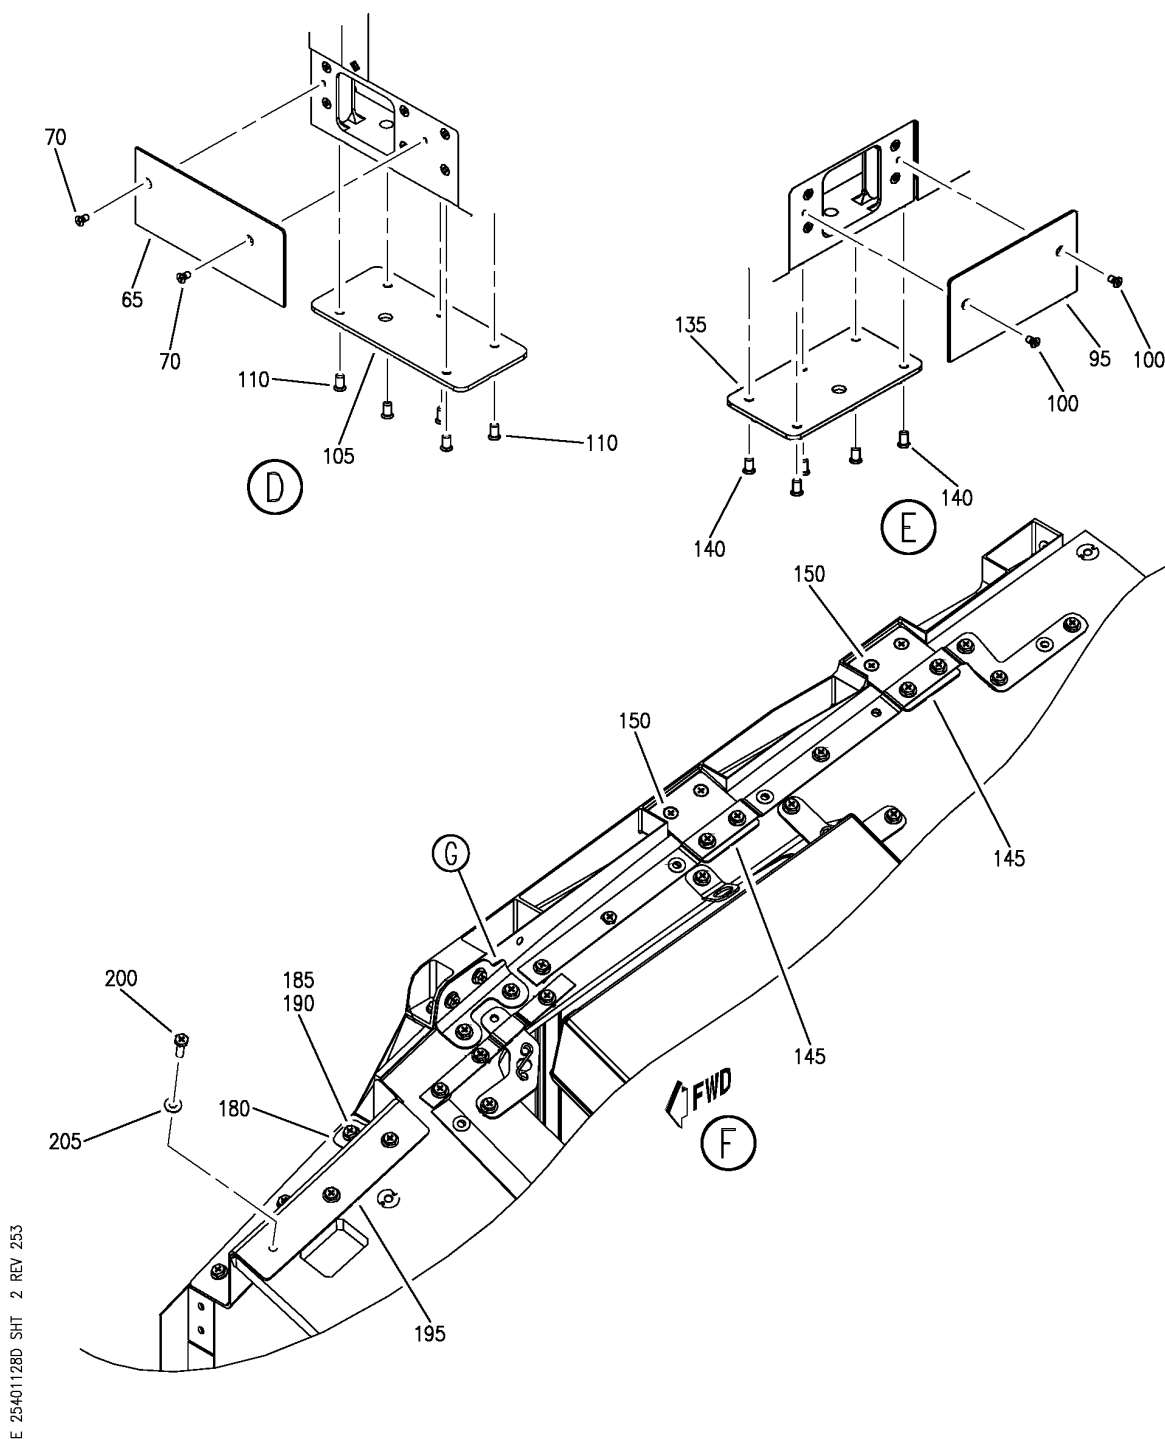

E 25401128D SHT 2 REV 253

STRUCTURE INSTL-LAV A  
FIGURE 28D (SHEET 2)


**25-40-11-28D**

R Y R  
F E B 15 / 20

25-40-11-28D  
PAGE 0A

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

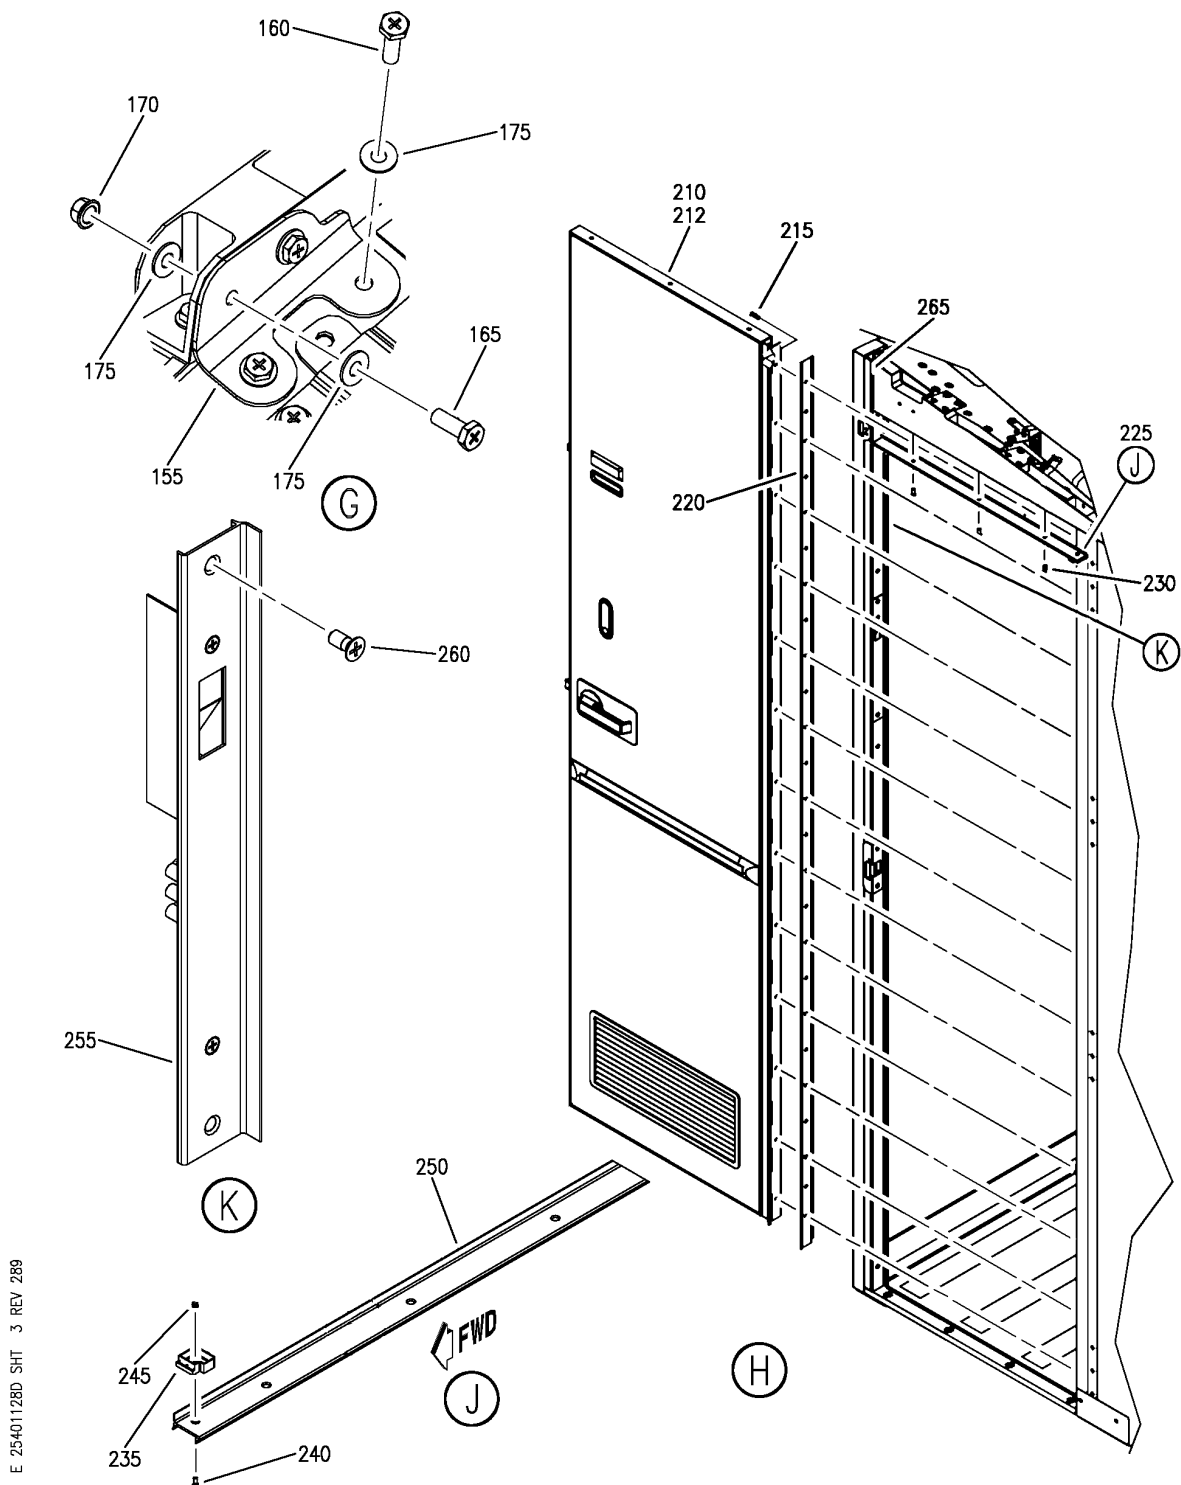

E 25401128D SHT 3 REV 289

STRUCTURE INSTL-LAV A  
FIGURE 28D (SHEET 3)

**25-40-11-28D**

R/YR  
AUG 15/20

25-40-11-28D  
PAGE 0B


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER     | 1 2 3 4 5 6 7 | NOMENCLATURE                                                                                                                                                                                                                       | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|-----------------|---------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 28D                                                     |                 |               |                                                                                                                                                                                                                                    |                   |                      |
| - 1                                                     | 1L306010-221CH  |               | STRUCTURE INSTL-LAV A<br>STRUCTURE INSTL-LAV A<br>SUPPLIER CODE:<br>V6S8D7<br>FOR NHA SEE:<br>25-40-11-11H                                                                                                                         | 476508<br>476508  | RF                   |
| - 50                                                    | 1L306010-221CH1 |               | .STRUCTURE INSTL-<br>SUPPLIER CODE:<br>V6S8D7<br>MISCELLANEOUS DATA:<br>NON PROCURABLE<br>FUNCTIONAL REFERENCE:<br>EQUIPMENT/FURNISHINGS<br>FOR DETAILS SEE<br>25-40-11-28F<br>LIGHTS<br>FOR DETAILS SEE<br>33-26-03-34J           | 476508            | RF                   |
| - 55                                                    | 1L306010-221CH2 |               | .STRUCTURE INSTL-<br>SUPPLIER CODE:<br>V6S8D7<br>MISCELLANEOUS DATA:<br>NON PROCURABLE<br>FUNCTIONAL REFERENCE:<br>EQUIPMENT/FURNISHINGS<br>FOR DETAILS SEE<br>25-40-11-28H<br>LIGHTS<br>FOR DETAILS SEE<br>33-26-03-34Z           | 476508            | RF                   |
| - 60                                                    | 1L306010-221CH3 |               | .STRUCTURE INSTL-<br>SUPPLIER CODE:<br>V6S8D7<br>MISCELLANEOUS DATA:<br>NON PROCURABLE<br>FUNCTIONAL REFERENCE:<br>AIR CONDITIONING<br>FOR DETAILS SEE<br>21-45-51-34K<br>EQUIPMENT/FURNISHINGS<br>FOR DETAILS SEE<br>25-40-11-28K | 476508            | RF                   |
| 65                                                      | 1L500109-689CH  |               | .PLATE-COVER<br>SUPPLIER CODE:<br>V6S8D7                                                                                                                                                                                           | 476508            | 1                    |
| 70                                                      | NAS514P632-5    |               | ATTACHING PARTS<br>.SCREW<br>-----*-----                                                                                                                                                                                           | 476508            | 2                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                 |               |                                                                                                                                                                                                                                    |                   |                      |

— ITEM NOT ILLUSTRATED

RYR

25-40-11-28D

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-11  
 FIG. 28D  
 PAGE 1  
 FEB 15/20


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 NOMENCLATURE                                   | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|--------------------------------------------------------------|-------------------|----------------------|
| 28D                                                     |                |                                                              |                   |                      |
| 75                                                      | 1L500109-593CH | .PLATE-COVER<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS  | 476508            | 1                    |
| 80                                                      | NAS514P632-5   | .SCREW<br>-----*-----                                        | 476508            | 2                    |
| 85                                                      | 1L500109-685CH | .PLATE-COVER<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS  | 476508            | 1                    |
| 90                                                      | NAS514P632-5   | .SCREW<br>-----*-----                                        | 476508            | 2                    |
| 95                                                      | 1L500109-581   | .PLATE-COVER<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS  | 476508            | 1                    |
| 100                                                     | NAS514P632-5   | .SCREW<br>-----*-----                                        | 476508            | 2                    |
| 105                                                     | 1L500109-79    | .PLATE-SHEAR<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS  | 476508            | 1                    |
| 110                                                     | BACB30VF3K1    | .BOLT<br>-----*-----                                         | 476508            | 5                    |
| 115                                                     | 1L500109-749   | .PLATE-SHEAR<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS  | 476508            | 1                    |
| 120                                                     | BACB30VF3K1    | .BOLT<br>-----*-----                                         | 476508            | 10                   |
| 125                                                     | 1L500109-57    | .PLATE-SHEAR<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS  | 476508            | 1                    |
| 130                                                     | BACB30VF3K1    | .BOLT<br>-----*-----                                         | 476508            | 5                    |
| 135                                                     | 1L500109-81    | .SHEAR PLATE-<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS | 476508            | 1                    |
| 140                                                     | BACB30VF3K1    | .BOLT<br>-----*-----                                         | 476508            | 5                    |
| 145                                                     | 1L500109-151   | .BRACKET-<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS     | 476508            | 2                    |
| 150                                                     | NAS514P1032-8  | .SCREW<br>-----*-----                                        | 476508            | 4                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |                                                              |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R

25-40-11-28D

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-11  
 FIG. 28D  
 PAGE 2  
 JUN 15/18


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER   | 1 2 3 4 5 6 7 | NOMENCLATURE                                                                                   | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|---------------|---------------|------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 28D<br>155                                              | 1L500109-155  |               | .BRACKET-<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                                       | 476508            | 1                    |
| 160                                                     | NAS1801-3-6   |               | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                                                | 476508            | 2                    |
| 165                                                     | NAS1801-3-8   |               | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-8                                                | 476508            | 2                    |
| 170                                                     | MS21042L3     |               | .NUT<br>STANDARD SUBSTITUTION:<br>BACN11AG3                                                    | 476508            | 1                    |
| 175                                                     | NAS1149D0332K |               | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0332J<br>-----*-----                              | 476508            | 5                    |
| 180                                                     | 1L500109-403  |               | .BRACKET-CLOSEOUT<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                               | 476508            | 1                    |
| 185                                                     | NAS1801-3-6   |               | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                                                | 476508            | 1                    |
| 190                                                     | NAS1149D0332K |               | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0332J<br>-----*-----                              | 476508            | 1                    |
| 195                                                     | 1L500109-101  |               | .BRACKET-CLG CLOSEOUT<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                           | 476508            | 1                    |
| 200                                                     | NAS1801-3-6   |               | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                                                | 476508            | 5                    |
| 205                                                     | NAS1149D0332K |               | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0332J<br>-----*-----                              | 476508            | 5                    |
| 210                                                     | 1L400105-33CH |               | .DOOR ASSY-<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-41-13-02Q<br>ATTACHING PARTS | 476508            | 1                    |
| 215                                                     | NAS8603-3     |               | .BOLT<br>-----*-----                                                                           | 476508            | 13                   |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |               |               |                                                                                                |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R

25-40-11-28D

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-11  
 FIG. 28D  
 PAGE 3  
 APR 15/23


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER  | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|--------------|-----------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 28D                                                     |              |                                                                                                           |                   |                      |
| 220                                                     | 1L500109-161 | .TRIM-EDGE<br>SUPPLIER CODE:<br>V6S8D7                                                                    | 476508            | 1                    |
| 225                                                     | 1L500109-461 | .TRIM ASSY-DOOR<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                                            | 476508            | 1                    |
| 230                                                     | NAS8703A1    | .BOLT<br>STANDARD SUBSTITUTION:<br>BACB30ZE3K1<br>-----*-----                                             | 476508            | 3                    |
| 235                                                     | 1L500105-169 | ..BLOCK-CLOSEOUT<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                                           | 476508            | 1                    |
| 240                                                     | NAS514P440-5 | ..SCREW                                                                                                   | 476508            | 1                    |
| 245                                                     | MS21042-04   | ..NUT<br>STANDARD SUBSTITUTION:<br>MS21042L04<br>BACN11AG04<br>-----*-----                                | 476508            | 1                    |
| 250                                                     | 1L500109-459 | ..TRIM-DOOR OPENING<br>SUPPLIER CODE:<br>V6S8D7<br>CONFIG CHG DATA FROM A CMM:<br>SUPSD BY 1L500109-627   | 476508            | 1                    |
| 250                                                     | 1L500109-627 | ..TRIM-DOOR OPENING<br>SUPPLIER CODE:<br>V6S8D7<br>CONFIG CHG DATA FROM A CMM:<br>SUPERSEDES 1L500109-459 | 476508            | 1                    |
| 255                                                     | 1L400109-93  | .SWITCH ASSY-<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>33-26-03-08E<br>ATTACHING PARTS          | 476508            | 1                    |
| 260                                                     | NAS8703A1    | .BOLT<br>STANDARD SUBSTITUTION:<br>BACB30ZE3K1<br>-----*-----                                             | 476508            | 2                    |
| 265                                                     | 1L500709-657 | .TRIM-HEADER<br>SUPPLIER CODE:<br>V6S8D7                                                                  | 476508            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |              |                                                                                                           |                   |                      |

— ITEM NOT ILLUSTRATED

RYR


25-40-11-28D

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

25-40-11  
 FIG. 28D  
 PAGE 4  
 APR 15/23



**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

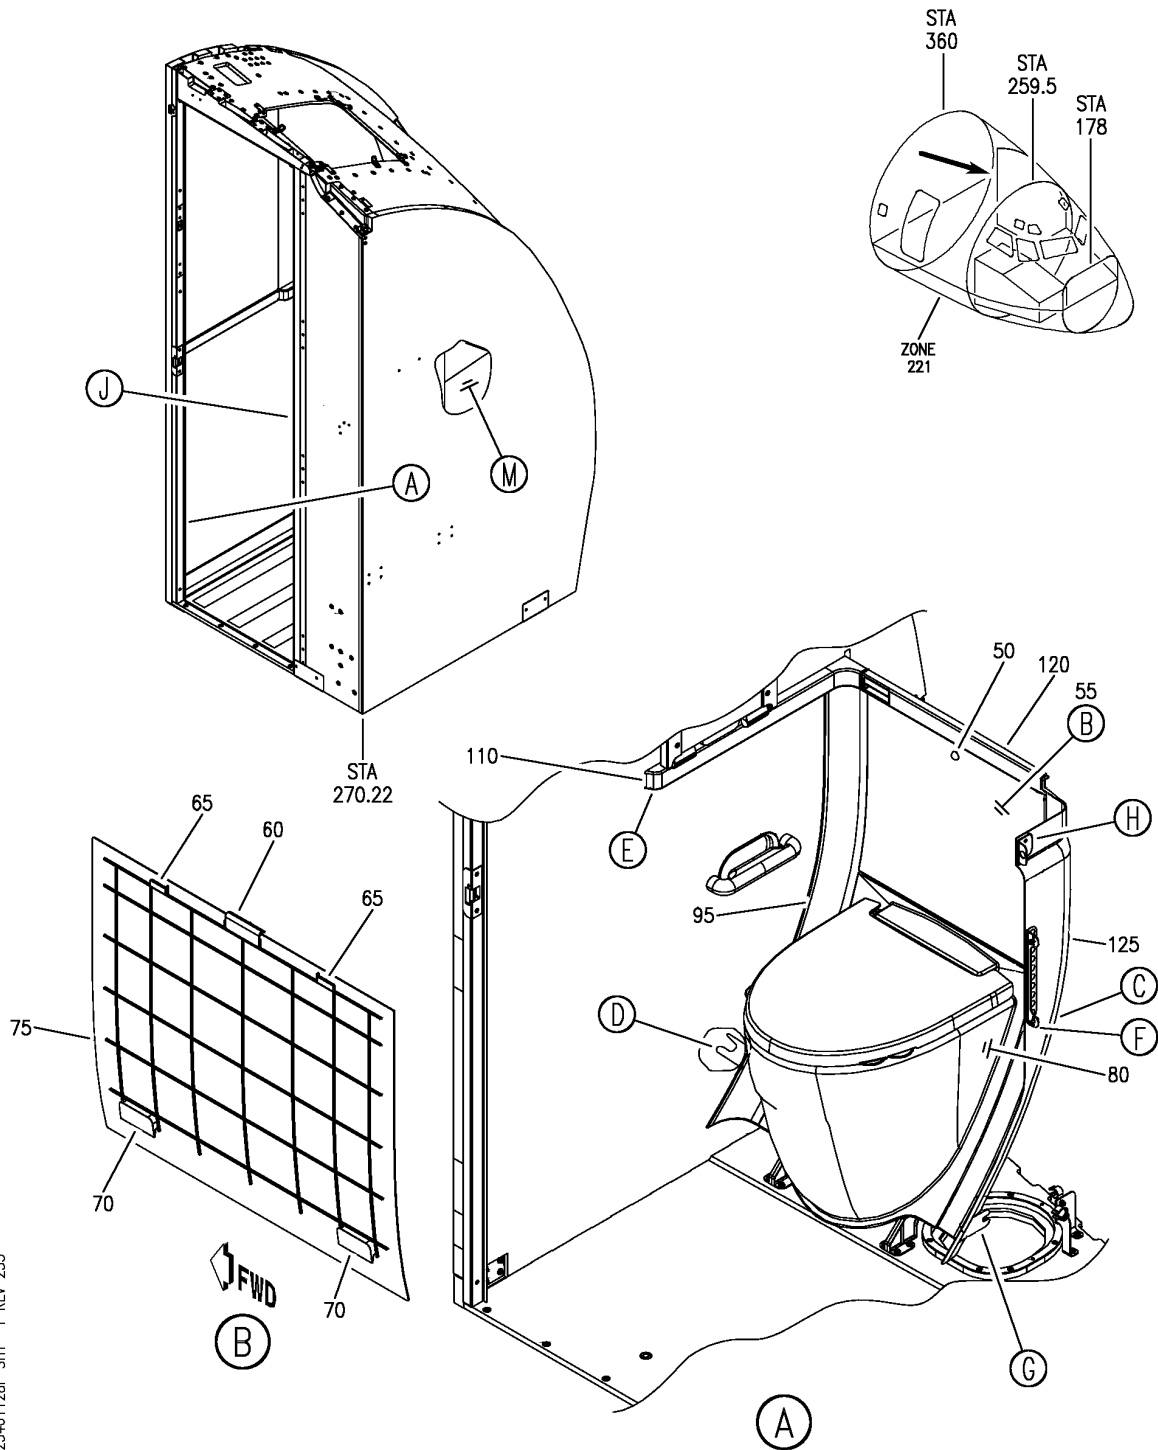

E 25401128F SHT 1 REV 253

STRUCTURE INSTL-LAV A (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 28F (SHEET 1)


**25-40-11-28F**

R/YR  
OCT 15/17

25-40-11-28F  
PAGE 0

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

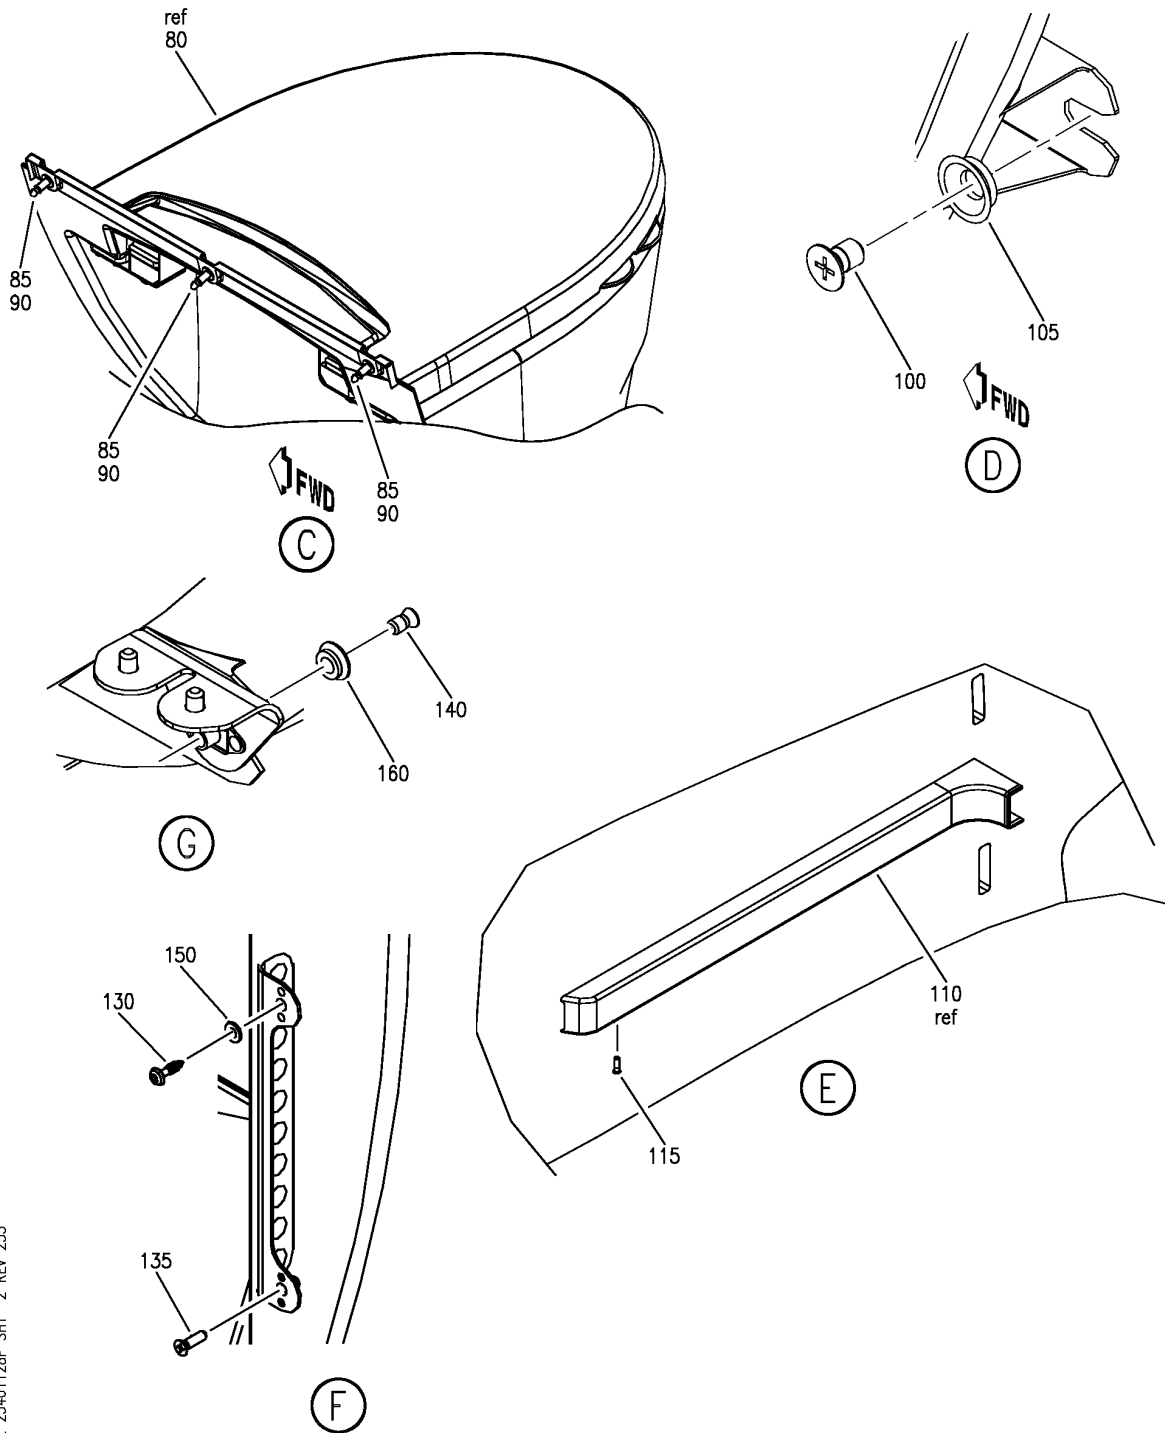

E 25401128F SHT 2 REV 253


STRUCTURE INSTL-LAV A (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 28F (SHEET 2)

**25-40-11-28F**

RYR  
OCT 15/17


25-40-11-28F  
PAGE 0A

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

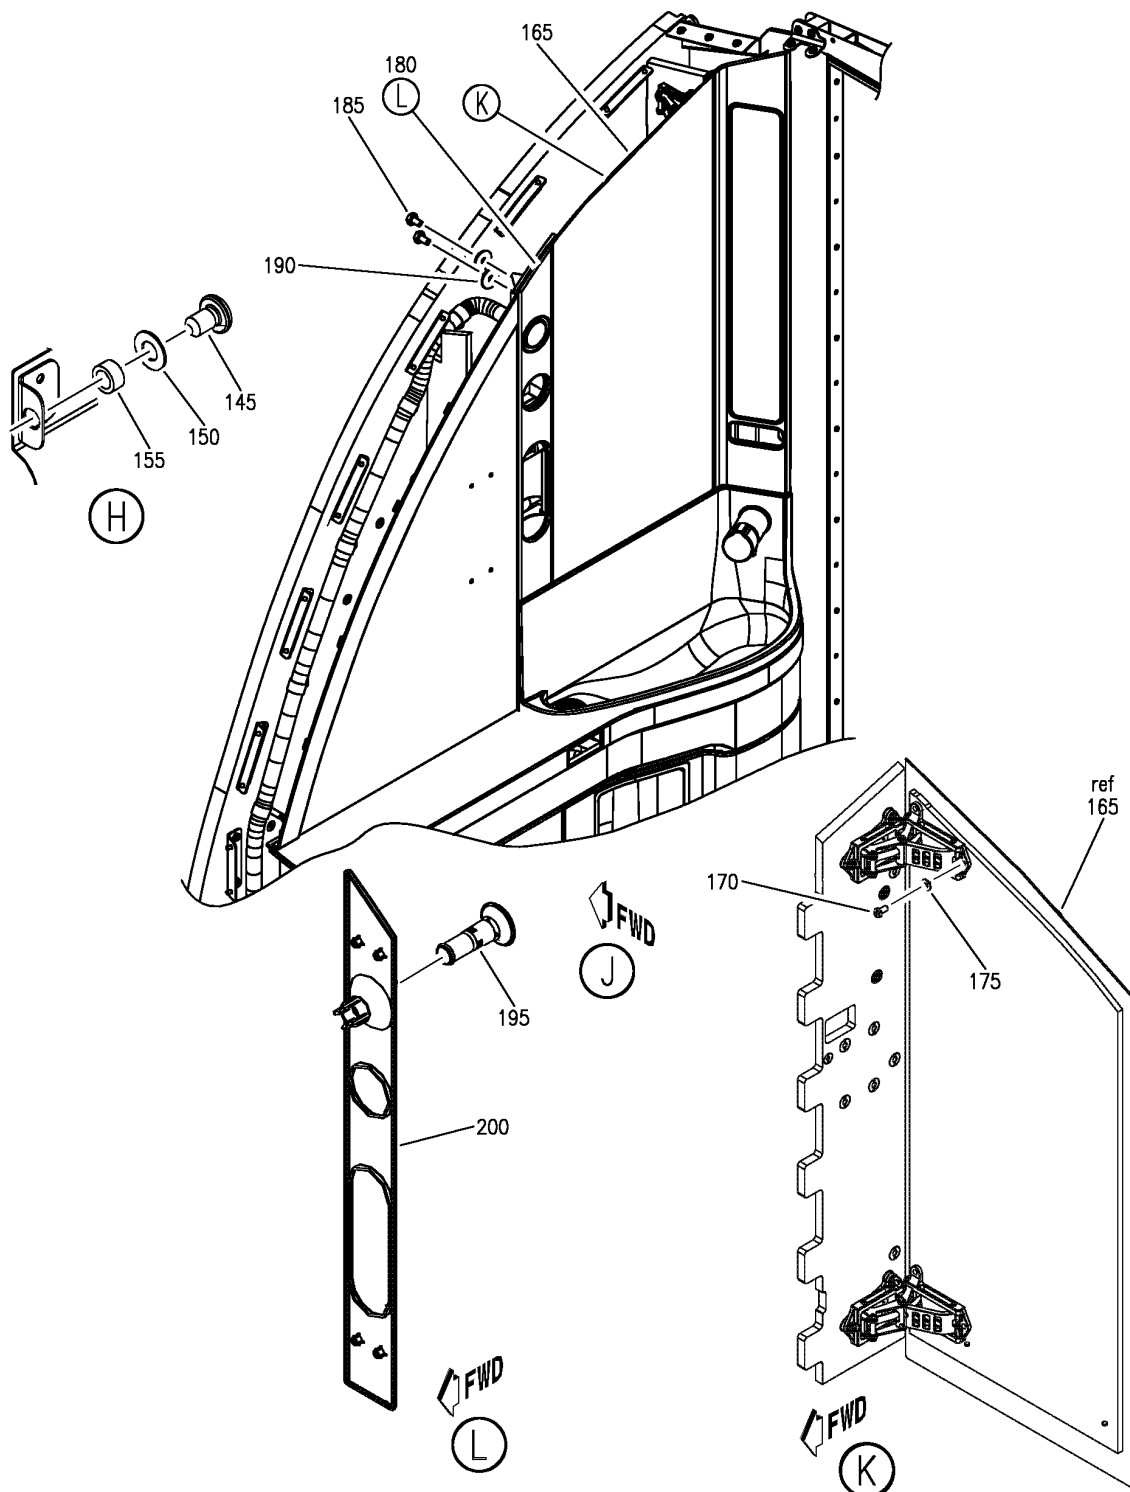

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

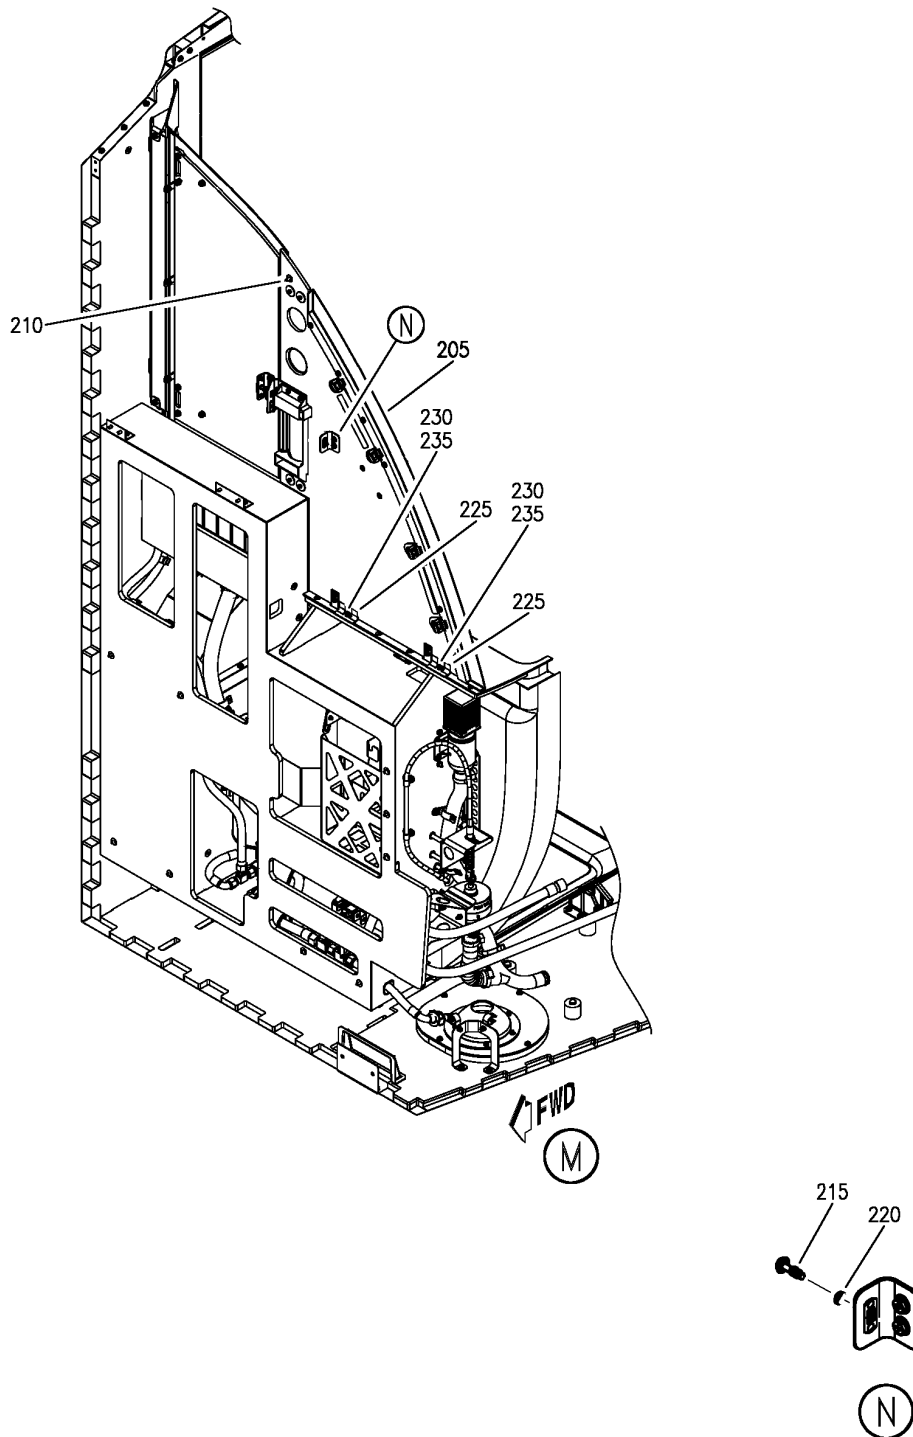

E 25401128F SHT 4 REV 253

STRUCTURE INSTL-LAV A (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 28F (SHEET 4)

**25-40-11-28F**

R Y R  
O C T 15 / 17

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

25-40-11-28F  
PAGE 0C


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER     | 1 2 3 4 5 6 7 | NOMENCLATURE                                                                                                                       | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|-----------------|---------------|------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 28 F                                                    |                 |               | STRUCTURE INSTL-LAV A<br>(EQUIPMENT/FURNISHINGS<br>ONLY)                                                                           | 476508            |                      |
| - 1                                                     | 1L306010-221CH1 |               | STRUCTURE INSTL-LAV A<br>(EQUIPMENT/FURNISHINGS<br>ONLY)<br>SUPPLIER CODE:<br>V6S8D7<br>FOR NHA/OTHER SYS DET SEE:<br>25-40-11-28D | 476508            | RF                   |
| 50                                                      | SJ5327          |               | .BUMPER-<br>SUPPLIER CODE:<br>V07080<br>TRUE PART NUMBER:<br>SJ-5327                                                               | 476508            | 1                    |
| 55                                                      | 1L400107-17     |               | .SHROUD ASSY-CTR<br>SUPPLIER CODE:<br>V6S8D7                                                                                       | 476508            | 1                    |
| 60                                                      | 1L500107-73     |               | ..HANDLE-PULL<br>SUPPLIER CODE:<br>V6S8D7                                                                                          | 476508            | 1                    |
| 65                                                      | 02-14-301-14    |               | ..STRIKER-SELF ADHESIVE<br>SUPPLIER CODE:<br>V94222                                                                                | 476508            | 2                    |
| 70                                                      | 1L500407-117    |               | ..BLOCK-GUIDE<br>SUPPLIER CODE:<br>V6S8D7                                                                                          | 476508            | 2                    |
| 75                                                      | 1L500107-71     |               | ..SHROUD-<br>SUPPLIER CODE:<br>V6S8D7                                                                                              | 476508            | 1                    |
| 80                                                      | 1L400407-51     |               | .SHROUD ASSY-TOILET LID<br>SEAT<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-41-21-19W<br>ATTACHING PARTS                 | 476508            | 1                    |
| 85                                                      | 85-99-541       |               | .FASTENER-<br>SUPPLIER CODE:<br>V94222<br>CONFIG CHG DATA FROM A CMM:<br>SUPSD BY 85-99-541-20                                     | 476508            | 3                    |
| 85                                                      | 85-99-541-20    |               | .FASTENER-<br>SUPPLIER CODE:<br>V94222<br>CONFIG CHG DATA FROM A CMM:<br>SUPERSEDES 85-99-541                                      | 476508            | 3                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                 |               |                                                                                                                                    |                   |                      |

- ITEM NOT ILLUSTRATED

RYR

25-40-11-28F

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-11  
FIG. 28F  
PAGE 1  
AUG 15/18


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 | NOMENCLATURE                                                                        | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|---------------|-------------------------------------------------------------------------------------|-------------------|----------------------|
| 28F<br>90                                               | 85-34-301-12   |               | .RETAINER-<br>SUPPLIER CODE:<br>V94222<br>-----*-----                               | 476508            | 3                    |
| 95                                                      | 1L500407-105   |               | .SHROUD-LH, OUTBD TOILET<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS             | 476508            | 1                    |
| 100                                                     | NAS514P1032-5  |               | .SCREW                                                                              | 476508            | 4                    |
| 105                                                     | 1L500407-203   |               | .FASTENER-SNAP<br>SUPPLIER CODE:<br>V6S8D7<br>-----*-----                           | 476508            | 4                    |
| 110                                                     | 1L500113-47    |               | .TRIM-AFT WALL<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                       | 476508            | 1                    |
| 115                                                     | NAS514P832-8   |               | .SCREW<br>-----*-----                                                               | 476508            | 1                    |
| 120                                                     | 1L500113-3     |               | .TRIM-OUTBD WALL<br>SUPPLIER CODE:<br>V6S8D7                                        | 476508            | 1                    |
| 125                                                     | 1L400107-9     |               | .SHROUD-RH, CORNER<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                   | 476508            | 1                    |
| 130                                                     | 09T305         |               | .SCREW-<br>SUPPLIER CODE:<br>V94222<br>TRUE PART NUMBER:<br>09-T-305                | 476508            | 1                    |
| 135                                                     | NAS514P1032-12 |               | .SCREW                                                                              | 476508            | 1                    |
| 140                                                     | NAS514P1032-5  |               | .SCREW                                                                              | 476508            | 1                    |
| 145                                                     | NAS603-5P      |               | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12CK3-5                                     | 476508            | 1                    |
| 150                                                     | NAS1149D0332J  |               | .WASHER                                                                             | 476508            | 2                    |
| 155                                                     | NAS43DD3-8N    |               | .SPACER<br>STANDARD SUBSTITUTION:<br>NAS43DD3-8FC                                   | 476508            | 1                    |
| 160                                                     | 1L500407-203   |               | .FASTENER-SNAP<br>SUPPLIER CODE:<br>V6S8D7<br>-----*-----                           | 476508            | 1                    |
| 165                                                     | 1L400103-137   |               | .MIRROR ASSY-HINGED<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-41-51-42G | 476508            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |               |                                                                                     |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R

25-40-11-28F

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-11  
FIG. 28F  
PAGE 2  
APR 15/23


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                                                                                                    | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 28 F                                                    |                |                                                                                                                                                                                               |                   |                      |
| 170                                                     | NAS1801-3-5    | ATTACHING PARTS<br>.SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-5                                                                                                                            | 476508            | 6                    |
| 175                                                     | NAS1149D0332J  | .WASHER<br>-----*-----                                                                                                                                                                        | 476508            | 6                    |
| 180                                                     | 1L400103-23    | .STRIP ASSY-AMENITIES<br>SUPPLIER CODE:<br>V6S8D7                                                                                                                                             | 476508            | 1                    |
| 185                                                     | NAS1801-08-6   | ATTACHING PARTS<br>.SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN08-6                                                                                                                           | 476508            | 4                    |
| 190                                                     | AN970-3        | .WASHER<br>-----*-----                                                                                                                                                                        | 476508            | 4                    |
| 195                                                     | 1L400203-13    | .GASPER-<br>SUPPLIER CODE:<br>V6S8D7                                                                                                                                                          | 476508            | 1                    |
| 200                                                     | 1L500103-1     | .STRIP-<br>SUPPLIER CODE:<br>V6S8D7                                                                                                                                                           | 476508            | 1                    |
| 205                                                     | 1L460010-357   | .VANITY ASSY-UPR<br>SUPPLIER CODE:<br>V6S8D7<br>FUNCTIONAL REFERENCE:<br>EQUIPMENT/FURNISHINGS<br>FOR DETAILS SEE<br>25-41-51-42H<br>PLACARDS AND MARKINGS<br>FOR DETAILS SEE<br>11-32-05-26Y | 476508            | 1                    |
| 210                                                     | NAS514P1032-10 | ATTACHING PARTS<br>.SCREW                                                                                                                                                                     | 476508            | 1                    |
| 215                                                     | 09T305         | .SCREW-<br>SUPPLIER CODE:<br>V94222<br>TRUE PART NUMBER:<br>09-T-305                                                                                                                          | 476508            | 1                    |
| 220                                                     | NAS1149D0332J  | .WASHER<br>-----*-----                                                                                                                                                                        | 476508            | 1                    |
| 225                                                     | 1L500403-199   | .BRACKET-MIRROR MOUNT<br>SUPPLIER CODE:<br>V6S8D7                                                                                                                                             | 476508            | 2                    |
| 230                                                     | NAS1801-3-7    | ATTACHING PARTS<br>.SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-7                                                                                                                            | 476508            | 2                    |
| 235                                                     | NAS1149D0332J  | .WASHER<br>-----*-----                                                                                                                                                                        | 476508            | 2                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |                                                                                                                                                                                               |                   |                      |


— ITEM NOT ILLUSTRATED

R Y R

25-40-11-28F

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-11  
FIG. 28F  
PAGE 3  
FEB 15/24


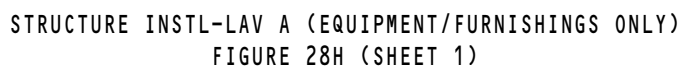


25-40-11-28H

ECCN 9E991 BOEING PROPRIETARY – See title page for details.



**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

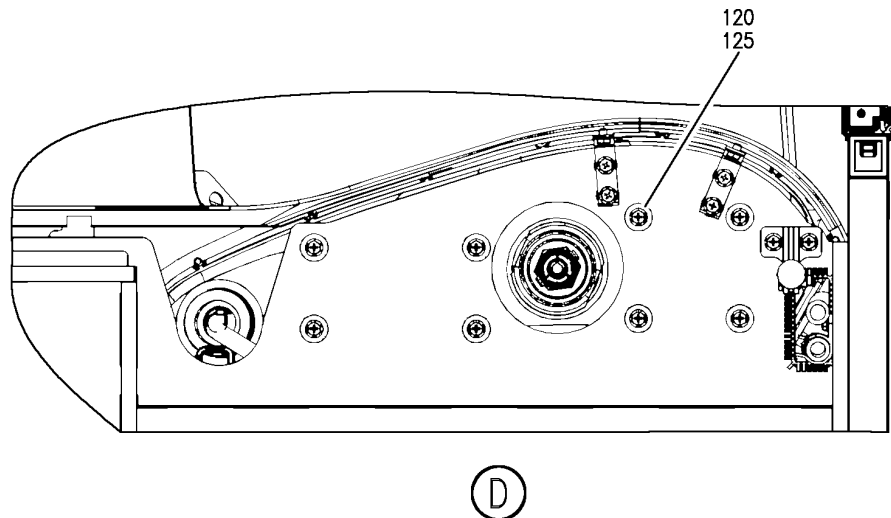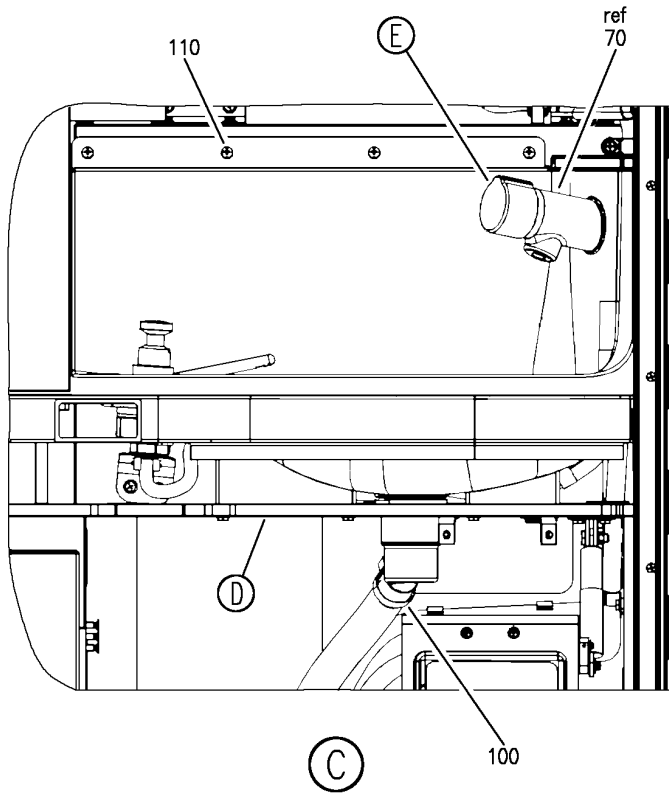

E 25401128H SHT 2 REV 275

STRUCTURE INSTL-LAV A (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 28H (SHEET 2)



**25-40-11-28H**

RJR  
JUN 15/19

25-40-11-28H  
PAGE 0A

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

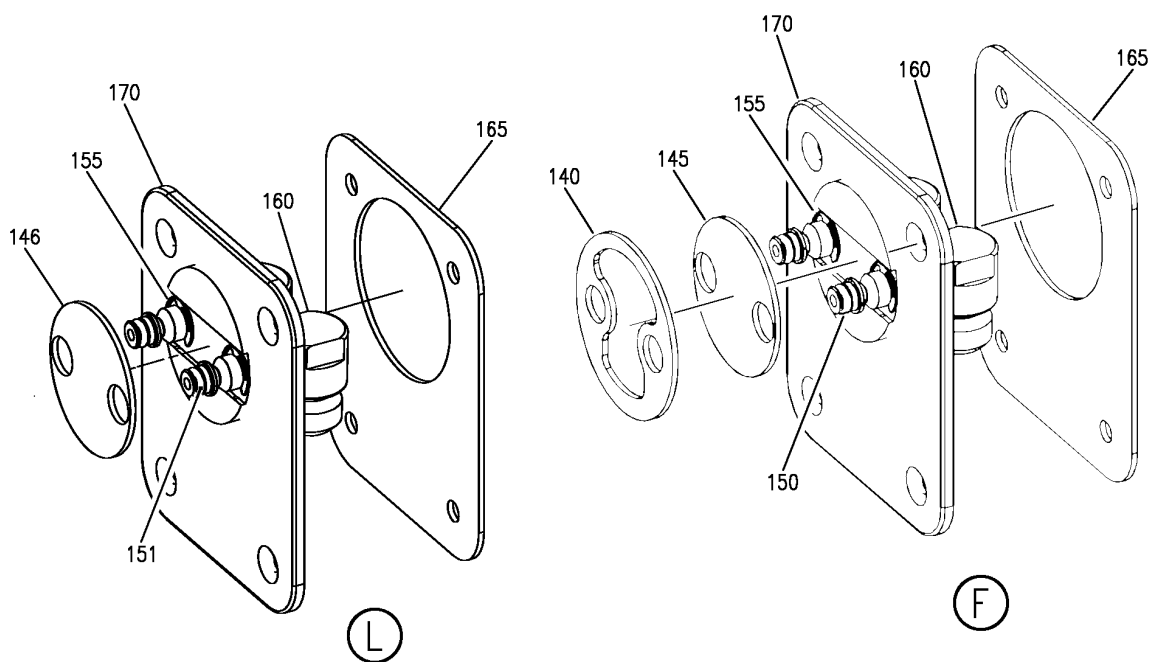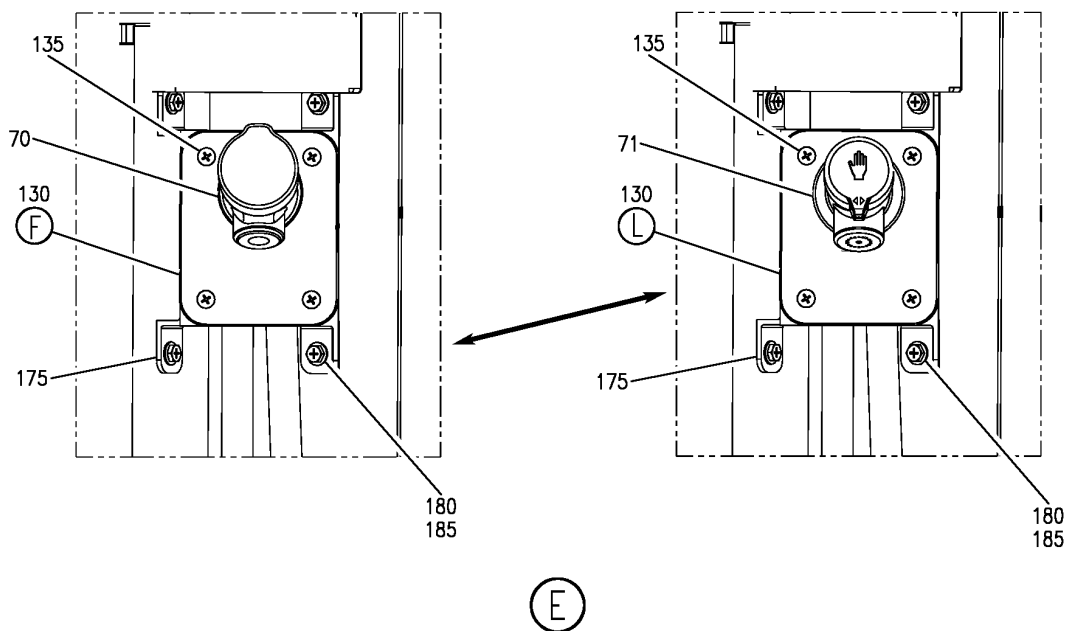

E 25401128H SHT 3 REV 273


STRUCTURE INSTL-LAV A (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 28H (SHEET 3)

**25-40-11-28H**

R Y R  
APR 15/19

25-40-11-28H  
PAGE 0B


ECCN 9E991 BOEING PROPRIETARY – See title page for details.

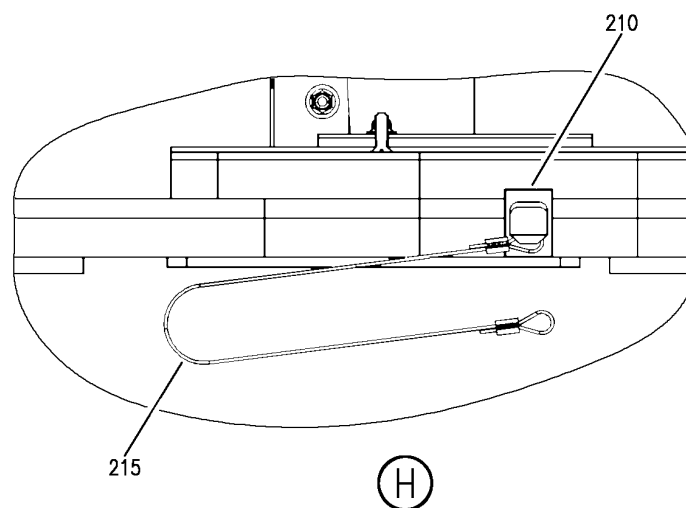

25-40-11-28H

25-40-11-28H  
PAGE 00

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

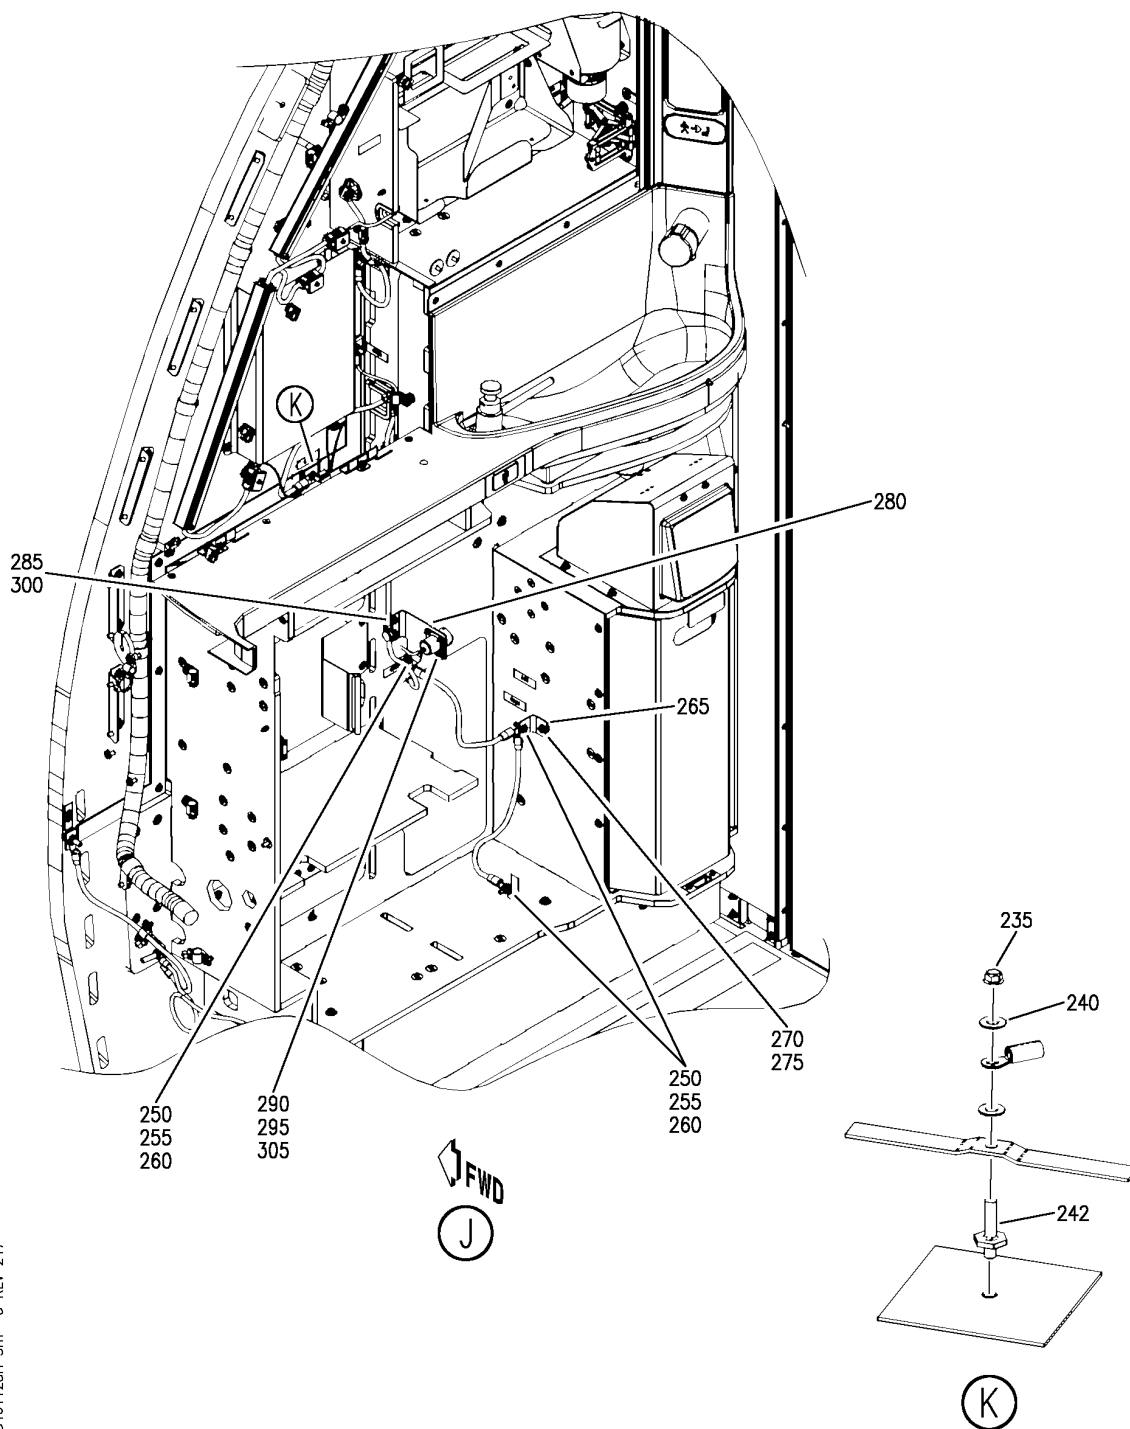

E 25401128H SHT 5 REV 247

STRUCTURE INSTL-LAV A (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 28H (SHEET 5)

**25-40-11-28H**

R/YR  
OCT 15/17

25-40-11-28H  
PAGE 0D

ECCN 9E991 BOEING PROPRIETARY – See title page for details.


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER     | 1 2 3 4 5 6 7 | NOMENCLATURE                                                                                                                                                                                                                                                               | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|-----------------|---------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 28H                                                     |                 |               | STRUCTURE INSTL-LAV A<br>(EQUIPMENT/FURNISHINGS<br>ONLY)                                                                                                                                                                                                                   | 476508            |                      |
| - 2                                                     | 1L306010-221CH2 |               | STRUCTURE INSTL-LAV A<br>(EQUIPMENT/FURNISHINGS<br>ONLY)                                                                                                                                                                                                                   | 476508            | RF                   |
|                                                         |                 |               | SUPPLIER CODE:<br>V6S8D7<br>FOR NHA/OTHER SYS DET SEE:<br>25-40-11-28D                                                                                                                                                                                                     |                   |                      |
| 50                                                      | 1L460010-343    |               | .LIGHT ASSY-<br>SUPPLIER CODE:<br>V6S8D7<br>FUNCTIONAL REFERENCE:<br>LIGHTS<br>FOR DETAILS SEE<br>33-26-03-08F<br>PLACARDS AND MARKINGS<br>FOR DETAILS SEE<br>11-32-05-26Z                                                                                                 | 476508            | 1                    |
|                                                         |                 |               | ATTACHING PARTS                                                                                                                                                                                                                                                            |                   |                      |
| 55                                                      | NAS1801-3-6     |               | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                                                                                                                                                                                                                            | 476508            | 6                    |
| 60                                                      | NAS1149D0332J   |               | .WASHER<br>-----*-----                                                                                                                                                                                                                                                     | 476508            | 6                    |
| 65                                                      | 1L500403-89     |               | .SHIM-<br>SUPPLIER CODE:<br>V6S8D7                                                                                                                                                                                                                                         | 476508            | 1                    |
| 70                                                      | AR9472-3W1D492  |               | .FAUCET ASSY-<br>SUPPLIER CODE:<br>V80477<br>SB DATA FROM A CMM:<br>PRE SB 1L3-25-0072<br>PRE SB 1L3-25-0114<br>CONFIG CHG DATA FROM A CMM:<br>SUPSD BY 4W200301-11<br>SUPSD BY 4101800-001<br>COMPONENT MAINT MANUAL REF:<br>38-11-71<br>FOR DETAILS SEE:<br>38-11-05-18Y | 476508            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                 |               |                                                                                                                                                                                                                                                                            |                   |                      |

- ITEM NOT ILLUSTRATED

RYR

25-40-11-28H

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-11  
FIG. 28H  
PAGE 1  
FEB 15/24


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER  | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                                                                                                                                                                                                                                                                              | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|--------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 28H<br>70                                               | SC4L500002-2 | . FAUCET ASSY-<br>SUPPLIER CODE:<br>V6S8D7<br>SB DATA FROM A CMM:<br>PRE SB 1L3-25-0072<br>PRE SB 1L3-25-0114<br>CONFIG CHG DATA FROM A CMM:<br>SUPSD BY SC4L500301-5<br>SUPSD BY SC4L500301-4<br>MISCELLANEOUS DATA:<br>ORDER AR9472-3W1D492<br><br>ADAMS RITE AEROSPACE<br>PART NUMBER<br>AR9472-3W1D492                                                              | 476508            | 1                    |
| 71                                                      | 4W200301-11  | . FAUCET ASSY-<br>SUPPLIER CODE:<br>V6S8D7<br>SB DATA FROM A CMM:<br>POST SB 1L3-25-0072<br>PRE SB 1L3-25-0114<br>CONFIG CHG DATA FROM A CMM:<br>SUPSD BY 4101800-001<br>SUPERSEDES<br>AR9472-3W1D492<br>COMPONENT MAINT MANUAL REF:<br>38-10-01<br>FOR DETAILS SEE:<br>38-11-05-60C                                                                                    | 476508            | 1                    |
| 71                                                      | SC4L500301-4 | . FAUCET ASSY-<br>SUPPLIER CODE:<br>V6S8D7<br>SB DATA FROM A CMM:<br>POST SB 1L3-25-0072<br>PRE SB 1L3-25-0114<br>CONFIG CHG DATA FROM A CMM:<br>SUPERSEDES SC4L500002-2<br>SUPSD BY SC4L500301-5<br>MISCELLANEOUS DATA:<br>ORDER 4W200301-11<br>COMPONENT MAINT MANUAL REF:<br>38-10-01<br>OPTIONAL PART:<br>4W200301-11<br>V6S8D7<br>FOR DETAILS SEE:<br>38-11-05-60C | 476508            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |              |                                                                                                                                                                                                                                                                                                                                                                         |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R

25-40-11-28H

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-11  
 FIG. 28H  
 PAGE 2  
 DEC 15/24


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER  | 1 2 3 4 5 6 7 | NOMENCLATURE                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                   | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|--------------|---------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 28H<br>71                                               | 4101800-001  |               | . FAUCET ASSY-<br>SUPPLIER CODE:<br>V5E3E9<br>SB DATA FROM A CMM:<br>POST SB 1L3-25-0114<br>CONFIG CHG DATA FROM A CMM:<br>SUPERSEDES<br>AR9472-3W1D492<br>SUPERSEDES 4W200301-11<br>COMPONENT MAINT MANUAL REF:<br>38-10-03<br>FOR DETAILS SEE:<br>38-11-05-60E                                                                                                                                                                                                                                                                                                               | 476508            | 1                    |
| 71                                                      | SC4L500301-5 |               | . FAUCET ASSY-<br>SUPPLIER CODE:<br>V6S8D7<br>FUNCTIONAL DESCRIPTION:<br>ASSEMBLY ALLOWS<br>DISPENSING OF POTABLE<br>WATER IN THE LAVATORY<br>SINK.<br>SB DATA FROM A CMM:<br>POST SB 1L3-25-0114<br>CONFIG CHG DATA FROM A CMM:<br>SUPERSEDES SC4L500002-2<br>SUPERSEDES SC4L500301-4<br>MISCELLANEOUS DATA:<br>ORDER 4101800-001<br><br>SC4L500301-5 IS AN<br>EQUIVALENT P/N FOR THE<br>4101800-001 FAUCET WHICH<br>IS COVERED BY CMM<br>38-10-03.<br>COMPONENT MAINT MANUAL REF:<br>38-10-03<br>OPTIONAL PART:<br>4101800-001<br>V5E3E9<br>FOR DETAILS SEE:<br>38-11-05-60E | 476508            | 1                    |
| - 75                                                    | 9L500001-003 |               | . STUD INSTL-GND, ELECTRICAL<br>SUPPLIER CODE:<br>V6S8D7                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                       | 476508            | 1                    |
| 80                                                      | NAS1801-3-10 |               | .. SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-10                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                             | 476508            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |              |               |                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                |                   |                      |

- ITEM NOT ILLUSTRATED

R Y R

25-40-11-28H

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-11  
FIG. 28H  
PAGE 3  
DEC 15/24


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                                                                       | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 28H<br>85                                               | MS21042L3      | ..NUT<br>STANDARD SUBSTITUTION:<br>BACN11AG3                                                                                                                     | 476508            | 1                    |
| 90                                                      | NAS1149D0316H  | ..WASHER                                                                                                                                                         | 476508            | 3                    |
| 100                                                     | NAS1922-0125-3 | .CLAMP                                                                                                                                                           | 476508            | 1                    |
| 105                                                     | 1L460010-303   | .SINK ASSY-<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-41-11-25T<br>ATTACHING PARTS                                                                   | 476508            | 1                    |
| 110                                                     | NAS514P1032-5  | .SCREW                                                                                                                                                           | 476508            | 4                    |
| 115                                                     | NAS514P1032-6  | .SCREW                                                                                                                                                           | 476508            | 2                    |
| 120                                                     | NAS1801-3-9    | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-9                                                                                                                  | 476508            | 8                    |
| 125                                                     | NAS1149D0332J  | .WASHER-<br>MISCELLANEOUS DATA:<br>USE AS REQUIRED TO<br>MAINTAIN FLUSHNESS WITH<br>THE REST OF THE VANITY.<br>-----*-----                                       | 476508            | AR                   |
| 130                                                     | 77586-1        | .PLATE ASSY-FAUCET MTG<br>SUPPLIER CODE:<br>V80477<br>COMPONENT MAINT MANUAL REF:<br>38-11-80                                                                    | 476508            | 1                    |
| 130                                                     | SC4L500002-3   | .PLATE ASSY-FAUCET MTG<br>SUPPLIER CODE:<br>V6S8D7<br>MISCELLANEOUS DATA:<br>ADAMS RITE AEROSPACE<br>PART NUMBER 77586-1<br><br>ORDER 77586-1<br>ATTACHING PARTS | 476508            | 1                    |
| 135                                                     | NAS514P1032-9  | .SCREW<br>-----*-----                                                                                                                                            | 476508            | 4                    |
| 140                                                     | 77593-1        | ..GASKET-<br>SUPPLIER CODE:<br>V80477<br>SB DATA FROM A CMM:<br>PRE SB 1L3-25-0072                                                                               | 476508            | 1                    |
| 145                                                     | 77644-1        | ..GASKET-<br>SUPPLIER CODE:<br>V80477<br>SB DATA FROM A CMM:<br>PRE SB 1L3-25-0072                                                                               | 476508            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |                                                                                                                                                                  |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R

25-40-11-28H

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-11  
FIG. 28H  
PAGE 4  
DEC 15/24




**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER   | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                                | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|---------------|---------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 28H<br>146                                              | 4W500301-31   | ..GASKET-<br>SUPPLIER CODE:<br>V6S8D7<br>SB DATA FROM A CMM:<br>POST SB 1L3-25-0072                                       | 476508            | 1                    |
| 150                                                     | 20166-007     | ..PACKING-<br>SUPPLIER CODE:<br>V80477<br>SB DATA FROM A CMM:<br>PRE SB 1L3-25-0072                                       | 476508            | 2                    |
| 151                                                     | LCCS14-007B   | ..PACKING-<br>SUPPLIER CODE:<br>V6S8D7<br>TRUE PART NUMBER:<br>LCCS-14-007B<br>SB DATA FROM A CMM:<br>POST SB 1L3-25-0072 | 476508            | 2                    |
| 155                                                     | 20058-31      | ..RING-<br>SUPPLIER CODE:<br>V80477                                                                                       | 476508            | 2                    |
| 160                                                     | 77592-1       | ..FITTING-<br>SUPPLIER CODE:<br>V80477                                                                                    | 476508            | 2                    |
| 165                                                     | 77599-1       | ..GASKET-<br>SUPPLIER CODE:<br>V80477                                                                                     | 476508            | 1                    |
| 170                                                     | 77585-1       | ..PLATE-BACK<br>SUPPLIER CODE:<br>V80477                                                                                  | 476508            | 1                    |
| 175                                                     | 4W400101-5    | .BRACKET ASSY-FAUCET MTG<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                                                   | 476508            | 1                    |
| 180                                                     | NAS1801-3-6   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                                                                           | 476508            | 4                    |
| 185                                                     | NAS1149D0332J | .WASHER<br>-----*-----                                                                                                    | 476508            | 4                    |
| 190                                                     | 1L400101-15   | .DOOR ASSY-ACCESS<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-41-51-42S                                         | 476508            | 1                    |
| 195                                                     | 4L400401-21   | .PLATE ASSY-CLOSEOUT<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-41-11-25W                                      | 476508            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |               |                                                                                                                           |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R

# 25-40-11-28H

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-11  
 FIG. 28H  
 PAGE 5  
 DEC 15/24

 **BOEING**  
737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 NOMENCLATURE                                                             | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|----------------------------------------------------------------------------------------|-------------------|----------------------|
| 28H                                                     |                |                                                                                        |                   |                      |
| 200                                                     | NAS1801-3-16   | . ATTACHING PARTS<br>. SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-16                 | 476508            | 4                    |
| 205                                                     | NAS1149D0332J  | . WASHER<br>-----*-----                                                                | 476508            | 4                    |
| 210                                                     | LWC19AC14      | . CLIP-ADHESIVE BACKED<br>SUPPLIER CODE:<br>V06383<br>TRUE PART NUMBER:<br>LWC19-A-C14 | 476508            | 1                    |
| 215                                                     | 4595339-012    | . LANYARD-<br>SUPPLIER CODE:<br>V16827                                                 | 476508            | 1                    |
| 220                                                     | 4L500401-45    | . FITTING-<br>SUPPLIER CODE:<br>V6S8D7                                                 | 476508            | 1                    |
| 225                                                     | NAS1922-0125-3 | . ATTACHING PARTS<br>. CLAMP<br>-----*-----                                            | 476508            | 2                    |
| - 230                                                   | 9L500001-051   | . STRAP INSTL-GND,<br>ELECTRICAL<br>SUPPLIER CODE:<br>V6S8D7                           | 476508            | 1                    |
| 235                                                     | MS21042L3      | .. NUT<br>STANDARD SUBSTITUTION:<br>BACN11AG3                                          | 476508            | 1                    |
| 240                                                     | NAS1149D0332H  | .. WASHER                                                                              | 476508            | 2                    |
| 242                                                     | 9L500001-201   | .. STANDOFF-HEXAGONAL<br>SUPPLIER CODE:<br>V6S8D7                                      | 476508            | 1                    |
| - 245                                                   | 9L500001-003   | . STUD INSTL-GND, ELECTRICAL<br>SUPPLIER CODE:<br>V6S8D7                               | 476508            | 3                    |
| 250                                                     | NAS1801-3-10   | .. SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-10                                     | 476508            | 1                    |
| 255                                                     | MS21042L3      | .. NUT<br>STANDARD SUBSTITUTION:<br>BACN11AG3                                          | 476508            | 1                    |
| 260                                                     | NAS1149D0316H  | .. WASHER                                                                              | 476508            | 3                    |
| 265                                                     | 3L500101-31    | . BRACKET-GND, ELECTRICAL<br>SUPPLIER CODE:<br>V6S8D7                                  | 476508            | 1                    |
| 270                                                     | NAS1801-3-7    | . ATTACHING PARTS<br>. SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-7                  | 476508            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |                                                                                        |                   |                      |

- ITEM NOT ILLUSTRATED

R Y R

25-40-11-28H

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-11  
FIG. 28H  
PAGE 6  
DEC 15/24


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER   | 1 2 3 4 5 6 7 | NOMENCLATURE                                                              | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|---------------|---------------|---------------------------------------------------------------------------|-------------------|----------------------|
| 28H<br>275                                              | NAS1149D0332K | .             | WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0332J<br>-----*-----          | 476508            | 1                    |
| 280                                                     | 3L500101-21   | .             | BRACKET-WATER HEATER DISC.<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS | 476508            | 1                    |
| 285                                                     | NAS1801-3-6   | .             | SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                            | 476508            | 2                    |
| 290                                                     | NAS1801-04-6  | .             | SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN04-6                           | 476508            | 4                    |
| 295                                                     | MS21042L04    | .             | NUT<br>STANDARD SUBSTITUTION:<br>BACN11AG04                               | 476508            | 4                    |
| 300                                                     | NAS1149D0316K | .             | WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J                         | 476508            | 2                    |
| 305                                                     | NAS1149DN432J | .             | WASHER<br>-----*-----                                                     | 476508            | 8                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |               |               |                                                                           |                   |                      |

— ITEM NOT ILLUSTRATED


R Y R

25-40-11-28H

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-11  
 FIG. 28H  
 PAGE 7  
 DEC 15/24

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

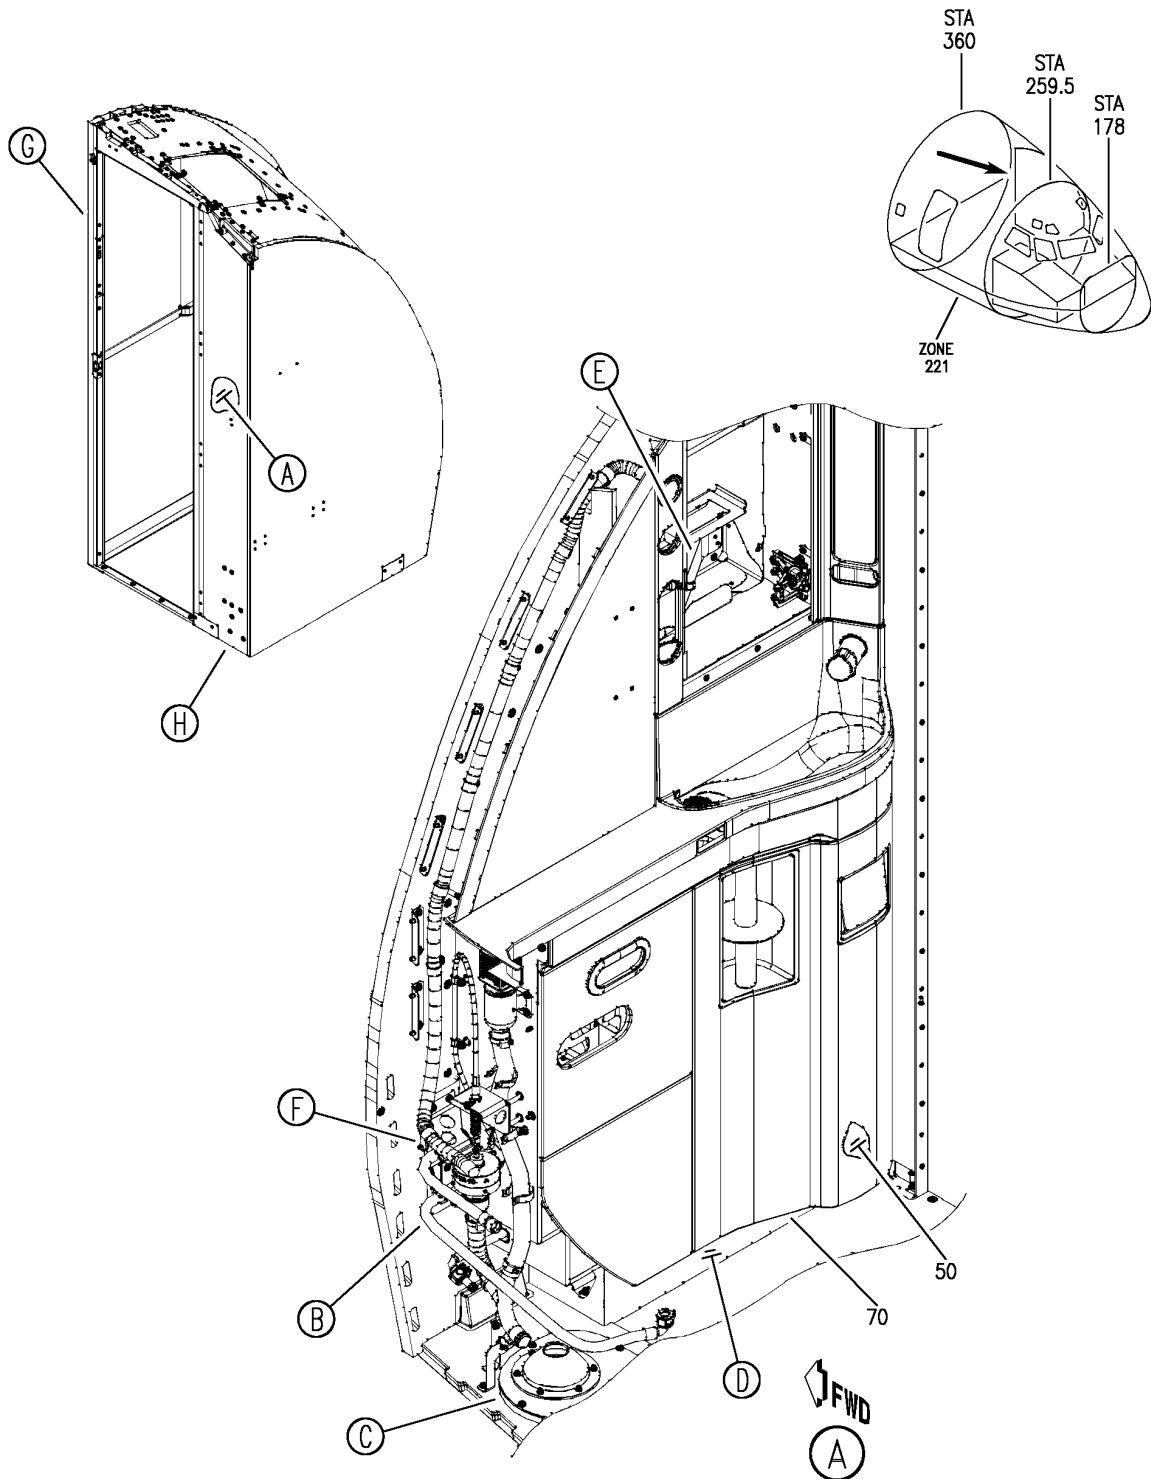

E 25401128K SHT 1 REV 247

STRUCTURE INSTL-LAV A (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 28K (SHEET 1)


**25-40-11-28K**

R/YR  
FEB 15/20


25-40-11-28K  
PAGE 0

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

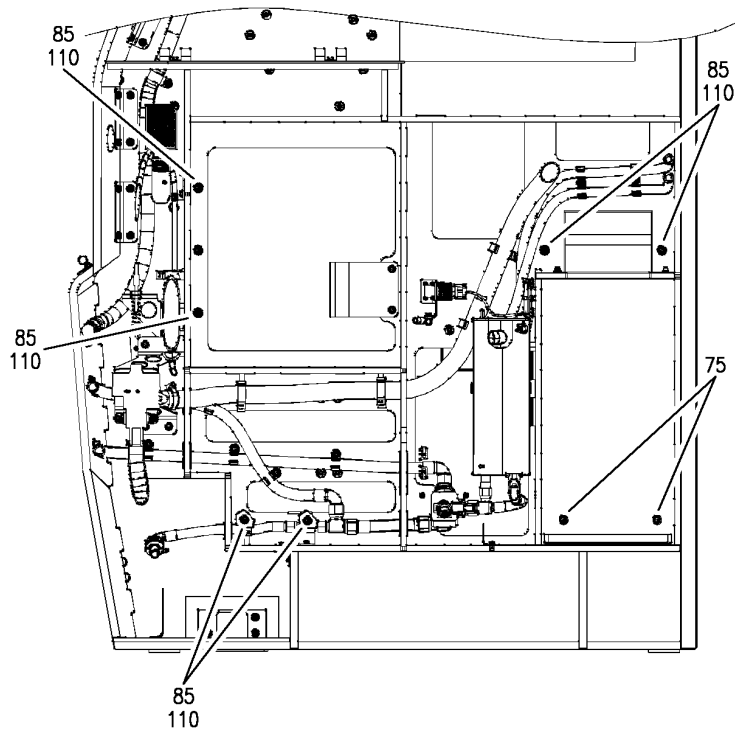

(B)

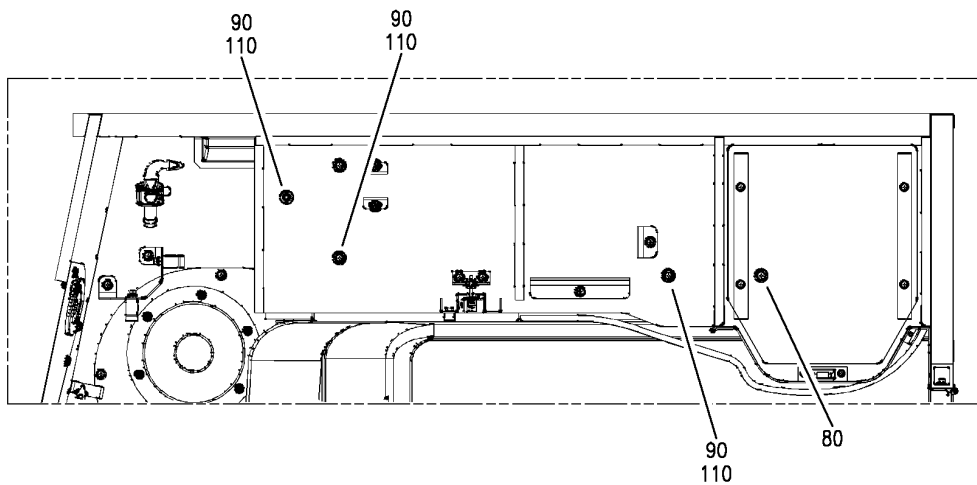

(C)

E 25401128K SHT 2 REV 247


STRUCTURE INSTL-LAV A (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 28K (SHEET 2)

**25-40-11-28K**


R/YR  
FEB 15/20

25-40-11-28K  
PAGE 0A


ECCN 9E991 BOEING PROPRIETARY – See title page for details.

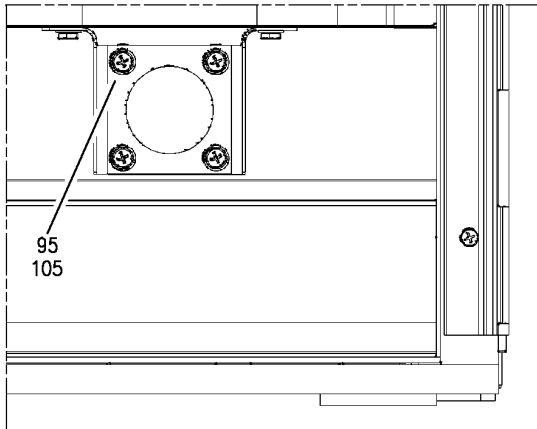

(D)

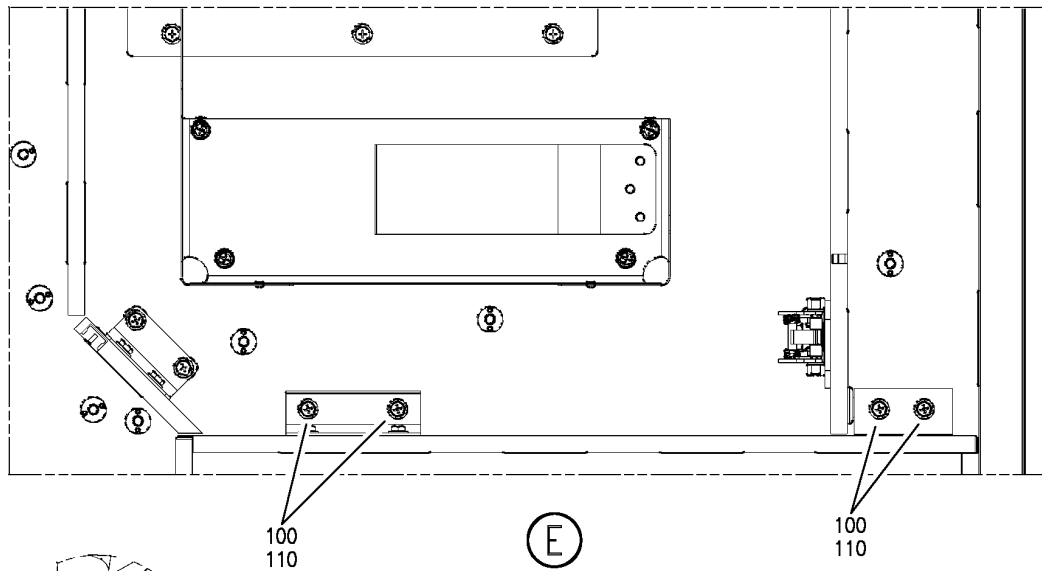

(E)

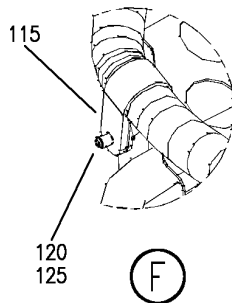

(F)

E 25401128K SHT 3 REV 247


STRUCTURE INSTL-LAV A (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 28K (SHEET 3)

**25-40-11-28K**

R Y R  
F E B 15 / 20

25-40-11-28K  
PAGE 0B

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

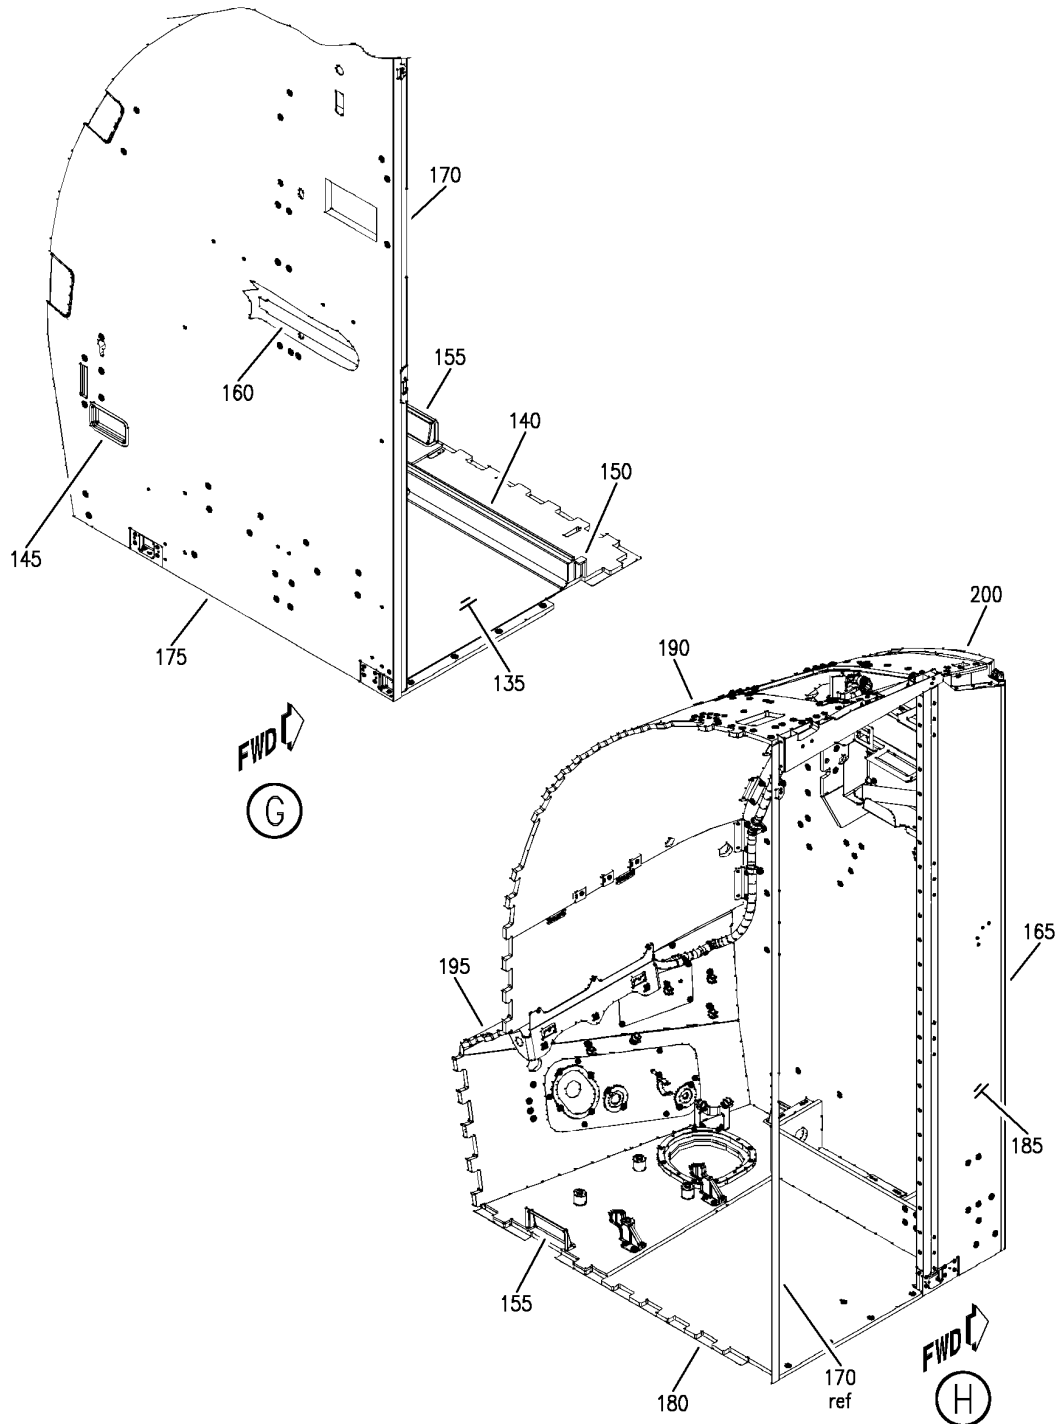

E 25401128K SHT 4 REV 247

STRUCTURE INSTL-LAV A (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 28K (SHEET 4)

**25-40-11-28K**

R Y R  
F E B 15 / 20

25-40-11-28K  
PAGE 0C

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

 **BOEING**  
737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER     | 1 2 3 4 5 6 7 | NOMENCLATURE                                                                                                                       | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|-----------------|---------------|------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 28K                                                     |                 |               | STRUCTURE INSTL-LAV A<br>(EQUIPMENT/FURNISHINGS<br>ONLY)                                                                           | 476508            |                      |
| - 2                                                     | 1L306010-221CH3 |               | STRUCTURE INSTL-LAV A<br>(EQUIPMENT/FURNISHINGS<br>ONLY)<br>SUPPLIER CODE:<br>V6S8D7<br>FOR NHA/OTHER SYS DET SEE:<br>25-40-11-28D | 476508            | RF                   |
| 50                                                      | 1L400101-65     |               | .CAN ASSY-WASTE<br>SUPPLIER CODE:<br>V6S8D7                                                                                        | 476508            | 1                    |
| - 52                                                    | SL00201         |               | ..GROMMET-<br>SUPPLIER CODE:<br>VOHES0<br>MISCELLANEOUS DATA:<br>ORDER LCEE000022                                                  | 476508            | AR                   |
| - 52                                                    | LCEE000022      |               | ..GROMMET-<br>SUPPLIER CODE:<br>V6S8D7<br>MISCELLANEOUS DATA:<br>DEVICE TECHNOLOGIES,<br>INC. PART NUMBER.<br>SL00201              | 476508            | AR                   |
| - 55                                                    | NAS1922-0050-3  |               | .CLAMP                                                                                                                             | 476508            | 1                    |
| - 65                                                    | MS3367-5-9      |               | .STRAP<br>STANDARD SUBSTITUTION:<br>BACS38K5                                                                                       | 476508            | AR                   |
| 70                                                      | 1L406100-209    |               | .VANITY ASSY-LWR<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-41-51-42T<br>ATTACHING PARTS                                | 476508            | 1                    |
| 75                                                      | NAS514P1032-10  |               | .SCREW                                                                                                                             | 476508            | 2                    |
| 80                                                      | NAS514P1032-12  |               | .SCREW                                                                                                                             | 476508            | 1                    |
| 85                                                      | NAS1801-3-11    |               | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-11                                                                                   | 476508            | 7                    |
| 90                                                      | NAS1801-3-13    |               | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-13                                                                                   | 476508            | 3                    |
| 95                                                      | NAS603-7B       |               | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12CK3H7                                                                                    | 476508            | 4                    |
| 100                                                     | NAS1801-3-6     |               | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                                                                                    | 476508            | 4                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                 |               |                                                                                                                                    |                   |                      |

- ITEM NOT ILLUSTRATED

RYR

25-40-11-28K

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-11  
FIG. 28K  
PAGE 1  
FEB 15/24




**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 | NOMENCLATURE           | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|---------------|------------------------|-------------------|----------------------|
| 28K                                                     |                |               |                        |                   |                      |
| 105                                                     | NAS1149C0316R  | .             | WASHER                 | 476508            | 4                    |
| 110                                                     | NAS1149D0332J  | .             | WASHER                 | 476508            | 14                   |
|                                                         |                | -----*-----   |                        |                   |                      |
| 115                                                     | BACC10DK13     | .             | CLAMP                  | 476508            | 1                    |
|                                                         |                |               | ATTACHING PARTS        |                   |                      |
| 120                                                     | NAS1801-3-8    | .             | SCREW                  | 476508            | 1                    |
|                                                         |                |               | STANDARD SUBSTITUTION: |                   |                      |
|                                                         |                |               | BACS12HN3-8            |                   |                      |
| 125                                                     | NAS1149D0332J  | .             | WASHER                 | 476508            | 1                    |
|                                                         |                | -----*-----   |                        |                   |                      |
| - 130                                                   | 1L400407-63    | .             | PAN ASSY-FLOOR         | 476508            | 1                    |
|                                                         |                |               | SUPPLIER CODE:         |                   |                      |
|                                                         |                |               | V6S8D7                 |                   |                      |
| 135                                                     | 1L400107-119   | ..            | MAT-                   | 476508            | 1                    |
|                                                         |                |               | SUPPLIER CODE:         |                   |                      |
|                                                         |                |               | V6S8D7                 |                   |                      |
| 140                                                     | 1L500107-11    | ..            | PAN-                   | 476508            | 1                    |
|                                                         |                |               | SUPPLIER CODE:         |                   |                      |
|                                                         |                |               | V6S8D7                 |                   |                      |
| 145                                                     | 1L500109-139   | .             | COVER-                 | 476508            | 1                    |
|                                                         |                |               | SUPPLIER CODE:         |                   |                      |
|                                                         |                |               | V6S8D7                 |                   |                      |
| 150                                                     | 1L500109-333   | .             | CLOSEOUT-FLOOR         | 476508            | 1                    |
|                                                         |                |               | SUPPLIER CODE:         |                   |                      |
|                                                         |                |               | V6S8D7                 |                   |                      |
| 155                                                     | 1L500109-347   | .             | CLOSEOUT-FLOOR         | 476508            | 2                    |
|                                                         |                |               | SUPPLIER CODE:         |                   |                      |
|                                                         |                |               | V6S8D7                 |                   |                      |
| 160                                                     | 1L500113-11    | .             | TRIM-AFT WALL CLOSEOUT | 476508            | 1                    |
|                                                         |                |               | SUPPLIER CODE:         |                   |                      |
|                                                         |                |               | V6S8D7                 |                   |                      |
| 165                                                     | 1L500709-655   | .             | TRIM-EDGE              | 476508            | 1                    |
|                                                         |                |               | SUPPLIER CODE:         |                   |                      |
|                                                         |                |               | V6S8D7                 |                   |                      |
| 170                                                     | 1L500709-669   | .             | TRIM-EDGE              | 476508            | 1                    |
|                                                         |                |               | SUPPLIER CODE:         |                   |                      |
|                                                         |                |               | V6S8D7                 |                   |                      |
| 175                                                     | 1L460010-485CH | .             | WALL ASSY-AFT          | 476508            | 1                    |
|                                                         |                |               | SUPPLIER CODE:         |                   |                      |
|                                                         |                |               | V6S8D7                 |                   |                      |
|                                                         |                |               | FOR DETAILS SEE:       |                   |                      |
|                                                         |                |               | 25-41-40-27N           |                   |                      |
| 180                                                     | 1L460010-397   | .             | FLOOR ASSY-            | 476508            | 1                    |
|                                                         |                |               | SUPPLIER CODE:         |                   |                      |
|                                                         |                |               | V6S8D7                 |                   |                      |
|                                                         |                |               | FOR DETAILS SEE:       |                   |                      |
|                                                         |                |               | 25-41-21-15C           |                   |                      |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |               |                        |                   |                      |

- ITEM NOT ILLUSTRATED

R Y R

25-40-11-28K

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-11  
 FIG. 28K  
 PAGE 2  
 FEB 15/24


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                                                                                             | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 28K<br>185                                              | 1L460010-361CH | .WALL ASSY-INBD<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-41-40-27K                                                                                                        | 476508            | 1                    |
| 190                                                     | 1L460010-325   | .CEILING ASSY-UPR<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-41-45-06P                                                                                                      | 476508            | 1                    |
| 195                                                     | 1L460010-305   | .WALL ASSY-OUTBD<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-41-40-27R                                                                                                       | 476508            | 1                    |
| 200                                                     | 1L460010-327   | .WALL ASSY-FWD<br>SUPPLIER CODE:<br>V6S8D7<br>FUNCTIONAL REFERENCE:<br>AIR CONDITIONING<br>FOR DETAILS SEE<br>21-24-51-11Y<br>EQUIPMENT/FURNISHINGS<br>FOR DETAILS SEE<br>25-41-40-27L | 476508            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |                                                                                                                                                                                        |                   |                      |

— ITEM NOT ILLUSTRATED





R Y R

25-40-11-28K

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

25-40-11  
 FIG. 28K  
 PAGE 3  
 FEB 15/24

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

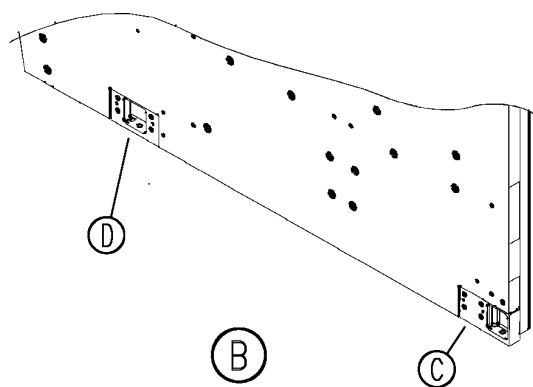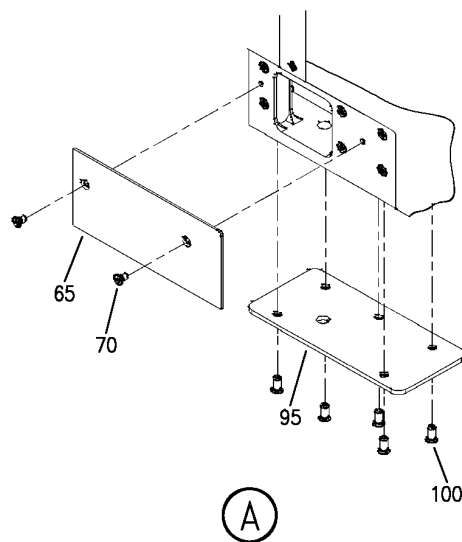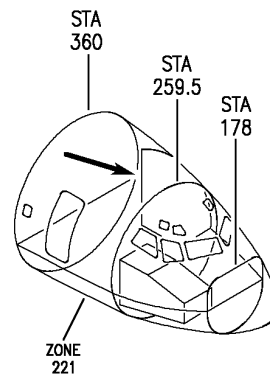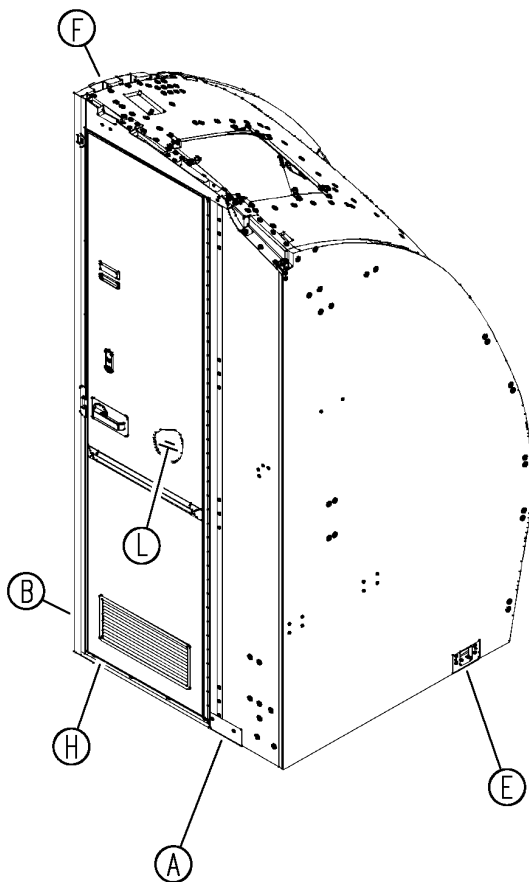

E 25401128M SHT 1 REV 267

STRUCTURE INSTL-LAV A  
FIGURE 28M (SHEET 1)




**25-40-11-28M**

R/YR  
AUG 15/20

25-40-11-28M  
PAGE 0

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

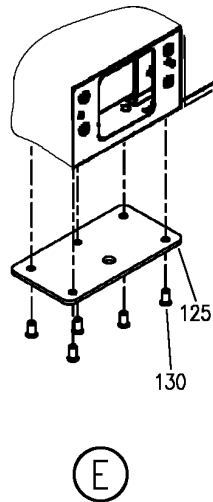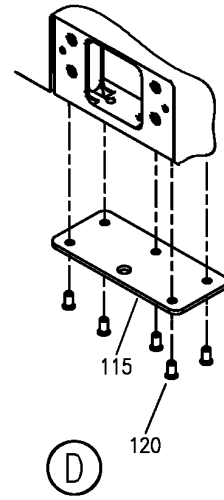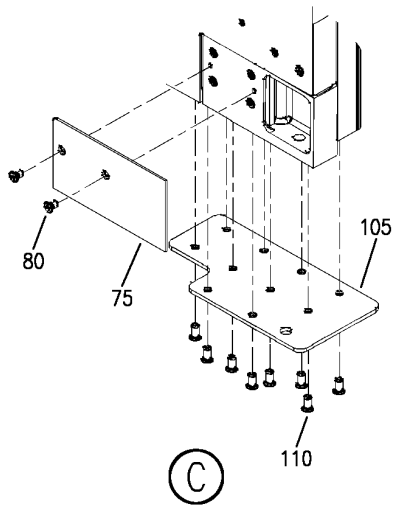

E 25401128M SHT 2 REV 267

STRUCTURE INSTL-LAV A  
FIGURE 28M (SHEET 2)


**25-40-11-28M**

R Y R  
AUG 15/20

25-40-11-28M  
PAGE 0A

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

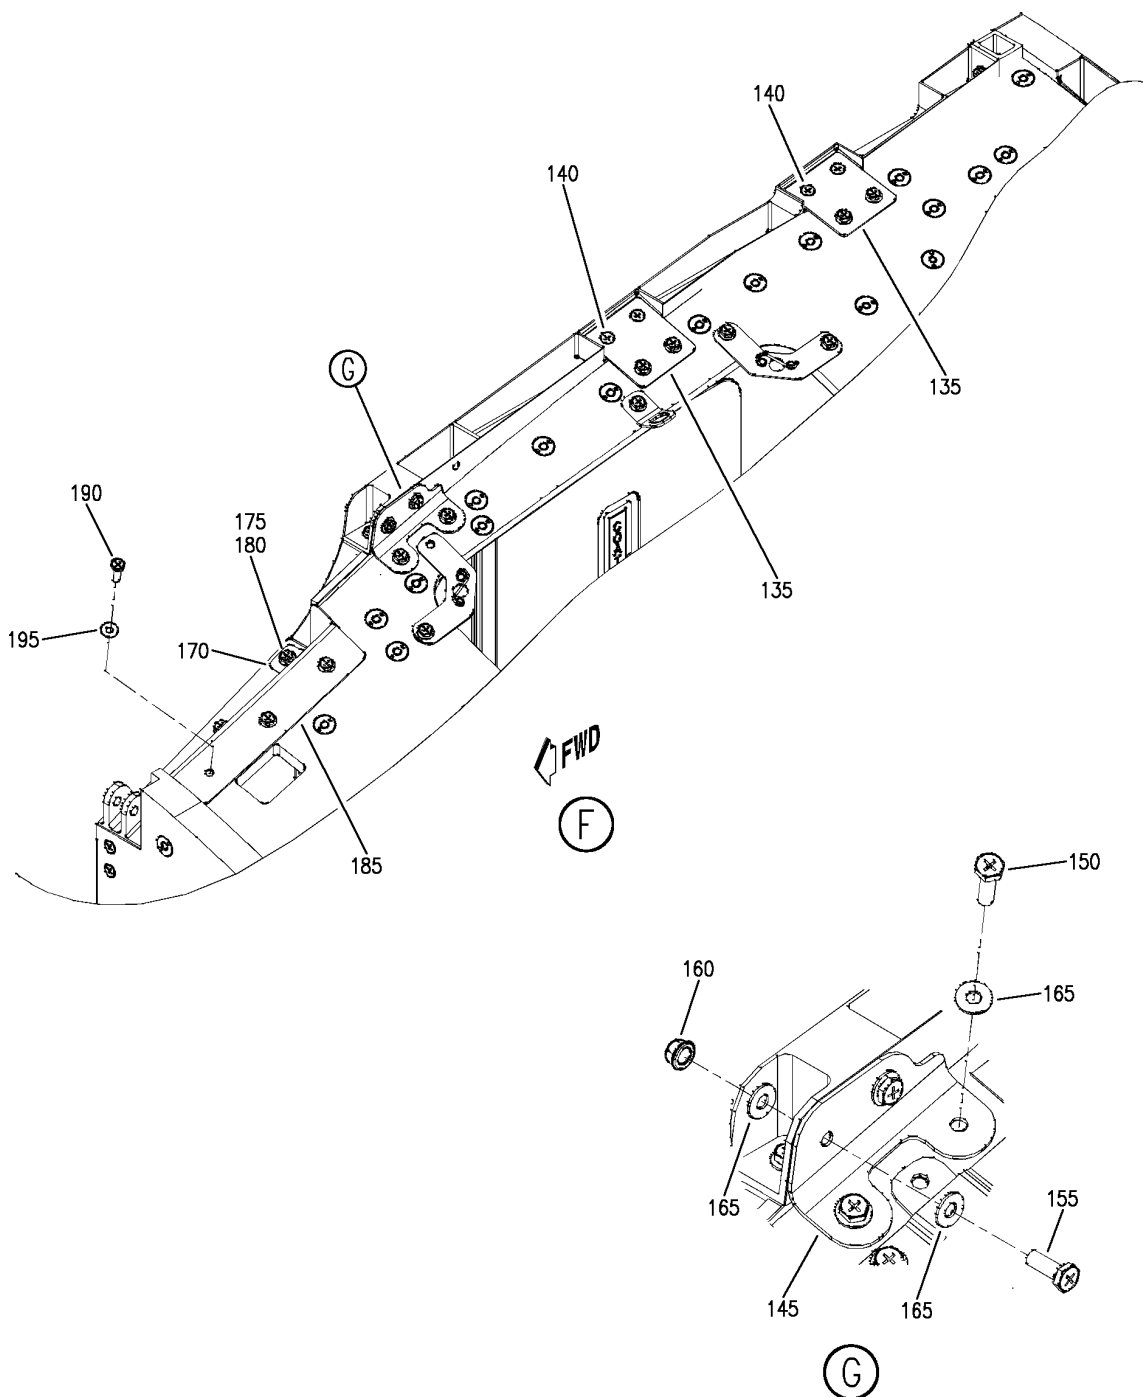

E 25401128M SHT 3 REV 251

STRUCTURE INSTL-LAV A  
FIGURE 28M (SHEET 3)


**25-40-11-28M**

R Y R  
AUG 15/20

25-40-11-28M  
PAGE 0B

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

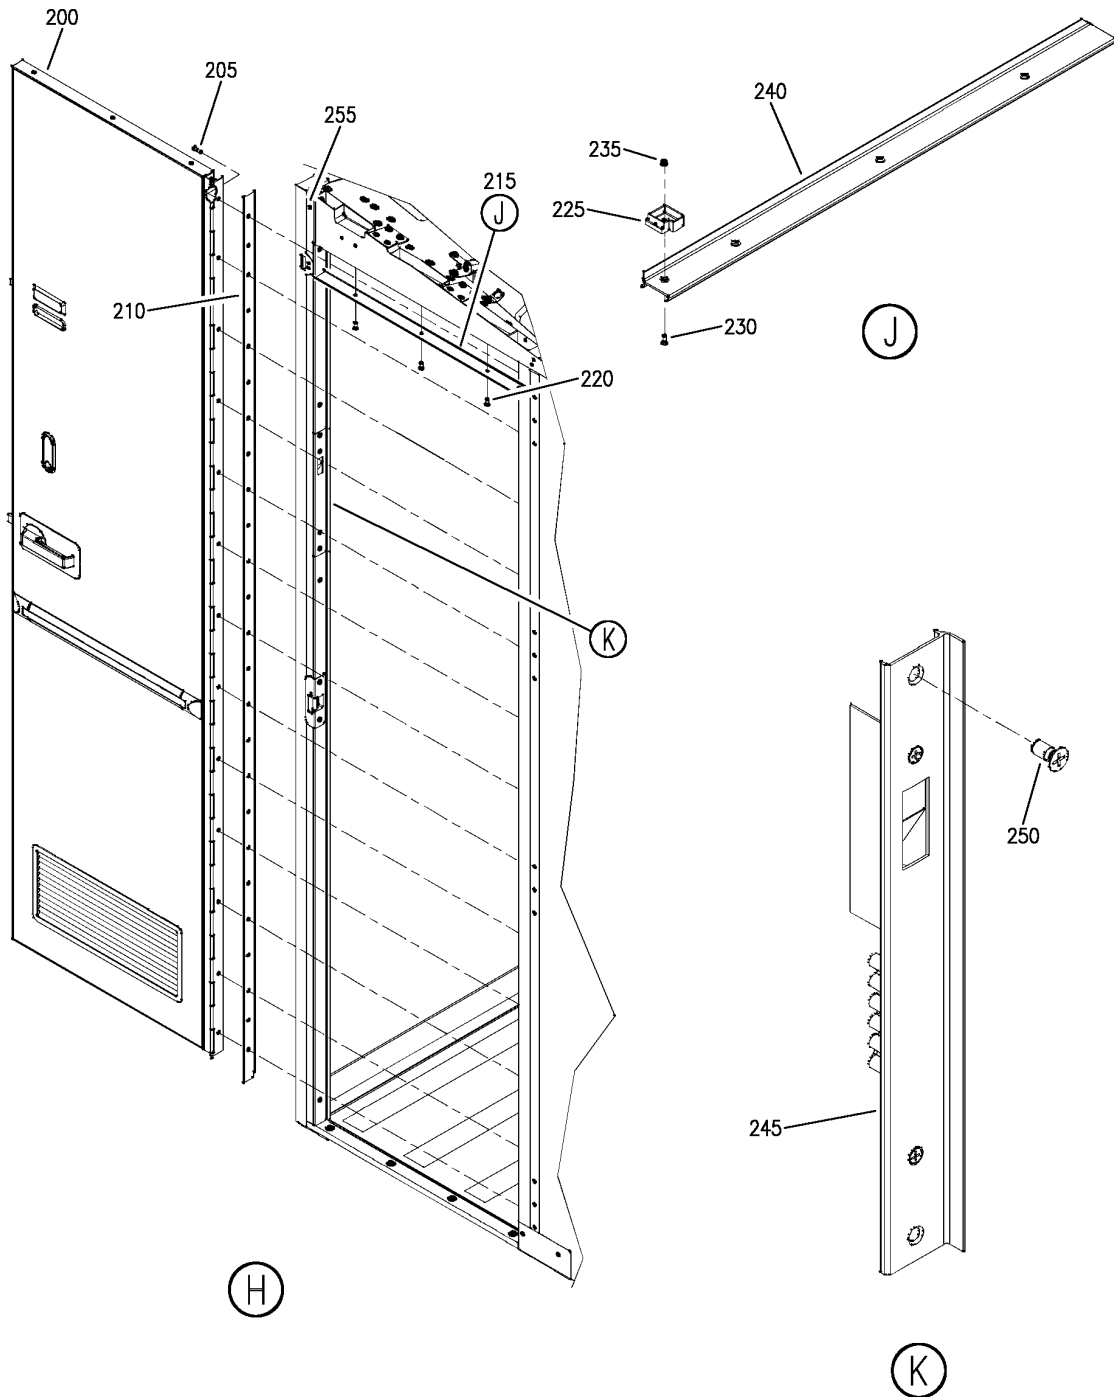

E 25401128M SHT 4 REV 251

STRUCTURE INSTL-LAV A  
FIGURE 28M (SHEET 4)


**25-40-11-28M**

R Y R  
AUG 15/20

25-40-11-28M  
PAGE 0C

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

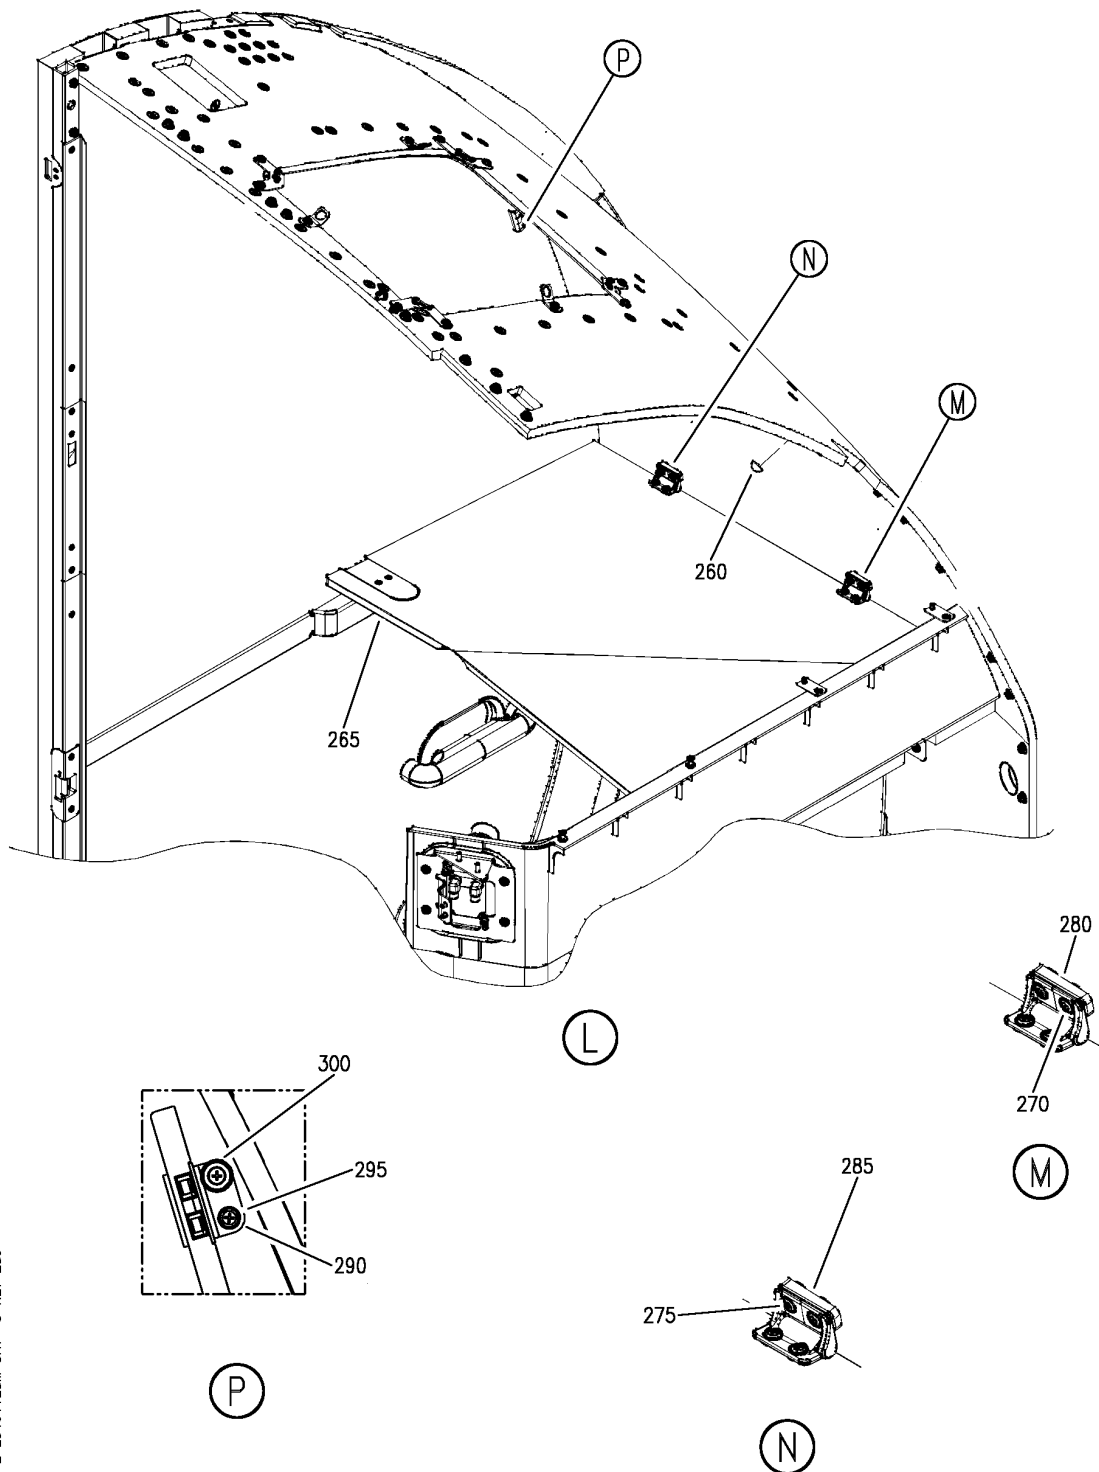

E 25401128M SHT 5 REV 289

STRUCTURE INSTL-LAV A  
FIGURE 28M (SHEET 5)

**25-40-11-28M**

R Y R  
AUG 15/20

25-40-11-28M  
PAGE 0D

ECCN 9E991 BOEING PROPRIETARY – See title page for details.


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER     | 1 2 3 4 5 6 7 | NOMENCLATURE                                                                                                                                                                              | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|-----------------|---------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 28M                                                     |                 |               |                                                                                                                                                                                           |                   |                      |
| - 1                                                     | 1L306010-437HF  |               | STRUCTURE INSTL-LAV A<br>STRUCTURE ASSY-LAV A<br>SUPPLIER CODE:<br>V6S8D7<br>FOR NHA SEE:<br>25-40-11-23D                                                                                 | 509999<br>509999  | RF                   |
| - 50                                                    | 1L306010-437HF1 |               | .STRUCTURE INSTL-<br>SUPPLIER CODE:<br>V6S8D7<br>FUNCTIONAL REFERENCE:<br>EQUIPMENT/FURNISHINGS<br>FOR DETAILS SEE<br>25-40-11-28N<br>LIGHTS<br>FOR DETAILS SEE<br>33-26-03-46X           | 509999            | RF                   |
| - 55                                                    | 1L306010-437HF2 |               | .STRUCTURE INSTL-<br>SUPPLIER CODE:<br>V6S8D7<br>FUNCTIONAL REFERENCE:<br>AIR CONDITIONING<br>FOR DETAILS SEE<br>21-45-51-24E<br>EQUIPMENT/FURNISHINGS<br>FOR DETAILS SEE<br>25-40-11-28P | 509999            | RF                   |
| - 60                                                    | MS3367-5-9      |               | .STRAP<br>STANDARD SUBSTITUTION:<br>BACS38K5                                                                                                                                              | 509999            | AR                   |
| 65                                                      | 1L500109-689CH  |               | .PLATE-COVER<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                                                                                                                               | 509999            | 1                    |
| 70                                                      | NAS514P632-5    |               | .SCREW<br>-----*-----                                                                                                                                                                     | 509999            | 2                    |
| 75                                                      | 1L500109-593CH  |               | .PLATE-COVER<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                                                                                                                               | 509999            | 1                    |
| 80                                                      | NAS514P632-5    |               | .SCREW<br>-----*-----                                                                                                                                                                     | 509999            | 2                    |
| - 85                                                    | 1L500109-685CH  |               | .PLATE-COVER<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                                                                                                                               | 509999            | 1                    |
| - 90                                                    | NAS514P632-5    |               | .SCREW<br>-----*-----                                                                                                                                                                     | 509999            | 2                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                 |               |                                                                                                                                                                                           |                   |                      |

— ITEM NOT ILLUSTRATED

RYR

25-40-11-28M

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-11  
FIG. 28M  
PAGE 1  
APR 15/23




**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER   | 1 2 3 4 5 6 7 NOMENCLATURE                                        | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|---------------|-------------------------------------------------------------------|-------------------|----------------------|
| 28M                                                     |               |                                                                   |                   |                      |
| 95                                                      | 1L500109-79   | .PLATE-SHEAR<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS       | 509999            | 1                    |
| 100                                                     | BACB30VF3K1   | .BOLT<br>-----*-----                                              | 509999            | 5                    |
| 105                                                     | 1L500109-749  | .PLATE-SHEAR<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS       | 509999            | 1                    |
| 110                                                     | BACB30VF3K1   | .BOLT<br>-----*-----                                              | 509999            | 10                   |
| 115                                                     | 1L500109-57   | .PLATE-SHEAR<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS       | 509999            | 1                    |
| 120                                                     | BACB30VF3K1   | .BOLT<br>-----*-----                                              | 509999            | 5                    |
| 125                                                     | 1L500109-81   | .SHEAR PLATE-<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS      | 509999            | 1                    |
| 130                                                     | BACB30VF3K1   | .BOLT<br>-----*-----                                              | 509999            | 5                    |
| 135                                                     | 1L500109-151  | .BRACKET-<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS          | 509999            | 2                    |
| 140                                                     | NAS514P1032-8 | .SCREW<br>-----*-----                                             | 509999            | 4                    |
| 145                                                     | 1L500109-155  | .BRACKET-<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS          | 509999            | 1                    |
| 150                                                     | NAS1801-3-6   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                   | 509999            | 2                    |
| 155                                                     | NAS1801-3-8   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-8                   | 509999            | 2                    |
| 160                                                     | MS21042L3     | .NUT<br>STANDARD SUBSTITUTION:<br>BACN11AG3                       | 509999            | 1                    |
| 165                                                     | NAS1149D0332K | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0332J<br>-----*----- | 509999            | 5                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |               |                                                                   |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R

25-40-11-28M

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-11  
 FIG. 28M  
 PAGE 2  
 APR 15/23


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER   | 1 2 3 4 5 6 7 NOMENCLATURE                                                                     | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|---------------|------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 28M<br>170                                              | 1L500109-403  | .BRACKET-CLOSEOUT<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                               | 509999            | 1                    |
| 175                                                     | NAS1801-3-6   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                                                | 509999            | 1                    |
| 180                                                     | NAS1149D0332K | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0332J<br>-----*-----                              | 509999            | 1                    |
| 185                                                     | 1L500109-101  | .BRACKET-CEILING CLOSEOUT<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                       | 509999            | 1                    |
| 190                                                     | NAS1801-3-6   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                                                | 509999            | 5                    |
| 195                                                     | NAS1149D0332K | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0332J<br>-----*-----                              | 509999            | 5                    |
| 200                                                     | 1L400105-33HF | .DOOR ASSY-<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-41-13-13B<br>ATTACHING PARTS | 509999            | 1                    |
| 205                                                     | NAS8603-3     | .BOLT<br>-----*-----                                                                           | 509999            | 13                   |
| 210                                                     | 1L500109-161  | .TRIM-EDGE<br>SUPPLIER CODE:<br>V6S8D7                                                         | 509999            | 1                    |
| 215                                                     | 1L500109-461  | .TRIM ASSY-DOOR<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                                 | 509999            | 1                    |
| 220                                                     | NAS8703A1     | .BOLT<br>STANDARD SUBSTITUTION:<br>BACB30ZE3K1<br>-----*-----                                  | 509999            | 3                    |
| 225                                                     | 1L500105-169  | ..BLOCK-CLOSEOUT<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                                | 509999            | 1                    |
| 230                                                     | NAS514P440-5  | ..SCREW                                                                                        | 509999            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |               |                                                                                                |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R

25-40-11-28M

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-11  
 FIG. 28M  
 PAGE 3  
 APR 15/23


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER  | 1 2 3 4 5 6 7 NOMENCLATURE                                                                           | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|--------------|------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 28M<br>235                                              | MS21042-04   | ..NUT<br>STANDARD SUBSTITUTION:<br>MS21042L04<br>BACN11AG04<br>-----*-----                           | 509999            | 1                    |
| 240                                                     | 1L500109-459 | ..TRIM-OPENING<br>SUPPLIER CODE:<br>V6S8D7<br>CONFIG CHG DATA FROM A CMM:<br>SUPSD BY 1L500109-627   | 509999            | 1                    |
| 240                                                     | 1L500109-627 | ..TRIM-OPENING<br>SUPPLIER CODE:<br>V6S8D7<br>CONFIG CHG DATA FROM A CMM:<br>SUPERSEDES 1L500109-459 | 509999            | 1                    |
| 245                                                     | 1L400109-93  | .SWITCH ASSY-<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>33-26-03-45Y<br>ATTACHING PARTS     | 509999            | 1                    |
| 250                                                     | NAS8703A1    | .BOLT<br>STANDARD SUBSTITUTION:<br>BACB30ZE3K1<br>-----*-----                                        | 509999            | 2                    |
| 255                                                     | 1L500709-657 | .TRIM-HEADER<br>SUPPLIER CODE:<br>V6S8D7                                                             | 509999            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |              |                                                                                                      |                   |                      |

— ITEM NOT ILLUSTRATED


R Y R

25-40-11-28M

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

25-40-11  
 FIG. 28M  
 PAGE 4  
 APR 15/23

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

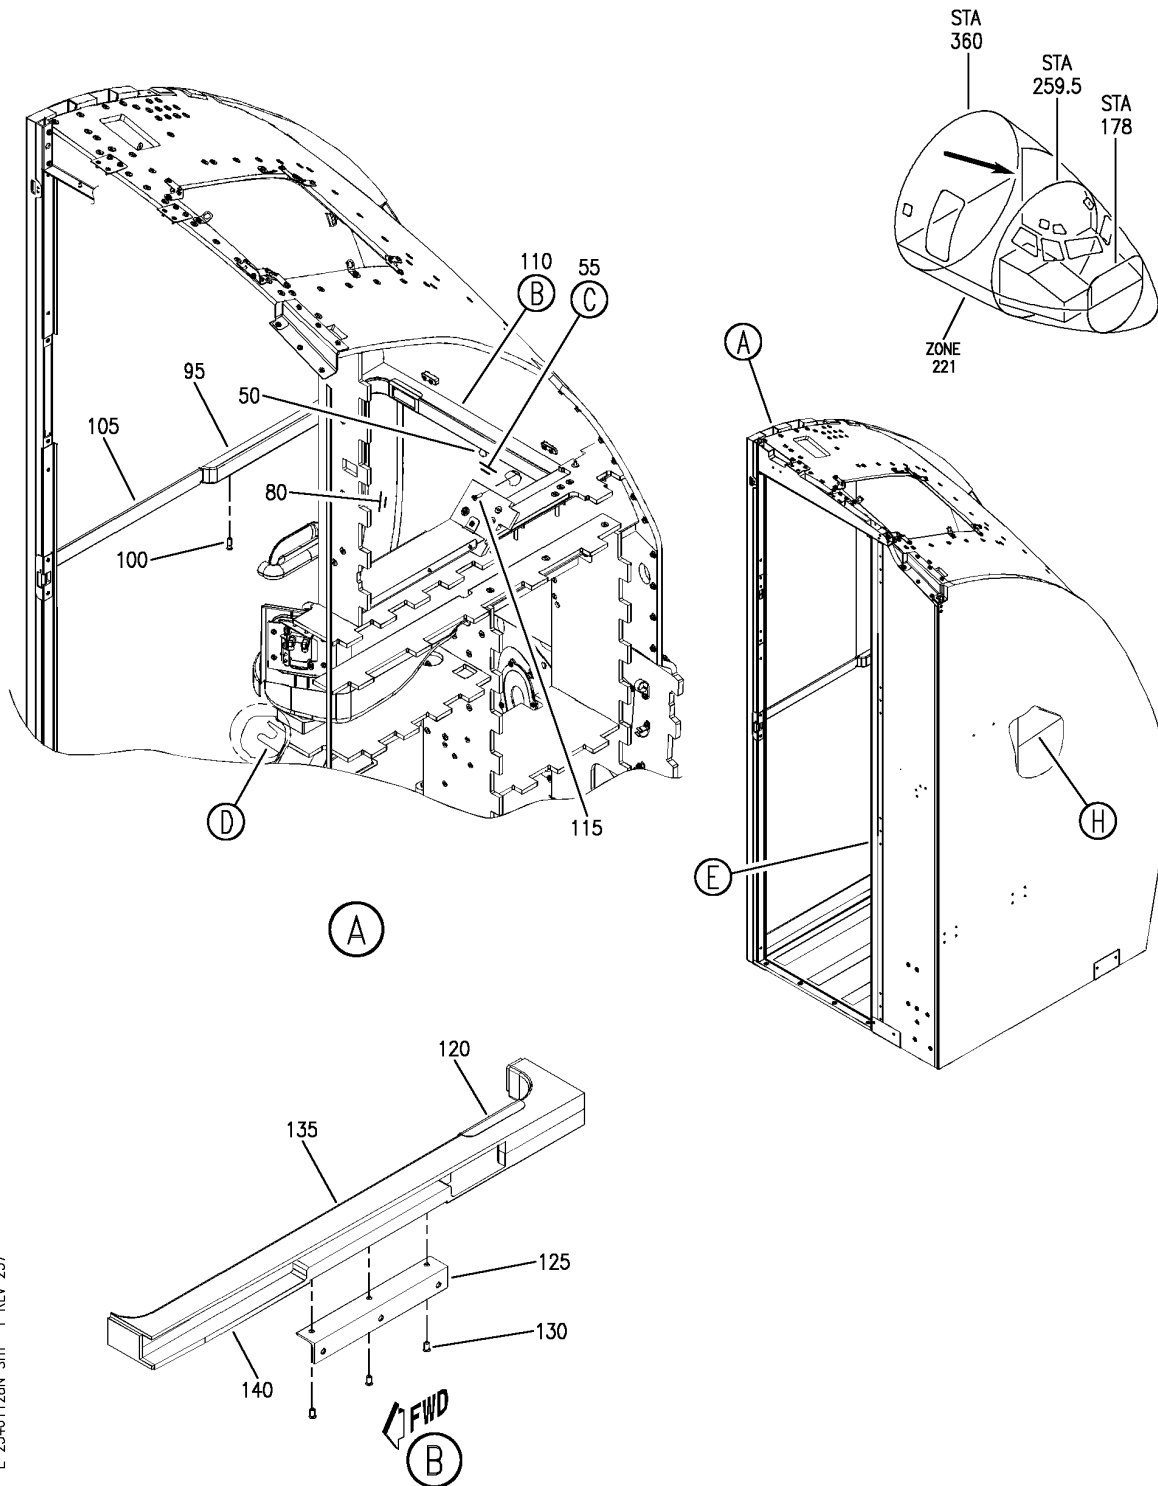

E 25401128N SHT 1 REV 257

STRUCTURE INSTL-LAV (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 28N (SHEET 1)





**25-40-11-28N**

RJR  
APR 15/18

25-40-11-28N  
PAGE 0

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

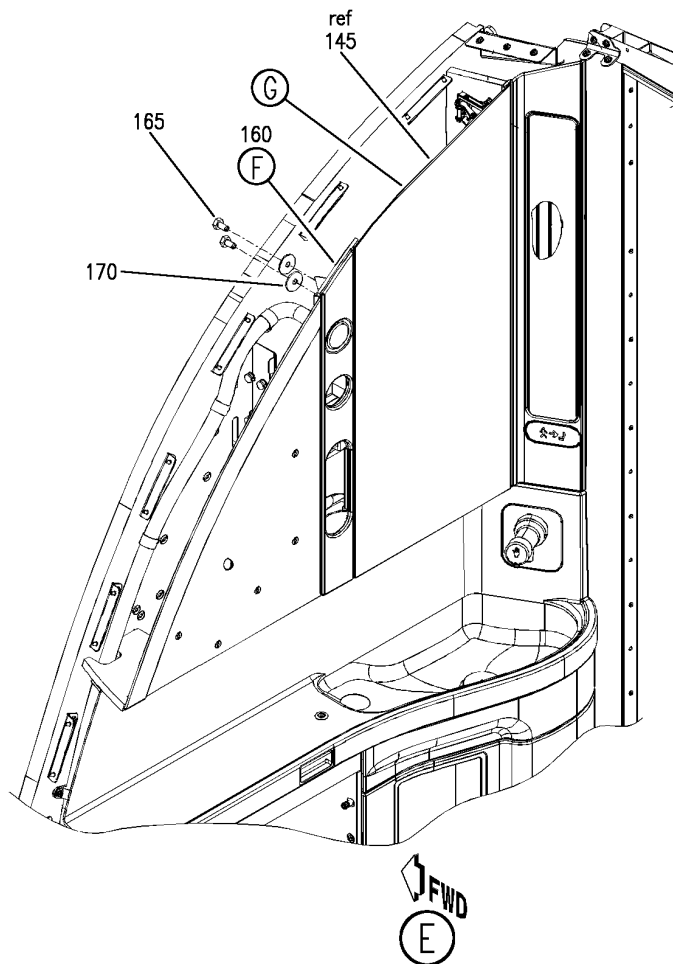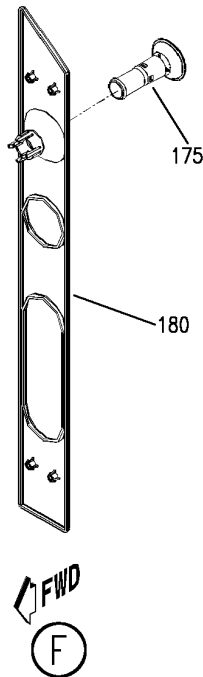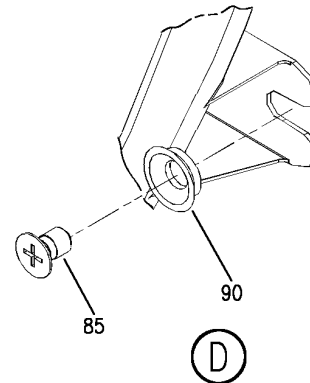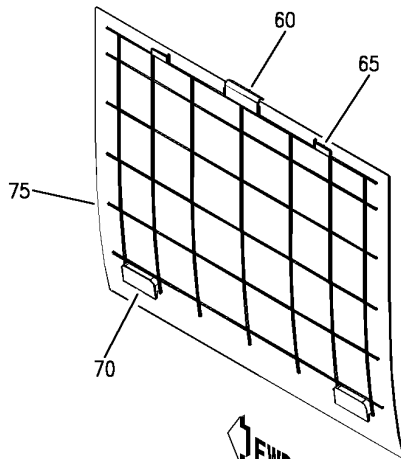

E 25401128N SHT 2 REV 257


STRUCTURE INSTL-LAV (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 28N (SHEET 2)

**25-40-11-28N**

R/YR  
APR 15/18

25-40-11-28N  
PAGE 0A

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

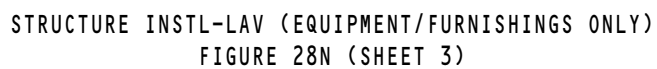

25-40-11-28N

ECCN 9E991 BOEING PROPRIETARY – See title page for details.


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER     | 1 2 3 4 5 6 7 | NOMENCLATURE                                                                                                                       | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|-----------------|---------------|------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 28N                                                     |                 |               | STRUCTURE INSTL-LAV<br>(EQUIPMENT/FURNISHINGS<br>ONLY)                                                                             | 509999            |                      |
| - 1                                                     | 1L306010-437HF1 |               | STRUCTURE INSTL-LAV A<br>(EQUIPMENT/FURNISHINGS<br>ONLY)<br>SUPPLIER CODE:<br>V6S8D7<br>FOR NHA/OTHER SYS DET SEE:<br>25-40-11-28M | 509999            | RF                   |
| 50                                                      | SJ5327          |               | .BUMPER-<br>SUPPLIER CODE:<br>V07080<br>TRUE PART NUMBER:<br>SJ-5327                                                               | 509999            | 1                    |
| 55                                                      | 1L400107-17     |               | .SHROUD ASSY-CTR<br>SUPPLIER CODE:<br>V6S8D7                                                                                       | 509999            | 1                    |
| 60                                                      | 1L500107-73     |               | ..HANDLE-PULL<br>SUPPLIER CODE:<br>V6S8D7                                                                                          | 509999            | 1                    |
| 65                                                      | 02-14-301-14    |               | ..STRIKER-SELF-ADHESIVE<br>SUPPLIER CODE:<br>V94222                                                                                | 509999            | 2                    |
| 70                                                      | 1L500407-117    |               | ..BLOCK-GUIDE<br>SUPPLIER CODE:<br>V6S8D7                                                                                          | 509999            | 2                    |
| 75                                                      | 1L500107-71     |               | ..SHROUD-<br>SUPPLIER CODE:<br>V6S8D7                                                                                              | 509999            | 1                    |
| 80                                                      | 1L500407-105    |               | .SHROUD-LH-OUTBD TOILET<br>SUPPLIER CODE:<br>V6S8D7                                                                                | 509999            | 1                    |
| 85                                                      | NAS514P1032-5   |               | ATTACHING PARTS<br>.SCREW<br>-----*-----                                                                                           | 509999            | 4                    |
| 90                                                      | 1L500407-203    |               | .FASTENER-SNAP<br>SUPPLIER CODE:<br>V6S8D7                                                                                         | 509999            | 4                    |
| 95                                                      | 1L500113-49     |               | .TRIM-AFT WALL<br>SUPPLIER CODE:<br>V6S8D7                                                                                         | 509999            | 1                    |
| 100                                                     | NAS514P832-8    |               | ATTACHING PARTS<br>.SCREW<br>-----*-----                                                                                           | 509999            | 1                    |
| 105                                                     | 1L500113-11     |               | .TRIM-AFT WALL CLOSEOUT<br>SUPPLIER CODE:<br>V6S8D7                                                                                | 509999            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                 |               |                                                                                                                                    |                   |                      |

- ITEM NOT ILLUSTRATED

RYR

25-40-11-28N

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-11  
FIG. 28N  
PAGE 1  
APR 15/18


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER   | 1 2 3 4 5 6 7 NOMENCLATURE                                                                             | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|---------------|--------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 28N                                                     |               |                                                                                                        |                   |                      |
| 110                                                     | 1L460010-347  | .COUNTER ASSY-OUTBD<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                                     | 509999            | 1                    |
| 115                                                     | NAS8603-1     | .SCREW<br>-----*-----                                                                                  | 509999            | 3                    |
| 120                                                     | 1L500409-15   | ..BRACKET-FLUSH SWITCH<br>SUPPLIER CODE:<br>V6S8D7                                                     | 509999            | 1                    |
| 125                                                     | 1L500409-553  | ..BRACKET-SPRT<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                                          | 509999            | 1                    |
| 130                                                     | NAS8603-1     | ..SCREW<br>-----*-----                                                                                 | 509999            | 3                    |
| 135                                                     | 1L500109-547  | ..PANEL-COUNTER<br>SUPPLIER CODE:<br>V6S8D7                                                            | 509999            | 1                    |
| 140                                                     | 1L500109-549  | ..PANEL-<br>SUPPLIER CODE:<br>V6S8D7                                                                   | 509999            | 1                    |
| 145                                                     | 1L400103-141  | .MIRROR ASSY-HINGED<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-41-51-56Q<br>ATTACHING PARTS | 509999            | 1                    |
| 150                                                     | NAS1801-3-5   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-5                                                        | 509999            | 6                    |
| 155                                                     | NAS1149D0332J | .WASHER<br>-----*-----                                                                                 | 509999            | 6                    |
| 160                                                     | 1L400103-23   | .STRIP ASSY-AMENITIES<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                                   | 509999            | 1                    |
| 165                                                     | NAS1801-08-6  | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN08-6                                                       | 509999            | 4                    |
| 170                                                     | AN970-3       | .WASHER<br>-----*-----                                                                                 | 509999            | 4                    |
| 175                                                     | 1L400203-13   | ..GASPER-<br>SUPPLIER CODE:<br>V6S8D7                                                                  | 509999            | 1                    |
| 180                                                     | 1L500103-1    | ..STRIP-AMENITIES<br>SUPPLIER CODE:<br>V6S8D7                                                          | 509999            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |               |                                                                                                        |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R

25-40-11-28N

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-11  
FIG. 28N  
PAGE 2  
APR 15/23




**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                                                                                                                                                                    | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 28N<br>185                                              | 1L460010-381   | .VANITY ASSY-UPR<br>SUPPLIER CODE:<br>V6S8D7<br>FUNCTIONAL REFERENCE:<br>EQUIPMENT/FURNISHINGS<br>FOR DETAILS SEE<br>25-41-51-32J<br>LIGHTS<br>FOR DETAILS SEE<br>33-26-03-38Z<br>PLACARDS AND MARKINGS<br>FOR DETAILS SEE<br>11-32-05-17R<br>ATTACHING PARTS | 509999            | 1                    |
| 190                                                     | NAS514P1032-10 | .SCREW                                                                                                                                                                                                                                                        | 509999            | 1                    |
| 195                                                     | 09T305         | .SCREW-<br>SUPPLIER CODE:<br>V94222<br>TRUE PART NUMBER:<br>09-T-305                                                                                                                                                                                          | 509999            | 1                    |
| - 200                                                   | NAS514P1032-13 | .SCREW                                                                                                                                                                                                                                                        | 509999            | 1                    |
| - 205                                                   | NAS1801-3-13   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-13                                                                                                                                                                                                              | 509999            | 1                    |
| 210                                                     | NAS1149D0332J  | .WASHER<br>-----*-----                                                                                                                                                                                                                                        | 509999            | 2                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |                                                                                                                                                                                                                                                               |                   |                      |

— ITEM NOT ILLUSTRATED


R Y R

25-40-11-28N

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-11  
FIG. 28N  
PAGE 3  
APR 15/23

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

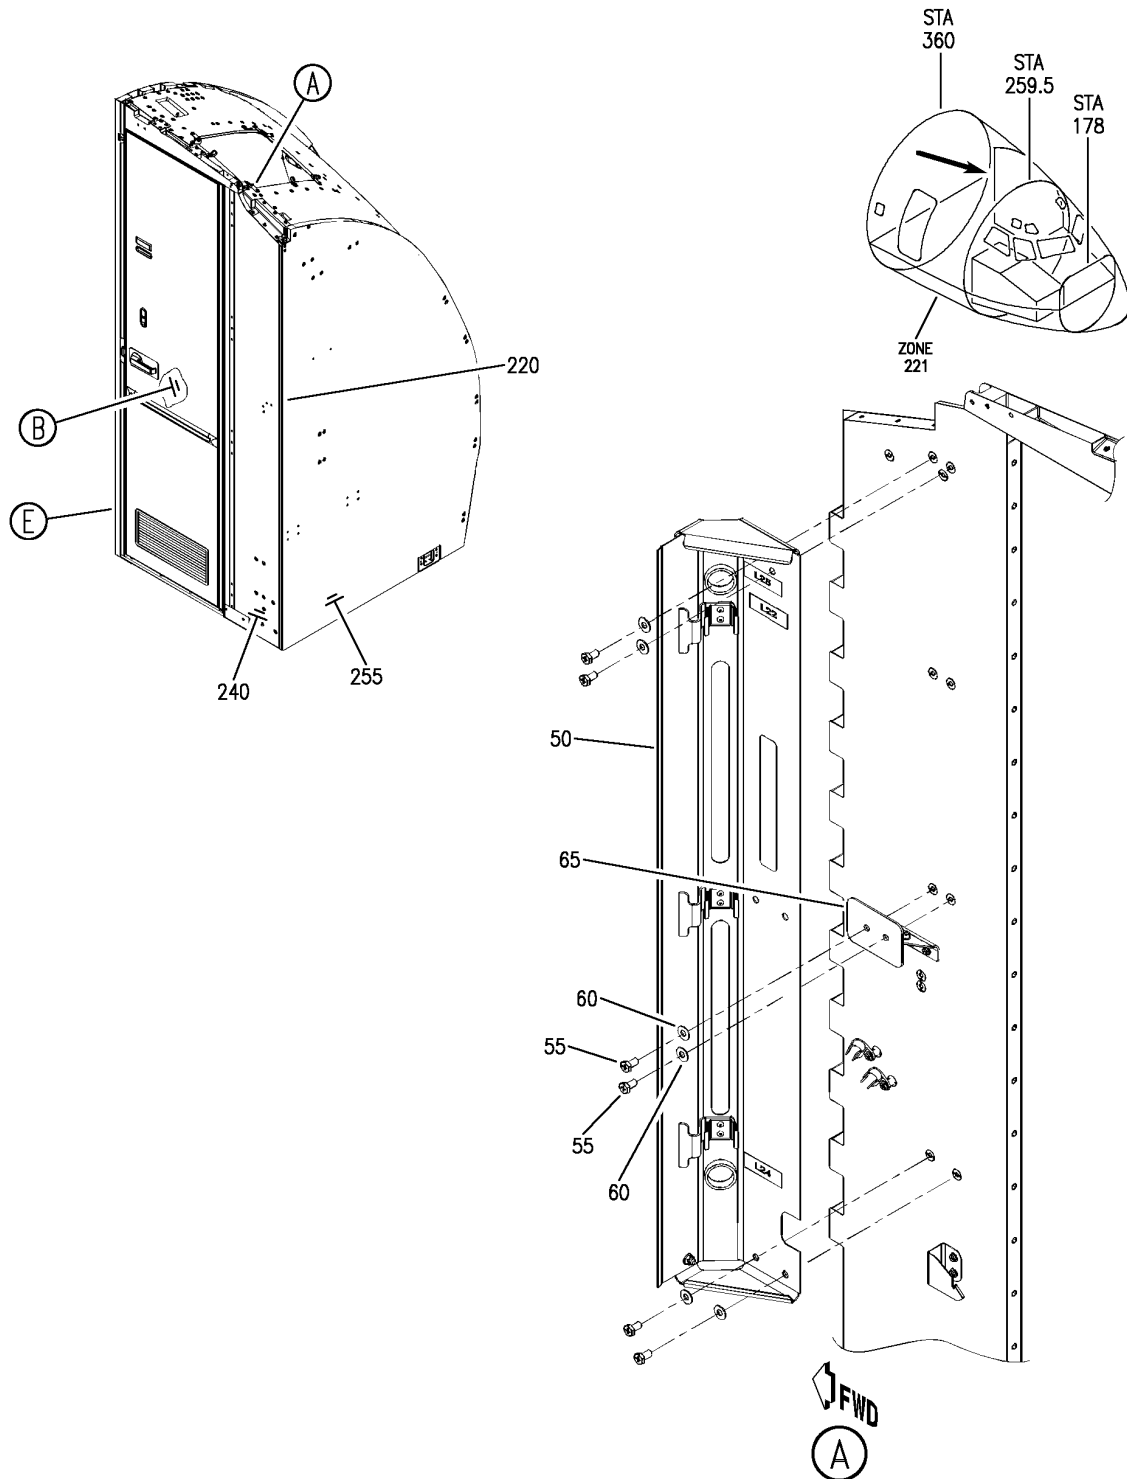

E 25401128P SHT 1 REV 263

STRUCTURE INSTL-LAV A (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 28P (SHEET 1)


**25-40-11-28P**

RJR  
JUN 15/18

25-40-11-28P  
PAGE 0

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

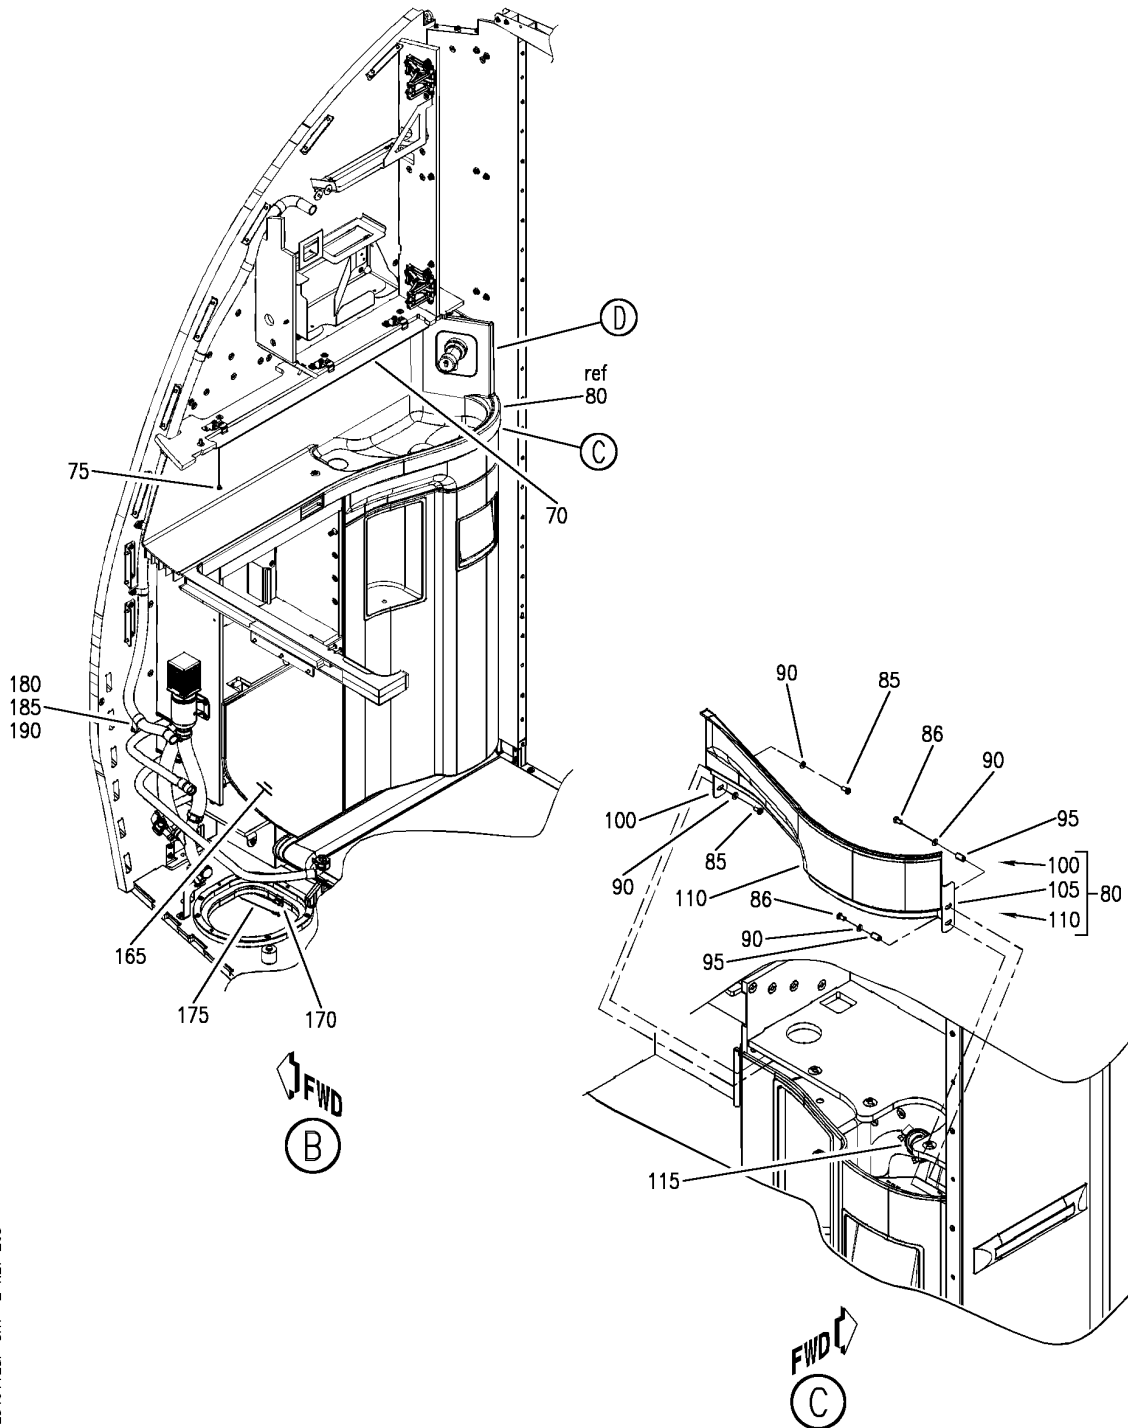

E 25401128P SHT 2 REV 263

STRUCTURE INSTL-LAV A (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 28P (SHEET 2)


**25-40-11-28P**

RJR  
JUN 15/18

25-40-11-28P  
PAGE 0A

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

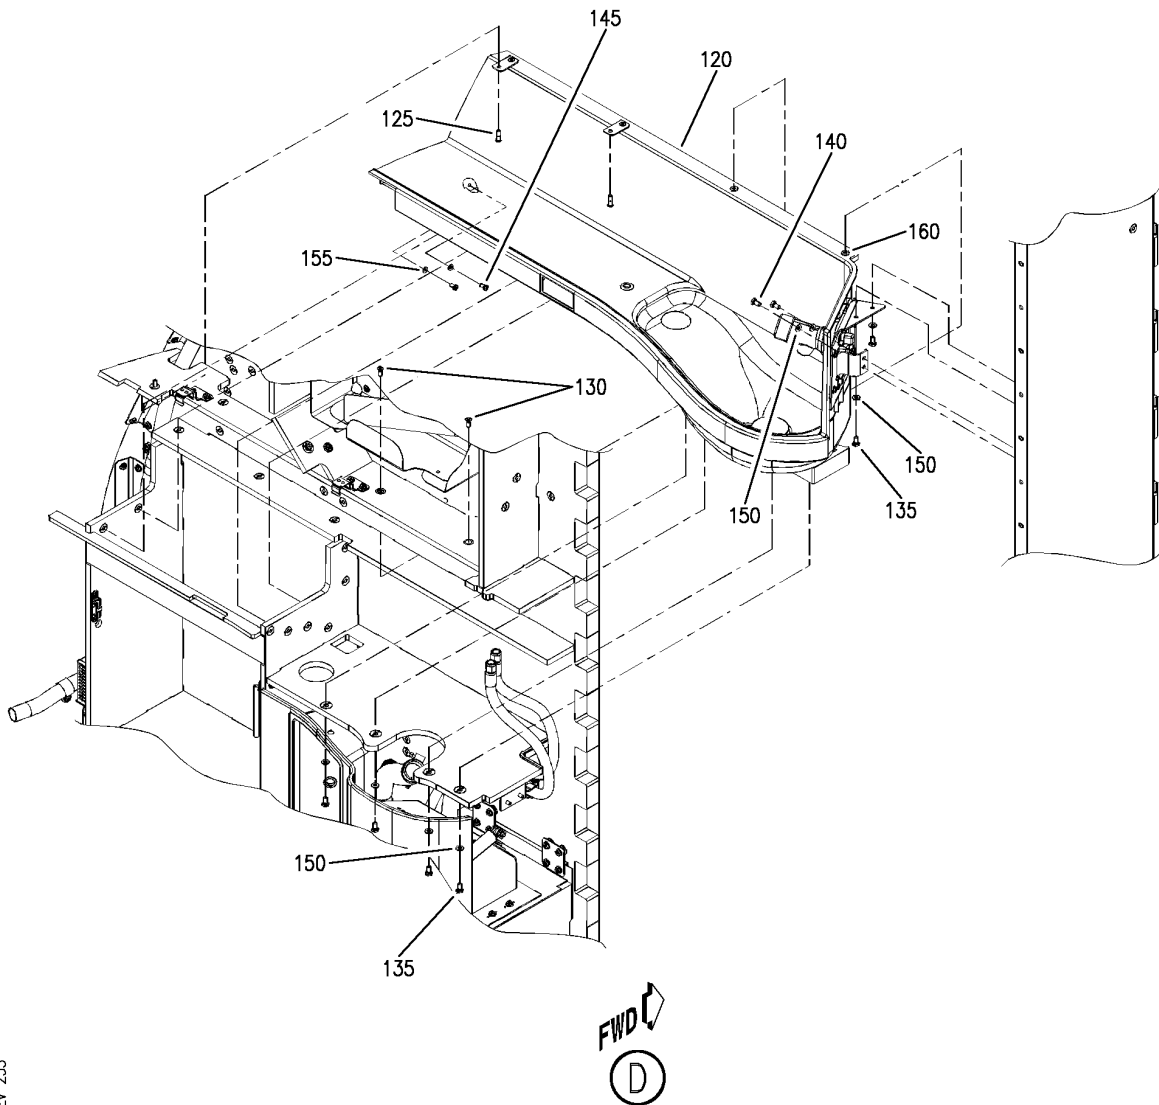

E 25401128P SHT 3 REV 255

STRUCTURE INSTL-LAV A (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 28P (SHEET 3)


**25-40-11-28P**

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

R Y R  
APR 15/18

25-40-11-28P  
PAGE 0B

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

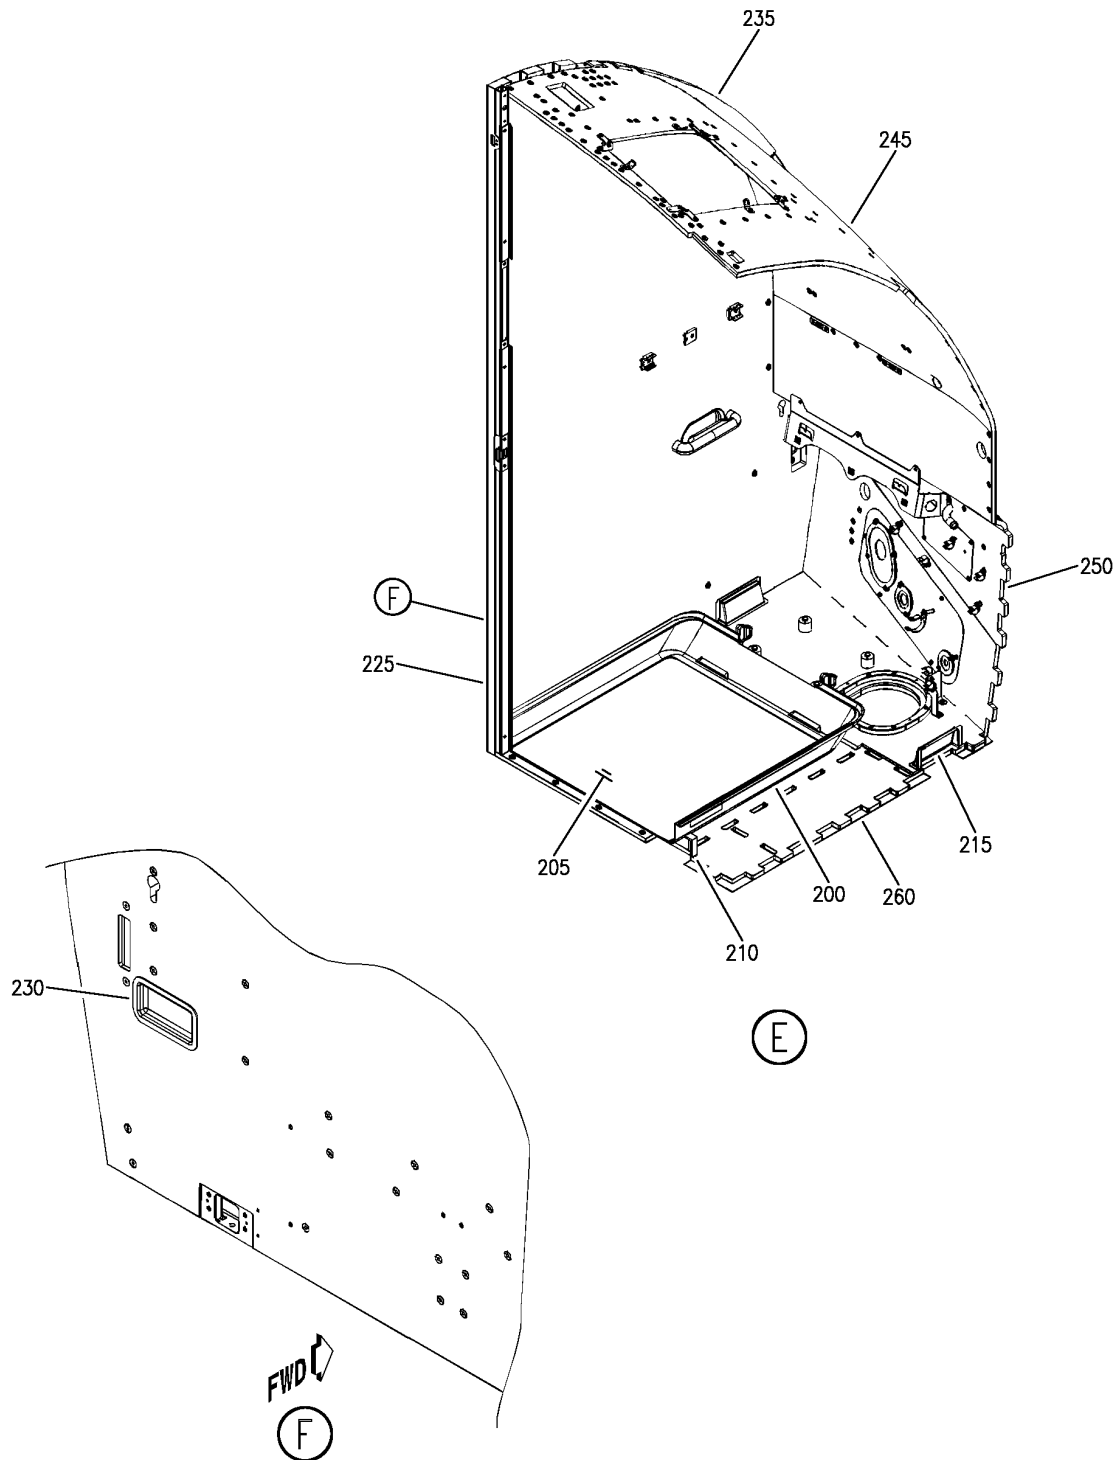

E 25401128P SHT 4 REV 255

STRUCTURE INSTL-LAV A (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 28P (SHEET 4)

**25-40-11-28P**

R Y R  
A P R 15 / 18

25-40-11-28P  
PAGE 0C

ECCN 9E991 BOEING PROPRIETARY – See title page for details.


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER     | 1 2 3 4 5 6 7 | NOMENCLATURE                                                                                                                                                                                  | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|-----------------|---------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 28P                                                     |                 |               | STRUCTURE INSTL-LAV A<br>(EQUIPMENT/FURNISHINGS<br>ONLY)                                                                                                                                      | 509999            |                      |
| - 1                                                     | 1L306010-437HF2 |               | STRUCTURE INSTL-LAV A<br>(EQUIPMENT/ FURNISHINGS<br>ONLY)<br>SUPPLIER CODE:<br>V6S8D7<br>FOR NHA/OTHER SYS DET SEE:<br>25-40-11-28M                                                           | 509999            | RF                   |
| 50                                                      | 1L460010-343    |               | .LIGHT ASSY-<br>SUPPLIER CODE:<br>V6S8D7<br>FUNCTIONAL REFERENCE:<br>LIGHTS<br>FOR DETAILS SEE<br>33-26-03-43Z<br>PLACARDS AND MARKINGS<br>FOR DETAILS SEE<br>11-32-05-63H<br>ATTACHING PARTS | 509999            | 1                    |
| 55                                                      | NAS1801-3-6     |               | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                                                                                                                                               | 509999            | 6                    |
| 60                                                      | NAS1149D0332J   |               | .WASHER<br>-----*-----                                                                                                                                                                        | 509999            | 6                    |
| 65                                                      | 1L500403-89     |               | .SHIM-<br>SUPPLIER CODE:<br>V6S8D7                                                                                                                                                            | 509999            | 1                    |
| 70                                                      | 1L500403-271    |               | .LENS-TASK LT<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                                                                                                                                  | 509999            | 1                    |
| 75                                                      | NAS8303-5       |               | .SCREW<br>-----*-----                                                                                                                                                                         | 509999            | 4                    |
| 80                                                      | 1L400113-1      |               | .FACADE ASSY-<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                                                                                                                                  | 509999            | 1                    |
| 85                                                      | NAS1801-3-6     |               | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                                                                                                                                               | 509999            | 2                    |
| 86                                                      | NAS1801-3-11    |               | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-11                                                                                                                                              | 509999            | 2                    |
| 90                                                      | NAS1149D0332J   |               | .WASHER                                                                                                                                                                                       | 509999            | 4                    |
| 95                                                      | NAS43DD3-24FC   |               | .SPACER<br>-----*-----                                                                                                                                                                        | 509999            | 2                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                 |               |                                                                                                                                                                                               |                   |                      |

- ITEM NOT ILLUSTRATED

RYR

25-40-11-28P

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-11  
 FIG. 28P  
 PAGE 1  
 APR 15/23


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 NOMENCLATURE                                                                           | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 28P<br>100                                              | 1L500113-51    | ..BRACKET-<br>SUPPLIER CODE:<br>V6S8D7                                                               | 509999            | 1                    |
| 105                                                     | 1L500113-45    | ..BRACKET-<br>SUPPLIER CODE:<br>V6S8D7                                                               | 509999            | 1                    |
| 110                                                     | 1L500113-43    | ..FACADE-<br>SUPPLIER CODE:<br>V6S8D7                                                                | 509999            | 1                    |
| 115                                                     | NAS1922-0125-3 | .CLAMP                                                                                               | 509999            | 1                    |
| 120                                                     | 1L400113-21    | .COUNTERTOP ASSY-<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-41-11-46F<br>ATTACHING PARTS | 509999            | 1                    |
| 125                                                     | NAS514P1032-5  | .SCREW                                                                                               | 509999            | 2                    |
| 130                                                     | NAS514P1032-12 | .SCREW                                                                                               | 509999            | 2                    |
| 135                                                     | NAS1801-3-9    | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-9                                                      | 509999            | 6                    |
| 140                                                     | NAS1801-3-6    | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                                                      | 509999            | 2                    |
| 145                                                     | NAS1801-3-5    | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-5                                                      | 509999            | 4                    |
| 150                                                     | NAS1149D0332J  | .WASHER                                                                                              | 509999            | 8                    |
| 155                                                     | NAS1149D0332K  | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0332J                                                   | 509999            | 4                    |
| 160                                                     | NAS1149D0363J  | .WASHER<br>-----*-----                                                                               | 509999            | 2                    |
| 165                                                     | 1L400109-257   | .DOOR ASSY-ACCESS<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-41-11-46G                    | 509999            | 1                    |
| 170                                                     | LWC19AC14      | .CLIP-ADHESIVE BACKED<br>SUPPLIER CODE:<br>V06383<br>TRUE PART NUMBER:<br>LWC19-A-C14                | 509999            | 1                    |
| 175                                                     | 4595339-012    | .LANYARD-<br>SUPPLIER CODE:<br>V16827                                                                | 509999            | 1                    |
| 180                                                     | BACC10DK13     | .CLAMP                                                                                               | 509999            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |                                                                                                      |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R

25-40-11-28P

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-11  
FIG. 28P  
PAGE 2  
APR 15/23


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 NOMENCLATURE                                                        | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|-----------------------------------------------------------------------------------|-------------------|----------------------|
| 28P                                                     |                | ATTACHING PARTS                                                                   |                   |                      |
| 185                                                     | NAS1801-3-8    | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-8                                   | 509999            | 1                    |
| 190                                                     | NAS1149D0332J  | .WASHER<br>-----*-----                                                            | 509999            | 1                    |
| - 195                                                   | 1L400407-73B   | .PAN ASSY-FL00R<br>SUPPLIER CODE:<br>V6S8D7                                       | 509999            | 1                    |
| 200                                                     | 1L400107-29B   | ..MAT-<br>SUPPLIER CODE:<br>V6S8D7                                                | 509999            | 1                    |
| 205                                                     | 1L500107-11    | ..PAN-<br>SUPPLIER CODE:<br>V6S8D7                                                | 509999            | 1                    |
| 210                                                     | 1L500109-333   | .CLOSEOUT-FL00R<br>SUPPLIER CODE:<br>V6S8D7                                       | 509999            | 1                    |
| 215                                                     | 1L500109-347   | .CLOSEOUT-FL00R<br>SUPPLIER CODE:<br>V6S8D7                                       | 509999            | 2                    |
| 220                                                     | 1L500709-655   | .TRIM-EDGE<br>SUPPLIER CODE:<br>V6S8D7                                            | 509999            | 1                    |
| 225                                                     | 1L500709-669   | .TRIM-EDGE<br>SUPPLIER CODE:<br>V6S8D7                                            | 509999            | 1                    |
| 230                                                     | 1L500109-139   | .COVER-<br>SUPPLIER CODE:<br>V6S8D7                                               | 509999            | 1                    |
| 235                                                     | 1L460010-517HF | .WALL ASSY-AFT<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-41-40-45W    | 509999            | 1                    |
| 240                                                     | 1L460010-370HF | .WALL ASSY-INBD<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-41-40-45V   | 509999            | 1                    |
| 245                                                     | 1L460010-57    | .CEILING ASSY-UPR<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-41-45-07J | 509999            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |                                                                                   |                   |                      |

- ITEM NOT ILLUSTRATED

R Y R

25-40-11-28P

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-11  
 FIG. 28P  
 PAGE 3  
 APR 15/23




**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER  | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                                                                                         | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|--------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 28P<br>250                                              | 1L460010-305 | .WALL ASSY-OUTBD<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-41-40-49N                                                                                                   | 509999            | 1                    |
| 255                                                     | 1L460010-323 | .WALL INSTL-FWD<br>SUPPLIER CODE:<br>V6S8D7<br>FUNCTIONAL REFERENCE:<br>EQUIPMENT/FURNISHINGS<br>FOR DETAILS SEE<br>25-41-40-45T<br>WATER/WASTE<br>FOR DETAILS SEE<br>38-13-01-05E | 509999            | 1                    |
| 260                                                     | 1L460010-497 | .FLOOR ASSY-<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-41-21-17P                                                                                                       | 509999            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |              |                                                                                                                                                                                    |                   |                      |

— ITEM NOT ILLUSTRATED


R Y R

25-40-11-28P

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

25-40-11  
FIG. 28P  
PAGE 4  
DEC 15/21

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

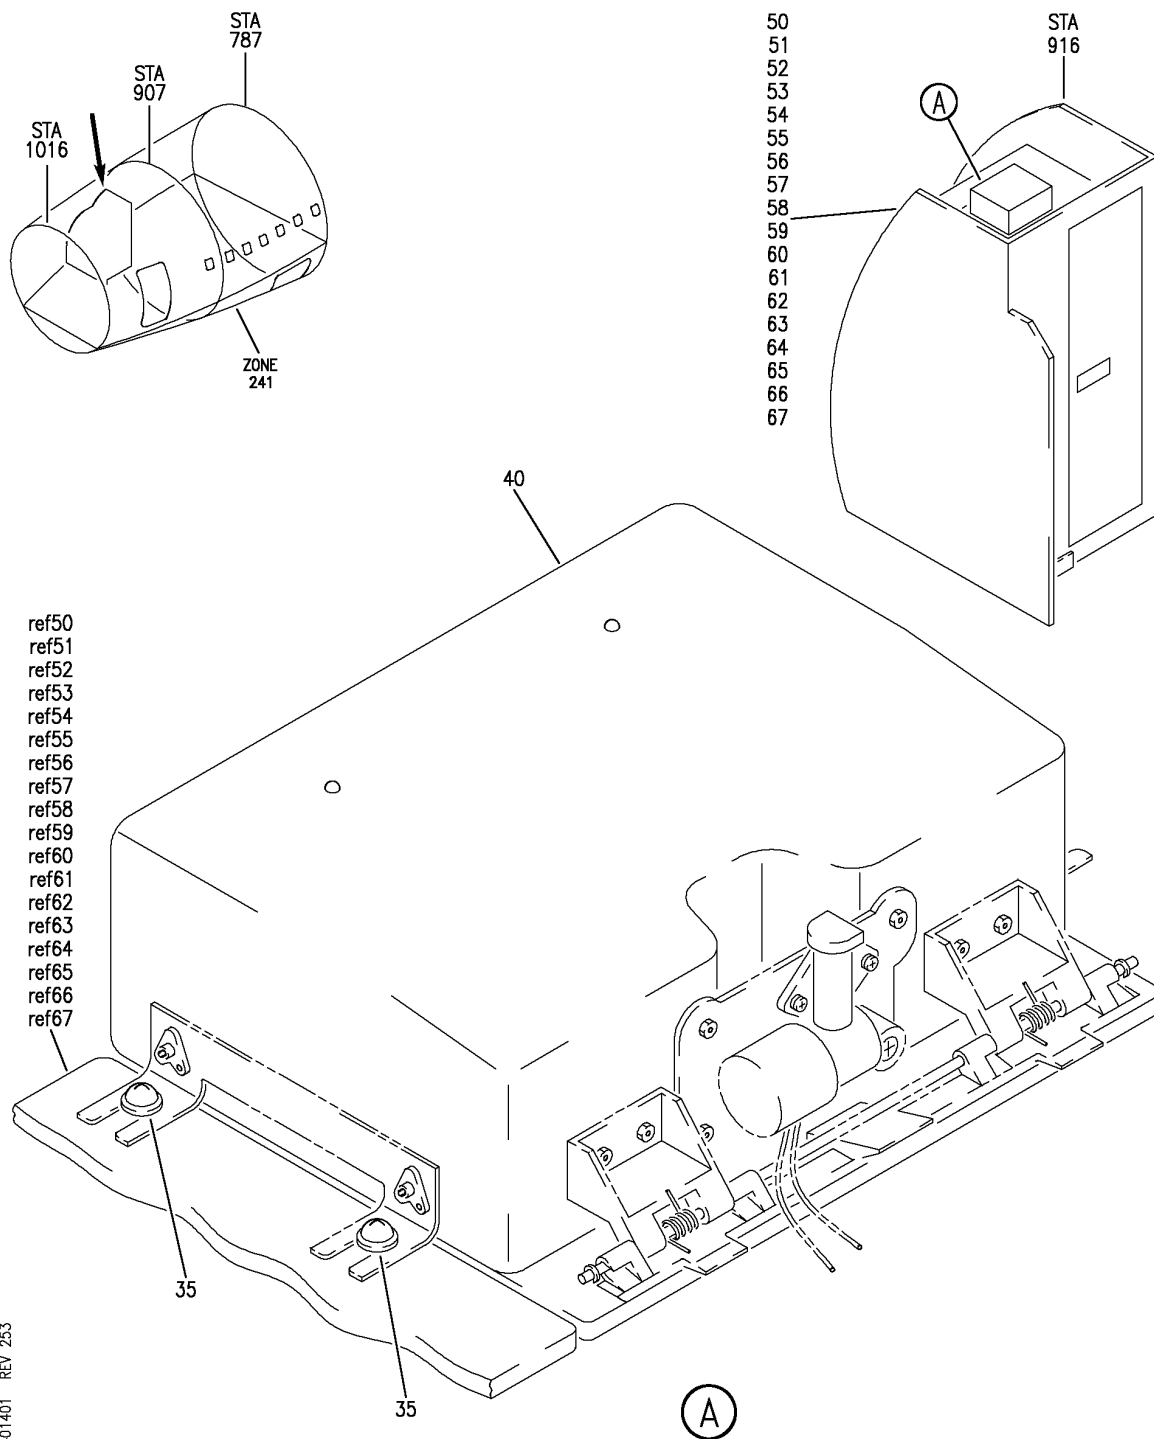

E 25401401 REV 253

LAVATORY INSTL-LAV D  
FIGURE 1

**25-40-14-01**

R Y R  
AUG 15/17

25-40-14-01  
PAGE 0

ECCN 9E991 BOEING PROPRIETARY – See title page for details.


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 | NOMENCLATURE                | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|---------------|-----------------------------|-------------------|----------------------|
| 1                                                       |                |               | LAVATORY INSTL-LAV D        | 336475            |                      |
| - 7                                                     | MODREF530896   |               | LAVATORY INSTL-LAV D        | 336353            | RF                   |
|                                                         |                |               | MODULE NUMBER:              |                   |                      |
|                                                         |                |               | 417A1158-114C REV C         |                   |                      |
| - 13                                                    | MODREF653585   |               | LAVATORY INSTL-LAV D        | 354377            | RF                   |
|                                                         |                |               | MODULE NUMBER:              |                   |                      |
|                                                         |                |               | 417A1158-114C REV D         |                   |                      |
| - 14                                                    | MODREF677534   |               | LAVATORY INSTL-LAV D        | 378416            | RF                   |
|                                                         |                |               | MODULE NUMBER:              |                   |                      |
|                                                         |                |               | 417A1158-1001R REV A        |                   |                      |
| - 16                                                    | MODREF706004   |               | LAVATORY INSTL-LAV D        | 417437            | RF                   |
|                                                         |                |               | MODULE NUMBER:              |                   |                      |
|                                                         |                |               | 417A1160-239B REV A         |                   |                      |
| - 17                                                    | MODREF717975   |               | LAVATORY INSTL-LAV D        | 438459            | RF                   |
|                                                         |                |               | MODULE NUMBER:              |                   |                      |
|                                                         |                |               | 417A1160-239C REV A         |                   |                      |
| - 18                                                    | MODREF726453   |               | LAVATORY INSTL-LAV D        | 460475            | RF                   |
|                                                         |                |               | MODULE NUMBER:              |                   |                      |
|                                                         |                |               | 417A1160-239D REV A         |                   |                      |
| 55                                                      | D72000801-111A |               | MODULE ASSY-LAV D           | 336353            | 1                    |
|                                                         |                |               | SUPPLIER CODE:              |                   |                      |
|                                                         |                |               | VJ4577                      |                   |                      |
|                                                         |                |               | FUNCTIONAL DESCRIPTION:     |                   |                      |
|                                                         |                |               | THIS PART PROVIDES          |                   |                      |
|                                                         |                |               | A RESTROOM FOR              |                   |                      |
|                                                         |                |               | PASSENGER AND CREW          |                   |                      |
|                                                         |                |               | ELECTRICAL EQUIP NUMBER:    |                   |                      |
|                                                         |                |               | M01418                      |                   |                      |
|                                                         |                |               | COMPONENT MAINT MANUAL REF: |                   |                      |
|                                                         |                |               | 25-48-30                    |                   |                      |
|                                                         |                |               | FUNCTIONAL REFERENCE:       |                   |                      |
|                                                         |                |               | AIR CONDITIONING            |                   |                      |
|                                                         |                |               | FOR DETAILS SEE             |                   |                      |
|                                                         |                |               | 21-24-51-02V                |                   |                      |
|                                                         |                |               | EQUIPMENT/FURNISHINGS       |                   |                      |
|                                                         |                |               | FOR DETAILS SEE             |                   |                      |
|                                                         |                |               | 25-40-14-02V                |                   |                      |
|                                                         |                |               | PLACARDS AND MARKINGS       |                   |                      |
|                                                         |                |               | FOR DETAILS SEE             |                   |                      |
|                                                         |                |               | 11-32-05-02V                |                   |                      |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |               |                             |                   |                      |

- ITEM NOT ILLUSTRATED

RYR

25-40-14-01

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-14  
 FIG. 01  
 PAGE 1  
 OCT 15/24


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER       | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                                                                                                                                                                                                                                                                                                                                             | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|-------------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 1                                                       | 61 D72000801-111F | .MODULE ASSY-LAV D<br>SUPPLIER CODE:<br>VJ4577<br>FUNCTIONAL DESCRIPTION:<br>THIS PART PROVIDES A<br>RESTROOM FOR PASSENGERS<br>AND CREW.<br>ELECTRICAL EQUIP NUMBER:<br>M01418<br>COMPONENT MAINT MANUAL REF:<br>25-48-30<br>FUNCTIONAL REFERENCE:<br>AIR CONDITIONING<br>FOR DETAILS SEE<br>21-24-51-02V<br>EQUIPMENT/FURNISHINGS<br>FOR DETAILS SEE<br>25-40-14-02V<br>PLACARDS AND MARKINGS<br>FOR DETAILS SEE<br>11-32-05-02V     | 354377            | 1                    |
|                                                         | 62 D72004800-111N | .MODULE ASSY-LAV D<br>SUPPLIER CODE:<br>VJ4577<br>FUNCTIONAL DESCRIPTION:<br>PART PROVIDES RESTROOM<br>FACILITIES FOR<br>PASSENGERS AND CREW.<br>ELECTRICAL EQUIP NUMBER:<br>M01418<br>COMPONENT MAINT MANUAL REF:<br>25-48-64<br>FUNCTIONAL REFERENCE:<br>AIR CONDITIONING<br>FOR DETAILS SEE<br>21-24-51-50L<br>EQUIPMENT/FURNISHINGS<br>FOR DETAILS SEE<br>25-40-14-10A<br>PLACARDS AND MARKINGS<br>FOR DETAILS SEE<br>11-32-05-50L | 378416            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                   |                                                                                                                                                                                                                                                                                                                                                                                                                                        |                   |                      |

— ITEM NOT ILLUSTRATED

RYR

25-40-14-01

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

25-40-14  
 FIG. 01  
 PAGE 2  
 OCT 15/24


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                                                                                                                                                                                                                                                                                                                                                                                                           | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 1<br>64                                                 | 1L300040-0743A | .MODULE ASSY-LAV D<br>SUPPLIER CODE:<br>V6S8D7<br>FUNCTIONAL DESCRIPTION:<br>PROVIDES LAVATORY<br>FACILITIES FOR<br>PASSENGERS AND CREW<br>ELECTRICAL EQUIP NUMBER:<br>M01418<br>COMPONENT MAINT MANUAL REF:<br>25-40-42<br>FUNCTIONAL REFERENCE:<br>COMMUNICATIONS<br>FOR DETAILS SEE<br>23-31-05-17L<br>EQUIPMENT/FURNISHINGS<br>FOR DETAILS SEE<br>25-40-14-12W<br>FIRE PROTECTION<br>FOR DETAILS SEE<br>26-14-01-14E<br>26-24-01-14C<br>PLACARDS AND MARKINGS<br>FOR DETAILS SEE<br>11-32-05-14K | 417437            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                      |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R

# 25-40-14-01

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

25-40-14  
 FIG. 01  
 PAGE 3  
 OCT 15/16


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7<br>NOMENCLATURE                                                                                                                                                                                                                                                                                                                                                                                                                                                                        | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 1<br>65                                                 | 1L300040-0743B | .MODULE ASSY-LAV D<br>SUPPLIER CODE:<br>V6S8D7<br>FUNCTIONAL DESCRIPTION:<br>PROVIDES LAVATORY<br>FACILITIES FOR<br>PASSENGERS AND CREW<br>ELECTRICAL EQUIP NUMBER:<br>M01418<br>COMPONENT MAINT MANUAL REF:<br>25-40-42<br>FUNCTIONAL REFERENCE:<br>COMMUNICATIONS<br>FOR DETAILS SEE<br>23-31-05-17L<br>EQUIPMENT/FURNISHINGS<br>FOR DETAILS SEE<br>25-40-14-13P<br>FIRE PROTECTION<br>FOR DETAILS SEE<br>26-14-01-14E<br>26-24-01-14C<br>PLACARDS AND MARKINGS<br>FOR DETAILS SEE<br>11-32-05-14K | 438459            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                      |                   |                      |

— ITEM NOT ILLUSTRATED

RYR

# 25-40-14-01

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

25-40-14  
 FIG. 01  
 PAGE 4  
 FEB 15/17


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                                                                                                                                                                                                                                                                                                                                                                                                           | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 1<br>66                                                 | 1L300040-0743C | .MODULE ASSY-LAV D<br>SUPPLIER CODE:<br>V6S8D7<br>FUNCTIONAL DESCRIPTION:<br>PROVIDES LAVATORY<br>FACILITIES FOR<br>PASSENGERS AND CREW<br>ELECTRICAL EQUIP NUMBER:<br>M01418<br>COMPONENT MAINT MANUAL REF:<br>25-40-55<br>FUNCTIONAL REFERENCE:<br>COMMUNICATIONS<br>FOR DETAILS SEE<br>23-31-05-15D<br>EQUIPMENT/FURNISHINGS<br>FOR DETAILS SEE<br>25-40-14-52D<br>FIRE PROTECTION<br>FOR DETAILS SEE<br>26-14-01-13Q<br>26-24-01-13Y<br>PLACARDS AND MARKINGS<br>FOR DETAILS SEE<br>11-32-05-17Q | 460475            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                      |                   |                      |

— ITEM NOT ILLUSTRATED


R Y R

# 25-40-14-01

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

25-40-14  
 FIG. 01  
 PAGE 5  
 OCT 15/17

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

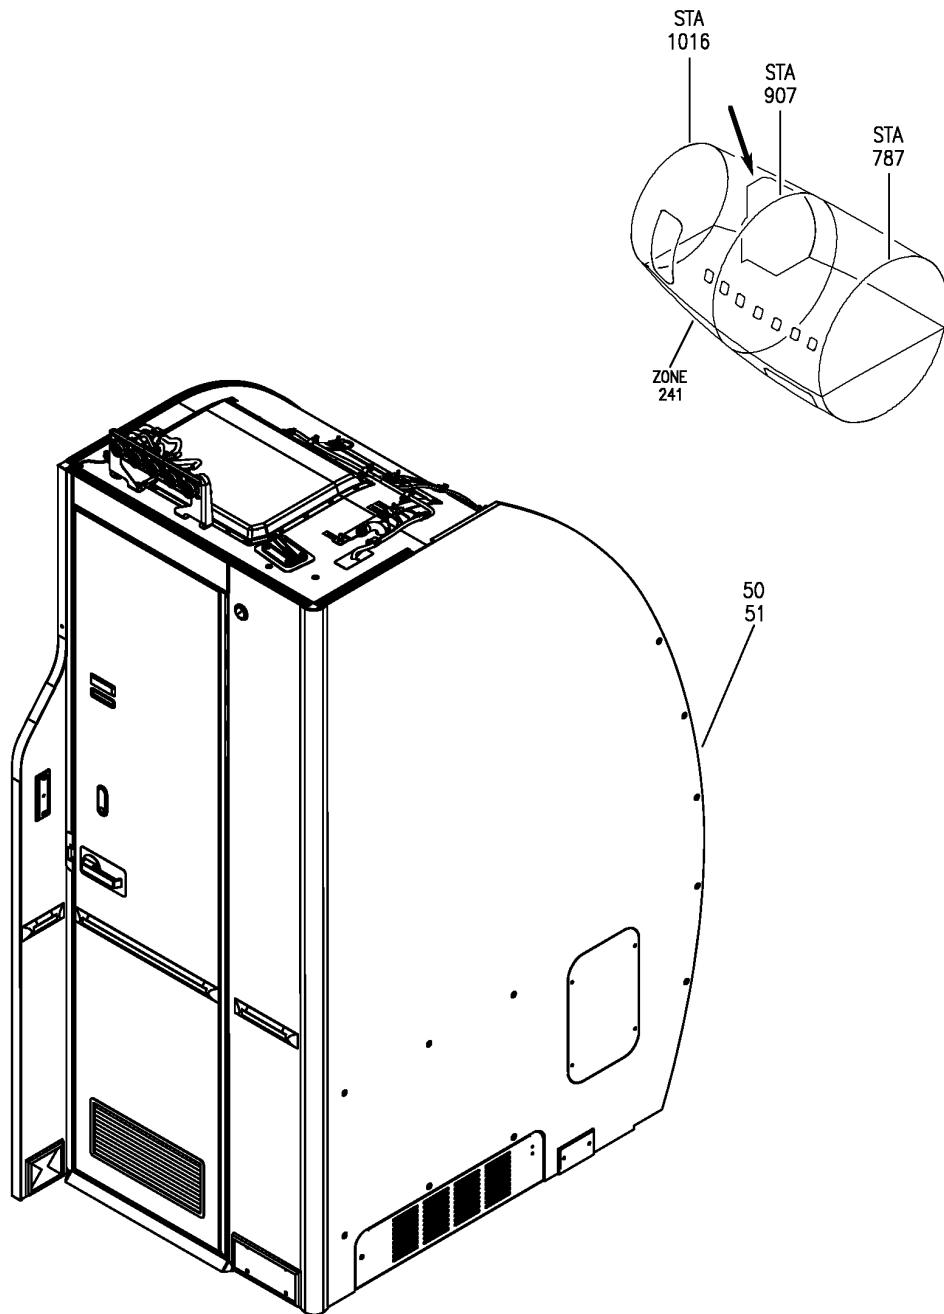

E 25401401B REV 263

LAVATORY INSTL-LAV D  
FIGURE 1B

**25-40-14-01B**

R Y R  
JUN 15/18

25-40-14-01B  
PAGE 0

ECCN 9E991 BOEING PROPRIETARY – See title page for details.




**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 | NOMENCLATURE                                                                                                                                                                                                                                                                                                                                                                                                                                                                                         | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|---------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 1B                                                      |                |               |                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                      |                   |                      |
| - 1                                                     | MODREF746540   |               | LAVATORY INSTL-LAV D<br>LAVATORY INSTL-LAV D<br>MODULE NUMBER:<br>417A1160-192D REV A                                                                                                                                                                                                                                                                                                                                                                                                                | 476999<br>476481  | RF                   |
| - 1                                                     | MODREF750032   |               | LAVATORY INSTL-LAV D<br>MODULE NUMBER:<br>417A1160-192E REV A                                                                                                                                                                                                                                                                                                                                                                                                                                        | 482508            | RF                   |
| - 1                                                     | MODREF763054   |               | LAVATORY INSTL-LAV D<br>MODULE NUMBER:<br>417A1160-538B REV A                                                                                                                                                                                                                                                                                                                                                                                                                                        | 509999            | RF                   |
| 50                                                      | 1L300040-0727C |               | MODULE ASSY-LAV D<br>SUPPLIER CODE:<br>V6S8D7<br>FUNCTIONAL DESCRIPTION:<br>PROVIDES LAVATORY<br>FACILITIES FOR<br>PASSENGERS AND CREW.<br>ELECTRICAL EQUIP NUMBER:<br>M01418<br>COMPONENT MAINT MANUAL REF:<br>25-40-55<br>FUNCTIONAL REFERENCE:<br>COMMUNICATIONS<br>FOR DETAILS SEE<br>23-31-05-15D<br>EQUIPMENT/FURNISHINGS<br>FOR DETAILS SEE<br>25-40-14-53A<br>FIRE PROTECTION<br>FOR DETAILS SEE<br>26-14-01-13Q<br>26-24-01-13Y<br>PLACARDS AND MARKINGS<br>FOR DETAILS SEE<br>11-32-05-17Q | 476481            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |               |                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                      |                   |                      |

- ITEM NOT ILLUSTRATED

RYR

25-40-14-01B

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-14  
FIG. 01B  
PAGE 1  
APR 15/18


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                                                                                                                                                                                                                                                                                                                                                                                                            | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 1B<br>50                                                | 1L300040-0727D | .MODULE ASSY-LAV D<br>SUPPLIER CODE:<br>V6S8D7<br>FUNCTIONAL DESCRIPTION:<br>PROVIDES LAVATORY<br>FACILITIES FOR<br>PASSENGERS AND CREW.<br>ELECTRICAL EQUIP NUMBER:<br>M01418<br>COMPONENT MAINT MANUAL REF:<br>25-40-55<br>FUNCTIONAL REFERENCE:<br>COMMUNICATIONS<br>FOR DETAILS SEE<br>23-31-05-15D<br>EQUIPMENT/FURNISHINGS<br>FOR DETAILS SEE<br>25-40-14-53B<br>FIRE PROTECTION<br>FOR DETAILS SEE<br>26-14-01-13Q<br>26-24-01-13Y<br>PLACARDS AND MARKINGS<br>FOR DETAILS SEE<br>11-32-05-17Q | 482508            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                       |                   |                      |

— ITEM NOT ILLUSTRATED

RYR

25-40-14-01B

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

25-40-14  
 FIG. 01B  
 PAGE 2  
 FEB 15/18


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                                                                                                                                                                                                                                                                                                                                                                                                            | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 1B<br>50                                                | 1L300040-0897A | .MODULE ASSY-LAV D<br>SUPPLIER CODE:<br>V6S8D7<br>FUNCTIONAL DESCRIPTION:<br>PROVIDES LAVATORY<br>FACILITIES FOR<br>PASSENGERS AND CREW.<br>ELECTRICAL EQUIP NUMBER:<br>M01418<br>COMPONENT MAINT MANUAL REF:<br>25-40-50<br>FUNCTIONAL REFERENCE:<br>COMMUNICATIONS<br>FOR DETAILS SEE<br>23-31-05-03W<br>EQUIPMENT/FURNISHINGS<br>FOR DETAILS SEE<br>25-40-14-14D<br>FIRE PROTECTION<br>FOR DETAILS SEE<br>26-14-01-03Y<br>26-24-01-03W<br>PLACARDS AND MARKINGS<br>FOR DETAILS SEE<br>11-32-05-11F | 509999            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                       |                   |                      |


— ITEM NOT ILLUSTRATED

RYR

25-40-14-01B

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

25-40-14  
 FIG. 01B  
 PAGE 3  
 APR 15/18

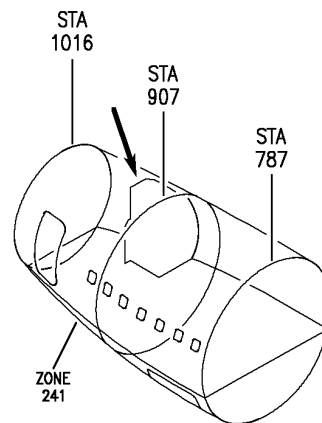


25-40-14-02V

25-40-14-02V  
PAGE 0

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

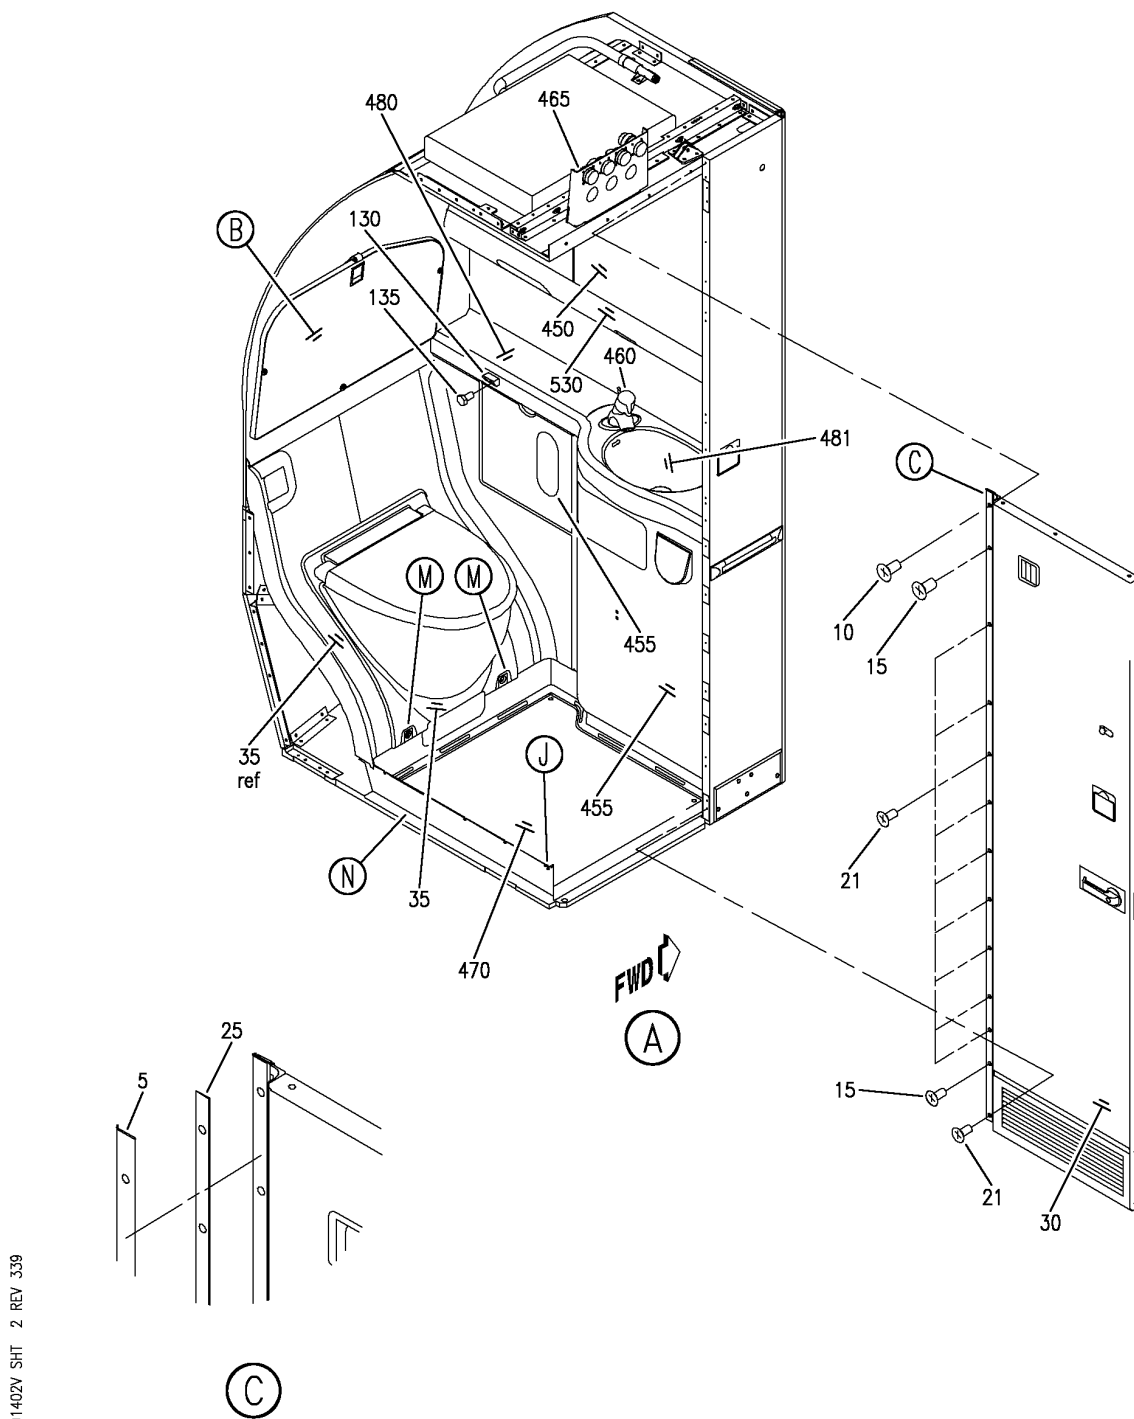

E 25401402V SHT 2 REV 339

MODULE ASSY-LAV D (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 2V (SHEET 2)


**25-40-14-02V**

RJR  
OCT 15/24

25-40-14-02V  
PAGE 0A

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

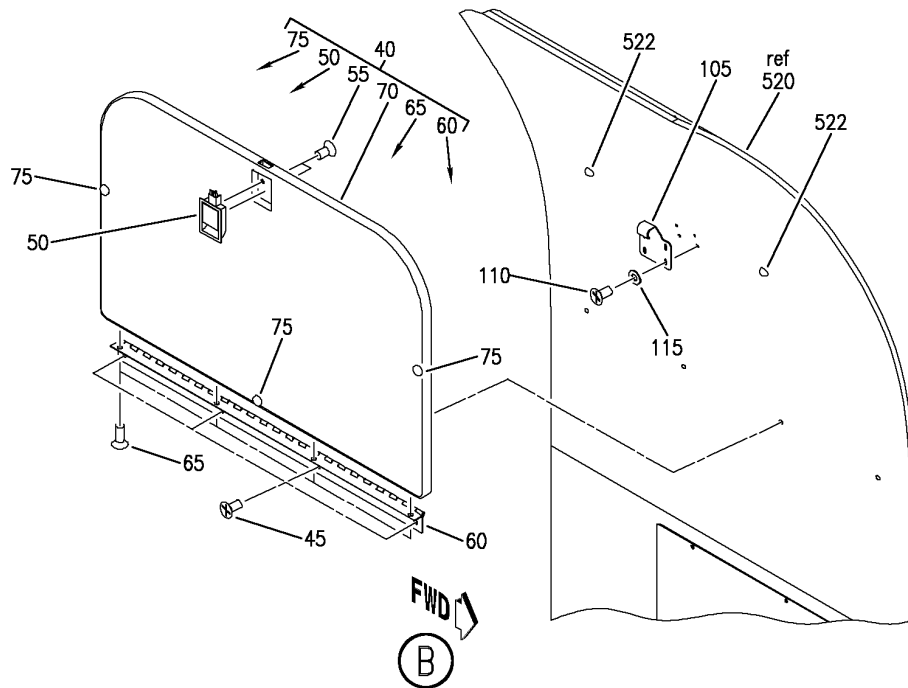

E 25401402V SHT 3 REV 219

MODULE ASSY-LAV D (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 2V (SHEET 3)


**25-40-14-02V**

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

R Y R  
O C T 15 / 14

25-40-14-02V  
PAGE 0B

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

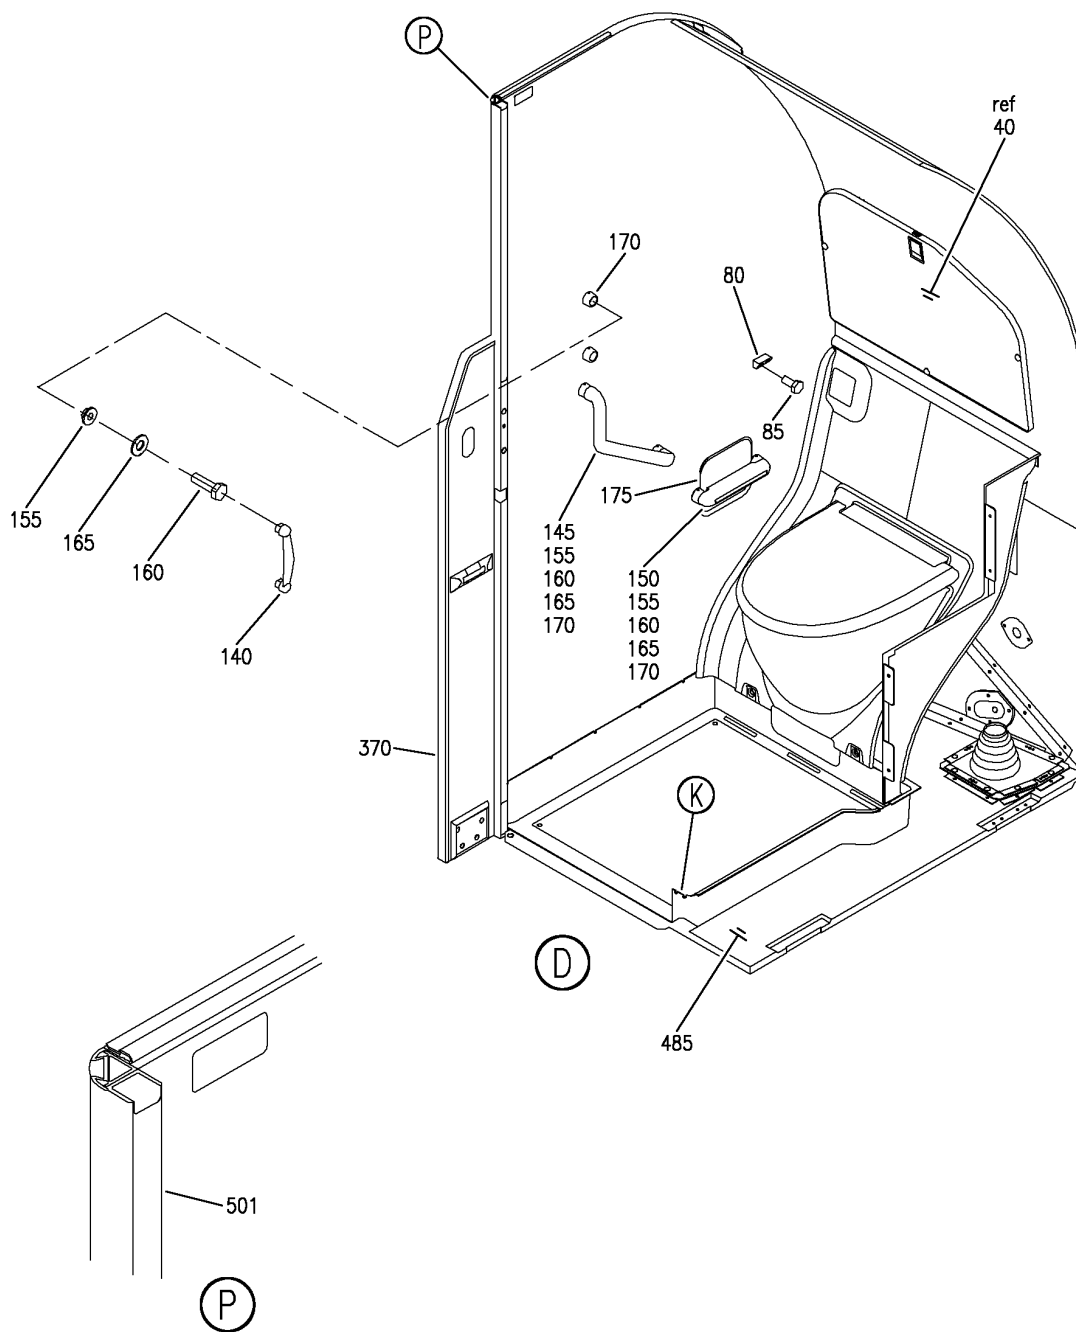



E 25401402V SHT 4 REV 339

MODULE ASSY-LAV D (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 2V (SHEET 4)

**25-40-14-02V**

R Y R  
O C T 15 / 24

25-40-14-02V  
PAGE 0C

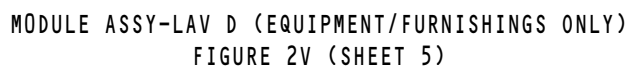


25-40-14-02V


ECCN 9E991 BOEING PROPRIETARY – See title page for details.




**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

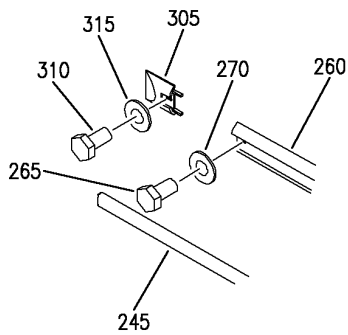


(F)

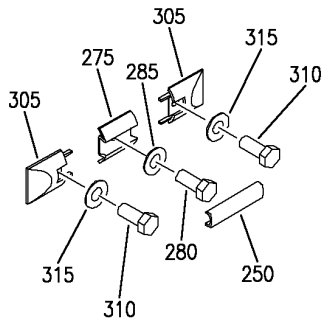


(G)

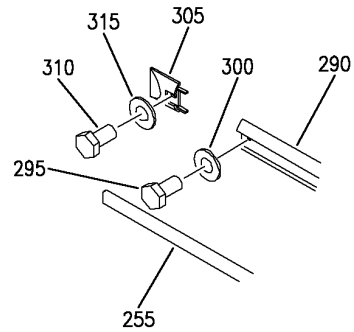


(H)

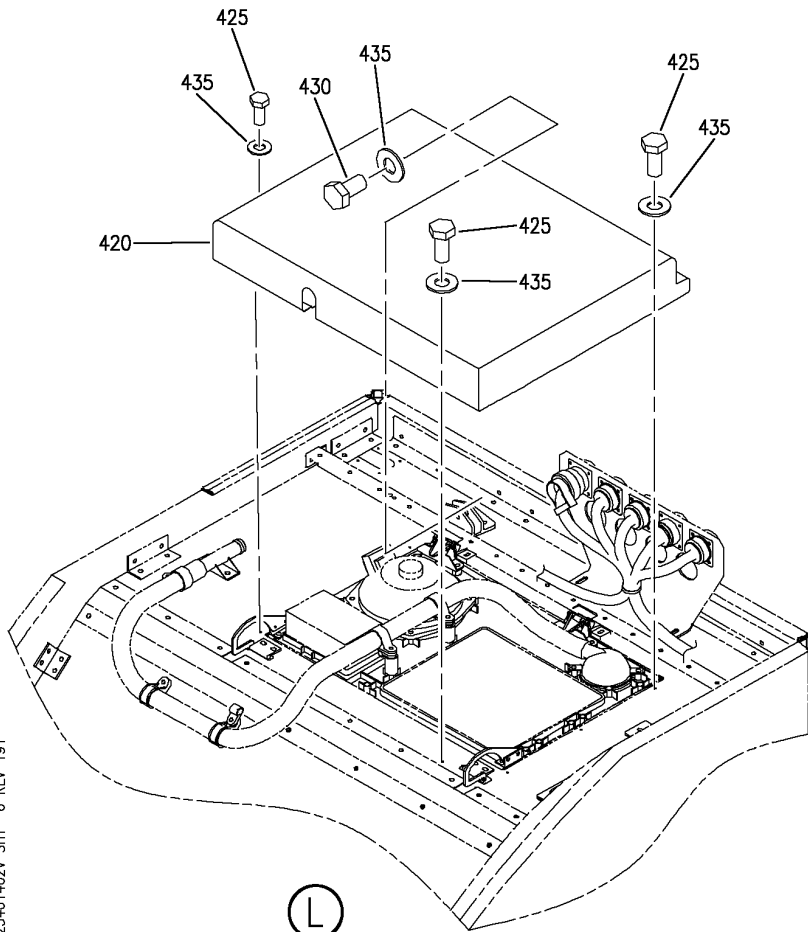

(L)

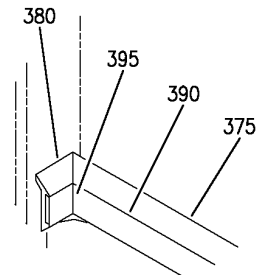

(J)

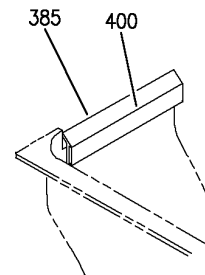

(K)

E 25401402V SHT 6 REV 191

MODULE ASSY-LAV D (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 2V (SHEET 6)


**25-40-14-02V**

RJR  
JUN 15/12

25-40-14-02V  
PAGE 0E

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

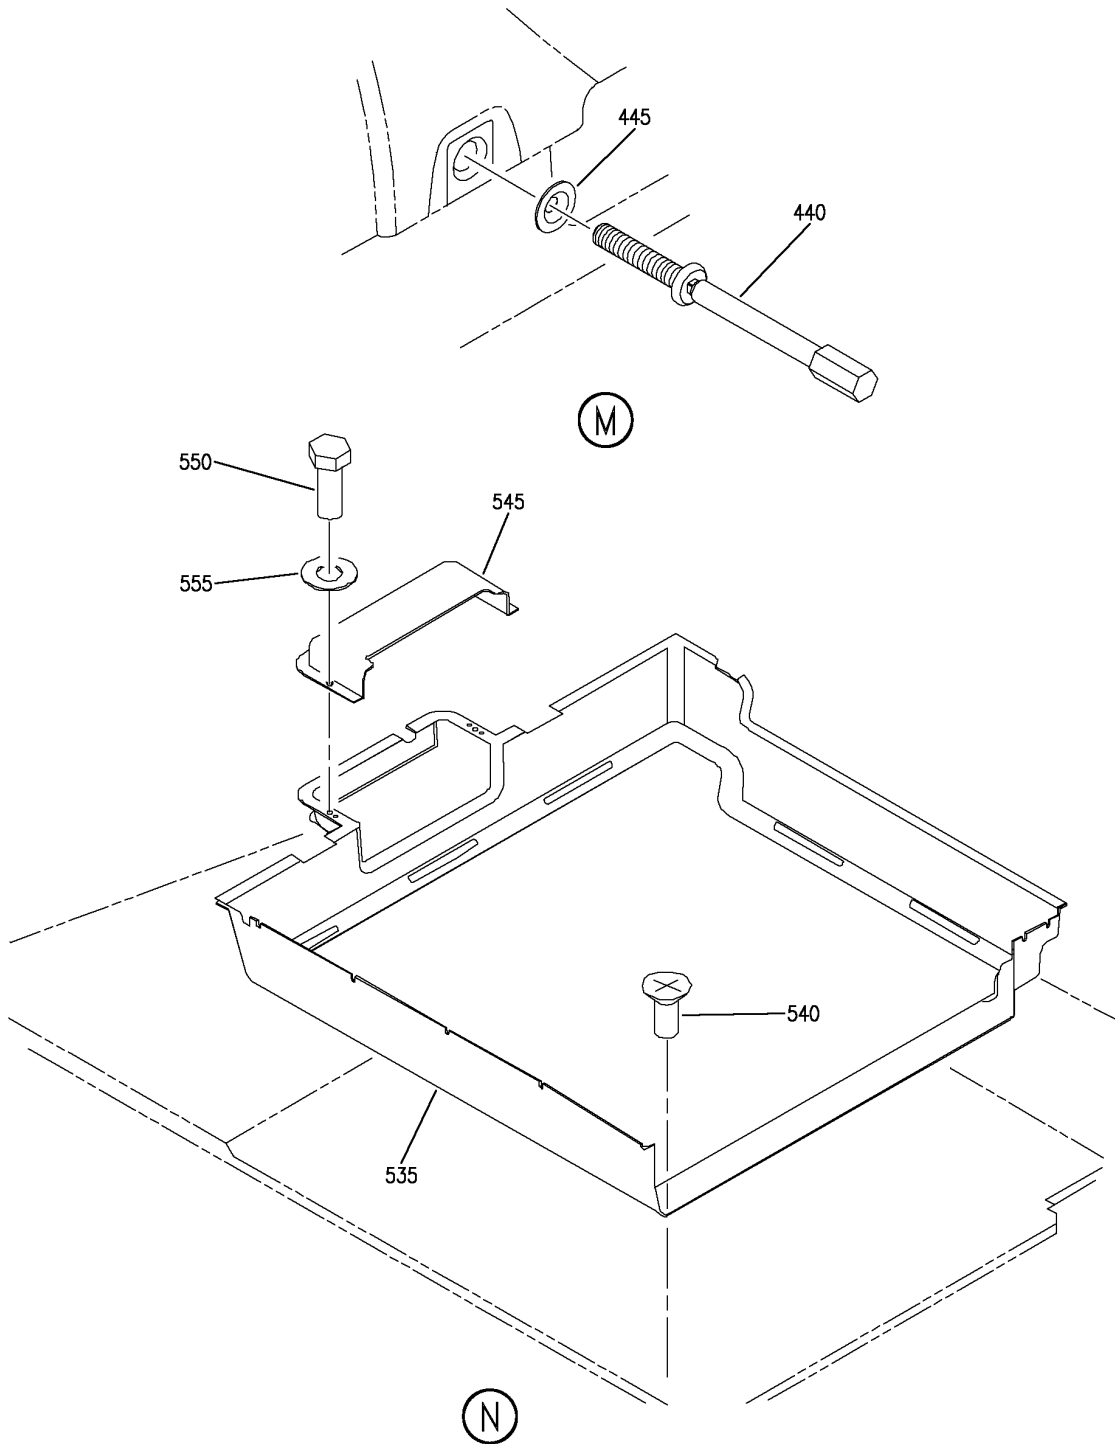

E 25401402V SHT 7 REV 191

MODULE ASSY-LAV D (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 2V (SHEET 7)

**25-40-14-02V**

RJR  
JUN 15/12

25-40-14-02V  
PAGE 0F

ECCN 9E991 BOEING PROPRIETARY - See title page for details.


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7<br>NOMENCLATURE                                                                                                                                                                                                                                                                             | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 2V                                                      |                | MODULE ASSY-LAV D<br>(EQUIPMENT/FURNISHINGS<br>ONLY)                                                                                                                                                                                                                                                      | 336377            |                      |
| - 1                                                     | D72000801-111A | MODULE ASSY-LAV D<br>(EQUIPMENT/FURNISHINGS<br>ONLY)<br>SUPPLIER CODE:<br>VJ4577<br>FUNCTIONAL DESCRIPTION:<br>THIS PART PROVIDES A<br>RESTROOM FOR PASSENGERS<br>AND CREW.<br>ELECTRICAL EQUIP NUMBER:<br>M01418<br>COMPONENT MAINT MANUAL REF:<br>25-48-30<br>FOR NHA/OTHER SYS DET SEE:<br>25-40-14-01 | 336353            | RF                   |
| - 1                                                     | D72000801-111F | MODULE ASSY-LAV D<br>(EQUIPMENT/FURNISHINGS<br>ONLY)<br>SUPPLIER CODE:<br>VJ4577<br>FUNCTIONAL DESCRIPTION:<br>THIS PART PROVIDES A<br>RESTROOM FOR PASSENGERS<br>AND CREW.<br>ELECTRICAL EQUIP NUMBER:<br>M01418<br>COMPONENT MAINT MANUAL REF:<br>25-48-30<br>FOR NHA/OTHER SYS DET SEE:<br>25-40-14-01 | 354377            | RF                   |
| 5                                                       | D72D70987-111  | .RETAINER-SEAL RUBBER<br>SUPPLIER CODE:<br>VS5825<br>ATTACHING PARTS                                                                                                                                                                                                                                      | 336377            | 1                    |
| 10                                                      | NAS514P1032-12 | .SCREW                                                                                                                                                                                                                                                                                                    | 336377            | 1                    |
| 15                                                      | NAS514P1032-8  | .SCREW                                                                                                                                                                                                                                                                                                    | 336377            | 2                    |
| 21                                                      | NAS514P1032-10 | .SCREW                                                                                                                                                                                                                                                                                                    | 336377            | 11                   |
|                                                         |                | -----*-----                                                                                                                                                                                                                                                                                               |                   |                      |
| 25                                                      | D72D70988-111  | .SEAL-RUBBER<br>SUPPLIER CODE:<br>VS5825                                                                                                                                                                                                                                                                  | 336377            | 1                    |
| 30                                                      | D72W13511-111C | .DOOR ASSY-SLAB<br>SUPPLIER CODE:<br>VS5825<br>FOR DETAILS SEE:<br>25-41-17-02V                                                                                                                                                                                                                           | 336377            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |                                                                                                                                                                                                                                                                                                           |                   |                      |

- ITEM NOT ILLUSTRATED

RYR

25-40-14-02V

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-14  
 FIG. 02V  
 PAGE 1  
 OCT 15/24


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                                           | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|--------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 2V                                                      |                |                                                                                                                                      |                   |                      |
| 35                                                      | D72W15501-111  | .TOILET AND FLOOR PAN ASSY-<br>SUPPLIER CODE:<br>VS5825<br>MISCELLANEOUS DATA:<br>NON PROCURABLE<br>FOR DETAILS SEE:<br>25-41-21-02V | 336377            | RF                   |
| 40                                                      | D72W30080-111A | .BOARD ASSY-DIAPER<br>SUPPLIER CODE:<br>VS5825<br>ATTACHING PARTS                                                                    | 336377            | 1                    |
| 45                                                      | NAS514P1032-5  | .SCREW<br>-----*-----                                                                                                                | 336377            | 4                    |
| 50                                                      | C396           | ..LATCH-CABINET<br>SUPPLIER CODE:<br>VJ3034<br>TRUE PART NUMBER:<br>C-396<br>ATTACHING PARTS                                         | 336377            | 1                    |
| 55                                                      | NAS514P1032-6P | ..SCREW<br>-----*-----                                                                                                               | 336377            | 2                    |
| 60                                                      | D72D70574-111  | ..HINGE-<br>SUPPLIER CODE:<br>VS5825<br>ATTACHING PARTS                                                                              | 336377            | 1                    |
| 65                                                      | NAS514P1032-5  | ..SCREW<br>-----*-----                                                                                                               | 336377            | 4                    |
| 70                                                      | D72W57315-111A | ..PANEL-<br>SUPPLIER CODE:<br>VS5825                                                                                                 | 336377            | 1                    |
| 75                                                      | D75D80033-111  | ...BUMPER-<br>SUPPLIER CODE:<br>VS5825                                                                                               | 336377            | 3                    |
| 80                                                      | D72D72627-111  | .SUPPORT-DIAPER BOARD<br>SUPPLIER CODE:<br>VS5825<br>ATTACHING PARTS                                                                 | 336377            | 1                    |
| 85                                                      | NAS1801-3-10   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-10<br>-----*-----                                                                      | 336377            | 2                    |
| - 90                                                    | D72D72620-111  | .ANGLE-SPRT<br>SUPPLIER CODE:<br>VS5825<br>ATTACHING PARTS                                                                           | 336377            | 1                    |
| - 95                                                    | NAS1801-3-9    | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-9                                                                                      | 336377            | 2                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |                                                                                                                                      |                   |                      |

- ITEM NOT ILLUSTRATED

RYR

25-40-14-02V

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-14  
FIG. 02V  
PAGE 2  
OCT 15/24


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 | NOMENCLATURE                                                        | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|---------------|---------------------------------------------------------------------|-------------------|----------------------|
| 2V<br>- 100                                             | NAS1149D0332K  | .             | WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0332J<br>-----*-----    | 336377            | 2                    |
| 105                                                     | D72D71041-111  | .             | STRIKER-LATCH<br>SUPPLIER CODE:<br>VS5825<br>ATTACHING PARTS        | 336377            | 1                    |
| 110                                                     | NAS514P632-4   | .             | SCREW                                                               | 336377            | 4                    |
| 115                                                     | D75D70052-111  | .             | WASHER-<br>SUPPLIER CODE:<br>VS5825<br>-----*-----                  | 336377            | 4                    |
| 120                                                     | D72D70434-111  | .             | ASHTRAY-<br>SUPPLIER CODE:<br>VS5825<br>ATTACHING PARTS             | 336377            | 1                    |
| 125                                                     | NAS514P1032-5P | .             | SCREW                                                               | 336377            | 2                    |
| 130                                                     | D72D72626-111  | .             | SUPPORT-DIAPER BOARD<br>SUPPLIER CODE:<br>VS5825<br>ATTACHING PARTS | 336377            | 1                    |
| 135                                                     | NAS1801-3-14   | .             | SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-14<br>-----*-----      | 336377            | 2                    |
| 140                                                     | 65-5458-20N    | .             | HANDLE                                                              | 336377            | 1                    |
| 145                                                     | 65C22388-13    | .             | HANDLE                                                              | 336377            | 1                    |
| 150                                                     | 69-72416-5     | .             | HANDLE-ASSIST<br>SUPPLIER CODE:<br>V26835                           | 336377            | 1                    |
| 155                                                     | 66-4302-1      | .             | COLLAR<br>ATTACHING PARTS                                           | 336377            | 7                    |
| 160                                                     | NAS1801-3-10   | .             | SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-10                     | 336377            | 7                    |
| 165                                                     | NAS1149D0332K  | .             | WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0332J                   | 336377            | 7                    |
| 170                                                     | 65-5458-21N    | .             | NUT<br>-----*-----                                                  | 336377            | 7                    |
| 175                                                     | D75D70952-163  | .             | PAN-<br>SUPPLIER CODE:<br>VS5825                                    | 336377            | 1                    |
| 180                                                     | D72D80015-111G | .             | KICKSTRIP-<br>SUPPLIER CODE:<br>VS5825                              | 336377            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |               |                                                                     |                   |                      |

- ITEM NOT ILLUSTRATED

R Y R

25-40-14-02V

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-14  
FIG. 02V  
PAGE 3  
OCT 15/24


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7       | NOMENCLATURE    | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|---------------------|-----------------|-------------------|----------------------|
| 2V                                                      |                |                     | ATTACHING PARTS |                   |                      |
| 185                                                     | NAS514P1032-5P | .SCREW              |                 | 336377            | 5                    |
| 190                                                     | NAS1169DD10    | .WASHER             |                 | 336377            | 5                    |
|                                                         |                | -----*-----         |                 |                   |                      |
| 195                                                     | D72D80020-111F | .KICKSTRIP-         |                 | 336377            | 1                    |
|                                                         |                | SUPPLIER CODE:      |                 |                   |                      |
|                                                         |                | VS5825              |                 |                   |                      |
|                                                         |                | ATTACHING PARTS     |                 |                   |                      |
| 200                                                     | NAS514P1032-6P | .SCREW              |                 | 336377            | 4                    |
| 205                                                     | NAS1169DD10    | .WASHER             |                 | 336377            | 4                    |
|                                                         |                | -----*-----         |                 |                   |                      |
| 210                                                     | D72D80021-111F | .KICKSTRIP-         |                 | 336377            | 1                    |
|                                                         |                | SUPPLIER CODE:      |                 |                   |                      |
|                                                         |                | VS5825              |                 |                   |                      |
|                                                         |                | ATTACHING PARTS     |                 |                   |                      |
| 215                                                     | NAS514P1032-5P | .SCREW              |                 | 336377            | 8                    |
| 220                                                     | NAS1169DD10    | .WASHER             |                 | 336377            | 8                    |
|                                                         |                | -----*-----         |                 |                   |                      |
| 225                                                     | D72D70947-111B | .PLATE-COVER        |                 | 336377            | 2                    |
|                                                         |                | SUPPLIER CODE:      |                 |                   |                      |
|                                                         |                | VS5825              |                 |                   |                      |
|                                                         |                | ATTACHING PARTS     |                 |                   |                      |
| 230                                                     | NAS514P632-4   | .SCREW              |                 | 336377            | 4                    |
|                                                         |                | -----*-----         |                 |                   |                      |
| 235                                                     | D72D70947-111M | .PLATE-COVER        |                 | 336377            | 2                    |
|                                                         |                | SUPPLIER CODE:      |                 |                   |                      |
|                                                         |                | VS5825              |                 |                   |                      |
|                                                         |                | ATTACHING PARTS     |                 |                   |                      |
| 240                                                     | NAS514P632-4   | .SCREW              |                 | 336377            | 4                    |
|                                                         |                | -----*-----         |                 |                   |                      |
| 245                                                     | D72D80025-911A | .RUBSTRIP-          |                 | 336377            | 1                    |
|                                                         |                | SUPPLIER CODE:      |                 |                   |                      |
|                                                         |                | VS5825              |                 |                   |                      |
|                                                         |                | MISCELLANEOUS DATA: |                 |                   |                      |
|                                                         |                | BAC1522-547-70229   |                 |                   |                      |
| 250                                                     | D72D80025-912A | .RUBSTRIP-          |                 | 336377            | 1                    |
|                                                         |                | SUPPLIER CODE:      |                 |                   |                      |
|                                                         |                | VS5825              |                 |                   |                      |
|                                                         |                | MISCELLANEOUS DATA: |                 |                   |                      |
|                                                         |                | BAC1522-547-70229   |                 |                   |                      |
| 255                                                     | D72D80025-913A | .RUBSTRIP-          |                 | 336377            | 1                    |
|                                                         |                | SUPPLIER CODE:      |                 |                   |                      |
|                                                         |                | VS5825              |                 |                   |                      |
|                                                         |                | MISCELLANEOUS DATA: |                 |                   |                      |
|                                                         |                | BAC1522-547-70229   |                 |                   |                      |
| 260                                                     | D72D80024-111B | .RETAINER-RUBSTRIP  |                 | 336377            | 1                    |
|                                                         |                | SUPPLIER CODE:      |                 |                   |                      |
|                                                         |                | VS5825              |                 |                   |                      |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |                     |                 |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R

25-40-14-02V

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

25-40-14  
 FIG. 02V  
 PAGE 4  
 OCT 15/24


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 | NOMENCLATURE                                                                      | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|---------------|-----------------------------------------------------------------------------------|-------------------|----------------------|
| 2V                                                      |                |               |                                                                                   |                   |                      |
| 265                                                     | NAS1801-08-5   |               | ATTACHING PARTS<br>.SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN08-5               | 336377            | 3                    |
| 270                                                     | NAS1149DN832K  |               | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149DN832J<br>-----*-----                 | 336377            | 3                    |
| 275                                                     | D72D80023-111B |               | .RETAINER-RUBSTRIP<br>SUPPLIER CODE:<br>VS5825<br>ATTACHING PARTS                 | 336377            | 1                    |
| 280                                                     | NAS1801-08-5   |               | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN08-5                                  | 336377            | 1                    |
| 285                                                     | NAS1149DN832K  |               | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149DN832J<br>-----*-----                 | 336377            | 1                    |
| 290                                                     | D72D80022-111B |               | .RETAINER-RUBSTRIP<br>SUPPLIER CODE:<br>VS5825<br>ATTACHING PARTS                 | 336377            | 1                    |
| 295                                                     | NAS1801-08-5   |               | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN08-5                                  | 336377            | 2                    |
| 300                                                     | NAS1149DN832K  |               | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149DN832J<br>-----*-----                 | 336377            | 2                    |
| 305                                                     | 432W7101-6J    |               | .ENDCAP<br>ATTACHING PARTS                                                        | 336377            | 6                    |
| 310                                                     | NAS1801-08-5   |               | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN08-5                                  | 336377            | 6                    |
| 315                                                     | NAS1149DN832K  |               | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149DN832J<br>-----*-----                 | 336377            | 6                    |
| 320                                                     | D72D80018-911B |               | .RUBSTRIP-<br>SUPPLIER CODE:<br>VS5825<br>MISCELLANEOUS DATA:<br>BAC1522-547-7802 | 336377            | 1                    |
| 325                                                     | D72D80011-111B |               | .RETAINER-RUBSTRIP<br>SUPPLIER CODE:<br>VS5825                                    | 336377            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |               |                                                                                   |                   |                      |

— ITEM NOT ILLUSTRATED

RYR

25-40-14-02V

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-14  
FIG. 02V  
PAGE 5  
OCT 15/24


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                                                                                                                     | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 2V                                                      |                |                                                                                                                                                                                                                |                   |                      |
| 330                                                     | NAS1801-08-7   | ATTACHING PARTS<br>.SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN08-7                                                                                                                                            | 336377            | 5                    |
| 335                                                     | NAS1149DN816K  | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149DN816J                                                                                                                                                             | 336377            | 5                    |
| 340                                                     | 130008         | .NUT<br>SUPPLIER CODE:<br>V60119<br>SPECIFICATION NUMBER:<br>BACN10FX84<br>OPTIONAL PART:<br>RM52LHA4972-6-8<br>V72962<br>SL211-08-1<br>V97393<br>A11330-6-82<br>V72962<br>A4972-6-82<br>V72962<br>-----*----- | 336377            | 5                    |
| 345                                                     | D72D80018-913B | .RUBSTRIP-<br>SUPPLIER CODE:<br>VS5825<br>MISCELLANEOUS DATA:<br>BAC1522-547-7802                                                                                                                              | 336377            | 1                    |
| 350                                                     | D72D80010-111B | .RETAINER-RUBSTRIP<br>SUPPLIER CODE:<br>VS5825                                                                                                                                                                 | 336377            | 1                    |
| 355                                                     | NAS1801-08-7   | ATTACHING PARTS<br>.SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN08-7                                                                                                                                            | 336377            | 12                   |
| 360                                                     | NAS1149DN816K  | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149DN816J                                                                                                                                                             | 336377            | 12                   |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |                                                                                                                                                                                                                |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R

25-40-14-02V

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

25-40-14  
 FIG. 02V  
 PAGE 6  
 OCT 15/24




**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7<br>NOMENCLATURE                                                                                                                                                                                  | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 2V<br>365                                               | 130008         | .NUT<br>SUPPLIER CODE:<br>V60119<br>SPECIFICATION NUMBER:<br>BACN10FX84<br>OPTIONAL PART:<br>RM52LHA4972-6-8<br>V72962<br>SL211-08-1<br>V97393<br>A11330-6-82<br>V72962<br>A4972-6-82<br>V72962<br>-----*----- | 336377            | 12                   |
| 370                                                     | D72D70548-111  | .TRIM-WALL EDGE<br>SUPPLIER CODE:<br>VS5825                                                                                                                                                                    | 336377            | 1                    |
| 375                                                     | D72D71109-111B | .TRIM-RTNR,FLOOR PAN<br>SUPPLIER CODE:<br>VS5825                                                                                                                                                               | 336377            | 1                    |
| 380                                                     | D72D71110-111B | .TRIM-RTNR,FLOOR PAN<br>SUPPLIER CODE:<br>VS5825                                                                                                                                                               | 336377            | 1                    |
| 385                                                     | D72D71111-111B | .TRIM-RTNR,FLOOR PAN<br>SUPPLIER CODE:<br>VS5825                                                                                                                                                               | 336377            | 1                    |
| 390                                                     | D72D71112-911B | .TRIM-INSERT,FLOOR PAN<br>SUPPLIER CODE:<br>VS5825                                                                                                                                                             | 336377            | 1                    |
| 395                                                     | D72D71112-912B | .TRIM-INSERT,FLOOR PAN<br>SUPPLIER CODE:<br>VS5825                                                                                                                                                             | 336377            | 1                    |
| 400                                                     | D72D71112-913B | .TRIM-INSERT,FLOOR PAN<br>SUPPLIER CODE:<br>VS5825                                                                                                                                                             | 336377            | 1                    |
| 405                                                     | D72D70301-911  | .SEAL-RTNR<br>SUPPLIER CODE:<br>VS5825                                                                                                                                                                         | 336377            | 1                    |
| 410                                                     | D72D70301-913  | .SEAL-RTNR<br>SUPPLIER CODE:<br>VS5825                                                                                                                                                                         | 336377            | 1                    |
| 415                                                     | D72D70301-915  | .SEAL-RTNR<br>SUPPLIER CODE:<br>VS5825                                                                                                                                                                         | 336377            | 1                    |
| 420                                                     | D72D70795-111  | .BLANKET-FIRE<br>SUPPLIER CODE:<br>VS5825                                                                                                                                                                      | 336377            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |                                                                                                                                                                                                                |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R

25-40-14-02V

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-14  
FIG. 02V  
PAGE 7  
DEC 15/15


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER   | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                                                                                                                                          | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|---------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 2V                                                      |               | ATTACHING PARTS                                                                                                                                                                                                                     |                   |                      |
| 425                                                     | NAS1801-3-4   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-4                                                                                                                                                                                     | 336377            | 10                   |
| 430                                                     | NAS1801-3-8   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-8                                                                                                                                                                                     | 336377            | 5                    |
| 435                                                     | NAS1149D0332K | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0332J<br>-----*-----                                                                                                                                                                   | 336377            | 15                   |
| 440                                                     | D72D72683-111 | .SCREW-TAMPER PROOF<br>SUPPLIER CODE:<br>VS5825<br>CONFIG CHG DATA FROM A CMM:<br>SUPSD BY D72D72683-913                                                                                                                            | 336377            | 2                    |
| 440                                                     | D72D72683-913 | .SCREW-TAMPER PROOF<br>SUPPLIER CODE:<br>VS5825<br>CONFIG CHG DATA FROM A CMM:<br>SUPERSEDES D72D72683-111                                                                                                                          | 336377            | 2                    |
| 445                                                     | NAS1149C0332R | .WASHER                                                                                                                                                                                                                             | 336377            | 2                    |
| 450                                                     | D72W16510-111 | .DISPENSER ASSY-UPR<br>SUPPLIER CODE:<br>VS5825<br>MISCELLANEOUS DATA:<br>NON PROCURABLE<br>FOR DETAILS SEE:<br>25-41-51-02V                                                                                                        | 336377            | RF                   |
| 455                                                     | D72W17505-111 | .DISPENSER ASSY-LWR<br>SUPPLIER CODE:<br>VS5825<br>MISCELLANEOUS DATA:<br>NON PROCURABLE<br>FUNCTIONAL REFERENCE:<br>EQUIPMENT/FURNISHINGS<br>FOR DETAILS SEE<br>25-41-51-20V<br>FIRE PROTECTION<br>FOR DETAILS SEE<br>26-24-01-02V | 336377            | RF                   |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |               |                                                                                                                                                                                                                                     |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R

25-40-14-02V

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-14  
 FIG. 02V  
 PAGE 8  
 OCT 15/24


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                                                                                                                                                                                                                                                                                                            | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 2V<br>460                                               | D72W26510-111  | .PLUMBING ASSY-<br>SUPPLIER CODE:<br>VS5825<br>MISCELLANEOUS DATA:<br>NON PROCURABLE<br>FUNCTIONAL REFERENCE:<br>AIR CONDITIONING<br>FOR DETAILS SEE<br>21-24-51-20V<br>WATER/WASTE<br>FOR DETAILS SEE<br>38-11-05-02V<br>38-11-51-02V<br>38-13-01-02V                                                                                                                                                | 336377            | RF                   |
| 465                                                     | D72W27534-111  | .ELECTRICAL ASSY-<br>SUPPLIER CODE:<br>VS5825<br>MISCELLANEOUS DATA:<br>NON PROCURABLE<br>FUNCTIONAL REFERENCE:<br>COMMUNICATIONS<br>FOR DETAILS SEE<br>23-31-05-02V<br>EQUIPMENT/FURNISHINGS<br>FOR DETAILS SEE<br>25-41-60-02V<br>FIRE PROTECTION<br>FOR DETAILS SEE<br>26-14-01-02V<br>LIGHTS<br>FOR DETAILS SEE<br>33-26-03-02V<br>33-27-51-02V<br>WATER/WASTE<br>FOR DETAILS SEE<br>38-32-04-02V | 336377            | RF                   |
| 470                                                     | D72D80006-111B | .MAT-FLOR<br>SUPPLIER CODE:<br>VS5825                                                                                                                                                                                                                                                                                                                                                                 | 336377            | 1                    |
| 475                                                     | D72W12512-111  | .OUTWALL ASSY-<br>SUPPLIER CODE:<br>VS5825<br>MISCELLANEOUS DATA:<br>NON PROCURABLE<br>FOR DETAILS SEE:<br>25-41-40-02V                                                                                                                                                                                                                                                                               | 336377            | RF                   |
| 480                                                     | D72W59250-111A | .SINK ASSY-DECK SUB<br>SUPPLIER CODE:<br>VS5825                                                                                                                                                                                                                                                                                                                                                       | 336377            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |                                                                                                                                                                                                                                                                                                                                                                                                       |                   |                      |

— ITEM NOT ILLUSTRATED

RYR

25-40-14-02V

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

25-40-14  
 FIG. 02V  
 PAGE 9  
 OCT 15/24


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7       | NOMENCLATURE                                                                                     | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|---------------------|--------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 2V                                                      |                |                     |                                                                                                  |                   |                      |
| 481                                                     | D72D70001-112  | ..                  | BOWL-<br>SUPPLIER CODE:<br>VS5825                                                                | 336377            | 1                    |
| 485                                                     | D72D41509-111  | .PANEL-             | FL00R<br>SUPPLIER CODE:<br>VS5825                                                                | 336377            | 1                    |
| 490                                                     | D72D46505-111  | .PANEL-             | SUPPLIER CODE:<br>VS5825<br>POSITION DATA:<br>OUTBD.UPR                                          | 336377            | 1                    |
| 495                                                     | D72D46004-111  | .PANEL-             | SUPPLIER CODE:<br>VS5825<br>POSITION DATA:<br>OUTBD. LWR                                         | 336377            | 1                    |
| 500                                                     | D72W52517-111A | .PANEL-SIDE WALL    | SUPPLIER CODE:<br>VS5825                                                                         | 336377            | 1                    |
| 501                                                     | D72D72685-111  | ..TUBE              | FRAME ASSY-<br>SUPPLIER CODE:<br>VS5825<br>MISCELLANEOUS DATA:<br>NO DECORATIVE LAMINATE<br>PART | 336377            | 1                    |
| 505                                                     | D72W53515-111B | .PANEL-SINK WALL    | SUPPLIER CODE:<br>VS5825                                                                         | 336377            | 1                    |
| 510                                                     | D72W54514-111B | .PANEL-DOOR WALL    | SUPPLIER CODE:<br>VS5825                                                                         | 336377            | 1                    |
| 515                                                     | D72W55500-111A | .PANEL-CLG          | SUPPLIER CODE:<br>VS5825                                                                         | 336377            | 1                    |
| 520                                                     | D72W56500-111A | .PANEL ASSY-LINING  | SUPPLIER CODE:<br>VS5825                                                                         | 336377            | 1                    |
| 522                                                     | 4A114-0016-1   | ..BUMPER-           | SUPPLIER CODE:<br>VS5825                                                                         | 336377            | 2                    |
| 525                                                     | D72W57009-111B | .PANEL-HEADER,      | BIFOLD<br>SUPPLIER CODE:<br>VS5825                                                               | 336377            | 1                    |
| 530                                                     | D72W59259-111A | .PANEL-DISP CABINET | SUPPLIER CODE:<br>VS5825                                                                         | 336377            | 1                    |
| 535                                                     | D72D70699-111B | .PAN ASSY-FL00R     | SUPPLIER CODE:<br>VS5825                                                                         | 336377            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |                     |                                                                                                  |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R

25-40-14-02V

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

25-40-14  
 FIG. 02V  
 PAGE 10  
 OCT 15/24


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 | NOMENCLATURE                                                        | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|---------------|---------------------------------------------------------------------|-------------------|----------------------|
| 2V                                                      |                |               |                                                                     |                   |                      |
| 540                                                     | NAS514P1032-6P |               | ATTACHING PARTS<br>.SCREW<br>-----*-----                            | 336377            | 4                    |
| 545                                                     | D72D70438-111B |               | .COVER-FL00R PAN<br>SUPPLIER CODE:<br>VS5825                        | 336377            | 1                    |
| 550                                                     | NAS1801-08-7   |               | ATTACHING PARTS<br>.SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN08-7 | 336377            | 2                    |
| 555                                                     | NAS1149DN816K  |               | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149DN816J<br>-----*-----   | 336377            | 2                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |               |                                                                     |                   |                      |

— ITEM NOT ILLUSTRATED


R Y R

25-40-14-02V

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

25-40-14  
 FIG. 02V  
 PAGE 11  
 OCT 15/24

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

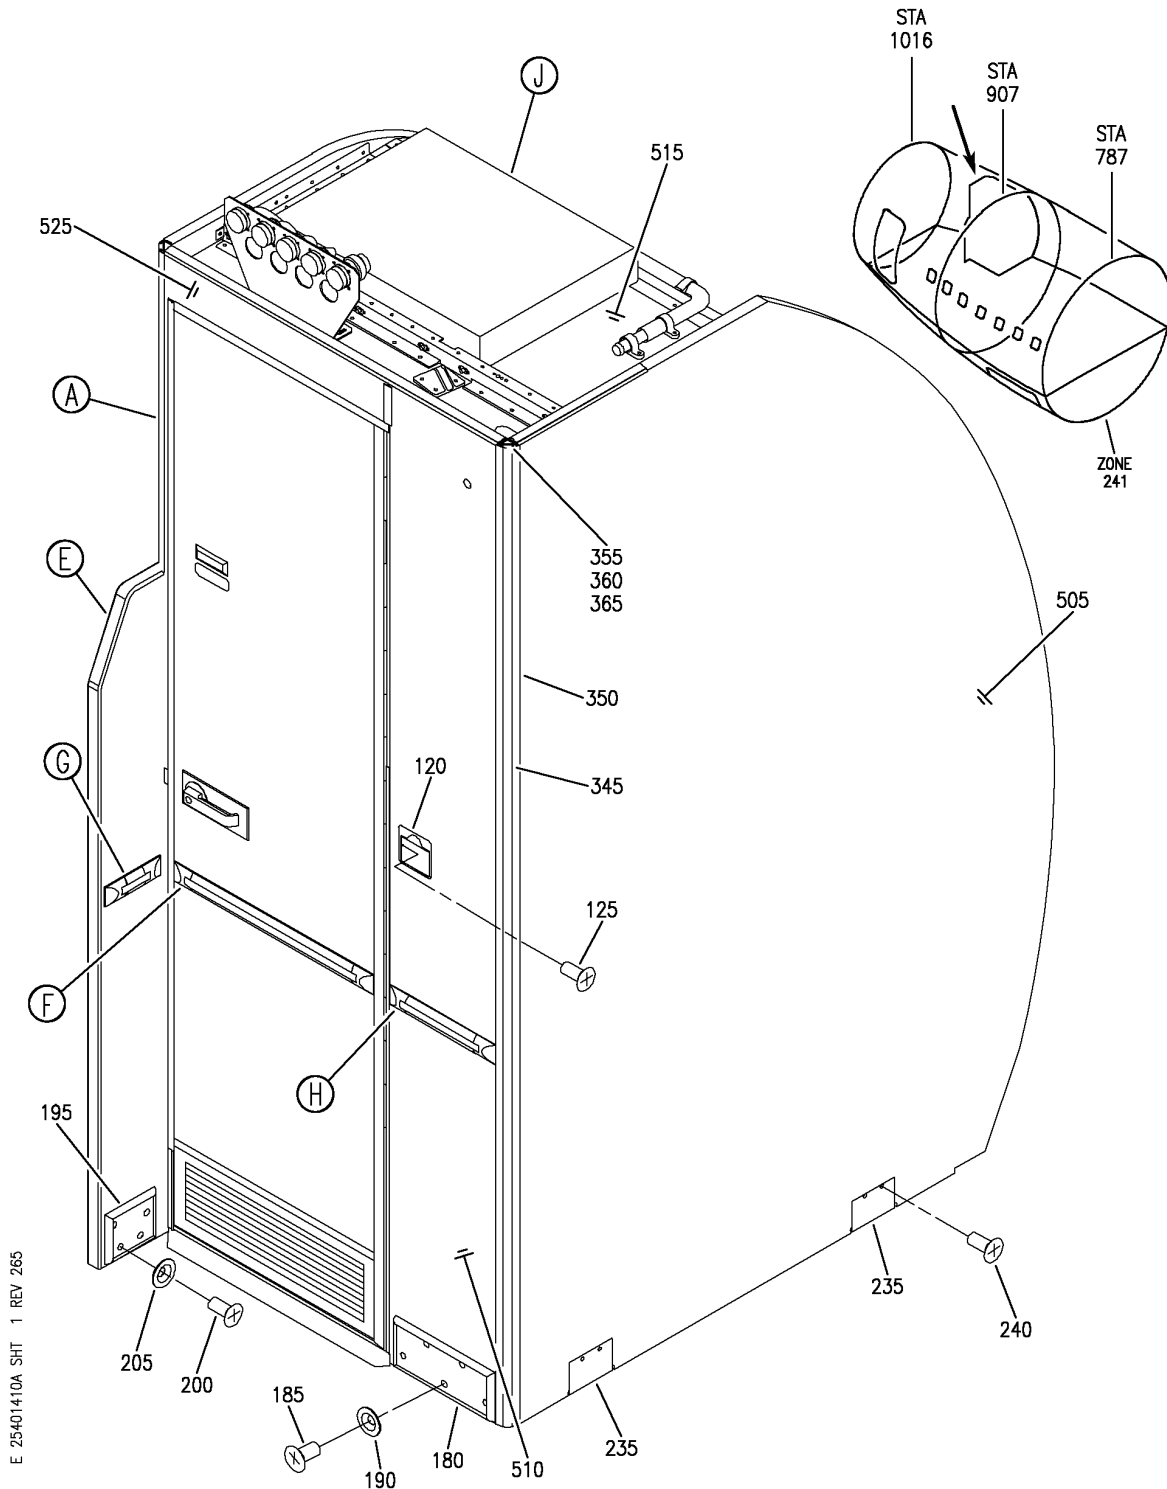


E 25401410A SHT 1 REV 265

MODULE ASSY-LAV D (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 10A (SHEET 1)

**25-40-14-10A**





R/YR  
AUG 15/18

25-40-14-10A  
PAGE 0

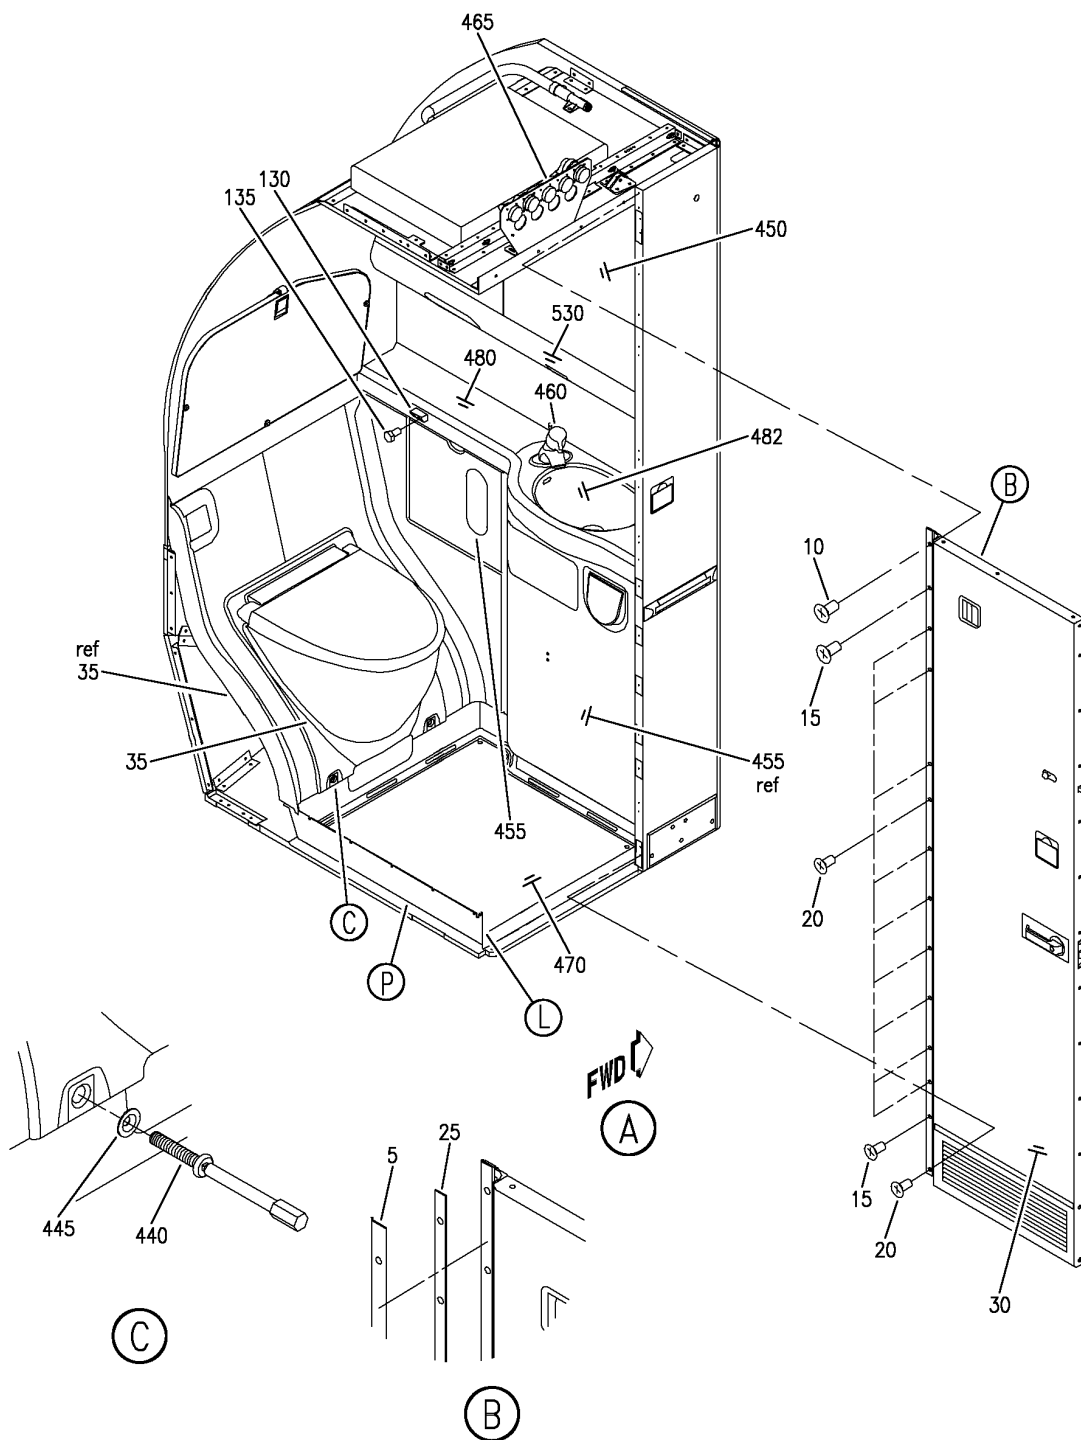

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

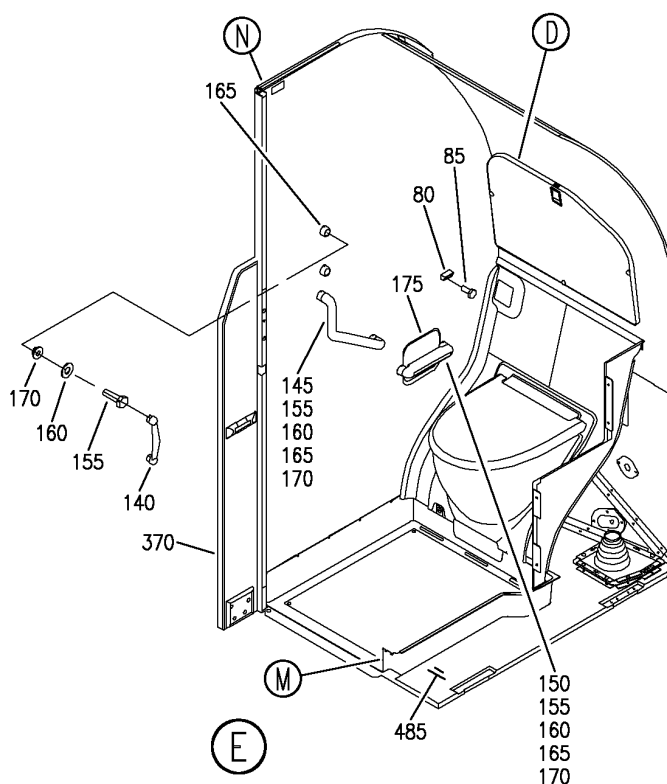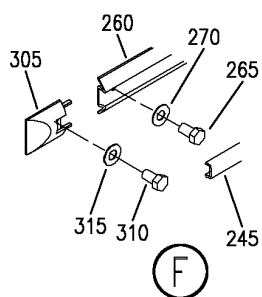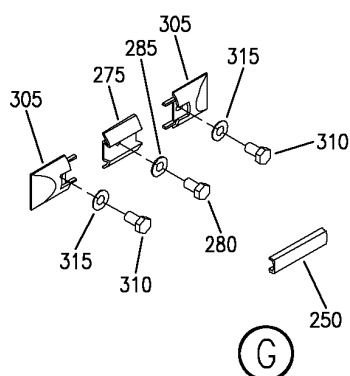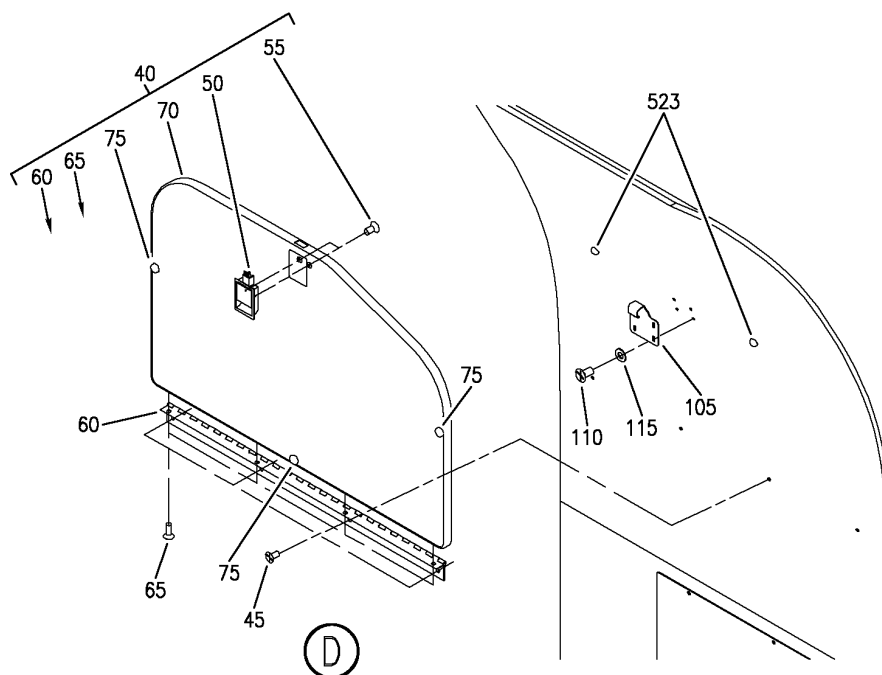

E 25401410A SHT 3 REV 265

MODULE ASSY-LAV D (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 10A (SHEET 3)


**25-40-14-10A**

R/YR  
AUG 15/18

25-40-14-10A  
PAGE 08



**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

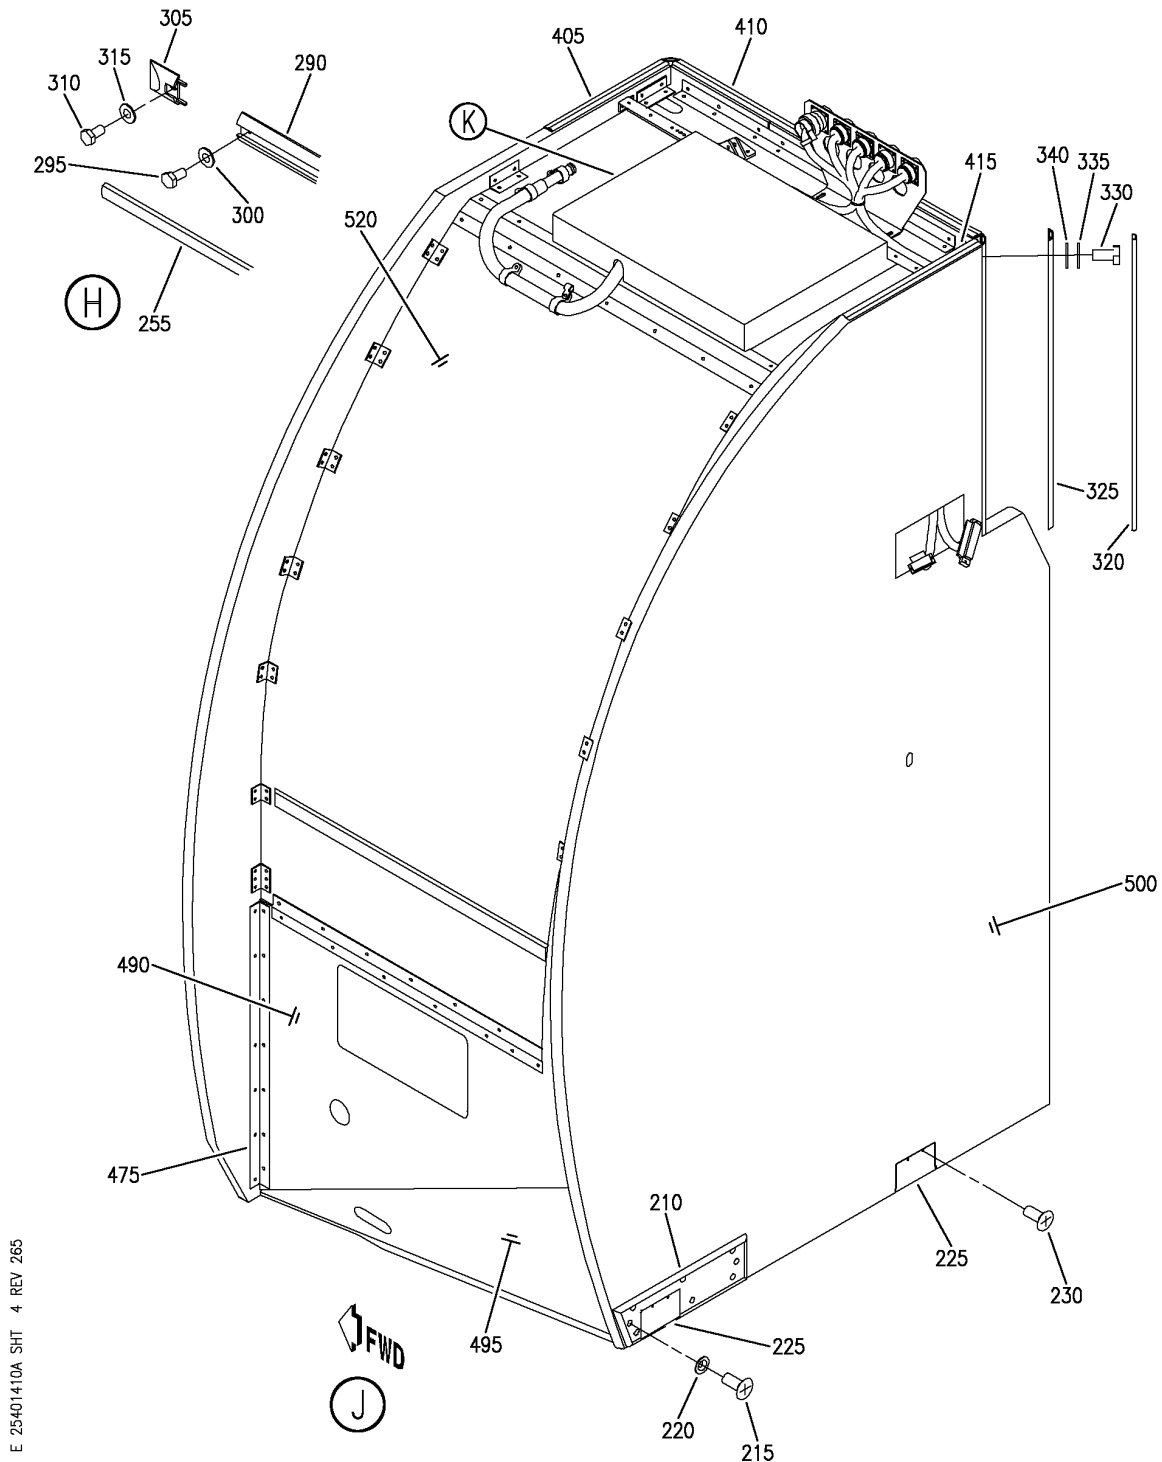

E 25401410A SHT 4 REV 265

MODULE ASSY-LAV D (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 10A (SHEET 4)


**25-40-14-10A**

RJR  
AUG 15/18

25-40-14-10A  
PAGE 0C

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

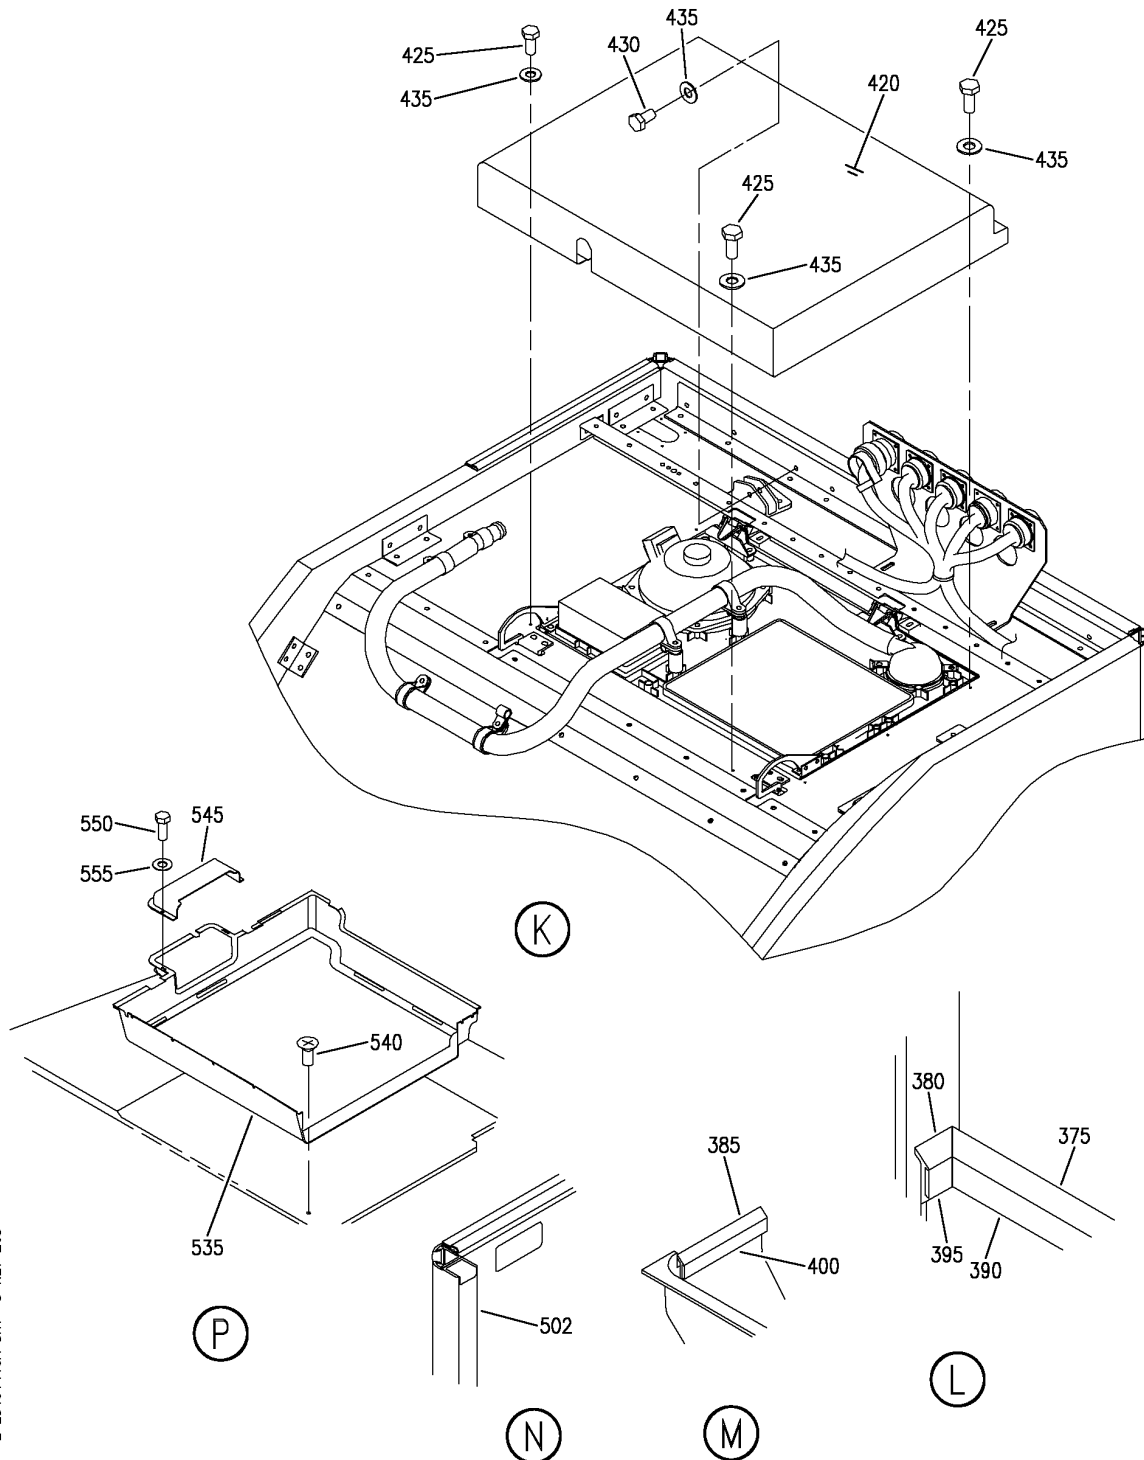

E 25401410A SHT 5 REV 265

MODULE ASSY-LAV D (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 10A (SHEET 5)

**25-40-14-10A**

R Y R  
AUG 15/18

25-40-14-10A  
PAGE 00

ECCN 9E991 BOEING PROPRIETARY – See title page for details.


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7<br>NOMENCLATURE                                                                                                                                                                                                                                                                                 | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 10A                                                     |                | MODULE ASSY-LAV D<br>(EQUIPMENT/FURNISHINGS<br>ONLY)                                                                                                                                                                                                                                                          | 378416            |                      |
| - 1                                                     | D72004800-111N | MODULE ASSY-LAV D<br>(EQUIPMENT/FURNISHINGS<br>ONLY)<br>SUPPLIER CODE:<br>VJ4577<br>FUNCTIONAL DESCRIPTION:<br>PART PROVIDES RESTROOM<br>FACILITIES FOR<br>PASSENGERS AND CREW.<br>ELECTRICAL EQUIP NUMBER:<br>M01418<br>COMPONENT MAINT MANUAL REF:<br>25-48-64<br>FOR NHA/OTHER SYS DET SEE:<br>25-40-14-01 | 378416            | RF                   |
| 5                                                       | D72D70987-111  | .RETAINER-SEAL, RUBBER<br>SUPPLIER CODE:<br>VS5825<br>ATTACHING PARTS                                                                                                                                                                                                                                         | 378416            | 1                    |
| 10                                                      | NAS514P1032-12 | .SCREW                                                                                                                                                                                                                                                                                                        | 378416            | 1                    |
| 15                                                      | NAS514P1032-8  | .SCREW                                                                                                                                                                                                                                                                                                        | 378416            | 2                    |
| 20                                                      | NAS514P1032-10 | .SCREW                                                                                                                                                                                                                                                                                                        | 378416            | 11                   |
|                                                         |                | -----*-----                                                                                                                                                                                                                                                                                                   |                   |                      |
| 25                                                      | D72D70988-111  | .SEAL-RUBBER<br>SUPPLIER CODE:<br>VS5825                                                                                                                                                                                                                                                                      | 378416            | 1                    |
| 30                                                      | D72W13511-111C | .DOOR ASSY-SLAB<br>SUPPLIER CODE:<br>VS5825<br>FOR DETAILS SEE:<br>25-41-17-50                                                                                                                                                                                                                                | 378416            | 1                    |
| 35                                                      | D72W15501-111  | .TOILET AND FLOOR PAN ASSY-<br>SUPPLIER CODE:<br>VS5825<br>MISCELLANEOUS DATA:<br>NON PROCURABLE<br>FOR DETAILS SEE:<br>25-41-21-50                                                                                                                                                                           | 378416            | RF                   |
| 40                                                      | D72W30080-111A | .BOARD ASSY-DIAPER<br>SUPPLIER CODE:<br>VS5825<br>ATTACHING PARTS                                                                                                                                                                                                                                             | 378416            | 1                    |
| 45                                                      | NAS514P1032-5  | .SCREW<br>-----*-----                                                                                                                                                                                                                                                                                         | 378416            | 4                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |                                                                                                                                                                                                                                                                                                               |                   |                      |

- ITEM NOT ILLUSTRATED

RYR

25-40-14-10A

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-14  
FIG. 10A  
PAGE 1  
OCT 15/24

 **BOEING**  
737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 NOMENCLATURE                                                                    | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|-----------------------------------------------------------------------------------------------|-------------------|----------------------|
| 10A<br>50                                               | C396           | .. LATCH-CABINET<br>SUPPLIER CODE:<br>VJ3034<br>TRUE PART NUMBER:<br>C-396<br>ATTACHING PARTS | 378416            | 1                    |
| 55                                                      | NAS514P1032-6P | .. SCREW<br>-----*-----                                                                       | 378416            | 2                    |
| 60                                                      | D72D70574-111  | .. HINGE-<br>SUPPLIER CODE:<br>VS5825<br>ATTACHING PARTS                                      | 378416            | 1                    |
| 65                                                      | NAS514P1032-5  | .. SCREW<br>-----*-----                                                                       | 378416            | 4                    |
| 70                                                      | D72W57315-111A | .. PANEL-<br>SUPPLIER CODE:<br>VS5825                                                         | 378416            | 1                    |
| 75                                                      | D75D80033-111  | ... BUMPER-<br>SUPPLIER CODE:<br>VS5825                                                       | 378416            | 3                    |
| 80                                                      | D72D72627-111  | . SUPPORT-DIAPER BOARD<br>SUPPLIER CODE:<br>VS5825<br>ATTACHING PARTS                         | 378416            | 1                    |
| 85                                                      | NAS1801-3-10   | . SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-10<br>-----*-----                              | 378416            | 2                    |
| - 90                                                    | D72D72620-111  | . ANGLE-SPRT<br>SUPPLIER CODE:<br>VS5825<br>ATTACHING PARTS                                   | 378416            | 1                    |
| - 95                                                    | NAS1801-3-9    | . SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-9                                              | 378416            | 2                    |
| - 100                                                   | NAS1149D0332K  | . WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0332J<br>-----*-----                            | 378416            | 2                    |
| 105                                                     | D72D71041-111  | . STRIKER-LATCH<br>SUPPLIER CODE:<br>VS5825<br>ATTACHING PARTS                                | 378416            | 1                    |
| 110                                                     | NAS514P632-4   | . SCREW                                                                                       | 378416            | 4                    |
| 115                                                     | D75D70052-111  | . WASHER-<br>SUPPLIER CODE:<br>VS5825<br>-----*-----                                          | 378416            | 4                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |                                                                                               |                   |                      |

- ITEM NOT ILLUSTRATED

R Y R

25-40-14-10A

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-14  
FIG. 10A  
PAGE 2  
APR 15/23


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM | PART NUMBER    | 1 2 3 4 5 6 7                                                         | NOMENCLATURE | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|-------------|----------------|-----------------------------------------------------------------------|--------------|-------------------|----------------------|
| 10A<br>120  | D72D70434-111  | . ASHTRAY-<br>SUPPLIER CODE:<br>VS5825<br>ATTACHING PARTS             |              | 378416            | 1                    |
| 125         | NAS514P1032-5P | . SCREW<br>-----*-----                                                |              | 378416            | 2                    |
| 130         | D72D72626-111  | . SUPPORT-DIAPER BOARD<br>SUPPLIER CODE:<br>VS5825<br>ATTACHING PARTS |              | 378416            | 1                    |
| 135         | NAS1801-3-14   | . SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-14<br>-----*-----      |              | 378416            | 2                    |
| 140         | 65-5458-20N    | . HANDLE-ASSIST                                                       |              | 378416            | 1                    |
| 145         | 65C22388-13    | . HANDLE-ASSIST                                                       |              | 378416            | 1                    |
| 150         | 69-72416-5     | . HANDLE-ASSIST<br>SUPPLIER CODE:<br>V26835                           |              | 378416            | 1                    |
| 155         | NAS1801-3-10   | . SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-10                     |              | 378416            | 7                    |
| 160         | NAS1149D0332K  | . WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0332J                   |              | 378416            | 7                    |
| 165         | 65-5458-21N    | . NUT                                                                 |              | 378416            | 7                    |
| 170         | 66-4302-1      | . COLLAR                                                              |              | 378416            | 7                    |
| 175         | D75D70952-163  | . PAN-<br>SUPPLIER CODE:<br>VS5825                                    |              | 378416            | 1                    |
| 180         | D72D80015-111G | . KICKSTRIP-<br>SUPPLIER CODE:<br>VS5825<br>ATTACHING PARTS           |              | 378416            | 1                    |
| 185         | NAS514P1032-5P | . SCREW                                                               |              | 378416            | 5                    |
| 190         | NAS1169DD10    | . WASHER<br>-----*-----                                               |              | 378416            | 5                    |
| 195         | D72D80020-111F | . KICKSTRIP-<br>SUPPLIER CODE:<br>VS5825<br>ATTACHING PARTS           |              | 378416            | 1                    |
| 200         | NAS514P1032-6P | . SCREW                                                               |              | 378416            | 4                    |
| 205         | NAS1169DD10    | . WASHER<br>-----*-----                                               |              | 378416            | 4                    |
| 210         | D72D80021-111F | . KICKSTRIP-<br>SUPPLIER CODE:<br>VS5825<br>ATTACHING PARTS           |              | 378416            | 1                    |
| 215         | NAS514P1032-5P | . SCREW                                                               |              | 378416            | 8                    |

ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE

— ITEM NOT ILLUSTRATED

RYR

25-40-14-10A

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-14  
FIG. 10A  
PAGE 3  
OCT 15/24


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER     | 1 2 3 4 5 6 7<br>NOMENCLATURE                                                       | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|-----------------|-------------------------------------------------------------------------------------|-------------------|----------------------|
| 10A                                                     |                 |                                                                                     |                   |                      |
| 220                                                     | NAS1169DD10     | . WASHER<br>-----*-----                                                             | 378416            | 8                    |
| 225                                                     | D72D70947-111B  | . PLATE-COVER<br>SUPPLIER CODE:<br>VS5825<br>ATTACHING PARTS                        | 378416            | 2                    |
| 230                                                     | NAS514P632-4    | . SCREW<br>-----*-----                                                              | 378416            | 4                    |
| 235                                                     | D72D70947-111FF | . PLATE-COVER<br>SUPPLIER CODE:<br>VS5825<br>ATTACHING PARTS                        | 378416            | 2                    |
| 240                                                     | NAS514P632-4    | . SCREW<br>-----*-----                                                              | 378416            | 4                    |
| 245                                                     | D72D80025-911A  | . RUBSTRIP-<br>SUPPLIER CODE:<br>VS5825<br>MISCELLANEOUS DATA:<br>BAC1522-547-70229 | 378416            | 1                    |
| 250                                                     | D72D80025-912A  | . RUBSTRIP-<br>SUPPLIER CODE:<br>VS5825<br>MISCELLANEOUS DATA:<br>BAC1522-547-70229 | 378416            | 1                    |
| 255                                                     | D72D80025-913A  | . RUBSTRIP-<br>SUPPLIER CODE:<br>VS5825<br>MISCELLANEOUS DATA:<br>BAC1522-547-70229 | 378416            | 1                    |
| 260                                                     | D72D80024-111B  | . RETAINER-RUBSTRIP<br>SUPPLIER CODE:<br>VS5825<br>ATTACHING PARTS                  | 378416            | 1                    |
| 265                                                     | NAS1801-08-5    | . SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN08-5                                   | 378416            | 3                    |
| 270                                                     | NAS1149DN832K   | . WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149DN832J<br>-----*-----                  | 378416            | 3                    |
| 275                                                     | D72D80023-111B  | . RETAINER-RUBSTRIP<br>SUPPLIER CODE:<br>VS5825<br>ATTACHING PARTS                  | 378416            | 1                    |
| 280                                                     | NAS1801-08-5    | . SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN08-5                                   | 378416            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                 |                                                                                     |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R

25-40-14-10A

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-14  
 FIG. 10A  
 PAGE 4  
 OCT 15/24


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 | NOMENCLATURE                                                                     | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|---------------|----------------------------------------------------------------------------------|-------------------|----------------------|
| 10A<br>285                                              | NAS1149DN832K  | .             | WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149DN832J<br>-----*-----                 | 378416            | 1                    |
| 290                                                     | D72D80022-111B | .             | RETAINER-RUBSTRIP<br>SUPPLIER CODE:<br>VS5825<br>ATTACHING PARTS                 | 378416            | 1                    |
| 295                                                     | NAS1801-08-5   | .             | SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN08-5                                  | 378416            | 2                    |
| 300                                                     | NAS1149DN832K  | .             | WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149DN832J<br>-----*-----                 | 378416            | 2                    |
| 305                                                     | 432W7101-6J    | .             | CAP-END<br>ATTACHING PARTS                                                       | 378416            | 6                    |
| 310                                                     | NAS1801-08-5   | .             | SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN08-5                                  | 378416            | 6                    |
| 315                                                     | NAS1149DN832K  | .             | WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149DN832J<br>-----*-----                 | 378416            | 6                    |
| 320                                                     | D72D80018-911B | .             | RUBSTRIP-<br>SUPPLIER CODE:<br>VS5825<br>MISCELLANEOUS DATA:<br>BAC1522-547-7802 | 378416            | 1                    |
| 325                                                     | D72D80011-111B | .             | RETAINER-RUBSTRIP<br>SUPPLIER CODE:<br>VS5825<br>ATTACHING PARTS                 | 378416            | 1                    |
| 330                                                     | NAS1801-08-7   | .             | SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN08-7                                  | 378416            | 5                    |
| 335                                                     | NAS1149DN816K  | .             | WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149DN816J                                | 378416            | 5                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |               |                                                                                  |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R

25-40-14-10A

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

25-40-14  
 FIG. 10A  
 PAGE 5  
 APR 15/23


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                                                                                                                             | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 10A<br>340                                              | 130008         | .NUT-CLIP ON<br>SUPPLIER CODE:<br>V60119<br>SPECIFICATION NUMBER:<br>BACN10FX84<br>OPTIONAL PART:<br>RM52LHA4972-6-8<br>V72962<br>SL211-08-1<br>V97393<br>A11330-6-82<br>V72962<br>A4972-6-82<br>V72962<br>-----*----- | 378416            | 5                    |
| 345                                                     | D72D80018-913B | .RUBSTRIP-<br>SUPPLIER CODE:<br>VS5825<br>MISCELLANEOUS DATA:<br>BAC1522-547-7802                                                                                                                                      | 378416            | 1                    |
| 350                                                     | D72D80010-111B | .RETAINER-RUBSTRIP<br>SUPPLIER CODE:<br>VS5825<br>ATTACHING PARTS                                                                                                                                                      | 378416            | 1                    |
| 355                                                     | NAS1801-08-7   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN08-7                                                                                                                                                                       | 378416            | 12                   |
| 360                                                     | NAS1149DN816K  | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149DN816J                                                                                                                                                                     | 378416            | 12                   |
| 365                                                     | 130008         | .NUT-CLIP ON<br>SUPPLIER CODE:<br>V60119<br>SPECIFICATION NUMBER:<br>BACN10FX84<br>OPTIONAL PART:<br>RM52LHA4972-6-8<br>V72962<br>SL211-08-1<br>V97393<br>A11330-6-82<br>V72962<br>A4972-6-82<br>V72962<br>-----*----- | 378416            | 12                   |
| 370                                                     | D72D70548-111  | .TRIM-WALL EDGE<br>SUPPLIER CODE:<br>VS5825                                                                                                                                                                            | 378416            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |                                                                                                                                                                                                                        |                   |                      |

— ITEM NOT ILLUSTRATED

RYR

25-40-14-10A

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-14  
 FIG. 10A  
 PAGE 6  
 APR 15/23




**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                              | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|-------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 10A<br>375                                              | D72D71109-111B | .TRIM-RTNR, FLOOR PAN<br>SUPPLIER CODE:<br>VS5825                                                                       | 378416            | 1                    |
| 380                                                     | D72D71110-111B | .TRIM-RTNR, FLOOR PAN<br>SUPPLIER CODE:<br>VS5825                                                                       | 378416            | 1                    |
| 385                                                     | D72D71111-111B | .TRIM-RTNR, FLOOR PAN<br>SUPPLIER CODE:<br>VS5825                                                                       | 378416            | 1                    |
| 390                                                     | D72D71112-911B | .TRIM-INSERT, FLOOR PAN<br>SUPPLIER CODE:<br>VS5825                                                                     | 378416            | 1                    |
| 395                                                     | D72D71112-912B | .TRIM-INSERT, FLOOR PAN<br>SUPPLIER CODE:<br>VS5825                                                                     | 378416            | 1                    |
| 400                                                     | D72D71112-913B | .TRIM-INSERT, FLOOR PAN<br>SUPPLIER CODE:<br>VS5825                                                                     | 378416            | 1                    |
| 405                                                     | D72D70301-911  | .SEAL-RTNR<br>SUPPLIER CODE:<br>VS5825                                                                                  | 378416            | 1                    |
| 410                                                     | D72D70301-913  | .SEAL-RTNR<br>SUPPLIER CODE:<br>VS5825                                                                                  | 378416            | 1                    |
| 415                                                     | D72D70301-915  | .SEAL-RTNR<br>SUPPLIER CODE:<br>VS5825                                                                                  | 378416            | 1                    |
| 420                                                     | D72D70795-111  | .BLANKET-FIRE<br>SUPPLIER CODE:<br>VS5825                                                                               | 378416            | 1                    |
| 425                                                     | NAS1801-3-4    | ATTACHING PARTS<br>.SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-4                                                      | 378416            | 10                   |
| 430                                                     | NAS1801-3-8    | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-8                                                                         | 378416            | 5                    |
| 435                                                     | NAS1149D0332K  | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0332J                                                                      | 378416            | 15                   |
| 440                                                     | D72D72683-111  | -----*-----<br>.SCREW-TAMPER PROOF<br>SUPPLIER CODE:<br>VS5825<br>CONFIG CHG DATA FROM A CMM:<br>SUPSD BY D72D72683-913 | 378416            | 2                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |                                                                                                                         |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R

25-40-14-10A

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

25-40-14  
 FIG. 10A  
 PAGE 7  
 APR 15/23


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER                    | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                                                                                                                                                           | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|--------------------------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 10A<br>440                                              | D72D72683-913                  | .SCREW-TAMPER PROOF<br>SUPPLIER CODE:<br>VS5825<br>CONFIG CHG DATA FROM A CMM:<br>SUPERSEDES D72D72683-111                                                                                                                                           | 378416            | 2                    |
| 445<br>450                                              | NAS1149C0332R<br>D72W16510-111 | .WASHER<br>.DISPENSER ASSY-<br>SUPPLIER CODE:<br>VS5825<br>MISCELLANEOUS DATA:<br>NON PROCURABLE<br>FOR DETAILS SEE:<br>25-41-51-50L                                                                                                                 | 378416<br>378416  | 2<br>RF              |
| 455                                                     | D72W17505-111                  | .DISPENSER ASSY-<br>SUPPLIER CODE:<br>VS5825<br>MISCELLANEOUS DATA:<br>NON PROCURABLE<br>FUNCTIONAL REFERENCE:<br>EQUIPMENT/FURNISHINGS<br>FOR DETAILS SEE<br>25-41-51-50M<br>FIRE PROTECTION<br>FOR DETAILS SEE<br>26-24-01-50                      | 378416            | RF                   |
| 460                                                     | D72W26510-111                  | .PLUMBING ASSY-<br>SUPPLIER CODE:<br>VS5825<br>MISCELLANEOUS DATA:<br>NON PROCURABLE<br>FUNCTIONAL REFERENCE:<br>AIR CONDITIONING<br>FOR DETAILS SEE<br>21-24-51-50M<br>WATER/WASTE<br>FOR DETAILS SEE<br>38-11-05-50<br>38-11-51-50<br>38-13-01-50L | 378416            | RF                   |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                                |                                                                                                                                                                                                                                                      |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R

25-40-14-10A

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

25-40-14  
 FIG. 10A  
 PAGE 8  
 OCT 15/24


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                                                                                                                                                                                                                                                                                                       | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 10A<br>465                                              | D72W27594-111  | .ELECTRICAL ASSY-<br>SUPPLIER CODE:<br>VS5825<br>MISCELLANEOUS DATA:<br>NON PROCURABLE<br>FUNCTIONAL REFERENCE:<br>COMMUNICATIONS<br>FOR DETAILS SEE<br>23-31-05-50<br>EQUIPMENT/FURNISHINGS<br>FOR DETAILS SEE<br>25-41-60-50<br>FIRE PROTECTION<br>FOR DETAILS SEE<br>26-14-01-50<br>LIGHTS<br>FOR DETAILS SEE<br>33-26-03-55A<br>33-27-51-50<br>WATER/WASTE<br>FOR DETAILS SEE<br>38-32-04-50 | 378416            | RF                   |
| 470                                                     | D72D80006-111B | .MAT-FLOOR<br>SUPPLIER CODE:<br>VS5825                                                                                                                                                                                                                                                                                                                                                           | 378416            | 1                    |
| 475                                                     | D72W12512-111  | .OUTWALL ASSY-<br>SUPPLIER CODE:<br>VS5825<br>MISCELLANEOUS DATA:<br>NON PROCURABLE<br>FOR DETAILS SEE:<br>25-41-40-50                                                                                                                                                                                                                                                                           | 378416            | RF                   |
| 480                                                     | D72W59250-111A | .SINK ASSY-DECK<br>SUPPLIER CODE:<br>VS5825                                                                                                                                                                                                                                                                                                                                                      | 378416            | 1                    |
| 482                                                     | D72D70001-112  | ..BOWL-<br>SUPPLIER CODE:<br>VS5825                                                                                                                                                                                                                                                                                                                                                              | 378416            | 1                    |
| 485                                                     | D72D41509-111  | .PANEL-FLOOR<br>SUPPLIER CODE:<br>VS5825                                                                                                                                                                                                                                                                                                                                                         | 378416            | 1                    |
| 490                                                     | D72D46505-111  | .PANEL-OUTBD, UPR<br>SUPPLIER CODE:<br>VS5825                                                                                                                                                                                                                                                                                                                                                    | 378416            | 1                    |
| 495                                                     | D72D46004-111  | .PANEL-OUTBD, LWR<br>SUPPLIER CODE:<br>VS5825                                                                                                                                                                                                                                                                                                                                                    | 378416            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |                                                                                                                                                                                                                                                                                                                                                                                                  |                   |                      |

— ITEM NOT ILLUSTRATED

RYR

25-40-14-10A

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-14  
 FIG. 10A  
 PAGE 9  
 OCT 15/24


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER     | 1 2 3 4 5 6 7 NOMENCLATURE                                                                              | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|-----------------|---------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 10A<br>500                                              | D72W52674-111AE | .PANEL-SIDE WALL<br>SUPPLIER CODE:<br>VS5825                                                            | 378416            | 1                    |
| 502                                                     | D72D72685-111   | ..TUBE FRAME ASSY-<br>SUPPLIER CODE:<br>VS5825<br>MISCELLANEOUS DATA:<br>NO DECORATIVE LAMINATE<br>PART | 378416            | 1                    |
| 505                                                     | D72W53515-111V  | .PANEL-SINK WALL<br>SUPPLIER CODE:<br>VS5825                                                            | 378416            | 1                    |
| 510                                                     | D72W54514-111B  | .PANEL-DOOR WALL<br>SUPPLIER CODE:<br>VS5825                                                            | 378416            | 1                    |
| 515                                                     | D72W55531-111A  | .PANEL-CLG<br>SUPPLIER CODE:<br>VS5825                                                                  | 378416            | 1                    |
| 520                                                     | D72W56500-111A  | .PANEL ASSY-LINING<br>SUPPLIER CODE:<br>VS5825                                                          | 378416            | 1                    |
| 523                                                     | 4A114-0016-1    | ..BUMPER-<br>SUPPLIER CODE:<br>VS5825                                                                   | 378416            | 2                    |
| 525                                                     | D72W57009-111B  | .PANEL-HEADER,BIFOLD<br>SUPPLIER CODE:<br>VS5825                                                        | 378416            | 1                    |
| 530                                                     | D72W59259-111A  | .PANEL-DISP CABINET<br>SUPPLIER CODE:<br>VS5825                                                         | 378416            | 1                    |
| 535                                                     | D72D70699-111B  | .PAN ASSY-FLOOR<br>SUPPLIER CODE:<br>VS5825<br>ATTACHING PARTS                                          | 378416            | 1                    |
| 540                                                     | NAS514P1032-6P  | .SCREW<br>-----*-----                                                                                   | 378416            | 4                    |
| 545                                                     | D72D70438-111B  | .COVER-FLOOR PAN<br>SUPPLIER CODE:<br>VS5825<br>ATTACHING PARTS                                         | 378416            | 1                    |
| 550                                                     | NAS1801-08-7    | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN08-7                                                        | 378416            | 2                    |
| 555                                                     | NAS1149DN816K   | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149DN816J<br>-----*-----                                       | 378416            | 2                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                 |                                                                                                         |                   |                      |

— ITEM NOT ILLUSTRATED


R Y R

25-40-14-10A

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-14  
FIG. 10A  
PAGE 10  
OCT 15/24

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

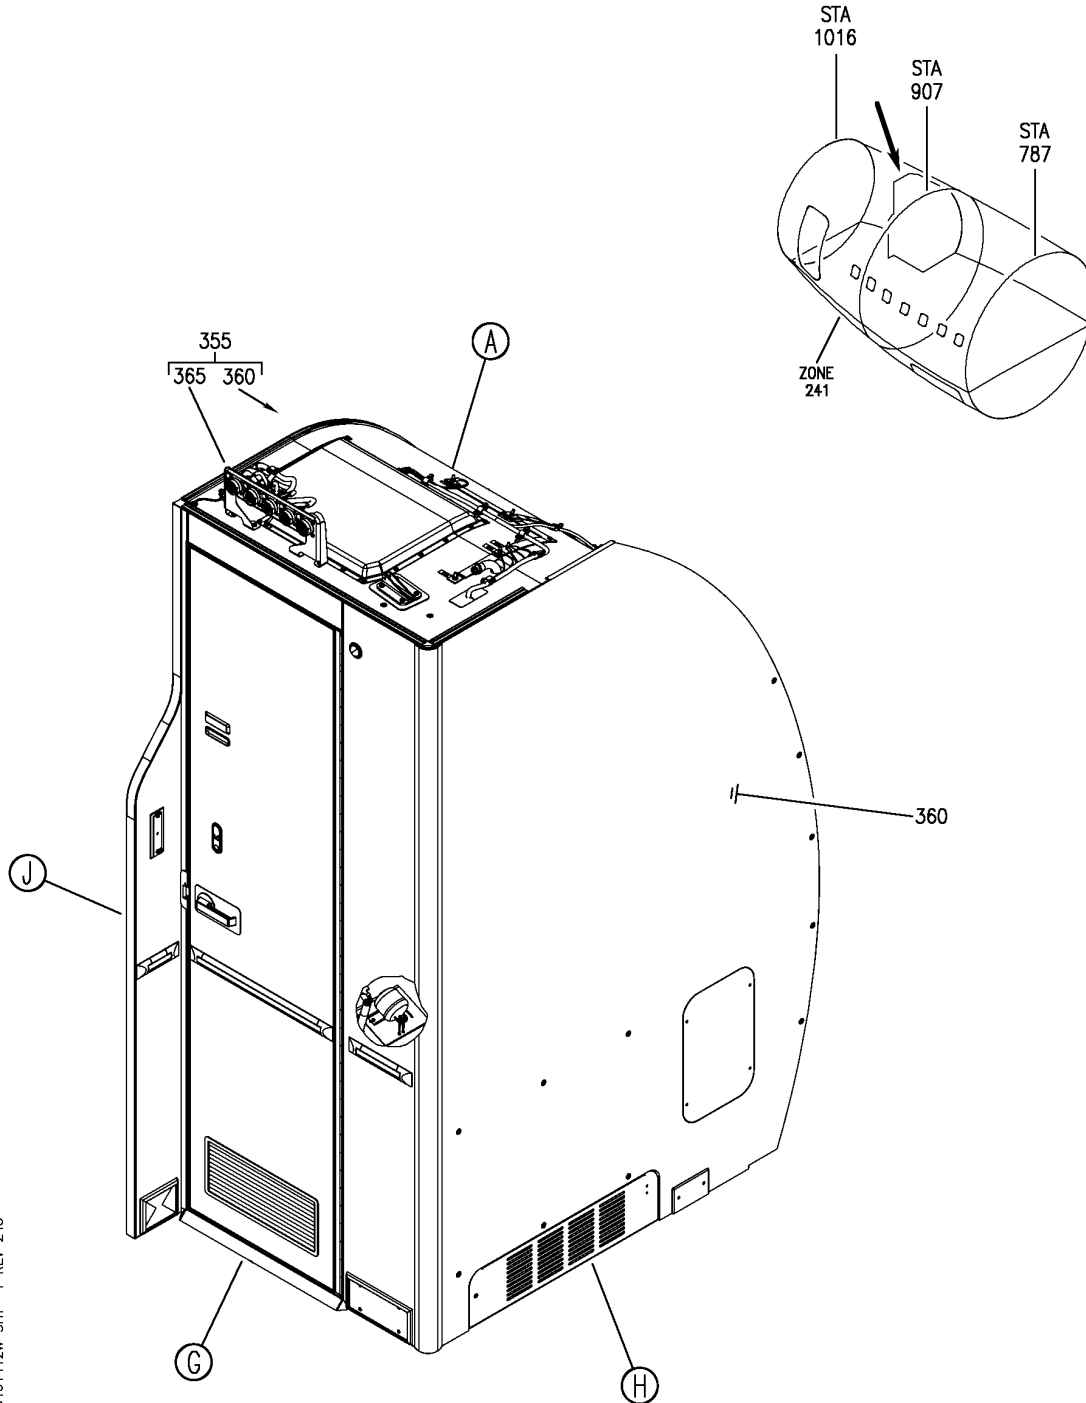

E 25401412W SHT 1 REV 243

MODULE ASSY-LAV D (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 12W (SHEET 1)


**25-40-14-12W**

RJR  
AUG 15/19

25-40-14-12W  
PAGE 0

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

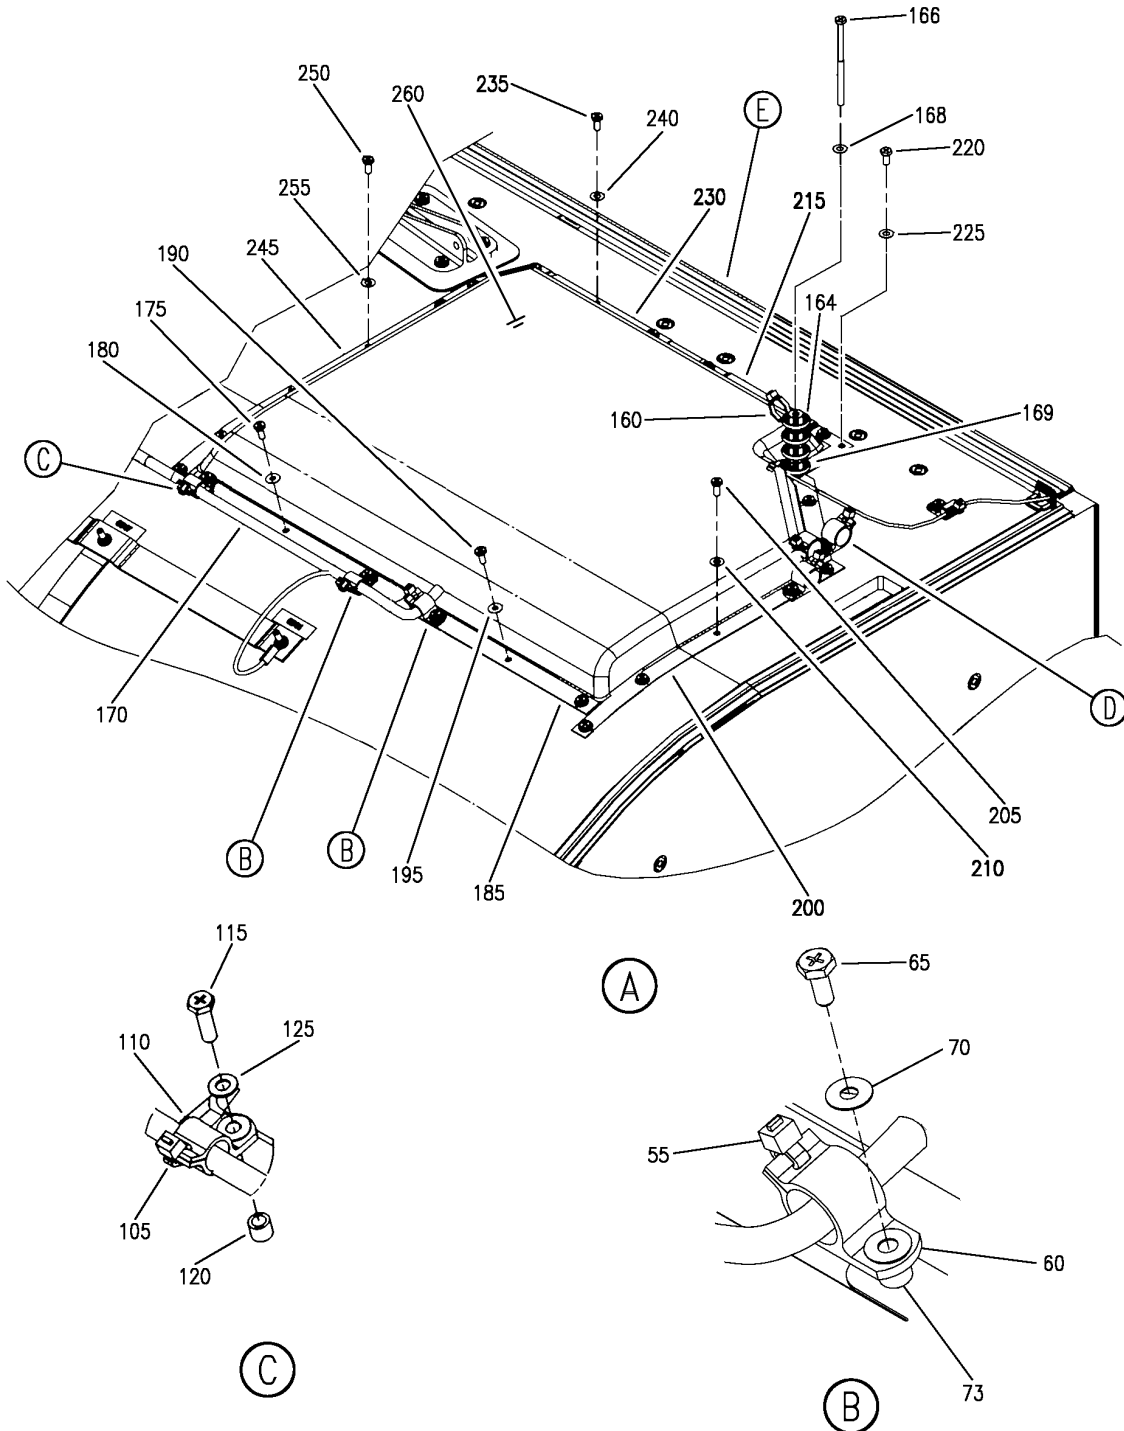

E 25401412W SHT 2 REV 259

MODULE ASSY-LAV D (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 12W (SHEET 2)


**25-40-14-12W**

R Y R  
AUG 15/19

25-40-14-12W  
PAGE 0A

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

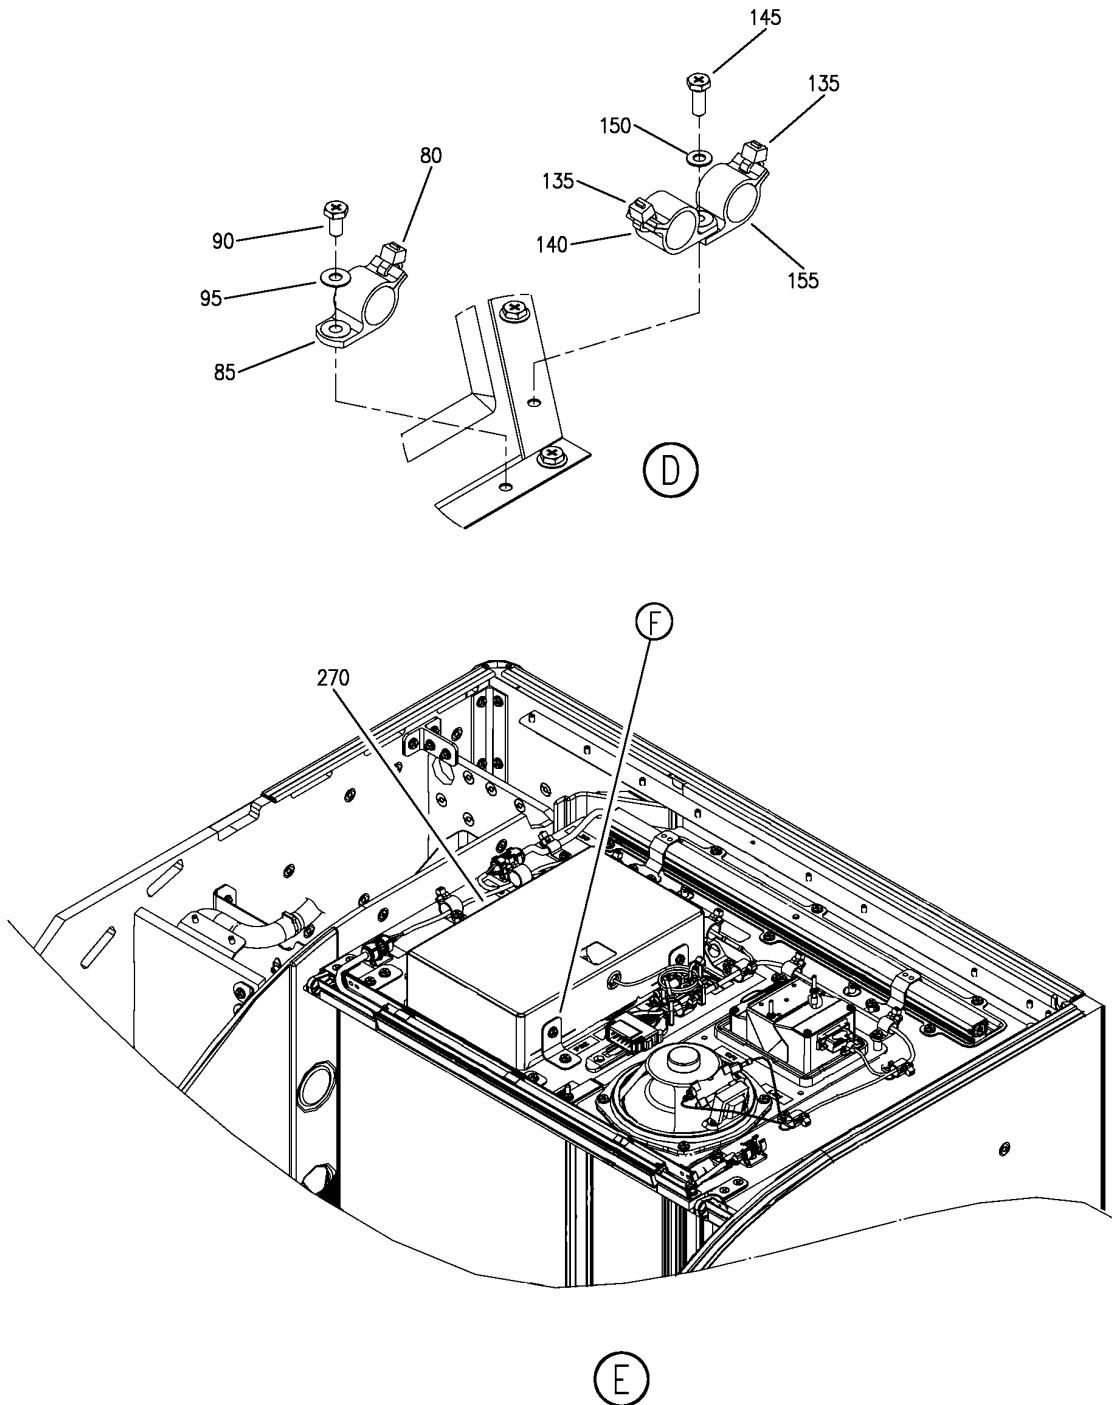

E 25401412W SHT 3 REV 243

MODULE ASSY-LAV D (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 12W (SHEET 3)


**25-40-14-12W**

R Y R  
AUG 15/19


25-40-14-12W  
PAGE 08

ECCN 9E991 BOEING PROPRIETARY – See title page for details.


**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

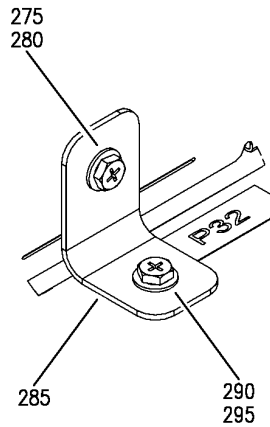

(F)

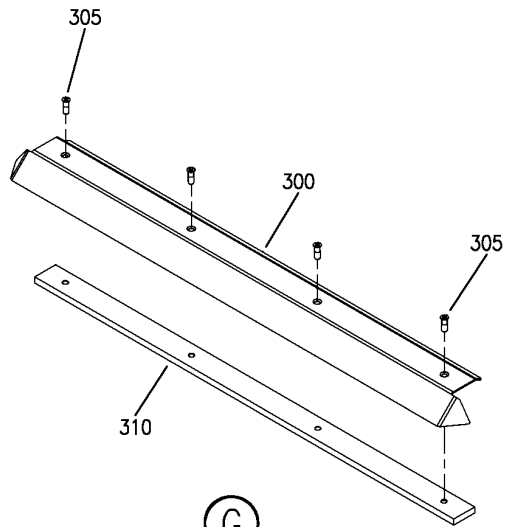

(G)

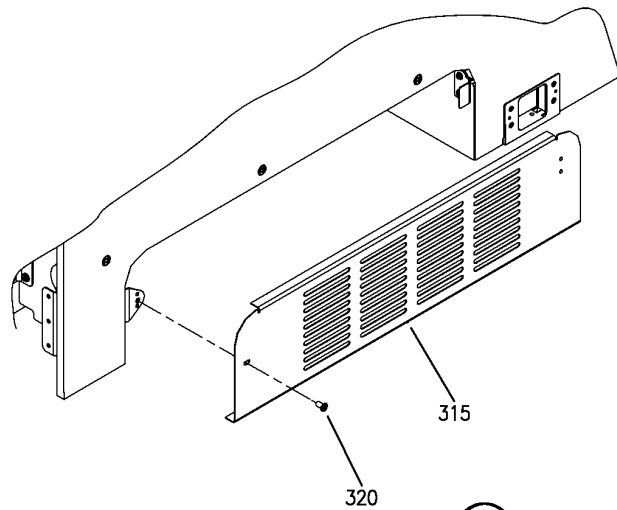

(H)

E 25401412W SHT 4 REV 243

MODULE ASSY-LAV D (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 12W (SHEET 4)

**25-40-14-12W**



ECCN 9E991 BOEING PROPRIETARY - See title page for details.

R Y R  
AUG 15 / 19

25-40-14-12W  
PAGE 0C



**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

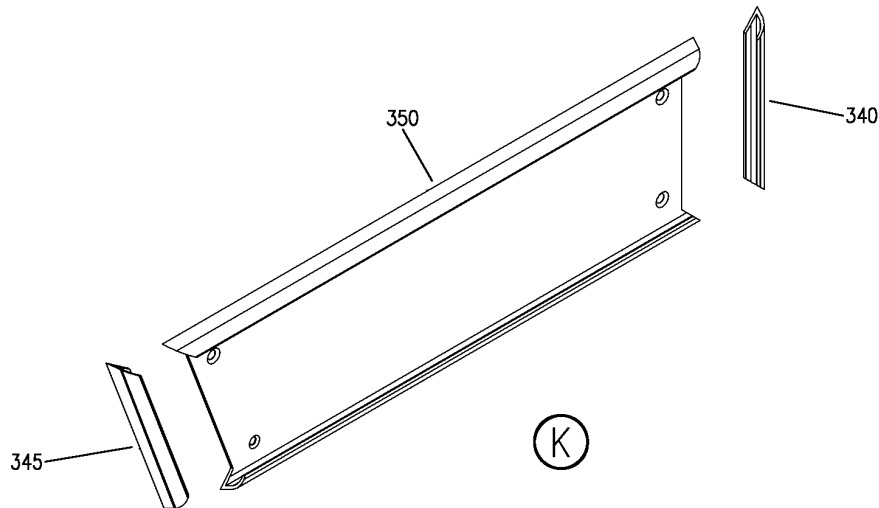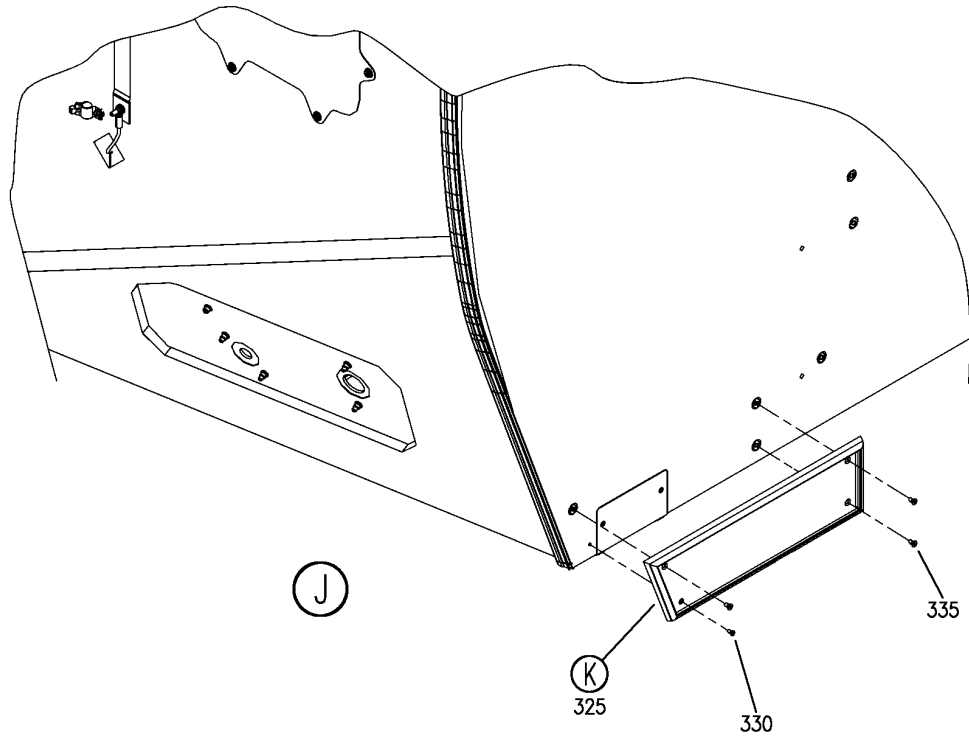

E 25401412W SHT 5 REV 243

MODULE ASSY-LAV D (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 12W (SHEET 5)

**25-40-14-12W**

R Y R  
AUG 15/19

25-40-14-12W  
PAGE 0D

ECCN 9E991 BOEING PROPRIETARY – See title page for details.


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7<br>NOMENCLATURE                                                                                                                                                                                                                                                                           | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 12W                                                     |                | MODULE ASSY-LAV D<br>(EQUIPMENT/FURNISHINGS<br>ONLY)                                                                                                                                                                                                                                                    | 417437            |                      |
| - 1                                                     | 1L300040-0743A | MODULE ASSY-LAV D<br>(EQUIPMENT/FURNISHINGS<br>ONLY)<br>SUPPLIER CODE:<br>V6S8D7<br>FUNCTIONAL DESCRIPTION:<br>PROVIDES LAVATORY<br>FACILITIES FOR<br>PASSENGERS AND CREW<br>ELECTRICAL EQUIP NUMBER:<br>M01418<br>COMPONENT MAINT MANUAL REF:<br>25-40-42<br>FOR NHA/OTHER SYS DET SEE:<br>25-40-14-01 | 417437            | RF                   |
| - 50                                                    | 9L500001-102   | .CLAMP INSTL-ELECTRICAL<br>SUPPLIER CODE:<br>V6S8D7<br>CONFIG CHG DATA FROM A CMM:<br>SUPSD BY 9L500001-107                                                                                                                                                                                             | 417437            | 2                    |
| - 50                                                    | 9L500001-107   | .CLAMP INSTL-ELECTRICAL<br>SUPPLIER CODE:<br>V6S8D7<br>CONFIG CHG DATA FROM A CMM:<br>SUPERSEDES 9L500001-102                                                                                                                                                                                           | 417437            | 2                    |
| 55                                                      | MS3367-5-9     | ..STRAP<br>STANDARD SUBSTITUTION:<br>BACS38K5                                                                                                                                                                                                                                                           | 417437            | 1                    |
| 60                                                      | CA2030-2       | ..CLAMP-<br>SUPPLIER CODE:<br>V03296<br>CONFIG CHG DATA FROM A CMM:<br>SUPSD BY CA2030-3                                                                                                                                                                                                                | 417437            | 1                    |
| 60                                                      | CA2030-3       | ..CLAMP-<br>SUPPLIER CODE:<br>V03296<br>CONFIG CHG DATA FROM A CMM:<br>SUPERSEDES CA2030-2                                                                                                                                                                                                              | 417437            | 1                    |
| 65                                                      | NAS1801-3-6    | ATTACHING PARTS<br>..SCREW-<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6<br>CONFIG CHG DATA FROM A CMM:<br>SUPSD BY NAS1801-3-10                                                                                                                                                                            | 417437            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |                                                                                                                                                                                                                                                                                                         |                   |                      |

- ITEM NOT ILLUSTRATED

RYR

25-40-14-12W

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-14  
 FIG. 12W  
 PAGE 1  
 APR 15/23


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER   | 1 2 3 4 5 6 7 | NOMENCLATURE                                                                                              | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|---------------|---------------|-----------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 12W<br>65                                               | NAS1801-3-10  | ..            | SCREW-<br>STANDARD SUBSTITUTION:<br>BACS12HN3-10<br>CONFIG CHG DATA FROM A CMM:<br>SUPERSEDES NAS1801-3-6 | 417437            | 1                    |
| 70                                                      | NAS1149D0316K | ..            | WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J                                                         | 417437            | 1                    |
| 73                                                      | NAS43DD3-16N  | ..            | SPACER-<br>STANDARD SUBSTITUTION:<br>NAS43DD3-16FC<br>USED ON:<br>9L500001-107<br>-----*-----             | 417437            | 1                    |
| - 75                                                    | 9L500001-103  | .CLAMP        | INSTL-ELECTRICAL<br>SUPPLIER CODE:<br>V6S8D7                                                              | 417437            | 1                    |
| 80                                                      | MS3367-5-9    | ..            | STRAP<br>STANDARD SUBSTITUTION:<br>BACS38K5                                                               | 417437            | 1                    |
| 85                                                      | CA2030-3      | ..            | CLAMP-<br>SUPPLIER CODE:<br>V03296<br>ATTACHING PARTS                                                     | 417437            | 1                    |
| 90                                                      | NAS1801-3-6   | ..            | SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                                                            | 417437            | 1                    |
| 95                                                      | NAS1149D0316K | ..            | WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J<br>-----*-----                                          | 417437            | 1                    |
| - 100                                                   | 9L500001-106  | .CLAMP        | INSTL-ELECTRICAL<br>SUPPLIER CODE:<br>V6S8D7<br>CONFIG CHG DATA FROM A CMM:<br>SUPSD BY 9L500001-107      | 417437            | 1                    |
| - 100                                                   | 9L500001-107  | .CLAMP        | INSTL-ELECTRICAL<br>SUPPLIER CODE:<br>V6S8D7<br>CONFIG CHG DATA FROM A CMM:<br>SUPERSEDES 9L500001-106    | 417437            | 1                    |
| 105                                                     | MS3367-5-9    | ..            | STRAP<br>STANDARD SUBSTITUTION:<br>BACS38K5                                                               | 417437            | 1                    |
| 110                                                     | CA2030-2      | ..            | CLAMP-<br>SUPPLIER CODE:<br>V03296<br>CONFIG CHG DATA FROM A CMM:<br>SUPSD BY CA2030-3                    | 417437            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |               |               |                                                                                                           |                   |                      |

- ITEM NOT ILLUSTRATED

R Y R

25-40-14-12W

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-14  
FIG. 12W  
PAGE 2  
APR 15/23


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER   | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                    | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|---------------|---------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 12W<br>110                                              | CA2030-3      | ..CLAMP-<br>SUPPLIER CODE:<br>V03296<br>CONFIG CHG DATA FROM A CMM:<br>SUPERSEDES CA2030-2<br>ATTACHING PARTS | 417437            | 1                    |
| 115                                                     | NAS1801-3-10  | ..SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-10                                                             | 417437            | 1                    |
| 120                                                     | NAS43DD3-16N  | ..SPACER<br>STANDARD SUBSTITUTION:<br>NAS43DD3-16FC                                                           | 417437            | 1                    |
| 125                                                     | NAS1149D0316K | ..WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J<br>-----*-----                                            | 417437            | 1                    |
| - 130                                                   | 9L500001-150  | .CLAMP INSTL-ELECTRICAL<br>SUPPLIER CODE:<br>V6S8D7                                                           | 417437            | 1                    |
| 135                                                     | MS3367-5-9    | ..STRAP<br>STANDARD SUBSTITUTION:<br>BACS38K5                                                                 | 417437            | 2                    |
| 140                                                     | CA2030-3      | ..CLAMP-<br>SUPPLIER CODE:<br>V03296<br>ATTACHING PARTS                                                       | 417437            | 1                    |
| 145                                                     | NAS1801-3-9   | ..SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-9                                                              | 417437            | 1                    |
| 150                                                     | NAS1149D0316K | ..WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J<br>-----*-----                                            | 417437            | 1                    |
| 155                                                     | CA2030-3      | ..CLAMP-<br>SUPPLIER CODE:<br>V03296                                                                          | 417437            | 1                    |
| 160                                                     | MS3367-5-9    | .STRAP<br>STANDARD SUBSTITUTION:<br>BACS38K5                                                                  | 417437            | 2                    |
| - 162                                                   | 9L500001-407  | .RINGPOST INSTL-ELECTRICAL<br>SUPPLIER CODE:<br>V6S8D7                                                        | 417437            | 1                    |
| 164                                                     | BACS31H1A     | ..SUPPORT<br>ATTACHING PARTS                                                                                  | 417437            | 1                    |
| 166                                                     | NAS1801-3-52  | ..SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-52                                                             | 417437            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |               |                                                                                                               |                   |                      |

- ITEM NOT ILLUSTRATED

R Y R

25-40-14-12W

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-14  
 FIG. 12W  
 PAGE 3  
 APR 15/23


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER   | 1 2 3 4 5 6 7                                                      | NOMENCLATURE                                                     | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|---------------|--------------------------------------------------------------------|------------------------------------------------------------------|-------------------|----------------------|
| 12W<br>168                                              | NAS1149D0316K | ..                                                                 | WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J<br>-----*----- | 417437            | 1                    |
| 169                                                     | BACS31H1A     | ..                                                                 | SUPPORT                                                          | 417437            | 3                    |
| 170                                                     | 1L500409-741  | .STRAP-FIRE BLANKET<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS |                                                                  | 417437            | 1                    |
| 175                                                     | NAS1801-3-6   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                    |                                                                  | 417437            | 1                    |
| 180                                                     | NAS1149D0316K | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J<br>-----*-----  |                                                                  | 417437            | 1                    |
| 185                                                     | 1L500409-743  | .STRAP-FIRE BLANKET<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS |                                                                  | 417437            | 1                    |
| 190                                                     | NAS1801-3-6   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                    |                                                                  | 417437            | 2                    |
| 195                                                     | NAS1149D0316K | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J<br>-----*-----  |                                                                  | 417437            | 2                    |
| 200                                                     | 1L500409-767  | .STRAP-FIRE BLANKET<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS |                                                                  | 417437            | 1                    |
| 205                                                     | NAS1801-3-6   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                    |                                                                  | 417437            | 4                    |
| 210                                                     | NAS1149D0316K | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J<br>-----*-----  |                                                                  | 417437            | 4                    |
| 215                                                     | 1L500409-765  | .STRAP-FIRE BLANKET<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS |                                                                  | 417437            | 1                    |
| 220                                                     | NAS1801-3-6   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                    |                                                                  | 417437            | 4                    |
| 225                                                     | NAS1149D0316K | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J<br>-----*-----  |                                                                  | 417437            | 4                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |               |                                                                    |                                                                  |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R

25-40-14-12W

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-14  
FIG. 12W  
PAGE 4  
APR 15/23


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER   | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                                                                                                                                                                                                                           | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|---------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 12W<br>230                                              | 1L500409-763  | .STRAP-FIRE BLANKET<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                                                                                                                                                                                                                                                   | 417437            | 1                    |
| 235                                                     | NAS1801-3-6   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                                                                                                                                                                                                                                                                      | 417437            | 2                    |
| 240                                                     | NAS1149D0316K | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J<br>-----*-----                                                                                                                                                                                                                                                    | 417437            | 2                    |
| 245                                                     | 1L500409-745  | .STRAP-FIRE BLANKET<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                                                                                                                                                                                                                                                   | 417437            | 1                    |
| 250                                                     | NAS1801-3-6   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                                                                                                                                                                                                                                                                      | 417437            | 7                    |
| 255                                                     | NAS1149D0316K | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J<br>-----*-----                                                                                                                                                                                                                                                    | 417437            | 7                    |
| 260                                                     | 1L500409-769  | .BLANKET-FIRE<br>SUPPLIER CODE:<br>V6S8D7                                                                                                                                                                                                                                                                            | 417437            | 1                    |
| - 265                                                   | MS3367-5-9    | .STRAP<br>STANDARD SUBSTITUTION:<br>BACS38K5                                                                                                                                                                                                                                                                         | 417437            | AR                   |
| 270                                                     | 4576001-101   | .BOX ASSY-OXY<br>SUPPLIER CODE:<br>V16827<br>FUNCTIONAL DESCRIPTION:<br>STORES OXYGEN AND MASK<br>ASSEMBLIES. CONTROLS THE<br>DELIVERY OF OXYGEN TO<br>EACH MASK AND<br>COMMUNICATES WITH THE<br>AIRPLANE NETWORK.<br>COMPONENT MAINT MANUAL REF:<br>25-23-68<br>FOR DETAILS SEE:<br>35-21-00-01A<br>ATTACHING PARTS | 417437            | 1                    |
| 275                                                     | NAS1801-3-6   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                                                                                                                                                                                                                                                                      | 417437            | 4                    |
| 280                                                     | NAS1149D0332J | .WASHER<br>-----*-----                                                                                                                                                                                                                                                                                               | 417437            | 4                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |               |                                                                                                                                                                                                                                                                                                                      |                   |                      |

- ITEM NOT ILLUSTRATED

R Y R

25-40-14-12W

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-14  
FIG. 12W  
PAGE 5  
APR 15/23


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7<br>NOMENCLATURE                                    | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|------------------------------------------------------------------|-------------------|----------------------|
| 12W<br>285                                              | 4L500403-17    | .ANGLE-<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS           | 417437            | 4                    |
| 290                                                     | NAS1801-3-6    | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                  | 417437            | 4                    |
| 295                                                     | NAS1149D0332J  | .WASHER<br>-----*-----                                           | 417437            | 4                    |
| 300                                                     | 1L500105-15    | .THRESHOLD-<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS       | 417437            | 1                    |
| 305                                                     | NAS8703A4      | .BOLT<br>STANDARD SUBSTITUTION:<br>BACB30ZE3K4<br>-----*-----    | 417437            | 4                    |
| 310                                                     | 1L500109-147   | .SPACER-THRESHOLD<br>SUPPLIER CODE:<br>V6S8D7                    | 417437            | 1                    |
| 315                                                     | 1L400040-41    | .COVER-TRASH TRAP<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS | 417437            | 1                    |
| 320                                                     | NAS8303-7      | .SCREW<br>-----*-----                                            | 417437            | 1                    |
| 325                                                     | 1L400109-403BA | .KICKSTRIP ASSY-<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS  | 417437            | 1                    |
| 330                                                     | NAS514P632-5   | .SCREW                                                           | 417437            | 1                    |
| 335                                                     | NAS514P832-5   | .SCREW<br>-----*-----                                            | 417437            | 3                    |
| 340                                                     | 1L500109-463BA | ..ENDCAP-<br>SUPPLIER CODE:<br>V6S8D7                            | 417437            | 1                    |
| 345                                                     | 1L500109-471BA | ..ENDCAP-<br>SUPPLIER CODE:<br>V6S8D7                            | 417437            | 1                    |
| 350                                                     | 1L500109-473BA | ..RETAINER-<br>SUPPLIER CODE:<br>V6S8D7                          | 417437            | 1                    |
| 355                                                     | 1L360041-0743A | .MODULE ASSY-<br>SUPPLIER CODE:<br>V6S8D7                        | 417437            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |                                                                  |                   |                      |

— ITEM NOT ILLUSTRATED

RYR

25-40-14-12W

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

25-40-14  
FIG. 12W  
PAGE 6  
APR 15/23


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 | NOMENCLATURE                                                                                                                                                                                                                      | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|---------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 12W<br>360                                              | 1L306041-151CH | ..            | STRUCTURE ASSY-<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-40-14-50H                                                                                                                                                   | 417437            | 1                    |
| 365                                                     | 3L306040-101   | ..            | ELECTRICAL INSTL-<br>SUPPLIER CODE:<br>V6S8D7<br>FUNCTIONAL REFERENCE:<br>EQUIPMENT/FURNISHINGS<br>FOR DETAILS SEE<br>25-41-60-05N<br>LIGHTS<br>FOR DETAILS SEE<br>33-27-51-18L<br>WATER/WASTE<br>FOR DETAILS SEE<br>38-32-04-06D | 417437            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |               |                                                                                                                                                                                                                                   |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R


25-40-14-12W

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

25-40-14  
 FIG. 12W  
 PAGE 7  
 FEB 15/18



**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

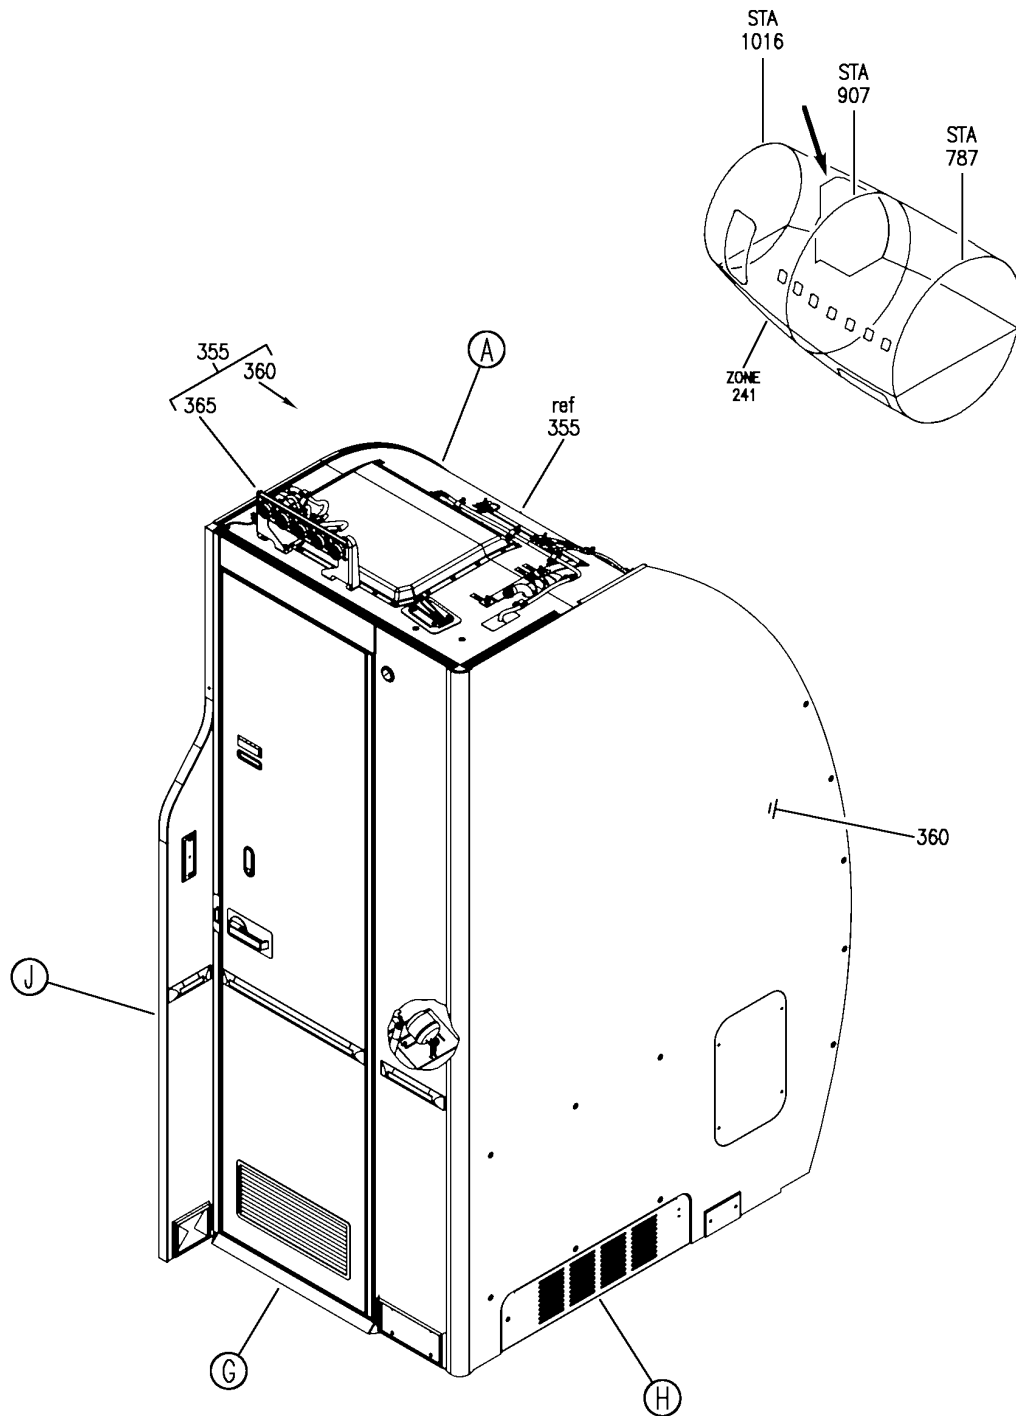

E 25401413P SHT 1 REV 259

MODULE ASSY-LAV D (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 13P (SHEET 1)


**25-40-14-13P**

R Y R  
F E B 15 / 18

25-40-14-13P  
PAGE 0

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

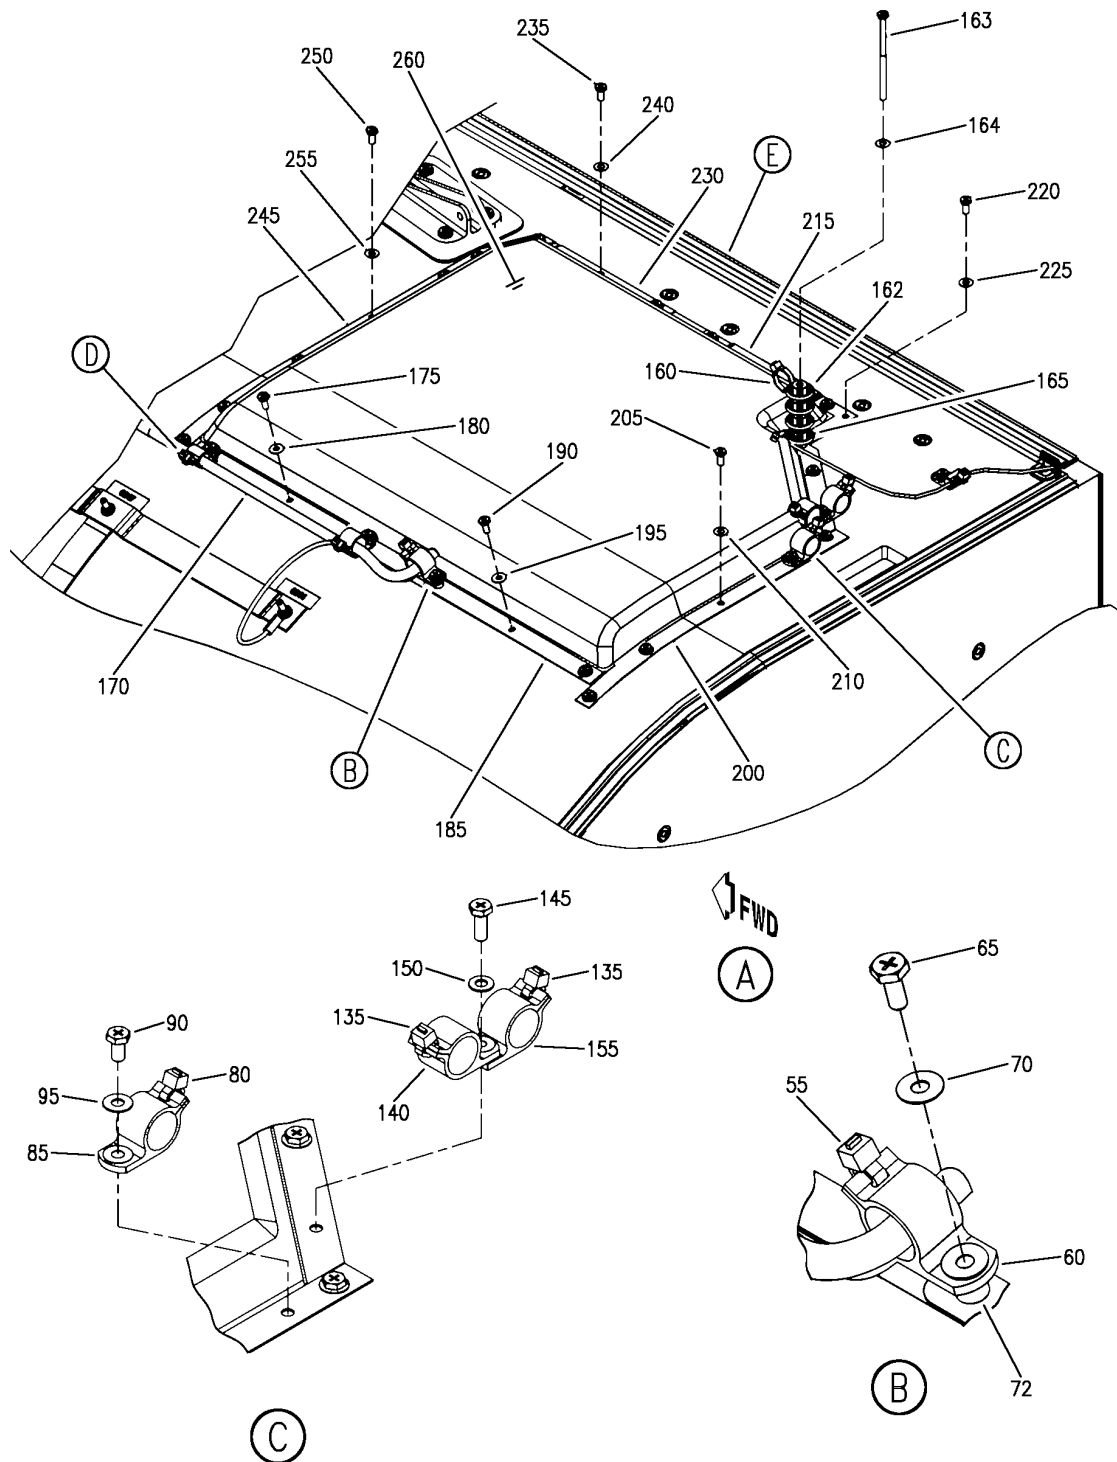

E 25401413P SHT 2 REV 259

MODULE ASSY-LAV D (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 13P (SHEET 2)


**25-40-14-13P**

R Y R  
F E B 15 / 18

25-40-14-13P  
PAGE 0A

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

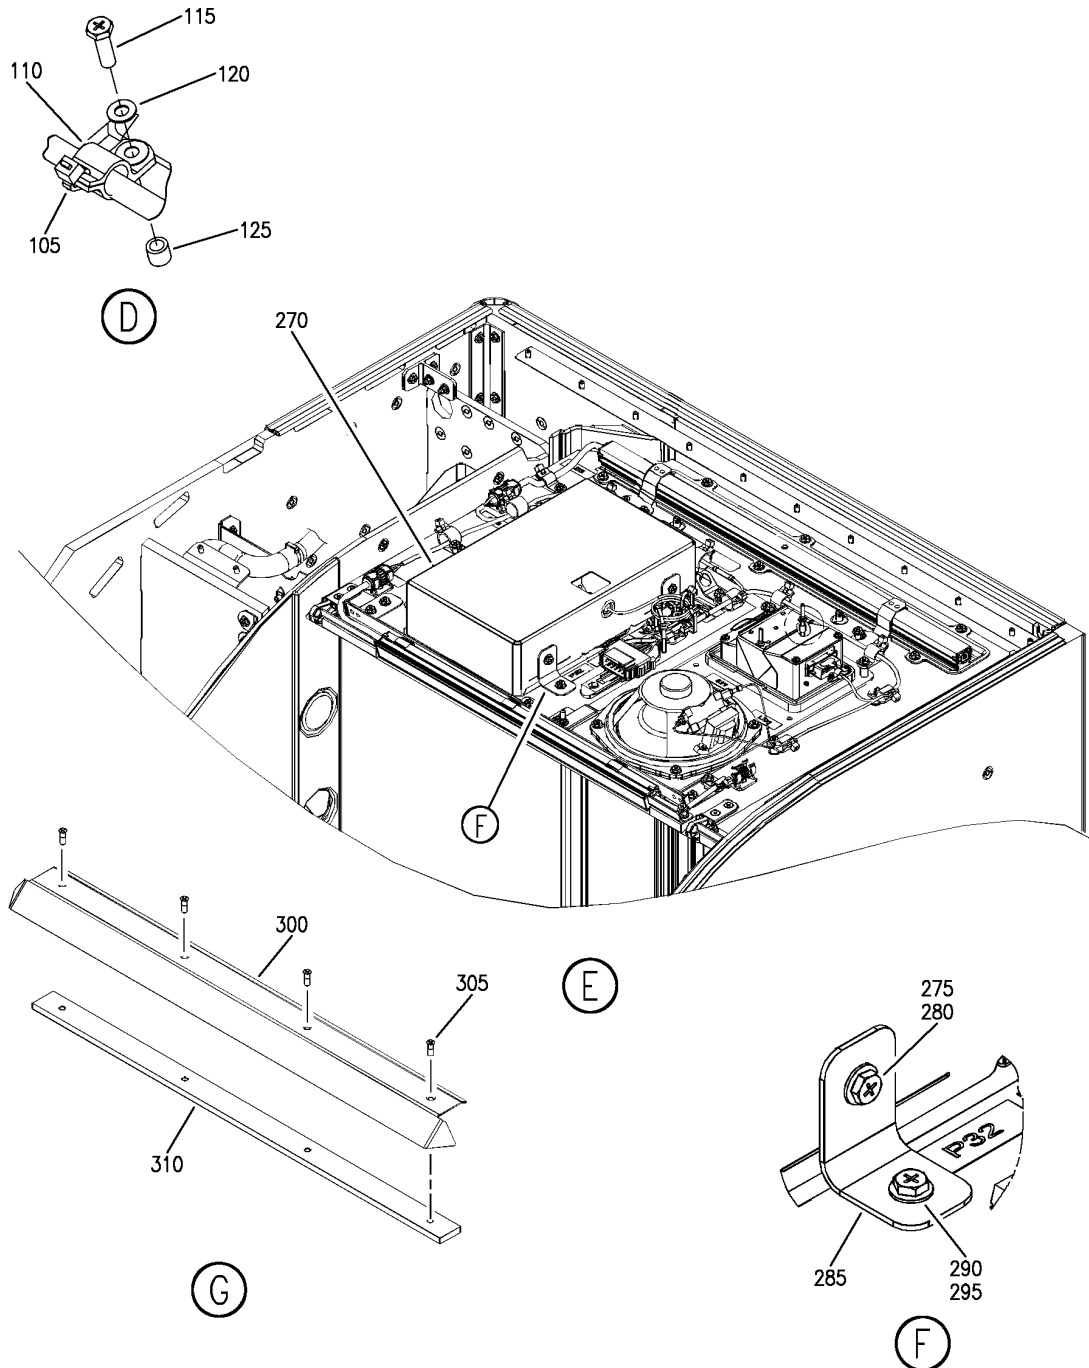

E 25401413P SHT 3 REV 259

MODULE ASSY-LAV D (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 13P (SHEET 3)


**25-40-14-13P**

R Y R  
F E B 15 / 18

25-40-14-13P  
PAGE 0B

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

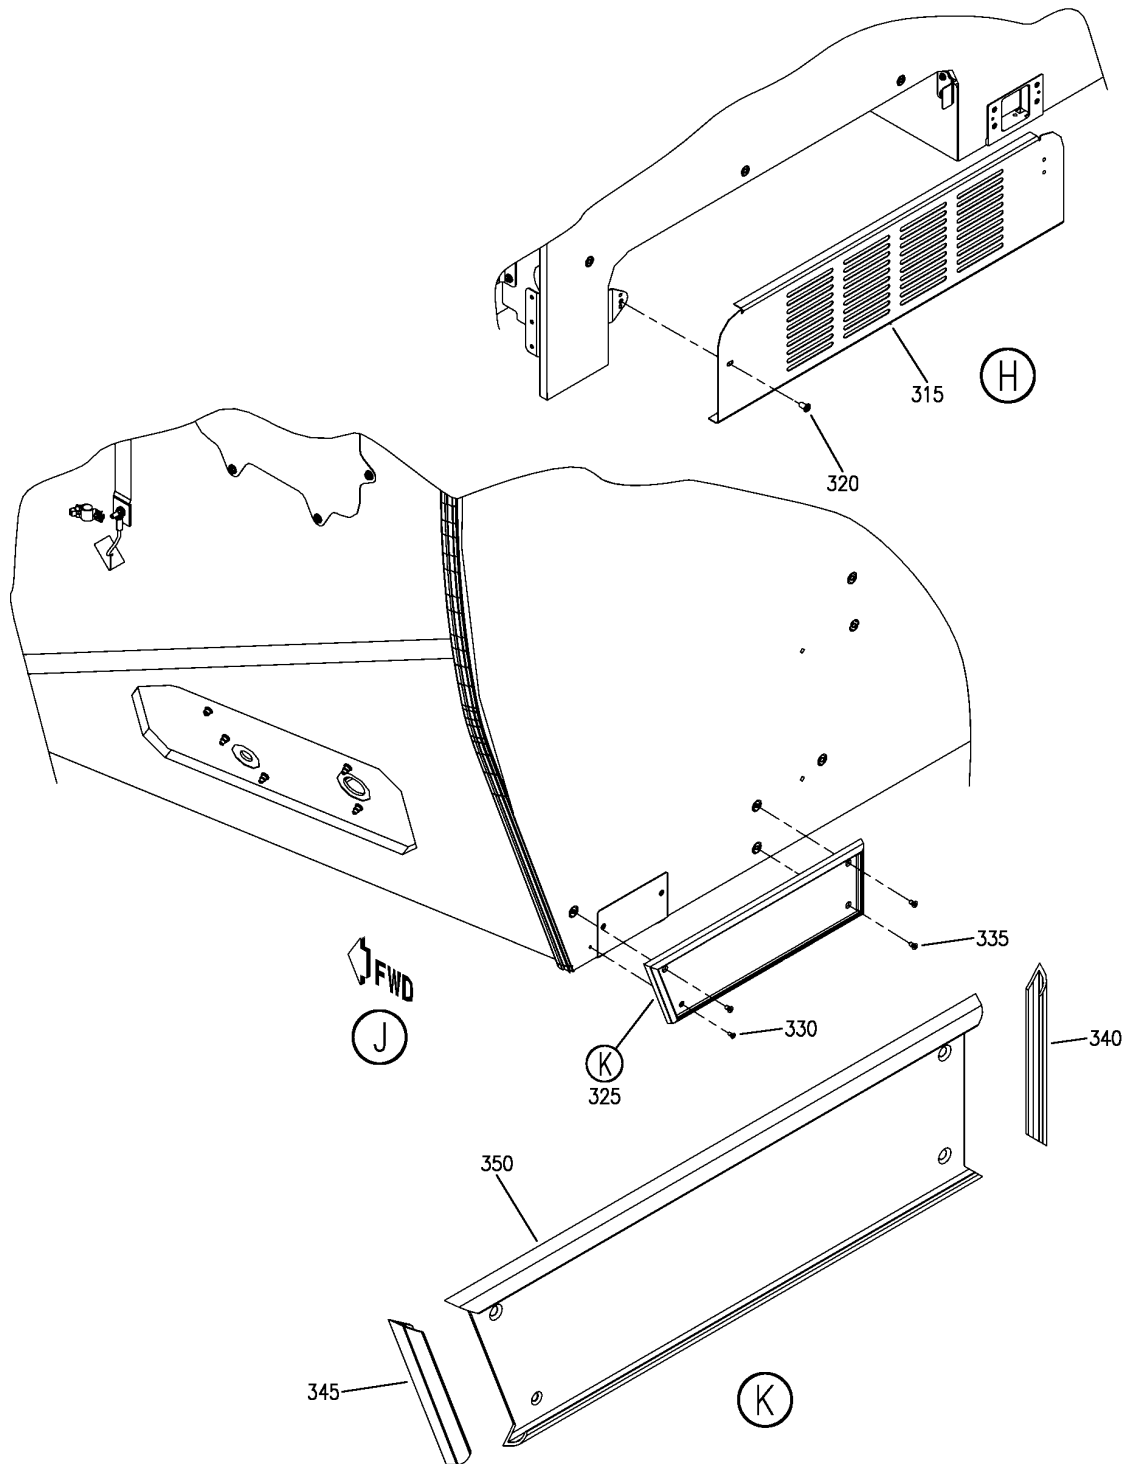

E 25401413P SHT 4 REV 259

MODULE ASSY-LAV D (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 13P (SHEET 4)

**25-40-14-13P**

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

R Y R  
F E B 15 / 18

25-40-14-13P  
PAGE 0C


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7<br>NOMENCLATURE                                                                                                                                                                                                                                                                            | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 13P                                                     |                | MODULE ASSY-LAV D<br>(EQUIPMENT/FURNISHINGS<br>ONLY)                                                                                                                                                                                                                                                     | 438459            |                      |
| - 1                                                     | 1L300040-0743B | MODULE ASSY-LAV D<br>(EQUIPMENT/ FURNISHINGS<br>ONLY)<br>SUPPLIER CODE:<br>V6S8D7<br>FUNCTIONAL DESCRIPTION:<br>PROVIDES LAVATORY<br>FACILITIES FOR<br>PASSENGERS AND CREW<br>ELECTRICAL EQUIP NUMBER:<br>M01418<br>COMPONENT MAINT MANUAL REF:<br>25-40-42<br>FOR NHA/OTHER SYS DET SEE:<br>25-40-14-01 | 438459            | RF                   |
| - 50                                                    | 9L500001-102   | .CLAMP INSTL-ELECTRICAL<br>SUPPLIER CODE:<br>V6S8D7<br>CONFIG CHG DATA FROM A CMM:<br>SUPSD BY 9L500001-107                                                                                                                                                                                              | 438459            | 2                    |
| - 50                                                    | 9L500001-107   | .CLAMP INSTL-ELECTRICAL<br>SUPPLIER CODE:<br>V6S8D7<br>CONFIG CHG DATA FROM A CMM:<br>SUPERSEDES 9L500001-102                                                                                                                                                                                            | 438459            | 2                    |
| 55                                                      | MS3367-5-9     | ..STRAP<br>STANDARD SUBSTITUTION:<br>BACS38K5                                                                                                                                                                                                                                                            | 438459            | 1                    |
| 60                                                      | CA2030-2       | ..CLAMP-<br>SUPPLIER CODE:<br>V03296<br>CONFIG CHG DATA FROM A CMM:<br>SUPSD BY CA2030-3                                                                                                                                                                                                                 | 438459            | 1                    |
| 60                                                      | CA2030-3       | ..CLAMP-<br>SUPPLIER CODE:<br>V03296<br>CONFIG CHG DATA FROM A CMM:<br>SUPERSEDES CA2030-2                                                                                                                                                                                                               | 438459            | 1                    |
| 65                                                      | NAS1801-3-6    | ATTACHING PARTS<br>..SCREW-<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6<br>CONFIG CHG DATA FROM A CMM:<br>SUPSD BY NAS1801-3-10                                                                                                                                                                             | 438459            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |                                                                                                                                                                                                                                                                                                          |                   |                      |

- ITEM NOT ILLUSTRATED

RYR

25-40-14-13P

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-14  
 FIG. 13P  
 PAGE 1  
 APR 15/23


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER   | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                    | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|---------------|---------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 13P<br>65                                               | NAS1801-3-10  | ..SCREW-<br>STANDARD SUBSTITUTION:<br>BACS12HN3-10<br>CONFIG CHG DATA FROM A CMM:<br>SUPERSEDES NAS1801-3-6   | 438459            | 1                    |
| 70                                                      | NAS1149D0316K | ..WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J                                                           | 438459            | 1                    |
| 72                                                      | NAS43DD3-16N  | ..SPACER-<br>STANDARD SUBSTITUTION:<br>NAS43DD3-16FC<br>USED ON:<br>9L500001-107<br>-----*-----               | 438459            | 1                    |
| - 75                                                    | 9L500001-103  | .CLAMP INSTL-ELECTRICAL<br>SUPPLIER CODE:<br>V6S8D7                                                           | 438459            | 1                    |
| 80                                                      | MS3367-5-9    | ..STRAP<br>STANDARD SUBSTITUTION:<br>BACS38K5                                                                 | 438459            | 1                    |
| 85                                                      | CA2030-3      | ..CLAMP-<br>SUPPLIER CODE:<br>V03296<br>ATTACHING PARTS                                                       | 438459            | 1                    |
| 90                                                      | NAS1801-3-6   | ..SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                                                              | 438459            | 1                    |
| 95                                                      | NAS1149D0316K | ..WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J<br>-----*-----                                            | 438459            | 1                    |
| - 100                                                   | 9L500001-106  | .CLAMP INSTL-ELECTRICAL<br>SUPPLIER CODE:<br>V6S8D7<br>CONFIG CHG DATA FROM A CMM:<br>SUPSD BY 9L500001-107   | 438459            | 1                    |
| - 100                                                   | 9L500001-107  | .CLAMP INSTL-ELECTRICAL<br>SUPPLIER CODE:<br>V6S8D7<br>CONFIG CHG DATA FROM A CMM:<br>SUPERSEDES 9L500001-106 | 438459            | 1                    |
| 105                                                     | MS3367-5-9    | ..STRAP<br>STANDARD SUBSTITUTION:<br>BACS38K5                                                                 | 438459            | 1                    |
| 110                                                     | CA2030-2      | ..CLAMP-<br>SUPPLIER CODE:<br>V03296<br>CONFIG CHG DATA FROM A CMM:<br>SUPSD BY CA2030-3                      | 438459            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |               |                                                                                                               |                   |                      |

- ITEM NOT ILLUSTRATED

R Y R

25-40-14-13P

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-14  
 FIG. 13P  
 PAGE 2  
 APR 15/23


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER   | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                    | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|---------------|---------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 13P<br>110                                              | CA2030-3      | ..CLAMP-<br>SUPPLIER CODE:<br>V03296<br>CONFIG CHG DATA FROM A CMM:<br>SUPERSEDES CA2030-2<br>ATTACHING PARTS | 438459            | 1                    |
| 115                                                     | NAS1801-3-10  | ..SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-10                                                             | 438459            | 1                    |
| 120                                                     | NAS1149D0316K | ..WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J                                                           | 438459            | 1                    |
| 125                                                     | NAS43DD3-16N  | ..SPACER<br>STANDARD SUBSTITUTION:<br>NAS43DD3-16FC<br>-----*-----                                            | 438459            | 1                    |
| - 130                                                   | 9L500001-150  | .CLAMP INSTL-ELECTRICAL<br>SUPPLIER CODE:<br>V6S8D7                                                           | 438459            | 1                    |
| 135                                                     | MS3367-5-9    | ..STRAP<br>STANDARD SUBSTITUTION:<br>BACS38K5                                                                 | 438459            | 2                    |
| 140                                                     | CA2030-3      | ..CLAMP-<br>SUPPLIER CODE:<br>V03296<br>ATTACHING PARTS                                                       | 438459            | 1                    |
| 145                                                     | NAS1801-3-9   | ..SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-9                                                              | 438459            | 1                    |
| 150                                                     | NAS1149D0316K | ..WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J<br>-----*-----                                            | 438459            | 1                    |
| 155                                                     | CA2030-3      | ..CLAMP-<br>SUPPLIER CODE:<br>V03296                                                                          | 438459            | 1                    |
| 160                                                     | MS3367-5-9    | .STRAP<br>STANDARD SUBSTITUTION:<br>BACS38K5                                                                  | 438459            | 2                    |
| - 161                                                   | 9L500001-407  | .RINGPOST INSTL-ELECTRICAL<br>SUPPLIER CODE:<br>V6S8D7                                                        | 438459            | 1                    |
| 162                                                     | BACS31H1A     | ..SUPPORT<br>ATTACHING PARTS                                                                                  | 438459            | 1                    |
| 163                                                     | NAS1801-3-52  | ..SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-52                                                             | 438459            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |               |                                                                                                               |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R

25-40-14-13P

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-14  
 FIG. 13P  
 PAGE 3  
 APR 15/23


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER   | 1 2 3 4 5 6 7                                                      | NOMENCLATURE                                                     | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|---------------|--------------------------------------------------------------------|------------------------------------------------------------------|-------------------|----------------------|
| 13P<br>164                                              | NAS1149D0316K | ..                                                                 | WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J<br>-----*----- | 438459            | 1                    |
| 165                                                     | BACS31H1A     | ..                                                                 | SUPPORT                                                          | 438459            | 3                    |
| 170                                                     | 1L500409-741  | .STRAP-FIRE BLANKET<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS |                                                                  | 438459            | 1                    |
| 175                                                     | NAS1801-3-6   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                    |                                                                  | 438459            | 1                    |
| 180                                                     | NAS1149D0316K | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J<br>-----*-----  |                                                                  | 438459            | 1                    |
| 185                                                     | 1L500409-743  | .STRAP-FIRE BLANKET<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS |                                                                  | 438459            | 1                    |
| 190                                                     | NAS1801-3-6   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                    |                                                                  | 438459            | 2                    |
| 195                                                     | NAS1149D0316K | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J<br>-----*-----  |                                                                  | 438459            | 2                    |
| 200                                                     | 1L500409-767  | .STRAP-FIRE BLANKET<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS |                                                                  | 438459            | 1                    |
| 205                                                     | NAS1801-3-6   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                    |                                                                  | 438459            | 4                    |
| 210                                                     | NAS1149D0316K | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J<br>-----*-----  |                                                                  | 438459            | 4                    |
| 215                                                     | 1L500409-765  | .STRAP-FIRE BLANKET<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS |                                                                  | 438459            | 1                    |
| 220                                                     | NAS1801-3-6   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                    |                                                                  | 438459            | 4                    |
| 225                                                     | NAS1149D0316K | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J<br>-----*-----  |                                                                  | 438459            | 4                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |               |                                                                    |                                                                  |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R

25-40-14-13P

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-14  
FIG. 13P  
PAGE 4  
APR 15/23




**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER   | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                                                                                                                                                                                                                           | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|---------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 13P<br>230                                              | 1L500409-763  | .STRAP-FIRE BLANKET<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                                                                                                                                                                                                                                                   | 438459            | 1                    |
| 235                                                     | NAS1801-3-6   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                                                                                                                                                                                                                                                                      | 438459            | 2                    |
| 240                                                     | NAS1149D0316K | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J<br>-----*-----                                                                                                                                                                                                                                                    | 438459            | 2                    |
| 245                                                     | 1L500409-745  | .STRAP-FIRE BLANKET<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                                                                                                                                                                                                                                                   | 438459            | 1                    |
| 250                                                     | NAS1801-3-6   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                                                                                                                                                                                                                                                                      | 438459            | 7                    |
| 255                                                     | NAS1149D0316K | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J<br>-----*-----                                                                                                                                                                                                                                                    | 438459            | 7                    |
| 260                                                     | 1L500409-769  | .BLANKET-FIRE<br>SUPPLIER CODE:<br>V6S8D7                                                                                                                                                                                                                                                                            | 438459            | 1                    |
| - 265                                                   | MS3367-5-9    | .STRAP<br>STANDARD SUBSTITUTION:<br>BACS38K5                                                                                                                                                                                                                                                                         | 438459            | AR                   |
| 270                                                     | 4576001-101   | .BOX ASSY-OXY<br>SUPPLIER CODE:<br>V16827<br>FUNCTIONAL DESCRIPTION:<br>STORES OXYGEN AND MASK<br>ASSEMBLIES. CONTROLS THE<br>DELIVERY OF OXYGEN TO<br>EACH MASK AND<br>COMMUNICATES WITH THE<br>AIRPLANE NETWORK.<br>COMPONENT MAINT MANUAL REF:<br>25-23-68<br>FOR DETAILS SEE:<br>35-21-00-01A<br>ATTACHING PARTS | 438459            | 1                    |
| 275                                                     | NAS1801-3-6   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                                                                                                                                                                                                                                                                      | 438459            | 4                    |
| 280                                                     | NAS1149D0332J | .WASHER<br>-----*-----                                                                                                                                                                                                                                                                                               | 438459            | 4                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |               |                                                                                                                                                                                                                                                                                                                      |                   |                      |

- ITEM NOT ILLUSTRATED

R Y R

25-40-14-13P

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-14  
FIG. 13P  
PAGE 5  
APR 15/23


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 | NOMENCLATURE                                                     | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|---------------|------------------------------------------------------------------|-------------------|----------------------|
| 13P<br>285                                              | 4L500403-17    |               | .ANGLE-<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS           | 438459            | 4                    |
| 290                                                     | NAS1801-3-6    |               | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                  | 438459            | 4                    |
| 295                                                     | NAS1149D0332J  |               | .WASHER<br>-----*-----                                           | 438459            | 4                    |
| 300                                                     | 1L500105-15    |               | .THRESHOLD-<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS       | 438459            | 1                    |
| 305                                                     | NAS8703A4      |               | .BOLT<br>STANDARD SUBSTITUTION:<br>BACB30ZE3K4<br>-----*-----    | 438459            | 4                    |
| 310                                                     | 1L500109-147   |               | .SPACER-THRESHOLD<br>SUPPLIER CODE:<br>V6S8D7                    | 438459            | 1                    |
| 315                                                     | 1L400040-41    |               | .COVER-TRASH TRAP<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS | 438459            | 1                    |
| 320                                                     | NAS8303-7      |               | .SCREW<br>-----*-----                                            | 438459            | 1                    |
| 325                                                     | 1L400109-403BA |               | .KICKSTRIP ASSY-<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS  | 438459            | 1                    |
| 330                                                     | NAS514P632-5   |               | .SCREW                                                           | 438459            | 1                    |
| 335                                                     | NAS514P832-5   |               | .SCREW<br>-----*-----                                            | 438459            | 3                    |
| 340                                                     | 1L500109-463BA |               | ..ENDCAP-<br>SUPPLIER CODE:<br>V6S8D7                            | 438459            | 1                    |
| 345                                                     | 1L500109-471BA |               | ..ENDCAP-<br>SUPPLIER CODE:<br>V6S8D7                            | 438459            | 1                    |
| 350                                                     | 1L500109-473BA |               | ..RETAINER-<br>SUPPLIER CODE:<br>V6S8D7                          | 438459            | 1                    |
| 355                                                     | 1L360041-0743B |               | .LAVATORY ASSY-<br>SUPPLIER CODE:<br>V6S8D7                      | 438459            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |               |                                                                  |                   |                      |

— ITEM NOT ILLUSTRATED

RYR

25-40-14-13P

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

25-40-14  
FIG. 13P  
PAGE 6  
APR 15/23


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 | NOMENCLATURE                                                                                                                                                                                                                            | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|---------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 13P<br>360                                              | 1L306041-151EE | ..            | STRUCTURE ASSY-<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-40-14-50H                                                                                                                                                         | 438459            | 1                    |
| 365                                                     | 3L306040-101   | ..            | ELECTRICAL INSTL-STRUCT<br>SUPPLIER CODE:<br>V6S8D7<br>FUNCTIONAL REFERENCE:<br>EQUIPMENT/FURNISHINGS<br>FOR DETAILS SEE<br>25-41-60-05N<br>LIGHTS<br>FOR DETAILS SEE<br>33-27-51-18L<br>WATER/WASTE<br>FOR DETAILS SEE<br>38-32-04-06D | 438459            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |               |                                                                                                                                                                                                                                         |                   |                      |


— ITEM NOT ILLUSTRATED

R Y R

25-40-14-13P

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

25-40-14  
 FIG. 13P  
 PAGE 7  
 AUG 15/19

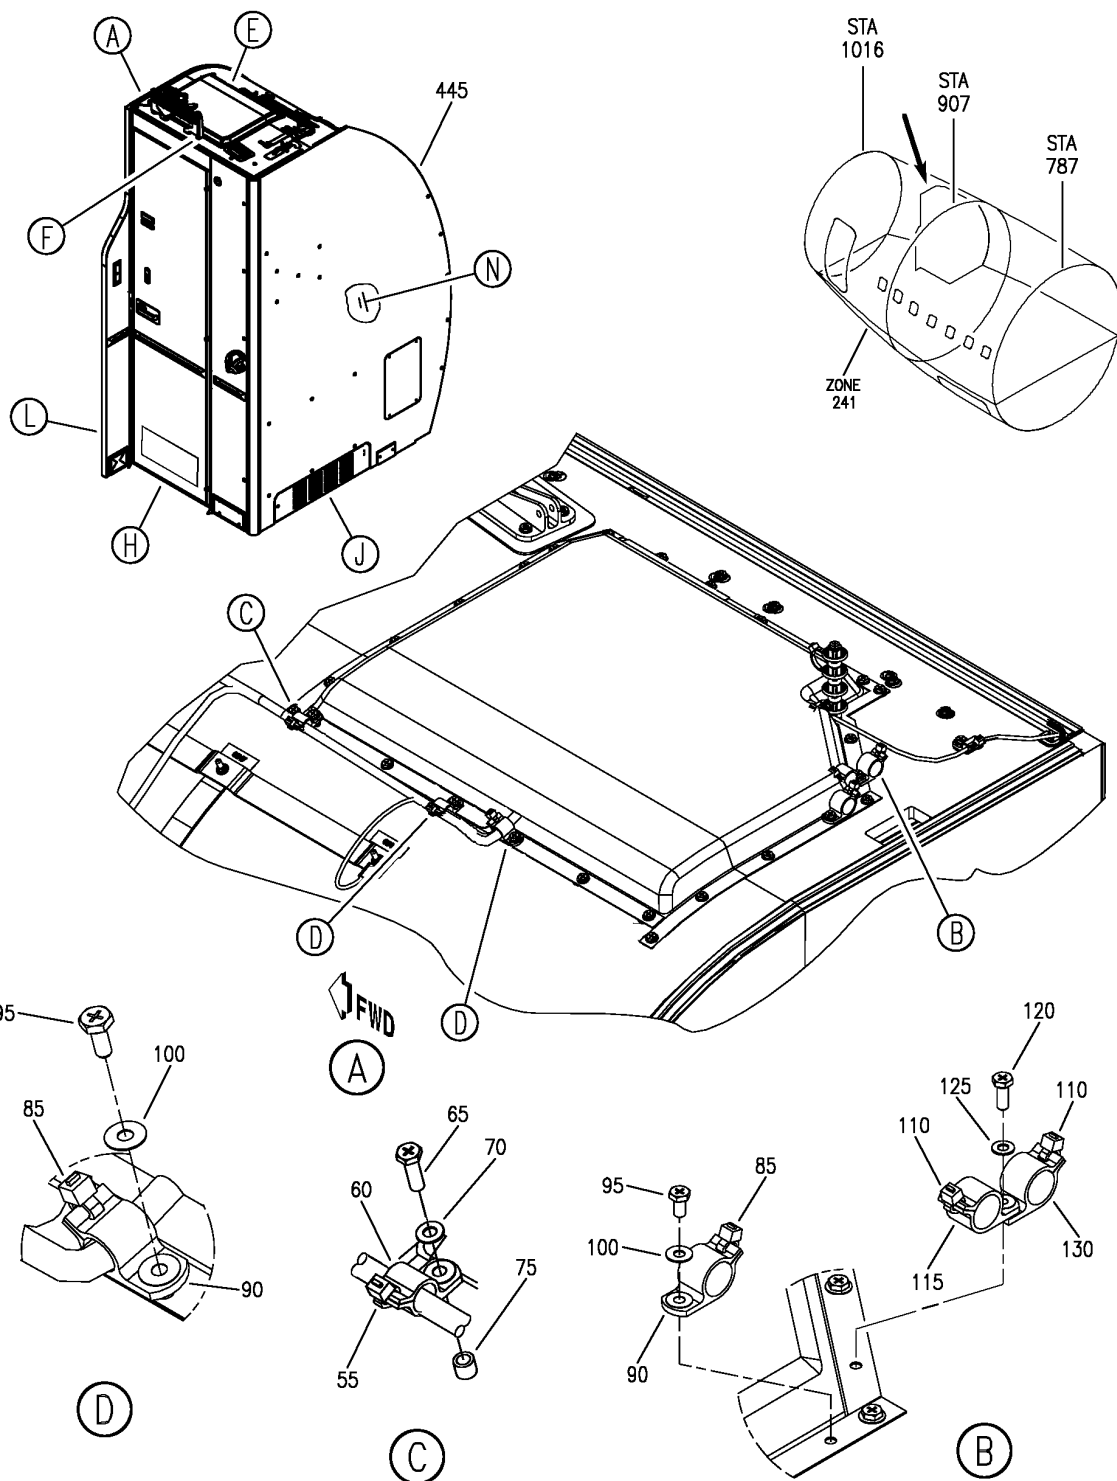

E 25401414D SHT 1 REV 261

MODULE ASSY-LAV D (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 14D (SHEET 1)


25-40-14-14D

R Y R  
AUG 15/19

25-40-14-14D  
PAGE 0

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

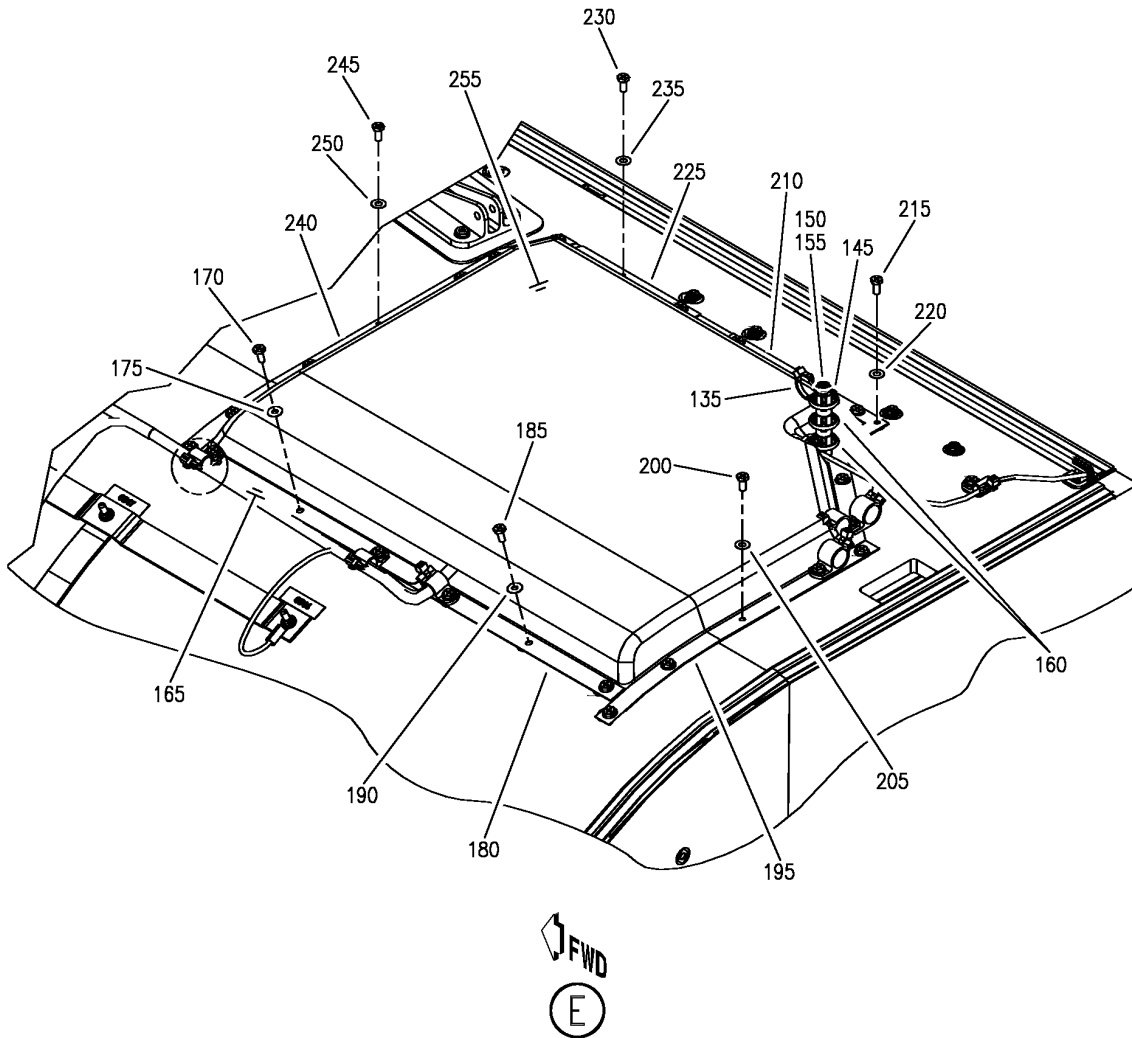

E 25401414D SHT 2 REV 261

MODULE ASSY-LAV D (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 14D (SHEET 2)



**25-40-14-14D**

R Y R  
AUG 15/19

25-40-14-14D  
PAGE 0A

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

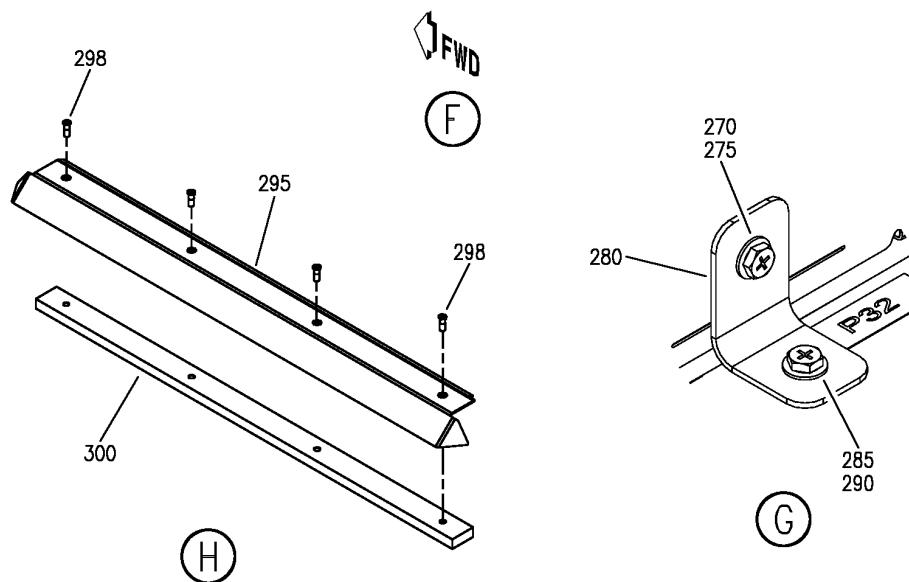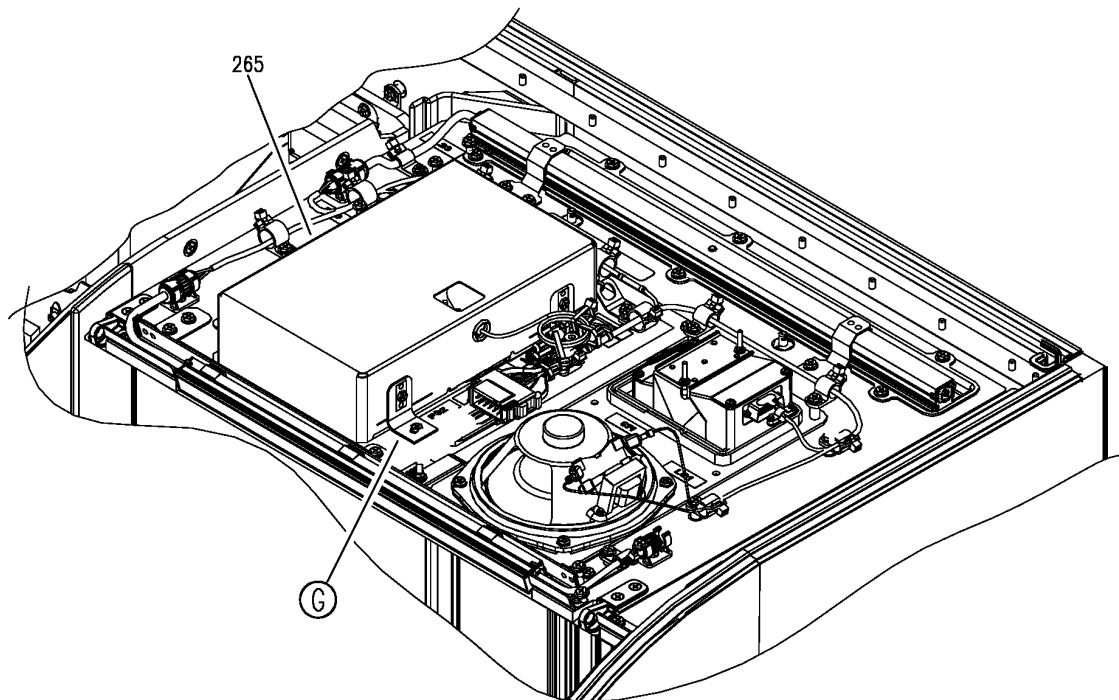

E 25401414D SHT 3 REV 261

MODULE ASSY-LAV D (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 14D (SHEET 3)


**25-40-14-14D**

RYR  
AUG 15/19

25-40-14-14D  
PAGE 0B

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

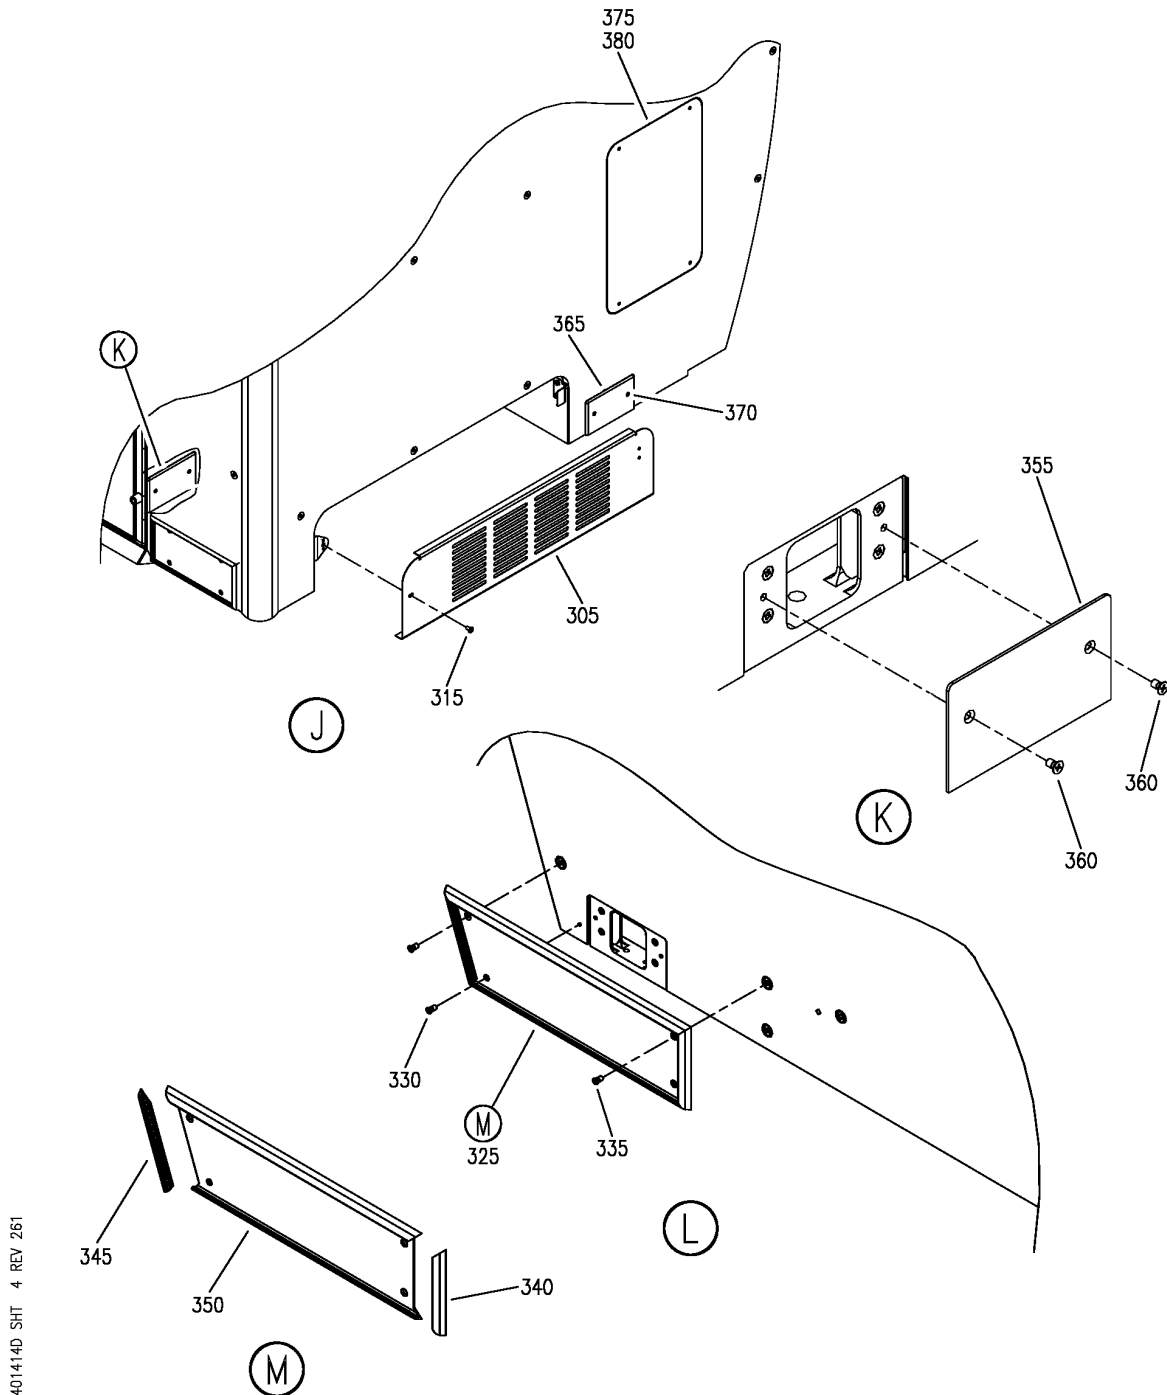

E 25401414D SHT 4 REV 261

MODULE ASSY-LAV D (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 14D (SHEET 4)


**25-40-14-14D**

R/YR  
AUG 15/19

25-40-14-14D  
PAGE 0C

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

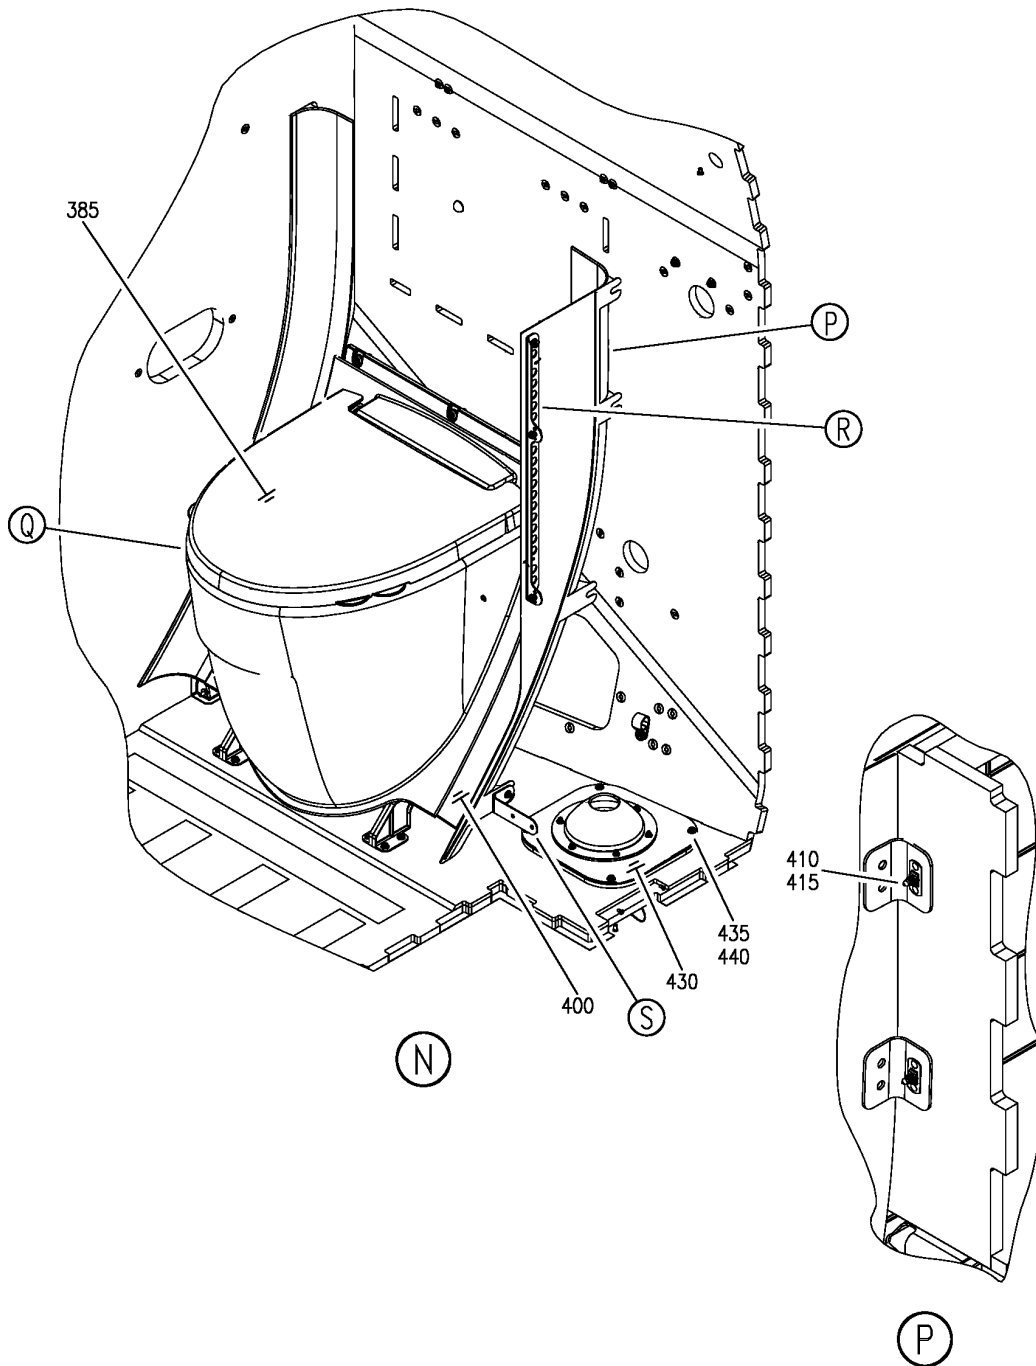

E 25401414D SHT 5 REV 261

MODULE ASSY-LAV D (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 14D (SHEET 5)

**25-40-14-14D**


R Y R  
AUG 15/19

25-40-14-14D  
PAGE 0D

ECCN 9E991 BOEING PROPRIETARY – See title page for details.



**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

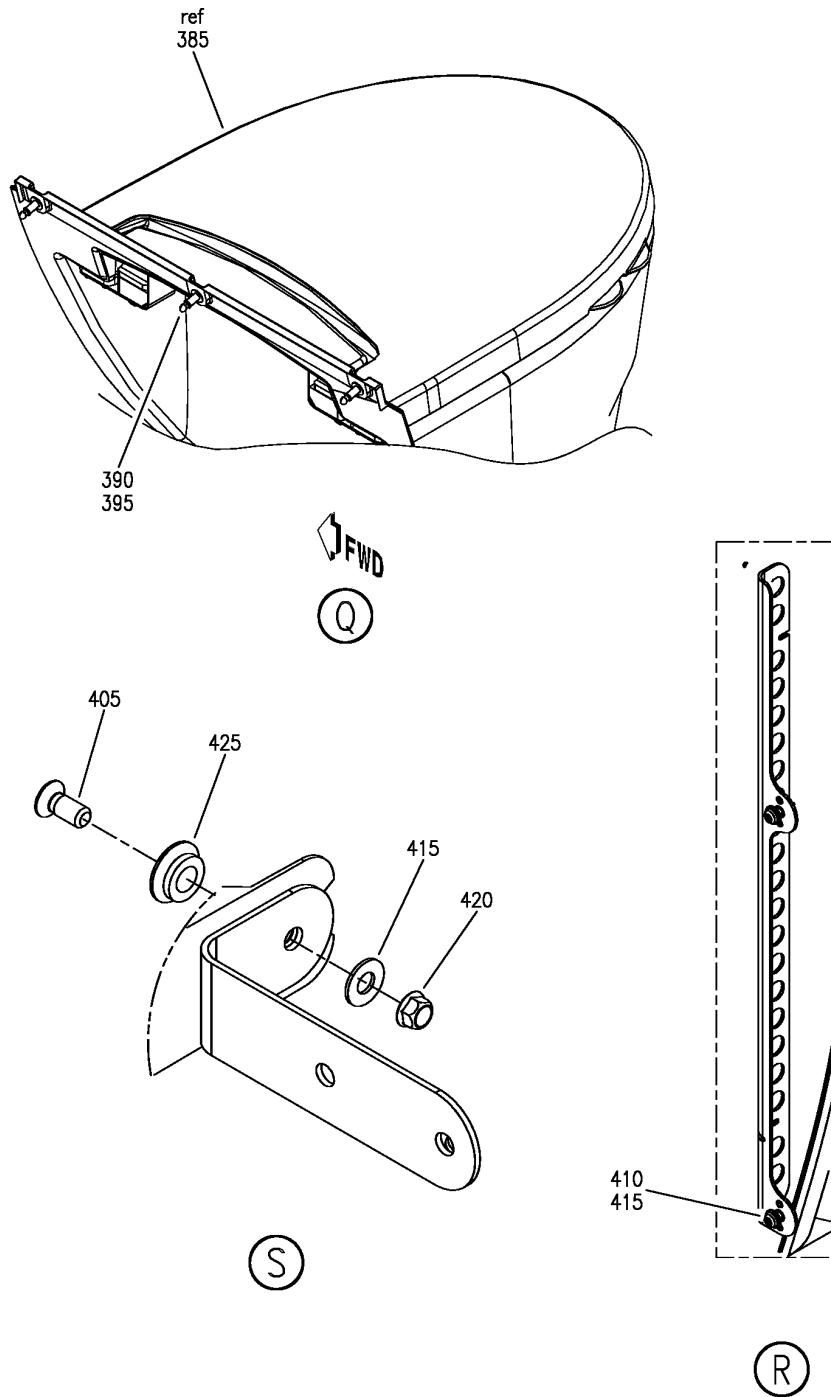

E 25401414D SHT 6 REV 261

MODULE ASSY-LAV D (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 14D (SHEET 6)

**25-40-14-14D**

R Y R  
AUG 15/19

25-40-14-14D  
PAGE 0E

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

 **BOEING**  
737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                                                                                                                                                                                                               | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 14D                                                     |                | MODULE ASSY-LAV D<br>(EQUIPMENT/FURNISHINGS<br>ONLY)                                                                                                                                                                                                                                                     | 509999            |                      |
| - 1                                                     | 1L300040-0897A | MODULE ASSY-LAV D<br>(EQUIPMENT/FURNISHINGS<br>ONLY)<br>SUPPLIER CODE:<br>V6S8D7<br>FUNCTIONAL DESCRIPTION:<br>PROVIDES LAVATORY<br>FACILITIES FOR<br>PASSENGERS AND CREW<br>ELECTRICAL EQUIP NUMBER:<br>M01418<br>COMPONENT MAINT MANUAL REF:<br>25-40-50<br>FOR NHA/OTHER SYS DET SEE:<br>25-40-14-01B | 509999            | RF                   |
| - 50                                                    | 9L500001-107   | .CLAMP INSTL-ELECTRICAL<br>SUPPLIER CODE:<br>V6S8D7                                                                                                                                                                                                                                                      | 509999            | 1                    |
| 55                                                      | MS3367-5-9     | ..STRAP<br>STANDARD SUBSTITUTION:<br>BACS38K5                                                                                                                                                                                                                                                            | 509999            | 1                    |
| 60                                                      | CA2030-3       | ..CLAMP-<br>SUPPLIER CODE:<br>V03296<br>ATTACHING PARTS                                                                                                                                                                                                                                                  | 509999            | 1                    |
| 65                                                      | NAS1801-3-10   | ..SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-10                                                                                                                                                                                                                                                        | 509999            | 1                    |
| 70                                                      | NAS1149D0316K  | ..WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J                                                                                                                                                                                                                                                      | 509999            | 1                    |
| 75                                                      | NAS43DD3-16N   | ..SPACER<br>STANDARD SUBSTITUTION:<br>NAS43DD3-16FC<br>-----*-----                                                                                                                                                                                                                                       | 509999            | 1                    |
| - 80                                                    | 9L500001-103   | .CLAMP INSTL-ELECTRICAL<br>SUPPLIER CODE:<br>V6S8D7                                                                                                                                                                                                                                                      | 509999            | 3                    |
| 85                                                      | MS3367-5-9     | ..STRAP<br>STANDARD SUBSTITUTION:<br>BACS38K5                                                                                                                                                                                                                                                            | 509999            | 1                    |
| 90                                                      | CA2030-3       | ..CLAMP-<br>SUPPLIER CODE:<br>V03296                                                                                                                                                                                                                                                                     | 509999            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |                                                                                                                                                                                                                                                                                                          |                   |                      |

- ITEM NOT ILLUSTRATED

RYR

25-40-14-14D

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-14  
FIG. 14D  
PAGE 1  
APR 15/23


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER   | 1 2 3 4 5 6 7 NOMENCLATURE                                          | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|---------------|---------------------------------------------------------------------|-------------------|----------------------|
| 14D                                                     |               | ATTACHING PARTS                                                     |                   |                      |
| 95                                                      | NAS1801-3-6   | ..SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                    | 509999            | 1                    |
| 100                                                     | NAS1149D0316K | ..WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J<br>-----*-----  | 509999            | 1                    |
| - 105                                                   | 9L500001-150  | .CLAMP INSTL-ELECTRICAL<br>SUPPLIER CODE:<br>V6S8D7                 | 509999            | 1                    |
| 110                                                     | MS3367-5-9    | ..STRAP<br>STANDARD SUBSTITUTION:<br>BACS38K5                       | 509999            | 2                    |
| 115                                                     | CA2030-3      | ..CLAMP-<br>SUPPLIER CODE:<br>V03296                                | 509999            | 1                    |
| 120                                                     | NAS1801-3-9   | ATTACHING PARTS<br>..SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-9 | 509999            | 1                    |
| 125                                                     | NAS1149D0316K | ..WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J<br>-----*-----  | 509999            | 1                    |
| 130                                                     | CA2030-3      | ..CLAMP-<br>SUPPLIER CODE:<br>V03296                                | 509999            | 1                    |
| 135                                                     | MS3367-5-9    | .STRAP<br>STANDARD SUBSTITUTION:<br>BACS38K5                        | 509999            | 2                    |
| - 140                                                   | 9L500001-405  | .RINGPOST INSTL-ELECTRICAL<br>SUPPLIER CODE:<br>V6S8D7              | 509999            | 1                    |
| 145                                                     | BACS31H1A     | ..SUPPORT<br>ATTACHING PARTS                                        | 509999            | 1                    |
| 150                                                     | NAS1801-3-40  | ..SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-40                   | 509999            | 1                    |
| 155                                                     | NAS1149D0316K | ..WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J<br>-----*-----  | 509999            | 1                    |
| 160                                                     | BACS31H1A     | ..SUPPORT                                                           | 509999            | 2                    |
| 165                                                     | 1L500409-741  | .STRAP-FIRE BLANKET<br>SUPPLIER CODE:<br>V6S8D7                     | 509999            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |               |                                                                     |                   |                      |

— ITEM NOT ILLUSTRATED

RYR

25-40-14-14D

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-14  
FIG. 14D  
PAGE 2  
APR 15/23


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER   | 1 2 3 4 5 6 7       | NOMENCLATURE                                             | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|---------------|---------------------|----------------------------------------------------------|-------------------|----------------------|
| 14D                                                     |               |                     |                                                          |                   |                      |
| 170                                                     | NAS1801-3-6   | .SCREW              | ATTACHING PARTS<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6 | 509999            | 1                    |
| 175                                                     | NAS1149D0316K | .WASHER             | STANDARD SUBSTITUTION:<br>NAS1149D0316J<br>-----*-----   | 509999            | 1                    |
| 180                                                     | 1L500409-743  | .STRAP-FIRE BLANKET | SUPPLIER CODE:<br>V6S8D7                                 | 509999            | 1                    |
| 185                                                     | NAS1801-3-6   | .SCREW              | ATTACHING PARTS<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6 | 509999            | 2                    |
| 190                                                     | NAS1149D0316K | .WASHER             | STANDARD SUBSTITUTION:<br>NAS1149D0316J<br>-----*-----   | 509999            | 2                    |
| 195                                                     | 1L500409-767  | .STRAP-FIRE BLANKET | SUPPLIER CODE:<br>V6S8D7                                 | 509999            | 1                    |
| 200                                                     | NAS1801-3-6   | .SCREW              | ATTACHING PARTS<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6 | 509999            | 4                    |
| 205                                                     | NAS1149D0316K | .WASHER             | STANDARD SUBSTITUTION:<br>NAS1149D0316J<br>-----*-----   | 509999            | 4                    |
| 210                                                     | 1L500409-765  | .STRAP-FIRE BLANKET | SUPPLIER CODE:<br>V6S8D7                                 | 509999            | 1                    |
| 215                                                     | NAS1801-3-6   | .SCREW              | ATTACHING PARTS<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6 | 509999            | 4                    |
| 220                                                     | NAS1149D0316K | .WASHER             | STANDARD SUBSTITUTION:<br>NAS1149D0316J<br>-----*-----   | 509999            | 4                    |
| 225                                                     | 1L500409-763  | .STRAP-FIRE BLANKET | SUPPLIER CODE:<br>V6S8D7                                 | 509999            | 1                    |
| 230                                                     | NAS1801-3-6   | .SCREW              | ATTACHING PARTS<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6 | 509999            | 2                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |               |                     |                                                          |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R

25-40-14-14D

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-14  
 FIG. 14D  
 PAGE 3  
 APR 15/23


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER   | 1 2 3 4 5 6 7 | NOMENCLATURE                                                                                                                                                                                                                                                                                                        | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|---------------|---------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 14D<br>235                                              | NAS1149D0316K | .             | WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J<br>-----*-----                                                                                                                                                                                                                                                    | 509999            | 2                    |
| 240                                                     | 1L500409-745  | .             | STRAP-FIRE BLANKET<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                                                                                                                                                                                                                                                   | 509999            | 1                    |
| 245                                                     | NAS1801-3-6   | .             | SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                                                                                                                                                                                                                                                                      | 509999            | 7                    |
| 250                                                     | NAS1149D0316K | .             | WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J<br>-----*-----                                                                                                                                                                                                                                                    | 509999            | 7                    |
| 255                                                     | 1L500409-769  | .             | BLANKET-FIRE<br>SUPPLIER CODE:<br>V6S8D7                                                                                                                                                                                                                                                                            | 509999            | 1                    |
| - 260                                                   | MS3367-5-9    | .             | STRAP<br>STANDARD SUBSTITUTION:<br>BACS38K5                                                                                                                                                                                                                                                                         | 509999            | AR                   |
| 265                                                     | 4576001-101   | .             | BOX ASSY-OXY<br>SUPPLIER CODE:<br>V16827<br>FUNCTIONAL DESCRIPTION:<br>STORES OXYGEN AND MASK<br>ASSEMBLIES. CONTROLS THE<br>DELIVERY OF OXYGEN TO<br>EACH MASK AND<br>COMMUNICATES WITH THE<br>AIRPLANE NETWORK.<br>COMPONENT MAINT MANUAL REF:<br>25-23-68<br>FOR DETAILS SEE:<br>35-21-00-01A<br>ATTACHING PARTS | 509999            | 1                    |
| 270                                                     | NAS1801-3-6   | .             | SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                                                                                                                                                                                                                                                                      | 509999            | 4                    |
| 275                                                     | NAS1149D0332J | .             | WASHER<br>-----*-----                                                                                                                                                                                                                                                                                               | 509999            | 4                    |
| 280                                                     | 4L500403-17   | .             | ANGLE-<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                                                                                                                                                                                                                                                               | 509999            | 4                    |
| 285                                                     | NAS1801-3-6   | .             | SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                                                                                                                                                                                                                                                                      | 509999            | 4                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |               |               |                                                                                                                                                                                                                                                                                                                     |                   |                      |

- ITEM NOT ILLUSTRATED

R Y R

25-40-14-14D

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-14  
 FIG. 14D  
 PAGE 4  
 APR 15/23


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 NOMENCLATURE                                       | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|------------------------------------------------------------------|-------------------|----------------------|
| 14D                                                     |                |                                                                  |                   |                      |
| 290                                                     | NAS1149D0332J  | .WASHER<br>-----*-----                                           | 509999            | 4                    |
| 295                                                     | 1L500105-15    | .THRESHOLD-<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS       | 509999            | 1                    |
| 298                                                     | NAS8703A4      | .BOLT<br>STANDARD SUBSTITUTION:<br>BACB30ZE3K4<br>-----*-----    | 509999            | 4                    |
| 300                                                     | 1L500109-147   | .SPACER-THRESHOLD<br>SUPPLIER CODE:<br>V6S8D7                    | 509999            | 1                    |
| 305                                                     | 1L400040-41    | .COVER-TRASH TRAP<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS | 509999            | 1                    |
| 315                                                     | NAS8303-7      | .SCREW<br>-----*-----                                            | 509999            | 1                    |
| - 320                                                   | 1L400421-111   | ..COVER-<br>SUPPLIER CODE:<br>V6S8D7                             | 509999            | 1                    |
| 325                                                     | 1L400109-403BA | .KICKSTRIP ASSY-<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS  | 509999            | 1                    |
| 330                                                     | NAS514P632-5   | .SCREW                                                           | 509999            | 1                    |
| 335                                                     | NAS514P832-5   | .SCREW<br>-----*-----                                            | 509999            | 3                    |
| 340                                                     | 1L500109-463BA | ..CAP-<br>SUPPLIER CODE:<br>V6S8D7                               | 509999            | 1                    |
| 345                                                     | 1L500109-471BA | ..ENDCAP-<br>SUPPLIER CODE:<br>V6S8D7                            | 509999            | 1                    |
| 350                                                     | 1L500109-473BA | ..RETAINER-<br>SUPPLIER CODE:<br>V6S8D7                          | 509999            | 1                    |
| 355                                                     | 1L500409-263   | .PLATE-COVER<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS      | 509999            | 1                    |
| 360                                                     | NAS514P632-5   | .SCREW<br>-----*-----                                            | 509999            | 2                    |
| 365                                                     | 1L500409-313   | .PLATE-COVER<br>SUPPLIER CODE:<br>V6S8D7                         | 509999            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |                                                                  |                   |                      |

- ITEM NOT ILLUSTRATED

R Y R

25-40-14-14D

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-14  
FIG. 14D  
PAGE 5  
APR 15/23


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER   | 1 2 3 4 5 6 7 NOMENCLATURE                                                                      | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|---------------|-------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 14D                                                     |               |                                                                                                 |                   |                      |
| 370                                                     | NAS514P632-5  | .ATTACHING PARTS<br>.SCREW<br>-----*-----                                                       | 509999            | 2                    |
| 375                                                     | 1L500409-907  | .PANEL-ACCESS<br>SUPPLIER CODE:<br>V6S8D7                                                       | 509999            | 1                    |
| 380                                                     | D4-99-161     | .FASTENER-QUARTER-TURN<br>SUPPLIER CODE:<br>V94222                                              | 509999            | 4                    |
| 385                                                     | 1L400407-51   | .SHROUD ASSY-TOILET LID<br>SEAT<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-41-21-06D | 509999            | 1                    |
| 390                                                     | 85-99-541-20  | .FASTENER-QUARTER-TURN<br>SUPPLIER CODE:<br>V94222                                              | 509999            | 3                    |
| 395                                                     | 85-34-301-12  | .RETAINER-QUARTER-TURN STUD<br>SUPPLIER CODE:<br>V94222                                         | 509999            | 3                    |
| 400                                                     | 1L400407-259  | .SHROUD-RH<br>SUPPLIER CODE:<br>V6S8D7                                                          | 509999            | 1                    |
| 405                                                     | NAS514P1032-7 | .ATTACHING PARTS<br>.SCREW                                                                      | 509999            | 1                    |
| 410                                                     | 09T305        | .SCREW-<br>SUPPLIER CODE:<br>V94222<br>TRUE PART NUMBER:<br>09-T-305                            | 509999            | 4                    |
| 415                                                     | NAS1149D0332J | .WASHER                                                                                         | 509999            | 5                    |
| 420                                                     | MS21042L3     | .NUT<br>STANDARD SUBSTITUTION:<br>BACN11AG3<br>-----*-----                                      | 509999            | 1                    |
| 425                                                     | 1L500407-203  | .FASTENER-SNAP<br>SUPPLIER CODE:<br>V6S8D7                                                      | 509999            | 1                    |
| 430                                                     | 4L400401-17   | .PLATE ASSY-CLOSEOUT<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-41-11-40F            | 509999            | 1                    |
| 435                                                     | NAS1801-3-11  | .ATTACHING PARTS<br>.SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-11                            | 509999            | 4                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |               |                                                                                                 |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R

25-40-14-14D

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-14  
FIG. 14D  
PAGE 6  
APR 15/23


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 | NOMENCLATURE     | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|---------------|------------------|-------------------|----------------------|
| 14D                                                     |                |               |                  |                   |                      |
| 440                                                     | NAS1149D0332J  |               | . WASHER         | 509999            | 4                    |
|                                                         |                |               | -----*-----      |                   |                      |
| 445                                                     | 1L360041-0897A |               | . LAVATORY ASSY- | 509999            | 1                    |
|                                                         |                |               | SUPPLIER CODE:   |                   |                      |
|                                                         |                |               | V6S8D7           |                   |                      |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |               |                  |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R


25-40-14-14D

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

25-40-14  
 FIG. 14D  
 PAGE 7  
 APR 15/18



**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

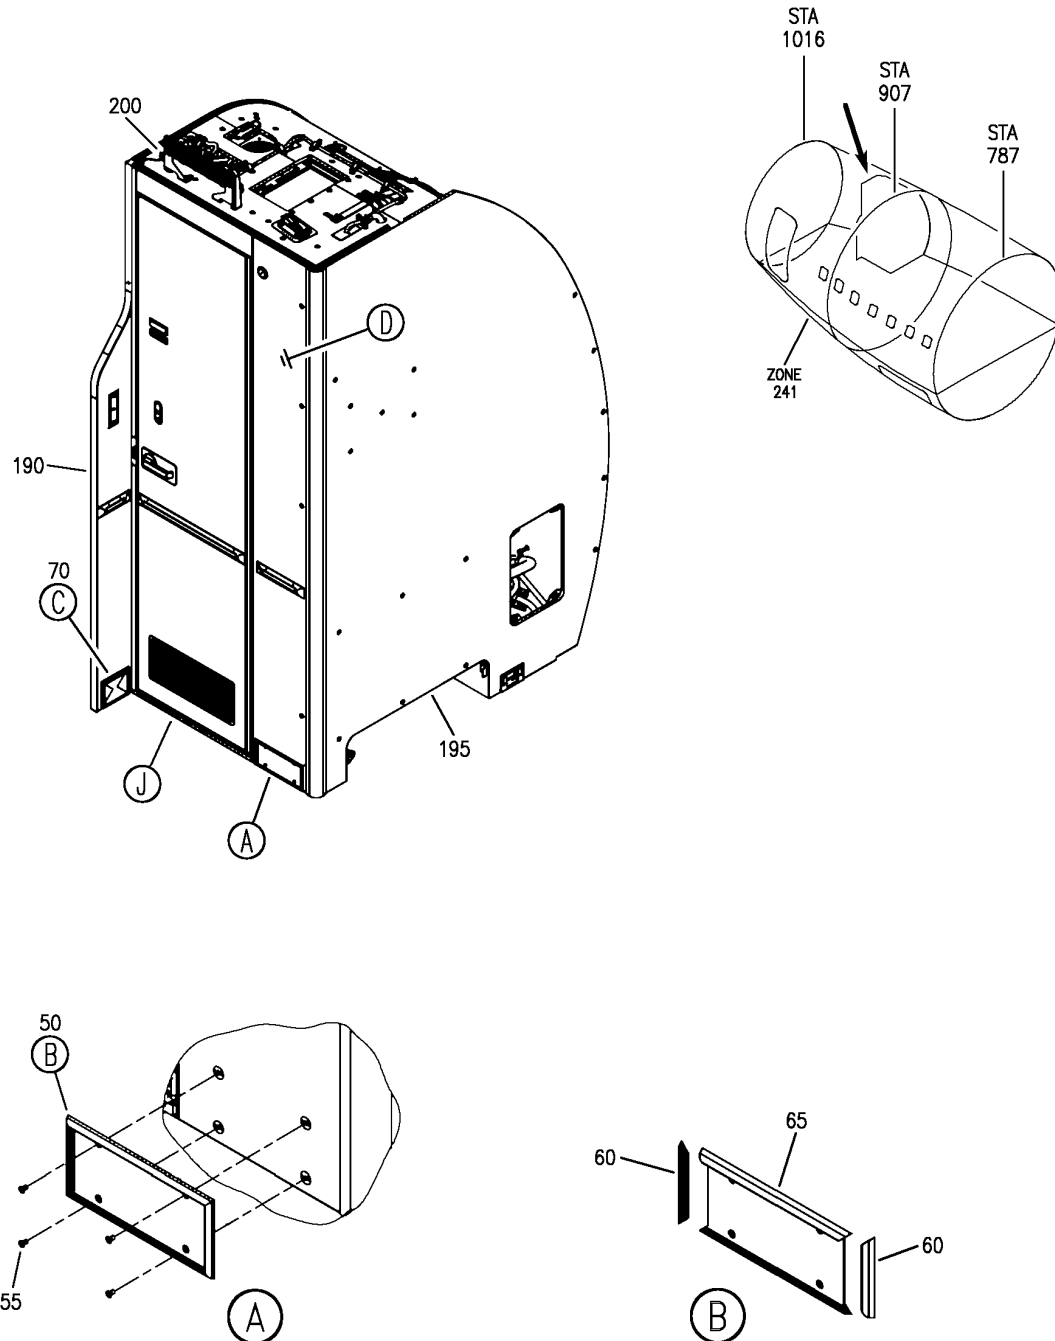

E 25401425E SHT 1 REV 261


R Y R  
APR 15 / 18

LAVATORY ASSY-LAV  
FIGURE 25E (SHEET 1)  
**25-40-14-25E**

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

25-40-14-25E  
PAGE 0

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

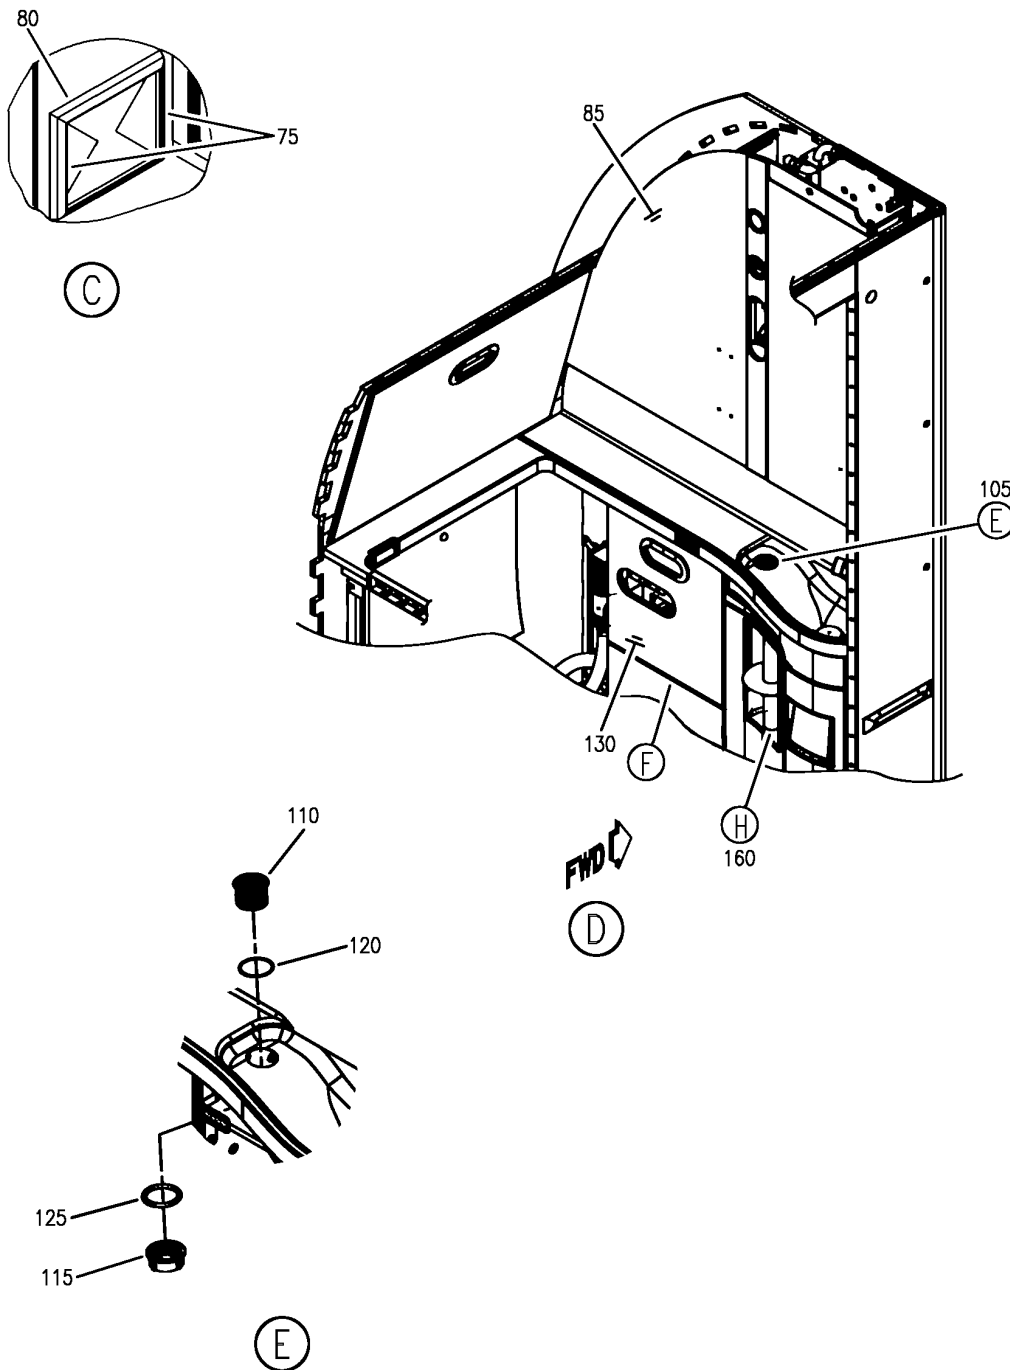

E 25401425E SHT 2 REV 261

LAVATORY ASSY-LAV  
FIGURE 25E (SHEET 2)





**25-40-14-25E**

R Y R  
APR 15 / 18

25-40-14-25E  
PAGE 0A

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

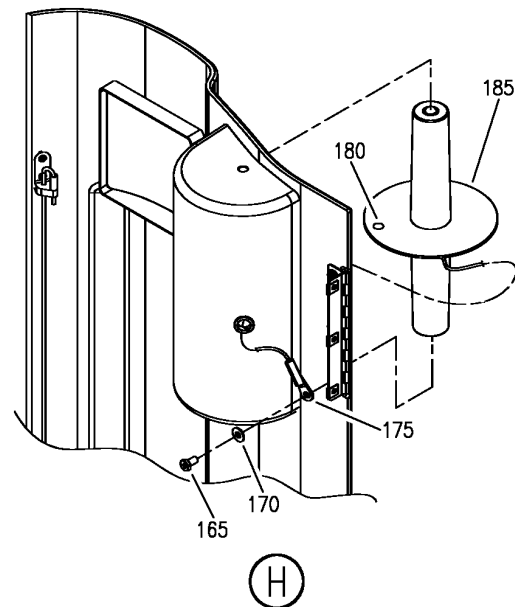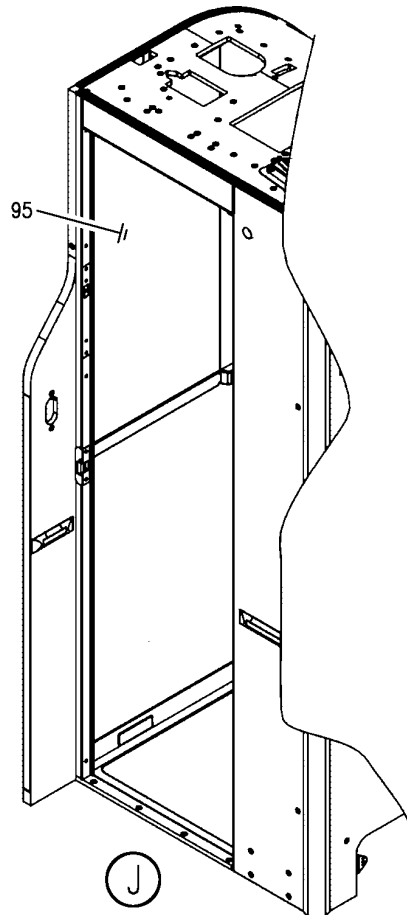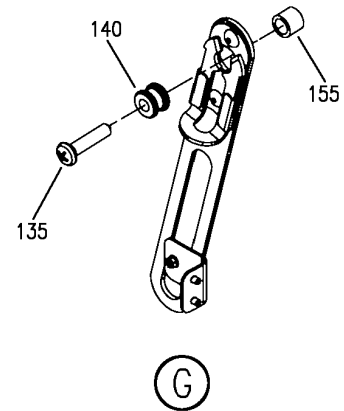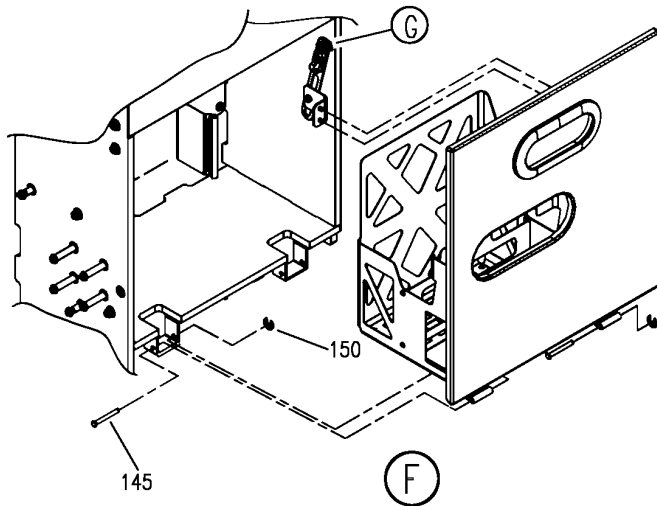

E 25401425E SHT 3 REV 261

LAVATORY ASSY-LAV  
FIGURE 25E (SHEET 3)

**25-40-14-25E**

R Y R  
APR 15/18

25-40-14-25E  
PAGE 0B

ECCN 9E991 BOEING PROPRIETARY – See title page for details.


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 NOMENCLATURE                                                                           | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 25 E                                                    |                |                                                                                                      |                   |                      |
| - 1                                                     | 1L360041-0897A | LAVATORY ASSY-LAV<br>LAVATORY ASSY-LAV D<br>SUPPLIER CODE:<br>V6S8D7<br>FOR NHA SEE:<br>25-40-14-14D | 509999<br>509999  | R F                  |
| 50                                                      | 1L500109-957BA | .KICKSTRIP ASSY-<br>SUPPLIER CODE:<br>V6S8D7                                                         | 509999            | 1                    |
| 55                                                      | NAS514P832-5   | ATTACHING PARTS<br>.SCREW<br>-----*-----                                                             | 509999            | 4                    |
| 60                                                      | 1L500109-463BA | ..CAP-<br>SUPPLIER CODE:<br>V6S8D7                                                                   | 509999            | 2                    |
| 65                                                      | 1L500109-955BA | ..RETAINER-<br>SUPPLIER CODE:<br>V6S8D7                                                              | 509999            | 1                    |
| 70                                                      | 1L400109-473BA | .KICKSTRIP ASSY-<br>SUPPLIER CODE:<br>V6S8D7                                                         | 509999            | 1                    |
| 75                                                      | 1L500109-493BA | ..CAP-<br>SUPPLIER CODE:<br>V6S8D7                                                                   | 509999            | 2                    |
| 80                                                      | 1L500109-513BA | ..RETAINER-<br>SUPPLIER CODE:<br>V6S8D7                                                              | 509999            | 1                    |
| 85                                                      | 1L400403-77    | .MIRROR ASSY-FXD<br>SUPPLIER CODE:<br>V6S8D7                                                         | 509999            | 1                    |
| - 90                                                    | 1L500403-347   | ..MIRROR-<br>SUPPLIER CODE:<br>V6S8D7                                                                | 509999            | 1                    |
| 95                                                      | 1L400403-231   | .MIRROR ASSY-AFT WALL<br>SUPPLIER CODE:<br>V6S8D7                                                    | 509999            | 1                    |
| - 100                                                   | 1L500403-231   | ..MIRROR-<br>SUPPLIER CODE:<br>V6S8D7                                                                | 509999            | 1                    |
| 105                                                     | 1L400401-211   | .SOAP DISPENSER ASSY-<br>THREADED SOAP<br>SUPPLIER CODE:<br>V6S8D7                                   | 509999            | 1                    |
| 110                                                     | 1L500401-233   | ..FITTING-DISP<br>SUPPLIER CODE:<br>V6S8D7                                                           | 509999            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |                                                                                                      |                   |                      |

- ITEM NOT ILLUSTRATED

R Y R

25-40-14-25E

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-14  
FIG. 25E  
PAGE 1  
JUN 15/18


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER   | 1 2 3 4 5 6 7 NOMENCLATURE                                                             | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|---------------|----------------------------------------------------------------------------------------|-------------------|----------------------|
| 25 E                                                    |               |                                                                                        |                   |                      |
| 115                                                     | 1L500401-171  | ATTACHING PARTS<br>..NUT-DISP<br>SUPPLIER CODE:<br>V6S8D7<br>-----*-----               | 509999            | 1                    |
| 120                                                     | MS28775-031   | ..PACKING                                                                              | 509999            | 1                    |
| 125                                                     | 1L500401-415  | ..WASHER-LOCK<br>SUPPLIER CODE:<br>V6S8D7                                              | 509999            | 1                    |
| 130                                                     | 1L400201-109  | .DRAWER ASSY-AMENITIES<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-41-11-16T | 509999            | 1                    |
| 135                                                     | NAS602-12P    | ATTACHING PARTS<br>.SCREW<br>STANDARD SUBSTITUTION:<br>BACS12CK08-12                   | 509999            | 1                    |
| 140                                                     | TL05-117-52   | .KEEPER-SLIDE-LATCH<br>SUPPLIER CODE:<br>V94222<br>TRUE PART NUMBER:<br>TL-05-117-52   | 509999            | 1                    |
| 145                                                     | CPG3-151B     | .PIN-GROOVED-CLEVIS<br>SUPPLIER CODE:<br>VOCUJ4<br>TRUE PART NUMBER:<br>CPG3-151-B     | 509999            | 2                    |
| 150                                                     | MS16633-1018  | .RING<br>STANDARD SUBSTITUTION:<br>MS16633-2018                                        | 509999            | 2                    |
| 155                                                     | NAS43DD3-16FC | .SPACER<br>-----*-----                                                                 | 509999            | 1                    |
| 160                                                     | 1L400401-219  | .HOLDER ASSY-TOILET PAPER<br>SUPPLIER CODE:<br>V6S8D7                                  | 509999            | 1                    |
| 165                                                     | NAS1801-3-5   | ATTACHING PARTS<br>.SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-5                     | 509999            | 1                    |
| 170                                                     | NAS1149D0332J | .WASHER<br>-----*-----                                                                 | 509999            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |               |                                                                                        |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R

25-40-14-25E

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-14  
 FIG. 25E  
 PAGE 2  
 APR 15/23


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                                                                                                                                                                | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 25 E<br>175                                             | L94B1000S3     | .. LANYARD-<br>SUPPLIER CODE:<br>VOCUJ4<br>TRUE PART NUMBER:<br>L94B-1000S-3<br>MISCELLANEOUS DATA:<br>B/E PART NO:<br>LCCS-5-3-BB-1000<br>ATTACHING PARTS                                                                                                | 509999            | 1                    |
| 180                                                     | MS20470AD6-6   | .. RIVET<br>STANDARD SUBSTITUTION:<br>BACR15BB6AD6C<br>-----*-----                                                                                                                                                                                        | 509999            | 1                    |
| 185                                                     | 1L400401-145   | .. HOLDER-TOILET PAPER<br>SUPPLIER CODE:<br>V6S8D7                                                                                                                                                                                                        | 509999            | 1                    |
| 190                                                     | 1L500409-761   | . TRIM-<br>SUPPLIER CODE:<br>V6S8D7                                                                                                                                                                                                                       | 509999            | 1                    |
| 195                                                     | 1L306041-401HF | . STRUCTURE INSTL-<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-40-14-50F                                                                                                                                                                        | 509999            | 1                    |
| 200                                                     | 3L306040-119   | . ELECTRICAL INSTL-STRUCT<br>SUPPLIER CODE:<br>V6S8D7<br>FUNCTIONAL REFERENCE:<br>EQUIPMENT/FURNISHINGS<br>FOR DETAILS SEE<br>25-41-60-02W<br>LIGHTS<br>FOR DETAILS SEE<br>33-26-03-03Z<br>33-27-51-02W<br>WATER/WASTE<br>FOR DETAILS SEE<br>38-32-04-06W | 509999            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |                                                                                                                                                                                                                                                           |                   |                      |

— ITEM NOT ILLUSTRATED


RYR

# 25-40-14-25E

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

25-40-14  
 FIG. 25E  
 PAGE 3  
 JUN 15/24

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

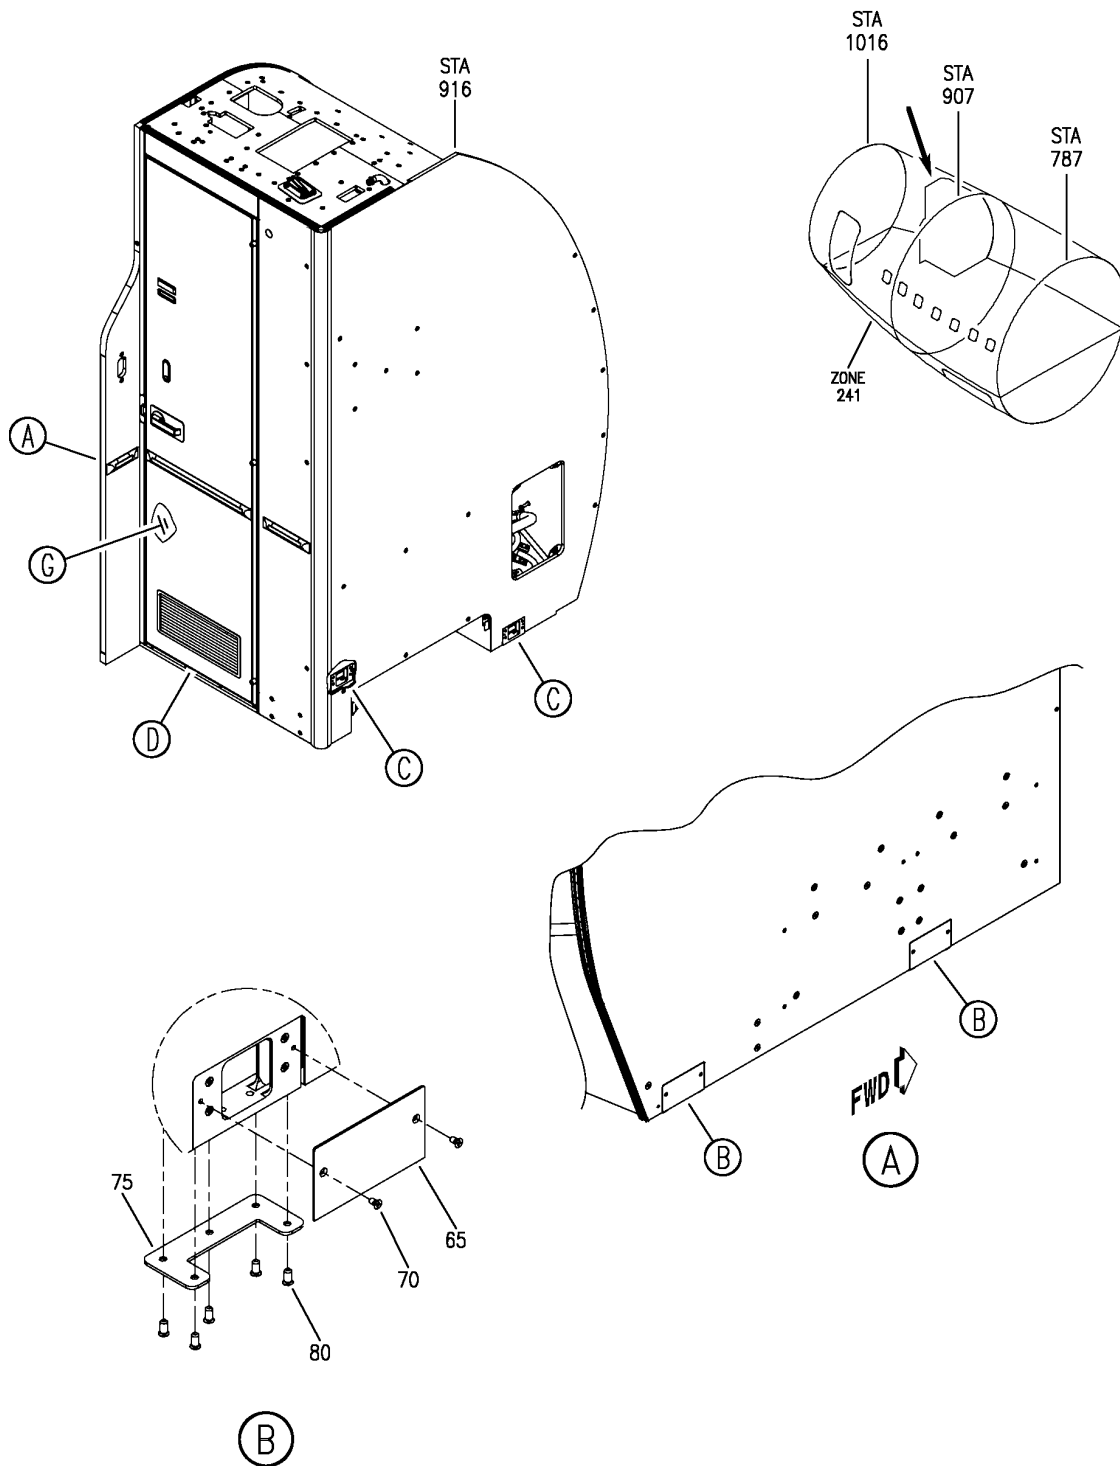

E 25401450F SHT 1 REV 251

STRUCTURE INSTL-LAV  
FIGURE 50F (SHEET 1)


**25-40-14-50F**

R Y R  
APR 15/18

25-40-14-50F  
PAGE 0

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

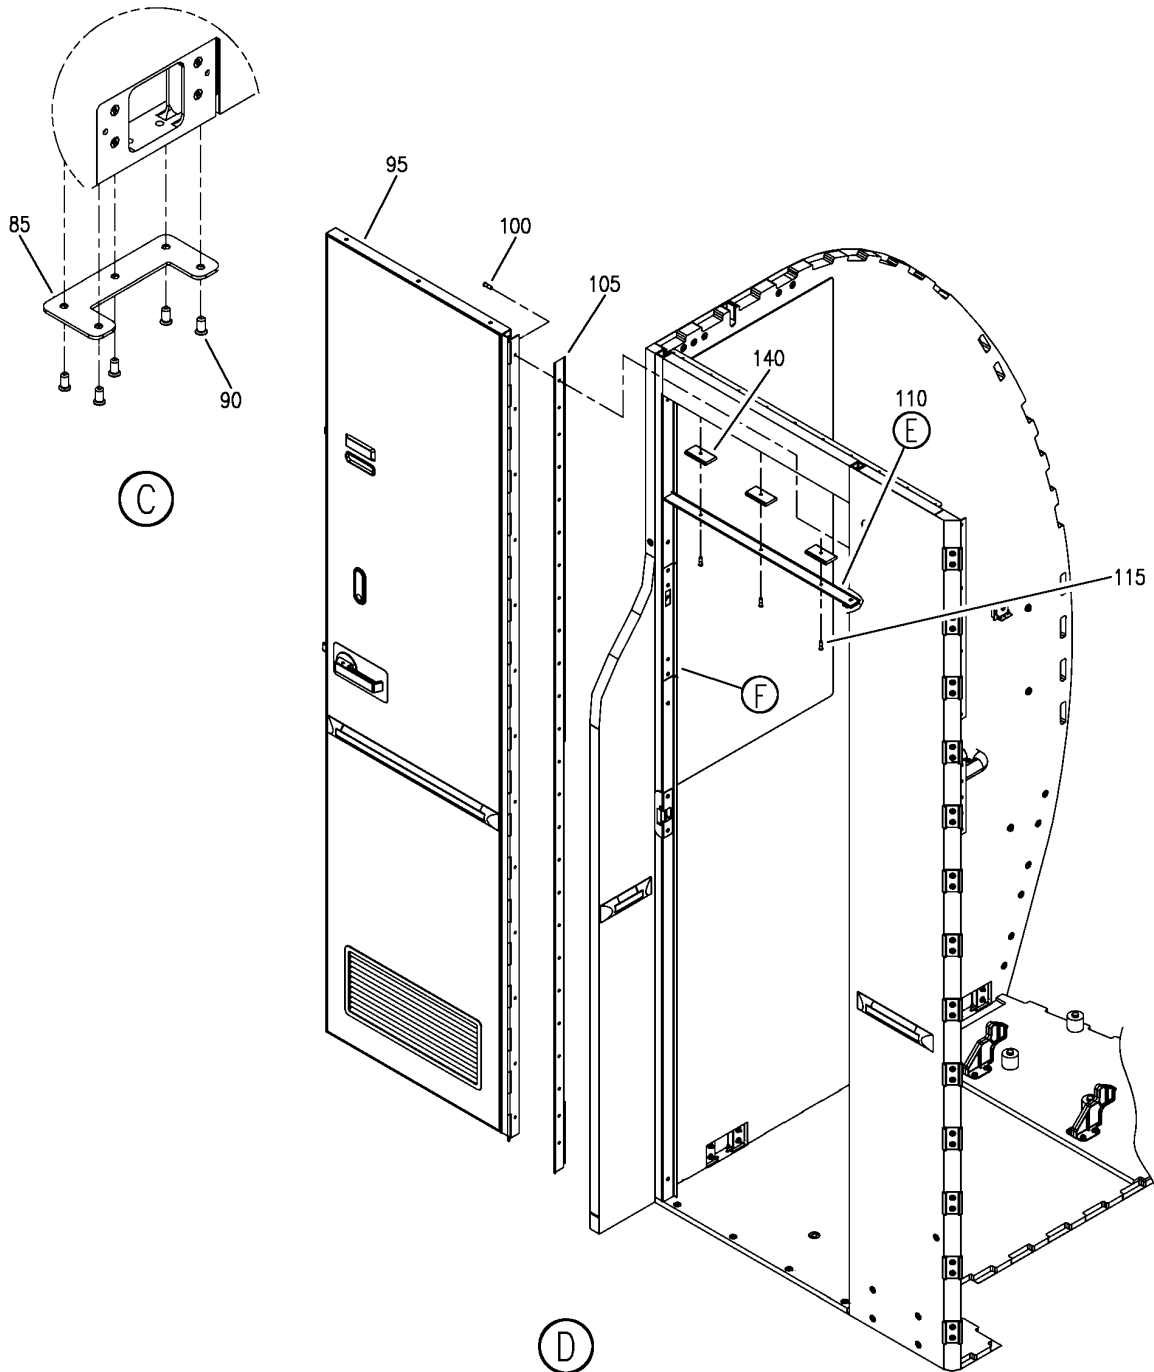

E 25401450F SHT 2 REV 251

STRUCTURE INSTL-LAV  
FIGURE 50F (SHEET 2)


**25-40-14-50F**

R Y R  
APR 15/18

25-40-14-50F  
PAGE 0A


ECCN 9E991 BOEING PROPRIETARY – See title page for details.





25-40-14-50F  
PAGE 0B

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

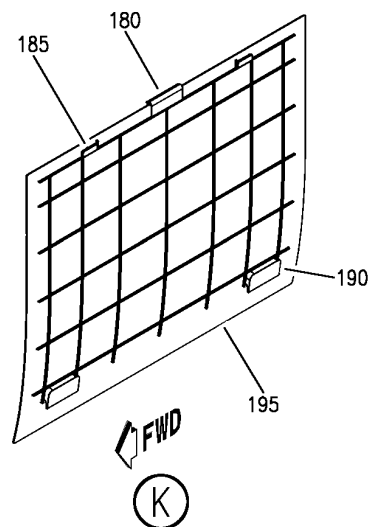

E 25401450F SHT 4 REV 251

STRUCTURE INSTL-LAV  
FIGURE 50F (SHEET 4)

**25-40-14-50F**

R Y R  
APR 15/18

25-40-14-50F  
PAGE 0C

ECCN 9E991 BOEING PROPRIETARY - See title page for details.


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER     | 1 2 3 4 5 6 7 | NOMENCLATURE                                                                                                                                                                                                             | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|-----------------|---------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 50F                                                     |                 |               |                                                                                                                                                                                                                          |                   |                      |
| - 1                                                     | 1L306041-401HF  |               | STRUCTURE INSTL-LAV<br>STRUCTURE INSTL-LAV D<br>SUPPLIER CODE:<br>V6S8D7<br>FOR NHA SEE:<br>25-40-14-25E                                                                                                                 | 509999<br>509999  | RF                   |
| - 50                                                    | 1L306041-401HF1 |               | .STRUCTURE INSTL-<br>SUPPLIER CODE:<br>V6S8D7<br>MISCELLANEOUS DATA:<br>NON PROCURABLE<br>FUNCTIONAL REFERENCE:<br>EQUIPMENT/FURNISHINGS<br>FOR DETAILS SEE<br>25-40-14-50G<br>LIGHTS<br>FOR DETAILS SEE<br>33-26-03-42R | 509999            | RF                   |
| - 55                                                    | 1L306041-401HF2 |               | .STRUCTURE INSTL-<br>SUPPLIER CODE:<br>V6S8D7<br>MISCELLANEOUS DATA:<br>NON PROCURABLE<br>FOR DETAILS SEE:<br>25-40-14-50L                                                                                               | 509999            | RF                   |
| - 60                                                    | 1L306041-401HF3 |               | .STRUCTURE ASSY-<br>SUPPLIER CODE:<br>V6S8D7<br>MISCELLANEOUS DATA:<br>NON PROCURABLE<br>FOR DETAILS SEE:<br>25-40-14-50T                                                                                                | 509999            | RF                   |
| 65                                                      | 1L500409-841CH  |               | .PLATE-COVER<br>SUPPLIER CODE:<br>V6S8D7<br>MISCELLANEOUS DATA:<br>BAC93319                                                                                                                                              | 509999            | 2                    |
| 70                                                      | NAS514P632-5    |               | ATTACHING PARTS<br>.SCREW<br>-----*-----                                                                                                                                                                                 | 509999            | 4                    |
| 75                                                      | 1L500409-253    |               | .PLATE-SHEAR<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                                                                                                                                                              | 509999            | 2                    |
| 80                                                      | BACB30VF3K1     |               | .BOLT<br>-----*-----                                                                                                                                                                                                     | 509999            | 10                   |
| 85                                                      | 1L500409-257    |               | .PLATE-SHEAR<br>SUPPLIER CODE:<br>V6S8D7                                                                                                                                                                                 | 509999            | 2                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                 |               |                                                                                                                                                                                                                          |                   |                      |

— ITEM NOT ILLUSTRATED

RYR

25-40-14-50F

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-14  
FIG. 50F  
PAGE 1  
FEB 15/24


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER   | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                                                                | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|---------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 50F                                                     |               |                                                                                                                                                           |                   |                      |
| 90                                                      | BACB30VF3K1   | ATTACHING PARTS<br>.BOLT<br>-----*-----                                                                                                                   | 509999            | 10                   |
| 95                                                      | 1L400105-33HF | .DOOR ASSY-<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-41-17-03W<br>ATTACHING PARTS<br>.BOLT<br>-----*-----                                    | 509999            | 1                    |
| 100                                                     | NAS8603-3     | .TRIM-EDGE<br>SUPPLIER CODE:<br>V6S8D7                                                                                                                    | 509999            | 13                   |
| 105                                                     | 1L500109-301  | .TRIM ASSY-DOOR<br>SUPPLIER CODE:<br>V6S8D7                                                                                                               | 509999            | 1                    |
| 110                                                     | 1L500109-461  | ATTACHING PARTS<br>.BOLT<br>STANDARD SUBSTITUTION:<br>BACB30ZE3K4<br>-----*-----                                                                          | 509999            | 3                    |
| 120                                                     | 1L500105-169  | ..BLOCK-CLOSE OUT<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS<br>..SCREW<br>..NUT<br>STANDARD SUBSTITUTION:<br>MS21042L04<br>BACN11AG04<br>-----*----- | 509999            | 1                    |
| 125                                                     | NAS514P440-5  | ..TRIM-OPENING<br>SUPPLIER CODE:<br>V6S8D7<br>CONFIG CHG DATA FROM A CMM:<br>SUPSD BY 1L500109-627                                                        | 509999            | 1                    |
| 130                                                     | MS21042-04    | ..TRIM-OPENING<br>SUPPLIER CODE:<br>V6S8D7<br>CONFIG CHG DATA FROM A CMM:<br>SUPERSEDES 1L500109-459                                                      | 509999            | 1                    |
| 135                                                     | 1L500109-459  | .SPACER-BLOCK<br>SUPPLIER CODE:<br>V6S8D7                                                                                                                 | 509999            | 3                    |
| 135                                                     | 1L500109-627  |                                                                                                                                                           |                   |                      |
| 140                                                     | 1L500409-267  |                                                                                                                                                           |                   |                      |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |               |                                                                                                                                                           |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R

25-40-14-50F

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-14  
FIG. 50F  
PAGE 2  
FEB 15/24


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER  | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                                                                                                                          | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|--------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 50F<br>145                                              | 1L400109-93  | .SWITCH ASSY-<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>33-26-03-08G<br>ATTACHING PARTS                                                                                                                    | 509999            | 1                    |
| 150                                                     | NAS8703A1    | .BOLT<br>STANDARD SUBSTITUTION:<br>BACB30ZE3K1<br>-----*-----                                                                                                                                                       | 509999            | 2                    |
| 155                                                     | 1L460070-255 | .TABLE ASSY-BABY CHANGING<br>SUPPLIER CODE:<br>VH1XK6<br>FOR DETAILS SEE:<br>25-41-52-01B<br>ATTACHING PARTS                                                                                                        | 509999            | 1                    |
| 160                                                     | NAS8302-5    | .SCREW<br>-----*-----                                                                                                                                                                                               | 509999            | 4                    |
| 165                                                     | 65PWF02      | .MAGNET-RECTANGULAR<br>SUPPLIER CODE:<br>V1B3S4<br>CONFIG CHG DATA FROM A CMM:<br>SUPSD BY 65PWF02-45<br>MISCELLANEOUS DATA:<br>ORDER LCCS7-2A                                                                      | 509999            | 2                    |
| 165                                                     | 65PWF02-45   | .MAGNET-RECTANGULAR<br>SUPPLIER CODE:<br>V1B3S4<br>CONFIG CHG DATA FROM A CMM:<br>SUPERSEDES 65PWF02<br>MISCELLANEOUS DATA:<br>ORDER LCCS7-6A                                                                       | 509999            | 2                    |
| 165                                                     | LCCS7-2A     | .MAGNET-RECTANGULAR<br>SUPPLIER CODE:<br>V6S8D7<br>TRUE PART NUMBER:<br>LCCS-7-2-A<br>CONFIG CHG DATA FROM A CMM:<br>SUPSD BY LCCS7-6A<br>MISCELLANEOUS DATA:<br>ADAMS MAGNETIC PRODUCTS<br>CO. PART NUMBER 65PWF02 | 509999            | 2                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |              |                                                                                                                                                                                                                     |                   |                      |

— ITEM NOT ILLUSTRATED

RYR

25-40-14-50F

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-14  
 FIG. 50F  
 PAGE 3  
 FEB 15/24


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER  | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                                                                                                                                  | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|--------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 50F<br>165                                              | LCCS7-6A     | .MAGNET-RECTANGULAR<br>SUPPLIER CODE:<br>V6S8D7<br>TRUE PART NUMBER:<br>LCCS-7-6-A<br>CONFIG CHG DATA FROM A CMM:<br>SUPERSEDES LCCS7-2A<br>MISCELLANEOUS DATA:<br>ADAMS MAGNETIC PRODUCTS<br>CO. PART NUMBER<br>65PWF02-45 | 509999            | 2                    |
| 170                                                     | 1L500411-69  | .SPACER-MAGNET<br>SUPPLIER CODE:<br>V6S8D7                                                                                                                                                                                  | 509999            | 1                    |
| 175                                                     | 1L400107-17  | .SHROUD ASSY-CTR<br>SUPPLIER CODE:<br>V6S8D7                                                                                                                                                                                | 509999            | 1                    |
| 180                                                     | 1L500107-73  | ..HANDLE-PULL<br>SUPPLIER CODE:<br>V6S8D7                                                                                                                                                                                   | 509999            | 1                    |
| 185                                                     | 02-14-301-14 | ..STRIKER-SELF ADHESIVE<br>SUPPLIER CODE:<br>V94222                                                                                                                                                                         | 509999            | 2                    |
| 190                                                     | 1L500407-117 | ..BLOCK-GUIDE<br>SUPPLIER CODE:<br>V6S8D7                                                                                                                                                                                   | 509999            | 2                    |
| 195                                                     | 1L500107-71  | ..SHROUD-<br>SUPPLIER CODE:<br>V6S8D7                                                                                                                                                                                       | 509999            | 1                    |
| - 200                                                   | SJ5327       | .BUMPER-<br>SUPPLIER CODE:<br>V07080<br>TRUE PART NUMBER:<br>SJ-5327                                                                                                                                                        | 509999            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |              |                                                                                                                                                                                                                             |                   |                      |

— ITEM NOT ILLUSTRATED


R Y R

25-40-14-50F

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-14  
 FIG. 50F  
 PAGE 4  
 FEB 15/24

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

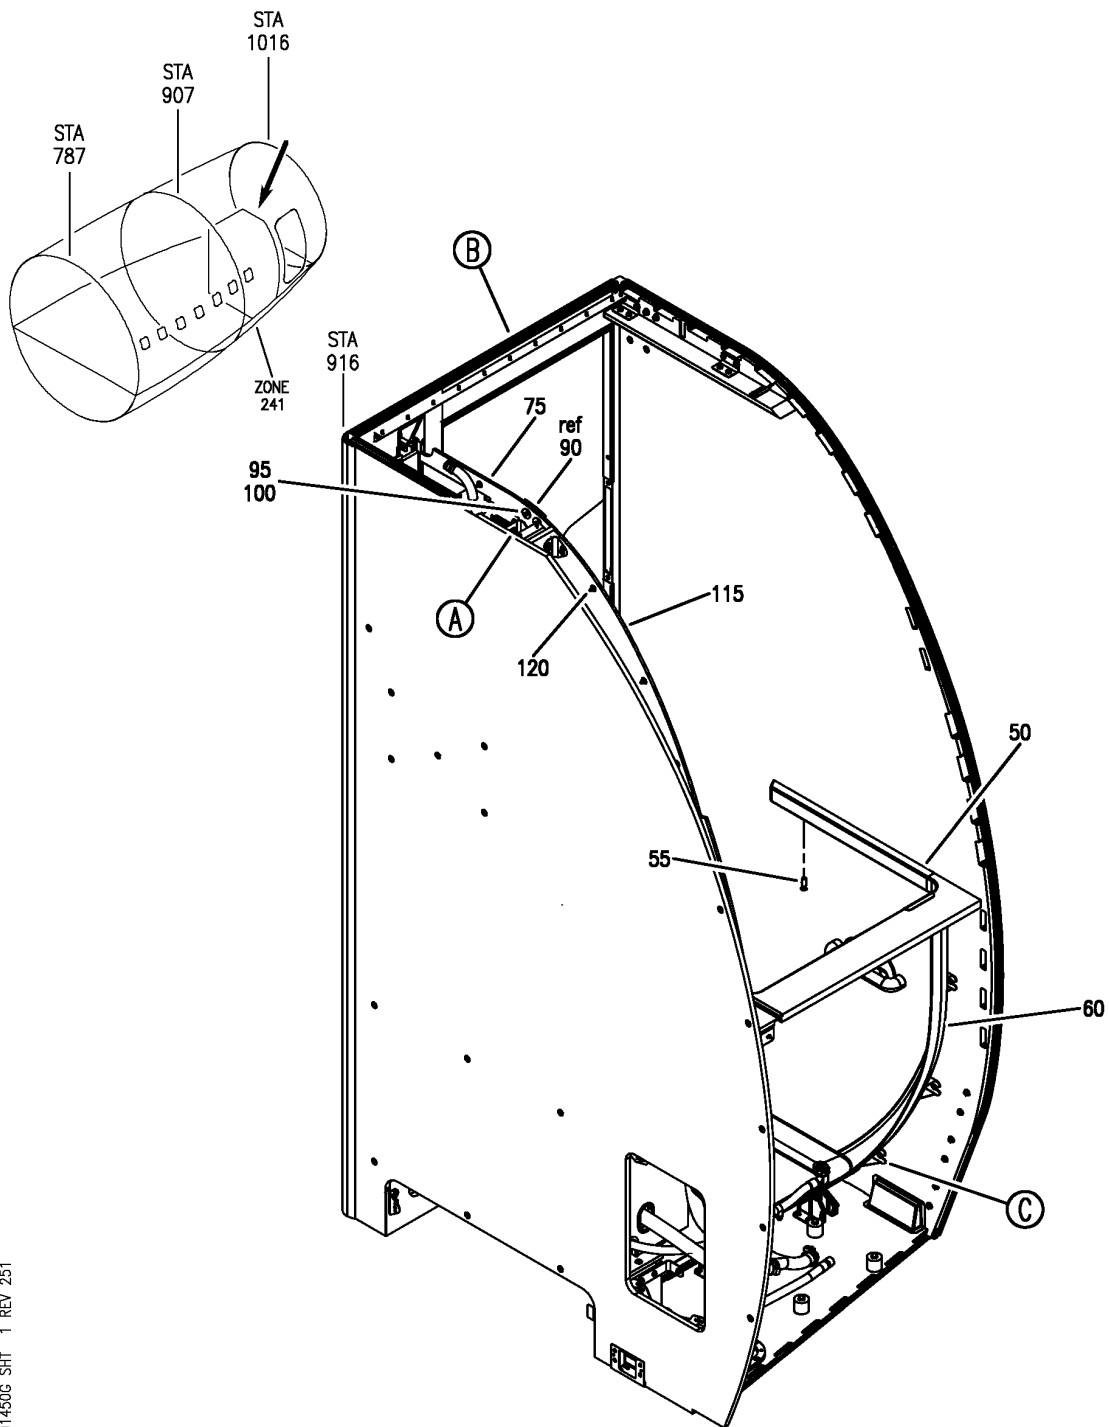

E 25401450G SHT 1 REV 251

STRUCTURE INSTL-LAV D (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 50G (SHEET 1)


**25-40-14-50G**

RJR  
OCT 15/20


25-40-14-50G  
PAGE 0

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

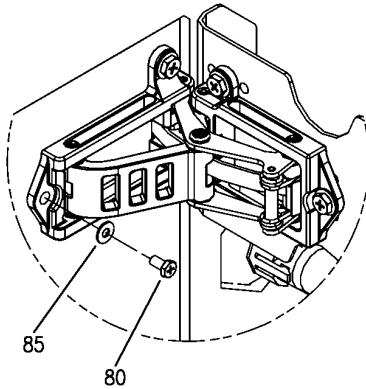

(A)

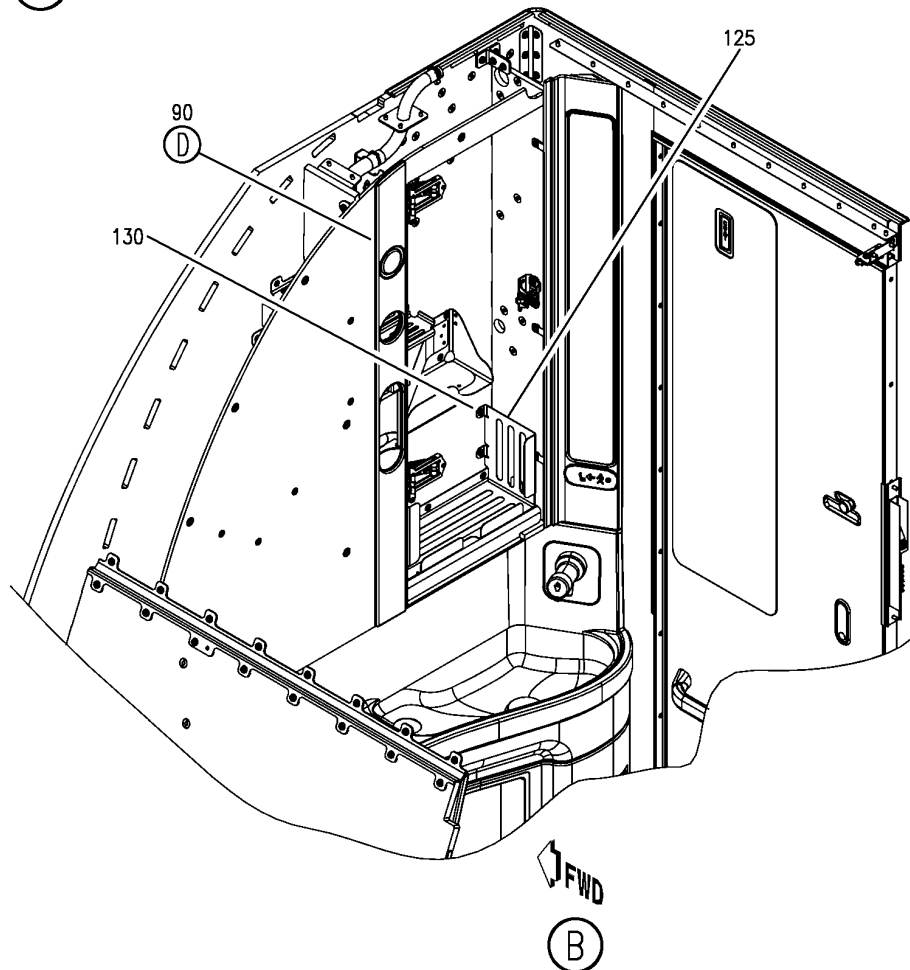

E 25401450G SHT 2 REV 251

STRUCTURE INSTL-LAV D (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 50G (SHEET 2)

**25-40-14-50G**


R Y R  
O C T 15 / 20

25-40-14-50G  
PAGE 0A


ECCN 9E991 BOEING PROPRIETARY – See title page for details.



**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

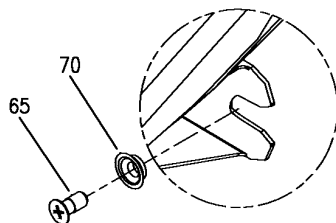

(C)

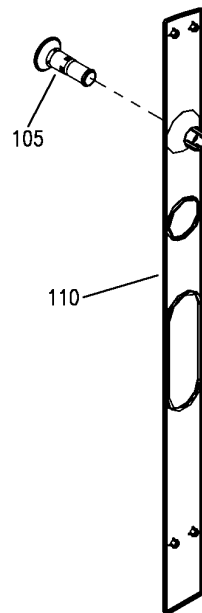

(D)

E 25401450G SHT 3 REV 291

STRUCTURE INSTL-LAV D (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 50G (SHEET 3)

**25-40-14-50G**

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

R Y R  
O C T 15 / 20

25-40-14-50G  
PAGE 0B


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER     | 1 2 3 4 5 6 7 | NOMENCLATURE                                                                                                                                        | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|-----------------|---------------|-----------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 50G                                                     |                 |               | STRUCTURE INSTL-LAV D<br>(EQUIPMENT/FURNISHINGS<br>ONLY)                                                                                            | 509999            |                      |
| - 1                                                     | 1L306041-401HF1 |               | STRUCTURE INSTL-LAV D<br>(EQUIPMENT/ FURNISHINGS<br>ONLY)<br>SUPPLIER CODE:<br>V6S8D7<br>FOR NHA/OTHER SYS DET SEE:<br>25-40-14-50F                 | 509999            | RF                   |
| 50                                                      | 1L500413-93     |               | .TRIM-AFT WALL<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                                                                                       | 509999            | 1                    |
| 55                                                      | NAS514P832-8    |               | .SCREW<br>-----*-----                                                                                                                               | 509999            | 1                    |
| 60                                                      | 1L500407-105    |               | .SHROUD-LH, OUTBD TOILET<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                                                                             | 509999            | 1                    |
| 65                                                      | NAS514P1032-6   |               | .SCREW<br>-----*-----                                                                                                                               | 509999            | 4                    |
| 70                                                      | 1L500407-203    |               | .FASTENER-SNAP<br>SUPPLIER CODE:<br>V6S8D7                                                                                                          | 509999            | 4                    |
| 75                                                      | 1L400403-107    |               | .MIRROR ASSY-HINGED<br>SUPPLIER CODE:<br>V6S8D7<br>SB DATA FROM A CMM:<br>PRE SB 1L3-25-0055<br>FOR DETAILS SEE:<br>25-41-51-49A<br>ATTACHING PARTS | 509999            | 1                    |
| 80                                                      | NAS1801-3-5     |               | .SCREW-<br>STANDARD SUBSTITUTION:<br>BACS12HN3-5<br>SB DATA FROM A CMM:<br>PRE SB 1L3-25-0055                                                       | 509999            | 6                    |
| 85                                                      | NAS1149D0332J   |               | .WASHER-<br>SB DATA FROM A CMM:<br>PRE SB 1L3-25-0055<br>-----*-----                                                                                | 509999            | 6                    |
| 90                                                      | 1L400403-27     |               | .STRIP ASSY-AMENITIES<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                                                                                | 509999            | 1                    |
| 95                                                      | NAS1801-08-6    |               | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN08-6                                                                                                    | 509999            | 4                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                 |               |                                                                                                                                                     |                   |                      |

- ITEM NOT ILLUSTRATED

RYR

25-40-14-50G

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-14  
FIG. 50G  
PAGE 1  
APR 15/23


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                                       | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|----------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 50G<br>100                                              | AN970-3        | .WASHER<br>-----*-----                                                                                                           | 509999            | 4                    |
| 105                                                     | 1L400203-13    | ..GASPER-<br>SUPPLIER CODE:<br>V6S8D7                                                                                            | 509999            | 1                    |
| 110                                                     | 1L500403-19    | ..STRIP-AMENITIES<br>SUPPLIER CODE:<br>V6S8D7                                                                                    | 509999            | 1                    |
| 115                                                     | 1L460040-327   | .VANITY ASSY-UPR<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-41-51-40A<br>ATTACHING PARTS                              | 509999            | 1                    |
| 120                                                     | NAS514P1032-10 | .SCREW<br>-----*-----                                                                                                            | 509999            | 11                   |
| 125                                                     | 1L500403-251   | .BRACKET-PAPER TOWEL<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                                                              | 509999            | 1                    |
| 130                                                     | NAS8303-5      | .SCREW<br>-----*-----                                                                                                            | 509999            | 4                    |
| - 135                                                   | 1L201300-017   | .MIRROR KIT-HINGED<br>SUPPLIER CODE:<br>V6S8D7<br>SB DATA FROM A CMM:<br>POST SB 1L3-25-0055<br>FOR DETAILS SEE:<br>25-41-51-38Z | 509999            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |                                                                                                                                  |                   |                      |

- ITEM NOT ILLUSTRATED






R Y R

25-40-14-50G

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-14  
 FIG. 50G  
 PAGE 2  
 OCT 15/20

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

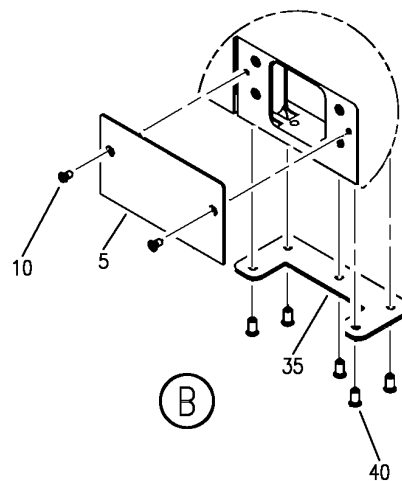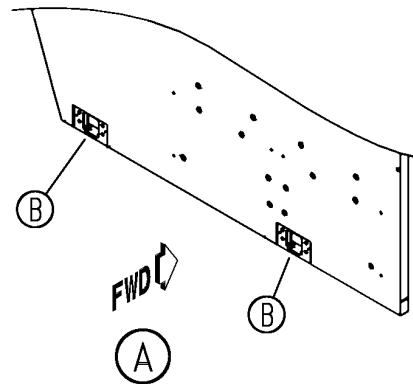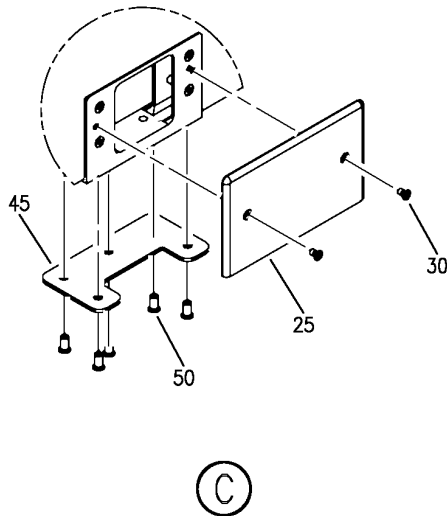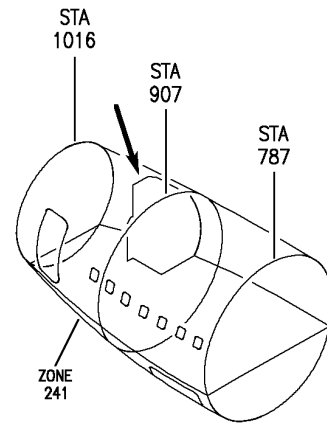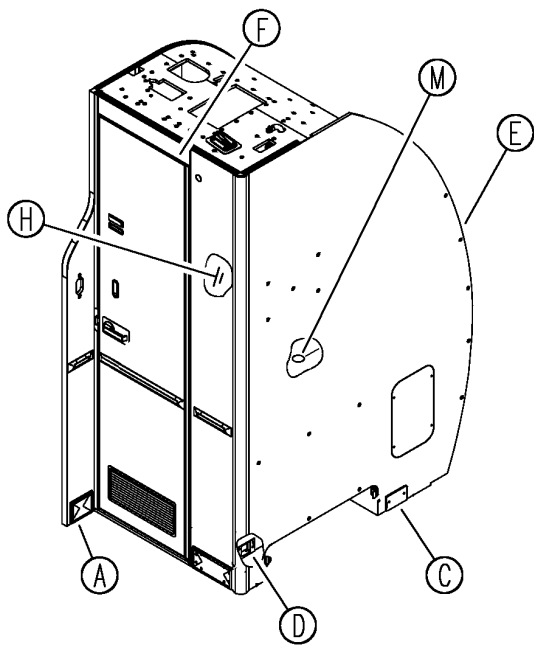

E 25401450H SHT 1 REV 241


STRUCTURE ASSY-LAV D  
FIGURE 50H (SHEET 1)

**25-40-14-50H**

R Y R  
O C T 15 / 16

25-40-14-50H  
PAGE 0

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

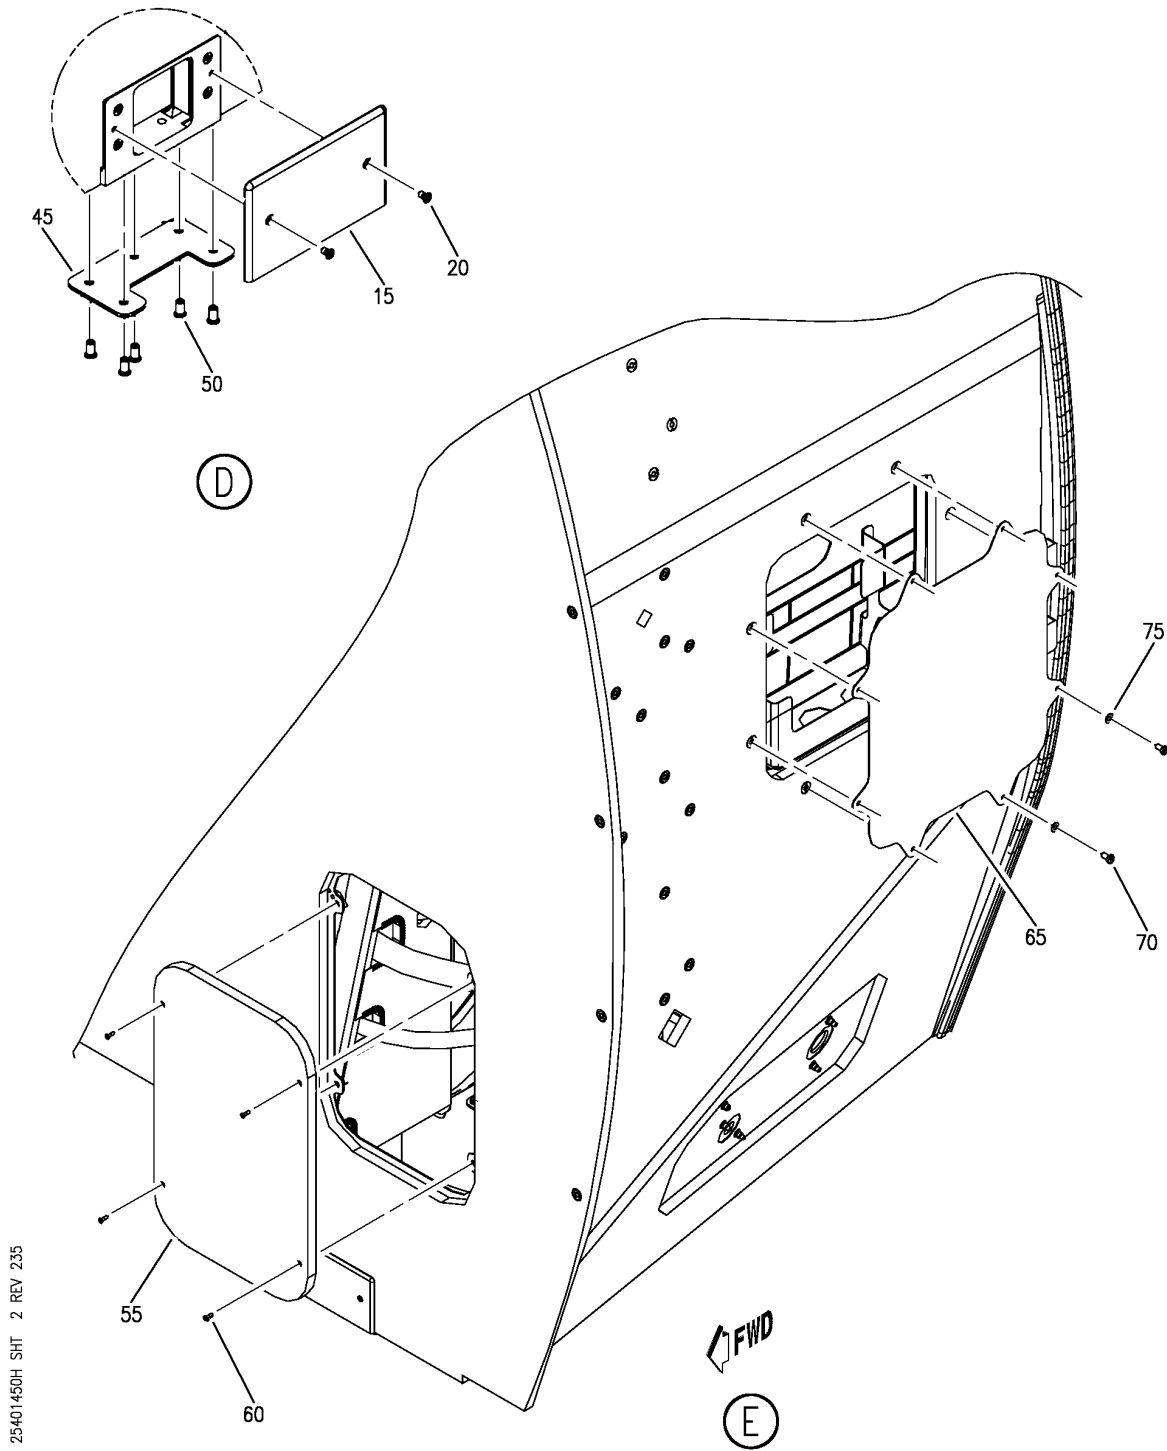

E 25401450H SHT 2 REV 235


STRUCTURE ASSY-LAV D  
FIGURE 50H (SHEET 2)

**25-40-14-50H**

RJR  
OCT 15/16

25-40-14-50H  
PAGE 0A

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

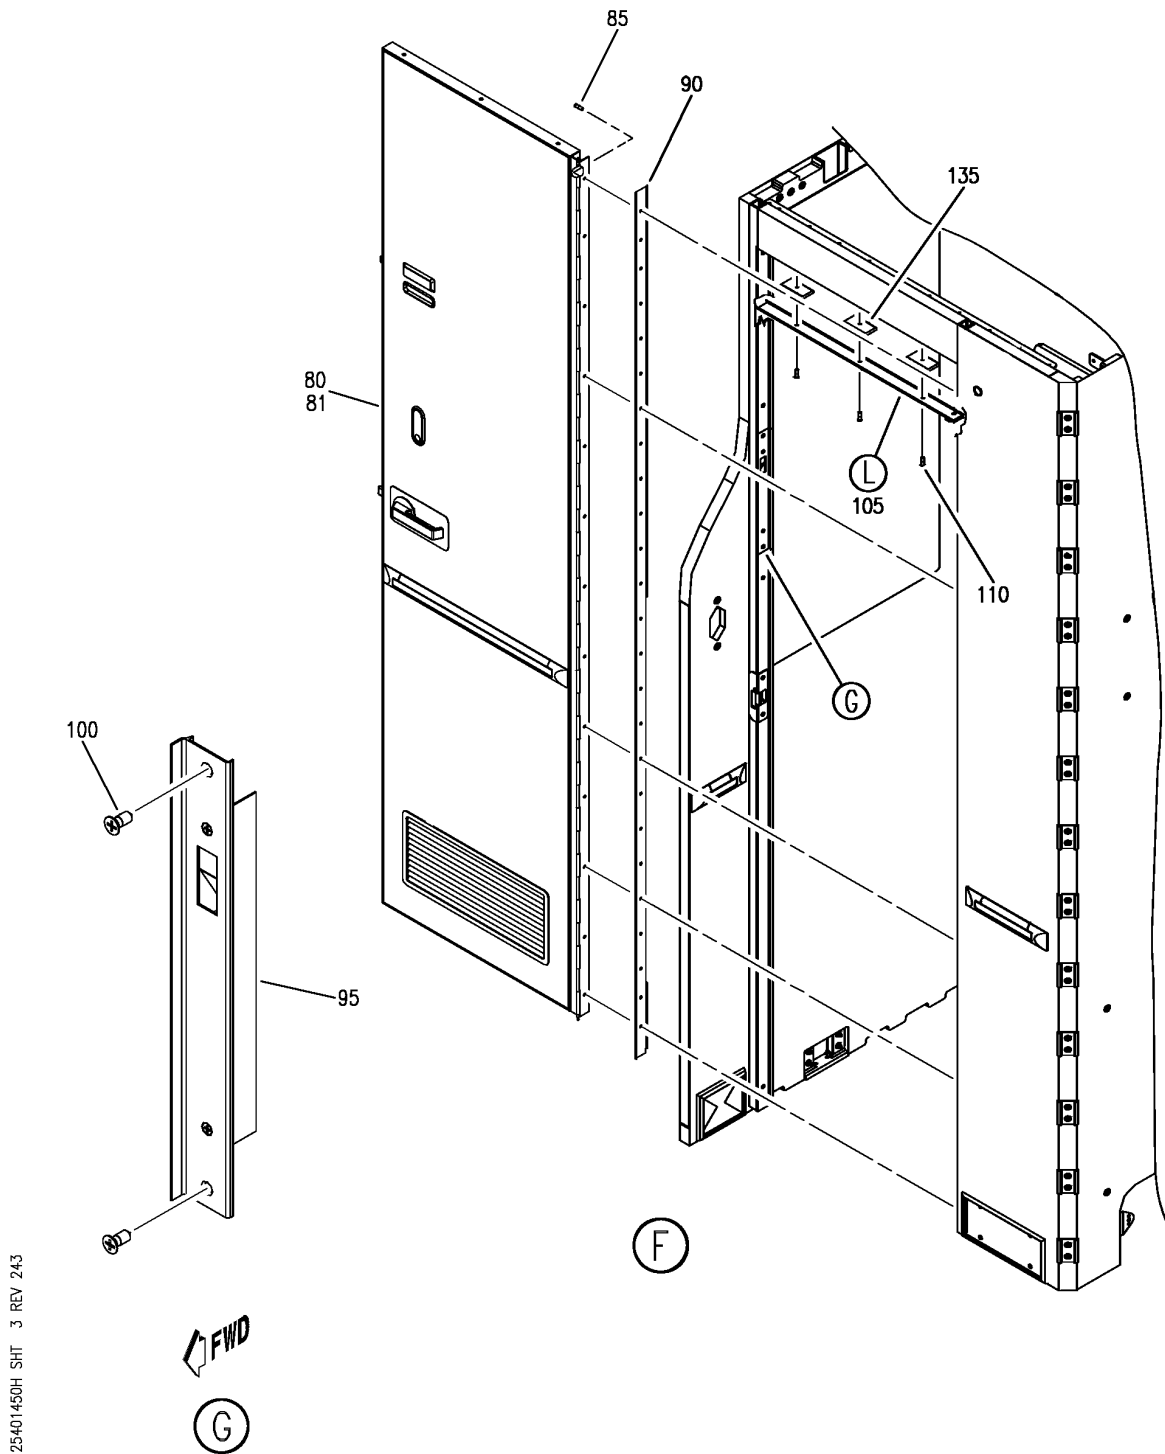

E 25401450H SHT 3 REV 243

STRUCTURE ASSY-LAV D  
FIGURE 50H (SHEET 3)


**25-40-14-50H**

RJR  
OCT 15/16

25-40-14-50H  
PAGE 08

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

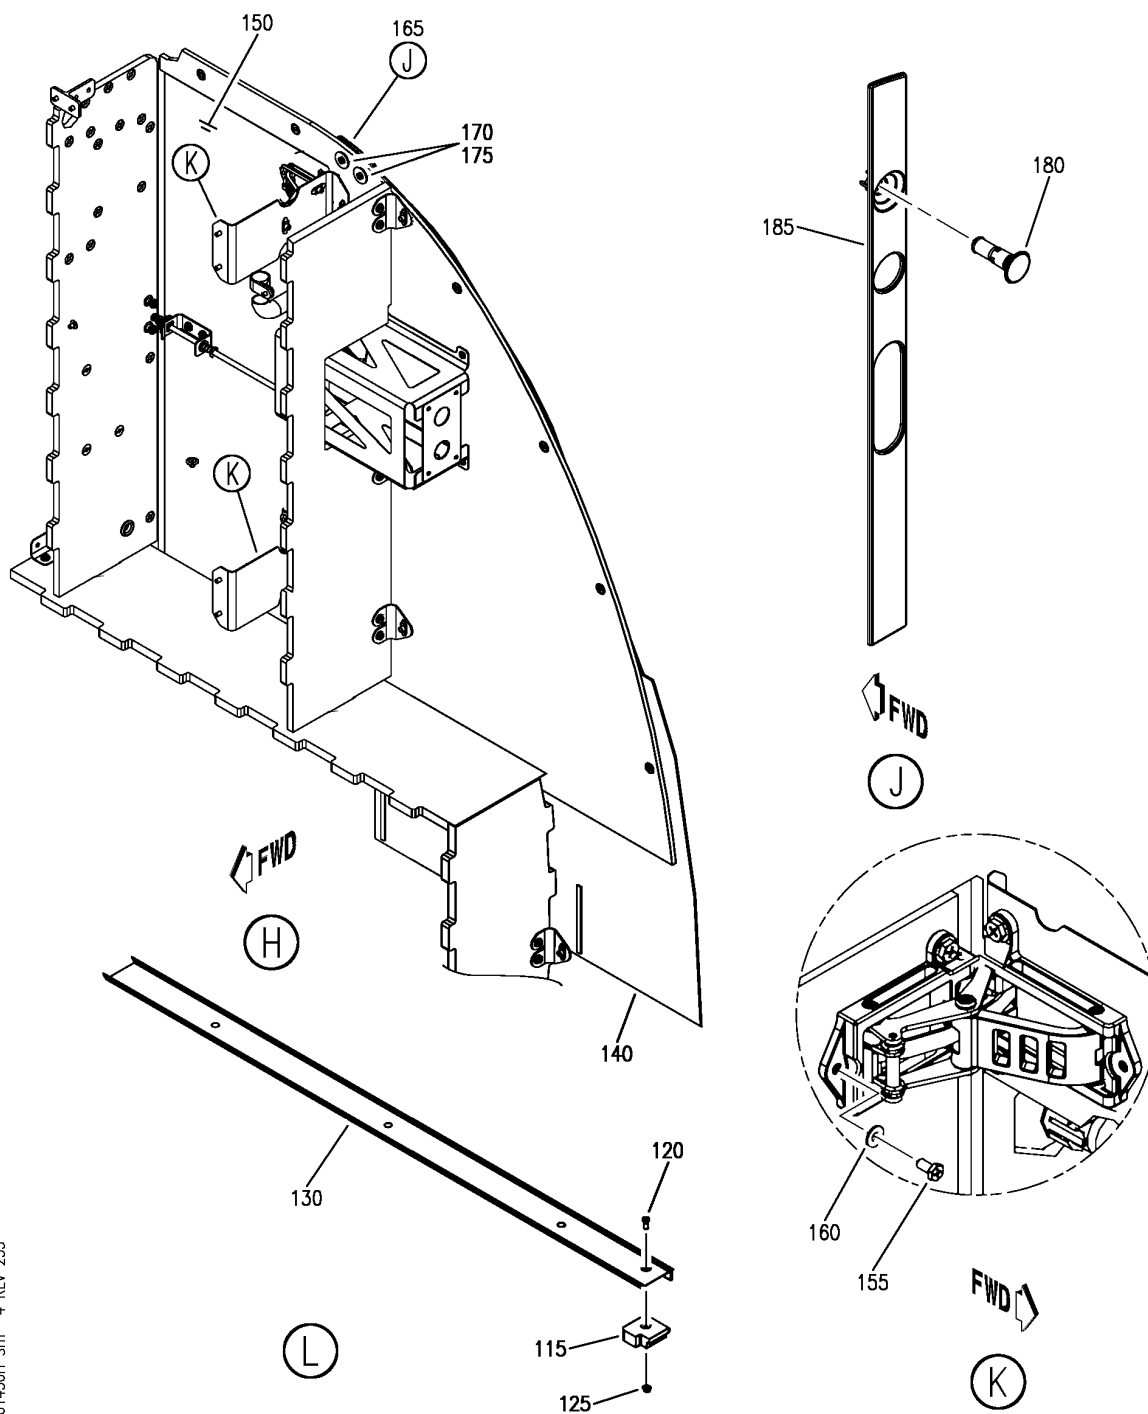

E 25401450H SHT 4 REV 235

STRUCTURE ASSY-LAV D  
FIGURE 50H (SHEET 4)


**25-40-14-50H**

R/YR  
OCT 15/16

25-40-14-50H  
PAGE 0C

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

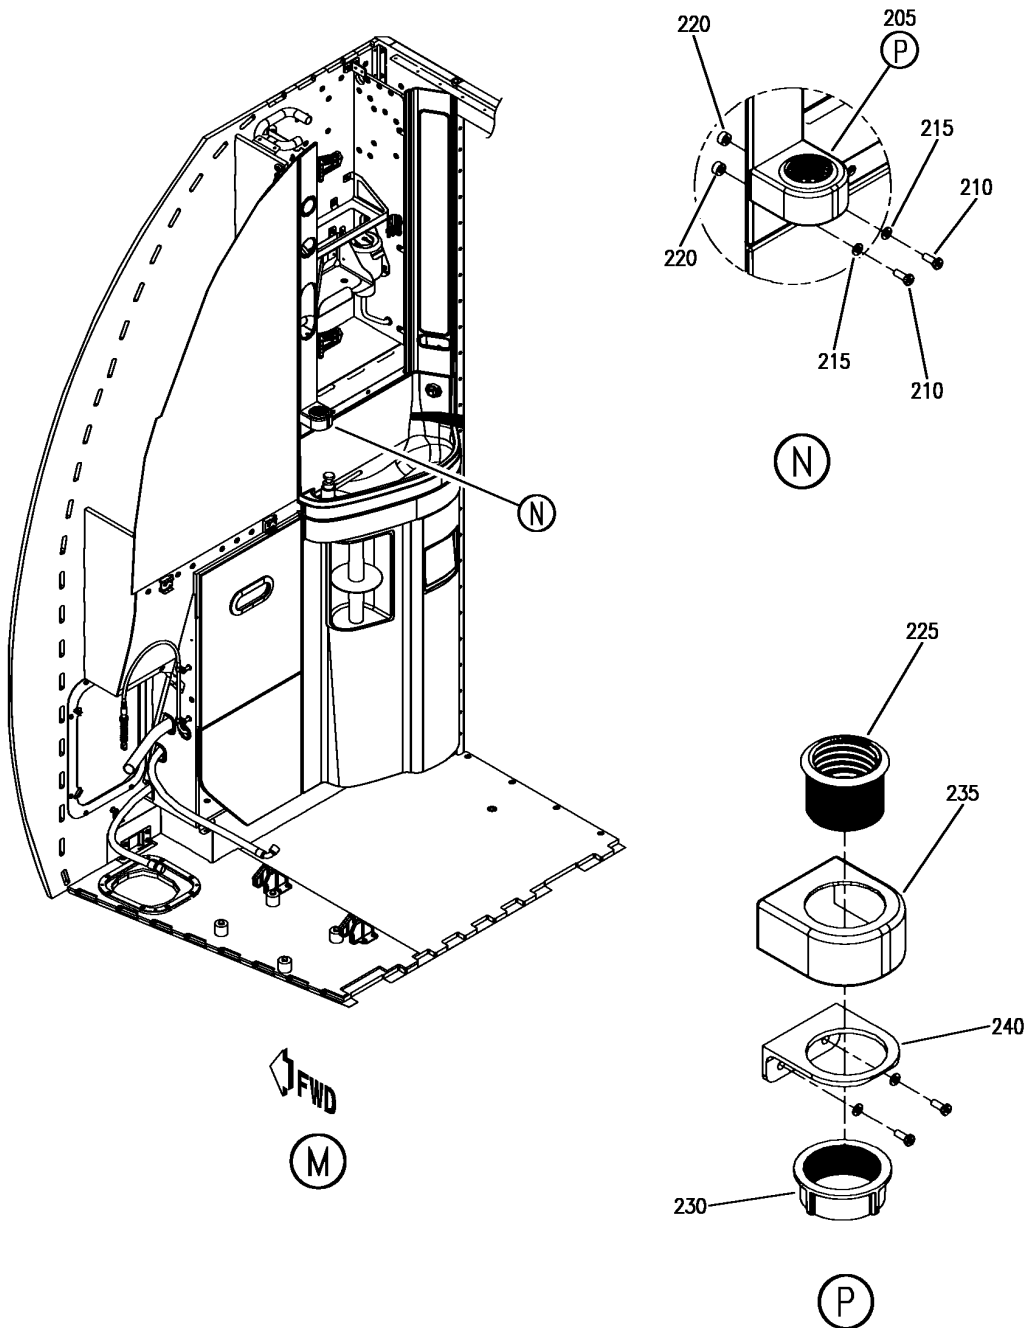

E 25401450H SHT 5 REV 241

STRUCTURE ASSY-LAV D  
FIGURE 50H (SHEET 5)

**25-40-14-50H**

RJR  
OCT 15/16

25-40-14-50H  
PAGE 00

ECCN 9E991 BOEING PROPRIETARY – See title page for details.




**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 | NOMENCLATURE                                                                                             | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|---------------|----------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 50H                                                     |                |               |                                                                                                          |                   |                      |
| - 1                                                     | 1L306041-151CH |               | STRUCTURE ASSY-LAV D<br>STRUCTURE ASSY-LAV D<br>SUPPLIER CODE:<br>V6S8D7<br>FOR NHA SEE:<br>25-40-14-12W | 417459<br>417437  | RF                   |
| - 2                                                     | 1L306041-151EE |               | STRUCTURE ASSY-LAV D<br>SUPPLIER CODE:<br>V6S8D7<br>FOR NHA SEE:<br>25-40-14-13P                         | 438459            | RF                   |
| 5                                                       | 1L500409-841CH |               | .PLATE-COVER<br>SUPPLIER CODE:<br>V6S8D7<br>MISCELLANEOUS DATA:<br>BAC93319<br>ATTACHING PARTS           | 417459            | 2                    |
| 10                                                      | NAS514P632-5   |               | .SCREW<br>-----*-----                                                                                    | 417459            | 4                    |
| 15                                                      | 1L500409-263   |               | .PLATE-COVER<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                                              | 417459            | 1                    |
| 20                                                      | NAS514P632-5   |               | .SCREW<br>-----*-----                                                                                    | 417459            | 2                    |
| 25                                                      | 1L500409-313   |               | .PLATE-COVER<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                                              | 417459            | 1                    |
| 30                                                      | NAS514P632-5   |               | .SCREW<br>-----*-----                                                                                    | 417459            | 2                    |
| 35                                                      | 1L500409-253   |               | .PLATE-SHEAR<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                                              | 417459            | 2                    |
| 40                                                      | BACB30VF3K1    |               | .BOLT<br>-----*-----                                                                                     | 417459            | 10                   |
| 45                                                      | 1L500409-257   |               | .PLATE-SHEAR<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                                              | 417459            | 2                    |
| 50                                                      | BACB30VF3K1    |               | .BOLT<br>-----*-----                                                                                     | 417459            | 10                   |
| 55                                                      | 1L500409-155   |               | .PANEL-<br>SUPPLIER CODE:<br>V6S8D7                                                                      | 417459            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |               |                                                                                                          |                   |                      |

- ITEM NOT ILLUSTRATED

RYR

25-40-14-50H

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-14  
FIG. 50H  
PAGE 1  
JUN 15/24


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER   | 1 2 3 4 5 6 7 NOMENCLATURE                                                                       | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|---------------|--------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 50H                                                     |               |                                                                                                  |                   |                      |
| 60                                                      | NAS517-3-5    | ATTACHING PARTS<br>.SCREW<br>STANDARD SUBSTITUTION:<br>BACB30LU3-5<br>BACB30LH3-5<br>-----*----- | 417459            | 4                    |
| 65                                                      | 1L500407-211  | .PAN-COVER<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                                        | 417459            | 1                    |
| 70                                                      | NAS1801-3-6   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                                                  | 417459            | 8                    |
| 75                                                      | NAS1149D0332J | .WASHER<br>-----*-----                                                                           | 417459            | 8                    |
| 80                                                      | 1L400105-33CH | .DOOR ASSY-<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-41-17-14A                      | 417437            | 1                    |
| 81                                                      | 1L400105-33EE | .DOOR ASSY-<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-41-17-14G                      | 438459            | 1                    |
| 85                                                      | NAS8603-3     | ATTACHING PARTS<br>.BOLT<br>-----*-----                                                          | 417459            | 13                   |
| 90                                                      | 1L500109-301  | .TRIM-EDGE<br>SUPPLIER CODE:<br>V6S8D7                                                           | 417459            | 1                    |
| 95                                                      | 1L400109-93   | .SWITCH ASSY-<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>33-26-03-14P                    | 417459            | 1                    |
| 100                                                     | NAS8703A1     | ATTACHING PARTS<br>.BOLT<br>STANDARD SUBSTITUTION:<br>BACB30ZE3K1<br>-----*-----                 | 417459            | 2                    |
| 105                                                     | 1L500109-461  | .TRIM ASSY-DOOR<br>SUPPLIER CODE:<br>V6S8D7                                                      | 417459            | 1                    |
| 110                                                     | NAS8703A4     | ATTACHING PARTS<br>.BOLT<br>STANDARD SUBSTITUTION:<br>BACB30ZE3K4<br>-----*-----                 | 417459            | 3                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |               |                                                                                                  |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R

25-40-14-50H

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-14  
FIG. 50H  
PAGE 2  
APR 15/23


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER  | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                                          | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|--------------|-------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 50H<br>115                                              | 1L500105-169 | ..BLOCK-CLOSE-OUT<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                                                                    | 417459            | 1                    |
| 120                                                     | NAS514P440-5 | ..SCREW                                                                                                                             | 417459            | 1                    |
| 125                                                     | MS21042-04   | ..NUT<br>STANDARD SUBSTITUTION:<br>MS21042L04<br>BACN11AG04<br>-----*-----                                                          | 417459            | 1                    |
| 130                                                     | 1L500109-459 | ..TRIM-DOOR OPENING<br>SUPPLIER CODE:<br>V6S8D7<br>CONFIG CHG DATA FROM A CMM:<br>SUPSD BY 1L500109-627                             | 417459            | 1                    |
| 130                                                     | 1L500109-627 | ..TRIM-DOOR OPENING<br>SUPPLIER CODE:<br>V6S8D7<br>CONFIG CHG DATA FROM A CMM:<br>SUPERSEDES 1L500109-459                           | 417459            | 1                    |
| 135                                                     | 1L500409-267 | .SPACER-BLK<br>SUPPLIER CODE:<br>V6S8D7                                                                                             | 417459            | 3                    |
| 140                                                     | 1L400403-155 | .MIRROR ASSY-FIXED<br>SUPPLIER CODE:<br>V6S8D7<br>CONFIG CHG DATA FROM A CMM:<br>SUPSD BY 1L400403-717<br>SUPSD BY 1L400403-719     | 417459            | 1                    |
| 140                                                     | 1L400403-717 | .MIRROR ASSY-FIXED<br>SUPPLIER CODE:<br>V6S8D7<br>CONFIG CHG DATA FROM A CMM:<br>SUPERSEDES 1L400403-155<br>SUPSD BY 1L400403-719   | 417459            | 1                    |
| 140                                                     | 1L400403-719 | .MIRROR ASSY-FIXED<br>SUPPLIER CODE:<br>V6S8D7<br>CONFIG CHG DATA FROM A CMM:<br>SUPERSEDES 1L400403-717<br>SUPERSEDES 1L400403-155 | 417459            | 1                    |
| - 145                                                   | 1L500403-351 | ..MIRROR-<br>SUPPLIER CODE:<br>V6S8D7<br>USED ON:<br>1L400403-155<br>1L400403-719                                                   | 417459            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |              |                                                                                                                                     |                   |                      |

- ITEM NOT ILLUSTRATED

R Y R

# 25-40-14-50H

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-14  
 FIG. 50H  
 PAGE 3  
 JUN 15/24


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER   | 1 2 3 4 5 6 7 | NOMENCLATURE                                                                                                       | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|---------------|---------------|--------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 50H                                                     |               |               |                                                                                                                    |                   |                      |
| - 145                                                   | 1L500403-345  |               | ..MIRROR-<br>SUPPLIER CODE:<br>V6S8D7<br>USED ON:<br>1L400403-717                                                  | 417459            | 1                    |
| - 147                                                   | 1L500045-67   |               | ..DOUBLER-<br>SUPPLIER CODE:<br>V6S8D7                                                                             | 417459            | 1                    |
| 150                                                     | 1L400403-99   |               | .MIRROR ASSY-HINGED<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-41-51-46X<br>ATTACHING PARTS             | 417459            | 1                    |
| 155                                                     | NAS1801-3-5   |               | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-5                                                                    | 417459            | 6                    |
| 160                                                     | NAS1149D0332J |               | .WASHER<br>-----*-----                                                                                             | 417459            | 6                    |
| 165                                                     | 1L400403-27   |               | .STRIP ASSY-AMENITIES<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                                               | 417459            | 1                    |
| 170                                                     | NAS1801-08-6  |               | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN08-6                                                                   | 417459            | 4                    |
| 175                                                     | AN970-3       |               | .WASHER<br>-----*-----                                                                                             | 417459            | 4                    |
| 180                                                     | 1L400203-13   |               | ..GASPER-<br>SUPPLIER CODE:<br>V6S8D7                                                                              | 417459            | 1                    |
| 185                                                     | 1L500403-19   |               | ..STRIP-<br>SUPPLIER CODE:<br>V6S8D7                                                                               | 417459            | 1                    |
| - 186                                                   | SJ4580        |               | ..FASTENER-TAPE, RECLOSABLE<br>SUPPLIER CODE:<br>V76381<br>MISCELLANEOUS DATA:<br>ORDER LCFT000012                 | 417459            | AR                   |
| - 186                                                   | LCFT000012    |               | ..FASTENER-TAPE, RECLOSABLE<br>SUPPLIER CODE:<br>V76381<br>MISCELLANEOUS DATA:<br>3M COMPANY PART NUMBER<br>SJ4580 | 417459            | AR                   |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |               |               |                                                                                                                    |                   |                      |

- ITEM NOT ILLUSTRATED

R Y R

25-40-14-50H

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-14  
FIG. 50H  
PAGE 4  
JUN 15/24


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER     | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                                                                                                                               | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|-----------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 50H<br>- 190                                            | 1L306041-151CH1 | .STRUCTURE INSTL-<br>SUPPLIER CODE:<br>V6S8D7<br>MISCELLANEOUS DATA:<br>NON PROCURABLE<br>FUNCTIONAL REFERENCE:<br>EQUIPMENT/FURNISHINGS<br>FOR DETAILS SEE<br>25-41-51-04Q<br>LIGHTS<br>FOR DETAILS SEE<br>33-26-03-25Y | 417437            | RF                   |
| - 191                                                   | 1L306041-151EE1 | .STRUCTURE INSTL-<br>SUPPLIER CODE:<br>V6S8D7<br>MISCELLANEOUS DATA:<br>NON PROCURABLE<br>FUNCTIONAL REFERENCE:<br>EQUIPMENT/FURNISHINGS<br>FOR DETAILS SEE<br>25-41-51-04Q<br>LIGHTS<br>FOR DETAILS SEE<br>33-26-03-25Y | 438459            | RF                   |
| - 195                                                   | 1L306041-151CH2 | .STRUCTURE INSTL-<br>SUPPLIER CODE:<br>V6S8D7<br>MISCELLANEOUS DATA:<br>NON PROCURABLE<br>FOR DETAILS SEE:<br>25-40-14-50J                                                                                               | 417437            | RF                   |
| - 196                                                   | 1L306041-151EE2 | .STRUCTURE INSTL-<br>SUPPLIER CODE:<br>V6S8D7<br>MISCELLANEOUS DATA:<br>NON PROCURABLE<br>FOR DETAILS SEE:<br>25-40-14-50J                                                                                               | 438459            | RF                   |
| - 200                                                   | 1L306041-151CH3 | .STRUCTURE INSTL-<br>SUPPLIER CODE:<br>V6S8D7<br>MISCELLANEOUS DATA:<br>NON PROCURABLE<br>FOR DETAILS SEE:<br>25-40-14-50K                                                                                               | 417437            | RF                   |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                 |                                                                                                                                                                                                                          |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R

# 25-40-14-50H

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

25-40-14  
 FIG. 50H  
 PAGE 5  
 JUN 15/24


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER     | 1 2 3 4 5 6 7 | NOMENCLATURE                                                                                                              | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|-----------------|---------------|---------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 50H<br>- 201                                            | 1L306041-151EE3 | .             | STRUCTURE INSTL-<br>SUPPLIER CODE:<br>V6S8D7<br>MISCELLANEOUS DATA:<br>NON PROCURABLE<br>FOR DETAILS SEE:<br>25-40-14-50K | 438459            | RF                   |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                 |               |                                                                                                                           |                   |                      |

— ITEM NOT ILLUSTRATED


RYR

# 25-40-14-50H

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

25-40-14  
 FIG. 50H  
 PAGE 6  
 JUN 15/24

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

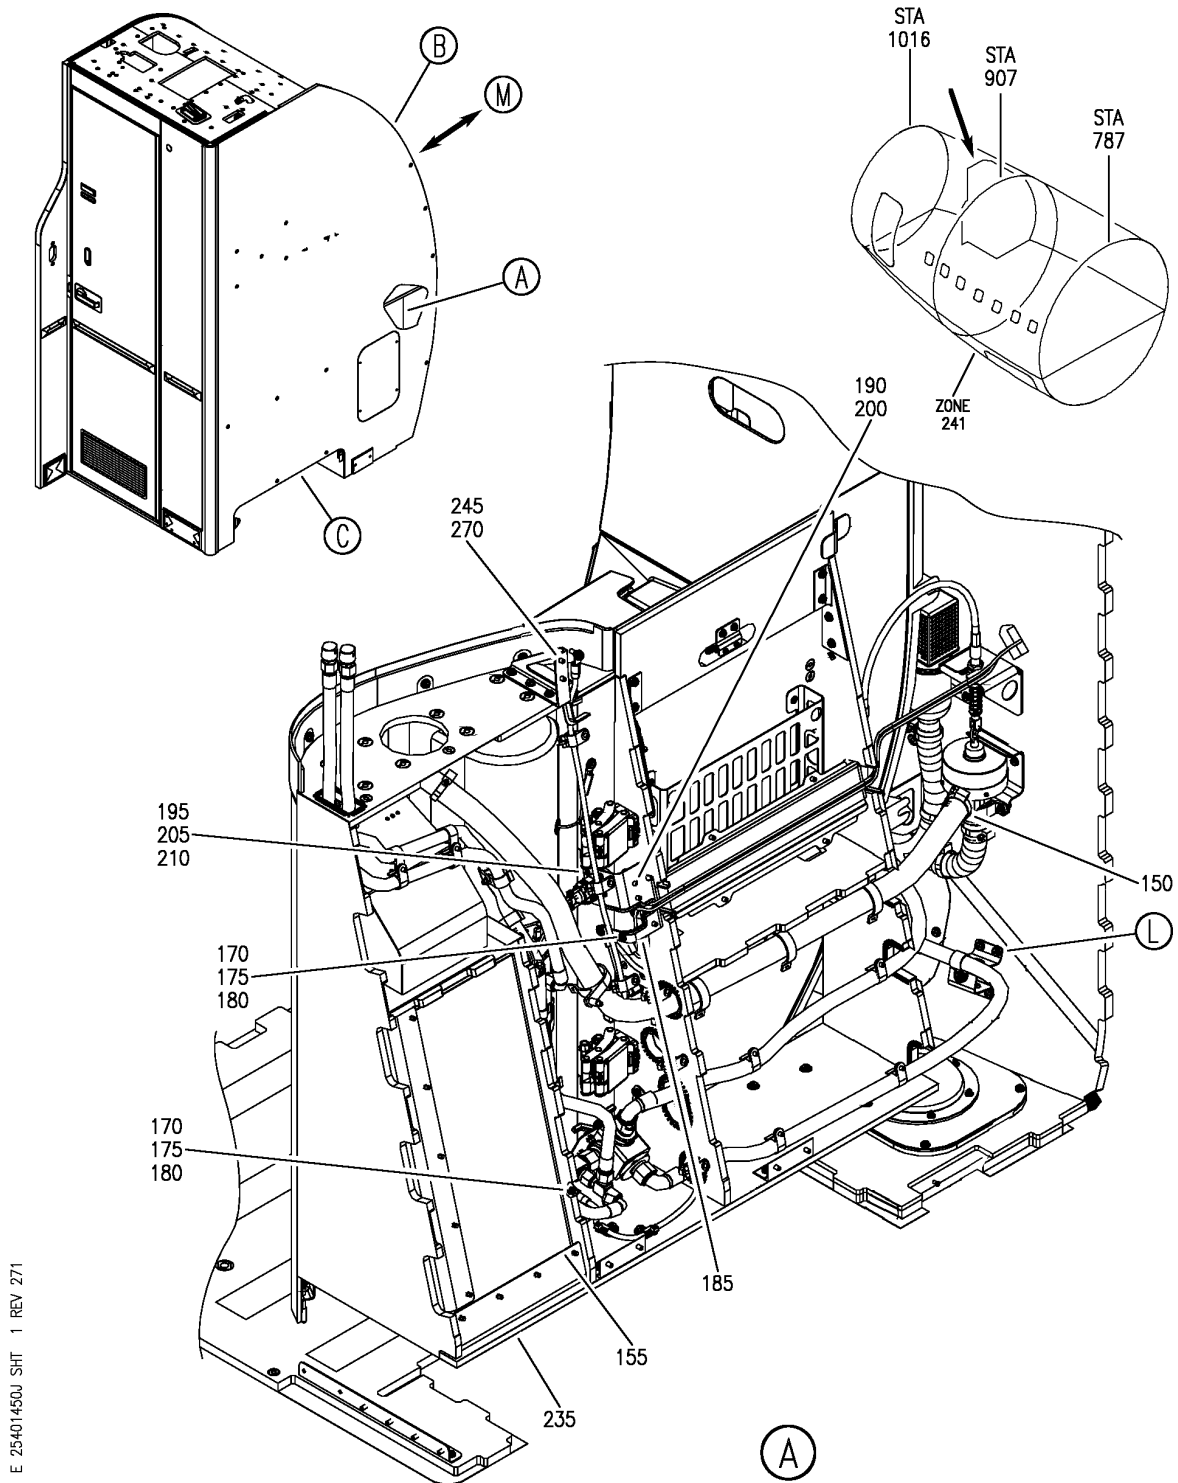

E 25401450J SHT 1 REV 271

STRUCTURE INSTL  
FIGURE 50J (SHEET 1)


**25-40-14-50J**

R/YR  
APR 15/25

25-40-14-50J  
PAGE 0

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

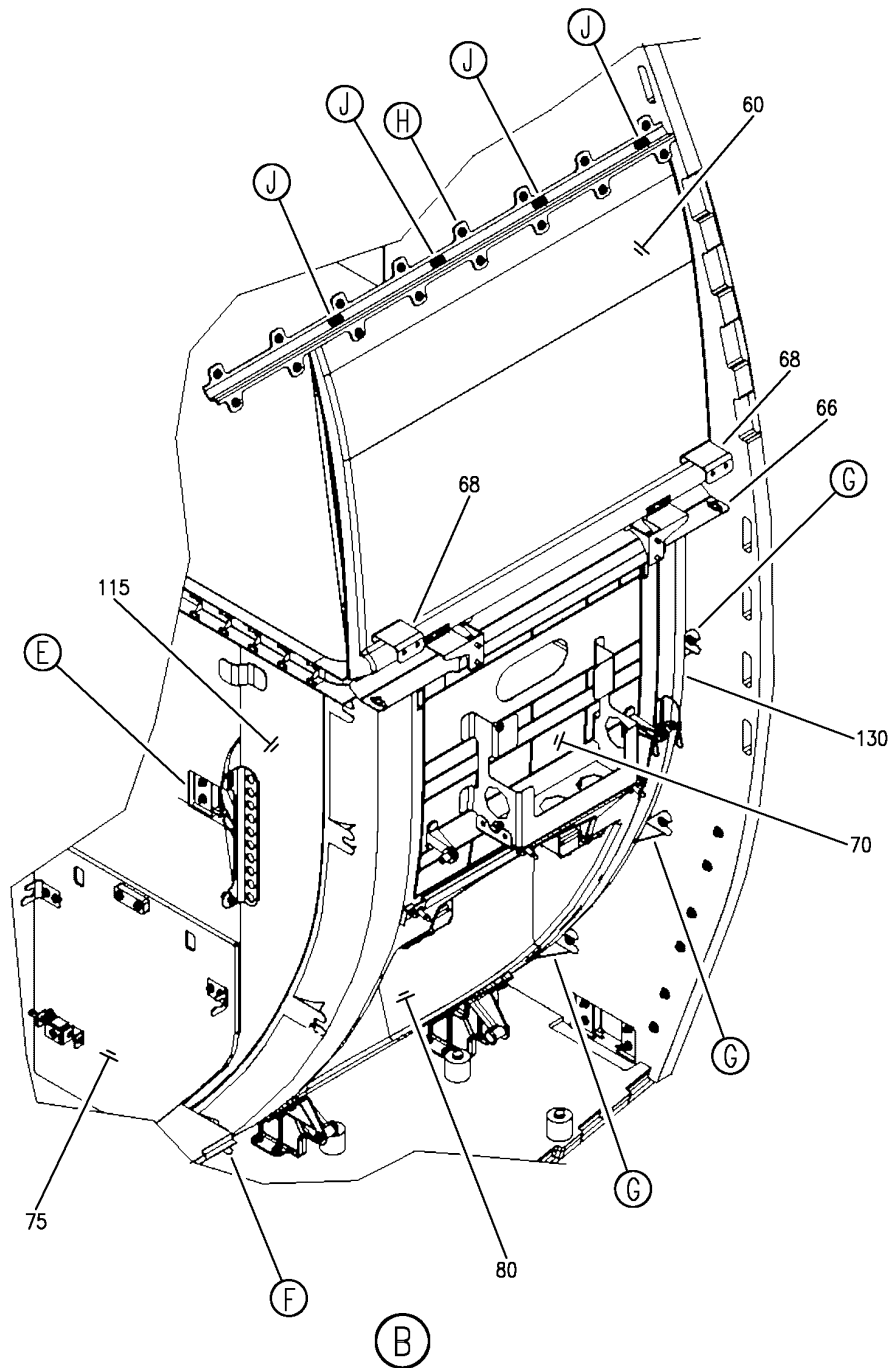

E 25401450J SHT 2 REV 345

STRUCTURE INSTL  
FIGURE 50J (SHEET 2)

**25-40-14-50J**



R Y R  
APR 15/25

25-40-14-50J  
PAGE 0A

ECCN 9E991 BOEING PROPRIETARY – See title page for details.



**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

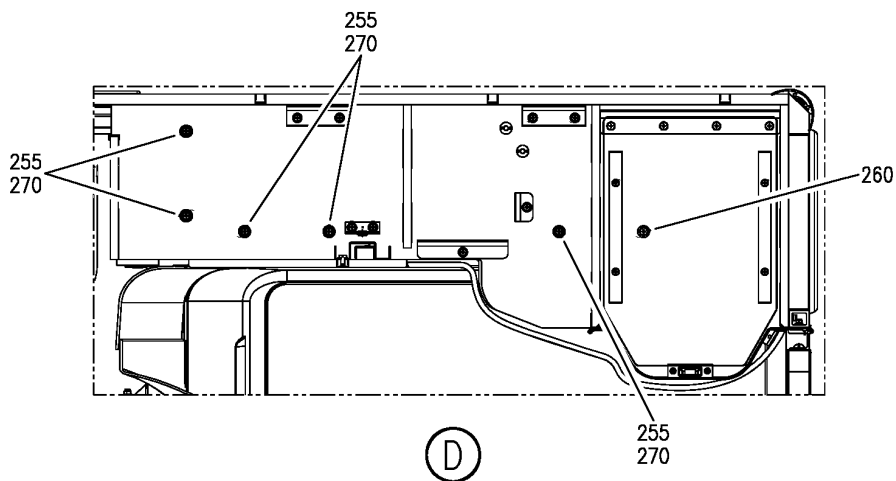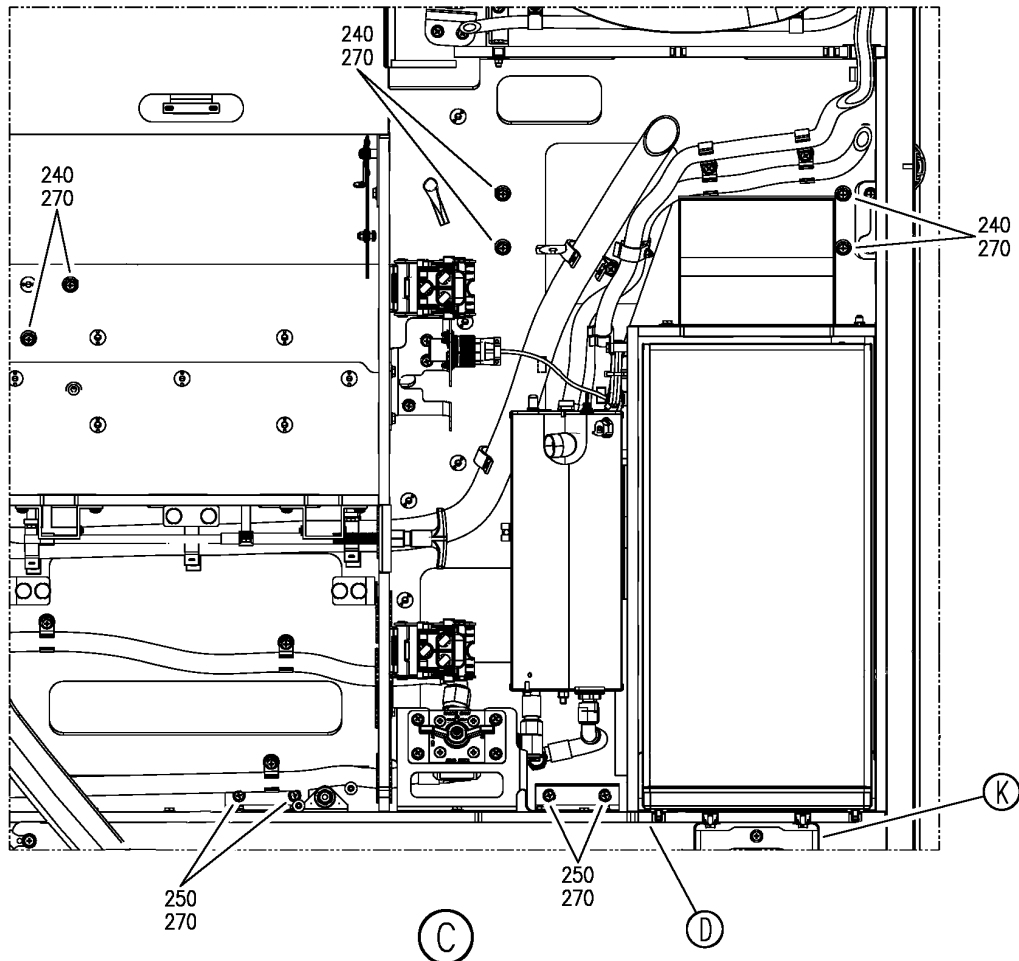

E 25401450J SHT 3 REV 235

STRUCTURE INSTL  
FIGURE 50J (SHEET 3)


**25-40-14-50J**

RJR  
APR 15/25

25-40-14-50J  
PAGE 0B

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

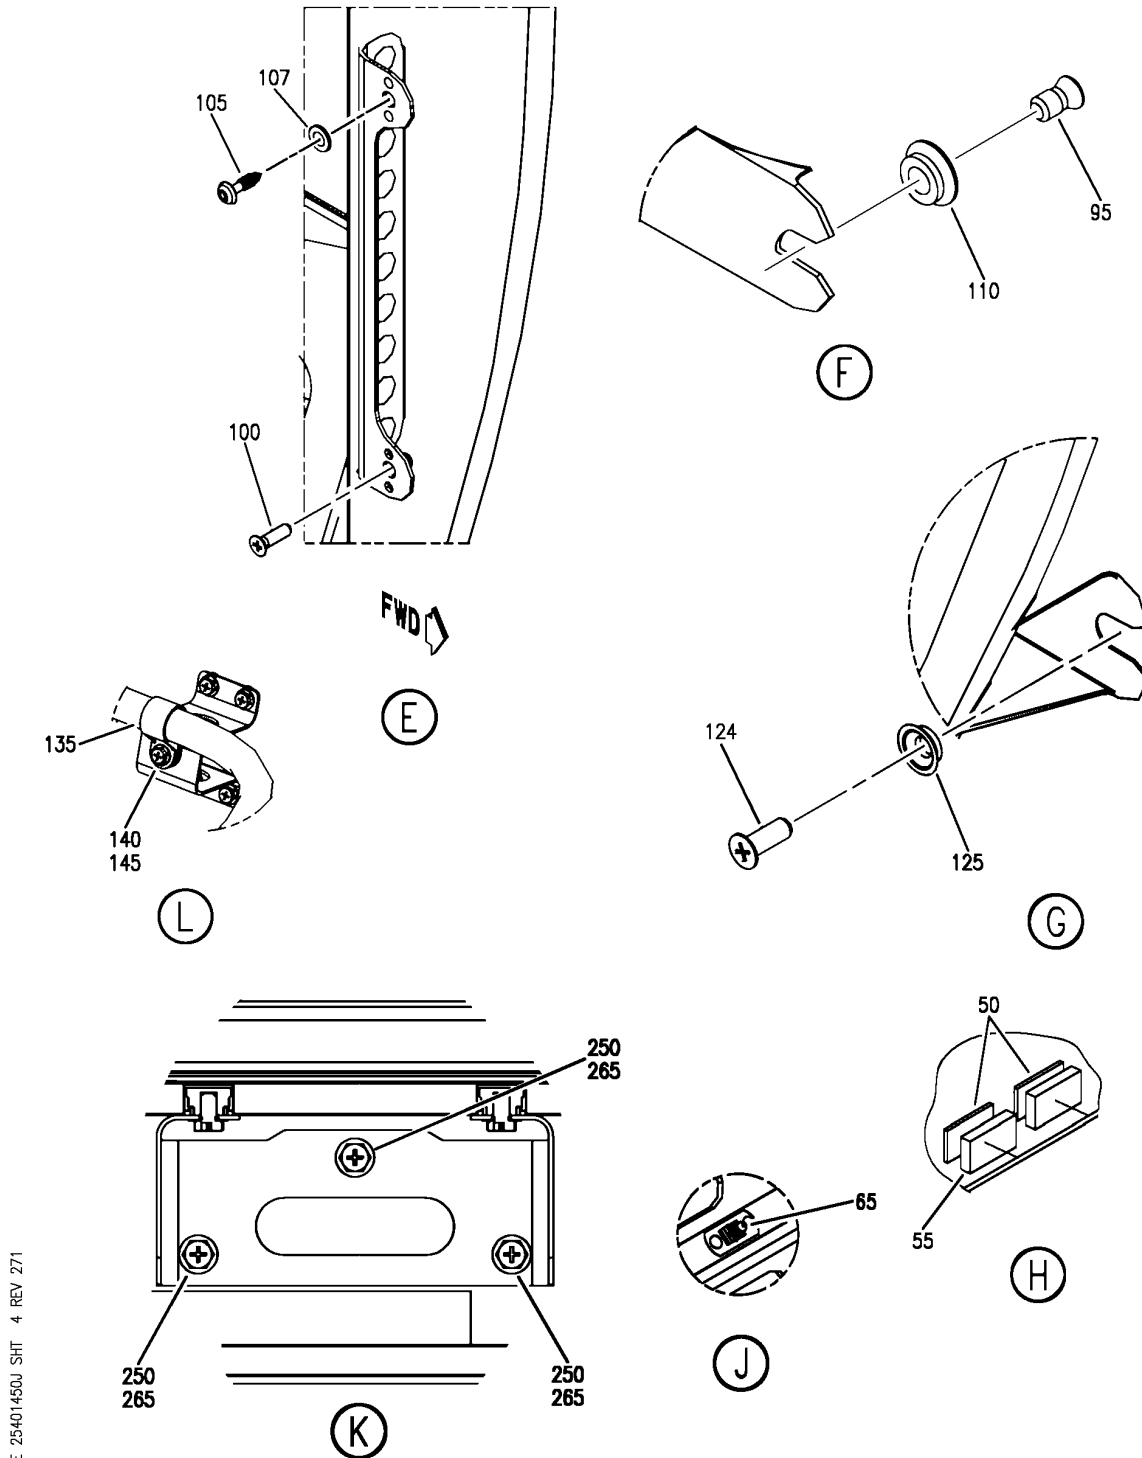

E 25401450J SHT 4 REV 271


STRUCTURE INSTL  
FIGURE 50J (SHEET 4)

**25-40-14-50J**

R Y R  
APR 15 / 25

25-40-14-50J  
PAGE 0C

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

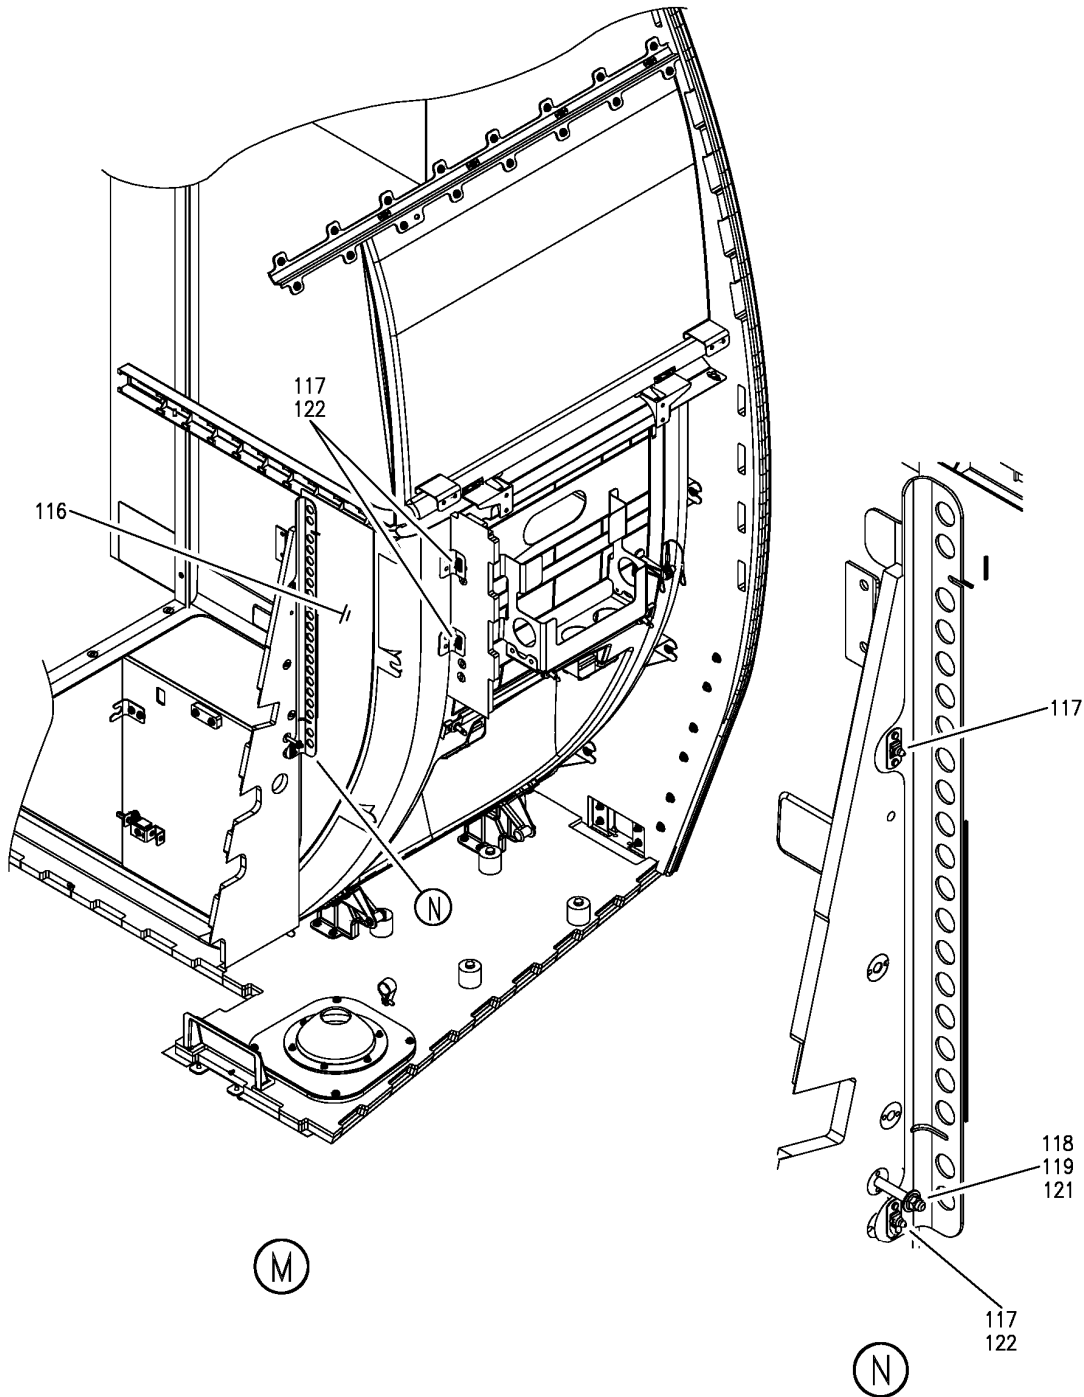

E 25401450J SHT 5 REV 271

STRUCTURE INSTL  
FIGURE 50J (SHEET 5)

**25-40-14-50J**

R Y R  
APR 15/25

25-40-14-50J  
PAGE 0D

ECCN 9E991 BOEING PROPRIETARY – See title page for details.


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER     | 1 2 3 4 5 6 7 | NOMENCLATURE                                                                                                                                                    | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|-----------------|---------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 50J                                                     |                 |               |                                                                                                                                                                 |                   |                      |
| - 1                                                     | 1L306041-151CH2 |               | STRUCTURE INSTL<br>STRUCTURE INSTL-LAV D<br>SUPPLIER CODE:<br>V6S8D7<br>FOR NHA SEE:<br>25-40-14-50H                                                            | 417459<br>417437  | RF                   |
| - 2                                                     | 1L306041-151EE2 |               | STRUCTURE INSTL-LAV D<br>SUPPLIER CODE:<br>V6S8D7<br>FOR NHA SEE:<br>25-40-14-50H                                                                               | 438459            | RF                   |
| 50                                                      | 65PWF02         |               | .MAGNET-RECTANGULAR<br>SUPPLIER CODE:<br>V1B3S4<br>MISCELLANEOUS DATA:<br>ORDER LCCS7-2A                                                                        | 417459            | 2                    |
| 50                                                      | LCCS7-2A        |               | .MAGNET-RECTANGULAR<br>SUPPLIER CODE:<br>V6S8D7<br>TRUE PART NUMBER:<br>LCCS-7-2-A<br>MISCELLANEOUS DATA:<br>ADAMS MAGNETIC PRODUCTS<br>CO. PART NUMBER 65PWF02 | 417459            | 2                    |
| 55                                                      | 1L500411-67     |               | .SPACER-MAGNET<br>SUPPLIER CODE:<br>V6S8D7                                                                                                                      | 417459            | 2                    |
| - 56                                                    | 9L500001-310    |               | .MOUNTING INSTL-TIE,<br>ELECTRICAL<br>SUPPLIER CODE:<br>V6S8D7                                                                                                  | 417459            | 1                    |
| - 57                                                    | MS3367-5-9      |               | ..STRAP<br>STANDARD SUBSTITUTION:<br>BACS38K5                                                                                                                   | 417459            | 1                    |
| - 58                                                    | TM3S10          |               | ..MOUNT-CABLE<br>SUPPLIER CODE:<br>V06383<br>ATTACHING PARTS                                                                                                    | 417459            | 1                    |
| - 59                                                    | NAS514P1032-8   |               | ..SCREW<br>-----*-----                                                                                                                                          | 417459            | 1                    |
| 60                                                      | 1L400411-57     |               | .SHROUD-BABY CHANGING TABLE<br>SUPPLIER CODE:<br>V6S8D7                                                                                                         | 417459            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                 |               |                                                                                                                                                                 |                   |                      |

- ITEM NOT ILLUSTRATED

R Y R

25-40-14-50J

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-14  
FIG. 50J  
PAGE 1  
APR 15/25


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 | NOMENCLATURE                                                                                                                           | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|---------------|----------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 50J                                                     |                |               |                                                                                                                                        |                   |                      |
| 65                                                      | 09T203         |               | ATTACHING PARTS<br>.SCREW-<br>SUPPLIER CODE:<br>V94222<br>TRUE PART NUMBER:<br>09-T-203<br>-----*-----                                 | 417459            | 4                    |
| 66                                                      | 1L400100-103   |               | .SHIELD-TRAP<br>SUPPLIER CODE:<br>V6S8D7                                                                                               | 417459            | 1                    |
| - 67                                                    | BAC1521-827    |               | .SEAL-<br>MISCELLANEOUS DATA:<br>ORDER LCSR000010                                                                                      | 417459            | AR                   |
| - 67                                                    | LCSR000010     |               | .SEAL-EXTRUDED SILICONE<br>RUBBER<br>SUPPLIER CODE:<br>V6S8D7<br>MISCELLANEOUS DATA:<br>THE BOEING COMPANY, PART<br>NUMBER BAC1521-827 | 417459            | AR                   |
| 68                                                      | 1L500100-101   |               | .STABILIZER-SHROUD<br>SUPPLIER CODE:<br>V6S8D7                                                                                         | 417459            | 2                    |
| 70                                                      | 1L400407-53    |               | .FACE ASSY-SEAT COVER<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-41-21-15F                                                  | 417459            | 1                    |
| 75                                                      | 1L400401-51    |               | .PANEL ASSY-AMENITIES BOX<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-41-51-50N                                              | 417459            | 1                    |
| 80                                                      | 1L400407-51    |               | .SHROUD ASSY-TOILET LID<br>SEAT<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-41-21-15G                                        | 417459            | 1                    |
| 95                                                      | NAS514P1032-10 |               | .SCREW                                                                                                                                 | 417459            | 1                    |
| 100                                                     | NAS514P1032-12 |               | .SCREW-<br>SB DATA FROM A CMM:<br>PRE SB 1L3-25-0057                                                                                   | 417459            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |               |                                                                                                                                        |                   |                      |

- ITEM NOT ILLUSTRATED

R Y R

25-40-14-50J

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-14  
 FIG. 50J  
 PAGE 2  
 APR 15/25


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER   | 1 2 3 4 5 6 7 | NOMENCLATURE                                                                                                                          | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|---------------|---------------|---------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 50J<br>105                                              | 09T305        |               | .SCREW-<br>SUPPLIER CODE:<br>V94222<br>TRUE PART NUMBER:<br>09-T-305<br>SB DATA FROM A CMM:<br>PRE SB 1L3-25-0057                     | 417459            | 1                    |
| 107                                                     | NAS1149D0332J |               | .WASHER-<br>SB DATA FROM A CMM:<br>PRE SB 1L3-25-0057                                                                                 | 417459            | 1                    |
| 110                                                     | 1L500407-203  |               | .FASTENER-SNAP<br>SUPPLIER CODE:<br>V6S8D7                                                                                            | 417459            | 1                    |
| 115                                                     | 1L400407-25   |               | .SHROUD-RH<br>SUPPLIER CODE:<br>V6S8D7<br>SB DATA FROM A CMM:<br>PRE SB 1L3-25-0057                                                   | 417459            | 1                    |
| 116                                                     | 1L400407-259  |               | .SHROUD-RH<br>SUPPLIER CODE:<br>V6S8D7<br>SB DATA FROM A CMM:<br>POST SB 1L3-25-0057                                                  | 417459            | 1                    |
| 116                                                     | 1L400407-259  |               | .SHROUD-RH<br>SUPPLIER CODE:<br>V6S8D7                                                                                                | 417459            | 1                    |
| 117                                                     | 09T407        |               | ATTACHING PARTS<br>.SCREW-<br>SUPPLIER CODE:<br>V94222<br>TRUE PART NUMBER:<br>09-T-407<br>SB DATA FROM A CMM:<br>POST SB 1L3-25-0057 | 417459            | 4                    |
| 117                                                     | 09T305        |               | .SCREW-<br>SUPPLIER CODE:<br>V94222<br>TRUE PART NUMBER:<br>09-T-305                                                                  | 417459            | 4                    |
| 118                                                     | NAS1801-3-26  |               | .SCREW-<br>STANDARD SUBSTITUTION:<br>BACS12HN3-26<br>SB DATA FROM A CMM:<br>POST SB 1L3-25-0057                                       | 417459            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |               |               |                                                                                                                                       |                   |                      |

— ITEM NOT ILLUSTRATED

RYR

25-40-14-50J

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

25-40-14  
 FIG. 50J  
 PAGE 3  
 APR 15/25

 **BOEING**  
737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 NOMENCLATURE                                                                              | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|---------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 50J<br>119                                              | MS21042-3      | .NUT-<br>STANDARD SUBSTITUTION:<br>MS21042L3<br>BACN11AG3<br>SB DATA FROM A CMM:<br>POST SB 1L3-25-0057 | 417459            | 1                    |
| 121                                                     | NAS1149D0332J  | .WASHER-<br>SB DATA FROM A CMM:<br>POST SB 1L3-25-0057                                                  | 417459            | 2                    |
| 122                                                     | NAS1149DN832J  | .WASHER-<br>SB DATA FROM A CMM:<br>POST SB 1L3-25-0057                                                  | 417459            | 3                    |
| - 123                                                   | NAS1149D0332J  | .WASHER<br>-----*-----                                                                                  | 417459            | 4                    |
| 124                                                     | NAS514P1032-6  | .SCREW                                                                                                  | 417459            | 4                    |
| 125                                                     | 1L500407-203   | .FASTENER-SNAP<br>SUPPLIER CODE:<br>V6S8D7                                                              | 417459            | 4                    |
| 130                                                     | 1L500407-105   | .SHROUD-LH, OUTBD TOILET<br>SUPPLIER CODE:<br>V6S8D7                                                    | 417459            | 1                    |
| 135                                                     | MS25281F11     | .CLAMP-<br>TRUE PART NUMBER:<br>MS25281-F11<br>ATTACHING PARTS                                          | 417459            | 1                    |
| 140                                                     | NAS1801-3-10   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-10                                                        | 417459            | 1                    |
| 145                                                     | NAS1149D0332J  | .WASHER<br>-----*-----                                                                                  | 417459            | 1                    |
| 150                                                     | NAS1922-0125-3 | .CLAMP                                                                                                  | 417459            | 1                    |
| 155                                                     | 1L400101-67    | .CAN ASSY-WASTE<br>SUPPLIER CODE:<br>V6S8D7                                                             | 417459            | 1                    |
| - 160                                                   | MS3367-5-9     | .STRAP<br>STANDARD SUBSTITUTION:<br>BACS38K5                                                            | 417459            | AR                   |
| - 165                                                   | 9L500001-003   | .STUD INSTL-GND, ELECTRICAL<br>SUPPLIER CODE:<br>V6S8D7                                                 | 417459            | 3                    |
| 170                                                     | NAS1801-3-10   | ..SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-10                                                       | 417459            | 1                    |
| 175                                                     | NAS1149D0316H  | ..WASHER                                                                                                | 417459            | 3                    |
| 180                                                     | MS21042L3      | ..NUT<br>STANDARD SUBSTITUTION:<br>BACN11AG3                                                            | 417459            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |                                                                                                         |                   |                      |

- ITEM NOT ILLUSTRATED

R Y R

25-40-14-50J

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-14  
FIG. 50J  
PAGE 4  
APR 15/25


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 NOMENCLATURE                                                                           | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 50J<br>185                                              | 1L500401-193   | .BRACKET-DISC.<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                                        | 417459            | 1                    |
| 190                                                     | NAS1801-3-5    | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-5                                                      | 417459            | 5                    |
| 195                                                     | NAS1801-04-6   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN04-6                                                     | 417459            | 4                    |
| 200                                                     | NAS1149D0332J  | .WASHER                                                                                              | 417459            | 5                    |
| 205                                                     | NAS1149DN432J  | .WASHER                                                                                              | 417459            | 8                    |
| 210                                                     | MS21042L04     | .NUT<br>STANDARD SUBSTITUTION:<br>BACN11AG04<br>-----*-----                                          | 417459            | 4                    |
| - 215                                                   | 9L500001-051   | .STRAP INSTL-GND,<br>ELECTRICAL<br>SUPPLIER CODE:<br>V6S8D7                                          | 417459            | 1                    |
| - 220                                                   | 9L500001-201   | ..STANDOFF-HEXAGONAL<br>SUPPLIER CODE:<br>V6S8D7                                                     | 417459            | 1                    |
| - 225                                                   | NAS1149D0332H  | ..WASHER                                                                                             | 417459            | 2                    |
| - 230                                                   | MS21042L3      | ..NUT<br>STANDARD SUBSTITUTION:<br>BACN11AG3                                                         | 417459            | 1                    |
| 235                                                     | 1L406700-323   | .VANITY INSTL-LWR<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-41-51-50P<br>ATTACHING PARTS | 417459            | 1                    |
| 240                                                     | NAS1801-3-11   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-11                                                     | 417459            | 6                    |
| 245                                                     | NAS1801-3-5    | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-5                                                      | 417459            | 2                    |
| 250                                                     | NAS1801-3-6    | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                                                      | 417459            | 7                    |
| 255                                                     | NAS1801-3-14   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-14                                                     | 417459            | 5                    |
| 260                                                     | NAS514P1032-12 | .SCREW                                                                                               | 417459            | 1                    |
| 265                                                     | NAS1149D0316K  | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J                                                   | 417459            | 3                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |                                                                                                      |                   |                      |

- ITEM NOT ILLUSTRATED

R Y R

25-40-14-50J

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-14  
FIG. 50J  
PAGE 5  
APR 15/25




**BOEING**  
 737-600/700/800/900  
 PARTS CATALOG (MAINTENANCE)

| FIG<br>ITEM                                             | PART NUMBER   | 1 2 3 4 5 6 7 | NOMENCLATURE            | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|---------------|---------------|-------------------------|-------------------|----------------------|
| 50J<br>270                                              | NAS1149D0332J |               | . WASHER<br>-----*----- | 417459            | 17                   |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |               |               |                         |                   |                      |


— ITEM NOT ILLUSTRATED

R Y R

25-40-14-50J


ECCN 9E991 BOEING PROPRIETARY – See title page for details.

25-40-14  
 FIG. 50J  
 PAGE 6  
 APR 15/25

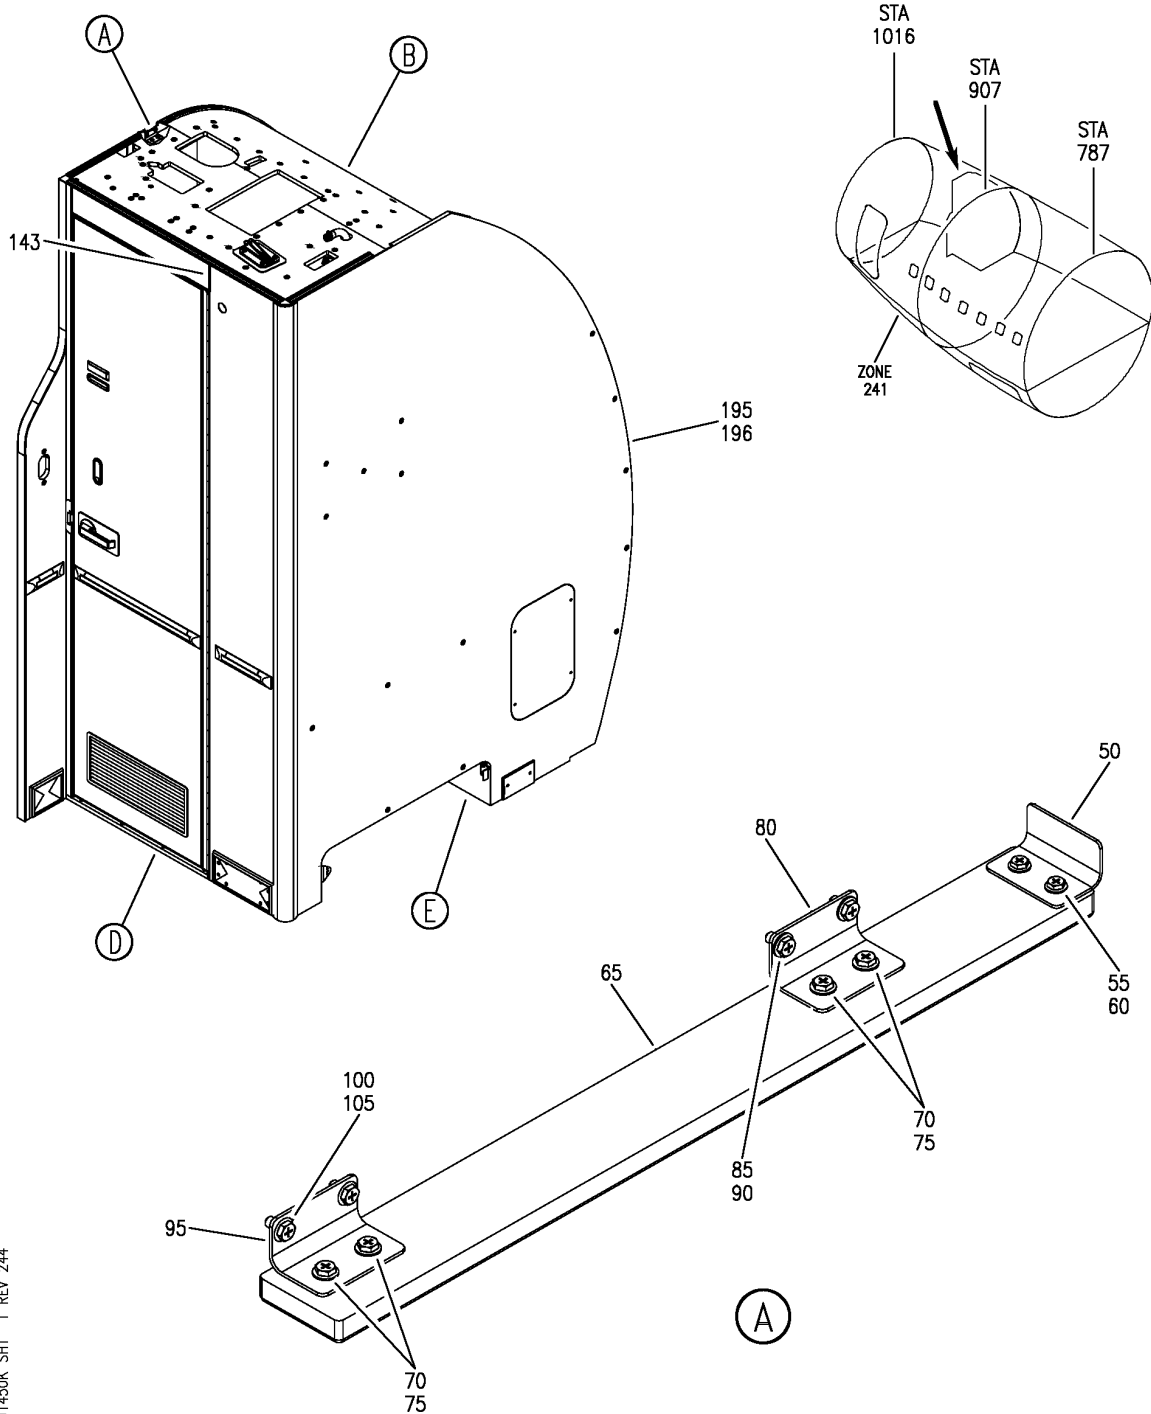

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

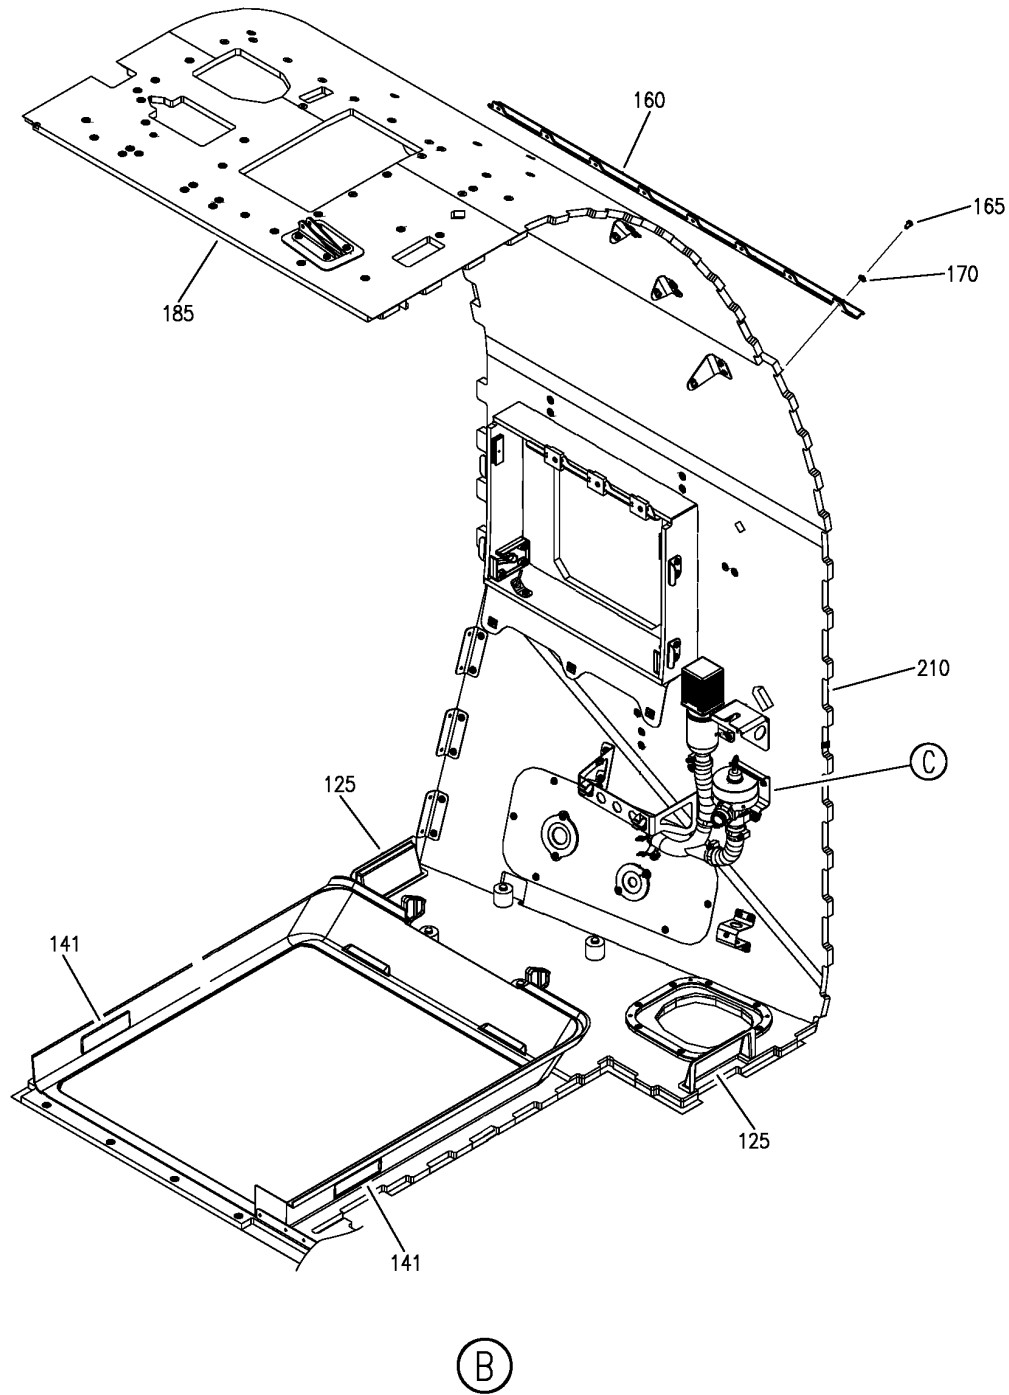

E 25401450K SHT 2 REV 241

STRUCTURE INSTL-LAV  
FIGURE 50K (SHEET 2)


**25-40-14-50K**

R Y R  
DEC 15 / 16

25-40-14-50K  
PAGE 0A

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

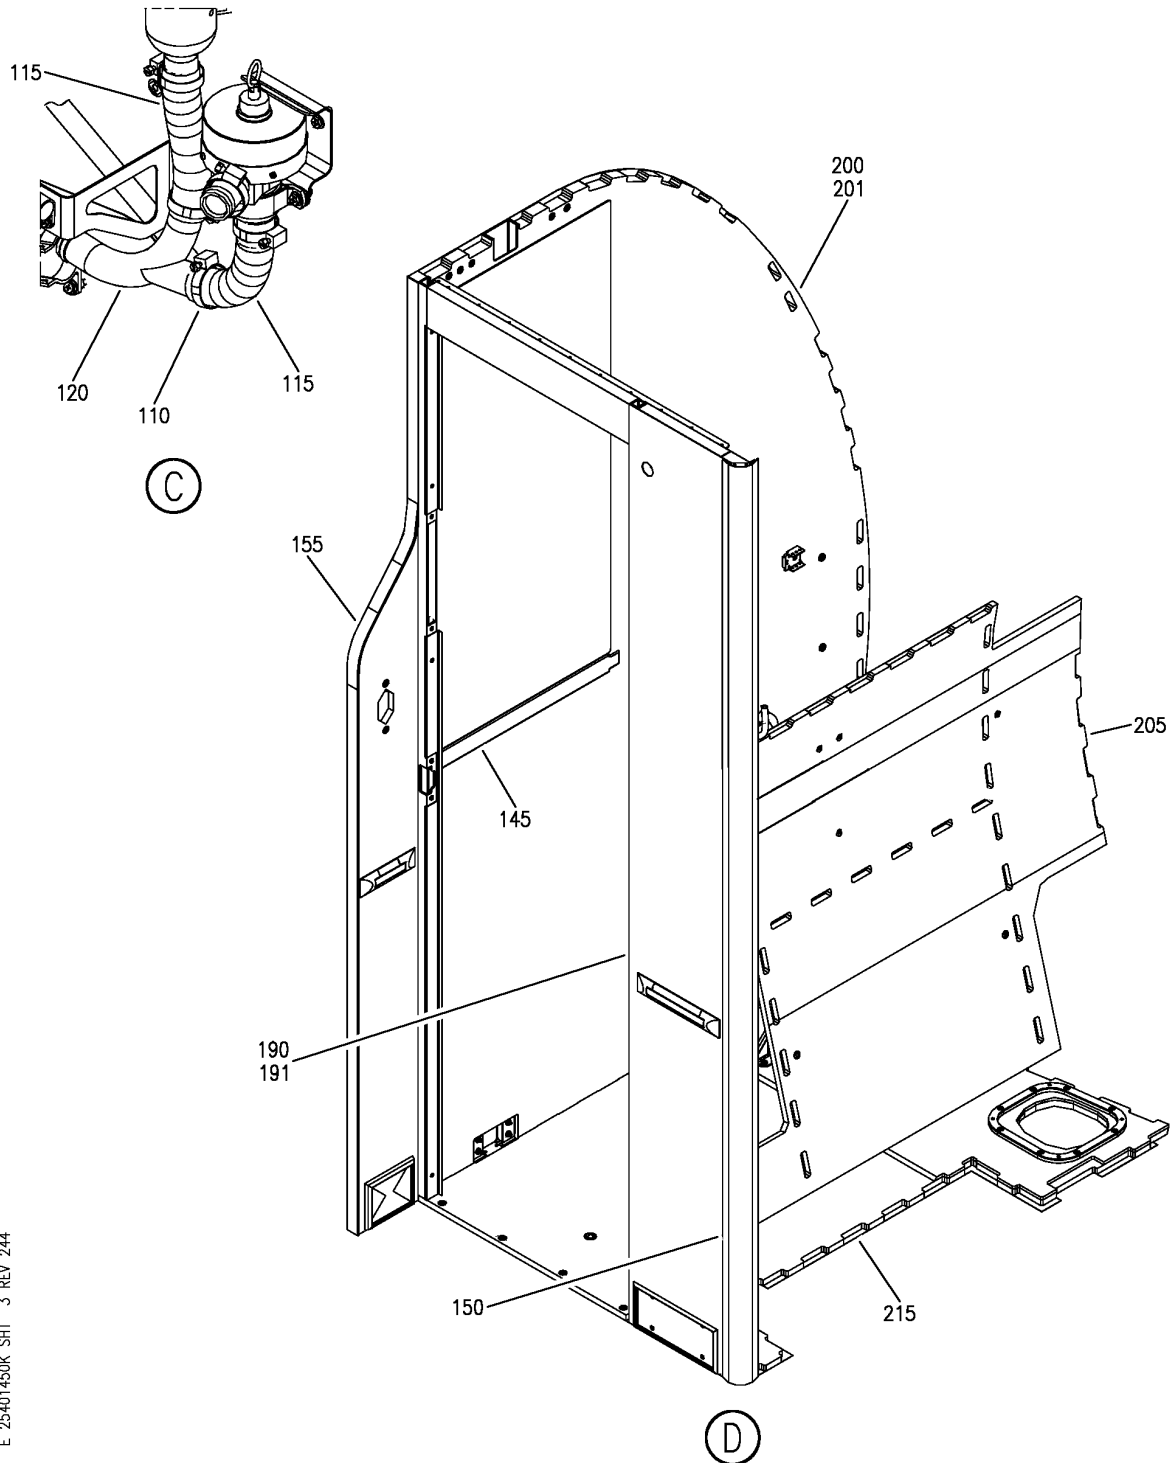

E 25401450K SHT 3 REV 244

STRUCTURE INSTL-LAV  
FIGURE 50K (SHEET 3)


**25-40-14-50K**

RJR  
DEC 15/16

25-40-14-50K  
PAGE 08

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

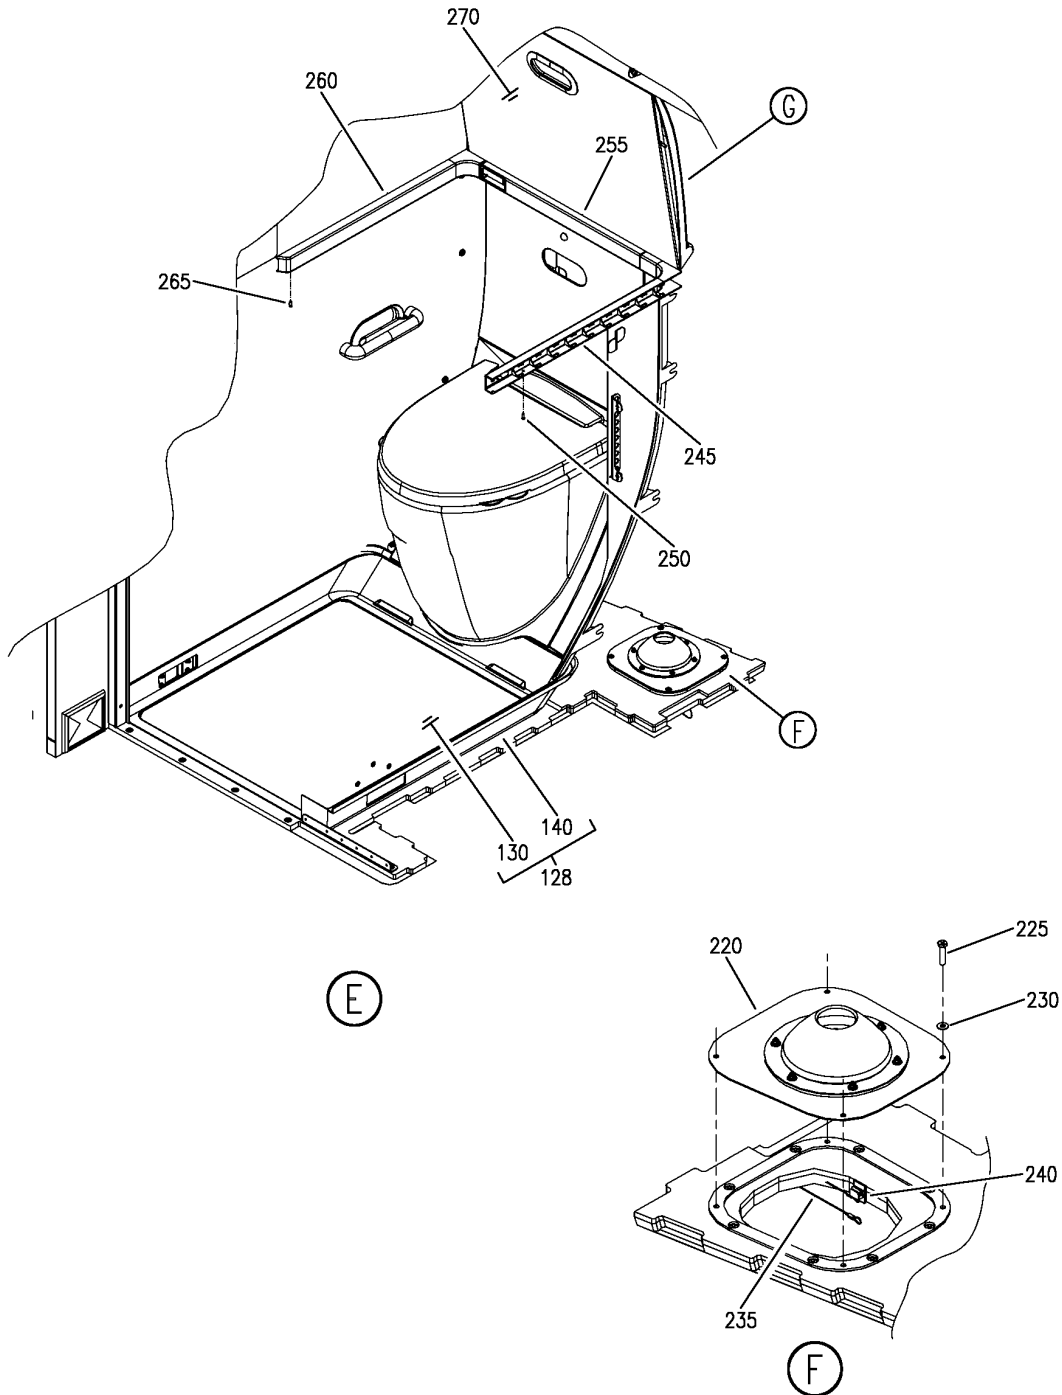

E 25401450K SHT 4 REV 241

STRUCTURE INSTL-LAV  
FIGURE 50K (SHEET 4)


**25-40-14-50K**

R Y R  
DEC 15/16


25-40-14-50K  
PAGE 0C

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

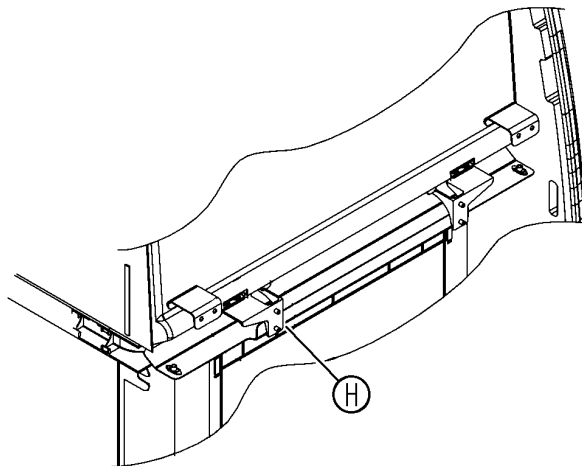

(G)

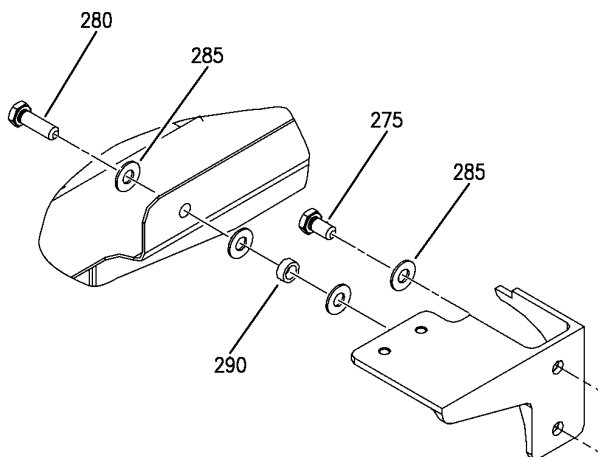

(H)

E 25401450K SHT 5 REV 241

STRUCTURE INSTL-LAV  
FIGURE 50K (SHEET 5)

**25-40-14-50K**

R Y R  
DEC 15/16

25-40-14-50K  
PAGE 0D

ECCN 9E991 BOEING PROPRIETARY - See title page for details.


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER     | 1 2 3 4 5 6 7 | NOMENCLATURE                                                                                             | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|-----------------|---------------|----------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 50K                                                     |                 |               |                                                                                                          |                   |                      |
| - 1                                                     | 1L306041-151CH3 |               | STRUCTURE INSTL-LAV<br>STRUCTURE INSTL-LAV D<br>SUPPLIER CODE:<br>V6S8D7<br>FOR NHA SEE:<br>25-40-14-50H | 417459<br>417437  | RF                   |
| - 2                                                     | 1L306041-151EE3 |               | STRUCTURE INSTL-LAV D<br>SUPPLIER CODE:<br>V6S8D7<br>FOR NHA SEE:<br>25-40-14-50H                        | 438459            | RF                   |
| 50                                                      | 4L500403-53     |               | .BRACKET-<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                                                 | 417459            | 1                    |
| 55                                                      | NAS1801-3-6     |               | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                                                          | 417459            | 2                    |
| 60                                                      | NAS1149D0332J   |               | .WASHER<br>-----*-----                                                                                   | 417459            | 2                    |
| 65                                                      | 4L400403-11     |               | .PANEL-<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                                                   | 417459            | 1                    |
| 70                                                      | NAS1801-3-6     |               | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                                                          | 417459            | 4                    |
| 75                                                      | NAS1149D0332J   |               | .WASHER<br>-----*-----                                                                                   | 417459            | 4                    |
| 80                                                      | 4L500403-55     |               | .BRACKET-<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                                                 | 417459            | 1                    |
| 85                                                      | NAS1801-3-6     |               | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                                                          | 417459            | 2                    |
| 90                                                      | NAS1149D0332J   |               | .WASHER<br>-----*-----                                                                                   | 417459            | 2                    |
| 95                                                      | 4L500403-55     |               | .BRACKET-<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                                                 | 417459            | 1                    |
| 100                                                     | NAS1801-3-6     |               | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                                                          | 417459            | 2                    |
| 105                                                     | NAS1149D0332K   |               | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0332J<br>-----*-----                                        | 417459            | 2                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                 |               |                                                                                                          |                   |                      |

- ITEM NOT ILLUSTRATED

RYR

25-40-14-50K

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-14  
FIG. 50K  
PAGE 1  
APR 15/23


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 NOMENCLATURE                                                                             | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|--------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 50K                                                     |                |                                                                                                        |                   |                      |
| 110                                                     | NAS1922-0125-3 | .CLAMP                                                                                                 | 417459            | 4                    |
| 115                                                     | 1T4350-314     | .HOSE ASSY-FLEXIBLE<br>SUPPLIER CODE:<br>V26831<br>MISCELLANEOUS DATA:<br>TRUE PART NO:<br>IT-4350-314 | 417459            | 2                    |
| 120                                                     | 4L500401-45    | .FITTING-<br>SUPPLIER CODE:<br>V6S8D7                                                                  | 417459            | 1                    |
| 125                                                     | 1L500109-347   | .CLOSEOUT-FLLOOR<br>SUPPLIER CODE:<br>V6S8D7                                                           | 417459            | 2                    |
| 128                                                     | 1L400407-67    | .PAN ASSY-FLLOOR<br>SUPPLIER CODE:<br>V6S8D7                                                           | 417459            | 1                    |
| 130                                                     | 1L400407-117   | ..MAT-<br>SUPPLIER CODE:<br>V6S8D7                                                                     | 417459            | 1                    |
| 140                                                     | 1L400407-15    | ..PAN-<br>SUPPLIER CODE:<br>V6S8D7                                                                     | 417459            | 1                    |
| 141                                                     | 1L500407-207   | .PLATE-COVER<br>SUPPLIER CODE:<br>V6S8D7                                                               | 417459            | 2                    |
| 143                                                     | 1L500709-661   | .TRIM-HEADER<br>SUPPLIER CODE:<br>V6S8D7                                                               | 417459            | 2                    |
| 145                                                     | 1L500413-131   | .TRIM-AFT WALL CLOSEOUT<br>SUPPLIER CODE:<br>V6S8D7                                                    | 417459            | 1                    |
| 150                                                     | 1L500419-299   | .TRIM-FLAT WALL<br>SUPPLIER CODE:<br>V6S8D7                                                            | 417459            | 1                    |
| 155                                                     | 1L500409-761   | .TRIM-EDGE<br>SUPPLIER CODE:<br>V6S8D7                                                                 | 417459            | 1                    |
| 160                                                     | 1L400419-153   | .EXTRUSION-<br>SUPPLIER CODE:<br>V6S8D7                                                                | 417459            | 1                    |
| 165                                                     | NAS1801-3-6    | ATTACHING PARTS<br>.SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                                     | 417459            | 16                   |
| - 167                                                   | NAS1801-3-8    | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-8                                                        | 417459            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |                                                                                                        |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R

25-40-14-50K

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-14  
FIG. 50K  
PAGE 2  
APR 15/25




**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                                                                                             | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 50K<br>170                                              | NAS1149D0332K  | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0332J                                                                                                                                     | 417459            | 16                   |
| - 172                                                   | NAS1149F0332P  | .WASHER<br>-----*-----                                                                                                                                                                 | 417459            | 1                    |
| - 175                                                   | 415U9010-82    | .EXTRUSION-<br>MISCELLANEOUS DATA:<br>ORDER LCPE000013                                                                                                                                 | 417459            | AR                   |
| - 175                                                   | LCPE000013     | .EXTRUSION-CLIP, RTNR<br>SUPPLIER CODE:<br>V6S8D7<br>MISCELLANEOUS DATA:<br>THE BOEING COMPANY PART<br>NUMBER 415U9010-82                                                              | 417459            | AR                   |
| - 180                                                   | LCEE000003     | .GROMMET-<br>SUPPLIER CODE:<br>V6S8D7                                                                                                                                                  | 417459            | AR                   |
| - 180                                                   | MS21266-2N     | .GROMMET-<br>STANDARD SUBSTITUTION:<br>BACG20Z-B001275<br>MISCELLANEOUS DATA:<br>ORDER LCEE000003                                                                                      | 417459            | AR                   |
| 185                                                     | 1L460041-277   | .CEILING ASSY-UPR<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-41-45-05R                                                                                                      | 417459            | 1                    |
| 190                                                     | 1L460041-303CH | .WALL ASSY-INBD<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-41-40-10X                                                                                                        | 417437            | 1                    |
| 191                                                     | 1L460041-303EE | .WALL ASSY-INBD<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-41-40-25Z                                                                                                        | 438459            | 1                    |
| 195                                                     | 1L460041-397CH | .WALL ASSY-FWD<br>SUPPLIER CODE:<br>V6S8D7<br>FUNCTIONAL REFERENCE:<br>AIR CONDITIONING<br>FOR DETAILS SEE<br>21-24-51-08D<br>EQUIPMENT/FURNISHINGS<br>FOR DETAILS SEE<br>25-41-40-10Y | 417437            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |                                                                                                                                                                                        |                   |                      |

- ITEM NOT ILLUSTRATED

R Y R

25-40-14-50K

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-14  
 FIG. 50K  
 PAGE 3  
 APR 15/25


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                                                                                                          | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 50K<br>196                                              | 1L460041-397EE | .WALL ASSY-FWD<br>SUPPLIER CODE:<br>V6S8D7<br>FUNCTIONAL REFERENCE:<br>AIR CONDITIONING<br>FOR DETAILS SEE<br>21-24-51-08D<br>EQUIPMENT/FURNISHINGS<br>FOR DETAILS SEE<br>25-41-40-10Y              | 438459            | 1                    |
| 200                                                     | 1L460040-413CH | .WALL ASSY-ATTENDANT<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-41-40-25J                                                                                                                | 417437            | 1                    |
| 201                                                     | 1L460040-413EE | .WALL ASSY-ATTENDANT<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-41-40-27J                                                                                                                | 438459            | 1                    |
| 205                                                     | 1L460041-255   | .WALL ASSY-SPACE<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-41-40-25Y                                                                                                                    | 417459            | 1                    |
| 210                                                     | 1L460041-247   | .WALL ASSY-OUTBD<br>SUPPLIER CODE:<br>V6S8D7<br>FUNCTIONAL REFERENCE:<br>EQUIPMENT/FURNISHINGS<br>FOR DETAILS SEE<br>25-41-40-14L<br>WATER/WASTE<br>FOR DETAILS SEE<br>38-11-08-15P<br>38-11-51-18X | 417459            | 1                    |
| 215                                                     | 1L460041-295   | .FLOOR ASSY-<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-41-21-21N                                                                                                                        | 417459            | 1                    |
| 220                                                     | 4L400401-17    | .PLATE ASSY-CLOSEOUT<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-41-11-40A                                                                                                                | 417459            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |                                                                                                                                                                                                     |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R

25-40-14-50K

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

25-40-14  
 FIG. 50K  
 PAGE 4  
 APR 15/25


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER   | 1 2 3 4 5 6 7 NOMENCLATURE                                                                  | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|---------------|---------------------------------------------------------------------------------------------|-------------------|----------------------|
| 50K                                                     |               |                                                                                             |                   |                      |
| 225                                                     | NAS1801-3-11  | ATTACHING PARTS<br>.SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-11                         | 417459            | 4                    |
| 230                                                     | NAS1149D0332J | .WASHER<br>-----*-----                                                                      | 417459            | 4                    |
| 235                                                     | 4595339-012   | .LANYARD-<br>SUPPLIER CODE:<br>V16827                                                       | 417459            | 1                    |
| 240                                                     | LWC19AC14     | .CLIP-ADHESIVE BACKED<br>SUPPLIER CODE:<br>V06383<br>TRUE PART NUMBER:<br>LWC19-A-C14       | 417459            | 1                    |
| 245                                                     | 1L500413-63   | .TRIM-SPACE WALL<br>SUPPLIER CODE:<br>V6S8D7                                                | 417459            | 1                    |
| 250                                                     | NAS514P832-8  | ATTACHING PARTS<br>.SCREW<br>-----*-----                                                    | 417459            | 1                    |
| 255                                                     | 1L500413-7    | .TRIM-OUTBD WALL<br>SUPPLIER CODE:<br>V6S8D7                                                | 417459            | 1                    |
| 260                                                     | 1L500413-91   | .TRIM-AFT WALL<br>SUPPLIER CODE:<br>V6S8D7                                                  | 417459            | 1                    |
| 265                                                     | NAS514P832-8  | ATTACHING PARTS<br>.SCREW<br>-----*-----                                                    | 417459            | 1                    |
| 270                                                     | 1L460070-253  | .STATION ASSY-BABY CHANGING<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-41-52-02C | 417459            | 1                    |
| 275                                                     | NAS1801-3-6   | ATTACHING PARTS<br>.SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                          | 417459            | 2                    |
| 280                                                     | NAS1801-3-10  | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-10                                            | 417459            | 2                    |
| 285                                                     | NAS1149C0332R | .WASHER                                                                                     | 417459            | 8                    |
| 290                                                     | NAS43DD3-8N   | .SPACER<br>STANDARD SUBSTITUTION:<br>NAS43DD3-8FC<br>-----*-----                            | 417459            | 2                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |               |                                                                                             |                   |                      |

— ITEM NOT ILLUSTRATED


R Y R

25-40-14-50K

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-14  
FIG. 50K  
PAGE 5  
APR 15/25

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

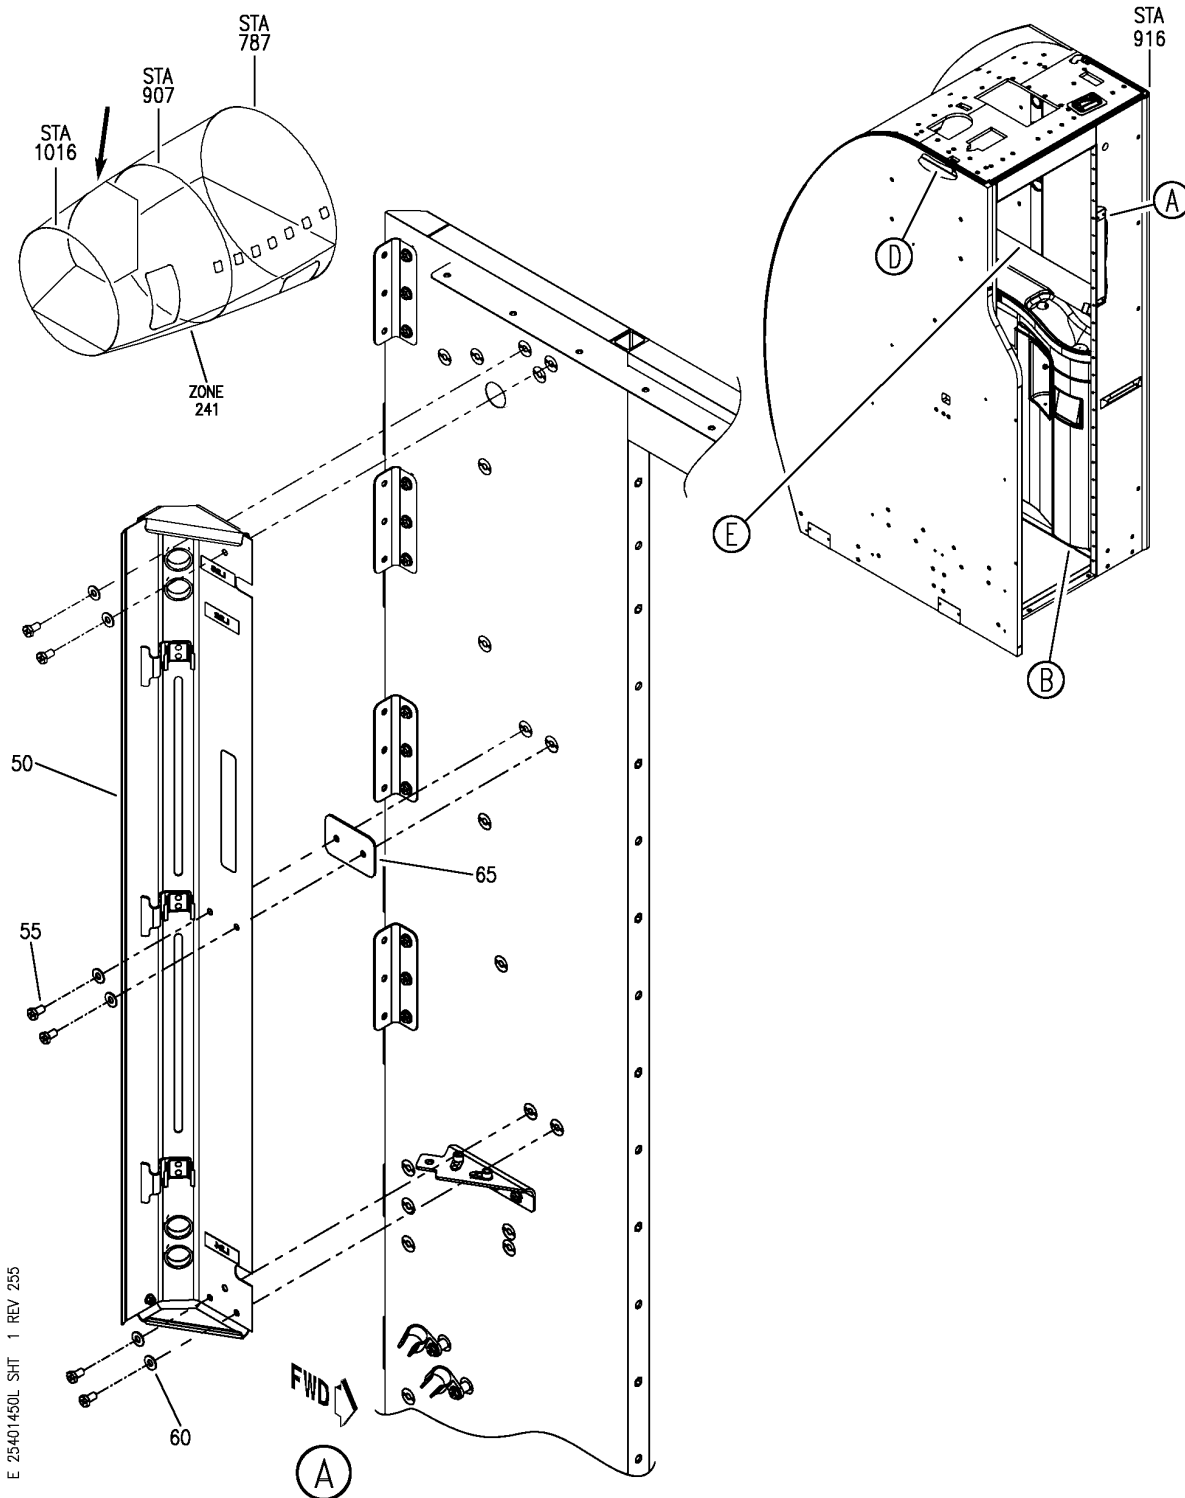

E 25401450L SHT 1 REV 255

STRUCTURE INSTL-LAV  
FIGURE 50L (SHEET 1)


**25-40-14-50L**

R Y R  
APR 15/18

25-40-14-50L  
PAGE 0

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

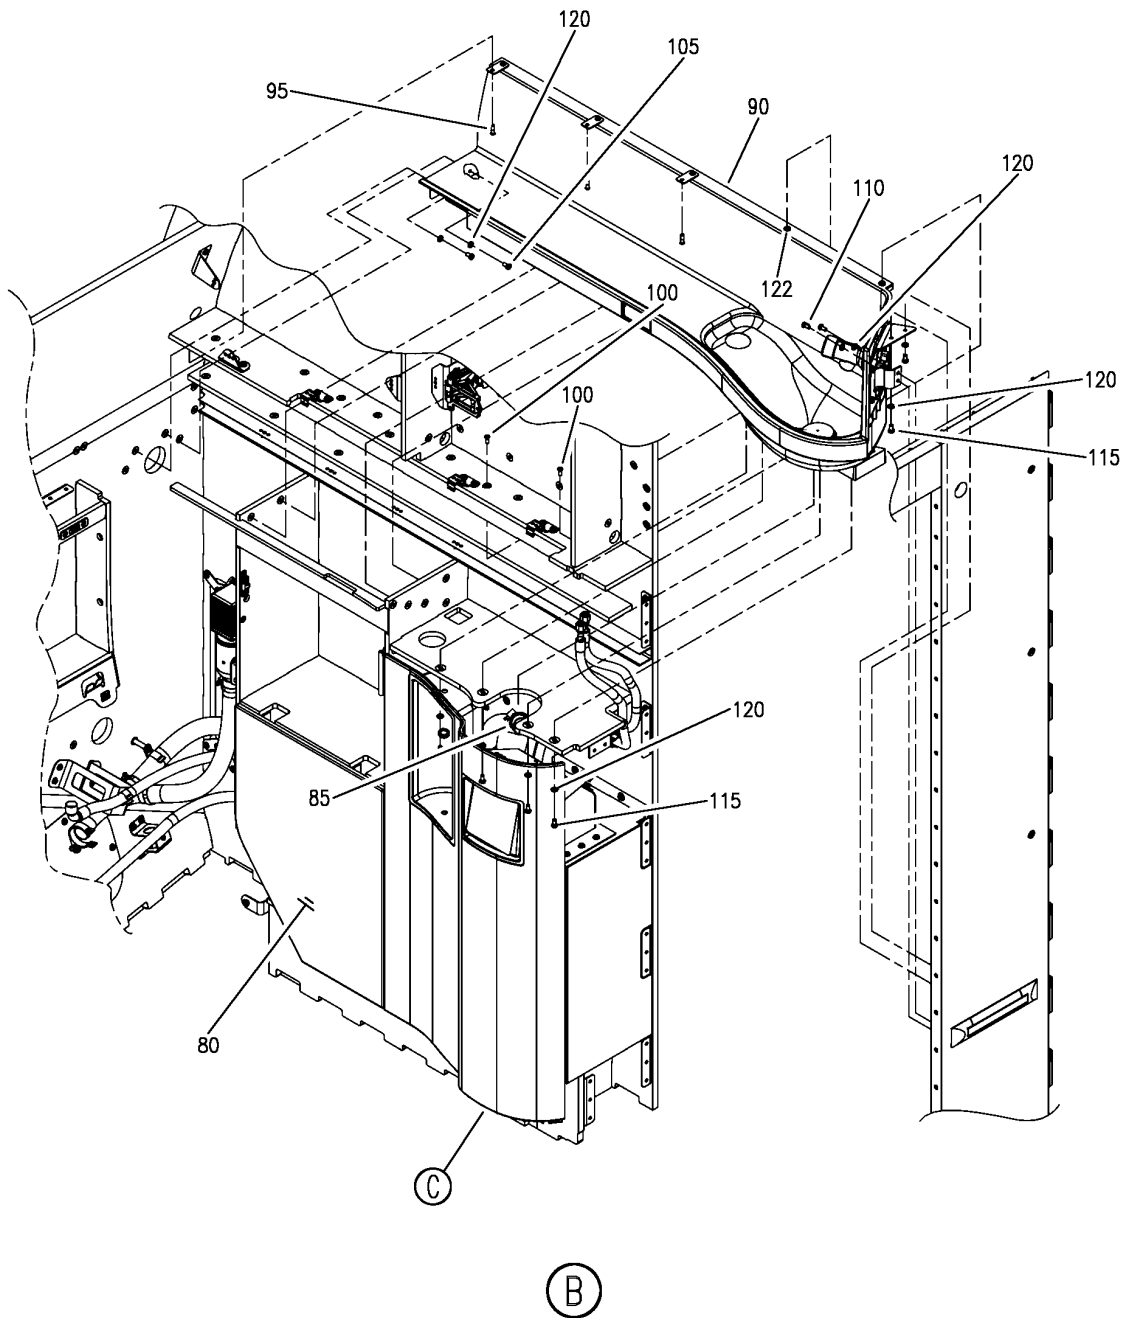

E 25401450L SHT 2 REV 259

STRUCTURE INSTL-LAV  
FIGURE 50L (SHEET 2)


**25-40-14-50L**

R Y R  
A P R 15 / 18

25-40-14-50L  
PAGE 0A

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

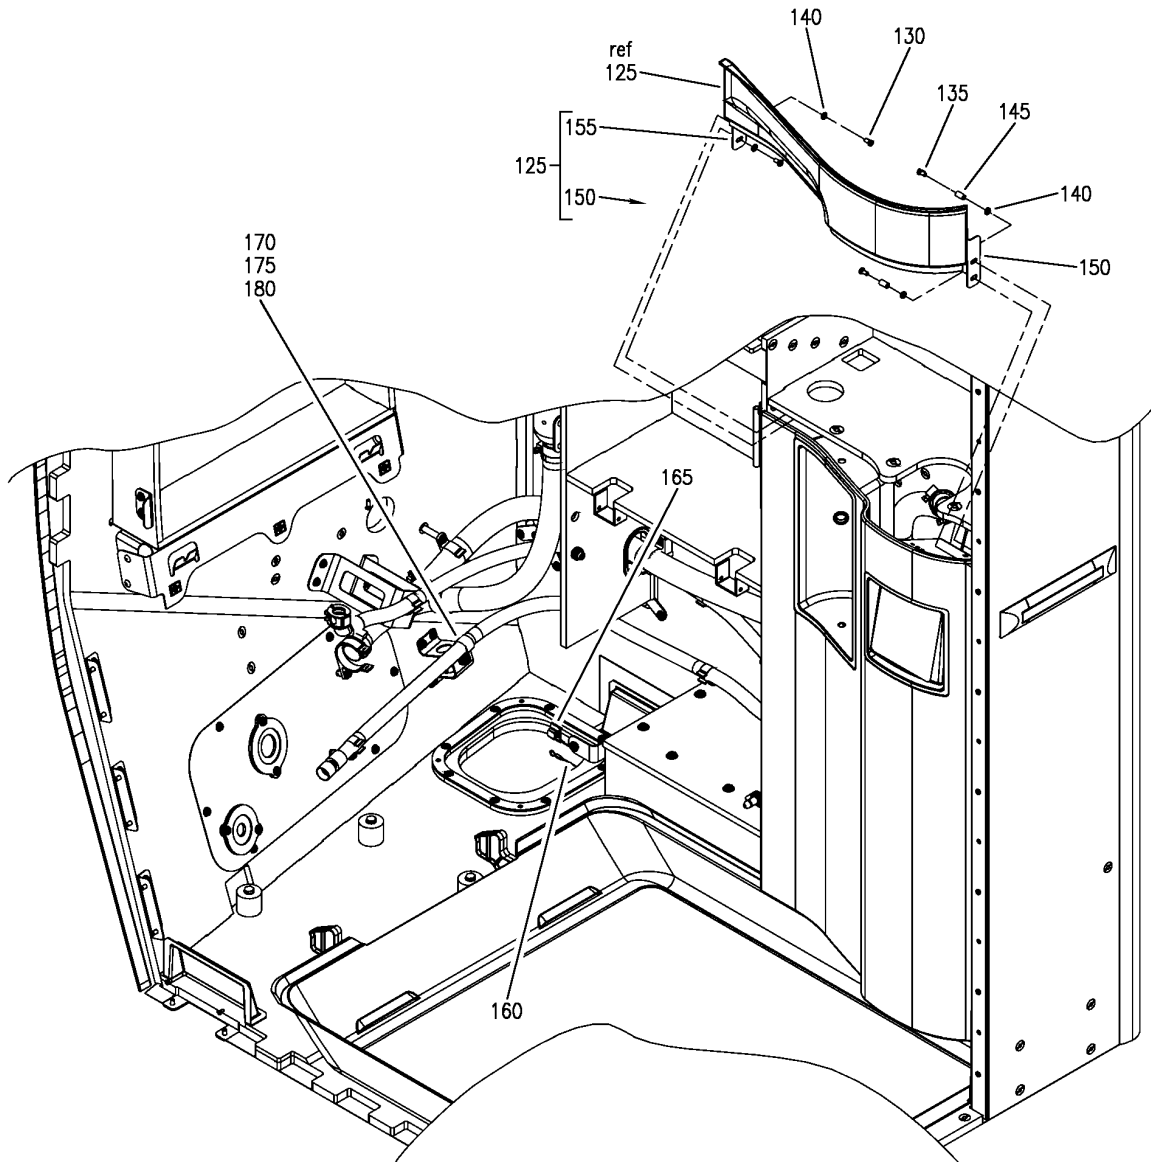

(C)

E 25401450L SHT 3 REV 255

STRUCTURE INSTL-LAV  
FIGURE 50L (SHEET 3)


**25-40-14-50L**

R Y R  
A P R 15 / 18


25-40-14-50L  
PAGE 0B

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

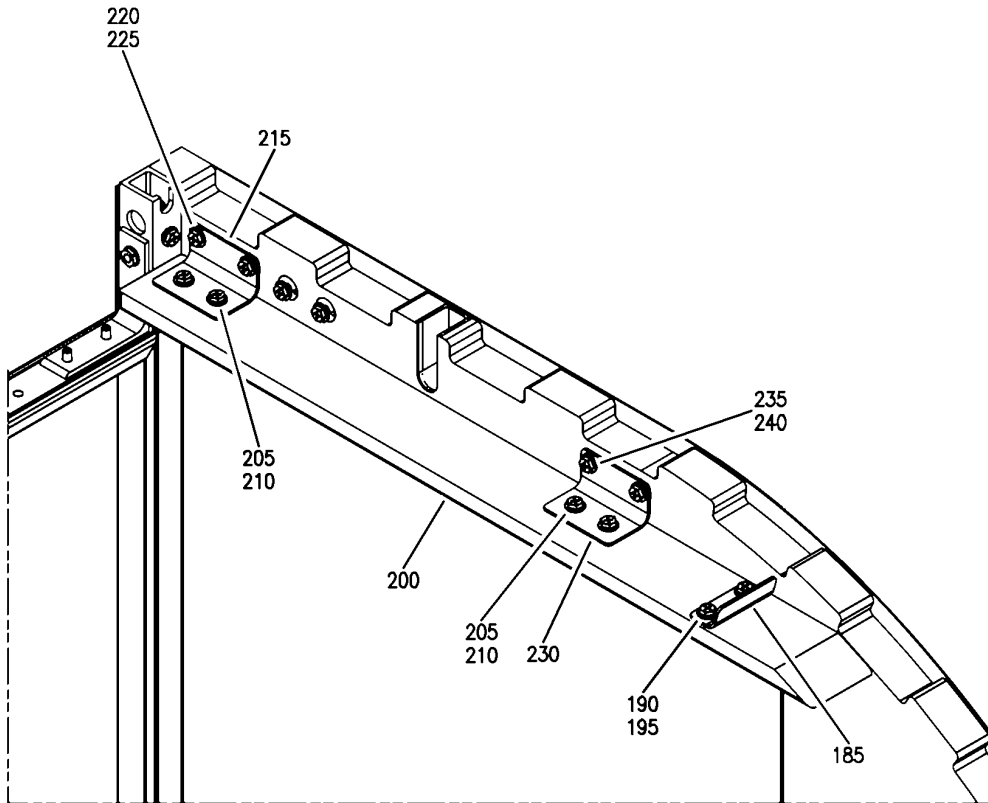

FWD  
(D)

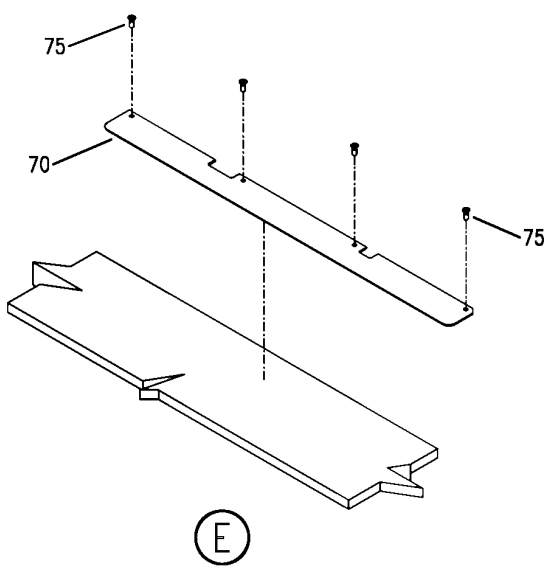

E 25401450L SHT 4 REV 255

STRUCTURE INSTL-LAV  
FIGURE 50L (SHEET 4)

**25-40-14-50L**

R Y R  
A P R 15 / 18

25-40-14-50L  
PAGE 0C

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

 **BOEING**  
737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER     | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                                                                                                    | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|-----------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 50L                                                     |                 |                                                                                                                                                                                               |                   |                      |
| - 1                                                     | 1L306041-401HF2 | STRUCTURE INSTL-LAV<br>STRUCTURE INSTL-LAV D<br>SUPPLIER CODE:<br>V6S8D7<br>FOR NHA SEE:<br>25-40-14-50F                                                                                      | 509999<br>509999  | RF                   |
| 50                                                      | 1L460070-251    | .LIGHT ASSY-<br>SUPPLIER CODE:<br>V6S8D7<br>FUNCTIONAL REFERENCE:<br>LIGHTS<br>FOR DETAILS SEE<br>33-26-03-43Y<br>PLACARDS AND MARKINGS<br>FOR DETAILS SEE<br>11-32-05-27X<br>ATTACHING PARTS | 509999            | 1                    |
| 55                                                      | NAS1801-3-7     | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-7                                                                                                                                               | 509999            | 6                    |
| 60                                                      | NAS1149D0332J   | .WASHER<br>-----*-----                                                                                                                                                                        | 509999            | 6                    |
| 65                                                      | 1L500403-89     | .SHIM-<br>SUPPLIER CODE:<br>V6S8D7                                                                                                                                                            | 509999            | 1                    |
| 70                                                      | 1L500403-271    | .LENS-TASK LT<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                                                                                                                                  | 509999            | 1                    |
| 75                                                      | NAS8303-5       | .SCREW<br>-----*-----                                                                                                                                                                         | 509999            | 4                    |
| 80                                                      | 1L400401-251    | .PANEL ASSY-AMENITIES BOX<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-41-11-07B                                                                                                     | 509999            | 1                    |
| 85                                                      | NAS1922-0125-3  | .CLAMP                                                                                                                                                                                        | 509999            | 1                    |
| 90                                                      | 1L400113-25     | .COUNTERTOP ASSY-<br>SUPPLIER CODE:<br>VH1XK6<br>FOR DETAILS SEE:<br>25-41-11-10P<br>ATTACHING PARTS                                                                                          | 509999            | 1                    |
| 95                                                      | NAS514P1032-5   | .SCREW                                                                                                                                                                                        | 509999            | 3                    |
| 100                                                     | NAS514P1032-12  | .SCREW                                                                                                                                                                                        | 509999            | 2                    |
| 105                                                     | NAS1801-3-5     | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-5                                                                                                                                               | 509999            | 6                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                 |                                                                                                                                                                                               |                   |                      |

- ITEM NOT ILLUSTRATED

RYR

25-40-14-50L

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-14  
FIG. 50L  
PAGE 1  
APR 15/23




**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER   | 1 2 3 4 5 6 7 NOMENCLATURE                                                            | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|---------------|---------------------------------------------------------------------------------------|-------------------|----------------------|
| 50L                                                     |               |                                                                                       |                   |                      |
| 110                                                     | NAS1801-3-6   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                                       | 509999            | 2                    |
| 115                                                     | NAS1801-3-9   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-9                                       | 509999            | 6                    |
| 120                                                     | NAS1149D0332J | .WASHER                                                                               | 509999            | 14                   |
| 122                                                     | NAS1149D0363J | .WASHER                                                                               | 509999            | 2                    |
|                                                         |               | -----*-----                                                                           |                   |                      |
| 125                                                     | 1L400113-1    | .FACADE ASSY-<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                          | 509999            | 1                    |
| 130                                                     | NAS1801-3-5   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-5                                       | 509999            | 2                    |
| 135                                                     | NAS1801-3-11  | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-11                                      | 509999            | 2                    |
| 140                                                     | NAS1149D0332J | .WASHER                                                                               | 509999            | 4                    |
| 145                                                     | NAS43DD3-24FC | .SPACER                                                                               | 509999            | 2                    |
|                                                         |               | -----*-----                                                                           |                   |                      |
| 150                                                     | 1L500113-51   | ..BRACKET-OUTBD<br>SUPPLIER CODE:<br>V6S8D7                                           | 509999            | 1                    |
| 155                                                     | 1L500113-45   | ..BRACKET-INBD<br>SUPPLIER CODE:<br>V6S8D7                                            | 509999            | 1                    |
| 160                                                     | 4595339-012   | .LANYARD-<br>SUPPLIER CODE:<br>V16827                                                 | 509999            | 1                    |
| 165                                                     | LWC19AC14     | .CLIP-ADHESIVE BACKED<br>SUPPLIER CODE:<br>V06383<br>TRUE PART NUMBER:<br>LWC19-A-C14 | 509999            | 1                    |
| 170                                                     | MS25281F11    | .CLAMP-<br>TRUE PART NUMBER:<br>MS25281-F11<br>ATTACHING PARTS                        | 509999            | 1                    |
| 175                                                     | NAS1801-3-10  | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-10                                      | 509999            | 1                    |
| 180                                                     | NAS1149D0332J | .WASHER                                                                               | 509999            | 1                    |
|                                                         |               | -----*-----                                                                           |                   |                      |
| 185                                                     | 4L500403-53   | .BRACKET-<br>SUPPLIER CODE:<br>V6S8D7                                                 | 509999            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |               |                                                                                       |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R

25-40-14-50L

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-14  
 FIG. 50L  
 PAGE 2  
 APR 15/23


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER   | 1 2 3 4 5 6 7 NOMENCLATURE                                         | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|---------------|--------------------------------------------------------------------|-------------------|----------------------|
| 50L                                                     |               |                                                                    |                   |                      |
| 190                                                     | NAS1801-3-6   | ATTACHING PARTS<br>.SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6 | 509999            | 2                    |
| 195                                                     | NAS1149D0332J | .WASHER<br>-----*-----                                             | 509999            | 2                    |
| 200                                                     | 4L400403-11   | .PANEL-<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS             | 509999            | 1                    |
| 205                                                     | NAS1801-3-6   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                    | 509999            | 4                    |
| 210                                                     | NAS1149D0332J | .WASHER<br>-----*-----                                             | 509999            | 4                    |
| 215                                                     | 4L500403-55   | .BRACKET-<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS           | 509999            | 1                    |
| 220                                                     | NAS1801-3-6   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                    | 509999            | 2                    |
| 225                                                     | NAS1149D0332K | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0332J<br>-----*-----  | 509999            | 2                    |
| 230                                                     | 4L500403-55   | .BRACKET-<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS           | 509999            | 1                    |
| 235                                                     | NAS1801-3-6   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                    | 509999            | 2                    |
| 240                                                     | NAS1149D0332J | .WASHER<br>-----*-----                                             | 509999            | 2                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |               |                                                                    |                   |                      |

— ITEM NOT ILLUSTRATED


R Y R

25-40-14-50L

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

25-40-14  
FIG. 50L  
PAGE 3  
APR 15/23

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

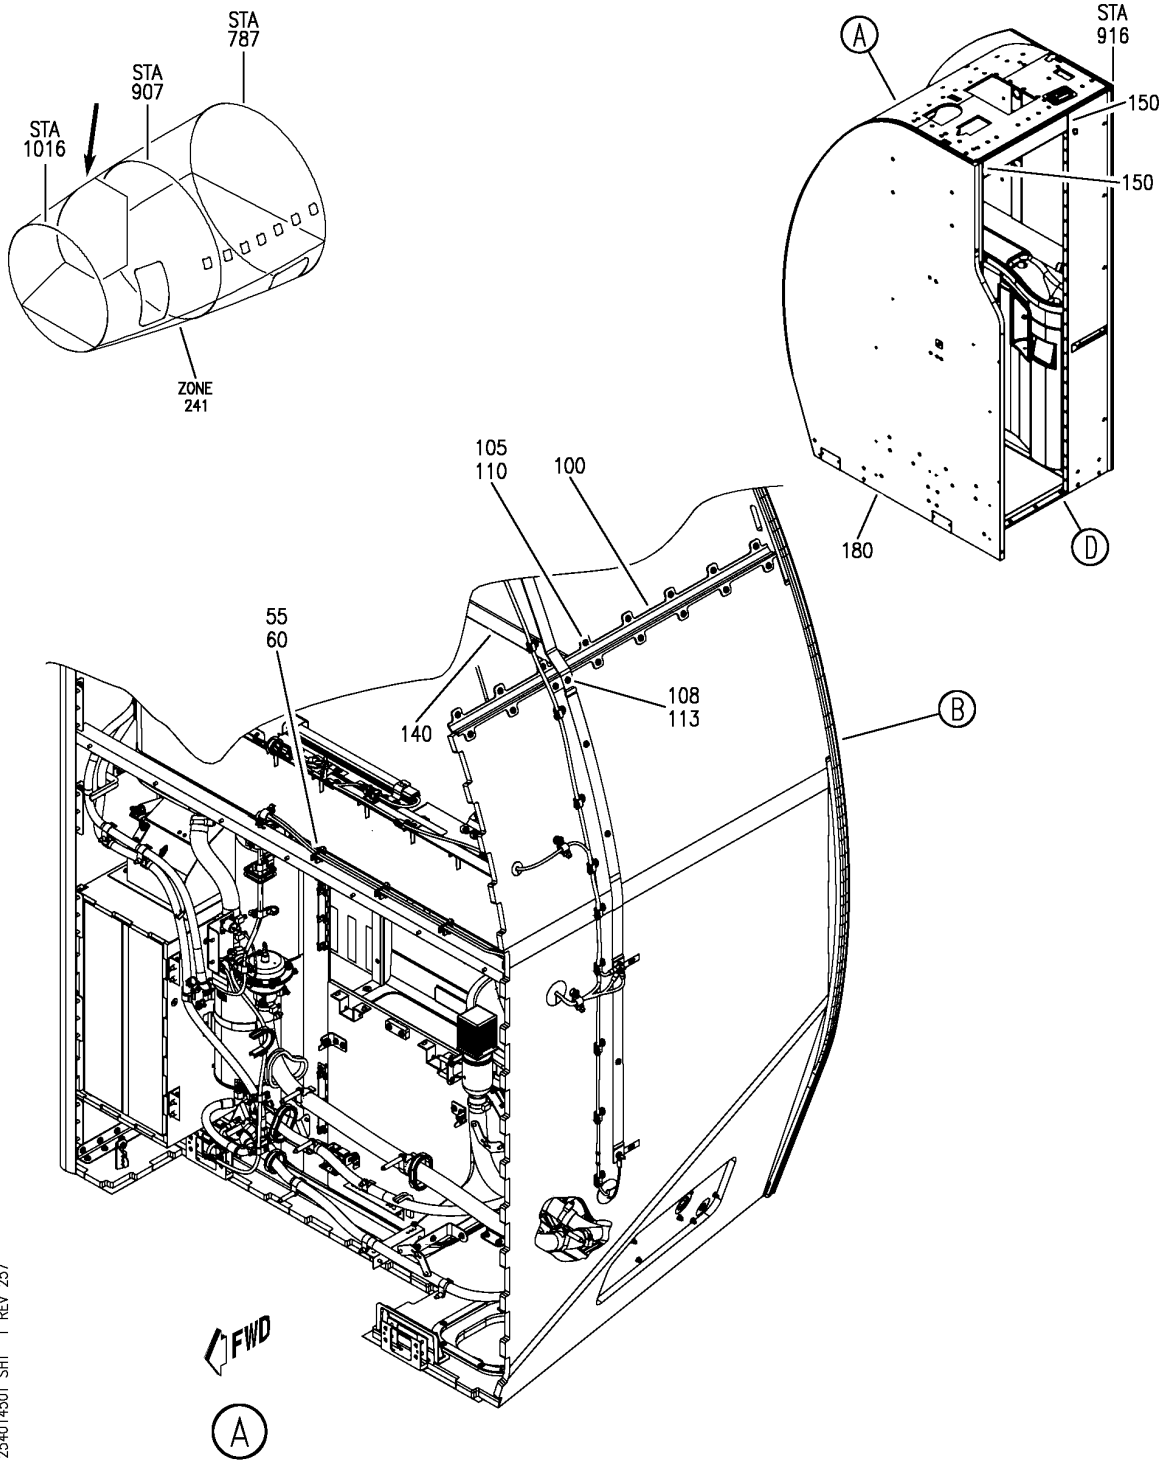

E 25401450T SHT 1 REV 257

STRUCTURE INSTL-LAV  
FIGURE 50T (SHEET 1)


**25-40-14-50T**

R Y R  
APR 15/18


25-40-14-50T  
PAGE 0

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

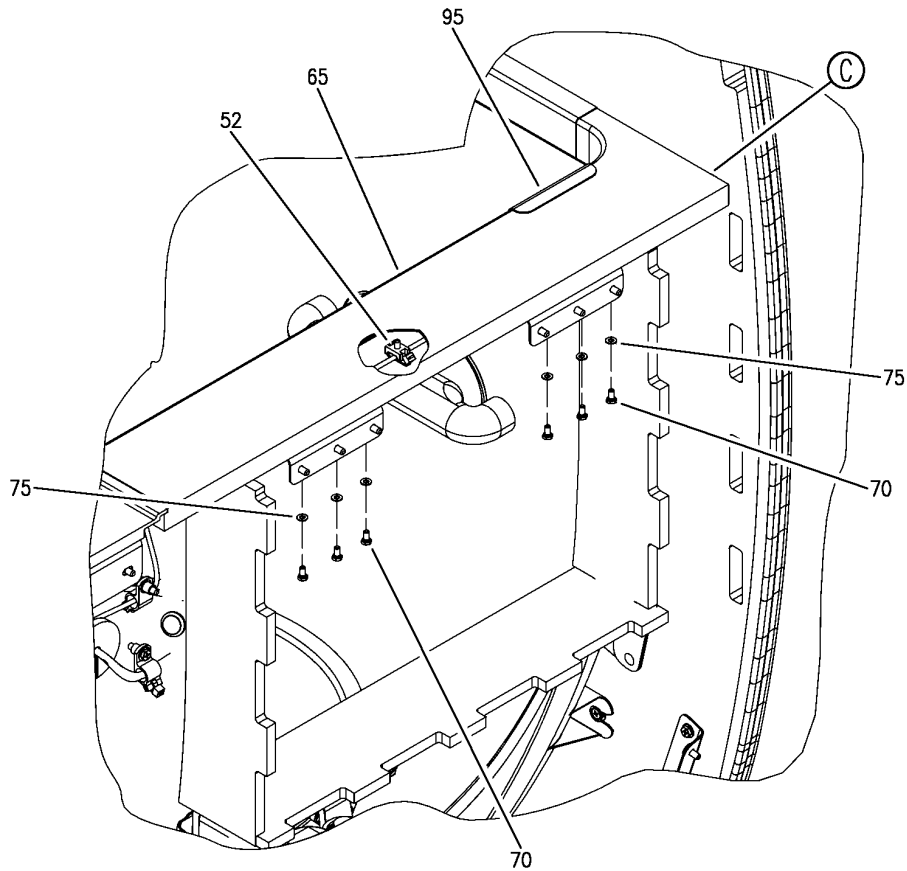

**(B)**

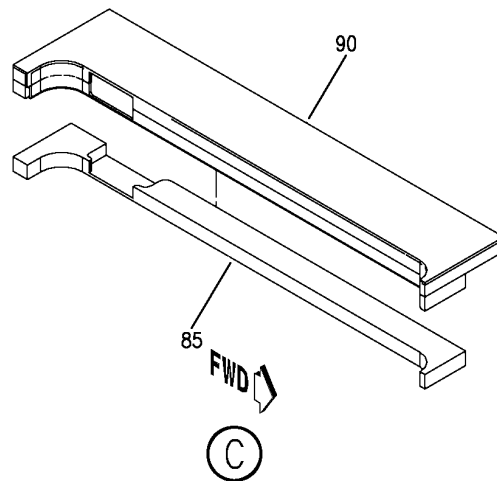

E 25401450T SHT 2 REV 265

STRUCTURE INSTL-LAV  
FIGURE 50T (SHEET 2)


**25-40-14-50T**

R Y R  
AUG 15/18

25-40-14-50T  
PAGE 0A

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

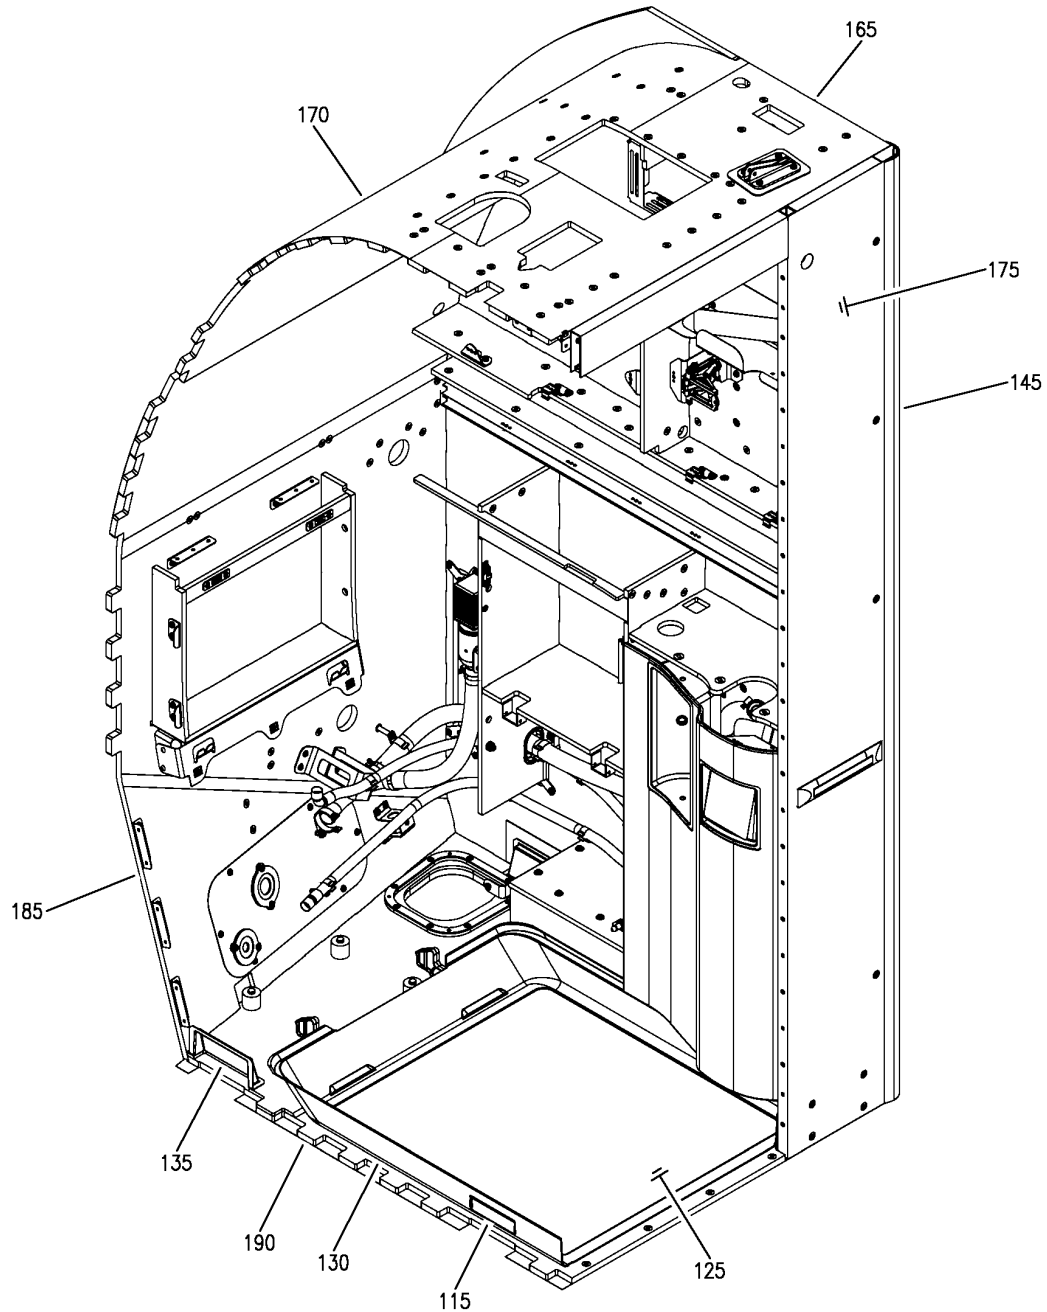

(D)

E 25401450T SHT 3 REV 257

STRUCTURE INSTL-LAV  
FIGURE 50T (SHEET 3)

**25-40-14-50T**

R Y R  
APR 15/18

25-40-14-50T  
PAGE 0B

ECCN 9E991 BOEING PROPRIETARY – See title page for details.


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER     | 1 2 3 4 5 6 7 | NOMENCLATURE                                                                                            | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|-----------------|---------------|---------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 50T                                                     |                 |               |                                                                                                         |                   |                      |
| - 1                                                     | 1L306041-401HF3 |               | STRUCTURE INSTL-LAV<br>STRUCTURE ASSY-LAV D<br>SUPPLIER CODE:<br>V6S8D7<br>FOR NHA SEE:<br>25-40-14-50F | 509999<br>509999  | RF                   |
| - 50                                                    | 9L500001-301    |               | .MOUNTING INSTL-ELECTRICAL<br>SUPPLIER CODE:<br>V6S8D7                                                  | 509999            | 4                    |
| 52                                                      | MS3367-5-9      |               | ..STRAP<br>STANDARD SUBSTITUTION:<br>BACS38K5                                                           | 509999            | 1                    |
| 55                                                      | TM2S8           |               | ..MOUNT-CABLE TIE<br>SUPPLIER CODE:<br>V06383<br>ATTACHING PARTS                                        | 509999            | 1                    |
| 60                                                      | NAS1801-08-5    |               | ..SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN08-5<br>-----*-----                                        | 509999            | 1                    |
| 65                                                      | 1L460040-335    |               | .COUNTER ASSY-OUTBD<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                                      | 509999            | 1                    |
| 70                                                      | NAS1801-3-6     |               | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                                                         | 509999            | 6                    |
| 75                                                      | NAS1149D0332J   |               | .WASHER<br>-----*-----                                                                                  | 509999            | 6                    |
| - 80                                                    | 1L406040-331    |               | ..COUNTER ASSY-<br>SUPPLIER CODE:<br>V6S8D7                                                             | 509999            | 1                    |
| 85                                                      | 1L500409-13     |               | ...PANEL-<br>SUPPLIER CODE:<br>V6S8D7                                                                   | 509999            | 1                    |
| 90                                                      | 1L500409-11     |               | ...PANEL-<br>SUPPLIER CODE:<br>V6S8D7                                                                   | 509999            | 1                    |
| 95                                                      | 1L500409-15     |               | ..BRACKET-FLUSH SWITCH<br>SUPPLIER CODE:<br>V6S8D7                                                      | 509999            | 1                    |
| 100                                                     | 1L500419-367    |               | .EXTRUSION-<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                                              | 509999            | 1                    |
| 105                                                     | NAS1801-3-6     |               | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                                                         | 509999            | 16                   |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                 |               |                                                                                                         |                   |                      |

- ITEM NOT ILLUSTRATED

RYR

25-40-14-50T

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-14  
FIG. 50T  
PAGE 1  
APR 15/23


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER   | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                      | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|---------------|-----------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 50T<br>108                                              | NAS1801-3-8   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-8                                                                 | 509999            | 1                    |
| 110                                                     | NAS1149D0332K | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0332J                                                              | 509999            | 16                   |
| 113                                                     | NAS1149F0332P | .WASHER<br>-----*-----                                                                                          | 509999            | 1                    |
| 115                                                     | 1L500407-207  | .PLATE-COVER<br>SUPPLIER CODE:<br>V6S8D7                                                                        | 509999            | 2                    |
| - 120                                                   | 1L400407-77B  | .PAN ASSY-FLOOR<br>SUPPLIER CODE:<br>V6S8D7                                                                     | 509999            | 1                    |
| 125                                                     | 1L400407-87B  | ..MAT-<br>SUPPLIER CODE:<br>V6S8D7                                                                              | 509999            | 1                    |
| 130                                                     | 1L400407-15   | ..PAN-<br>SUPPLIER CODE:<br>V6S8D7<br>CONFIG CHG DATA FROM A CMM:<br>SUPSD BY 1L400407-137                      | 509999            | 1                    |
| 130                                                     | 1L400407-137  | ..PAN-<br>SUPPLIER CODE:<br>V6S8D7<br>CONFIG CHG DATA FROM A CMM:<br>SUPERSEDES 1L400407-15                     | 509999            | 1                    |
| 135                                                     | 1L500109-347  | .CLOSEOUT-FLOOR<br>SUPPLIER CODE:<br>V6S8D7                                                                     | 509999            | 2                    |
| 140                                                     | 1L500413-131  | .TRIM-AFT WALL CLOSEOUT<br>SUPPLIER CODE:<br>V6S8D7                                                             | 509999            | 1                    |
| 145                                                     | 1L500419-299  | .TRIM-FLAT WALL<br>SUPPLIER CODE:<br>V6S8D7                                                                     | 509999            | 1                    |
| 150                                                     | 1L500709-661  | .TRIM-HEADER<br>SUPPLIER CODE:<br>V6S8D7                                                                        | 509999            | 2                    |
| - 155                                                   | 415U9010-82   | .EXTRUSION-<br>MISCELLANEOUS DATA:<br>ORDER LCPE000013                                                          | 509999            | AR                   |
| - 155                                                   | LCPE000013    | .EXTRUSION-<br>SUPPLIER CODE:<br>V6S8D7<br>MISCELLANEOUS DATA:<br>THE BOEING COMPANY PART<br>NUMBER 415U9010-82 | 509999            | AR                   |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |               |                                                                                                                 |                   |                      |

- ITEM NOT ILLUSTRATED

R Y R

25-40-14-50T

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-14  
FIG. 50T  
PAGE 2  
FEB 15/24


**BOEING**  
 737-600/700/800/900  
 PARTS CATALOG (MAINTENANCE)

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7<br>NOMENCLATURE                                                                                                                                                          | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 50T<br>- 160                                            | MS21266-2N     | .GROMMET-<br>STANDARD SUBSTITUTION:<br>BACG20Z-B001275<br>MISCELLANEOUS DATA:<br>ORDER LCEE000003                                                                                      | 509999            | AR                   |
| - 160                                                   | LCEE000003     | .GROMMET-<br>SUPPLIER CODE:<br>V6S8D7                                                                                                                                                  | 509999            | AR                   |
| 165                                                     | 1L460041-383HF | .WALL ASSY-FWD<br>SUPPLIER CODE:<br>V6S8D7<br>FUNCTIONAL REFERENCE:<br>AIR CONDITIONING<br>FOR DETAILS SEE<br>21-24-51-14V<br>EQUIPMENT/FURNISHINGS<br>FOR DETAILS SEE<br>25-41-40-05W | 509999            | 1                    |
| 170                                                     | 1L460041-273   | .CEILING ASSY-UPR<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-41-45-05E                                                                                                      | 509999            | 1                    |
| 175                                                     | 1L460041-321HF | .WALL ASSY-INBD<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-41-40-05Z                                                                                                        | 509999            | 1                    |
| 180                                                     | 1L460040-419HF | .WALL ASSY-ATTENDANT<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-41-40-26F                                                                                                   | 509999            | 1                    |
| 185                                                     | 1L460041-243   | .WALL ASSY-OUTBD<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-41-40-28W                                                                                                       | 509999            | 1                    |
| 190                                                     | 1L460041-423   | .FLOOR ASSY-<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-41-21-07W                                                                                                           | 509999            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |                                                                                                                                                                                        |                   |                      |

— ITEM NOT ILLUSTRATED



R Y R

25-40-14-50T

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

25-40-14  
 FIG. 50T  
 PAGE 3  
 FEB 15/24



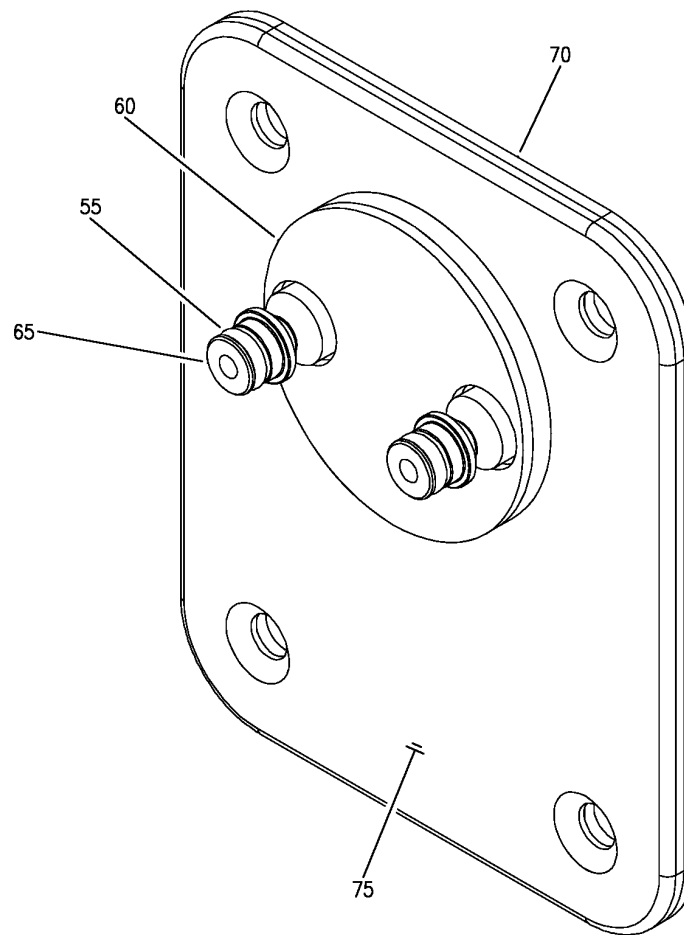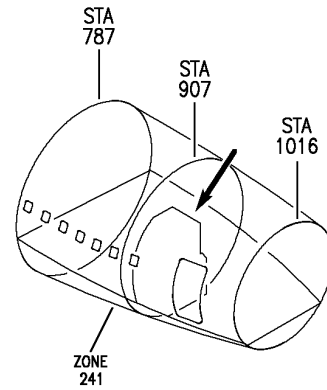

E 25401451E REV 253

PLATE ASSY-FAUCET MTG, LAV  
FIGURE 51E

**25-40-14-51E**

R Y R  
APR 15 / 18

25-40-14-51E  
PAGE 0


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER  | 1 2 3 4 5 6 7 | NOMENCLATURE                                                                                                                                                      | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|--------------|---------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 51E                                                     |              |               |                                                                                                                                                                   |                   |                      |
| - 1                                                     | SC4L500301-2 |               | PLATE ASSY-FAUCET MTG, LAV<br>PLATE ASSY-FAUCET MTG, LAV<br>SUPPLIER CODE:<br>V6S8D7<br>MISCELLANEOUS DATA:<br>ORDER 4W200301-201<br>FOR NHA SEE:<br>25-41-11-10P | 509999<br>509999  | RF                   |
| - 1                                                     | 4W200301-201 |               | PLATE ASSY-FAUCET MTG, LAV<br>SUPPLIER CODE:<br>V6S8D7<br>FOR NHA SEE:<br>25-41-11-10P                                                                            | 509999            | RF                   |
| - 50                                                    | 4W400301-201 |               | . PLATE ASSY-<br>SUPPLIER CODE:<br>V6S8D7                                                                                                                         | 509999            | 1                    |
| 55                                                      | LCCS14-007B  |               | .. PACKING-<br>SUPPLIER CODE:<br>V6S8D7<br>TRUE PART NUMBER:<br>LCCS-14-007B                                                                                      | 509999            | 2                    |
| 60                                                      | 4W500301-31  |               | .. GASKET-<br>SUPPLIER CODE:<br>V6S8D7                                                                                                                            | 509999            | 1                    |
| 65                                                      | 4W500301-21  |               | .. NIPPLE-<br>SUPPLIER CODE:<br>V6S8D7                                                                                                                            | 509999            | 2                    |
| 70                                                      | 4W500301-29  |               | .. GASKET-<br>SUPPLIER CODE:<br>V6S8D7                                                                                                                            | 509999            | 1                    |
| 75                                                      | 4W500301-27  |               | .. PLATE-<br>SUPPLIER CODE:<br>V6S8D7                                                                                                                             | 509999            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |              |               |                                                                                                                                                                   |                   |                      |

- ITEM NOT ILLUSTRATED


RYR

25-40-14-51E

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-14  
 FIG. 51E  
 PAGE 1  
 AUG 15/18

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

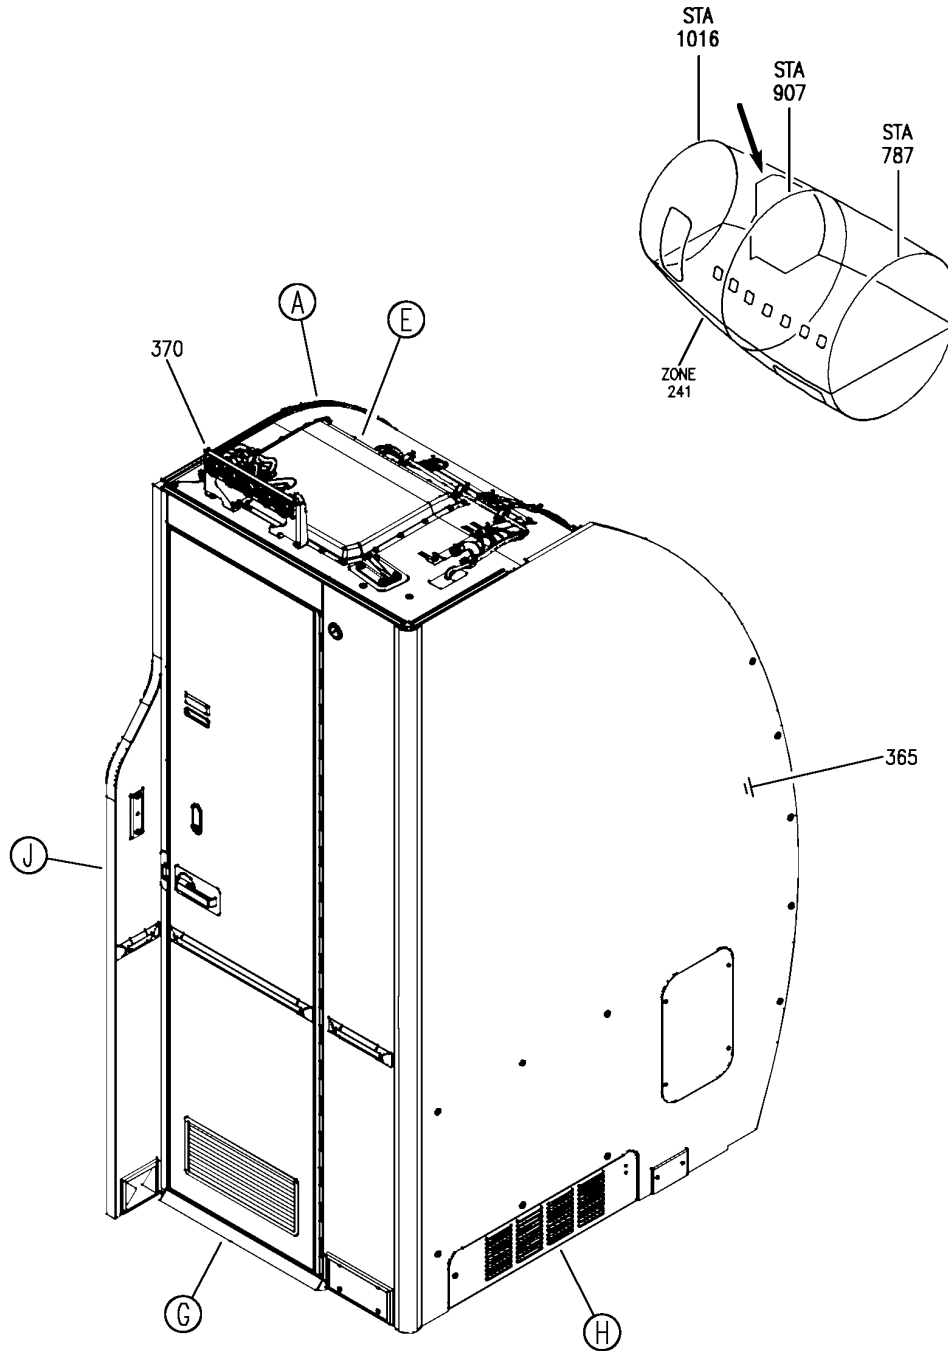

E 25401452D SHT 1 REV 253

MODULE ASSY-LAV D (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 52D (SHEET 1)


**25-40-14-52D**

R Y R  
AUG 15/19

25-40-14-52D  
PAGE 0

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

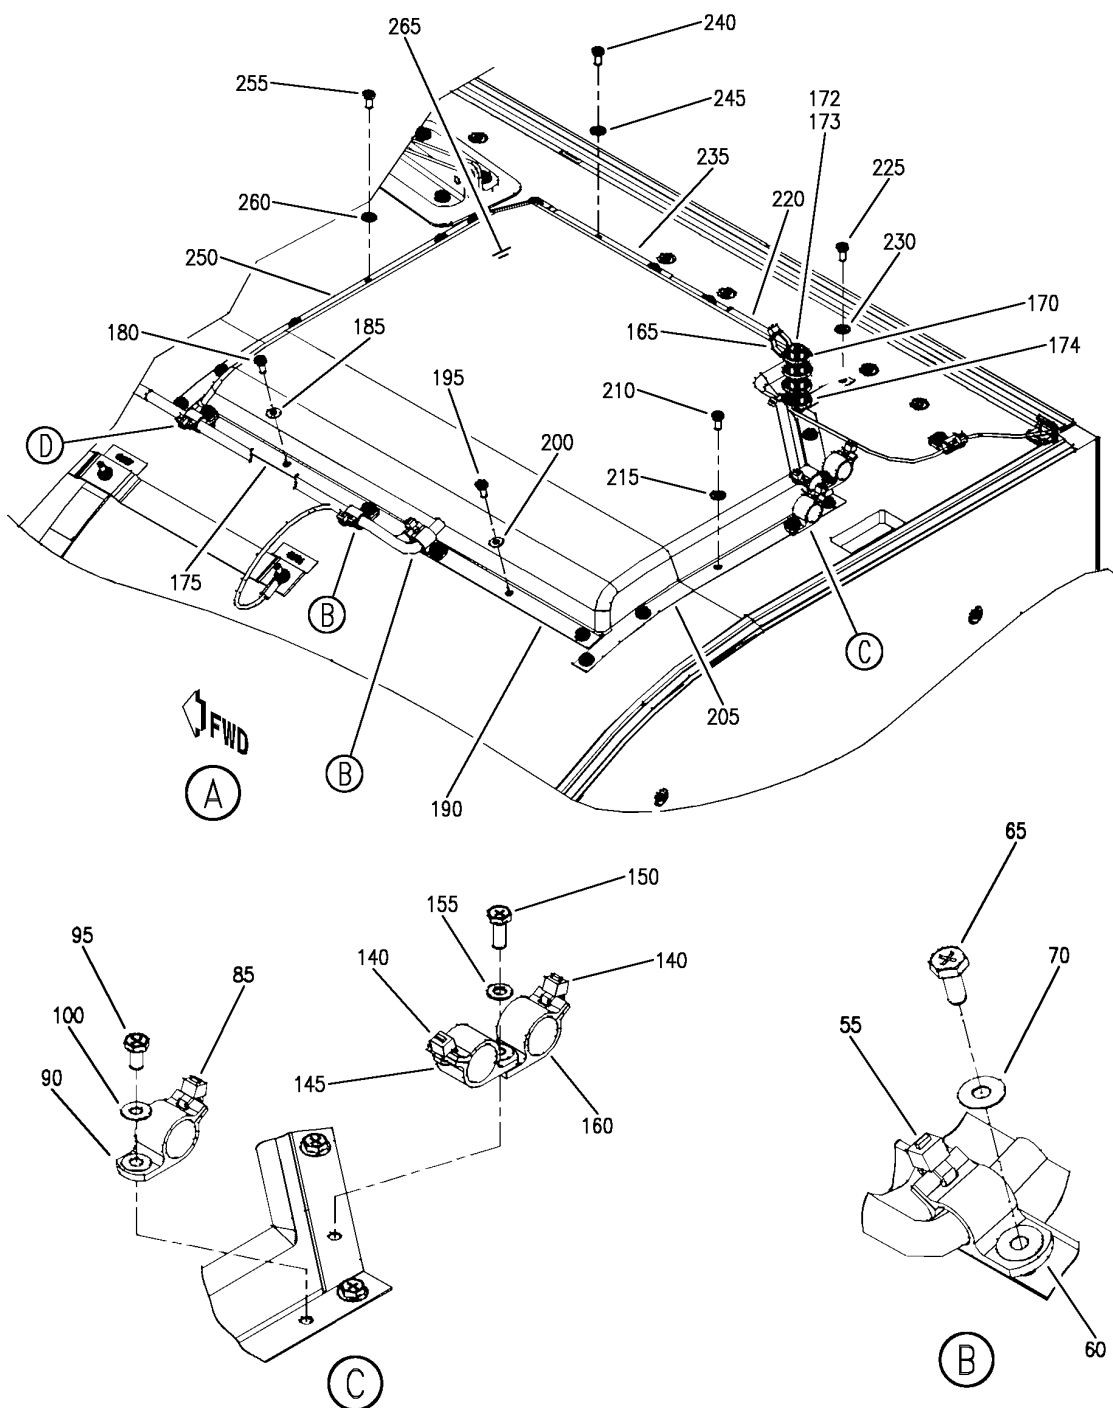

E 25401452D SHT 2 REV 253




MODULE ASSY-LAV D (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 52D (SHEET 2)

**25-40-14-52D**

RYR  
AUG 15/19

25-40-14-52D  
PAGE 0A

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

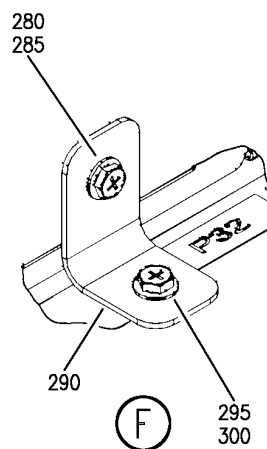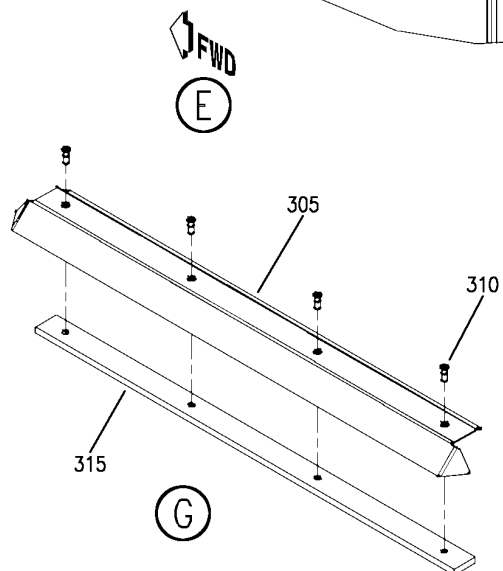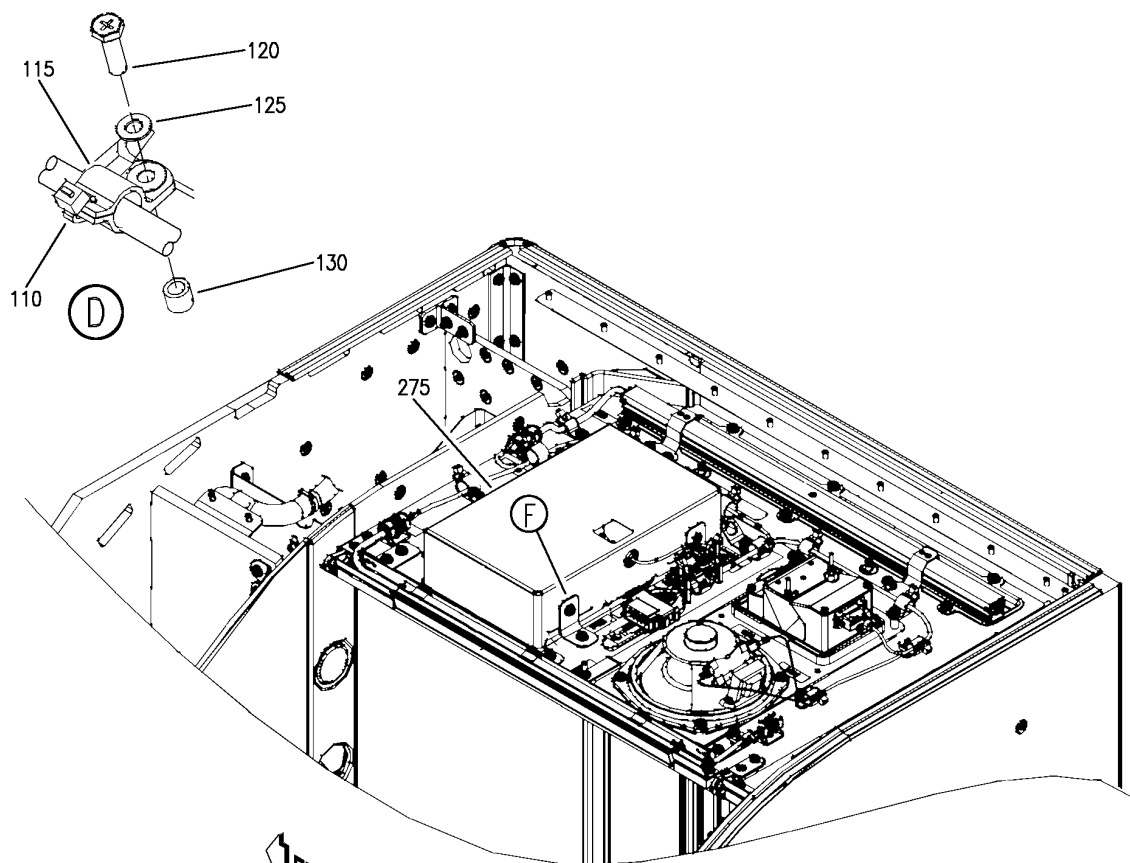


MODULE ASSY-LAV D (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 52D (SHEET 3)

25-40-14-52D

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

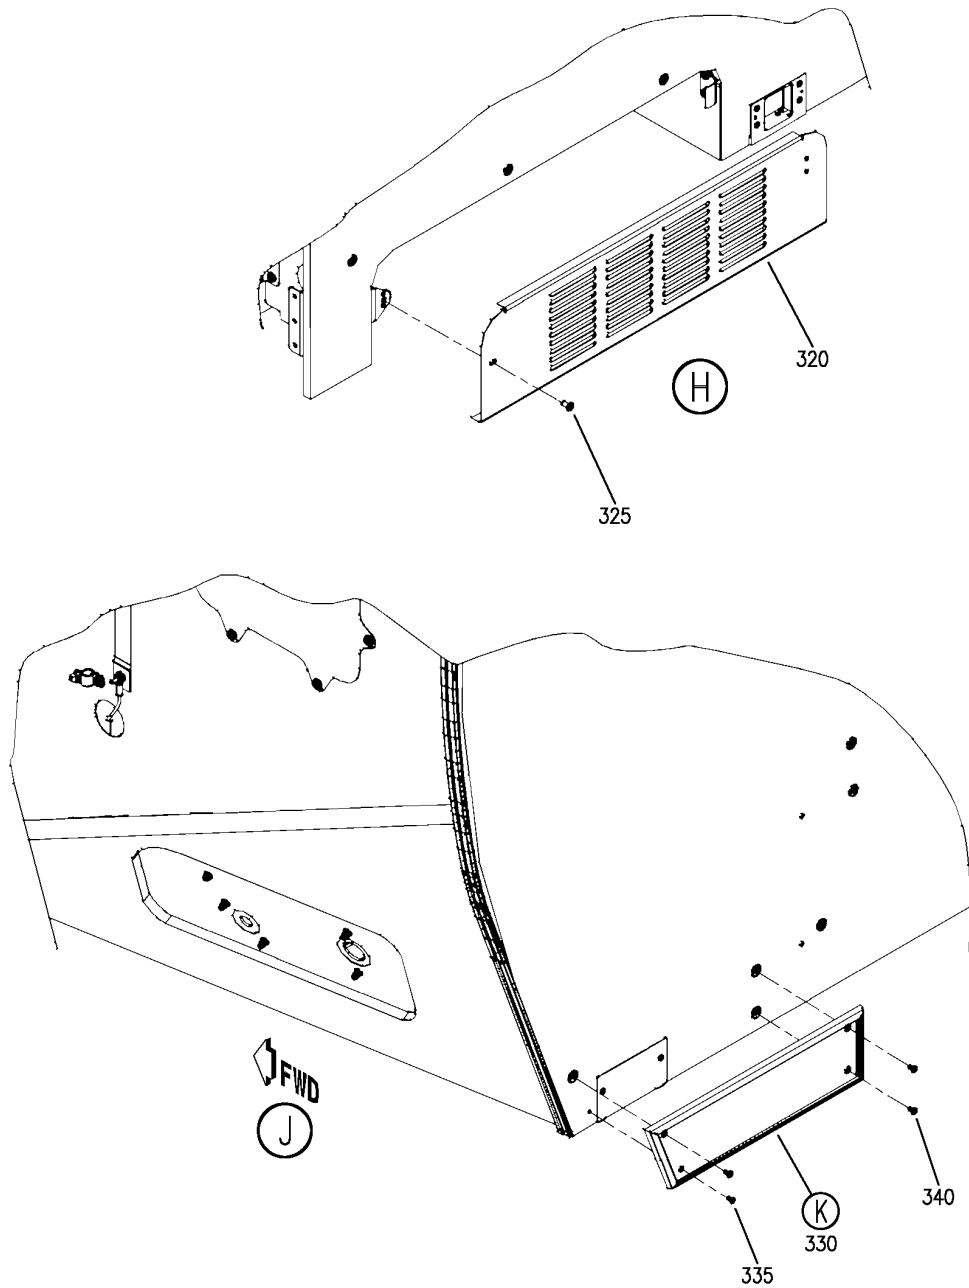

E 25401452D SHT 4 REV 253


MODULE ASSY-LAV D (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 52D (SHEET 4)

**25-40-14-52D**

R/YR  
AUG 15/19

25-40-14-52D  
PAGE 0C

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

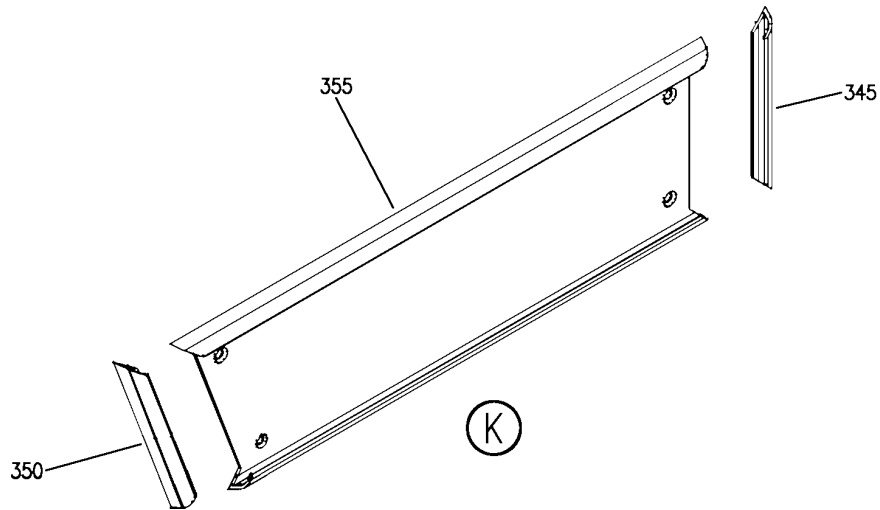

E 25401452D SHT 5 REV 253

MODULE ASSY-LAV D (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 52D (SHEET 5)

**25-40-14-52D**

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

R Y R  
AUG 15 / 19

25-40-14-52D  
PAGE 0D


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                                                                                                                                                                                                              | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 52D                                                     |                | MODULE ASSY-LAV D<br>(EQUIPMENT/FURNISHINGS<br>ONLY)                                                                                                                                                                                                                                                    | 460475            |                      |
| - 1                                                     | 1L300040-0743C | MODULE ASSY-LAV D<br>(EQUIPMENT/FURNISHINGS<br>ONLY)<br>SUPPLIER CODE:<br>V6S8D7<br>FUNCTIONAL DESCRIPTION:<br>PROVIDES LAVATORY<br>FACILITIES FOR<br>PASSENGERS AND CREW<br>ELECTRICAL EQUIP NUMBER:<br>M01418<br>COMPONENT MAINT MANUAL REF:<br>25-40-55<br>FOR NHA/OTHER SYS DET SEE:<br>25-40-14-01 | 460475            | RF                   |
| - 50                                                    | 9L500001-102   | .CLAMP INSTL-ELECTRICAL<br>SUPPLIER CODE:<br>V6S8D7<br>CONFIG CHG DATA FROM A CMM:<br>SUPSD BY 9L500001-107                                                                                                                                                                                             | 460475            | 2                    |
| - 50                                                    | 9L500001-107   | .CLAMP INSTL-ELECTRICAL<br>SUPPLIER CODE:<br>V6S8D7<br>CONFIG CHG DATA FROM A CMM:<br>SUPERSEDES 9L500001-102                                                                                                                                                                                           | 460475            | 2                    |
| 55                                                      | MS3367-5-9     | ..STRAP<br>STANDARD SUBSTITUTION:<br>BACS38K5                                                                                                                                                                                                                                                           | 460475            | 1                    |
| 60                                                      | CA2030-2       | ..CLAMP-<br>SUPPLIER CODE:<br>V03296<br>CONFIG CHG DATA FROM A CMM:<br>SUPSD BY CA2030-3                                                                                                                                                                                                                | 460475            | 1                    |
| 60                                                      | CA2030-3       | ..CLAMP-<br>SUPPLIER CODE:<br>V03296<br>CONFIG CHG DATA FROM A CMM:<br>SUPERSEDES CA2030-2                                                                                                                                                                                                              | 460475            | 1                    |
| 65                                                      | NAS1801-3-6    | ATTACHING PARTS<br>..SCREW-<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6<br>CONFIG CHG DATA FROM A CMM:<br>SUPSD BY NAS1801-3-10                                                                                                                                                                            | 460475            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |                                                                                                                                                                                                                                                                                                         |                   |                      |

- ITEM NOT ILLUSTRATED

RYR

25-40-14-52D

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-14  
 FIG. 52D  
 PAGE 1  
 APR 15/23




**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER   | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                    | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|---------------|---------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 52D                                                     |               |                                                                                                               |                   |                      |
| 65                                                      | NAS1801-3-10  | ..SCREW-<br>STANDARD SUBSTITUTION:<br>BACS12HN3-10<br>CONFIG CHG DATA FROM A CMM:<br>SUPERSEDES NAS1801-3-6   | 460475            | 1                    |
| 70                                                      | NAS1149D0316K | ..WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J                                                           | 460475            | 1                    |
| - 75                                                    | NAS43DD3-16N  | ..SPACER-<br>STANDARD SUBSTITUTION:<br>NAS43DD3-16FC<br>USED WITH:<br>9L500001-107<br>-----*-----             | 460475            | 1                    |
| - 80                                                    | 9L500001-103  | .CLAMP INSTL-ELECTRICAL<br>SUPPLIER CODE:<br>V6S8D7                                                           | 460475            | 1                    |
| 85                                                      | MS3367-5-9    | ..STRAP<br>STANDARD SUBSTITUTION:<br>BACS38K5                                                                 | 460475            | 1                    |
| 90                                                      | CA2030-3      | ..CLAMP-<br>SUPPLIER CODE:<br>V03296<br>ATTACHING PARTS                                                       | 460475            | 1                    |
| 95                                                      | NAS1801-3-6   | ..SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                                                              | 460475            | 1                    |
| 100                                                     | NAS1149D0316K | ..WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J<br>-----*-----                                            | 460475            | 1                    |
| - 105                                                   | 9L500001-106  | .CLAMP INSTL-ELECTRICAL<br>SUPPLIER CODE:<br>V6S8D7<br>CONFIG CHG DATA FROM A CMM:<br>SUPSD BY 9L500001-107   | 460475            | 1                    |
| - 105                                                   | 9L500001-107  | .CLAMP INSTL-ELECTRICAL<br>SUPPLIER CODE:<br>V6S8D7<br>CONFIG CHG DATA FROM A CMM:<br>SUPERSEDES 9L500001-106 | 460475            | 1                    |
| 110                                                     | MS3367-5-9    | ..STRAP<br>STANDARD SUBSTITUTION:<br>BACS38K5                                                                 | 460475            | 1                    |
| 115                                                     | CA2030-2      | ..CLAMP-<br>SUPPLIER CODE:<br>V03296<br>CONFIG CHG DATA FROM A CMM:<br>SUPSD BY CA2030-3                      | 460475            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |               |                                                                                                               |                   |                      |

- ITEM NOT ILLUSTRATED

R Y R

25-40-14-52D

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-14  
FIG. 52D  
PAGE 2  
APR 15/23

 **BOEING**  
737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER   | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                    | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|---------------|---------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 52D<br>115                                              | CA2030-3      | ..CLAMP-<br>SUPPLIER CODE:<br>V03296<br>CONFIG CHG DATA FROM A CMM:<br>SUPERSEDES CA2030-2<br>ATTACHING PARTS | 460475            | 1                    |
| 120                                                     | NAS1801-3-10  | ..SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-10                                                             | 460475            | 1                    |
| 125                                                     | NAS1149D0316K | ..WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J                                                           | 460475            | 1                    |
| 130                                                     | NAS43DD3-16N  | ..SPACER<br>STANDARD SUBSTITUTION:<br>NAS43DD3-16FC<br>-----*-----                                            | 460475            | 1                    |
| - 135                                                   | 9L500001-150  | .CLAMP INSTL-ELECTRICAL<br>SUPPLIER CODE:<br>V6S8D7                                                           | 460475            | 1                    |
| 140                                                     | MS3367-5-9    | ..STRAP<br>STANDARD SUBSTITUTION:<br>BACS38K5                                                                 | 460475            | 2                    |
| 145                                                     | CA2030-3      | ..CLAMP-<br>SUPPLIER CODE:<br>V03296<br>ATTACHING PARTS                                                       | 460475            | 1                    |
| 150                                                     | NAS1801-3-9   | ..SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-9                                                              | 460475            | 1                    |
| 155                                                     | NAS1149D0316K | ..WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J<br>-----*-----                                            | 460475            | 1                    |
| 160                                                     | CA2030-3      | ..CLAMP-<br>SUPPLIER CODE:<br>V03296                                                                          | 460475            | 1                    |
| 165                                                     | MS3367-5-9    | .STRAP<br>STANDARD SUBSTITUTION:<br>BACS38K5                                                                  | 460475            | 2                    |
| 170                                                     | BACS31H1A     | ..SUPPORT<br>ATTACHING PARTS                                                                                  | 460475            | 1                    |
| 172                                                     | NAS1801-3-52  | ..SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-52                                                             | 460475            | 1                    |
| 173                                                     | NAS1149D0316K | ..WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J<br>-----*-----                                            | 460475            | 1                    |
| 174                                                     | BACS31H1A     | ..SUPPORT                                                                                                     | 460475            | 3                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |               |                                                                                                               |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R

25-40-14-52D

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-14  
FIG. 52D  
PAGE 3  
APR 15/23


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER   | 1 2 3 4 5 6 7 NOMENCLATURE                                         | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|---------------|--------------------------------------------------------------------|-------------------|----------------------|
| 52D                                                     |               |                                                                    |                   |                      |
| 175                                                     | 1L500409-741  | .STRAP-FIRE BLANKET<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS | 460475            | 1                    |
| 180                                                     | NAS1801-3-6   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                    | 460475            | 1                    |
| 185                                                     | NAS1149D0316K | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J<br>-----*-----  | 460475            | 1                    |
| 190                                                     | 1L500409-743  | .STRAP-FIRE BLANKET<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS | 460475            | 1                    |
| 195                                                     | NAS1801-3-6   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                    | 460475            | 2                    |
| 200                                                     | NAS1149D0316K | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J<br>-----*-----  | 460475            | 2                    |
| 205                                                     | 1L500409-767  | .STRAP-FIRE BLANKET<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS | 460475            | 1                    |
| 210                                                     | NAS1801-3-6   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                    | 460475            | 4                    |
| 215                                                     | NAS1149D0316K | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J<br>-----*-----  | 460475            | 4                    |
| 220                                                     | 1L500409-765  | .STRAP-FIRE BLANKET<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS | 460475            | 1                    |
| 225                                                     | NAS1801-3-6   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                    | 460475            | 4                    |
| 230                                                     | NAS1149D0316K | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J<br>-----*-----  | 460475            | 4                    |
| 235                                                     | 1L500409-763  | .STRAP-FIRE BLANKET<br>SUPPLIER CODE:<br>V6S8D7                    | 460475            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |               |                                                                    |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R

25-40-14-52D

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-14  
 FIG. 52D  
 PAGE 4  
 APR 15/23


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER   | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                                                                                                                                                                                                                                                                                 | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|---------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 52D                                                     |               |                                                                                                                                                                                                                                                                                                                                                                            |                   |                      |
| 240                                                     | NAS1801-3-6   | .ATTACHING PARTS<br>.SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                                                                                                                                                                                                                                                                                                        | 460475            | 2                    |
| 245                                                     | NAS1149D0316K | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J<br>-----*-----                                                                                                                                                                                                                                                                                                          | 460475            | 2                    |
| 250                                                     | 1L500409-745  | .STRAP-FIRE BLANKET<br>SUPPLIER CODE:<br>V6S8D7                                                                                                                                                                                                                                                                                                                            | 460475            | 1                    |
| 255                                                     | NAS1801-3-6   | .ATTACHING PARTS<br>.SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                                                                                                                                                                                                                                                                                                        | 460475            | 7                    |
| 260                                                     | NAS1149D0316K | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J<br>-----*-----                                                                                                                                                                                                                                                                                                          | 460475            | 7                    |
| 265                                                     | 1L500409-769  | .BLANKET-FIRE<br>SUPPLIER CODE:<br>V6S8D7                                                                                                                                                                                                                                                                                                                                  | 460475            | 1                    |
| - 270                                                   | MS3367-5-9    | .STRAP<br>STANDARD SUBSTITUTION:<br>BACS38K5                                                                                                                                                                                                                                                                                                                               | 460475            | AR                   |
| 275                                                     | 4576001-101   | .BOX ASSY-OXY<br>SUPPLIER CODE:<br>V16827<br>FUNCTIONAL DESCRIPTION:<br>STORES OXYGEN AND MASK<br>ASSEMBLIES. CONTROLS THE<br>DELIVERY OF OXYGEN TO<br>EACH MASK AND<br>COMMUNICATES WITH THE<br>AIRPLANE NETWORK.<br>MISCELLANEOUS DATA:<br>INC. LIFE SUPPORT<br><br>SYSTEMS CMM 25-23-68)<br>COMPONENT MAINT MANUAL REF:<br>25-23-68<br>FOR DETAILS SEE:<br>35-21-00-01A | 460475            | 1                    |
| 280                                                     | NAS1801-3-6   | .ATTACHING PARTS<br>.SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                                                                                                                                                                                                                                                                                                        | 460475            | 4                    |
| 285                                                     | NAS1149D0332J | .WASHER<br>-----*-----                                                                                                                                                                                                                                                                                                                                                     | 460475            | 4                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |               |                                                                                                                                                                                                                                                                                                                                                                            |                   |                      |

— ITEM NOT ILLUSTRATED

RYR

25-40-14-52D

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-14  
 FIG. 52D  
 PAGE 5  
 APR 15/23


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 | NOMENCLATURE                                                     | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|---------------|------------------------------------------------------------------|-------------------|----------------------|
| 52D<br>290                                              | 4L500403-17    |               | .ANGLE-<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS           | 460475            | 4                    |
| 295                                                     | NAS1801-3-6    |               | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                  | 460475            | 4                    |
| 300                                                     | NAS1149D0332J  |               | .WASHER<br>-----*-----                                           | 460475            | 4                    |
| 305                                                     | 1L500105-15    |               | .THRESHOLD-<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS       | 460475            | 1                    |
| 310                                                     | NAS8703A4      |               | .BOLT<br>STANDARD SUBSTITUTION:<br>BACB30ZE3K4<br>-----*-----    | 460475            | 4                    |
| 315                                                     | 1L500109-147   |               | .SPACER-THRESHOLD<br>SUPPLIER CODE:<br>V6S8D7                    | 460475            | 1                    |
| 320                                                     | 1L400040-41    |               | .COVER-TRASH TRAP<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS | 460475            | 1                    |
| 325                                                     | NAS8303-7      |               | .SCREW<br>-----*-----                                            | 460475            | 1                    |
| 330                                                     | 1L400109-403BA |               | .KICKSTRIP ASSY-<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS  | 460475            | 1                    |
| 335                                                     | NAS514P632-5   |               | .SCREW                                                           | 460475            | 1                    |
| 340                                                     | NAS514P832-5   |               | .SCREW<br>-----*-----                                            | 460475            | 3                    |
| 345                                                     | 1L500109-463BA |               | ..CAP-<br>SUPPLIER CODE:<br>V6S8D7                               | 460475            | 1                    |
| 350                                                     | 1L500109-471BA |               | ..ENDCAP-<br>SUPPLIER CODE:<br>V6S8D7                            | 460475            | 1                    |
| 355                                                     | 1L500109-473BA |               | ..RETAINER-<br>SUPPLIER CODE:<br>V6S8D7                          | 460475            | 1                    |
| - 360                                                   | 1L360041-0743C |               | .LAVATORY ASSY-<br>SUPPLIER CODE:<br>V16827                      | 460475            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |               |                                                                  |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R

25-40-14-52D

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-14  
 FIG. 52D  
 PAGE 6  
 APR 15/23


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 | NOMENCLATURE                                                                                                                                                                                                                           | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|---------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 52D<br>365                                              | 1L306041-151EW | ..            | STRUCTURE INSTL-<br>SUPPLIER CODE:<br>V16827<br>FOR DETAILS SEE:<br>25-40-14-52P                                                                                                                                                       | 460475            | 1                    |
| 370                                                     | 3L306040-101   | ..            | ELECTRICAL INSTL-STRUCT<br>SUPPLIER CODE:<br>V6S8D7<br>FUNCTIONAL REFERENCE:<br>EQUIPMENT/FURNISHINGS<br>FOR DETAILS SEE<br>25-41-60-25M<br>LIGHTS<br>FOR DETAILS SEE<br>33-27-51-20<br>WATER/WASTE<br>FOR DETAILS SEE<br>38-32-04-05U | 460475            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |               |                                                                                                                                                                                                                                        |                   |                      |

— ITEM NOT ILLUSTRATED


R Y R

25-40-14-52D

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

25-40-14  
 FIG. 52D  
 PAGE 7  
 DEC 15/17

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

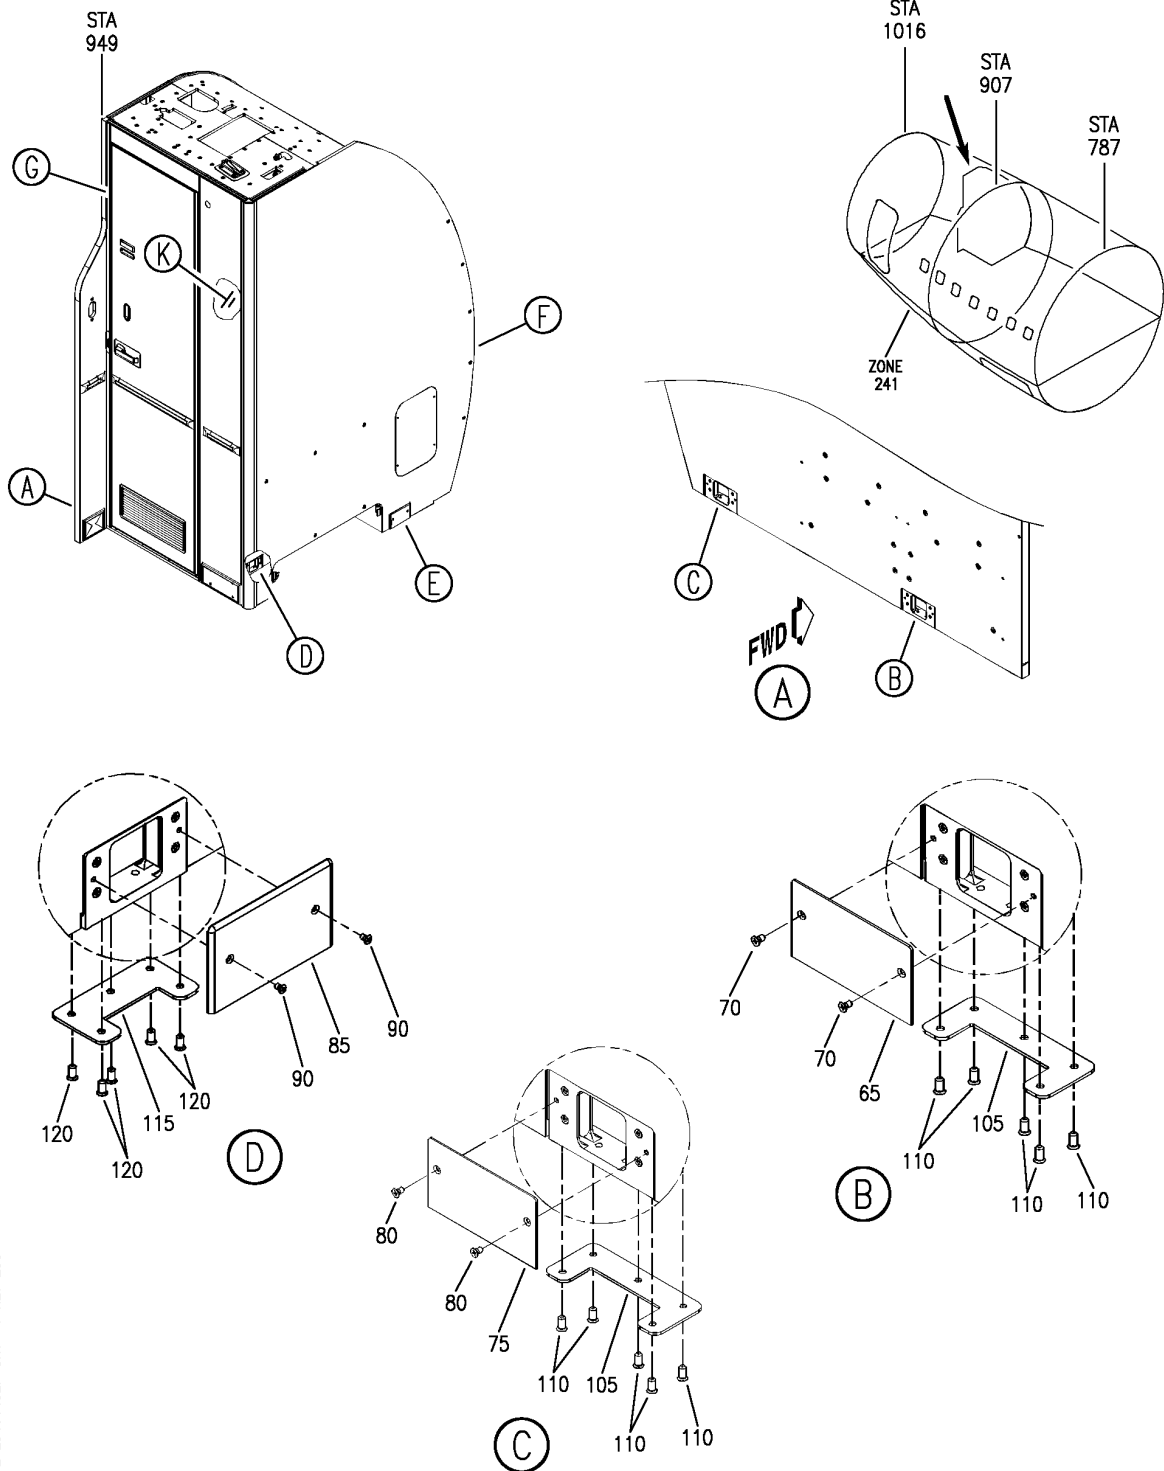

E 25401452P SHT 1 REV 253

STRUCTURE INSTL-LAV D  
FIGURE 52P (SHEET 1)


**25-40-14-52P**

R/YR  
AUG 15/17

25-40-14-52P  
PAGE 0

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

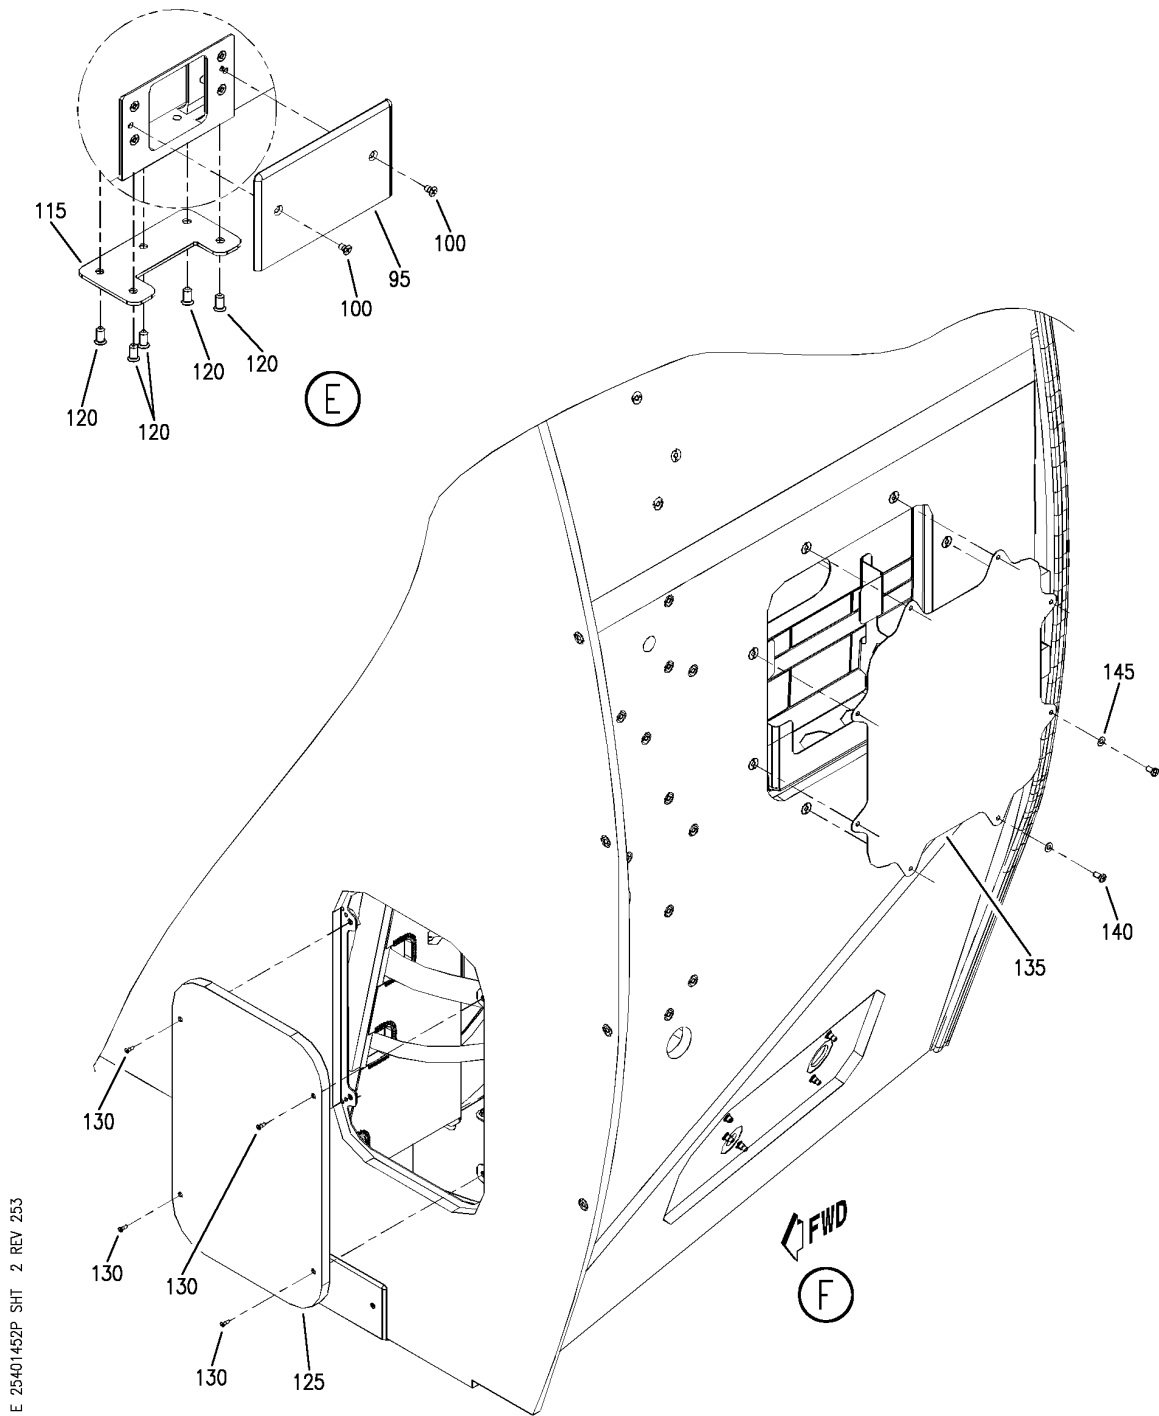

E 25401452P SHT 2 REV 253

STRUCTURE INSTL-LAV D  
FIGURE 52P (SHEET 2)

**25-40-14-52P**


R Y R  
AUG 15/17

25-40-14-52P  
PAGE 0A

ECCN 9E991 BOEING PROPRIETARY – See title page for details.



**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

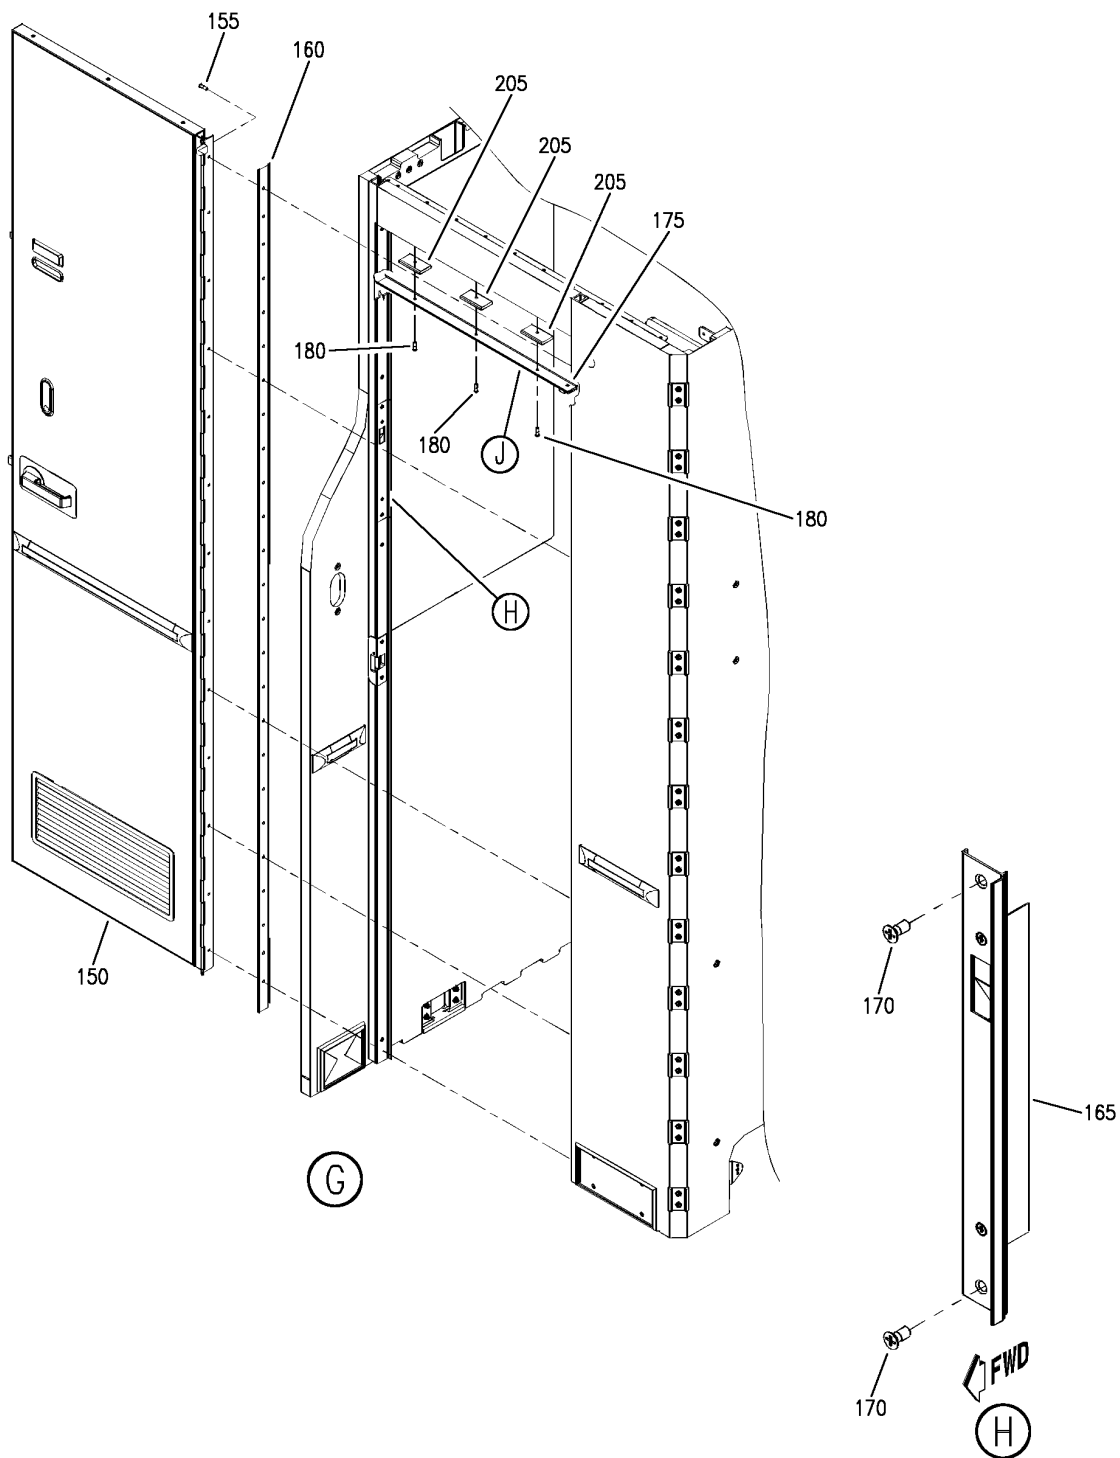

E 25401452P SHT 3 REV 253


STRUCTURE INSTL-LAV D  
FIGURE 52P (SHEET 3)

**25-40-14-52P**

R Y R  
AUG 15 / 17

25-40-14-52P  
PAGE 0B

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

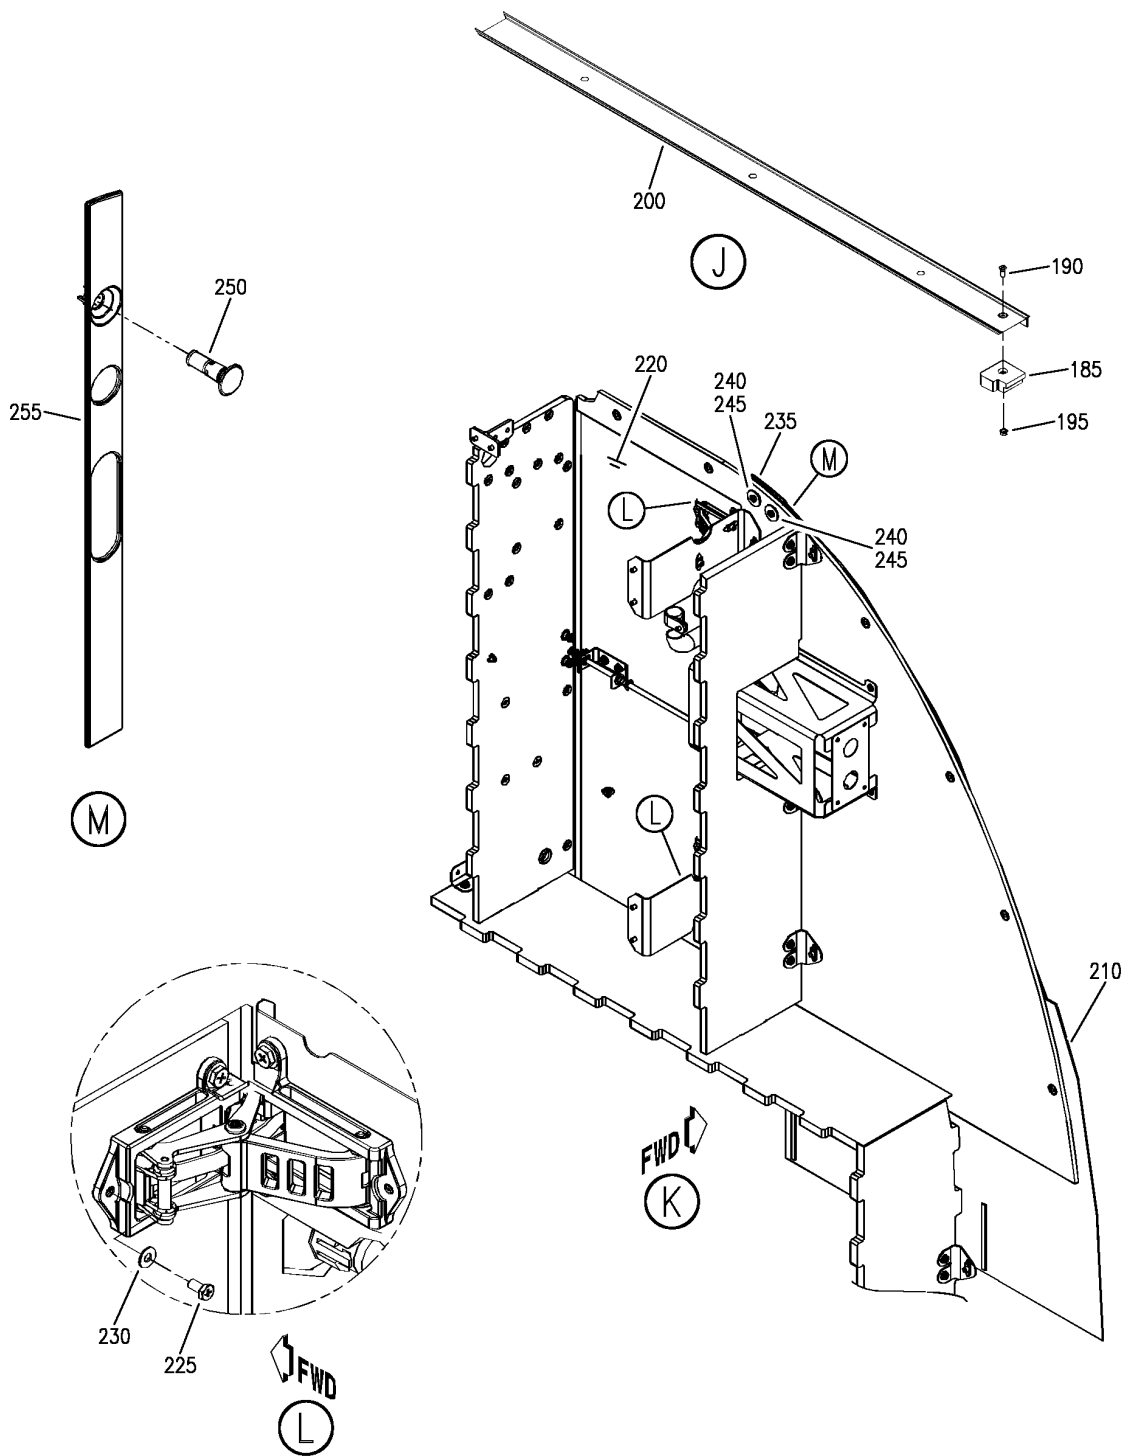

E 25401452P SHT 4 REV 253

STRUCTURE INSTL-LAV D  
FIGURE 52P (SHEET 4)

25-40-14-52P

R Y R  
AUG 15/17

25-40-14-52P  
PAGE 00

ECCN 9E991 BOEING PROPRIETARY – See title page for details.


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER     | 1 2 3 4 5 6 7 | NOMENCLATURE                                                                                                                                                                     | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|-----------------|---------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 52P                                                     |                 |               |                                                                                                                                                                                  |                   |                      |
| - 1                                                     | 1L306041-151EW  |               | STRUCTURE INSTL-LAV D<br>STRUCTURE INSTL-LAV D<br>SUPPLIER CODE:<br>V16827<br>FOR NHA SEE:<br>25-40-14-52D                                                                       | 460508<br>460475  | RF                   |
| - 1                                                     | 1L306041-117EW  |               | STRUCTURE INSTL-LAV D<br>SUPPLIER CODE:<br>V6S8D7<br>FOR NHA SEE:<br>25-40-14-53A                                                                                                | 476481            | RF                   |
| - 2                                                     | 1L306041-117HF  |               | STRUCTURE INSTL-LAV D<br>SUPPLIER CODE:<br>V6S8D7<br>FOR NHA SEE:<br>25-40-14-53B                                                                                                | 482508            | RF                   |
| - 50                                                    | 1L306041-151EW1 |               | . STRUCTURE INSTL-<br>SUPPLIER CODE:<br>V16827<br>FUNCTIONAL REFERENCE:<br>EQUIPMENT/FURNISHINGS<br>FOR DETAILS SEE<br>25-40-14-52Y<br>LIGHTS<br>FOR DETAILS SEE<br>33-26-03-43Q | 460475            | RF                   |
| - 50                                                    | 1L306041-117EW1 |               | . STRUCTURE INSTL-<br>SUPPLIER CODE:<br>V6S8D7<br>FUNCTIONAL REFERENCE:<br>EQUIPMENT/FURNISHINGS<br>FOR DETAILS SEE<br>25-40-14-52Y<br>LIGHTS<br>FOR DETAILS SEE<br>33-26-03-43Q | 476481            | RF                   |
| - 50                                                    | 1L306041-117HF1 |               | . STRUCTURE INSTL-<br>SUPPLIER CODE:<br>V6S8D7<br>FUNCTIONAL REFERENCE:<br>EQUIPMENT/FURNISHINGS<br>FOR DETAILS SEE<br>25-40-14-52Y<br>LIGHTS<br>FOR DETAILS SEE<br>33-26-03-43Q | 482508            | RF                   |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                 |               |                                                                                                                                                                                  |                   |                      |

- ITEM NOT ILLUSTRATED

RYR

25-40-14-52P

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-14  
 FIG. 52P  
 PAGE 1  
 FEB 15/18


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER     | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                                                                                           | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|-----------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 52P<br>- 55                                             | 1L306041-151EW2 | .STRUCTURE INSTL-<br>SUPPLIER CODE:<br>V16827<br>FOR DETAILS SEE:<br>25-40-14-52R                                                                                                    | 460475            | RF                   |
| - 55                                                    | 1L306041-117EW2 | .STRUCTURE INSTL-<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-40-14-52R                                                                                                    | 476481            | RF                   |
| - 55                                                    | 1L306041-117HF2 | .STRUCTURE INSTL-<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-40-14-52R                                                                                                    | 482508            | RF                   |
| - 60                                                    | 1L306041-151EW3 | .STRUCTURE INSTL-<br>SUPPLIER CODE:<br>V16827<br>FUNCTIONAL REFERENCE:<br>EQUIPMENT/FURNISHINGS<br>FOR DETAILS SEE<br>25-40-14-52T<br>WATER/WASTE<br>FOR DETAILS SEE<br>38-11-51-21P | 460475            | RF                   |
| - 60                                                    | 1L306041-117EW3 | .STRUCTURE INSTL-<br>SUPPLIER CODE:<br>V6S8D7<br>FUNCTIONAL REFERENCE:<br>EQUIPMENT/FURNISHINGS<br>FOR DETAILS SEE<br>25-40-14-52T<br>WATER/WASTE<br>FOR DETAILS SEE<br>38-11-51-21P | 476481            | RF                   |
| - 60                                                    | 1L306041-117HF3 | .STRUCTURE INSTL-<br>SUPPLIER CODE:<br>V6S8D7<br>FUNCTIONAL REFERENCE:<br>EQUIPMENT/FURNISHINGS<br>FOR DETAILS SEE<br>25-40-14-52T<br>WATER/WASTE<br>FOR DETAILS SEE<br>38-11-51-21P | 482508            | RF                   |
| 65                                                      | 1L500409-841CH  | .PLATE-COVER<br>SUPPLIER CODE:<br>V6S8D7                                                                                                                                             | 460508            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                 |                                                                                                                                                                                      |                   |                      |

- ITEM NOT ILLUSTRATED

RYR

25-40-14-52P

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-14  
 FIG. 52P  
 PAGE 2  
 FEB 15/18


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                                              | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|-----------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 52P                                                     |                |                                                                                                                                         |                   |                      |
| 70                                                      | NAS514P632-5   | ATTACHING PARTS<br>.SCREW<br>-----*-----                                                                                                | 460508            | 2                    |
| 75                                                      | 1L500409-841CH | .PLATE-COVER<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS<br>.SCREW<br>-----*-----                                                    | 460508            | 1                    |
| 80                                                      | NAS514P632-5   | ATTACHING PARTS<br>.SCREW<br>-----*-----                                                                                                | 460508            | 2                    |
| 85                                                      | 1L500409-263   | .PLATE-COVER<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS<br>.SCREW<br>-----*-----                                                    | 460508            | 1                    |
| 90                                                      | NAS514P632-5   | ATTACHING PARTS<br>.SCREW<br>-----*-----                                                                                                | 460508            | 2                    |
| 95                                                      | 1L500409-313   | .PLATE-COVER<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS<br>.SCREW<br>-----*-----                                                    | 460508            | 1                    |
| 100                                                     | NAS514P632-5   | ATTACHING PARTS<br>.SCREW<br>-----*-----                                                                                                | 460508            | 2                    |
| 105                                                     | 1L500409-253   | .PLATE-SHEAR<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS<br>.BOLT<br>-----*-----                                                     | 460508            | 2                    |
| 110                                                     | BACB30VF3K1    | ATTACHING PARTS<br>.BOLT<br>-----*-----                                                                                                 | 460508            | 10                   |
| 115                                                     | 1L500409-257   | .PLATE-SHEAR<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS<br>.BOLT<br>-----*-----                                                     | 460508            | 2                    |
| 120                                                     | BACB30VF3K1    | ATTACHING PARTS<br>.BOLT<br>-----*-----                                                                                                 | 460508            | 10                   |
| 125                                                     | 1L500409-155   | .PANEL-<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS<br>.SCREW<br>STANDARD SUBSTITUTION:<br>BACB30LU3-5<br>BACB30LH3-5<br>-----*----- | 460508            | 1                    |
| 130                                                     | NAS517-3-5     | ATTACHING PARTS<br>.SCREW<br>STANDARD SUBSTITUTION:<br>BACB30LU3-5<br>BACB30LH3-5<br>-----*-----                                        | 460508            | 4                    |
| 135                                                     | 1L500407-211   | .PAN-COVER<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS<br>.SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                            | 460508            | 1                    |
| 140                                                     | NAS1801-3-6    | ATTACHING PARTS<br>.SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                                                                      | 460508            | 8                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |                                                                                                                                         |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R

25-40-14-52P

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-14  
 FIG. 52P  
 PAGE 3  
 APR 15/23


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER   | 1 2 3 4 5 6 7 NOMENCLATURE                                                                       | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|---------------|--------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 52P                                                     |               |                                                                                                  |                   |                      |
| 145                                                     | NAS1149D0332J | .WASHER<br>-----*-----                                                                           | 460508            | 8                    |
| 150                                                     | 1L400105-33EW | .DOOR ASSY-<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-41-17-13F                      | 460481            | 1                    |
| 150                                                     | 1L400105-33HF | .DOOR ASSY-<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-41-17-13F<br>ATTACHING PARTS   | 482508            | 1                    |
| 155                                                     | NAS8603-3     | .BOLT<br>-----*-----                                                                             | 460508            | 13                   |
| 160                                                     | 1L500109-301  | .TRIM-EDGE<br>SUPPLIER CODE:<br>V6S8D7                                                           | 460508            | 1                    |
| 165                                                     | 1L400109-93   | .SWITCH ASSY-<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>33-26-03-43R<br>ATTACHING PARTS | 460508            | 1                    |
| 170                                                     | NAS8703A1     | .BOLT<br>STANDARD SUBSTITUTION:<br>BACB30ZE3K1<br>-----*-----                                    | 460508            | 2                    |
| 175                                                     | 1L500109-461  | .TRIM ASSY-DOOR<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                                   | 460508            | 1                    |
| 180                                                     | NAS8703A4     | .BOLT<br>STANDARD SUBSTITUTION:<br>BACB30ZE3K4<br>-----*-----                                    | 460508            | 3                    |
| 185                                                     | 1L500105-169  | ..BLOCK-CLOSE-OUT<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                                 | 460508            | 1                    |
| 190                                                     | NAS514P440-5  | ..SCREW                                                                                          | 460508            | 1                    |
| 195                                                     | MS21042-04    | ..NUT<br>STANDARD SUBSTITUTION:<br>MS21042L04<br>BACN11AG04<br>-----*-----                       | 460508            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |               |                                                                                                  |                   |                      |

— ITEM NOT ILLUSTRATED

RYR

25-40-14-52P

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-14  
 FIG. 52P  
 PAGE 4  
 APR 15/23


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER  | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                                        | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|--------------|-----------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 52P<br>200                                              | 1L500109-459 | ..TRIM-OPENING<br>SUPPLIER CODE:<br>V6S8D7<br>CONFIG CHG DATA FROM A CMM:<br>SUPSD BY 1L500109-627                                | 460508            | 1                    |
| 200                                                     | 1L500109-627 | ..TRIM-OPENING<br>SUPPLIER CODE:<br>V6S8D7<br>CONFIG CHG DATA FROM A CMM:<br>SUPERSEDES 1L500109-459                              | 460508            | 1                    |
| 205                                                     | 1L500409-267 | .SPACER-BLK<br>SUPPLIER CODE:<br>V6S8D7                                                                                           | 460508            | 3                    |
| 210                                                     | 1L400403-71  | .MIRROR ASSY-FXD<br>SUPPLIER CODE:<br>V6S8D7<br>CONFIG CHG DATA FROM A CMM:<br>SUPSD BY 1L400403-711                              | 476508            | 1                    |
| 210                                                     | 1L400403-155 | .MIRROR ASSY-FXD<br>SUPPLIER CODE:<br>V6S8D7<br>CONFIG CHG DATA FROM A CMM:<br>SUPSD BY 1L400403-717                              | 460475            | 1                    |
| 210                                                     | 1L400403-711 | .MIRROR ASSY-FXD<br>SUPPLIER CODE:<br>V6S8D7<br>CONFIG CHG DATA FROM A CMM:<br>SUPERSEDES 1L400403-71                             | 476508            | 1                    |
| 210                                                     | 1L400403-719 | .MIRROR ASSY-FXD<br>SUPPLIER CODE:<br>V6S8D7<br>CONFIG CHG DATA FROM A CMM:<br>SUPERSEDES 1L400403-717                            | 460475            | 1                    |
| 210                                                     | 1L400403-717 | .MIRROR ASSY-FXD<br>SUPPLIER CODE:<br>V6S8D7<br>CONFIG CHG DATA FROM A CMM:<br>SUPERSEDES 1L400403-153<br>SUPERSEDES 1L400403-155 | 460475            | 1                    |
| - 215                                                   | 1L500403-351 | ..MIRROR-<br>SUPPLIER CODE:<br>V6S8D7<br>CONFIG CHG DATA FROM A CMM:<br>SUPSD BY 1L500403-345                                     | 460475            | 1                    |
| - 215                                                   | 1L500403-341 | ..MIRROR-<br>SUPPLIER CODE:<br>V6S8D7                                                                                             | 476508            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |              |                                                                                                                                   |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R

25-40-14-52P

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-14  
 FIG. 52P  
 PAGE 5  
 DEC 15/18


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER   | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                           | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|---------------|----------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 52P<br>- 215                                            | 1L500403-345  | ..MIRROR-<br>SUPPLIER CODE:<br>V6S8D7<br>CONFIG CHG DATA FROM A CMM:<br>SUPERSEDES 1L500403-351                      | 460475            | 1                    |
| - 215                                                   | 1L500403-351  | ..MIRROR-<br>SUPPLIER CODE:<br>V6S8D7<br>CONFIG CHG DATA FROM A CMM:<br>SUPSD BY 1L500403-345                        | 460475            | 1                    |
| - 217                                                   | 1L500045-67   | ..DOUBLER-<br>SUPPLIER CODE:<br>V6S8D7<br>USED WITH:<br>1L400403-711<br>1L400403-715<br>1L400403-717<br>1L400403-719 | 460508            | 1                    |
| 220                                                     | 1L400403-99   | .MIRROR ASSY-HINGED<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-41-51-62R<br>ATTACHING PARTS               | 460508            | 1                    |
| 225                                                     | NAS1801-3-5   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-5                                                                      | 460508            | 6                    |
| 230                                                     | NAS1149D0332J | .WASHER<br>-----*-----                                                                                               | 460508            | 6                    |
| 235                                                     | 1L400403-27   | .STRIP ASSY-AMENITIES<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                                                 | 460508            | 1                    |
| 240                                                     | NAS1801-08-6  | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN08-6                                                                     | 460508            | 4                    |
| 245                                                     | AN970-3       | .WASHER<br>-----*-----                                                                                               | 460508            | 4                    |
| 250                                                     | 1L400203-13   | ..GASPER-<br>SUPPLIER CODE:<br>V6S8D7                                                                                | 460508            | 1                    |
| 255                                                     | 1L500403-19   | ..STRIP-<br>SUPPLIER CODE:<br>V6S8D7                                                                                 | 460508            | 1                    |
| - 260                                                   | 1L500045-43   | .BRACKET-CUP HOLDER<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                                                   | 460475            | 2                    |
| - 265                                                   | NAS514P832-6  | .SCREW                                                                                                               | 460475            | 2                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |               |                                                                                                                      |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R

25-40-14-52P

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-14  
FIG. 52P  
PAGE 6  
APR 15/23




**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER | 1 2 3 4 5 6 7 | NOMENCLATURE   | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|-------------|---------------|----------------|-------------------|----------------------|
| 52P                                                     |             |               |                |                   |                      |
| - 270                                                   | NAS1169-8L  |               | . WASHER       | 460475            | 2                    |
|                                                         |             |               | -----*-----    |                   |                      |
| - 275                                                   | 1L400045-1  |               | . HOLDER-CUP   | 460475            | 1                    |
|                                                         |             |               | SUPPLIER CODE: |                   |                      |
|                                                         |             |               | V6S8D7         |                   |                      |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |             |               |                |                   |                      |

— ITEM NOT ILLUSTRATED


RYR

25-40-14-52P

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

25-40-14  
 FIG. 52P  
 PAGE 7  
 DEC 15/18

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

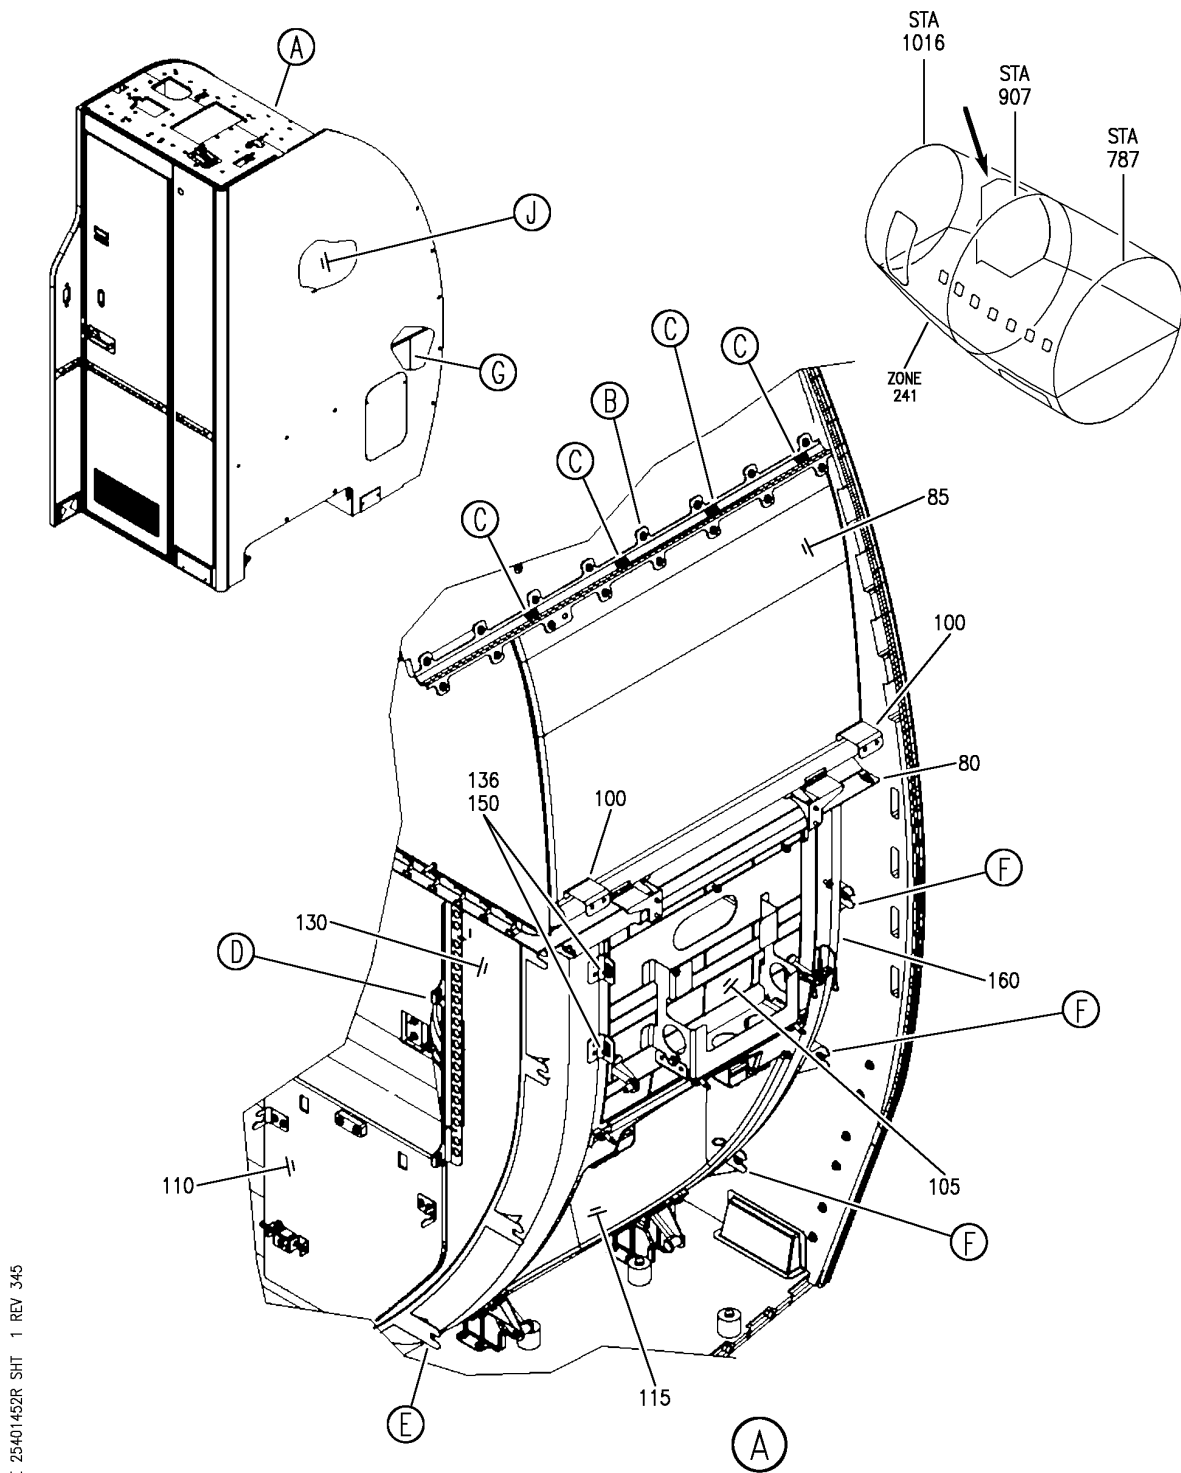

E 25401452R SHT 1 REV 345

STRUCTURE INSTL  
FIGURE 52R (SHEET 1)


**25-40-14-52R**

R/YR  
APR 15/25

25-40-14-52R  
PAGE 0

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

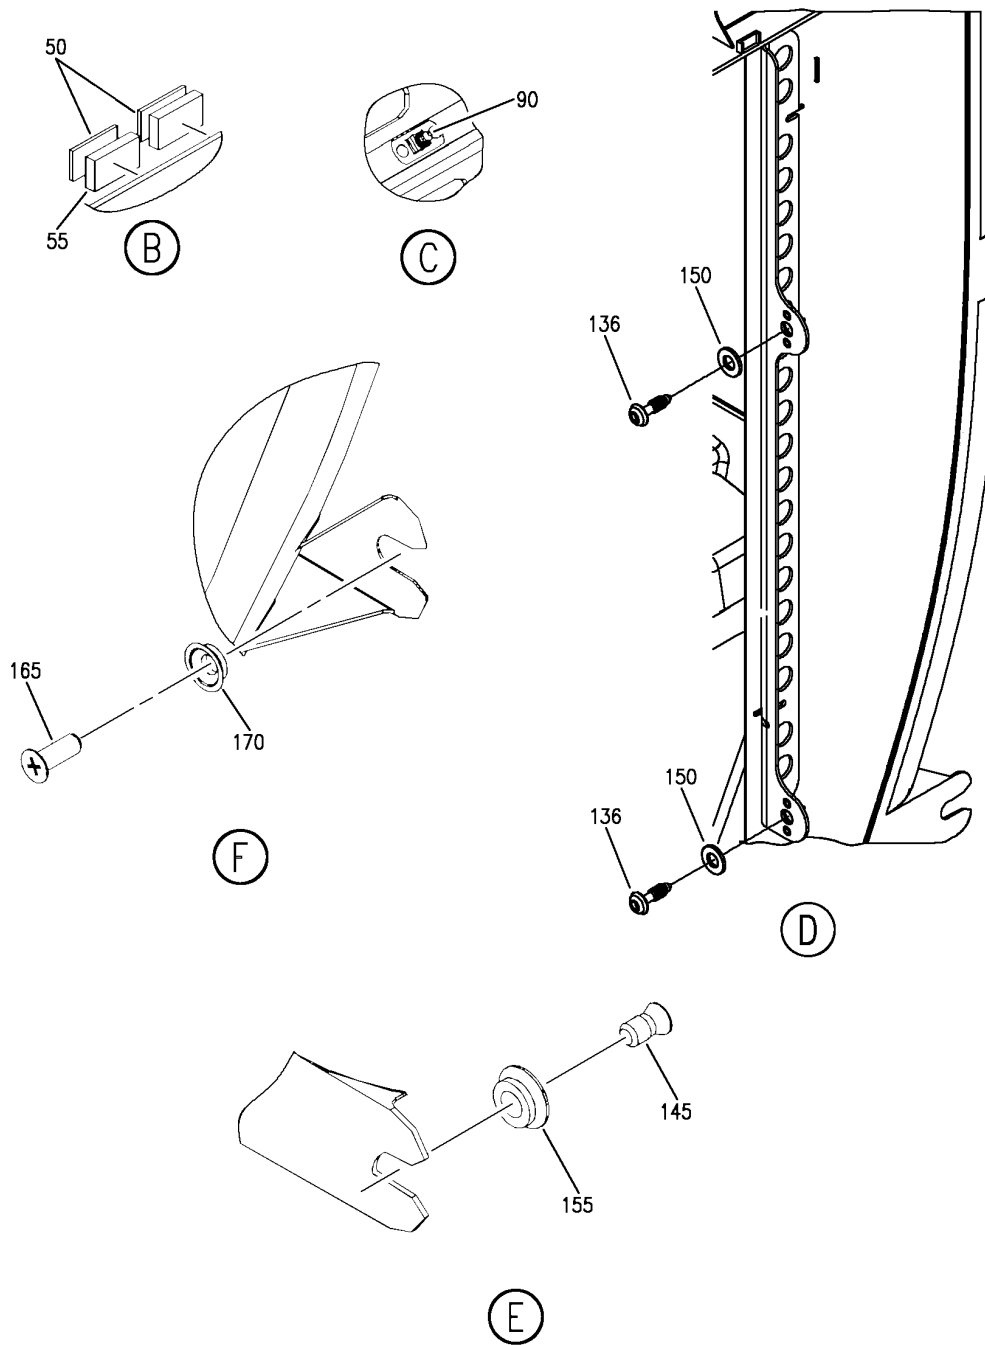

E 25401452R SHT 2 REV 297

STRUCTURE INSTL  
FIGURE 52R (SHEET 2)


**25-40-14-52R**

R Y R  
APR 15/25

25-40-14-52R  
PAGE 0A

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

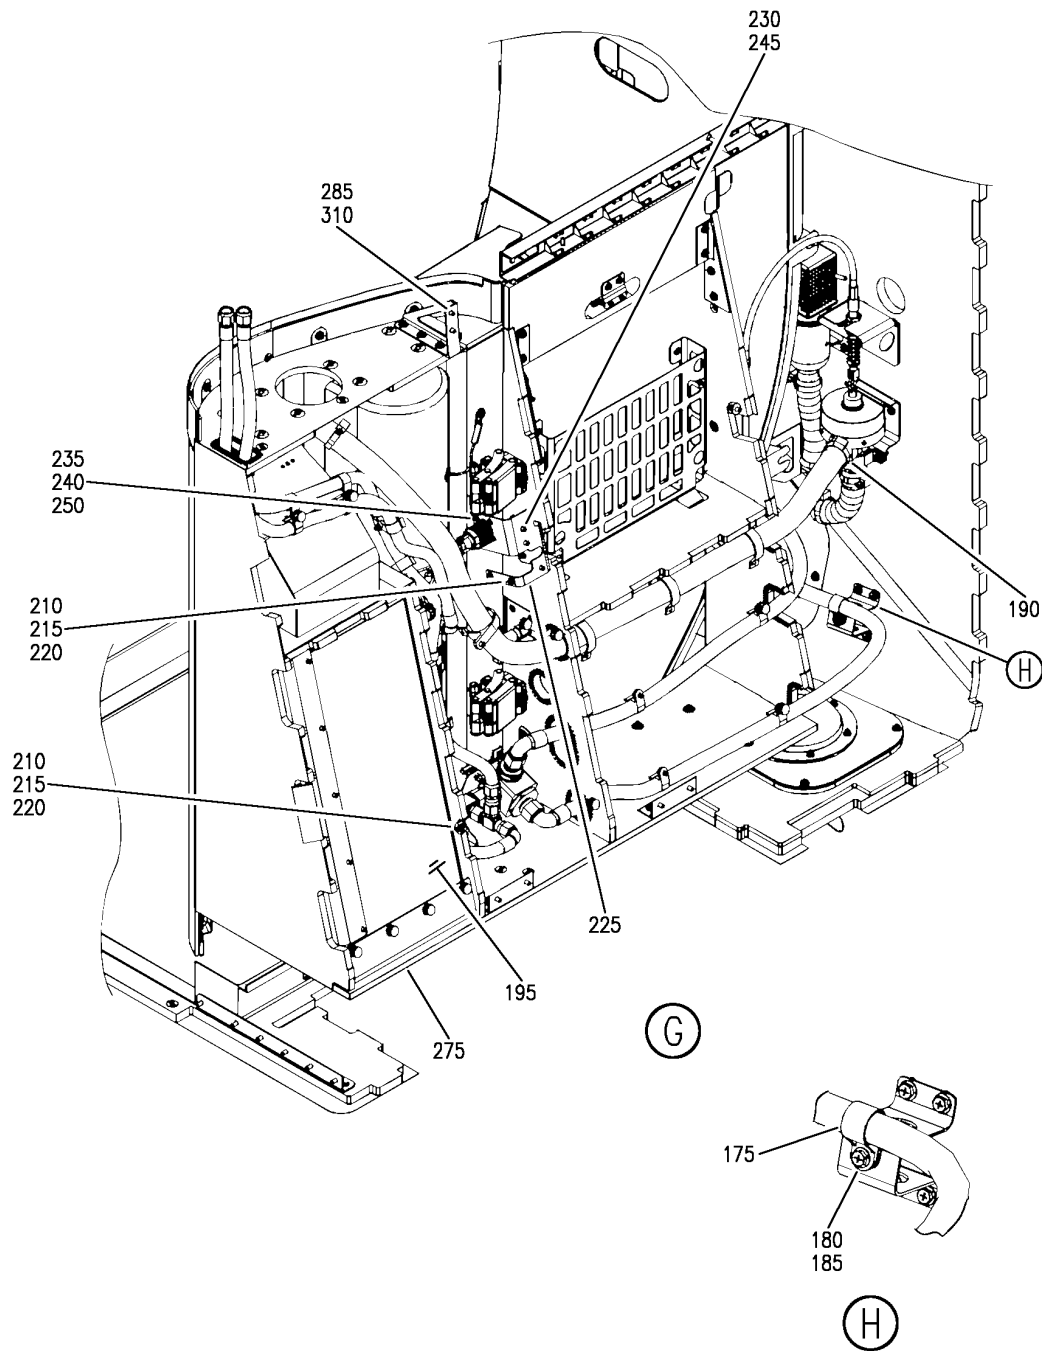

E 25401452R SHT 3 REV 253

STRUCTURE INSTL  
FIGURE 52R (SHEET 3)


**25-40-14-52R**

R Y R  
A P R 15 / 25

25-40-14-52R  
PAGE 0B

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

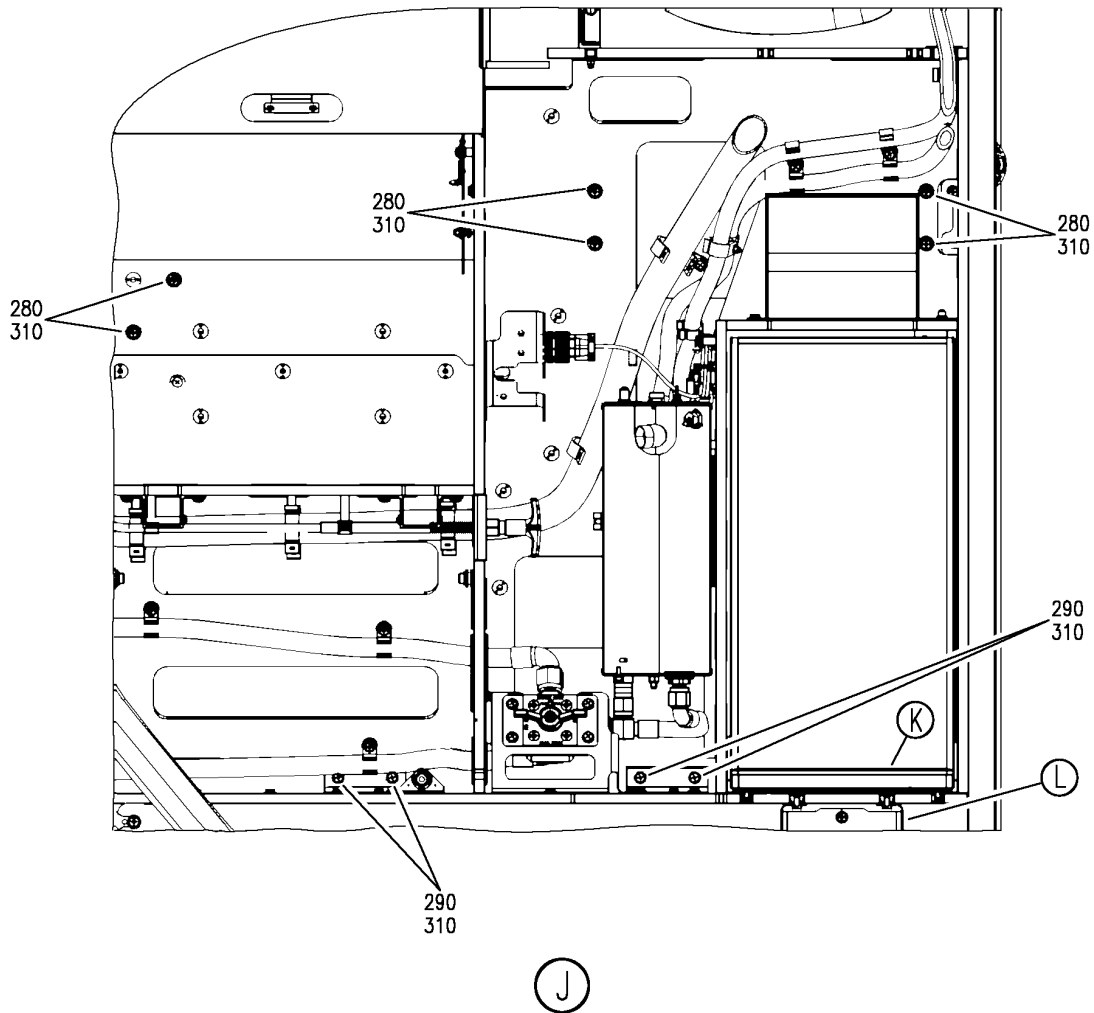

E 25401452R SHT 4 REV 253

STRUCTURE INSTL  
FIGURE 52R (SHEET 4)



**25-40-14-52R**

R Y R  
APR 15/25

25-40-14-52R  
PAGE 0C

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

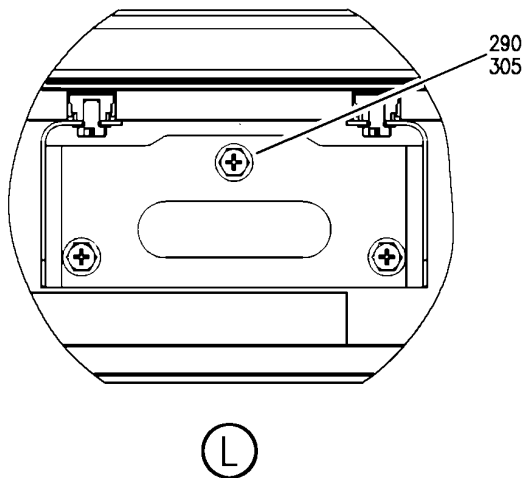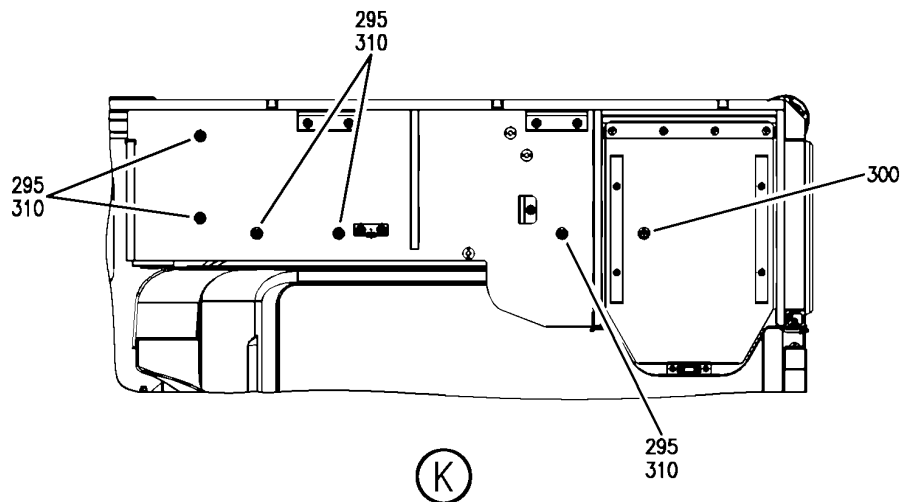

E 25401452R SHT 5 REV 297

STRUCTURE INSTL  
FIGURE 52R (SHEET 5)

**25-40-14-52R**

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

R Y R  
APR 15/25

25-40-14-52R  
PAGE 0D


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER     | 1 2 3 4 5 6 7 | NOMENCLATURE                                                                                                                                                    | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|-----------------|---------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 52R                                                     |                 |               |                                                                                                                                                                 |                   |                      |
| - 1                                                     | 1L306041-151EW2 |               | STRUCTURE INSTL<br>STRUCTURE INSTL-LAV D<br>SUPPLIER CODE:<br>V16827<br>FOR NHA SEE:<br>25-40-14-52P                                                            | 460508<br>460475  | RF                   |
| - 2                                                     | 1L306041-117EW2 |               | STRUCTURE INSTL-LAV D<br>SUPPLIER CODE:<br>V6S8D7<br>FOR NHA SEE:<br>25-40-14-52P                                                                               | 476481            | RF                   |
| - 2                                                     | 1L306041-117HF2 |               | STRUCTURE INSTL-LAV D<br>SUPPLIER CODE:<br>V6S8D7<br>FOR NHA SEE:<br>25-40-14-52P                                                                               | 482508            | RF                   |
| 50                                                      | 65PWF02         |               | .MAGNET-RECTANGULAR<br>SUPPLIER CODE:<br>V1B3S4<br>MISCELLANEOUS DATA:<br>ORDER LCCS7-2A                                                                        | 460508            | 2                    |
| 50                                                      | LCCS7-2A        |               | .MAGNET-RECTANGULAR<br>SUPPLIER CODE:<br>V6S8D7<br>TRUE PART NUMBER:<br>LCCS-7-2-A<br>MISCELLANEOUS DATA:<br>ADAMS MAGNETIC PRODUCTS<br>CO. PART NUMBER 65PWF02 | 460508            | 2                    |
| 55                                                      | 1L500411-67     |               | .SPACER-MAGNET<br>SUPPLIER CODE:<br>V6S8D7                                                                                                                      | 460508            | 2                    |
| - 60                                                    | 9L500001-310    |               | .MOUNTING INSTL-TIE,<br>ELECTRICAL<br>SUPPLIER CODE:<br>V6S8D7                                                                                                  | 460508            | 1                    |
| - 65                                                    | MS3367-5-9      |               | ..STRAP<br>STANDARD SUBSTITUTION:<br>BACS38K5                                                                                                                   | 460508            | 1                    |
| - 70                                                    | TM3S10          |               | ..MOUNT-CABLE<br>SUPPLIER CODE:<br>V06383<br>ATTACHING PARTS                                                                                                    | 460508            | 1                    |
| - 75                                                    | NAS514P1032-8   |               | ..SCREW<br>-----*-----                                                                                                                                          | 460508            | 1                    |
| 80                                                      | 1L400100-103    |               | .SHIELD-TRAP<br>SUPPLIER CODE:<br>V6S8D7                                                                                                                        | 460508            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                 |               |                                                                                                                                                                 |                   |                      |

— ITEM NOT ILLUSTRATED

RYR

25-40-14-52R

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-14  
FIG. 52R  
PAGE 1  
APR 15/25


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER  | 1 2 3 4 5 6 7<br>NOMENCLATURE                                                                                                         | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|--------------|---------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 52R<br>85                                               | 1L400411-57  | .SHROUD-BABY CHANGING TABLE<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                                                            | 460508            | 1                    |
| 90                                                      | 09T203       | .SCREW-<br>SUPPLIER CODE:<br>V94222<br>TRUE PART NUMBER:<br>09-T-203<br>-----*-----                                                   | 460508            | 4                    |
| - 95                                                    | BAC1521-827  | .SEAL-<br>MISCELLANEOUS DATA:<br>ORDER LCSR000010                                                                                     | 460508            | AR                   |
| - 95                                                    | LCSR000010   | .SEAL-EXTRUDED SILICONE<br>RUBBER<br>SUPPLIER CODE:<br>V6S8D7<br>MISCELLANEOUS DATA:<br>THE BOEING COMPANY PART<br>NUMBER BAC1521-827 | 460508            | AR                   |
| 100                                                     | 1L500100-101 | .STABILIZER-SHROUD<br>SUPPLIER CODE:<br>V6S8D7                                                                                        | 460508            | 2                    |
| 105                                                     | 1L400407-53  | .FACE ASSY-SEAT COVER<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-41-21-04J                                                 | 460508            | 1                    |
| 110                                                     | 1L400401-51  | .PANEL ASSY-AMENITIES BOX<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-41-40-04B                                             | 460508            | 1                    |
| 115                                                     | 1L400407-51  | .SHROUD ASSY-TOILET LID<br>SEAT<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-41-21-04K                                       | 460508            | 1                    |
| 130                                                     | 1L400407-259 | .SHROUD-RH<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                                                                             | 460508            | 1                    |
| 136                                                     | 09T305       | .SCREW-<br>SUPPLIER CODE:<br>V94222<br>TRUE PART NUMBER:<br>09-T-305                                                                  | 460508            | 4                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |              |                                                                                                                                       |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R

25-40-14-52R

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-14  
FIG. 52R  
PAGE 2  
APR 15/25




**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER                    | 1 2 3 4 5 6 7             | NOMENCLATURE                                                                                   | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|--------------------------------|---------------------------|------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 52R<br>- 142                                            | NAS1801-3-26                   | .SCREW-                   | STANDARD SUBSTITUTION:<br>BACS12HN3-26<br>SB DATA FROM A CMM:<br>POST SB 1L3-25-0057           | 460508            | 1                    |
| 145<br>- 147                                            | NAS514P1032-10<br>MS21042-3    | .SCREW<br>.NUT-           | STANDARD SUBSTITUTION:<br>MS21042L3<br>BACN11AG3<br>SB DATA FROM A CMM:<br>POST SB 1L3-25-0057 | 460508<br>460508  | 1<br>1               |
| 150<br>- 153                                            | NAS1149D0332J<br>NAS1149D0332J | .WASHER<br>.WASHER-       | SB DATA FROM A CMM:<br>POST SB 1L3-25-0057                                                     | 460508<br>460508  | 4<br>2               |
| 155                                                     | 1L500407-203                   | .FASTENER-SNAP            | SUPPLIER CODE:<br>V6S8D7                                                                       | 460508            | 1                    |
| 160                                                     | 1L500407-105                   | .SHROUD-LH OUTBD TOILET   | SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                                                    | 460508            | 1                    |
| 165<br>170                                              | NAS514P1032-6<br>1L500407-203  | .SCREW<br>.FASTENER-SNAP  | SUPPLIER CODE:<br>V6S8D7                                                                       | 460508<br>460508  | 4<br>4               |
| 175                                                     | MS25281F11                     | .CLAMP-                   | TRUE PART NUMBER:<br>MS25281-F11<br>ATTACHING PARTS                                            | 460508            | 1                    |
| 180                                                     | NAS1801-3-10                   | .SCREW                    | STANDARD SUBSTITUTION:<br>BACS12HN3-10                                                         | 460508            | 1                    |
| 185                                                     | NAS1149D0332J                  | .WASHER                   | -----*-----                                                                                    | 460508            | 1                    |
| 190<br>195                                              | NAS1922-0125-3<br>1L400101-67  | .CLAMP<br>.CAN ASSY-WASTE | SUPPLIER CODE:<br>V6S8D7                                                                       | 460508<br>460508  | 1<br>1               |
| - 197                                                   | SL00201                        | ..GROMMET-                | SUPPLIER CODE:<br>VOHESO<br>MISCELLANEOUS DATA:<br>ORDER LCEE000022                            | 460508            | AR                   |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                                |                           |                                                                                                |                   |                      |

- ITEM NOT ILLUSTRATED

R Y R

25-40-14-52R

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-14  
 FIG. 52R  
 PAGE 3  
 APR 15/25


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER   | 1 2 3 4 5 6 7 | NOMENCLATURE                                                                                                    | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|---------------|---------------|-----------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 52R<br>- 197                                            | LCEE000022    | ..            | GROMMET-<br>SUPPLIER CODE:<br>V6S8D7<br>MISCELLANEOUS DATA:<br>DEVICE TECHNOLOGIES,<br>INC. PART NUMBER SL00201 | 460508            | AR                   |
| - 200                                                   | MS3367-5-9    | .S            | STRAP<br>STANDARD SUBSTITUTION:<br>BACS38K5                                                                     | 460508            | AR                   |
| - 205                                                   | 9L500001-003  | .S            | STUD INSTL-GND ELECTRICAL<br>SUPPLIER CODE:<br>V6S8D7                                                           | 460508            | 3                    |
| 210                                                     | NAS1801-3-10  | ..S           | CREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-10                                                                  | 460508            | 1                    |
| 215                                                     | MS21042L3     | ..N           | UT<br>STANDARD SUBSTITUTION:<br>BACN11AG3                                                                       | 460508            | 1                    |
| 220                                                     | NAS1149D0316H | ..W           | ASHER                                                                                                           | 460508            | 3                    |
| 225                                                     | 1L500401-193  | .B            | RACKET-DISC.<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                                                     | 460508            | 1                    |
| 230                                                     | NAS1801-3-5   | .S            | CREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-5                                                                   | 460508            | 5                    |
| 235                                                     | NAS1801-04-6  | .S            | CREW<br>STANDARD SUBSTITUTION:<br>BACS12HN04-6                                                                  | 460508            | 4                    |
| 240                                                     | MS21042L04    | .N            | UT<br>STANDARD SUBSTITUTION:<br>BACN11AG04                                                                      | 460508            | 4                    |
| 245                                                     | NAS1149D0332J | .W            | ASHER                                                                                                           | 460508            | 5                    |
| 250                                                     | NAS1149DN432J | .W            | ASHER                                                                                                           | 460508            | 8                    |
| - 255                                                   | 9L500001-051  | .S            | STRAP INSTL-GND ELECTRICAL<br>SUPPLIER CODE:<br>V6S8D7                                                          | 460508            | 1                    |
| - 260                                                   | MS21042L3     | ..N           | UT<br>STANDARD SUBSTITUTION:<br>BACN11AG3                                                                       | 460508            | 1                    |
| - 265                                                   | NAS1149D0332H | ..W           | ASHER                                                                                                           | 460508            | 2                    |
| - 270                                                   | 9L500001-201  | ..S           | STANDOFF-HEXAGONAL<br>SUPPLIER CODE:<br>V6S8D7                                                                  | 460508            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |               |               |                                                                                                                 |                   |                      |

- ITEM NOT ILLUSTRATED

R Y R

25-40-14-52R

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-14  
 FIG. 52R  
 PAGE 4  
 APR 15/25


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                                                                                                                                                                                             | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 52R<br>275                                              | 1L406700-323   | .VANITY INSTL-LWR<br>SUPPLIER CODE:<br>V6S8D7<br>USED ON:<br>1L306041-117EW2<br>1L306041-117HF2<br>1L306041-151EW2<br>FUNCTIONAL REFERENCE:<br>EQUIPMENT/FURNISHINGS<br>FOR DETAILS SEE<br>25-41-51-64A<br>PLACARDS AND MARKINGS<br>FOR DETAILS SEE<br>11-32-05-53H<br>ATTACHING PARTS | 460508            | 1                    |
| 280                                                     | NAS1801-3-11   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-11                                                                                                                                                                                                                                       | 460508            | 6                    |
| 285                                                     | NAS1801-3-5    | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-5                                                                                                                                                                                                                                        | 460508            | 2                    |
| 290                                                     | NAS1801-3-6    | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                                                                                                                                                                                                                                        | 460508            | 7                    |
| 295                                                     | NAS1801-3-14   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-14                                                                                                                                                                                                                                       | 460508            | 5                    |
| 300                                                     | NAS514P1032-12 | .SCREW                                                                                                                                                                                                                                                                                 | 460508            | 1                    |
| 305                                                     | NAS1149D0316K  | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J                                                                                                                                                                                                                                     | 460508            | 3                    |
| 310                                                     | NAS1149D0332J  | .WASHER<br>-----*-----                                                                                                                                                                                                                                                                 | 460508            | 17                   |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |                                                                                                                                                                                                                                                                                        |                   |                      |

— ITEM NOT ILLUSTRATED


R Y R

25-40-14-52R

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

25-40-14  
FIG. 52R  
PAGE 5  
APR 15/25

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

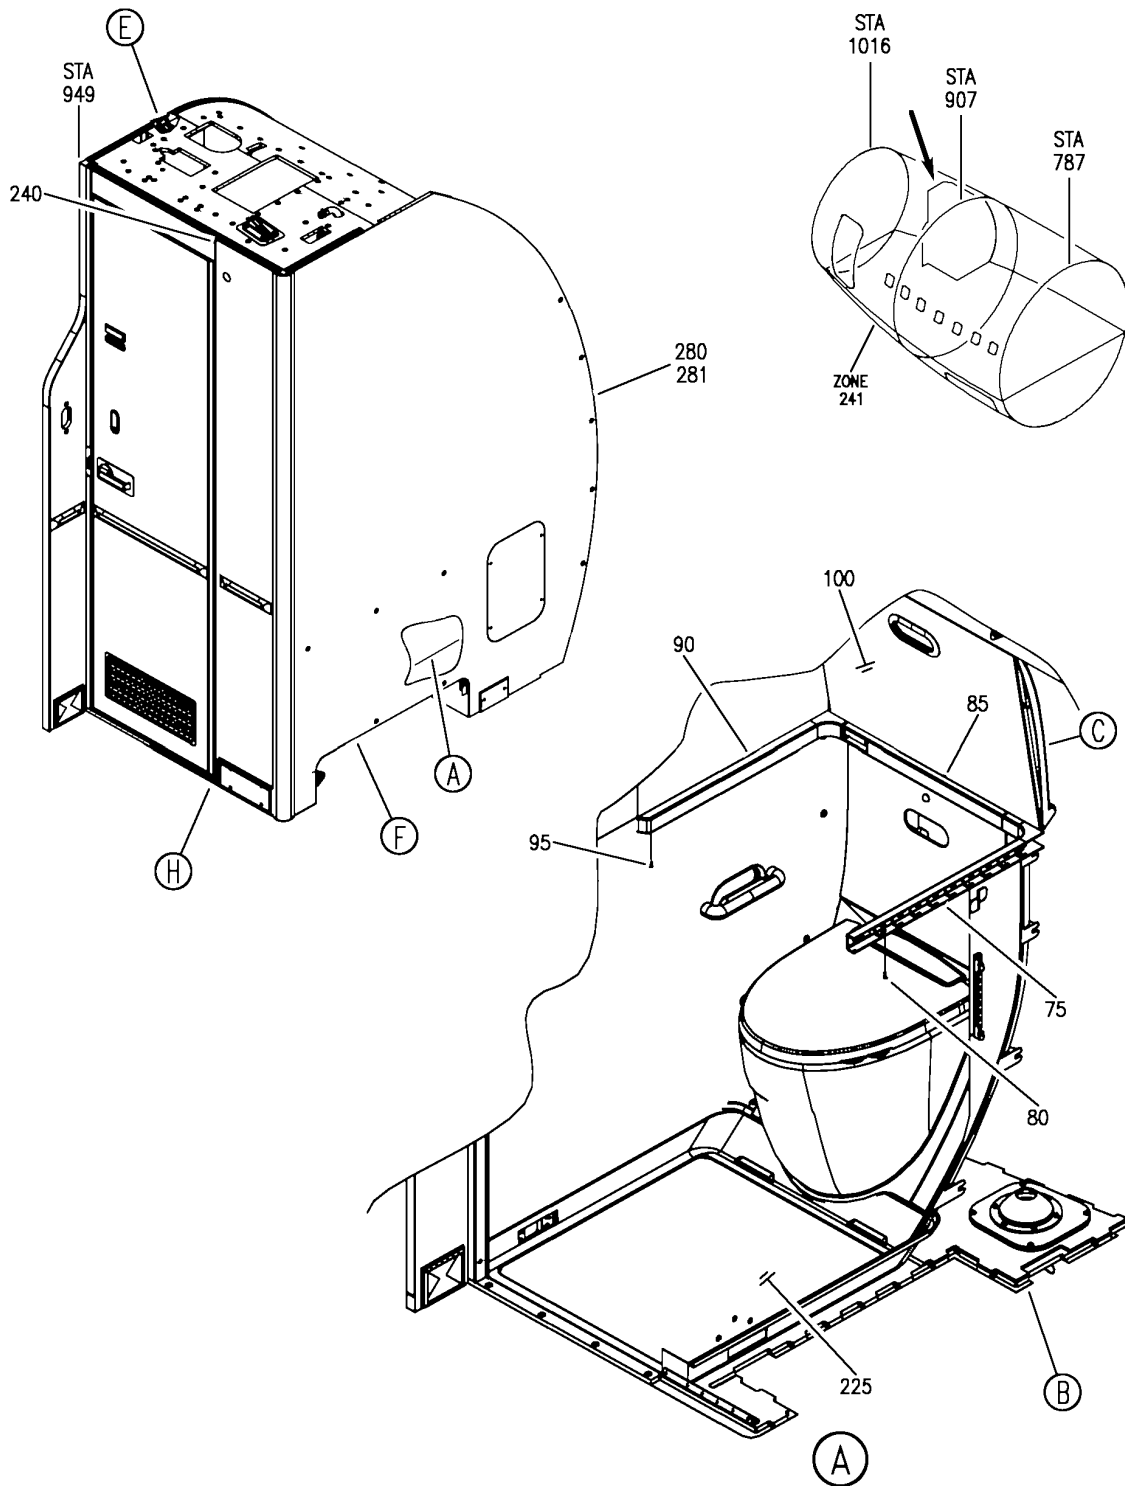

E 25401452T SHT 1 REV 259

STRUCTURE INSTL-LAV (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 52T (SHEET 1)


**25-40-14-52T**

RJR  
FEB 15/18

25-40-14-52T  
PAGE 0

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

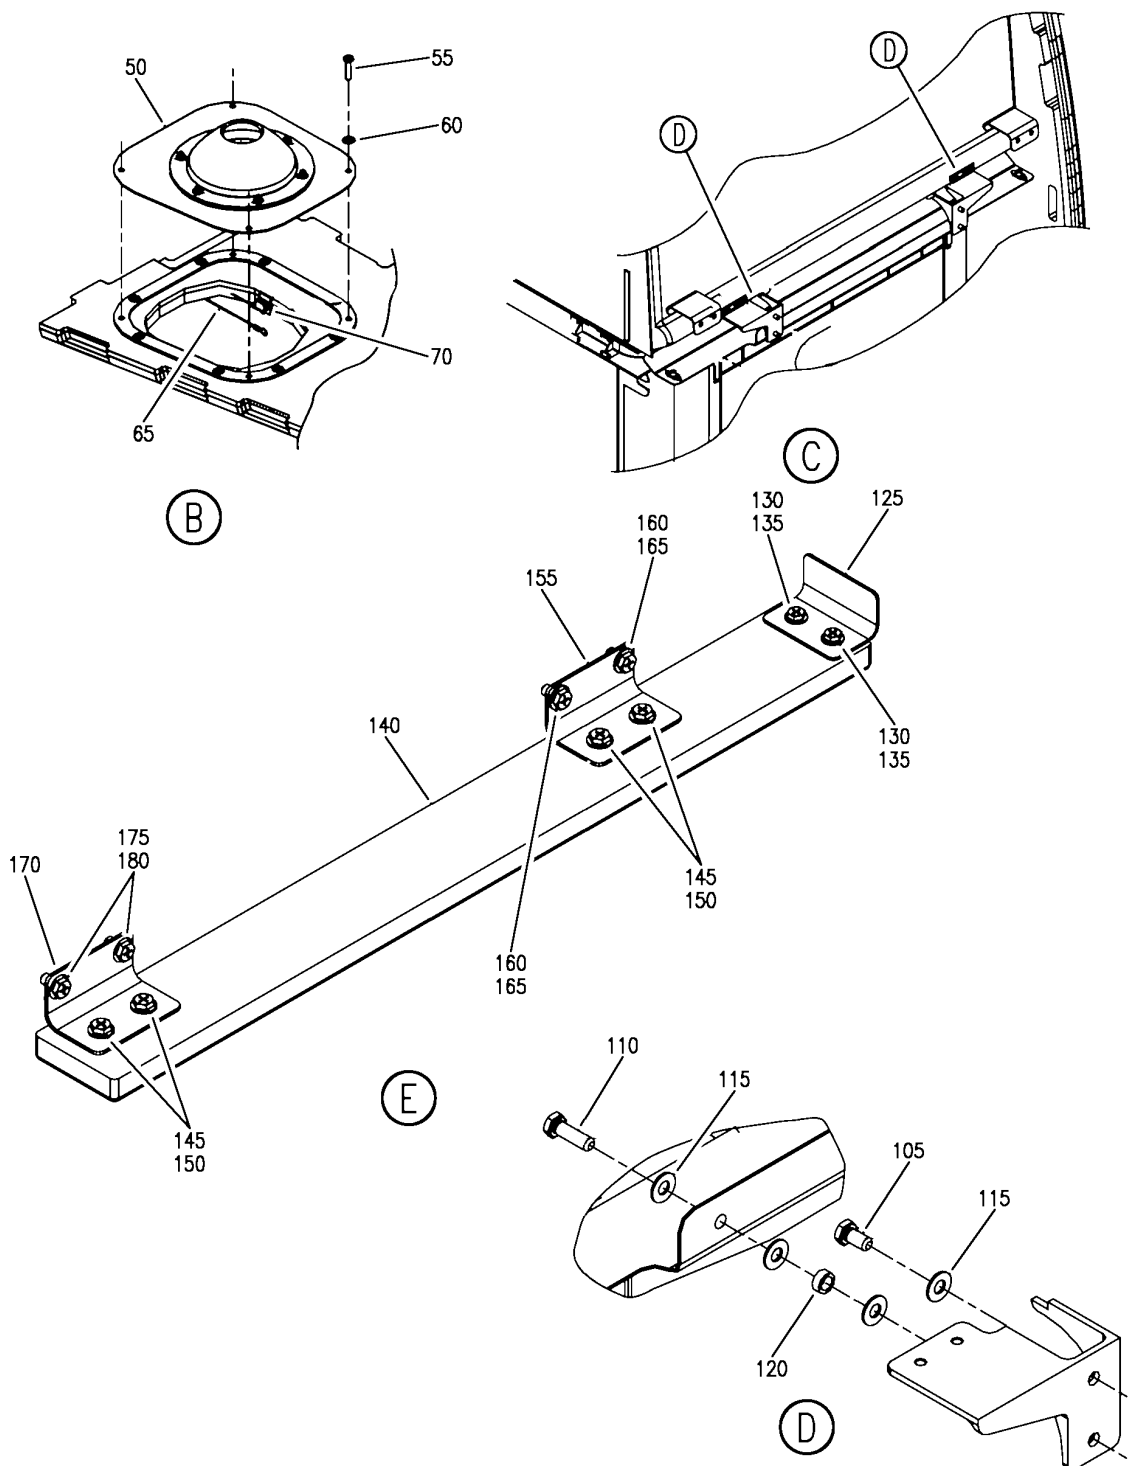

E 25401452T SHT 2 REV 253

STRUCTURE INSTL-LAV (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 52T (SHEET 2)


**25-40-14-52T**

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

RYR  
AUG 15/17

25-40-14-52T  
PAGE 0A

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

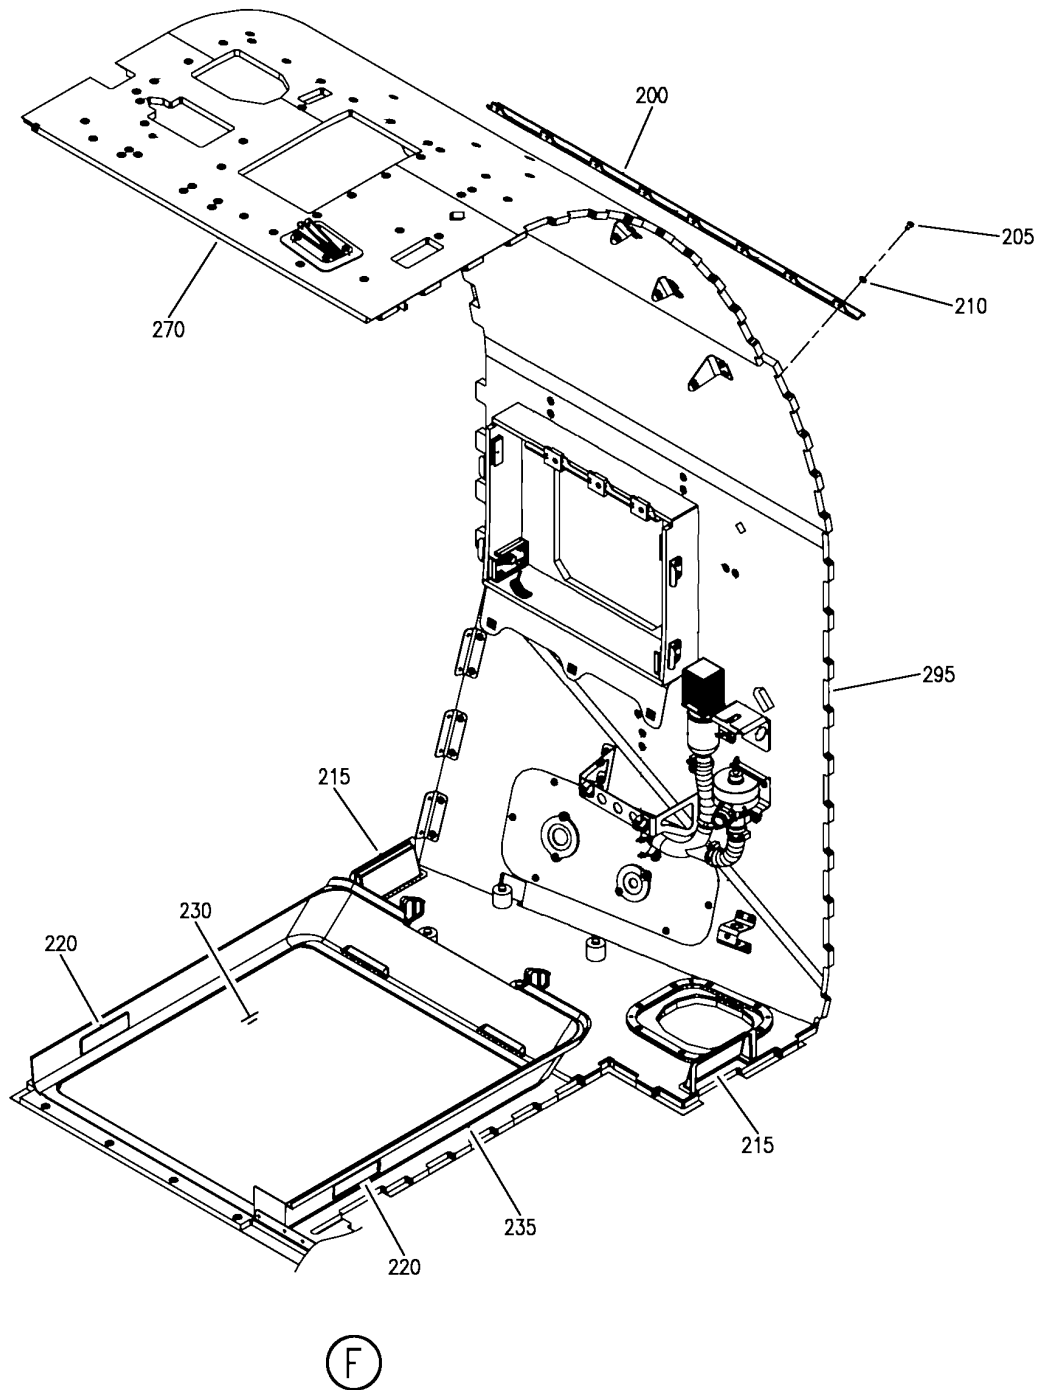

E 25401452T SHT 3 REV 255

STRUCTURE INSTL-LAV (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 52T (SHEET 3)


**25-40-14-52T**

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

R Y R  
O C T 15 / 17

25-40-14-52T  
PAGE 0B

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

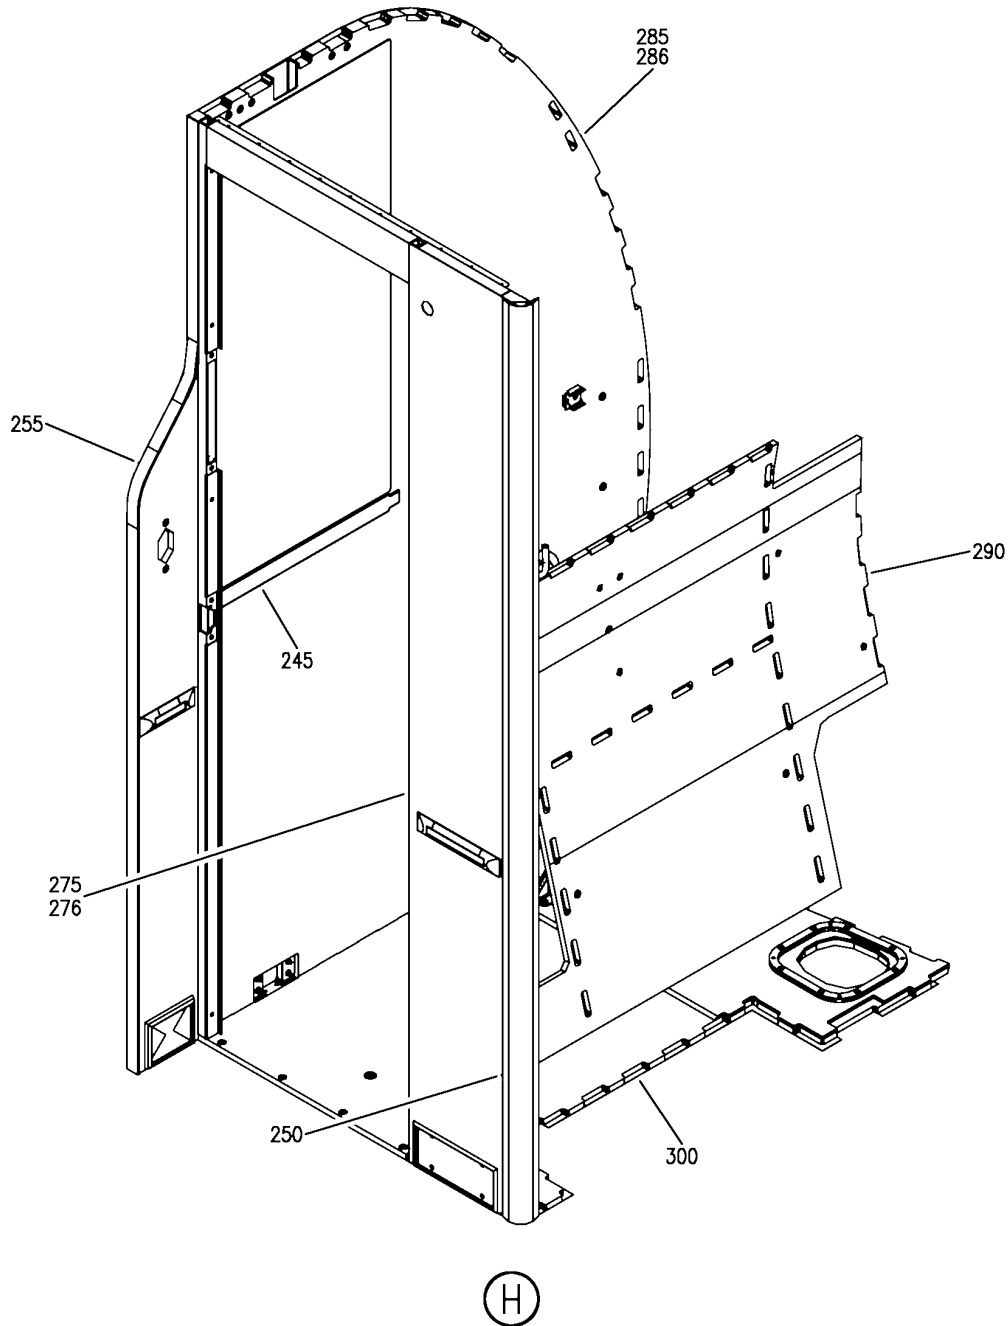

E 25401452T SH1 4 REV 263

STRUCTURE INSTL-LAV (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 52T (SHEET 4)

**25-40-14-52T**

RJR  
JUN 15/18

25-40-14-52T  
PAGE 0C

ECCN 9E991 BOEING PROPRIETARY – See title page for details.


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER     | 1 2 3 4 5 6 7 | NOMENCLATURE                                                                                                                       | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|-----------------|---------------|------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 52T                                                     |                 |               | STRUCTURE INSTL-LAV<br>(EQUIPMENT/FURNISHINGS<br>ONLY)                                                                             | 460508            |                      |
| - 1                                                     | 1L306041-151EW3 |               | STRUCTURE INSTL-LAV D<br>(EQUIPMENT/FURNISHINGS<br>ONLY)<br>SUPPLIER CODE:<br>V16827<br>FOR NHA/OTHER SYS DET SEE:<br>25-40-14-52P | 460475            | RF                   |
| - 2                                                     | 1L306041-117EW3 |               | STRUCTURE INSTL-LAV D<br>(EQUIPMENT/FURNISHINGS<br>ONLY)<br>SUPPLIER CODE:<br>V6S8D7<br>FOR NHA/OTHER SYS DET SEE:<br>25-40-14-52P | 476481            | RF                   |
| - 2                                                     | 1L306041-117HF3 |               | STRUCTURE INSTL-LAV D<br>(EQUIPMENT/FURNISHINGS<br>ONLY)<br>SUPPLIER CODE:<br>V6S8D7<br>FOR NHA/OTHER SYS DET SEE:<br>25-40-14-52P | 482508            | RF                   |
| 50                                                      | 4L400401-17     |               | .PLATE ASSY-CLOSEOUT<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-41-11-10M<br>ATTACHING PARTS                            | 460508            | 1                    |
| 55                                                      | NAS1801-3-11    |               | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-11                                                                                   | 460508            | 4                    |
| 60                                                      | NAS1149D0332J   |               | .WASHER<br>-----*-----                                                                                                             | 460508            | 4                    |
| 65                                                      | 4595339-012     |               | .LANYARD-<br>SUPPLIER CODE:<br>V16827                                                                                              | 460508            | 1                    |
| 70                                                      | LWC19AC14       |               | .CLIP-ADHESIVE BACKED<br>SUPPLIER CODE:<br>V06383<br>TRUE PART NUMBER:<br>LWC19-A-C14                                              | 460508            | 1                    |
| 75                                                      | 1L500413-63     |               | .TRIM-SPACE WALL<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                                                                    | 460508            | 1                    |
| 80                                                      | NAS514P832-8    |               | .SCREW<br>-----*-----                                                                                                              | 460508            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                 |               |                                                                                                                                    |                   |                      |

— ITEM NOT ILLUSTRATED

RYR

25-40-14-52T

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-14  
 FIG. 52T  
 PAGE 1  
 APR 15/23




**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER   | 1 2 3 4 5 6 7<br>NOMENCLATURE                                                                                 | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|---------------|---------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 52T                                                     |               |                                                                                                               |                   |                      |
| 85                                                      | 1L500413-7    | .TRIM-OUTBD WALL<br>SUPPLIER CODE:<br>V6S8D7                                                                  | 460508            | 1                    |
| 90                                                      | 1L500413-91   | .TRIM-AFT WALL<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                                                 | 460508            | 1                    |
| 95                                                      | NAS514P832-8  | .SCREW<br>-----*-----                                                                                         | 460508            | 1                    |
| 100                                                     | 1L460070-253  | .STATION ASSY-BABY CHANGING<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-41-52-03<br>ATTACHING PARTS | 460508            | 1                    |
| 105                                                     | NAS1801-3-6   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                                                               | 460508            | 2                    |
| 110                                                     | NAS1801-3-10  | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-10                                                              | 460508            | 2                    |
| 115                                                     | NAS1149C0332R | .WASHER                                                                                                       | 460508            | 8                    |
| 120                                                     | NAS43DD3-8N   | .SPACER<br>STANDARD SUBSTITUTION:<br>NAS43DD3-8FC<br>-----*-----                                              | 460508            | 2                    |
| 125                                                     | 4L500403-53   | .BRACKET-<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                                                      | 460508            | 1                    |
| 130                                                     | NAS1801-3-6   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                                                               | 460508            | 2                    |
| 135                                                     | NAS1149D0332J | .WASHER<br>-----*-----                                                                                        | 460508            | 2                    |
| 140                                                     | 4L400403-11   | .PANEL-<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                                                        | 460508            | 1                    |
| 145                                                     | NAS1801-3-6   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                                                               | 460508            | 4                    |
| 150                                                     | NAS1149D0332J | .WASHER<br>-----*-----                                                                                        | 460508            | 4                    |
| 155                                                     | 4L500403-55   | .BRACKET-<br>SUPPLIER CODE:<br>V6S8D7                                                                         | 460508            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |               |                                                                                                               |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R

25-40-14-52T

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-14  
FIG. 52T  
PAGE 2  
APR 15/23

 **BOEING**  
737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER   | 1 2 3 4 5 6 7 NOMENCLATURE                                         | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|---------------|--------------------------------------------------------------------|-------------------|----------------------|
| 52T                                                     |               |                                                                    |                   |                      |
| 160                                                     | NAS1801-3-6   | ATTACHING PARTS<br>.SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6 | 460508            | 2                    |
| 165                                                     | NAS1149D0332J | .WASHER<br>-----*-----                                             | 460508            | 2                    |
| 170                                                     | 4L500403-55   | .BRACKET-<br>SUPPLIER CODE:<br>V6S8D7                              | 460508            | 1                    |
| 175                                                     | NAS1801-3-6   | ATTACHING PARTS<br>.SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6 | 460508            | 2                    |
| 180                                                     | NAS1149D0332K | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0332J<br>-----*-----  | 460508            | 2                    |
| 200                                                     | 1L400419-153  | .EXTRUSION-<br>SUPPLIER CODE:<br>V6S8D7                            | 460508            | 1                    |
| 205                                                     | NAS1801-3-6   | ATTACHING PARTS<br>.SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6 | 460508            | 16                   |
| - 208                                                   | NAS1801-3-8   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-8                    | 460508            | 1                    |
| 210                                                     | NAS1149D0332K | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0332J                 | 460508            | 16                   |
| - 213                                                   | NAS1149F0332P | .WASHER<br>-----*-----                                             | 460508            | 1                    |
| 215                                                     | 1L500109-347  | .CLOSEOUT-FLOOR<br>SUPPLIER CODE:<br>V6S8D7                        | 460508            | 2                    |
| 220                                                     | 1L500407-207  | .PLATE-COVER<br>SUPPLIER CODE:<br>V6S8D7                           | 460508            | 2                    |
| 225                                                     | 1L400407-67   | .PAN ASSY-FLOOR<br>SUPPLIER CODE:<br>V6S8D7                        | 460508            | 1                    |
| 230                                                     | 1L400407-117  | ..MAT-<br>SUPPLIER CODE:<br>V6S8D7                                 | 460508            | 1                    |
| 235                                                     | 1L400407-15   | ..PAN-<br>SUPPLIER CODE:<br>V6S8D7                                 | 460508            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |               |                                                                    |                   |                      |

- ITEM NOT ILLUSTRATED

R Y R

25-40-14-52T

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-14  
FIG. 52T  
PAGE 3  
APR 15/23


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                                | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|---------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 52T                                                     |                |                                                                                                                           |                   |                      |
| 240                                                     | 1L500709-661   | .TRIM-HEADER<br>SUPPLIER CODE:<br>V6S8D7                                                                                  | 460508            | 2                    |
| 245                                                     | 1L500413-131   | .TRIM-AFT WALL CLOSEOUT<br>SUPPLIER CODE:<br>V6S8D7                                                                       | 460508            | 1                    |
| 250                                                     | 1L500419-299   | .TRIM-FLAT WALL<br>SUPPLIER CODE:<br>V6S8D7                                                                               | 460508            | 1                    |
| 255                                                     | 1L500409-761   | .TRIM-EDGE<br>SUPPLIER CODE:<br>V6S8D7                                                                                    | 460508            | 1                    |
| - 260                                                   | 415U9010-82    | .EXTRUSION-CLIP, RTNR<br>MISCELLANEOUS DATA:<br>ORDER LCPE000013                                                          | 460508            | AR                   |
| - 260                                                   | LCPE000013     | .EXTRUSION-CLIP, RTNR<br>SUPPLIER CODE:<br>V6S8D7<br>MISCELLANEOUS DATA:<br>THE BOEING COMPANY PART<br>NUMBER 415U9010-82 | 460508            | AR                   |
| - 265                                                   | MS21266-2N     | .GROMMET-<br>STANDARD SUBSTITUTION:<br>BACG20Z-B001275<br>MISCELLANEOUS DATA:<br>ORDER LCEE000003                         | 460508            | AR                   |
| - 265                                                   | LCEE000003     | .GROMMET-<br>SUPPLIER CODE:<br>V6S8D7                                                                                     | 460508            | AR                   |
| 270                                                     | 1L460041-277   | .CEILING ASSY-UPR<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-41-45-07D                                         | 460508            | 1                    |
| 275                                                     | 1L460041-303EW | .WALL ASSY-INBD<br>SUPPLIER CODE:<br>V16827<br>FOR DETAILS SEE:<br>25-41-40-04C                                           | 460481            | 1                    |
| 275                                                     | 1L460041-303HF | .WALL ASSY-INBD<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-41-40-04C                                           | 482508            | 1                    |
| 280                                                     | 1L460041-397EW | .WALL ASSY-FWD<br>SUPPLIER CODE:<br>V16827<br>FOR DETAILS SEE:<br>25-41-40-05Q                                            | 460481            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |                                                                                                                           |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R

25-40-14-52T

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-14  
 FIG. 52T  
 PAGE 4  
 APR 15/24


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                                                                                                          | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 52T<br>280                                              | 1L460041-397HF | .WALL INSTL-FWD<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-41-40-05Q                                                                                                                     | 482508            | 1                    |
| 285                                                     | 1L460040-413EW | .WALL ASSY-ATTENDANT<br>SUPPLIER CODE:<br>V16827<br>FOR DETAILS SEE:<br>25-41-40-31H                                                                                                                | 460475            | 1                    |
| 285                                                     | 1L460041-411EW | .WALL ASSY-ATTENDANT<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-41-40-31H                                                                                                                | 476481            | 1                    |
| 285                                                     | 1L460041-411HF | .WALL ASSY-ATTENDANT<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-41-40-31H                                                                                                                | 482508            | 1                    |
| 290                                                     | 1L460041-255   | .WALL ASSY-SPACE<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-41-40-40H                                                                                                                    | 460508            | 1                    |
| 295                                                     | 1L460041-247   | .WALL ASSY-OUTBD<br>SUPPLIER CODE:<br>V6S8D7<br>FUNCTIONAL REFERENCE:<br>EQUIPMENT/FURNISHINGS<br>FOR DETAILS SEE<br>25-41-40-41B<br>WATER/WASTE<br>FOR DETAILS SEE<br>38-11-08-14B<br>38-11-51-17F | 460508            | 1                    |
| 300                                                     | 1L460041-295   | .FLOOR ASSY-<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-41-21-19B                                                                                                                        | 460508            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |                                                                                                                                                                                                     |                   |                      |

— ITEM NOT ILLUSTRATED


R Y R

25-40-14-52T

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

25-40-14  
 FIG. 52T  
 PAGE 5  
 APR 15/24

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

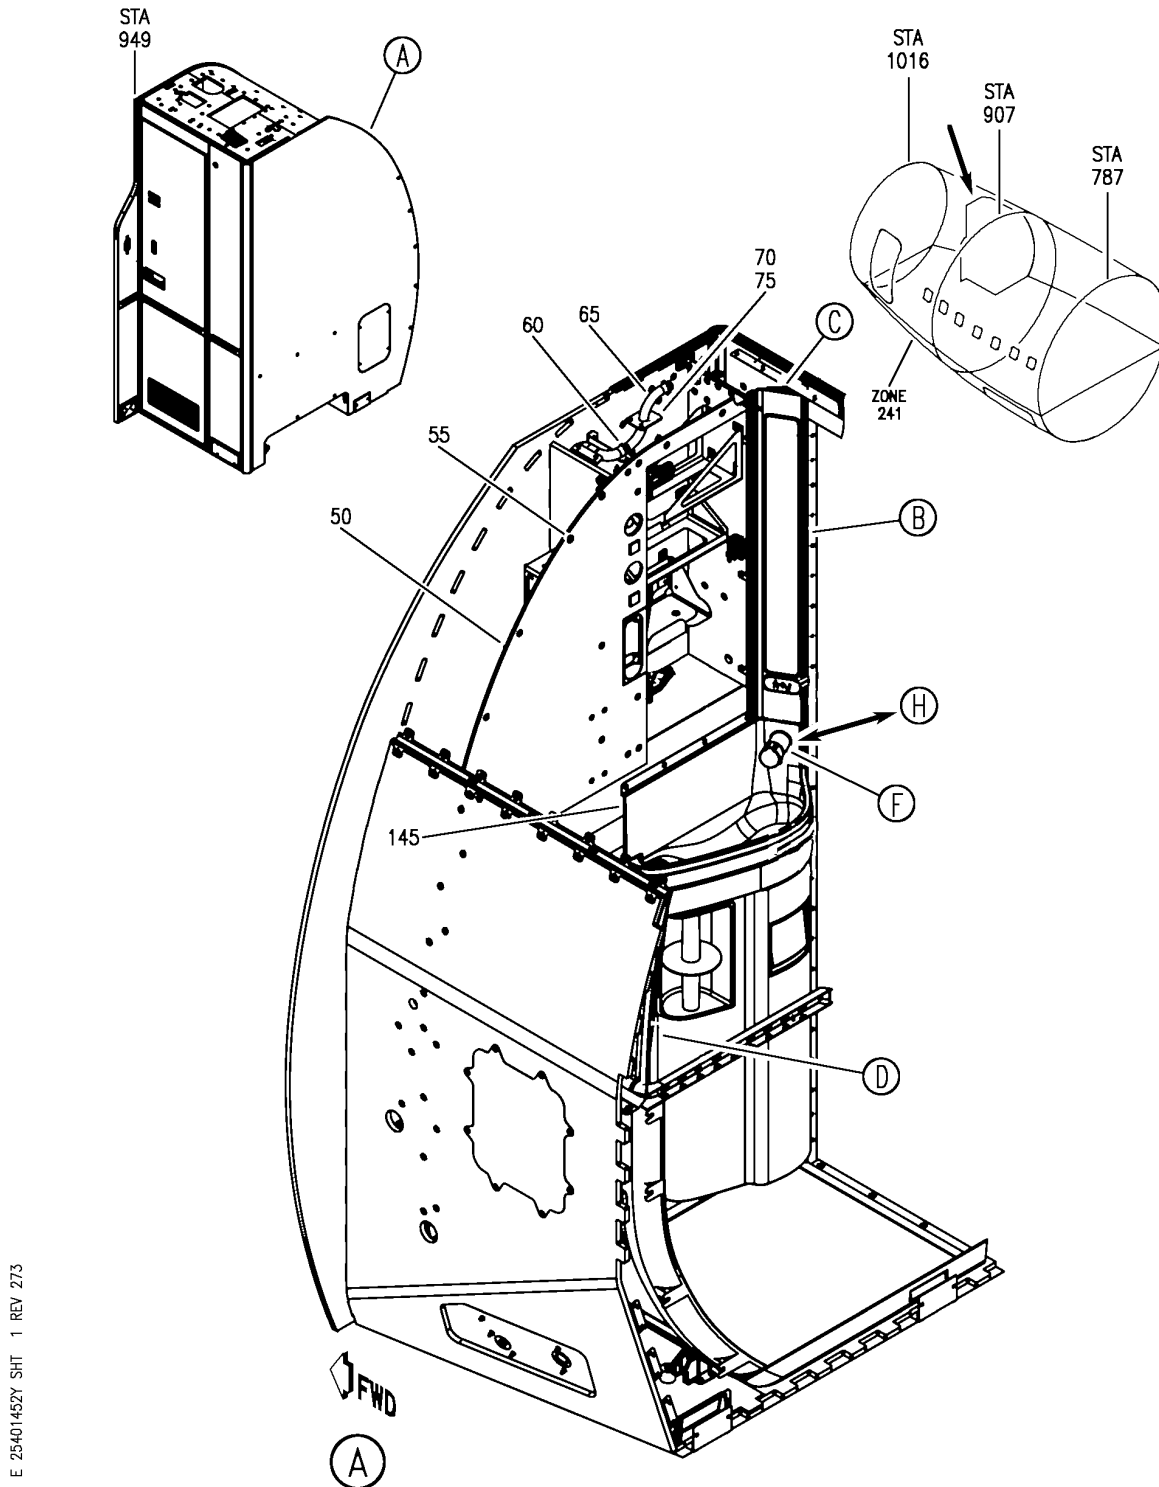


STRUCTURE INSTL-LAV (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 52Y (SHEET 1)

**25-40-14-52Y**

R Y R  
APR 15/19

25-40-14-52Y  
PAGE 0

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

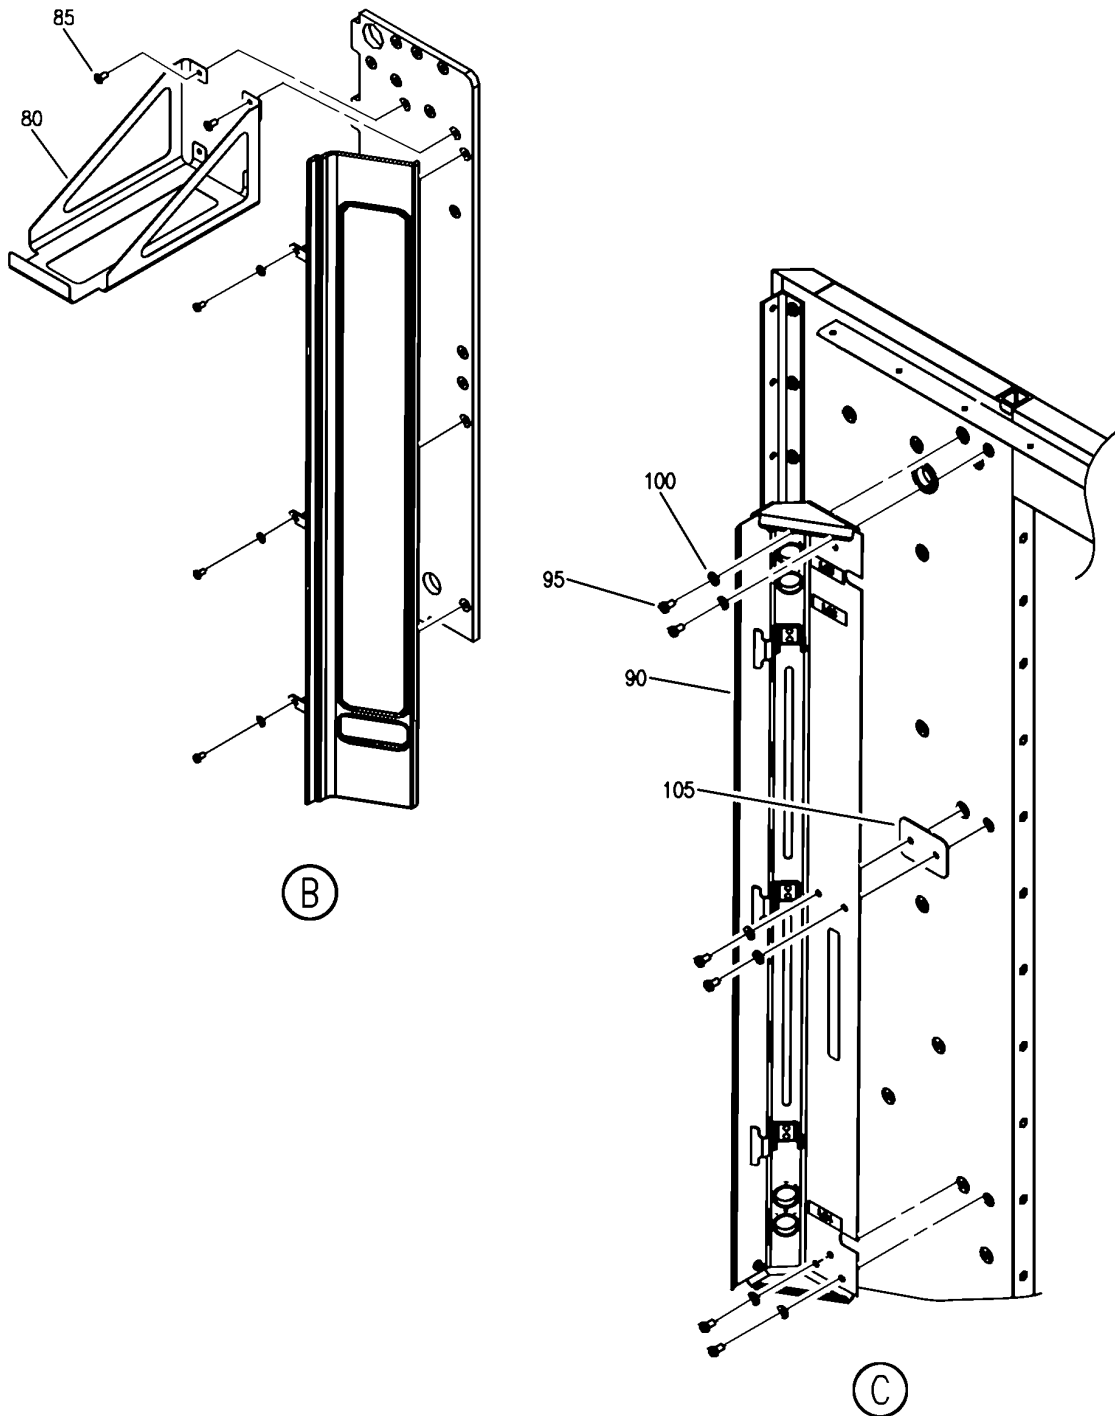

E 25401452Y SHT 2 REV 253

STRUCTURE INSTL-LAV (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 52Y (SHEET 2)


**25-40-14-52Y**

R Y R  
APR 15/19

25-40-14-52Y  
PAGE 0A

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

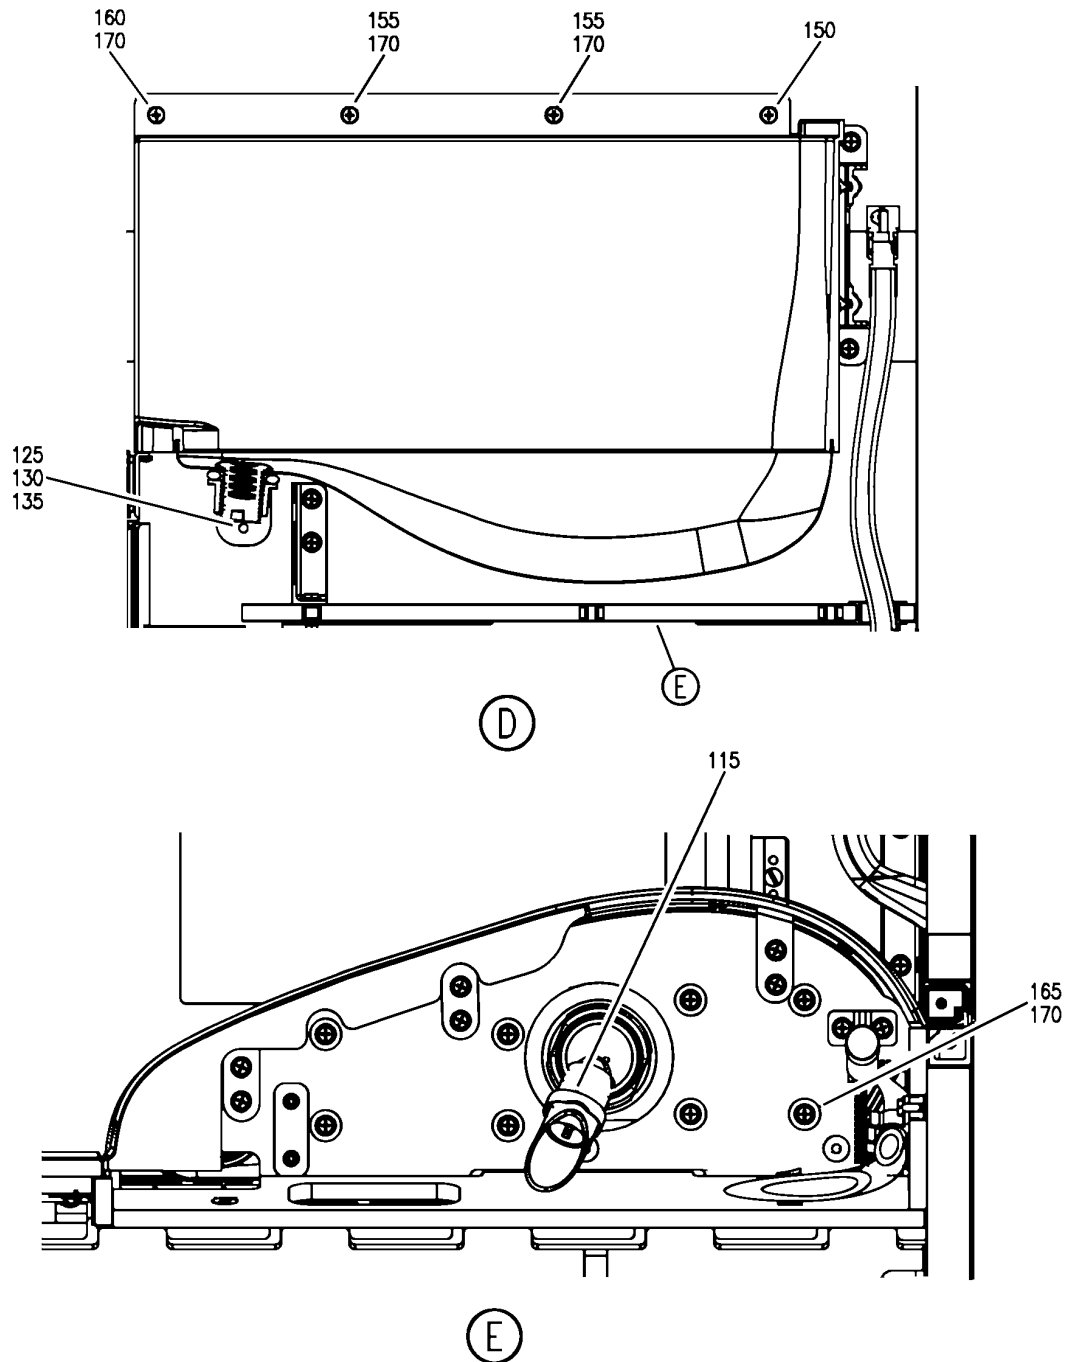

E 25401452Y SHT 3 REV 253

STRUCTURE INSTL-LAV (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 52Y (SHEET 3)





**25-40-14-52Y**

R Y R  
APR 15/19

25-40-14-52Y  
PAGE 0B

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

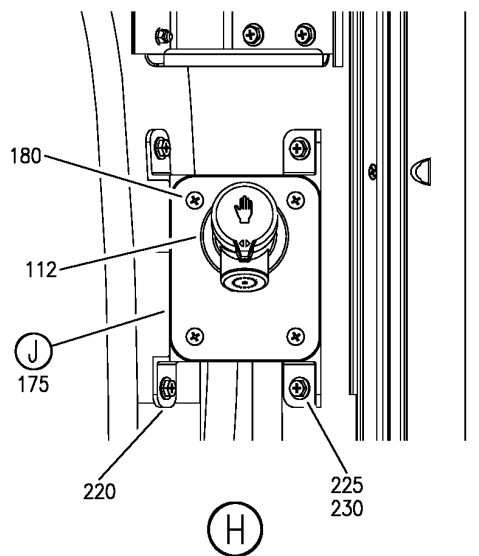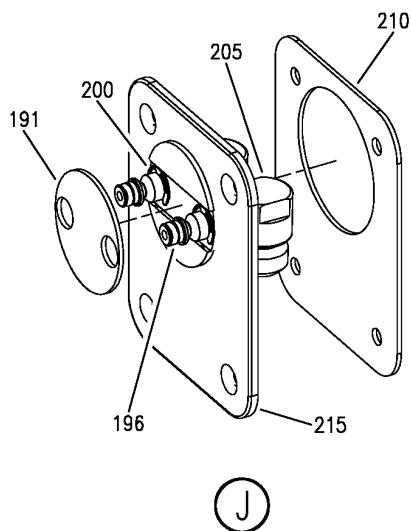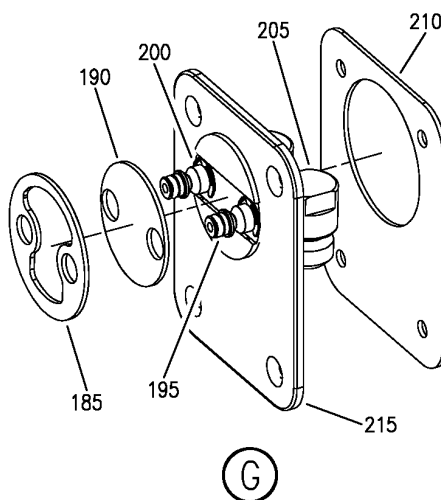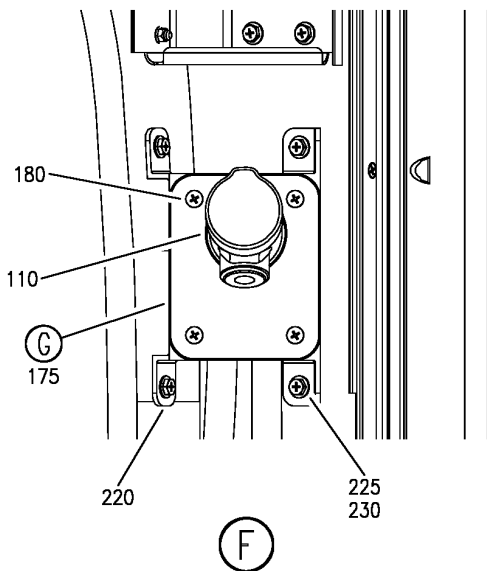

E 25401452Y SHT 4 REV 273

STRUCTURE INSTL-LAV (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 52Y (SHEET 4)

**25-40-14-52Y**

R Y R  
APR 15 / 19

25-40-14-52Y  
PAGE 0C

ECCN 9E991 BOEING PROPRIETARY – See title page for details.




**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER     | 1 2 3 4 5 6 7 | NOMENCLATURE                                                                                                                       | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|-----------------|---------------|------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 52Y                                                     |                 |               | STRUCTURE INSTL-LAV<br>(EQUIPMENT/FURNISHINGS<br>ONLY)                                                                             | 460508            |                      |
| - 1                                                     | 1L306041-151EW1 |               | STRUCTURE INSTL-LAV D<br>(EQUIPMENT/FURNISHINGS<br>ONLY)<br>SUPPLIER CODE:<br>V16827<br>FOR NHA/OTHER SYS DET SEE:<br>25-40-14-52P | 460475            | RF                   |
| - 1                                                     | 1L306041-117EW1 |               | STRUCTURE INSTL-LAV D<br>(EQUIPMENT/FURNISHINGS<br>ONLY)<br>SUPPLIER CODE:<br>V6S8D7<br>FOR NHA/OTHER SYS DET SEE:<br>25-40-14-52P | 476481            | RF                   |
| - 2                                                     | 1L306041-117HF1 |               | STRUCTURE INSTL-LAV D<br>(EQUIPMENT/FURNISHINGS<br>ONLY)<br>SUPPLIER CODE:<br>V6S8D7<br>FOR NHA/OTHER SYS DET SEE:<br>25-40-14-52P | 482508            | RF                   |
| 50                                                      | 1L460040-341    |               | .VANITY ASSY-UPR<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-41-51-64                                                    | 460475            | 1                    |
| 50                                                      | 1L460040-311    |               | .VANITY ASSY-UPR<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-41-51-64                                                    | 476508            | 1                    |
| 55                                                      | NAS514P1032-10  |               | ATTACHING PARTS<br>.SCREW<br>-----*-----                                                                                           | 460508            | 11                   |
| 60                                                      | MS3367-5-9      |               | .STRAP<br>STANDARD SUBSTITUTION:<br>BACS38K5                                                                                       | 460508            | 2                    |
| 65                                                      | 1L400403-61     |               | .INTERFACE-GASPER<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                                                                   | 460508            | 1                    |
| 70                                                      | NAS1801-3-6     |               | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                                                                                    | 460508            | 4                    |
| 75                                                      | NAS1149D0332J   |               | .WASHER<br>-----*-----                                                                                                             | 460508            | 4                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                 |               |                                                                                                                                    |                   |                      |

— ITEM NOT ILLUSTRATED

RYR

25-40-14-52Y

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-14  
 FIG. 52Y  
 PAGE 1  
 APR 15/23


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7<br>NOMENCLATURE                                                                                                                                                                                                                                                    | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 52Y<br>80                                               | 1L500403-157   | .BRACKET-HAND TOWEL<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                                                                                                                                                                                                               | 460508            | 1                    |
| 85                                                      | NAS8303-4      | .SCREW<br>-----*-----                                                                                                                                                                                                                                                            | 460508            | 4                    |
| 90                                                      | 1L460070-251   | .LIGHT ASSY-<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>33-26-03-43S<br>ATTACHING PARTS                                                                                                                                                                                  | 460508            | 1                    |
| 95                                                      | NAS1801-3-7    | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-7                                                                                                                                                                                                                                  | 460508            | 6                    |
| 100                                                     | NAS1149D0332J  | .WASHER<br>-----*-----                                                                                                                                                                                                                                                           | 460508            | 6                    |
| 105                                                     | 1L500403-89    | .SHIM-<br>SUPPLIER CODE:<br>V6S8D7                                                                                                                                                                                                                                               | 460508            | 1                    |
| 110                                                     | AR9472-3W1D492 | .FAUCET ASSY-<br>SUPPLIER CODE:<br>V80477<br>SB DATA FROM A CMM:<br>PRE SB 1L3-25-0072<br>PRE SB 1L3-25-0114<br>CONFIG CHG DATA FROM A CMM:<br>REPLD BY 4W200301-11<br>SUPSD BY 4101800-001<br>COMPONENT MAINT MANUAL REF:<br>38-11-71<br>FOR DETAILS SEE:<br>38-11-05-18Y       | 460508            | 1                    |
| 110                                                     | SC4L500002-2   | .FAUCET ASSY-<br>SUPPLIER CODE:<br>V6S8D7<br>SB DATA FROM A CMM:<br>PRE SB 1L3-25-0072<br>PRE SB 1L3-25-0114<br>CONFIG CHG DATA FROM A CMM:<br>SUPSD BY SC4L500301-5<br>MISCELLANEOUS DATA:<br>ADAMS RITE AEROSPACE<br>PART NUMBER<br>AR9472-3W1D492<br><br>ORDER AR9472-3W1D492 | 460508            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |                                                                                                                                                                                                                                                                                  |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R

25-40-14-52Y

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-14  
 FIG. 52Y  
 PAGE 2  
 APR 15/23


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER  | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                                                                                                                                                                                                                                                   | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|--------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 52Y<br>112                                              | 4W200301-11  | . FAUCET ASSY-<br>SUPPLIER CODE:<br>V6S8D7<br>SB DATA FROM A CMM:<br>POST SB 1L3-25-0072<br>PRE SB 1L3-25-0114<br>CONFIG CHG DATA FROM A CMM:<br>REPLS AR9472-3W1D492<br>SUPSD BY 4101800-001<br>COMPONENT MAINT MANUAL REF:<br>38-10-01<br>FOR DETAILS SEE:<br>38-11-05-60C                                                                 | 460508            | 1                    |
| 112                                                     | SC4L500301-4 | . FAUCET ASSY-<br>SUPPLIER CODE:<br>V6S8D7<br>SB DATA FROM A CMM:<br>POST SB 1L3-25-0072<br>PRE SB 1L3-25-0114<br>CONFIG CHG DATA FROM A CMM:<br>SUPSD BY SC4L500301-5<br>MISCELLANEOUS DATA:<br>ORDER 4W200301-11<br>COMPONENT MAINT MANUAL REF:<br>38-10-01<br>OPTIONAL PART:<br>4W200301-11<br>V6S8D7<br>FOR DETAILS SEE:<br>38-11-05-60C | 460508            | 1                    |
| 112                                                     | 4101800-001  | . FAUCET ASSY-<br>SUPPLIER CODE:<br>V5E3E9<br>SB DATA FROM A CMM:<br>POST SB 1L3-25-0114<br>CONFIG CHG DATA FROM A CMM:<br>SUPERSEDES<br>AR9472-3W1D492<br>SUPERSEDES 4W200301-11<br>COMPONENT MAINT MANUAL REF:<br>38-10-03<br>FOR DETAILS SEE:<br>38-11-05-60E                                                                             | 460508            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |              |                                                                                                                                                                                                                                                                                                                                              |                   |                      |

— ITEM NOT ILLUSTRATED

RYR

25-40-14-52Y

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-14  
 FIG. 52Y  
 PAGE 3  
 AUG 15/21

 **BOEING**  
737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                     | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 52Y<br>112                                              | SC4L500301-5   | . FAUCET ASSY-<br>SUPPLIER CODE:<br>V6S8D7<br>FUNCTIONAL DESCRIPTION:<br>ASSEMBLY ALLOWS<br>DISPENSING OF POTABLE<br>WATER IN THE LAVATORY<br>SINK.<br>SB DATA FROM A CMM:<br>POST SB 1L3-25-0114<br>CONFIG CHG DATA FROM A CMM:<br>SUPERSEDES SC4L500002-2<br>SUPERSEDES SC4L500301-4<br>MISCELLANEOUS DATA:<br>ORDER 4101800-001<br><br>SC4L500301-5 IS AN<br>EQUIVALENT P/N FOR THE<br>4101800-001 FAUCET WHICH<br>IS COVERED BY CMM<br>38-10-03.<br>COMPONENT MAINT MANUAL REF:<br>38-10-03<br>OPTIONAL PART:<br>4101800-001<br>V5E3E9<br>FOR DETAILS SEE:<br>38-11-05-60E | 460508            | 1                    |
| 115                                                     | NAS1922-0125-3 | . CLAMP                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                        | 460508            | 1                    |
| - 120                                                   | 9L500001-003   | . STUD INSTL-GND ELECTRICAL<br>SUPPLIER CODE:<br>V6S8D7                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                        | 460508            | 1                    |
| 125                                                     | NAS1801-3-10   | .. SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-10                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                             | 460508            | 1                    |
| 130                                                     | MS21042L3      | .. NUT<br>STANDARD SUBSTITUTION:<br>BACN11AG3                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                  | 460508            | 1                    |
| 135                                                     | NAS1149D0316H  | .. WASHER                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                      | 460508            | 3                    |
| 145                                                     | 1L460071-235   | . SINK ASSY-<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-41-11-16D<br>ATTACHING PARTS                                                                                                                                                                                                                                                                                                                                                                                                                                                                                | 460508            | 1                    |
| 150                                                     | NAS514P1032-4  | . SCREW                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                        | 460508            | 1                    |
| 155                                                     | NAS514P1032-5  | . SCREW                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                        | 460508            | 2                    |
| 160                                                     | NAS514P1032-6  | . SCREW                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                        | 460508            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                |                   |                      |

— ITEM NOT ILLUSTRATED

RYR

25-40-14-52Y

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-14  
FIG. 52Y  
PAGE 4  
DEC 15/24


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER   | 1 2 3 4 5 6 7<br>NOMENCLATURE                                                                                                                                    | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|---------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 52Y<br>165                                              | NAS1801-3-9   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-9                                                                                                                  | 460508            | 8                    |
| 170                                                     | NAS1149D0332J | .WASHER-<br>MISCELLANEOUS DATA:<br>USE AS REQUIRED TO<br>MAINTAIN FLUSHNESS WITH<br>THE REST OF THE VANITY<br>-----*-----                                        | 460508            | AR                   |
| 175                                                     | 77586-1       | .PLATE ASSY-FAUCET MTG<br>SUPPLIER CODE:<br>V80477<br>COMPONENT MAINT MANUAL REF:<br>38-11-80                                                                    | 460508            | 1                    |
| 175                                                     | SC4L500002-3  | .PLATE ASSY-FAUCET MTG<br>SUPPLIER CODE:<br>V6S8D7<br>MISCELLANEOUS DATA:<br>ADAMS RITE AEROSPACE<br>PART NUMBER 77586-1<br><br>ORDER 77586-1<br>ATTACHING PARTS | 460508            | 1                    |
| 180                                                     | NAS514P1032-9 | .SCREW<br>-----*-----                                                                                                                                            | 460508            | 4                    |
| 185                                                     | 77593-1       | ..GASKET-<br>SUPPLIER CODE:<br>V80477<br>SB DATA FROM A CMM:<br>PRE SB 1L3-25-0072                                                                               | 460508            | 1                    |
| 190                                                     | 77644-1       | ..GASKET-<br>SUPPLIER CODE:<br>V80477<br>SB DATA FROM A CMM:<br>PRE SB 1L3-25-0072                                                                               | 460508            | 1                    |
| 191                                                     | 4W500301-31   | ..GASKET-<br>SUPPLIER CODE:<br>V6S8D7<br>SB DATA FROM A CMM:<br>POST SB 1L3-25-0072<br>POST SB 1L3-25-0114                                                       | 460508            | 1                    |
| 195                                                     | 20166-007     | ..PACKING-<br>SUPPLIER CODE:<br>V80477<br>SB DATA FROM A CMM:<br>PRE SB 1L3-25-0072                                                                              | 460508            | 2                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |               |                                                                                                                                                                  |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R

25-40-14-52Y

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-14  
 FIG. 52Y  
 PAGE 5  
 DEC 15/24


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER   | 1 2 3 4 5 6 7 | NOMENCLATURE                                                                                                                                     | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|---------------|---------------|--------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 52Y<br>196                                              | LCCS14-007B   |               | ..PACKING-<br>SUPPLIER CODE:<br>V6S8D7<br>TRUE PART NUMBER:<br>LCCS-14-007B<br>SB DATA FROM A CMM:<br>POST SB 1L3-25-0072<br>POST SB 1L3-25-0114 | 460508            | 2                    |
| 200                                                     | 20058-31      |               | ..RING-<br>SUPPLIER CODE:<br>V80477                                                                                                              | 460508            | 2                    |
| 205                                                     | 77592-1       |               | ..FITTING-<br>SUPPLIER CODE:<br>V80477                                                                                                           | 460508            | 2                    |
| 210                                                     | 77599-1       |               | ..GASKET-<br>SUPPLIER CODE:<br>V80477                                                                                                            | 460508            | 1                    |
| 215                                                     | 77585-1       |               | ..PLATE-BACK<br>SUPPLIER CODE:<br>V80477                                                                                                         | 460508            | 1                    |
| 220                                                     | 4W400401-5    |               | .BRACKET ASSY-FAUCET MTG<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                                                                          | 460508            | 1                    |
| 225                                                     | NAS1801-3-6   |               | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                                                                                                  | 460508            | 4                    |
| 230                                                     | NAS1149D0332J |               | .WASHER<br>-----*-----                                                                                                                           | 460508            | 4                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |               |               |                                                                                                                                                  |                   |                      |

— ITEM NOT ILLUSTRATED


R Y R

25-40-14-52Y

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

25-40-14  
 FIG. 52Y  
 PAGE 6  
 AUG 15/24

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

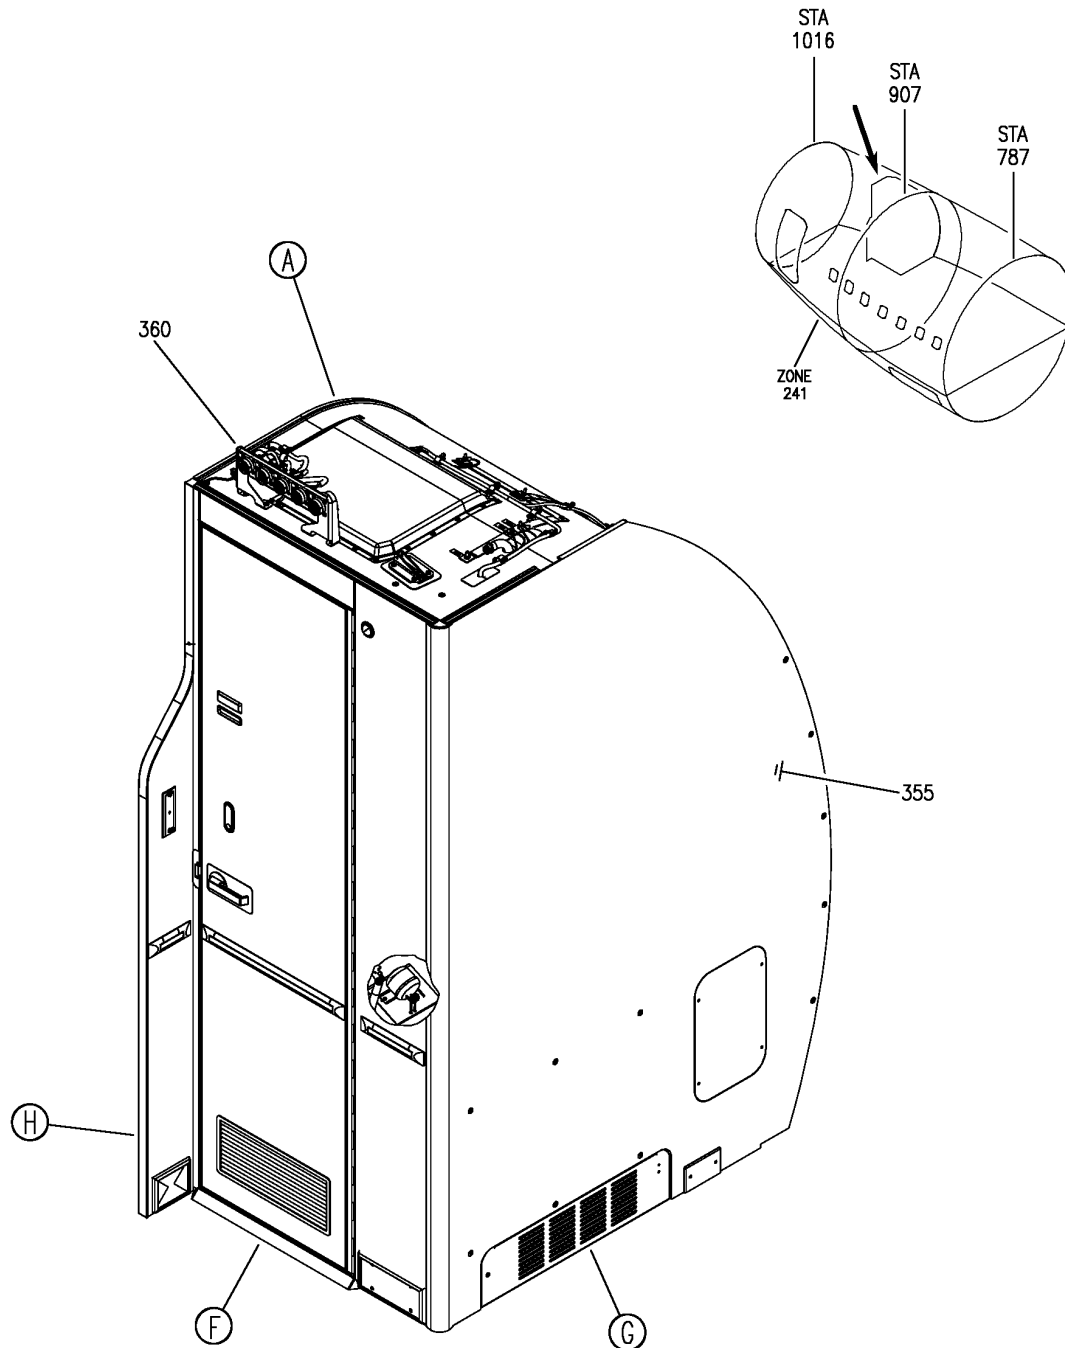

E 25401453A SHT 1 REV 255

MODULE ASSY-LAV D (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 53A (SHEET 1)


**25-40-14-53A**

R Y R  
O C T 15 / 17

25-40-14-53A  
PAGE 0

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

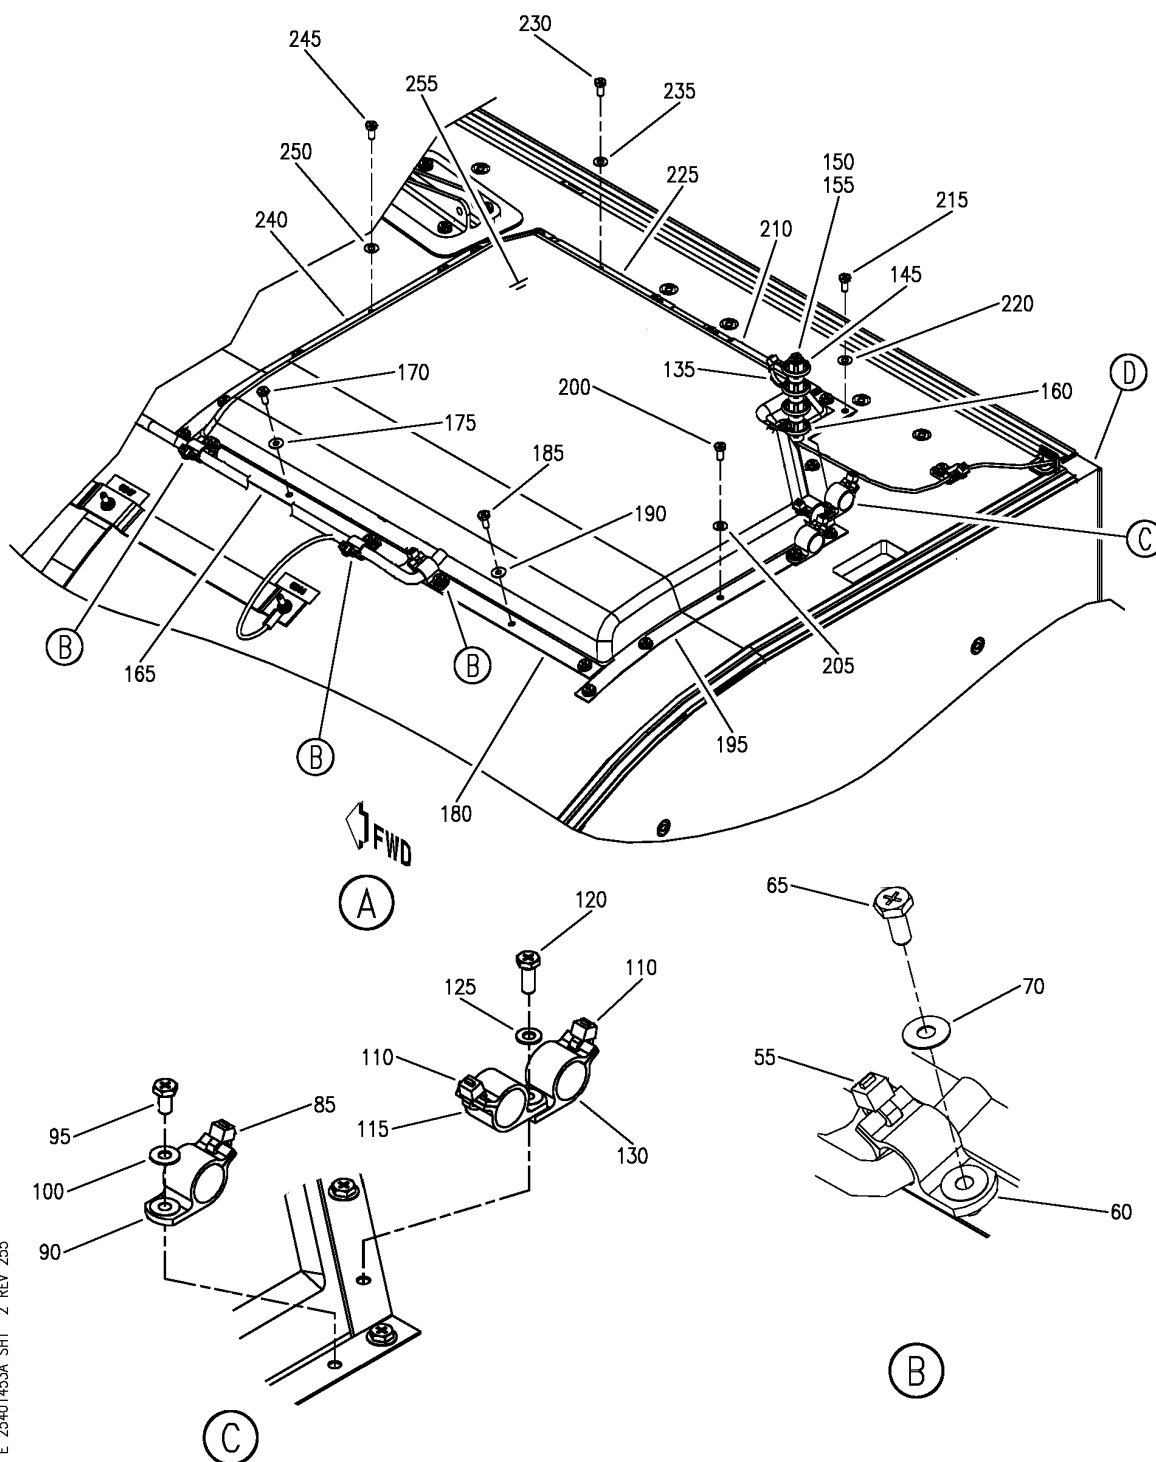

E 25401453A SHT 2 REV 255

MODULE ASSY-LAV D (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 53A (SHEET 2)

**25-40-14-53A**


RYR  
OCT 15/17

25-40-14-53A  
PAGE 0A

ECCN 9E991 BOEING PROPRIETARY – See title page for details.



**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

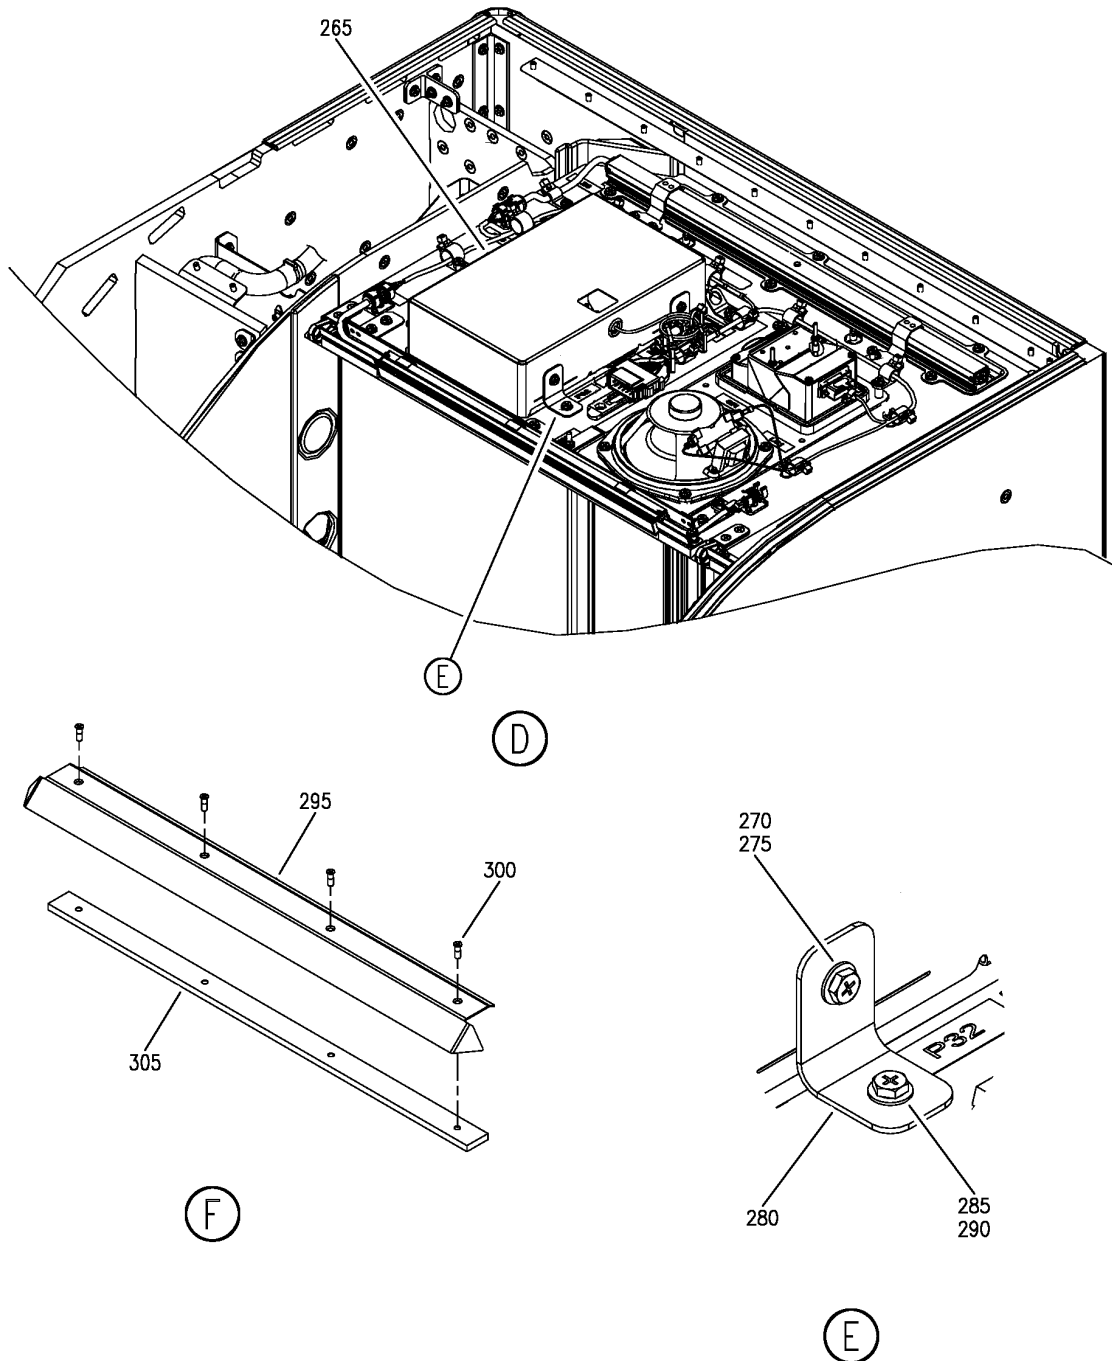

E 25401453A SHT 3 REV 255


MODULE ASSY-LAV D (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 53A (SHEET 3)

**25-40-14-53A**

RYR  
OCT 15/17

25-40-14-53A  
PAGE 0B

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

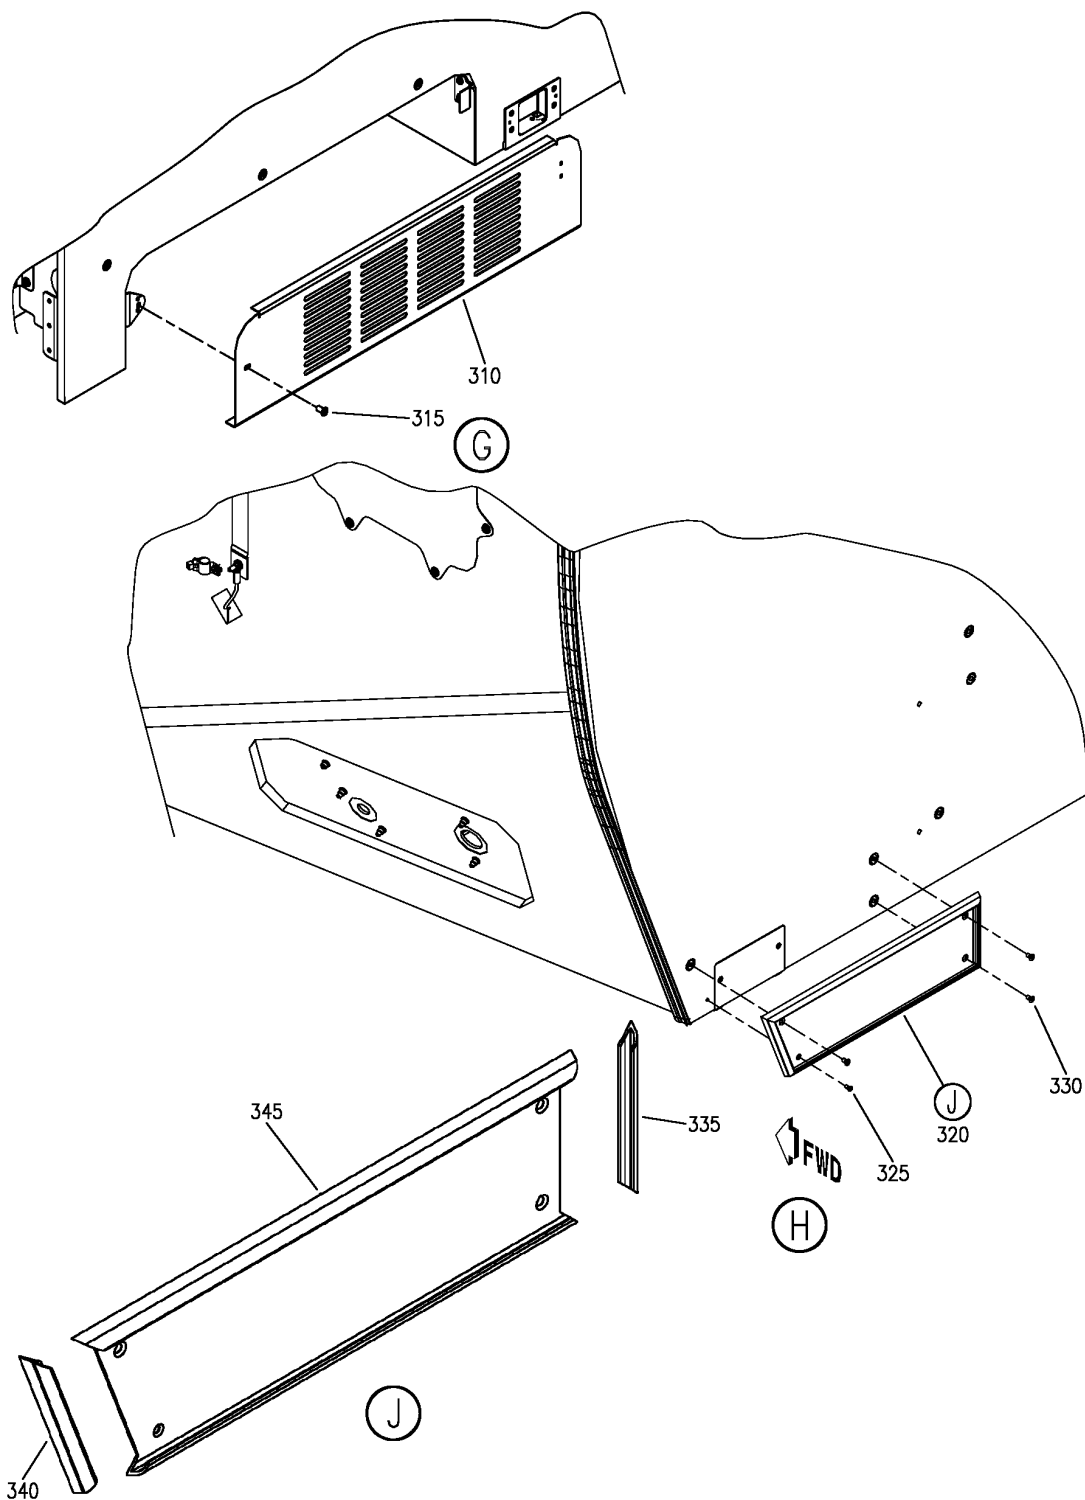

E 25401453A SHT 4 REV 255

25-40-14-53A

25-40-14-53A  
PAGE 00

ECCN 9E991 BOEING PROPRIETARY – See title page for details.


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 | NOMENCLATURE                                                                                                                                                                                                                                                                                              | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|---------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 53A                                                     |                |               | MODULE ASSY-LAV D<br>(EQUIPMENT/FURNISHINGS<br>ONLY)                                                                                                                                                                                                                                                      | 476481            |                      |
| - 1                                                     | 1L300040-0727C |               | MODULE ASSY-LAV D<br>(EQUIPMENT/FURNISHINGS<br>ONLY)<br>SUPPLIER CODE:<br>V6S8D7<br>FUNCTIONAL DESCRIPTION:<br>PROVIDES LAVATORY<br>FACILITIES FOR<br>PASSENGERS AND CREW.<br>ELECTRICAL EQUIP NUMBER:<br>M01418<br>COMPONENT MAINT MANUAL REF:<br>25-40-55<br>FOR NHA/OTHER SYS DET SEE:<br>25-40-14-01B | 476481            | RF                   |
| - 50                                                    | 9L500001-107   |               | .CLAMP INSTL-ELECTRICAL<br>SUPPLIER CODE:<br>V6S8D7                                                                                                                                                                                                                                                       | 476481            | 3                    |
| 55                                                      | MS3367-5-9     |               | ..STRAP<br>STANDARD SUBSTITUTION:<br>BACS38K5                                                                                                                                                                                                                                                             | 476481            | 1                    |
| 60                                                      | CA2030-3       |               | ..CLAMP-<br>SUPPLIER CODE:<br>V03296<br>ATTACHING PARTS                                                                                                                                                                                                                                                   | 476481            | 1                    |
| 65                                                      | NAS1801-3-10   |               | ..SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-10                                                                                                                                                                                                                                                         | 476481            | 1                    |
| 70                                                      | NAS1149D0316K  |               | ..WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J                                                                                                                                                                                                                                                       | 476481            | 1                    |
| - 75                                                    | NAS43DD3-16N   |               | ..SPACER<br>STANDARD SUBSTITUTION:<br>NAS43DD3-16FC<br>-----*-----                                                                                                                                                                                                                                        | 476481            | 1                    |
| - 80                                                    | 9L500001-103   |               | .CLAMP INSTL-ELECTRICAL<br>SUPPLIER CODE:<br>V6S8D7                                                                                                                                                                                                                                                       | 476481            | 1                    |
| 85                                                      | MS3367-5-9     |               | ..STRAP<br>STANDARD SUBSTITUTION:<br>BACS38K5                                                                                                                                                                                                                                                             | 476481            | 1                    |
| 90                                                      | CA2030-3       |               | ..CLAMP-<br>SUPPLIER CODE:<br>V03296                                                                                                                                                                                                                                                                      | 476481            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |               |                                                                                                                                                                                                                                                                                                           |                   |                      |

- ITEM NOT ILLUSTRATED

RYR

25-40-14-53A

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-14  
FIG. 53A  
PAGE 1  
APR 15/23


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER   | 1 2 3 4 5 6 7 NOMENCLATURE                                          | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|---------------|---------------------------------------------------------------------|-------------------|----------------------|
| 53A                                                     |               | ATTACHING PARTS                                                     |                   |                      |
| 95                                                      | NAS1801-3-6   | ..SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                    | 476481            | 1                    |
| 100                                                     | NAS1149D0316K | ..WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J<br>-----*-----  | 476481            | 1                    |
| - 105                                                   | 9L500001-150  | .CLAMP INSTL-ELECTRICAL<br>SUPPLIER CODE:<br>V6S8D7                 | 476481            | 1                    |
| 110                                                     | MS3367-5-9    | ..STRAP<br>STANDARD SUBSTITUTION:<br>BACS38K5                       | 476481            | 2                    |
| 115                                                     | CA2030-3      | ..CLAMP-<br>SUPPLIER CODE:<br>V03296                                | 476481            | 1                    |
| 120                                                     | NAS1801-3-9   | ATTACHING PARTS<br>..SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-9 | 476481            | 1                    |
| 125                                                     | NAS1149D0316K | ..WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J<br>-----*-----  | 476481            | 1                    |
| 130                                                     | CA2030-3      | ..CLAMP-<br>SUPPLIER CODE:<br>V03296                                | 476481            | 1                    |
| 135                                                     | MS3367-5-9    | .STRAP<br>STANDARD SUBSTITUTION:<br>BACS38K5                        | 476481            | 2                    |
| - 140                                                   | 9L500001-407  | .RINGPOST INSTL-ELECTRICAL<br>SUPPLIER CODE:<br>V6S8D7              | 476481            | 1                    |
| 145                                                     | BACS31H1A     | ..SUPPORT-SINGLE<br>ATTACHING PARTS                                 | 476481            | 1                    |
| 150                                                     | NAS1801-3-52  | ..SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-52                   | 476481            | 1                    |
| 155                                                     | NAS1149D0316K | ..WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J<br>-----*-----  | 476481            | 1                    |
| 160                                                     | BACS31H1A     | ..SUPPORT                                                           | 476481            | 3                    |
| 165                                                     | 1L500409-741  | .STRAP-FIRE BLANKET<br>SUPPLIER CODE:<br>V6S8D7                     | 476481            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |               |                                                                     |                   |                      |

- ITEM NOT ILLUSTRATED

RYR

25-40-14-53A

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-14  
 FIG. 53A  
 PAGE 2  
 APR 15/23


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER   | 1 2 3 4 5 6 7       | NOMENCLATURE                            | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|---------------|---------------------|-----------------------------------------|-------------------|----------------------|
| 53A                                                     |               |                     | ATTACHING PARTS                         |                   |                      |
| 170                                                     | NAS1801-3-6   | .SCREW              | STANDARD SUBSTITUTION:<br>BACS12HN3-6   | 476481            | 1                    |
| 175                                                     | NAS1149D0316K | .WASHER             | STANDARD SUBSTITUTION:<br>NAS1149D0316J | 476481            | 1                    |
|                                                         |               | -----*-----         |                                         |                   |                      |
| 180                                                     | 1L500409-743  | .STRAP-FIRE BLANKET | SUPPLIER CODE:<br>V6S8D7                | 476481            | 1                    |
|                                                         |               |                     | ATTACHING PARTS                         |                   |                      |
| 185                                                     | NAS1801-3-6   | .SCREW              | STANDARD SUBSTITUTION:<br>BACS12HN3-6   | 476481            | 2                    |
| 190                                                     | NAS1149D0316K | .WASHER             | STANDARD SUBSTITUTION:<br>NAS1149D0316J | 476481            | 2                    |
|                                                         |               | -----*-----         |                                         |                   |                      |
| 195                                                     | 1L500409-767  | .STRAP-FIRE BLANKET | SUPPLIER CODE:<br>V6S8D7                | 476481            | 1                    |
|                                                         |               |                     | ATTACHING PARTS                         |                   |                      |
| 200                                                     | NAS1801-3-6   | .SCREW              | STANDARD SUBSTITUTION:<br>BACS12HN3-6   | 476481            | 4                    |
| 205                                                     | NAS1149D0316K | .WASHER             | STANDARD SUBSTITUTION:<br>NAS1149D0316J | 476481            | 4                    |
|                                                         |               | -----*-----         |                                         |                   |                      |
| 210                                                     | 1L500409-765  | .STRAP-FIRE BLANKET | SUPPLIER CODE:<br>V6S8D7                | 476481            | 1                    |
|                                                         |               |                     | ATTACHING PARTS                         |                   |                      |
| 215                                                     | NAS1801-3-6   | .SCREW              | STANDARD SUBSTITUTION:<br>BACS12HN3-6   | 476481            | 4                    |
| 220                                                     | NAS1149D0316K | .WASHER             | STANDARD SUBSTITUTION:<br>NAS1149D0316J | 476481            | 4                    |
|                                                         |               | -----*-----         |                                         |                   |                      |
| 225                                                     | 1L500409-763  | .STRAP-FIRE BLANKET | SUPPLIER CODE:<br>V6S8D7                | 476481            | 1                    |
|                                                         |               |                     | ATTACHING PARTS                         |                   |                      |
| 230                                                     | NAS1801-3-6   | .SCREW              | STANDARD SUBSTITUTION:<br>BACS12HN3-6   | 476481            | 2                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |               |                     |                                         |                   |                      |

— ITEM NOT ILLUSTRATED

RYR

25-40-14-53A

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-14  
 FIG. 53A  
 PAGE 3  
 APR 15/23


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER   | 1 2 3 4 5 6 7 | NOMENCLATURE                                                                                                                                                                                                                                                                                                        | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|---------------|---------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 53A<br>235                                              | NAS1149D0316K | .             | WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J<br>-----*-----                                                                                                                                                                                                                                                    | 476481            | 2                    |
| 240                                                     | 1L500409-745  | .             | STRAP-FIRE BLANKET<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                                                                                                                                                                                                                                                   | 476481            | 1                    |
| 245                                                     | NAS1801-3-6   | .             | SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                                                                                                                                                                                                                                                                      | 476481            | 7                    |
| 250                                                     | NAS1149D0316K | .             | WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J<br>-----*-----                                                                                                                                                                                                                                                    | 476481            | 7                    |
| 255                                                     | 1L500409-769  | .             | BLANKET-FIRE<br>SUPPLIER CODE:<br>V6S8D7                                                                                                                                                                                                                                                                            | 476481            | 1                    |
| - 260                                                   | MS3367-5-9    | .             | STRAP<br>STANDARD SUBSTITUTION:<br>BACS38K5                                                                                                                                                                                                                                                                         | 476481            | AR                   |
| 265                                                     | 4576001-101   | .             | BOX ASSY-OXY<br>SUPPLIER CODE:<br>V16827<br>FUNCTIONAL DESCRIPTION:<br>STORES OXYGEN AND MASK<br>ASSEMBLIES. CONTROLS THE<br>DELIVERY OF OXYGEN TO<br>EACH MASK AND<br>COMMUNICATES WITH THE<br>AIRPLANE NETWORK.<br>COMPONENT MAINT MANUAL REF:<br>25-23-68<br>FOR DETAILS SEE:<br>35-21-00-01A<br>ATTACHING PARTS | 476481            | 1                    |
| 270                                                     | NAS1801-3-6   | .             | SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                                                                                                                                                                                                                                                                      | 476481            | 4                    |
| 275                                                     | NAS1149D0332J | .             | WASHER<br>-----*-----                                                                                                                                                                                                                                                                                               | 476481            | 4                    |
| 280                                                     | 4L500403-17   | .             | ANGLE-<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                                                                                                                                                                                                                                                               | 476481            | 4                    |
| 285                                                     | NAS1801-3-6   | .             | SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                                                                                                                                                                                                                                                                      | 476481            | 4                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |               |               |                                                                                                                                                                                                                                                                                                                     |                   |                      |

- ITEM NOT ILLUSTRATED

R Y R

25-40-14-53A

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-14  
 FIG. 53A  
 PAGE 4  
 APR 15/23


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 NOMENCLATURE                                                         | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|------------------------------------------------------------------------------------|-------------------|----------------------|
| 53A                                                     |                |                                                                                    |                   |                      |
| 290                                                     | NAS1149D0332J  | .WASHER<br>-----*-----                                                             | 476481            | 4                    |
| 295                                                     | 1L500105-15    | .THRESHOLD-<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                         | 476481            | 1                    |
| 300                                                     | NAS8703A4      | .BOLT<br>STANDARD SUBSTITUTION:<br>BACB30ZE3K4<br>-----*-----                      | 476481            | 4                    |
| 305                                                     | 1L500109-147   | .SPACER-THRESHOLD<br>SUPPLIER CODE:<br>V6S8D7                                      | 476481            | 1                    |
| 310                                                     | 1L400040-41    | .COVER-TRASH TRAP<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                   | 476481            | 1                    |
| 315                                                     | NAS8303-7      | .SCREW<br>-----*-----                                                              | 476481            | 1                    |
| 320                                                     | 1L400109-403B  | .KICKSTRIP ASSY-<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                    | 476481            | 1                    |
| 325                                                     | NAS514P632-5   | .SCREW                                                                             | 476481            | 1                    |
| 330                                                     | NAS514P832-5   | .SCREW<br>-----*-----                                                              | 476481            | 3                    |
| 335                                                     | 1L500109-463BA | ..CAP-<br>SUPPLIER CODE:<br>V6S8D7                                                 | 476481            | 1                    |
| 340                                                     | 1L500109-471BA | ..ENDCAP-<br>SUPPLIER CODE:<br>V6S8D7                                              | 476481            | 1                    |
| 345                                                     | 1L500109-473BA | ..RETAINER-<br>SUPPLIER CODE:<br>V6S8D7                                            | 476481            | 1                    |
| - 350                                                   | 1L360041-0727C | .LAVATORY ASSY-<br>SUPPLIER CODE:<br>V6S8D7                                        | 476481            | 1                    |
| 355                                                     | 1L306041-117EW | ..STRUCTURE INSTL-<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-40-14-52P | 476481            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |                                                                                    |                   |                      |

- ITEM NOT ILLUSTRATED

RYR

25-40-14-53A

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-14  
 FIG. 53A  
 PAGE 5  
 APR 15/23


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER  | 1 2 3 4 5 6 7 | NOMENCLATURE                                                                                                                                                                                                                             | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|--------------|---------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 53A<br>360                                              | 3L306040-101 |               | ..ELECTRICAL INSTL-STRUCT<br>SUPPLIER CODE:<br>V6S8D7<br>FUNCTIONAL REFERENCE:<br>EQUIPMENT/FURNISHINGS<br>FOR DETAILS SEE<br>25-41-60-25M<br>LIGHTS<br>FOR DETAILS SEE<br>33-27-51-20<br>WATER/WASTE<br>FOR DETAILS SEE<br>38-32-04-05U | 476481            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |              |               |                                                                                                                                                                                                                                          |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R


25-40-14-53A

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

25-40-14  
 FIG. 53A  
 PAGE 6  
 OCT 15/17



**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

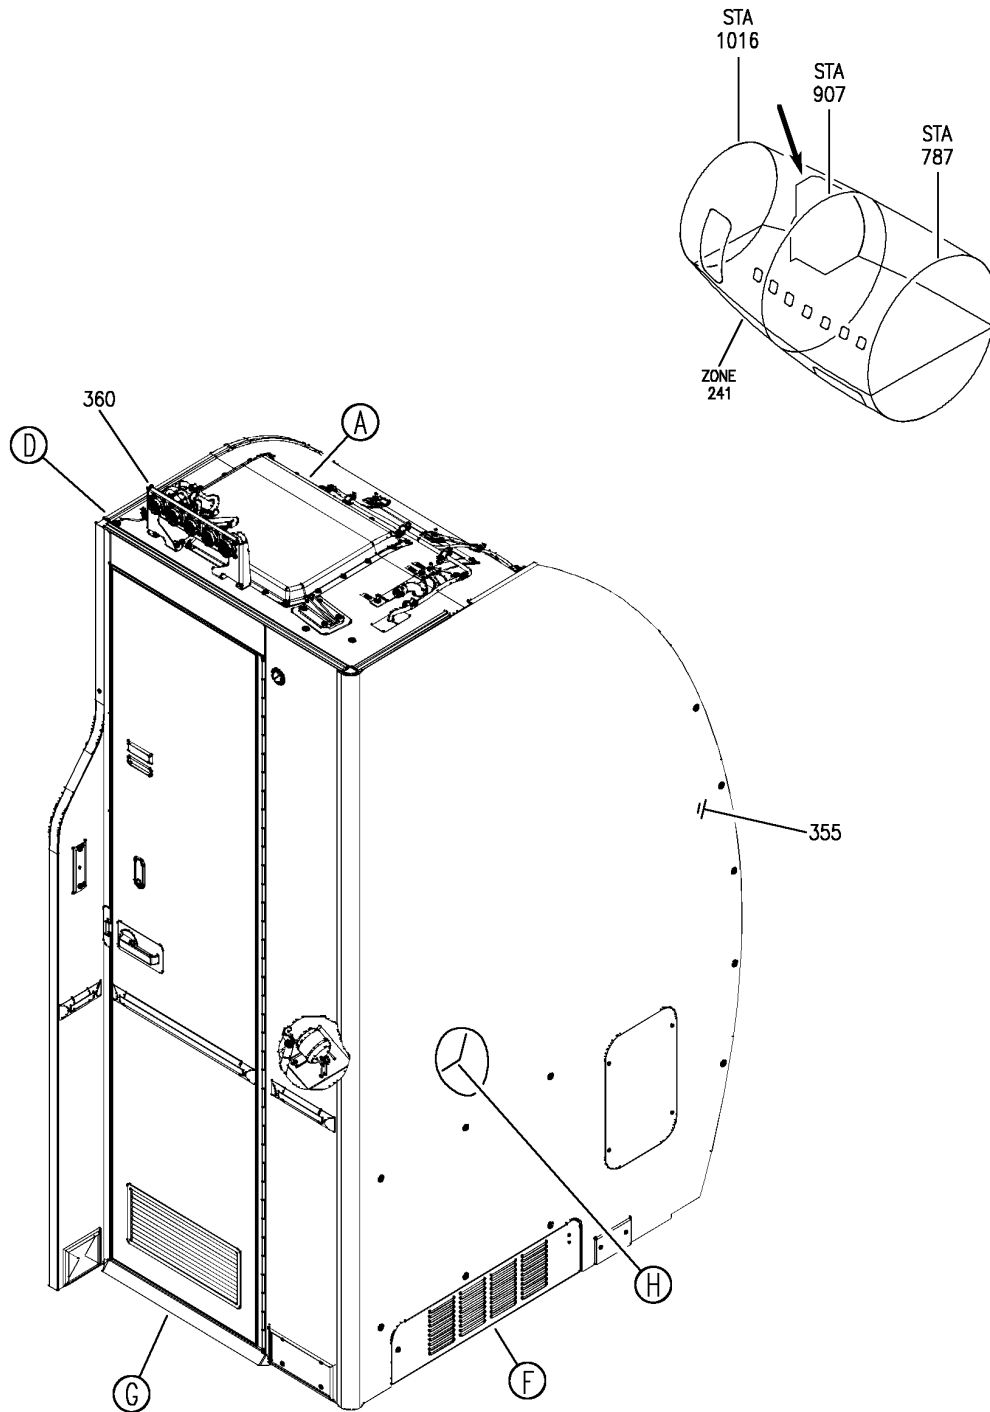

E 25401453B SHT 1 REV 257

MODULE ASSY-LAV D (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 53B (SHEET 1)


**25-40-14-53B**

R Y R  
AUG 15/19

25-40-14-53B  
PAGE 0

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

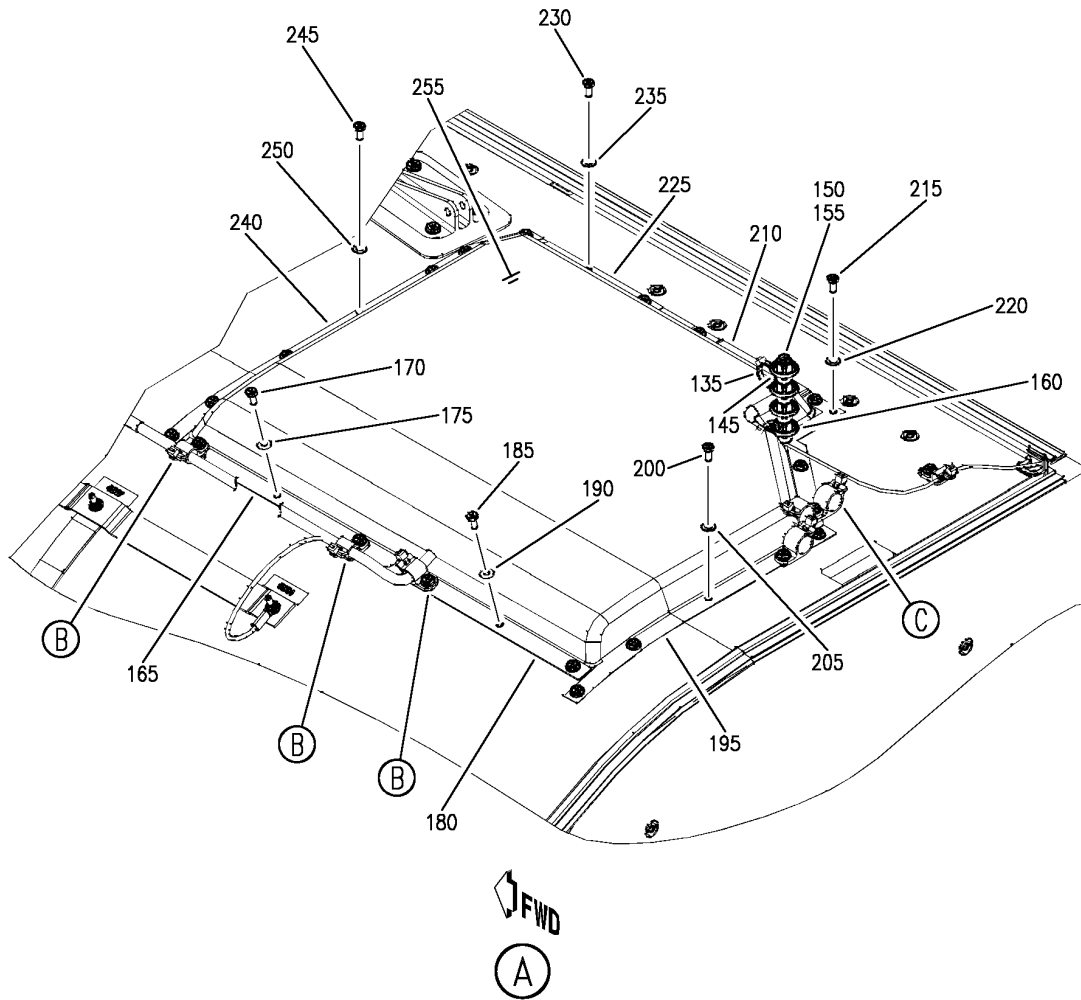

E 25401453B SHT 2 REV 257

MODULE ASSY-LAV D (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 53B (SHEET 2)


**25-40-14-53B**

R/YR  
AUG 15/19


25-40-14-53B  
PAGE 0A

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

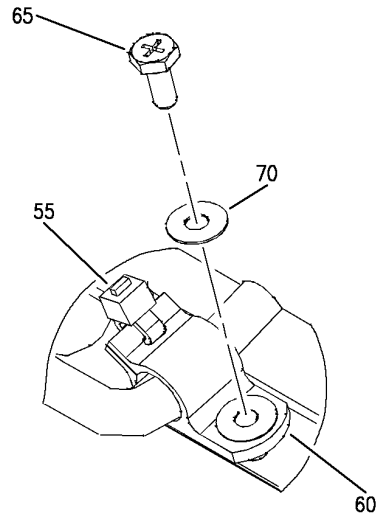

(B)

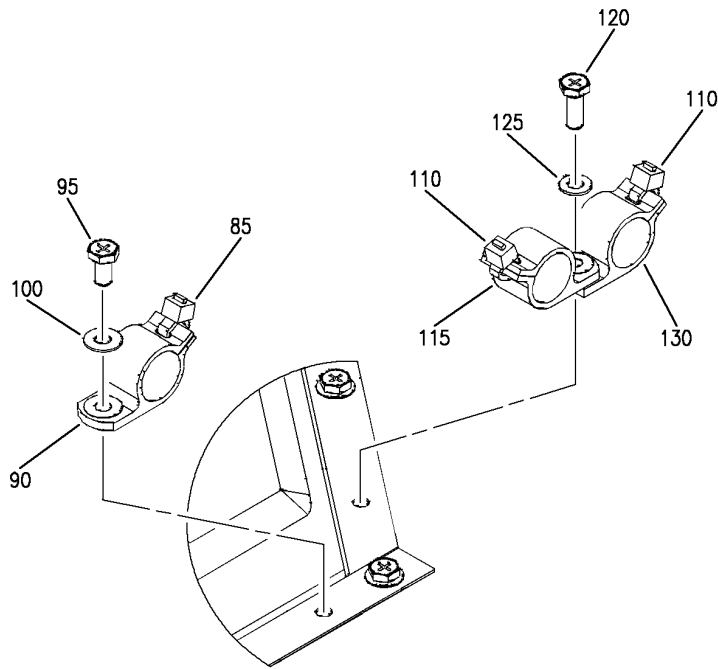

(C)

E 25401453B SHT 3 REV 257

MODULE ASSY-LAV D (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 53B (SHEET 3)


**25-40-14-53B**

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

R Y R  
AUG 15/19

25-40-14-53B  
PAGE 0B

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

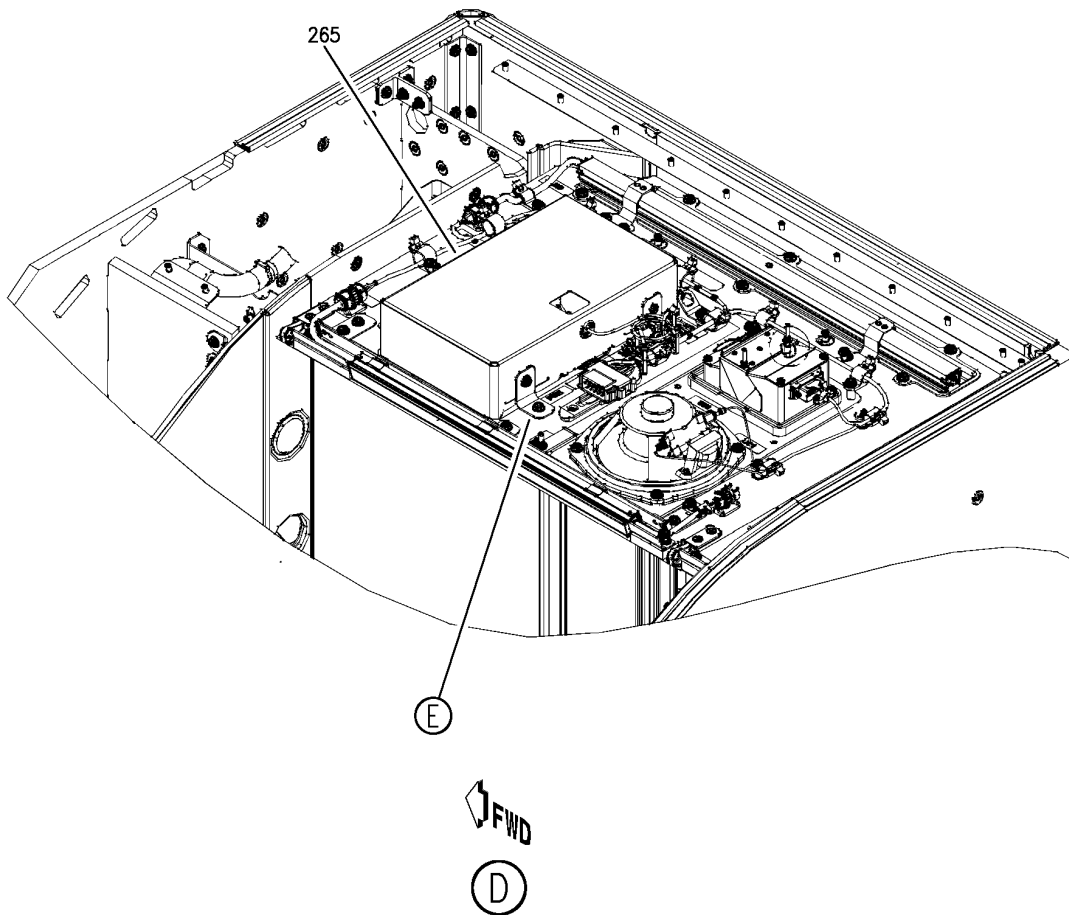

E 25401453B SHT 4 REV 257


MODULE ASSY-LAV D (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 53B (SHEET 4)

**25-40-14-53B**

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

R/YR  
AUG 15/19

25-40-14-53B  
PAGE 0C

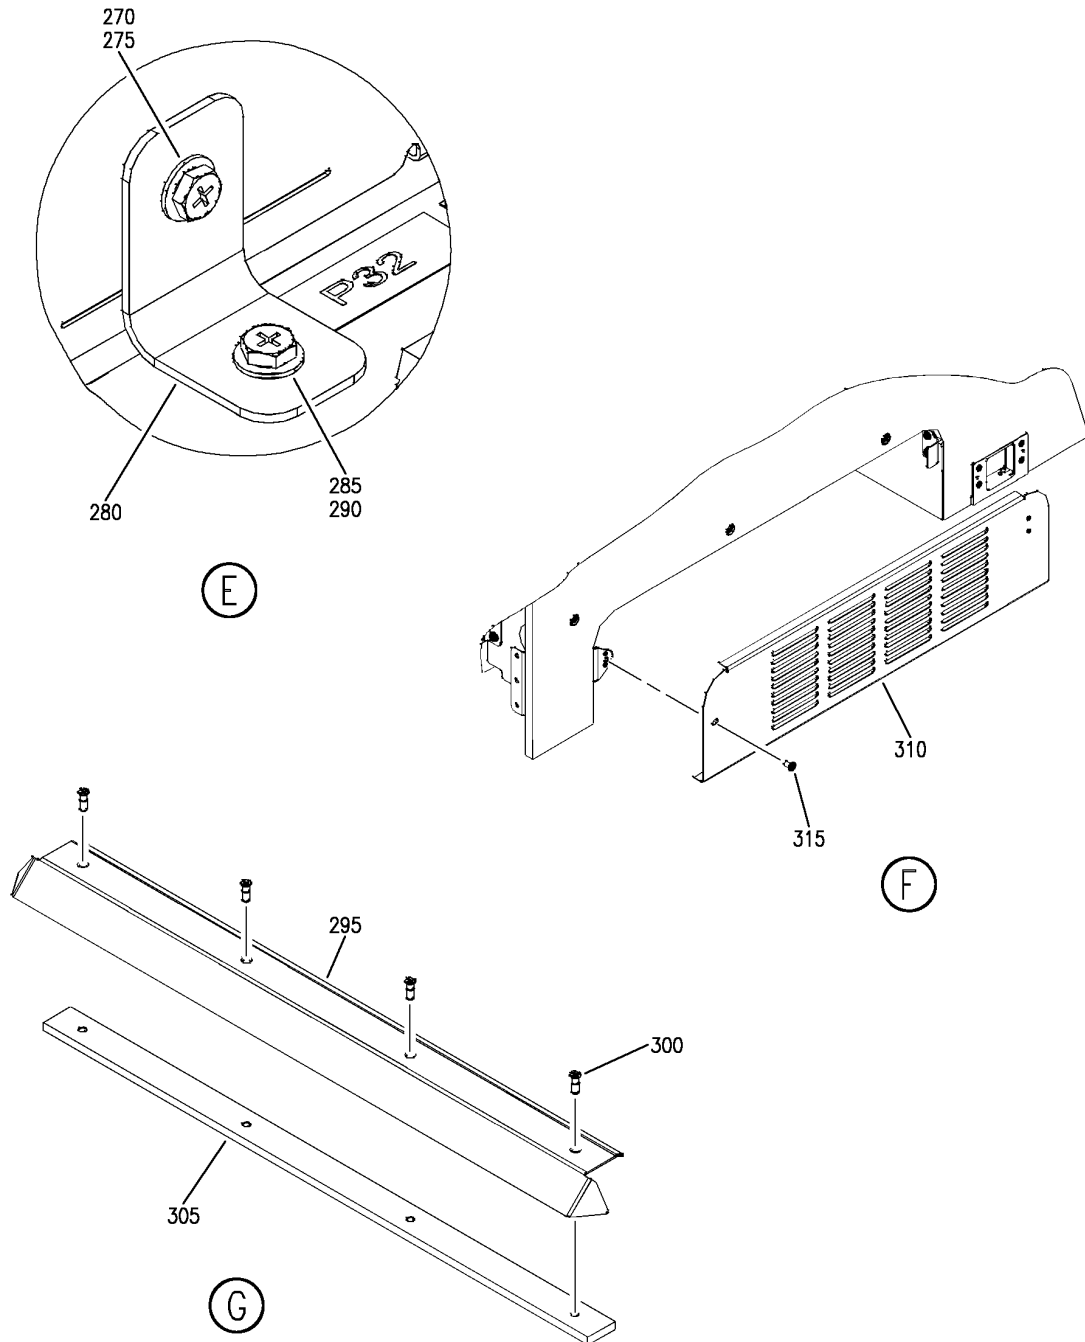

E 25401453B SHT 5 REV 257



MODULE ASSY-LAV D (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 53B (SHEET 5)

**25-40-14-53B**

R Y R  
AUG 15 / 19

25-40-14-53B  
PAGE 0D

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

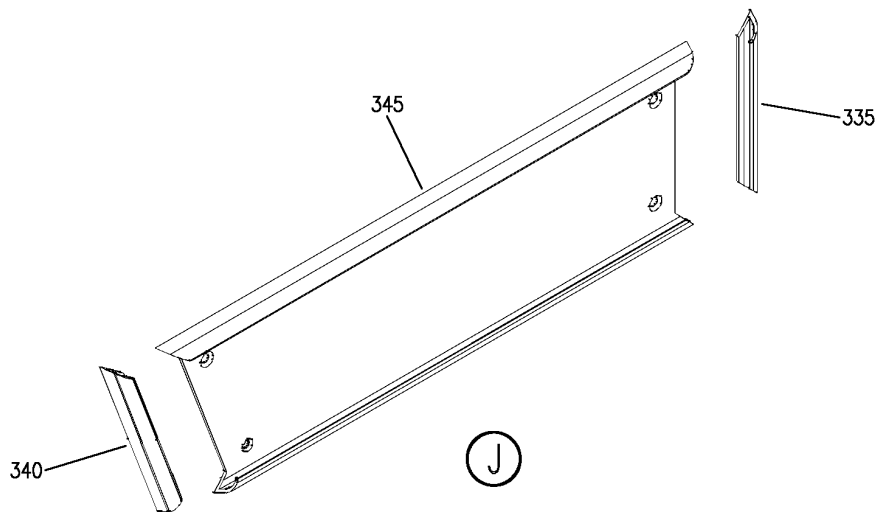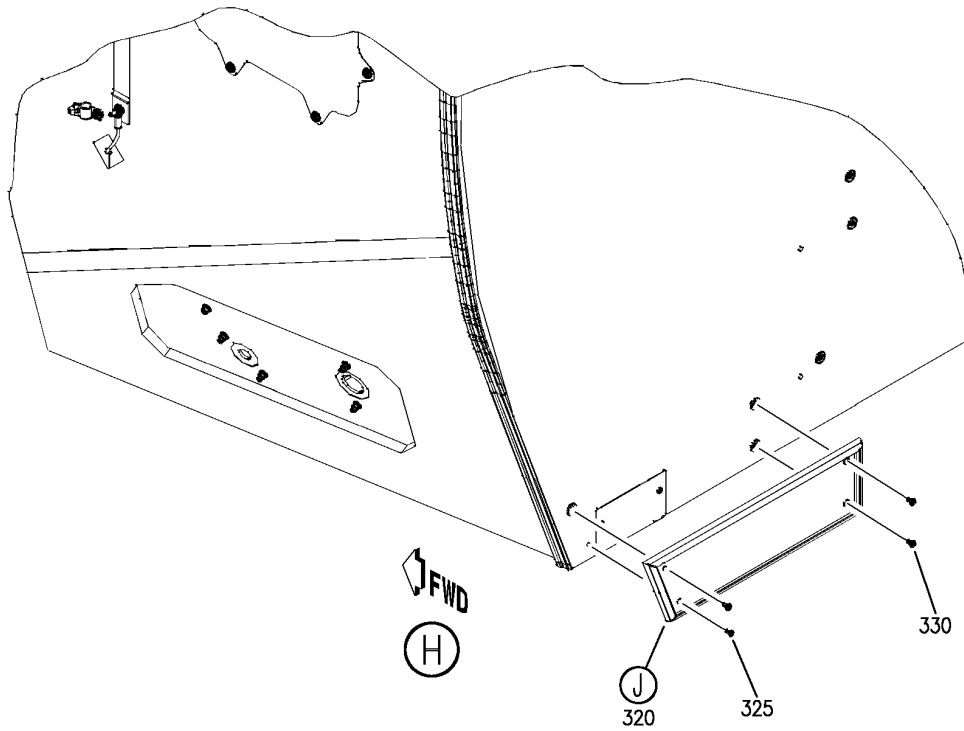

E 25401453B SHT 6 REV 257

MODULE ASSY-LAV D (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 53B (SHEET 6)

**25-40-14-53B**

R Y R  
AUG 15/19

25-40-14-53B  
PAGE 0E

ECCN 9E991 BOEING PROPRIETARY - See title page for details.


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 | NOMENCLATURE                                                                                                                                                                                                                                                                                              | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|---------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 53B                                                     |                |               | MODULE ASSY-LAV D<br>(EQUIPMENT/FURNISHINGS<br>ONLY)                                                                                                                                                                                                                                                      | 482508            |                      |
| - 1                                                     | 1L300040-0727D |               | MODULE ASSY-LAV D<br>(EQUIPMENT/FURNISHINGS<br>ONLY)<br>SUPPLIER CODE:<br>V6S8D7<br>FUNCTIONAL DESCRIPTION:<br>PROVIDES LAVATORY<br>FACILITIES FOR<br>PASSENGERS AND CREW.<br>ELECTRICAL EQUIP NUMBER:<br>M01418<br>COMPONENT MAINT MANUAL REF:<br>25-40-55<br>FOR NHA/OTHER SYS DET SEE:<br>25-40-14-01B | 482508            | RF                   |
| - 50                                                    | 9L500001-107   |               | .CLAMP INSTL-ELECTRICAL<br>SUPPLIER CODE:<br>V6S8D7                                                                                                                                                                                                                                                       | 482508            | 3                    |
| 55                                                      | MS3367-5-9     |               | ..STRAP<br>STANDARD SUBSTITUTION:<br>BACS38K5                                                                                                                                                                                                                                                             | 482508            | 1                    |
| 60                                                      | CA2030-3       |               | ..CLAMP-<br>SUPPLIER CODE:<br>V03296<br>ATTACHING PARTS                                                                                                                                                                                                                                                   | 482508            | 1                    |
| 65                                                      | NAS1801-3-10   |               | ..SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-10                                                                                                                                                                                                                                                         | 482508            | 1                    |
| 70                                                      | NAS1149D0316K  |               | ..WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J                                                                                                                                                                                                                                                       | 482508            | 1                    |
| - 75                                                    | NAS43DD3-16N   |               | ..SPACER<br>STANDARD SUBSTITUTION:<br>NAS43DD3-16FC<br>-----*-----                                                                                                                                                                                                                                        | 482508            | 1                    |
| - 80                                                    | 9L500001-103   |               | .CLAMP INSTL-ELECTRICAL<br>SUPPLIER CODE:<br>V6S8D7                                                                                                                                                                                                                                                       | 482508            | 1                    |
| 85                                                      | MS3367-5-9     |               | ..STRAP<br>STANDARD SUBSTITUTION:<br>BACS38K5                                                                                                                                                                                                                                                             | 482508            | 1                    |
| 90                                                      | CA2030-3       |               | ..CLAMP-<br>SUPPLIER CODE:<br>V03296                                                                                                                                                                                                                                                                      | 482508            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |               |                                                                                                                                                                                                                                                                                                           |                   |                      |

- ITEM NOT ILLUSTRATED

RYR

25-40-14-53B

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-14  
FIG. 53B  
PAGE 1  
APR 15/23

 **BOEING**  
737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER   | 1 2 3 4 5 6 7 NOMENCLATURE                                         | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|---------------|--------------------------------------------------------------------|-------------------|----------------------|
| 53B                                                     |               | ATTACHING PARTS                                                    |                   |                      |
| 95                                                      | NAS1801-3-6   | ..SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                   | 482508            | 1                    |
| 100                                                     | NAS1149D0316K | ..WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J<br>-----*----- | 482508            | 1                    |
| - 105                                                   | 9L500001-150  | .CLAMP INSTL-ELECTRICAL<br>SUPPLIER CODE:<br>V6S8D7                | 482508            | 1                    |
| 110                                                     | MS3367-5-9    | ..STRAP<br>STANDARD SUBSTITUTION:<br>BACS38K5                      | 482508            | 2                    |
| 115                                                     | CA2030-3      | ..CLAMP-<br>SUPPLIER CODE:<br>V03296<br>ATTACHING PARTS            | 482508            | 1                    |
| 120                                                     | NAS1801-3-9   | ..SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-9                   | 482508            | 1                    |
| 125                                                     | NAS1149D0316K | ..WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J<br>-----*----- | 482508            | 1                    |
| 130                                                     | CA2030-3      | ..CLAMP-<br>SUPPLIER CODE:<br>V03296                               | 482508            | 1                    |
| 135                                                     | MS3367-5-9    | .STRAP<br>STANDARD SUBSTITUTION:<br>BACS38K5                       | 482508            | 2                    |
| - 140                                                   | 9L500001-407  | .RINGPOST INSTL-ELECTRICAL<br>SUPPLIER CODE:<br>V6S8D7             | 482508            | 1                    |
| 145                                                     | BACS31H1A     | ..SUPPORT-SINGLE<br>ATTACHING PARTS                                | 482508            | 1                    |
| 150                                                     | NAS1801-3-52  | ..SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-52                  | 482508            | 1                    |
| 155                                                     | NAS1149D0316K | ..WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J<br>-----*----- | 482508            | 1                    |
| 160                                                     | BACS31H1A     | ..SUPPORT-SINGLE                                                   | 482508            | 3                    |
| 165                                                     | 1L500409-741  | .STRAP-FIRE BLANKET<br>SUPPLIER CODE:<br>V6S8D7                    | 482508            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |               |                                                                    |                   |                      |

- ITEM NOT ILLUSTRATED

RYR

25-40-14-53B

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-14  
FIG. 53B  
PAGE 2  
APR 15/23




**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER   | 1 2 3 4 5 6 7 | NOMENCLATURE                                                       | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|---------------|---------------|--------------------------------------------------------------------|-------------------|----------------------|
| 53B                                                     |               |               |                                                                    |                   |                      |
| 170                                                     | NAS1801-3-6   |               | ATTACHING PARTS<br>.SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6 | 482508            | 1                    |
| 175                                                     | NAS1149D0316K |               | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J<br>-----*-----  | 482508            | 1                    |
| 180                                                     | 1L500409-743  |               | .STRAP-FIRE BLANKET<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS | 482508            | 1                    |
| 185                                                     | NAS1801-3-6   |               | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                    | 482508            | 2                    |
| 190                                                     | NAS1149D0316K |               | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J<br>-----*-----  | 482508            | 2                    |
| 195                                                     | 1L500409-767  |               | .STRAP-FIRE BLANKET<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS | 482508            | 1                    |
| 200                                                     | NAS1801-3-6   |               | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                    | 482508            | 4                    |
| 205                                                     | NAS1149D0316K |               | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J<br>-----*-----  | 482508            | 4                    |
| 210                                                     | 1L500409-765  |               | .STRAP-FIRE BLANKET<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS | 482508            | 1                    |
| 215                                                     | NAS1801-3-6   |               | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                    | 482508            | 4                    |
| 220                                                     | NAS1149D0316K |               | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J<br>-----*-----  | 482508            | 4                    |
| 225                                                     | 1L500409-763  |               | .STRAP-FIRE BLANKET<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS | 482508            | 1                    |
| 230                                                     | NAS1801-3-6   |               | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                    | 482508            | 2                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |               |               |                                                                    |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R

25-40-14-53B

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-14  
 FIG. 53B  
 PAGE 3  
 APR 15/23


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER   | 1 2 3 4 5 6 7 | NOMENCLATURE                                                                                                                                                                                                                                                                                      | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|---------------|---------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 53B<br>235                                              | NAS1149D0316K |               | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J<br>-----*-----                                                                                                                                                                                                                                 | 482508            | 2                    |
| 240                                                     | 1L500409-745  |               | .STRAP-FIRE BLANKET<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                                                                                                                                                                                                                                | 482508            | 1                    |
| 245                                                     | NAS1801-3-6   |               | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                                                                                                                                                                                                                                                   | 482508            | 7                    |
| 250                                                     | NAS1149D0316K |               | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J<br>-----*-----                                                                                                                                                                                                                                 | 482508            | 7                    |
| 255                                                     | 1L500409-769  |               | .BLANKET-FIRE<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                                                                                                                                                                                                                                      | 482508            | 1                    |
| - 260                                                   | MS3367-5-9    |               | .STRAP<br>STANDARD SUBSTITUTION:<br>BACS38K5                                                                                                                                                                                                                                                      | 482508            | AR                   |
| 265                                                     | 4576001-101   |               | .BOX ASSY-OXY<br>SUPPLIER CODE:<br>V16827<br>FUNCTIONAL DESCRIPTION:<br>STORES OXYGEN AND MASK<br>ASSEMBLIES. CONTROLS THE<br>DELIVERY OF OXYGEN TO<br>EACH MASK AND<br>COMMUNICATES WITH THE<br>AIRPLANE NETWORK.<br>COMPONENT MAINT MANUAL REF:<br>25-23-68<br>FOR DETAILS SEE:<br>35-21-00-01A | 482508            | 1                    |
| 270                                                     | NAS1801-3-6   |               | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                                                                                                                                                                                                                                                   | 482508            | 4                    |
| 275                                                     | NAS1149D0332J |               | .WASHER<br>-----*-----                                                                                                                                                                                                                                                                            | 482508            | 4                    |
| 280                                                     | 4L500403-17   |               | .ANGLE-<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                                                                                                                                                                                                                                            | 482508            | 4                    |
| 285                                                     | NAS1801-3-6   |               | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                                                                                                                                                                                                                                                   | 482508            | 4                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |               |               |                                                                                                                                                                                                                                                                                                   |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R

25-40-14-53B

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-14  
 FIG. 53B  
 PAGE 4  
 APR 15/23


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 NOMENCLATURE                                                         | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|------------------------------------------------------------------------------------|-------------------|----------------------|
| 53B                                                     |                |                                                                                    |                   |                      |
| 290                                                     | NAS1149D0332J  | .WASHER<br>-----*-----                                                             | 482508            | 4                    |
| 295                                                     | 1L500105-15    | .THRESHOLD-<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                         | 482508            | 1                    |
| 300                                                     | NAS8703A4      | .BOLT<br>STANDARD SUBSTITUTION:<br>BACB30ZE3K4<br>-----*-----                      | 482508            | 4                    |
| 305                                                     | 1L500109-147   | .SPACER-THRESHOLD<br>SUPPLIER CODE:<br>V6S8D7                                      | 482508            | 1                    |
| 310                                                     | 1L400040-41    | .COVER-TRASH TRAP<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                   | 482508            | 1                    |
| 315                                                     | NAS8303-7      | .SCREW<br>-----*-----                                                              | 482508            | 1                    |
| 320                                                     | 1L400109-403BA | .KICKSTRIP ASSY-<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                    | 482508            | 1                    |
| 325                                                     | NAS514P632-5   | .SCREW                                                                             | 482508            | 1                    |
| 330                                                     | NAS514P832-5   | .SCREW<br>-----*-----                                                              | 482508            | 3                    |
| 335                                                     | 1L500109-463BA | ..CAP-<br>SUPPLIER CODE:<br>V6S8D7                                                 | 482508            | 1                    |
| 340                                                     | 1L500109-471BA | ..ENDCAP-<br>SUPPLIER CODE:<br>V6S8D7                                              | 482508            | 1                    |
| 345                                                     | 1L500109-473BA | ..RETAINER-<br>SUPPLIER CODE:<br>V6S8D7                                            | 482508            | 1                    |
| - 350                                                   | 1L360041-0727D | .LAVATORY ASSY-<br>SUPPLIER CODE:<br>V6S8D7                                        | 482508            | 1                    |
| 355                                                     | 1L306041-117HF | ..STRUCTURE INSTL-<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-40-14-52P | 482508            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |                                                                                    |                   |                      |

- ITEM NOT ILLUSTRATED

RYR

25-40-14-53B

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-14  
 FIG. 53B  
 PAGE 5  
 APR 15/23


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER  | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                                                                                                                                               | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|--------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 53B<br>360                                              | 3L306040-101 | ..ELECTRICAL INSTL-STRUCT<br>SUPPLIER CODE:<br>V6S8D7<br>FUNCTIONAL REFERENCE:<br>EQUIPMENT/FURNISHINGS<br>FOR DETAILS SEE<br>25-41-60-25M<br>LIGHTS<br>FOR DETAILS SEE<br>33-27-51-20<br>WATER/WASTE<br>FOR DETAILS SEE<br>38-32-04-05U | 482508            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |              |                                                                                                                                                                                                                                          |                   |                      |

— ITEM NOT ILLUSTRATED


R Y R

25-40-14-53B

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

25-40-14  
 FIG. 53B  
 PAGE 6  
 FEB 15/18

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

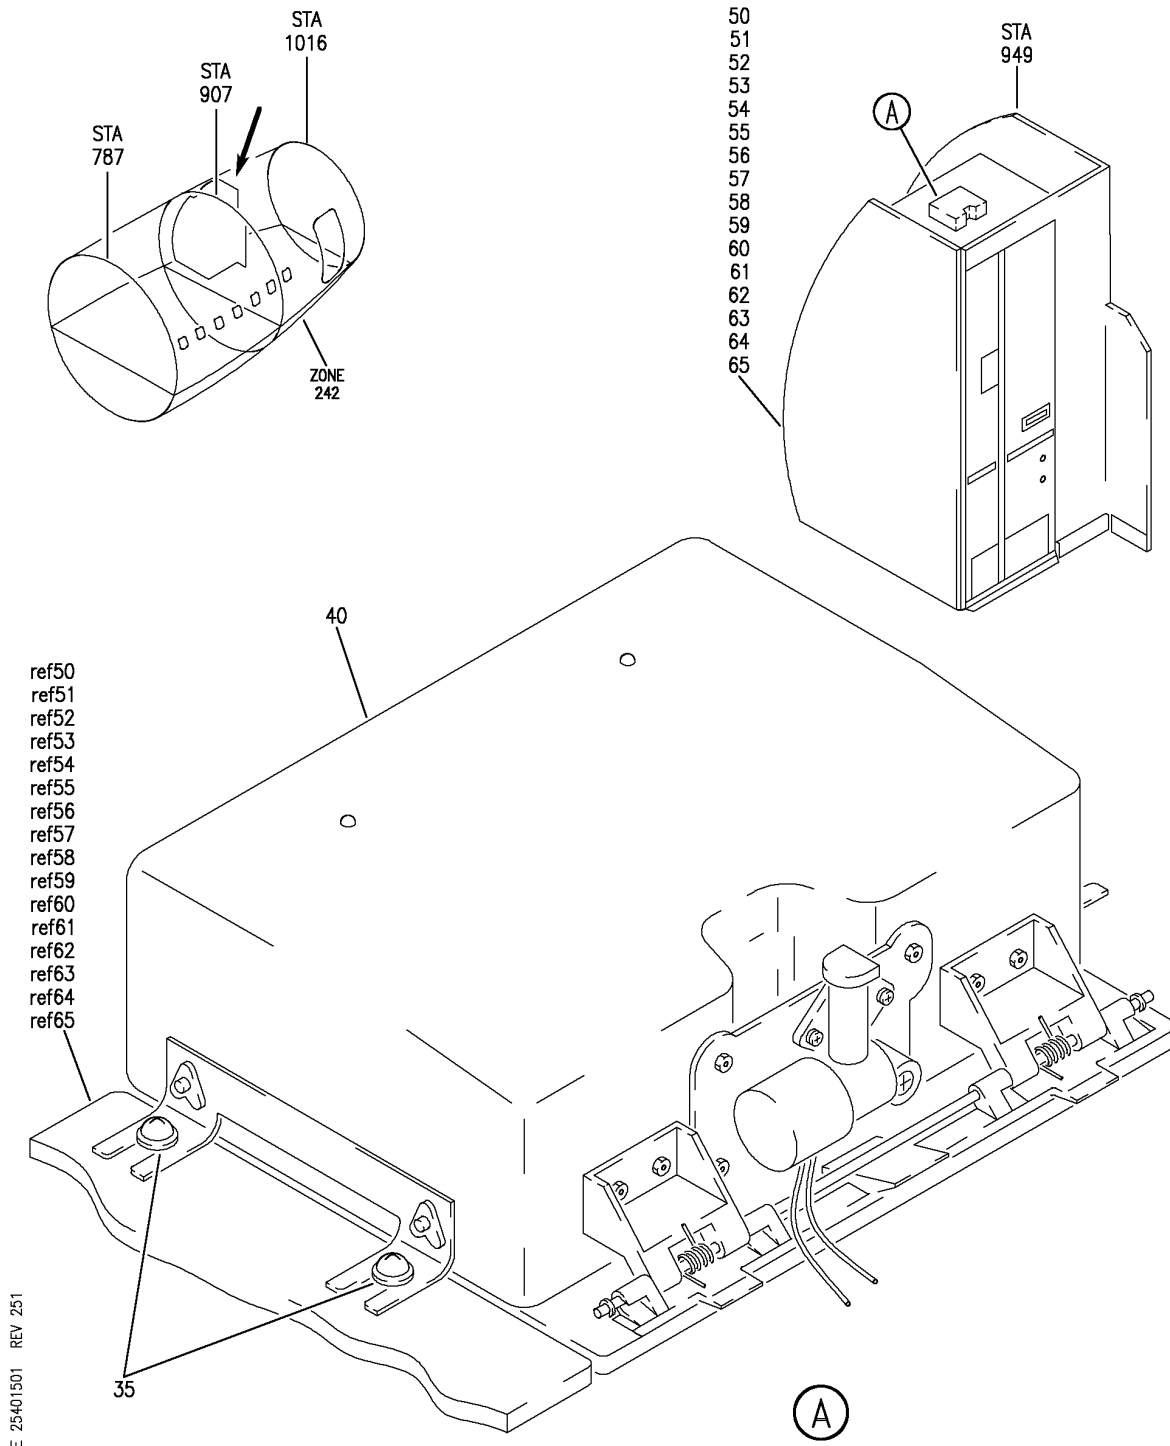

E 25401501 REV 251

LAVATORY INSTL-LAV E  
FIGURE 1

**25-40-15-01**

RYR  
JUN 15/17

25-40-15-01  
PAGE 0


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 | NOMENCLATURE                                                                                                                                                                                         | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|---------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 1                                                       |                |               | LAVATORY INSTL-LAV E                                                                                                                                                                                 | 336475            |                      |
| - 5                                                     | MODREF530895   |               | LAVATORY INSTL-LAV E                                                                                                                                                                                 | 336353            | RF                   |
|                                                         |                |               | MODULE NUMBER:<br>417A1158-117C REV C                                                                                                                                                                |                   |                      |
| - 11                                                    | MODREF653586   |               | LAVATORY INSTL-LAV E                                                                                                                                                                                 | 354377            | RF                   |
|                                                         |                |               | MODULE NUMBER:<br>417A1158-117C REV D                                                                                                                                                                |                   |                      |
| - 13                                                    | MODREF683441   |               | LAVATORY INSTL-LAV E                                                                                                                                                                                 | 378416            | RF                   |
|                                                         |                |               | MODULE NUMBER:<br>417A1158-117D REV A                                                                                                                                                                |                   |                      |
| - 15                                                    | MODREF706005   |               | LAVATORY INSTL-LAV E                                                                                                                                                                                 | 417437            | RF                   |
|                                                         |                |               | MODULE NUMBER:<br>417A1160-240B REV A                                                                                                                                                                |                   |                      |
| - 16                                                    | MODREF717976   |               | LAVATORY INSTL-LAV E                                                                                                                                                                                 | 438459            | RF                   |
|                                                         |                |               | MODULE NUMBER:<br>417A1160-240C REV A                                                                                                                                                                |                   |                      |
| - 17                                                    | MODREF726454   |               | LAVATORY INSTL-LAV E                                                                                                                                                                                 | 460475            | RF                   |
|                                                         |                |               | MODULE NUMBER:<br>417A1160-240D REV A                                                                                                                                                                |                   |                      |
| 54                                                      | D72001401-111A |               | MODULE ASSY-LAV E                                                                                                                                                                                    | 336353            | 1                    |
|                                                         |                |               | SUPPLIER CODE:<br>VJ4577                                                                                                                                                                             |                   |                      |
|                                                         |                |               | FUNCTIONAL DESCRIPTION:<br>THIS PART PROVIDES A<br>RESTROOM FOR PASSENGERS<br>AND CREW.                                                                                                              |                   |                      |
|                                                         |                |               | ELECTRICAL EQUIP NUMBER:<br>M01419                                                                                                                                                                   |                   |                      |
|                                                         |                |               | COMPONENT MAINT MANUAL REF:<br>25-48-31                                                                                                                                                              |                   |                      |
|                                                         |                |               | FUNCTIONAL REFERENCE:<br>AIR CONDITIONING<br>FOR DETAILS SEE<br>21-24-51-21A<br>EQUIPMENT/FURNISHINGS<br>FOR DETAILS SEE<br>25-40-15-21A<br>PLACARDS AND MARKINGS<br>FOR DETAILS SEE<br>11-32-05-19B |                   |                      |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |               |                                                                                                                                                                                                      |                   |                      |

- ITEM NOT ILLUSTRATED

RYR

# 25-40-15-01

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-15  
 FIG. 01  
 PAGE 1  
 OCT 15/24


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 | NOMENCLATURE                                                                                                                                                                                                                                                                                                                                                                                                                       | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|---------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 1                                                       |                |               |                                                                                                                                                                                                                                                                                                                                                                                                                                    |                   |                      |
| 59                                                      | D72001401-111F |               | .MODULE ASSY-LAV E<br>SUPPLIER CODE:<br>VJ4577<br>FUNCTIONAL DESCRIPTION:<br>THIS PART PROVIDES A<br>RESTROOM FOR PASSENGERS<br>AND CREW.<br>ELECTRICAL EQUIP NUMBER:<br>M01419<br>COMPONENT MAINT MANUAL REF:<br>25-48-31<br>FUNCTIONAL REFERENCE:<br>AIR CONDITIONING<br>FOR DETAILS SEE<br>21-24-51-21A<br>EQUIPMENT/FURNISHINGS<br>FOR DETAILS SEE<br>25-40-15-21A<br>PLACARDS AND MARKINGS<br>FOR DETAILS SEE<br>11-32-05-19B | 354377            | 1                    |
| 61                                                      | D72001401-111G |               | .MODULE ASSY-LAV E<br>SUPPLIER CODE:<br>VJ4577<br>FUNCTIONAL DESCRIPTION:<br>THIS PART PROVIDES A<br>RESTROOM FOR PASSENGERS<br>AND CREW.<br>ELECTRICAL EQUIP NUMBER:<br>M01419<br>COMPONENT MAINT MANUAL REF:<br>25-48-31<br>FUNCTIONAL REFERENCE:<br>AIR CONDITIONING<br>FOR DETAILS SEE<br>21-24-51-21A<br>EQUIPMENT/FURNISHINGS<br>FOR DETAILS SEE<br>25-40-15-21A<br>PLACARDS AND MARKINGS<br>FOR DETAILS SEE<br>11-32-05-19B | 378416            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |               |                                                                                                                                                                                                                                                                                                                                                                                                                                    |                   |                      |

— ITEM NOT ILLUSTRATED

RYR

# 25-40-15-01

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

25-40-15  
 FIG. 01  
 PAGE 2  
 OCT 15/24


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                                                                                                                                                                                                                                                                                                                                                                              | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 1                                                       |                |                                                                                                                                                                                                                                                                                                                                                                                                                                                                         |                   |                      |
| 62                                                      | 1L300050-1241A | .MODULE ASSY-LAV E<br>SUPPLIER CODE:<br>V6S8D7<br>FUNCTIONAL DESCRIPTION:<br>PROVIDES LAVATORY<br>SERVICES<br>ELECTRICAL EQUIP NUMBER:<br>M01419<br>COMPONENT MAINT MANUAL REF:<br>25-40-44<br>FUNCTIONAL REFERENCE:<br>COMMUNICATIONS<br>FOR DETAILS SEE<br>23-31-05-17N<br>EQUIPMENT/FURNISHINGS<br>FOR DETAILS SEE<br>25-40-15-09F<br>FIRE PROTECTION<br>FOR DETAILS SEE<br>26-14-01-14G<br>26-24-01-14E<br>PLACARDS AND MARKINGS<br>FOR DETAILS SEE<br>11-32-05-14M | 417437            | 1                    |
| 63                                                      | 1L300050-1241B | .MODULE ASSY-LAV E<br>SUPPLIER CODE:<br>V6S8D7<br>FUNCTIONAL DESCRIPTION:<br>PROVIDES LAVATORY<br>SERVICES<br>ELECTRICAL EQUIP NUMBER:<br>M01419<br>COMPONENT MAINT MANUAL REF:<br>25-40-44<br>FUNCTIONAL REFERENCE:<br>COMMUNICATIONS<br>FOR DETAILS SEE<br>23-31-05-17N<br>EQUIPMENT/FURNISHINGS<br>FOR DETAILS SEE<br>25-40-15-09U<br>FIRE PROTECTION<br>FOR DETAILS SEE<br>26-14-01-14G<br>26-24-01-14E<br>PLACARDS AND MARKINGS<br>FOR DETAILS SEE<br>11-32-05-14M | 438459            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |                                                                                                                                                                                                                                                                                                                                                                                                                                                                         |                   |                      |

— ITEM NOT ILLUSTRATED

RYR

25-40-15-01

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

25-40-15  
 FIG. 01  
 PAGE 3  
 FEB 15/17




**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                                                                                                                                                                                                                                                                                                                                                                                                           | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 1<br>64                                                 | 1L300050-1241C | .MODULE ASSY-LAV E<br>SUPPLIER CODE:<br>V6S8D7<br>FUNCTIONAL DESCRIPTION:<br>PROVIDES LAVATORY<br>FACILITIES FOR<br>PASSENGERS AND CREW<br>ELECTRICAL EQUIP NUMBER:<br>M01419<br>COMPONENT MAINT MANUAL REF:<br>25-40-56<br>FUNCTIONAL REFERENCE:<br>COMMUNICATIONS<br>FOR DETAILS SEE<br>23-31-05-15C<br>EQUIPMENT/FURNISHINGS<br>FOR DETAILS SEE<br>25-40-15-13D<br>FIRE PROTECTION<br>FOR DETAILS SEE<br>26-14-01-13P<br>26-24-01-13X<br>PLACARDS AND MARKINGS<br>FOR DETAILS SEE<br>11-32-05-17L | 460475            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                      |                   |                      |

— ITEM NOT ILLUSTRATED


R Y R

# 25-40-15-01

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

25-40-15  
 FIG. 01  
 PAGE 4  
 OCT 15/17

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

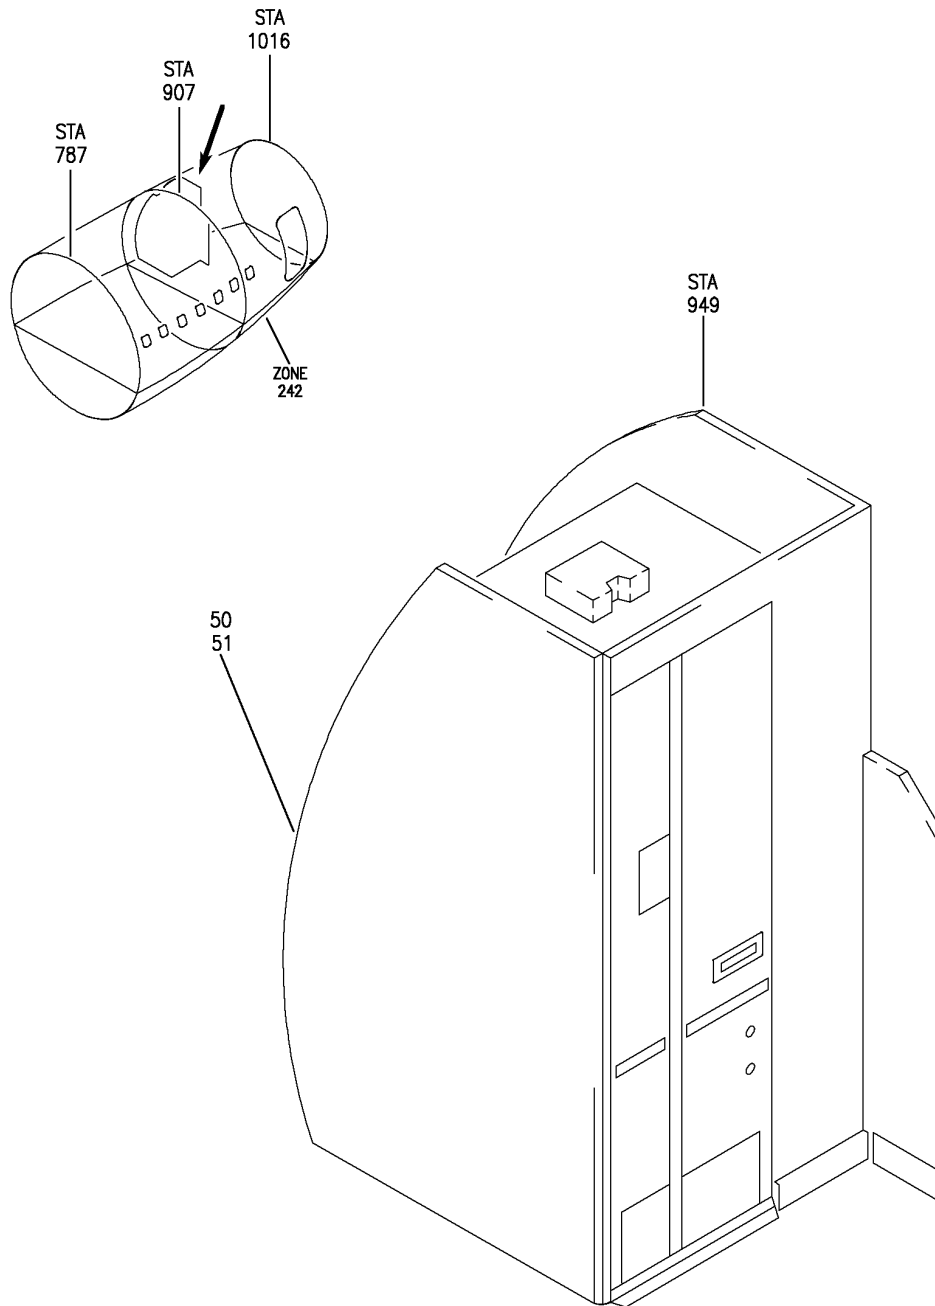

E 25401501B REV 263

LAVATORY INSTL-LAV E  
FIGURE 1B

**25-40-15-01B**

R Y R  
JUN 15/18

25-40-15-01B  
PAGE 0

ECCN 9E991 BOEING PROPRIETARY – See title page for details.


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 | NOMENCLATURE                                                                                                                                                                                                                                                                                                                                                                                                                                                                                        | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|---------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 1B                                                      |                |               |                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                     |                   |                      |
| - 1                                                     | MODREF746542   |               | LAVATORY INSTL-LAV E<br>LAVATORY INSTL-LAV E<br>MODULE NUMBER:<br>417A1160-460B REV A                                                                                                                                                                                                                                                                                                                                                                                                               | 476999<br>476481  | RF                   |
| - 1                                                     | MODREF750034   |               | LAVATORY INSTL-LAV E<br>MODULE NUMBER:<br>417A1160-460C REV A                                                                                                                                                                                                                                                                                                                                                                                                                                       | 482508            | RF                   |
| - 1                                                     | MODREF763055   |               | LAVATORY INSTL-LAV E<br>MODULE NUMBER:<br>417A1160-539B REV A                                                                                                                                                                                                                                                                                                                                                                                                                                       | 509999            | RF                   |
| 50                                                      | 1L300050-1285A |               | MODULE ASSY-LAV E<br>SUPPLIER CODE:<br>V6S8D7<br>FUNCTIONAL DESCRIPTION:<br>PROVIDES LAVATORY<br>FACILITIES FOR<br>PASSENGERS AND CREW<br>ELECTRICAL EQUIP NUMBER:<br>M01419<br>COMPONENT MAINT MANUAL REF:<br>25-40-56<br>FUNCTIONAL REFERENCE:<br>COMMUNICATIONS<br>FOR DETAILS SEE<br>23-31-05-15C<br>EQUIPMENT/FURNISHINGS<br>FOR DETAILS SEE<br>25-40-15-13S<br>FIRE PROTECTION<br>FOR DETAILS SEE<br>26-14-01-13P<br>26-24-01-13X<br>PLACARDS AND MARKINGS<br>FOR DETAILS SEE<br>11-32-05-17L | 476481            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |               |                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                     |                   |                      |

- ITEM NOT ILLUSTRATED

R Y R

25-40-15-01B

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-15  
FIG. 01B  
PAGE 1  
APR 15/18


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                                                                                                                                                                                                                                                                                                                                                                                                           | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 1B<br>50                                                | 1L300050-1285B | .MODULE ASSY-LAV E<br>SUPPLIER CODE:<br>V6S8D7<br>FUNCTIONAL DESCRIPTION:<br>PROVIDES LAVATORY<br>FACILITIES FOR<br>PASSENGERS AND CREW<br>ELECTRICAL EQUIP NUMBER:<br>M01419<br>COMPONENT MAINT MANUAL REF:<br>25-40-56<br>FUNCTIONAL REFERENCE:<br>COMMUNICATIONS<br>FOR DETAILS SEE<br>23-31-05-15C<br>EQUIPMENT/FURNISHINGS<br>FOR DETAILS SEE<br>25-40-15-13T<br>FIRE PROTECTION<br>FOR DETAILS SEE<br>26-14-01-13P<br>26-24-01-13X<br>PLACARDS AND MARKINGS<br>FOR DETAILS SEE<br>11-32-05-17L | 482508            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                      |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R

25-40-15-01B

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

25-40-15  
 FIG. 01B  
 PAGE 2  
 APR 15/18


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                                                                                                                                                                                                                                                                                                                                                                                                           | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 1B<br>50                                                | 1L300050-1397A | .MODULE ASSY-LAV E<br>SUPPLIER CODE:<br>V6S8D7<br>FUNCTIONAL DESCRIPTION:<br>PROVIDES LAVATORY<br>FACILITIES FOR<br>PASSENGERS AND CREW<br>ELECTRICAL EQUIP NUMBER:<br>M01419<br>COMPONENT MAINT MANUAL REF:<br>25-40-51<br>FUNCTIONAL REFERENCE:<br>COMMUNICATIONS<br>FOR DETAILS SEE<br>23-31-05-14D<br>EQUIPMENT/FURNISHINGS<br>FOR DETAILS SEE<br>25-40-15-23L<br>FIRE PROTECTION<br>FOR DETAILS SEE<br>26-14-01-15A<br>26-24-01-15A<br>PLACARDS AND MARKINGS<br>FOR DETAILS SEE<br>11-32-05-20E | 509999            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                      |                   |                      |

— ITEM NOT ILLUSTRATED


R Y R

25-40-15-01B

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

25-40-15  
 FIG. 01B  
 PAGE 3  
 APR 15/18

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

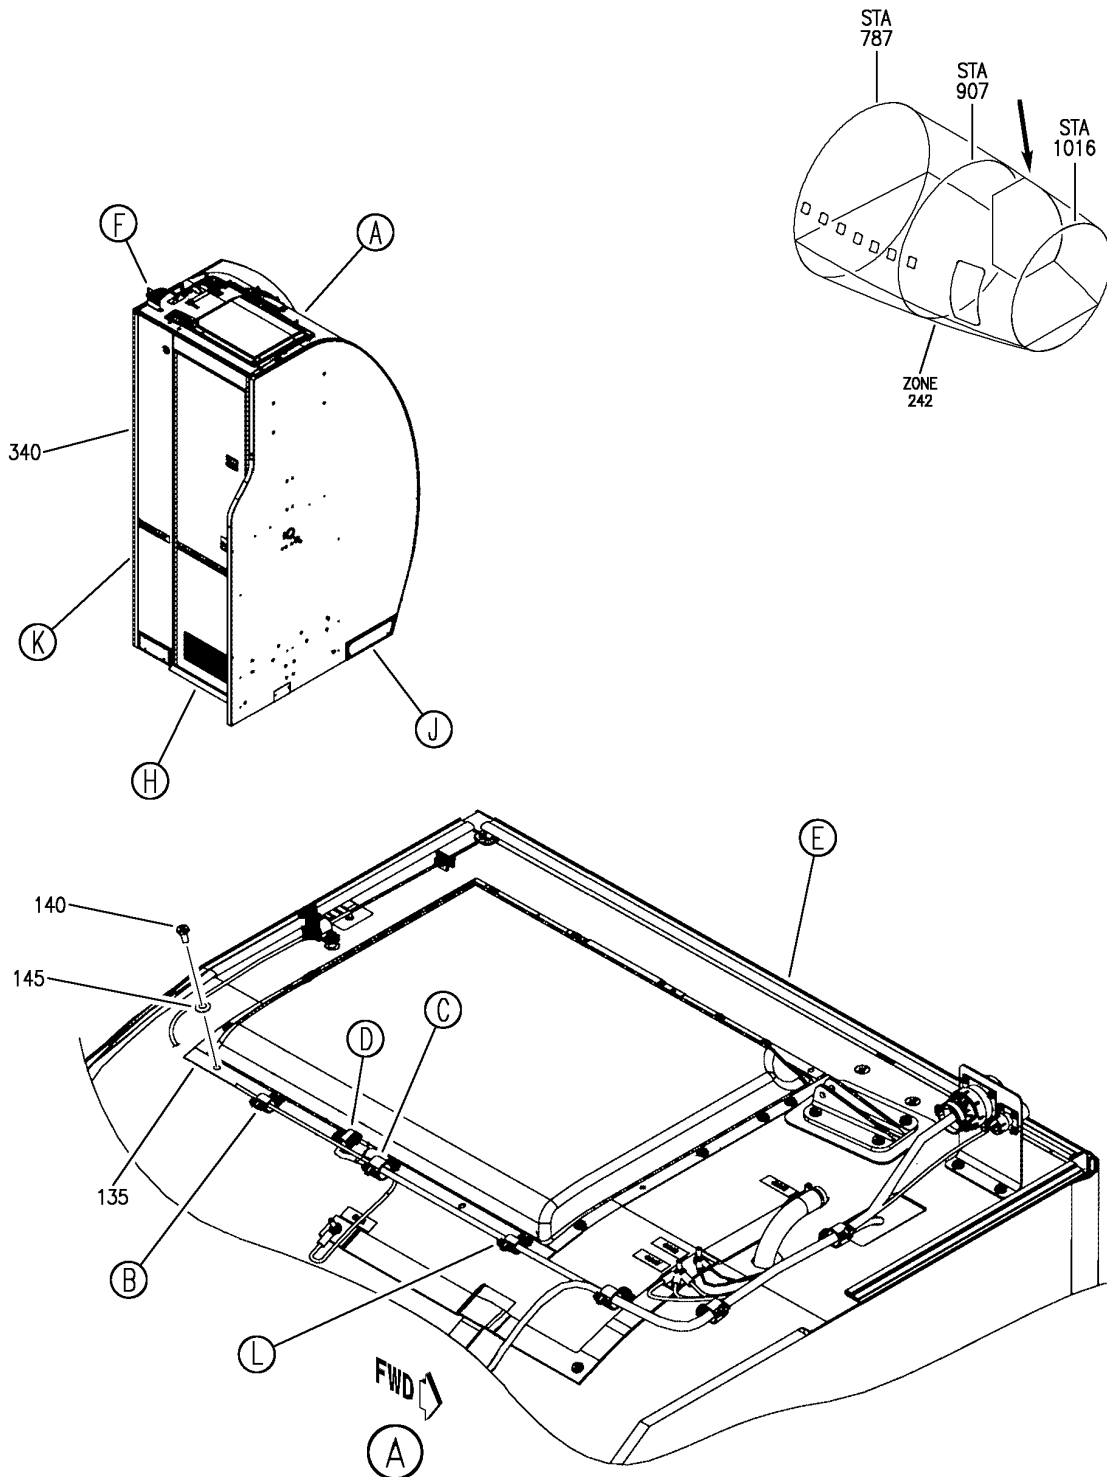

E 25401509F SHT 1 REV 271

MODULE ASSY-LAV E (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 9F (SHEET 1)


**25-40-15-09F**

R/YR  
AUG 15/19

25-40-15-09F  
PAGE 0

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

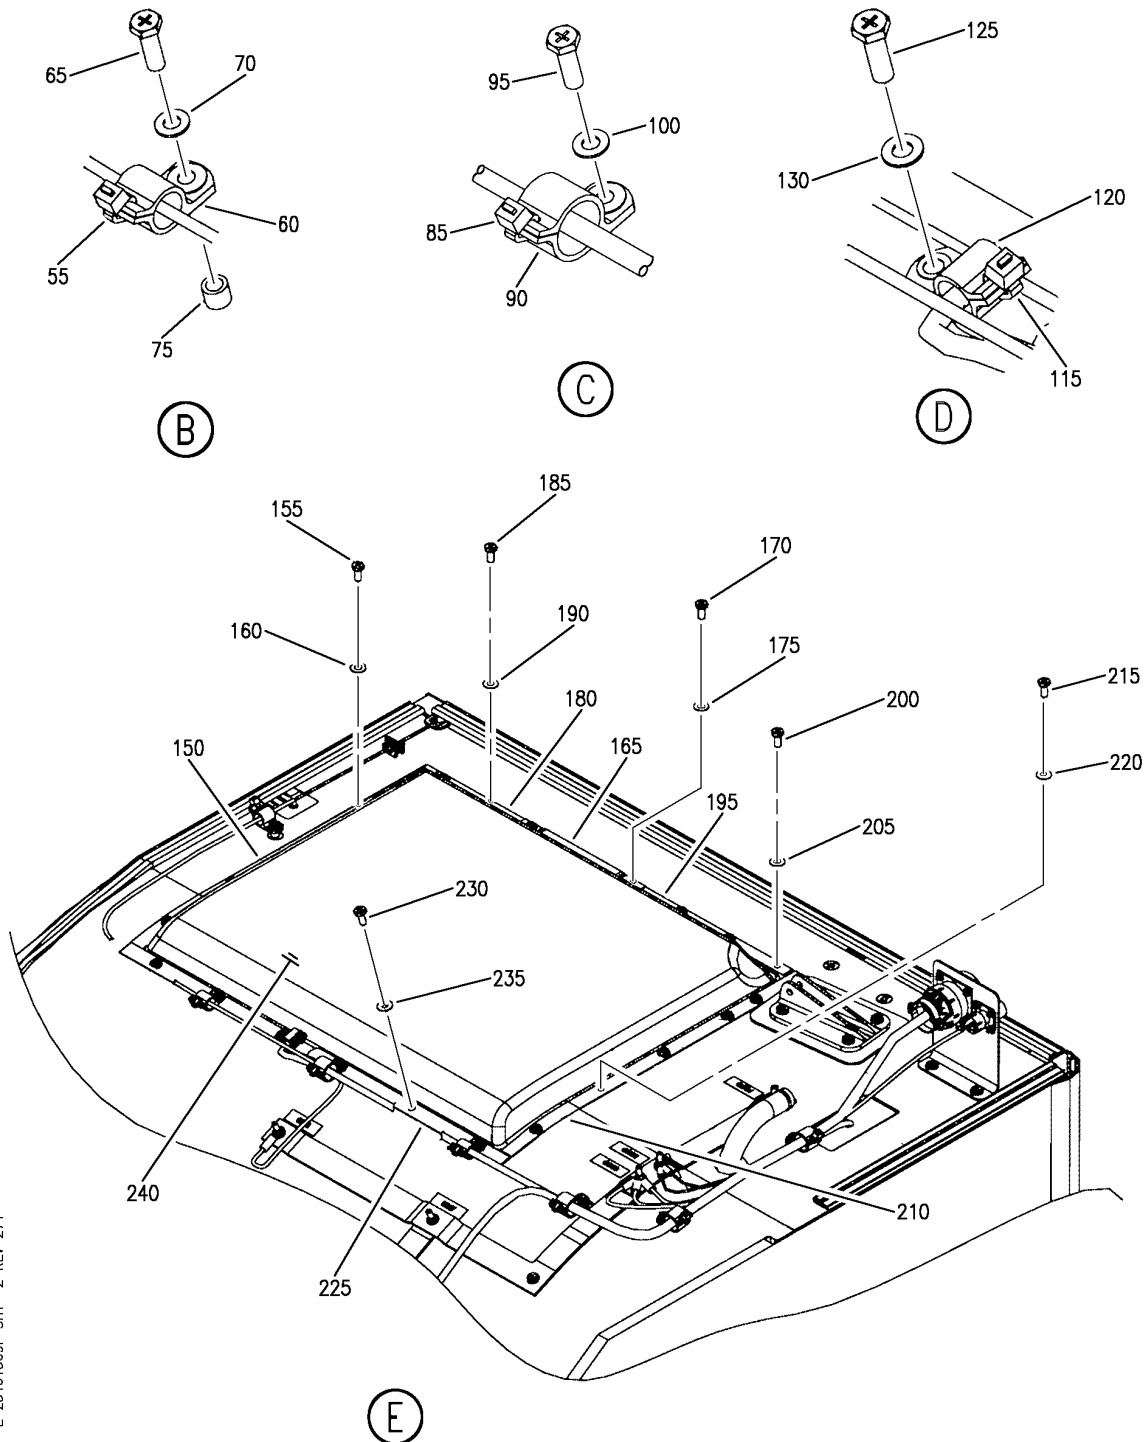

E 25401509F SHT 2 REV 271

MODULE ASSY-LAV E (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 9F (SHEET 2)


**25-40-15-09F**

R/YR  
AUG 15/19


25-40-15-09F  
PAGE 0A

ECCN 9E991 BOEING PROPRIETARY - See title page for details.


**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

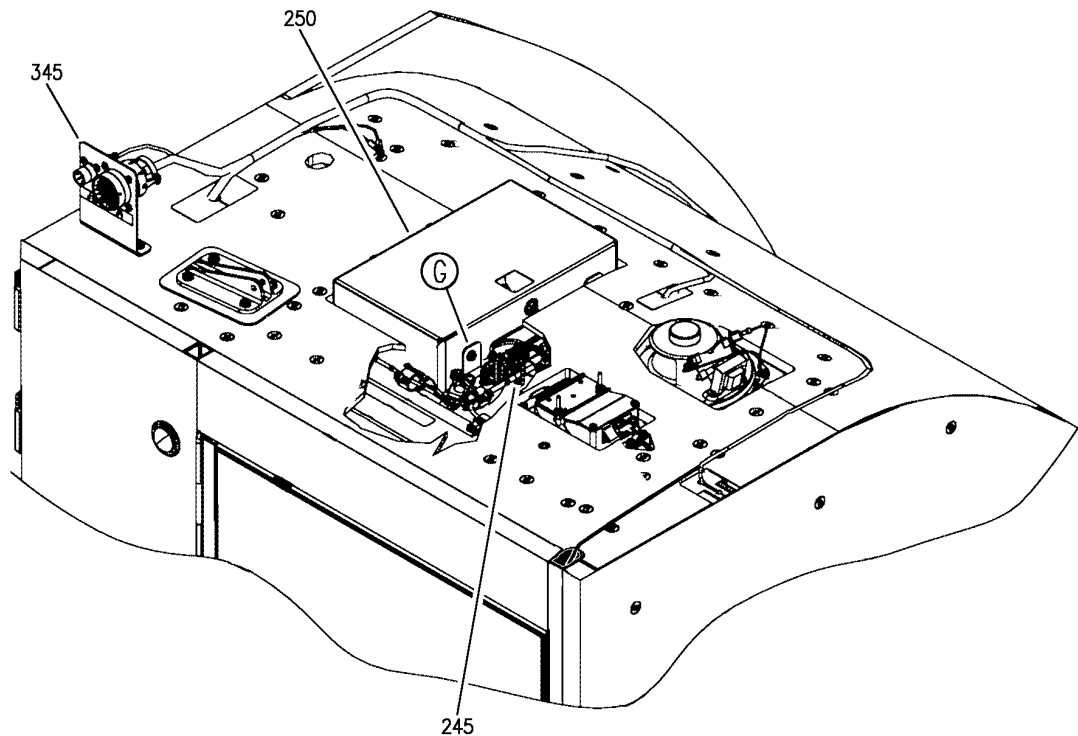

(F)

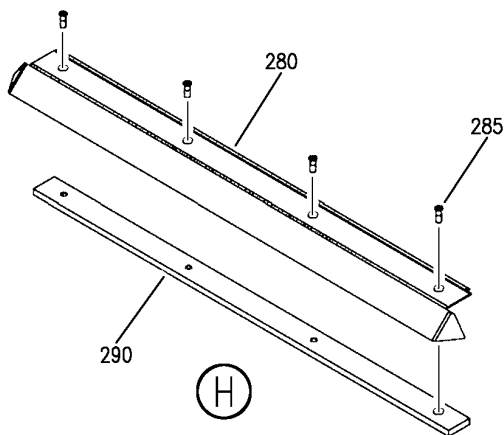

(H)

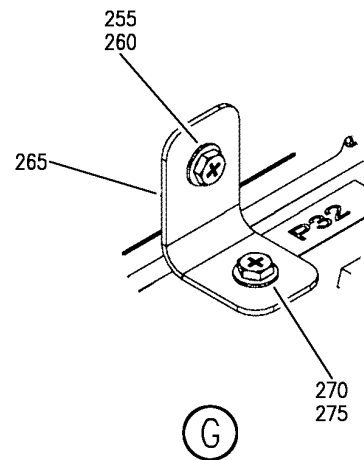

(G)

E 25401509F SHT 3 REV 243

MODULE ASSY-LAV E (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 9F (SHEET 3)

**25-40-15-09F**


R Y R  
AUG 15/19

25-40-15-09F  
PAGE 0B

ECCN 9E991 BOEING PROPRIETARY - See title page for details.



**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

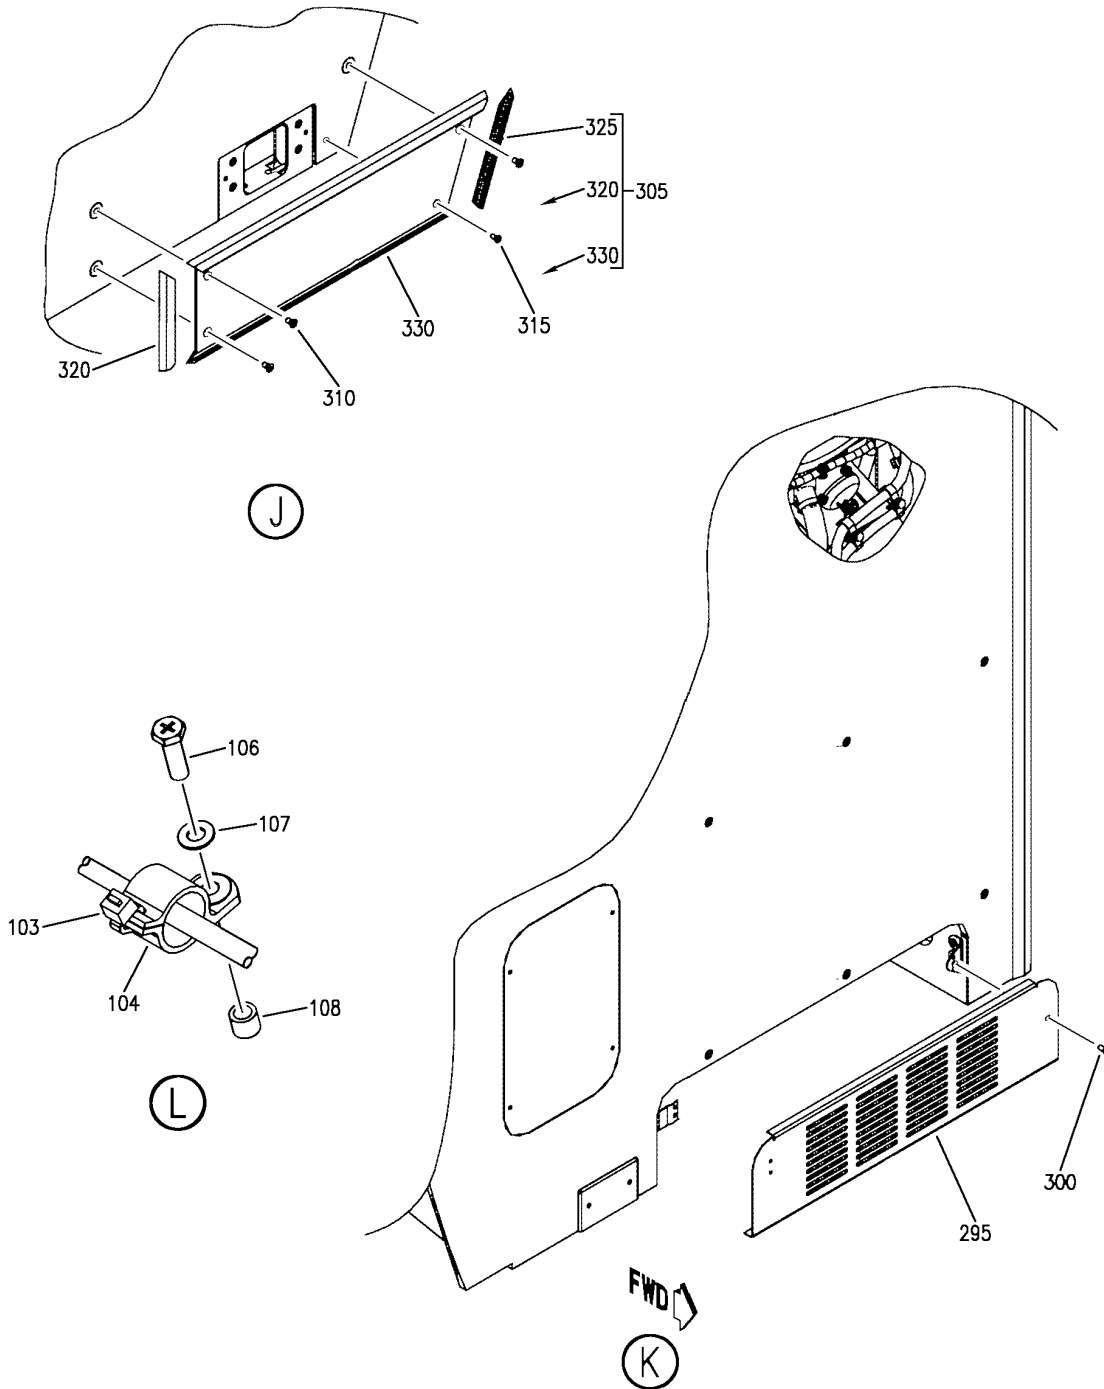

E 25401509F SHT 4 REV 271

MODULE ASSY-LAV E (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 9F (SHEET 4)

**25-40-15-09F**

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

R Y R  
AUG 15/19

25-40-15-09F  
PAGE 0C


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                                                                                                                                                                                 | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 9 F                                                     |                | MODULE ASSY-LAV E<br>(EQUIPMENT/FURNISHINGS<br>ONLY)                                                                                                                                                                                                                       | 417437            |                      |
| - 1                                                     | 1L300050-1241A | MODULE ASSY-LAV E<br>(EQUIPMENT/FURNISHINGS<br>ONLY)<br>SUPPLIER CODE:<br>V6S8D7<br>FUNCTIONAL DESCRIPTION:<br>PROVIDES LAVATORY<br>SERVICES<br>ELECTRICAL EQUIP NUMBER:<br>M01419<br>COMPONENT MAINT MANUAL REF:<br>25-40-44<br>FOR NHA/OTHER SYS DET SEE:<br>25-40-15-01 | 417437            | RF                   |
| - 50                                                    | 9L500001-106   | .CLAMP INSTL-ELECTRICAL<br>SUPPLIER CODE:<br>V6S8D7                                                                                                                                                                                                                        | 417437            | 1                    |
| 55                                                      | MS3367-5-9     | ..STRAP<br>STANDARD SUBSTITUTION:<br>BACS38K5                                                                                                                                                                                                                              | 417437            | 1                    |
| 60                                                      | CA2030-2       | ..CLAMP-<br>SUPPLIER CODE:<br>V03296<br>ATTACHING PARTS                                                                                                                                                                                                                    | 417437            | 1                    |
| 65                                                      | NAS1801-3-10   | ..SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-10                                                                                                                                                                                                                          | 417437            | 1                    |
| 70                                                      | NAS1149D0316K  | ..WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J                                                                                                                                                                                                                        | 417437            | 1                    |
| 75                                                      | NAS43DD3-16N   | ..SPACER<br>STANDARD SUBSTITUTION:<br>NAS43DD3-16FC<br>-----*-----                                                                                                                                                                                                         | 417437            | 1                    |
| - 80                                                    | 9L500001-107   | .CLAMP INSTL-ELECTRICAL<br>SUPPLIER CODE:<br>V6S8D7<br>CONFIG CHG DATA FROM A CMM:<br>SUPSD BY 9L500001-103                                                                                                                                                                | 417437            | 1                    |
| - 80                                                    | 9L500001-103   | .CLAMP INSTL-ELECTRICAL<br>SUPPLIER CODE:<br>V6S8D7<br>CONFIG CHG DATA FROM A CMM:<br>SUPERSEDES 9L500001-107                                                                                                                                                              | 417437            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |                                                                                                                                                                                                                                                                            |                   |                      |

- ITEM NOT ILLUSTRATED

RYR

25-40-15-09F

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-15  
 FIG. 09F  
 PAGE 1  
 APR 15/23


**BOEING**  
**737-600/700/800/900**  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER   | 1 2 3 4 5 6 7 | NOMENCLATURE                                                                                              | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|---------------|---------------|-----------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 9F                                                      |               |               |                                                                                                           |                   |                      |
| 85                                                      | MS3367-5-9    | ..            | STRAP<br>STANDARD SUBSTITUTION:<br>BACS38K5                                                               | 417437            | 1                    |
| 90                                                      | CA2030-3      | ..            | CLAMP-<br>SUPPLIER CODE:<br>V03296<br>ATTACHING PARTS                                                     | 417437            | 1                    |
| 95                                                      | NAS1801-3-10  | ..            | SCREW-<br>STANDARD SUBSTITUTION:<br>BACS12HN3-10<br>CONFIG CHG DATA FROM A CMM:<br>SUPSD BY NAS1801-3-6   | 417437            | 1                    |
| 95                                                      | NAS1801-3-6   | ..            | SCREW-<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6<br>CONFIG CHG DATA FROM A CMM:<br>SUPERSEDES NAS1801-3-10 | 417437            | 1                    |
| 100                                                     | NAS1149D0316K | ..            | WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J                                                         | 417437            | 1                    |
| - 101                                                   | NAS43DD3-16N  | ..            | SPACER-<br>STANDARD SUBSTITUTION:<br>NAS43DD3-16FC<br>USED ON:<br>9L500001-107<br>-----*-----             | 417437            | 1                    |
| - 102                                                   | 9L500001-106  | .CLAMP        | INSTL-ELECTTRICAL<br>SUPPLIER CODE:<br>V6S8D7<br>CONFIG CHG DATA FROM A CMM:<br>SUPSD BY 9L500001-107     | 417437            | 1                    |
| - 102                                                   | 9L500001-107  | .CLAMP        | INSTL-ELECTTRICAL<br>SUPPLIER CODE:<br>V6S8D7<br>CONFIG CHG DATA FROM A CMM:<br>SUPERSEDES 9L500001-106   | 417437            | 1                    |
| 103                                                     | MS3367-5-9    | ..            | STRAP<br>STANDARD SUBSTITUTION:<br>BACS38K5                                                               | 417437            | 1                    |
| 104                                                     | CA2030-2      | ..            | CLAMP-<br>SUPPLIER CODE:<br>V03296<br>CONFIG CHG DATA FROM A CMM:<br>SUPSD BY CA2030-3                    | 417437            | 1                    |
| 104                                                     | CA2030-3      | ..            | CLAMP-<br>SUPPLIER CODE:<br>V03296<br>CONFIG CHG DATA FROM A CMM:<br>SUPERSEDES CA2030-2                  | 417437            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |               |               |                                                                                                           |                   |                      |

- ITEM NOT ILLUSTRATED

R Y R

25-40-15-09F

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-15  
 FIG. 09F  
 PAGE 2  
 APR 15/23


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER   | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                                 | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|---------------|----------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 9F                                                      |               | ATTACHING PARTS                                                                                                            |                   |                      |
| 106                                                     | NAS1801-3-10  | ..SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-10                                                                          | 417437            | 1                    |
| 107                                                     | NAS1149D0316K | ..WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J                                                                        | 417437            | 1                    |
| 108                                                     | NAS43DD3-16N  | ..SPACER<br>STANDARD SUBSTITUTION:<br>NAS43DD3-16FC                                                                        | 417437            | 1                    |
| - 110                                                   | 9L500001-102  | -----*-----<br>.CLAMP INSTL-ELECTRICAL<br>SUPPLIER CODE:<br>V6S8D7<br>CONFIG CHG DATA FROM A CMM:<br>SUPSD BY 9L500001-103 | 417437            | 1                    |
| - 110                                                   | 9L500001-103  | .CLAMP INSTL-ELECTRICAL<br>SUPPLIER CODE:<br>V6S8D7<br>CONFIG CHG DATA FROM A CMM:<br>SUPERSEDES 9L500001-102              | 417437            | 1                    |
| 115                                                     | MS3367-5-9    | ..STRAP<br>STANDARD SUBSTITUTION:<br>BACS38K5                                                                              | 417437            | 1                    |
| 120                                                     | CA2030-2      | ..CLAMP-<br>SUPPLIER CODE:<br>V03296<br>CONFIG CHG DATA FROM A CMM:<br>SUPSD BY CA2030-3                                   | 417437            | 1                    |
| 120                                                     | CA2030-3      | ..CLAMP-<br>SUPPLIER CODE:<br>V03296<br>CONFIG CHG DATA FROM A CMM:<br>SUPERSEDES CA2030-2                                 | 417437            | 1                    |
| 125                                                     | NAS1801-3-6   | ATTACHING PARTS<br>..SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                                                        | 417437            | 1                    |
| 130                                                     | NAS1149D0316K | ..WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J                                                                        | 417437            | 1                    |
| 135                                                     | 1L500409-795  | -----*-----<br>.STRAP-FIRE BLANKET<br>SUPPLIER CODE:<br>V6S8D7                                                             | 417437            | 1                    |
| 140                                                     | NAS1801-3-6   | ATTACHING PARTS<br>.SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                                                         | 417437            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |               |                                                                                                                            |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R

25-40-15-09F

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-15  
FIG. 09F  
PAGE 3  
APR 15/23


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER   | 1 2 3 4 5 6 7 | NOMENCLATURE                                                        | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|---------------|---------------|---------------------------------------------------------------------|-------------------|----------------------|
| 9F                                                      |               |               |                                                                     |                   |                      |
| 145                                                     | NAS1149D0316K |               | . WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J<br>-----*-----  | 417437            | 1                    |
| 150                                                     | 1L500409-781  |               | . STRAP-FIRE BLANKET<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS | 417437            | 1                    |
| 155                                                     | NAS1801-3-6   |               | . SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                    | 417437            | 5                    |
| 160                                                     | NAS1149D0316K |               | . WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J<br>-----*-----  | 417437            | 5                    |
| 165                                                     | 1L500409-791  |               | . STRAP-FIRE BLANKET<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS | 417437            | 1                    |
| 170                                                     | NAS1801-3-6   |               | . SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                    | 417437            | 2                    |
| 175                                                     | NAS1149D0316K |               | . WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J<br>-----*-----  | 417437            | 2                    |
| 180                                                     | 1L500409-723  |               | . STRAP-FIRE BLANKET<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS | 417437            | 1                    |
| 185                                                     | NAS1801-3-6   |               | . SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                    | 417437            | 2                    |
| 190                                                     | NAS1149D0316K |               | . WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J<br>-----*-----  | 417437            | 2                    |
| 195                                                     | 1L500409-721  |               | . STRAP-FIRE BLANKET<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS | 417437            | 1                    |
| 200                                                     | NAS1801-3-6   |               | . SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                    | 417437            | 3                    |
| 205                                                     | NAS1149D0316K |               | . WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J<br>-----*-----  | 417437            | 3                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |               |               |                                                                     |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R

25-40-15-09F

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-15  
 FIG. 09F  
 PAGE 4  
 APR 15/23


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER   | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                                                                                                                                                                                                                           | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|---------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 9F                                                      |               |                                                                                                                                                                                                                                                                                                                      |                   |                      |
| 210                                                     | 1L500409-787  | .STRAP-FIRE BLANKET<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                                                                                                                                                                                                                                                   | 417437            | 1                    |
| 215                                                     | NAS1801-3-6   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                                                                                                                                                                                                                                                                      | 417437            | 5                    |
| 220                                                     | NAS1149D0316K | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J<br>-----*-----                                                                                                                                                                                                                                                    | 417437            | 5                    |
| 225                                                     | 1L500409-797  | .STRAP-FIRE BLANKET<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                                                                                                                                                                                                                                                   | 417437            | 1                    |
| 230                                                     | NAS1801-3-6   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                                                                                                                                                                                                                                                                      | 417437            | 1                    |
| 235                                                     | NAS1149D0316K | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J<br>-----*-----                                                                                                                                                                                                                                                    | 417437            | 1                    |
| 240                                                     | 1L500409-793  | .BLANKET-FIRE<br>SUPPLIER CODE:<br>V6S8D7                                                                                                                                                                                                                                                                            | 417437            | 1                    |
| 245                                                     | MS3367-5-9    | .STRAP<br>STANDARD SUBSTITUTION:<br>BACS38K5                                                                                                                                                                                                                                                                         | 417437            | AR                   |
| 250                                                     | 4576001-101   | .BOX ASSY-OXY<br>SUPPLIER CODE:<br>V16827<br>FUNCTIONAL DESCRIPTION:<br>STORES OXYGEN AND MASK<br>ASSEMBLIES. CONTROLS THE<br>DELIVERY OF OXYGEN TO<br>EACH MASK AND<br>COMMUNICATES WITH THE<br>AIRPLANE NETWORK.<br>COMPONENT MAINT MANUAL REF:<br>25-23-68<br>FOR DETAILS SEE:<br>35-21-00-01A<br>ATTACHING PARTS | 417437            | 1                    |
| 255                                                     | NAS1801-3-6   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                                                                                                                                                                                                                                                                      | 417437            | 4                    |
| 260                                                     | NAS1149D0332J | .WASHER<br>-----*-----                                                                                                                                                                                                                                                                                               | 417437            | 4                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |               |                                                                                                                                                                                                                                                                                                                      |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R

25-40-15-09F

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-15  
 FIG. 09F  
 PAGE 5  
 APR 15/23


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 | NOMENCLATURE                                                     | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|---------------|------------------------------------------------------------------|-------------------|----------------------|
| 9F                                                      |                |               |                                                                  |                   |                      |
| 265                                                     | 4L500403-17    |               | .ANGLE-<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS           | 417437            | 4                    |
| 270                                                     | NAS1801-3-6    |               | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                  | 417437            | 4                    |
| 275                                                     | NAS1149D0332J  |               | .WASHER<br>-----*-----                                           | 417437            | 4                    |
| 280                                                     | 1L500105-16    |               | .THRESHOLD-<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS       | 417437            | 1                    |
| 285                                                     | NAS8703A4      |               | .BOLT<br>STANDARD SUBSTITUTION:<br>BACB30ZE3K4<br>-----*-----    | 417437            | 4                    |
| 290                                                     | 1L500109-147   |               | .SPACER-THRESHOLD<br>SUPPLIER CODE:<br>V6S8D7                    | 417437            | 1                    |
| 295                                                     | 1L400040-42    |               | .COVER-TRASH TRAP<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS | 417437            | 1                    |
| 300                                                     | NAS8303-7      |               | .SCREW<br>-----*-----                                            | 417437            | 1                    |
| 305                                                     | 1L400109-404BA |               | .KICKSTRIP ASSY-<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS  | 417437            | 1                    |
| 310                                                     | NAS514P832-5   |               | .SCREW                                                           | 417437            | 3                    |
| 315                                                     | NAS514P632-5   |               | .SCREW<br>-----*-----                                            | 417437            | 1                    |
| 320                                                     | 1L500109-463BA |               | ..ENDCAP-<br>SUPPLIER CODE:<br>V6S8D7                            | 417437            | 1                    |
| 325                                                     | 1L500109-472BA |               | ..ENDCAP-<br>SUPPLIER CODE:<br>V6S8D7                            | 417437            | 1                    |
| 330                                                     | 1L500109-474BA |               | ..RETAINER-<br>SUPPLIER CODE:<br>V6S8D7                          | 417437            | 1                    |
| - 335                                                   | 1L360051-1241A |               | .LAVATORY ASSY-<br>SUPPLIER CODE:<br>V6S8D7                      | 417437            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |               |                                                                  |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R

25-40-15-09F

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-15  
FIG. 09F  
PAGE 6  
APR 15/23


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 | NOMENCLATURE                                                                        | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|---------------|-------------------------------------------------------------------------------------|-------------------|----------------------|
| 9 F                                                     |                |               |                                                                                     |                   |                      |
| 340                                                     | 1L306051-155CH |               | ..STRUCTURE INSTL-<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-40-15-12N  | 417437            | 1                    |
| 345                                                     | 3L306050-111   |               | ..ELECTRICAL INSTL-<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-40-15-55C | 417437            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |               |                                                                                     |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R


25-40-15-09F

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

25-40-15  
 FIG. 09F  
 PAGE 7  
 FEB 15/19



**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

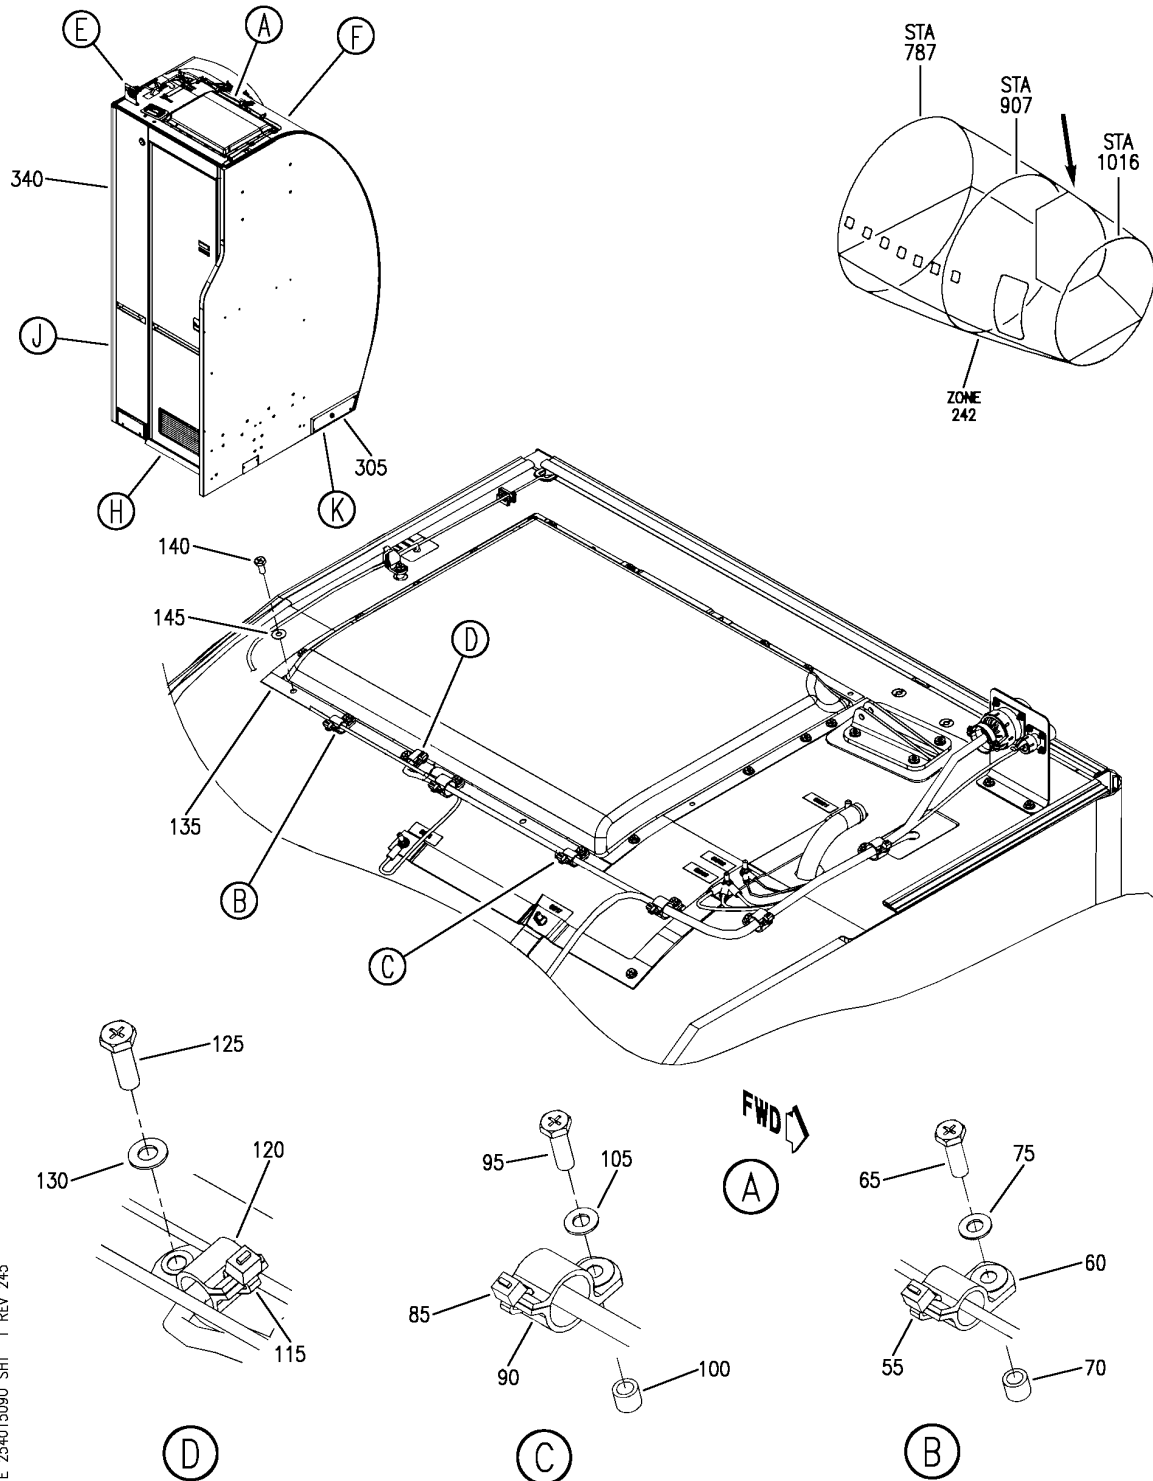

E 25401509U SHT 1 REV 245

MODULE ASSY-LAV E (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 9U (SHEET 1)


**25-40-15-09U**

RJR  
DEC 15/16

25-40-15-09U  
PAGE 0

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

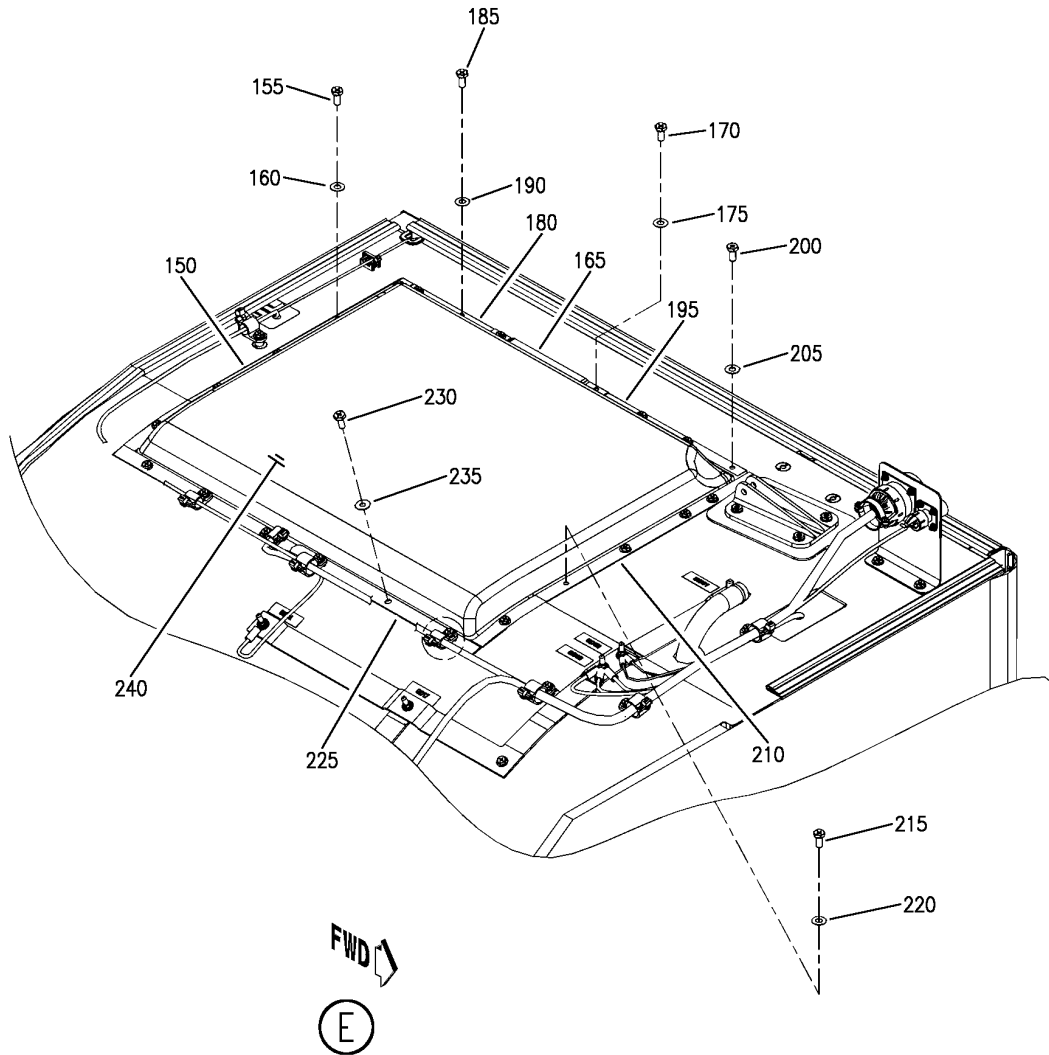

E 25401509U SHT 2 REV 245

MODULE ASSY-LAV E (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 9U (SHEET 2)


**25-40-15-09U**

RJR  
DEC 15/16


25-40-15-09U  
PAGE 0A

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

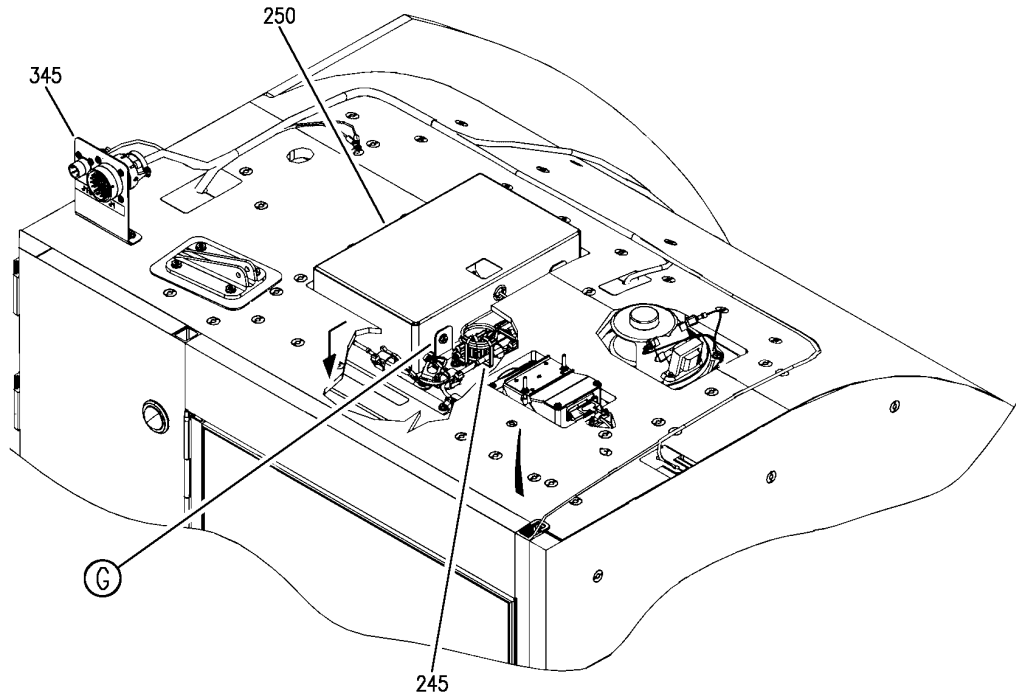

(F)

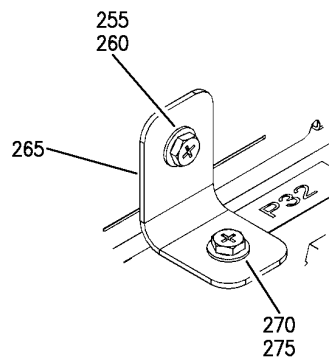

(G)

E 25401509U SHT 3 REV 245

MODULE ASSY-LAV E (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 9U (SHEET 3)


**25-40-15-09U**

R Y R  
DEC 15/16

25-40-15-09U  
PAGE 0B

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

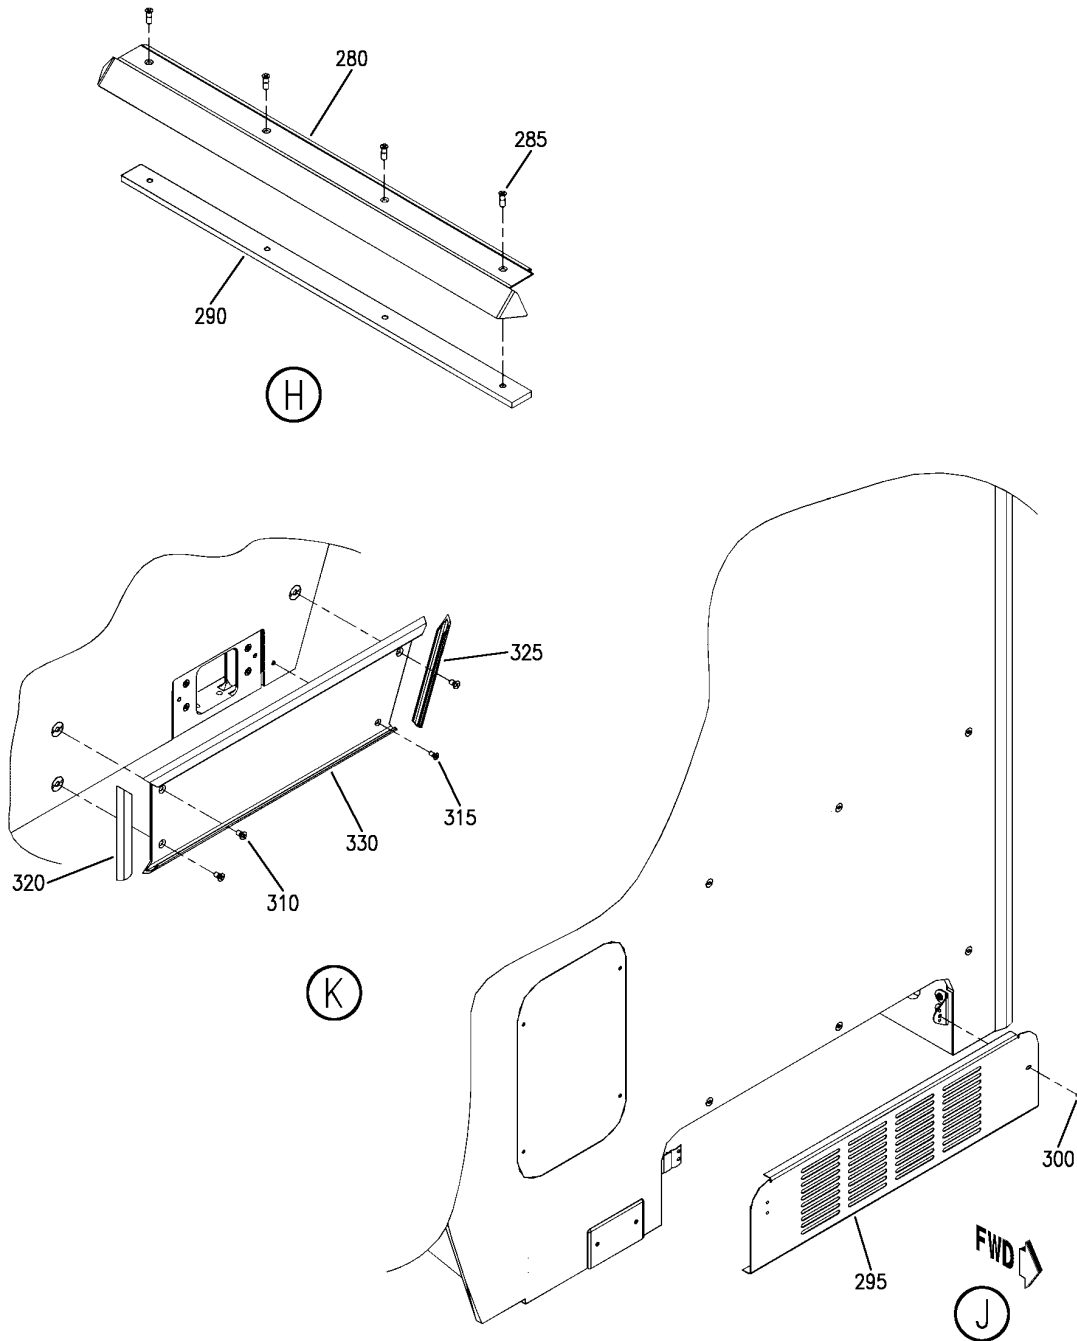

E 25401509U SHT 4 REV 245

MODULE ASSY-LAV E (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 9U (SHEET 4)

**25-40-15-09U**

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

R/YR  
DEC 15/16

25-40-15-09U  
PAGE 0C


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                                                                                                                                                                                 | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 9U                                                      |                | MODULE ASSY-LAV E<br>(EQUIPMENT/FURNISHINGS<br>ONLY)                                                                                                                                                                                                                       | 438459            |                      |
| - 1                                                     | 1L300050-1241B | MODULE ASSY-LAV E<br>(EQUIPMENT/FURNISHINGS<br>ONLY)<br>SUPPLIER CODE:<br>V6S8D7<br>FUNCTIONAL DESCRIPTION:<br>PROVIDES LAVATORY<br>SERVICES<br>ELECTRICAL EQUIP NUMBER:<br>M01419<br>COMPONENT MAINT MANUAL REF:<br>25-40-44<br>FOR NHA/OTHER SYS DET SEE:<br>25-40-15-01 | 438459            | RF                   |
| - 50                                                    | 9L500001-106   | .CLAMP INSTL-ELECTRICAL<br>SUPPLIER CODE:<br>V6S8D7                                                                                                                                                                                                                        | 438459            | 1                    |
| 55                                                      | MS3367-5-9     | ..STRAP<br>STANDARD SUBSTITUTION:<br>BACS38K5                                                                                                                                                                                                                              | 438459            | 1                    |
| 60                                                      | CA2030-2       | ..CLAMP-<br>SUPPLIER CODE:<br>V03296<br>ATTACHING PARTS                                                                                                                                                                                                                    | 438459            | 1                    |
| 65                                                      | NAS1801-3-10   | ..SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-10                                                                                                                                                                                                                          | 438459            | 1                    |
| 70                                                      | NAS43DD3-16N   | ..SPACER<br>STANDARD SUBSTITUTION:<br>NAS43DD3-16FC                                                                                                                                                                                                                        | 438459            | 1                    |
| 75                                                      | NAS1149D0316K  | ..WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J<br>-----*-----                                                                                                                                                                                                         | 438459            | 1                    |
| - 80                                                    | 9L500001-107   | .CLAMP INSTL-ELECTRICAL<br>SUPPLIER CODE:<br>V6S8D7                                                                                                                                                                                                                        | 438459            | 1                    |
| 85                                                      | MS3367-5-9     | ..STRAP<br>STANDARD SUBSTITUTION:<br>BACS38K5                                                                                                                                                                                                                              | 438459            | 1                    |
| 90                                                      | CA2030-3       | ..CLAMP-<br>SUPPLIER CODE:<br>V03296                                                                                                                                                                                                                                       | 438459            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |                                                                                                                                                                                                                                                                            |                   |                      |

- ITEM NOT ILLUSTRATED

RYR

25-40-15-09U

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-15  
FIG. 09U  
PAGE 1  
APR 15/23


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER   | 1 2 3 4 5 6 7 | NOMENCLATURE                                      | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|---------------|---------------|---------------------------------------------------|-------------------|----------------------|
| 9U                                                      |               |               | ATTACHING PARTS                                   |                   |                      |
| 95                                                      | NAS1801-3-10  | ..            | SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-10   | 438459            | 1                    |
| 100                                                     | NAS43DD3-16N  | ..            | SPACER<br>STANDARD SUBSTITUTION:<br>NAS43DD3-16FC | 438459            | 1                    |
| 105                                                     | NAS1149D0316K | ..            | WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J | 438459            | 1                    |
|                                                         |               |               | -----*-----                                       |                   |                      |
| - 110                                                   | 9L500001-103  | .CLAMP        | INSTL-ELECTRICAL<br>SUPPLIER CODE:<br>V6S8D7      | 438459            | 2                    |
| 115                                                     | MS3367-5-9    | ..            | STRAP<br>STANDARD SUBSTITUTION:<br>BACS38K5       | 438459            | 1                    |
| 120                                                     | CA2030-3      | ..            | CLAMP-<br>SUPPLIER CODE:<br>V03296                | 438459            | 1                    |
|                                                         |               |               | ATTACHING PARTS                                   |                   |                      |
| 125                                                     | NAS1801-3-6   | ..            | SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6    | 438459            | 1                    |
| 130                                                     | NAS1149D0316K | ..            | WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J | 438459            | 1                    |
|                                                         |               |               | -----*-----                                       |                   |                      |
| 135                                                     | 1L500409-795  | .STRAP-FIRE   | BLANKET<br>SUPPLIER CODE:<br>V6S8D7               | 438459            | 1                    |
|                                                         |               |               | ATTACHING PARTS                                   |                   |                      |
| 140                                                     | NAS1801-3-6   | .SCREW        | STANDARD SUBSTITUTION:<br>BACS12HN3-6             | 438459            | 1                    |
| 145                                                     | NAS1149D0316K | .WASHER       | STANDARD SUBSTITUTION:<br>NAS1149D0316J           | 438459            | 1                    |
|                                                         |               |               | -----*-----                                       |                   |                      |
| 150                                                     | 1L500409-781  | .STRAP-FIRE   | BLANKET<br>SUPPLIER CODE:<br>V6S8D7               | 438459            | 1                    |
|                                                         |               |               | ATTACHING PARTS                                   |                   |                      |
| 155                                                     | NAS1801-3-6   | .SCREW        | STANDARD SUBSTITUTION:<br>BACS12HN3-6             | 438459            | 5                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |               |               |                                                   |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R

25-40-15-09U

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-15  
 FIG. 09U  
 PAGE 2  
 APR 15/23


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER   | 1 2 3 4 5 6 7 | NOMENCLATURE                                                      | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|---------------|---------------|-------------------------------------------------------------------|-------------------|----------------------|
| 9U<br>160                                               | NAS1149D0316K | .             | WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J<br>-----*-----  | 438459            | 5                    |
| 165                                                     | 1L500409-791  | .             | STRAP-FIRE BLANKET<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS | 438459            | 1                    |
| 170                                                     | NAS1801-3-6   | .             | SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                    | 438459            | 2                    |
| 175                                                     | NAS1149D0316K | .             | WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J<br>-----*-----  | 438459            | 2                    |
| 180                                                     | 1L500409-723  | .             | STRAP-FIRE BLANKET<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS | 438459            | 1                    |
| 185                                                     | NAS1801-3-6   | .             | SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                    | 438459            | 2                    |
| 190                                                     | NAS1149D0316K | .             | WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J<br>-----*-----  | 438459            | 2                    |
| 195                                                     | 1L500409-721  | .             | STRAP-FIRE BLANKET<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS | 438459            | 1                    |
| 200                                                     | NAS1801-3-6   | .             | SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                    | 438459            | 3                    |
| 205                                                     | NAS1149D0316K | .             | WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J<br>-----*-----  | 438459            | 3                    |
| 210                                                     | 1L500409-787  | .             | STRAP-FIRE BLANKET<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS | 438459            | 1                    |
| 215                                                     | NAS1801-3-6   | .             | SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                    | 438459            | 5                    |
| 220                                                     | NAS1149D0316K | .             | WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J<br>-----*-----  | 438459            | 5                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |               |               |                                                                   |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R

25-40-15-09U

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-15  
 FIG. 09U  
 PAGE 3  
 APR 15/23


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER   | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                                                                                                                                                                                                                           | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|---------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 9U                                                      |               |                                                                                                                                                                                                                                                                                                                      |                   |                      |
| 225                                                     | 1L500409-797  | .STRAP-FIRE BLANKET<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                                                                                                                                                                                                                                                   | 438459            | 1                    |
| 230                                                     | NAS1801-3-6   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                                                                                                                                                                                                                                                                      | 438459            | 1                    |
| 235                                                     | NAS1149D0316K | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J<br>-----*-----                                                                                                                                                                                                                                                    | 438459            | 1                    |
| 240                                                     | 1L500409-793  | .BLANKET-FIRE<br>SUPPLIER CODE:<br>V6S8D7                                                                                                                                                                                                                                                                            | 438459            | 1                    |
| 245                                                     | MS3367-5-9    | .STRAP<br>STANDARD SUBSTITUTION:<br>BACS38K5                                                                                                                                                                                                                                                                         | 438459            | AR                   |
| 250                                                     | 4576001-101   | .BOX ASSY-OXY<br>SUPPLIER CODE:<br>V16827<br>FUNCTIONAL DESCRIPTION:<br>STORES OXYGEN AND MASK<br>ASSEMBLIES. CONTROLS THE<br>DELIVERY OF OXYGEN TO<br>EACH MASK AND<br>COMMUNICATES WITH THE<br>AIRPLANE NETWORK.<br>COMPONENT MAINT MANUAL REF:<br>25-23-68<br>FOR DETAILS SEE:<br>35-21-00-01A<br>ATTACHING PARTS | 438459            | 1                    |
| 255                                                     | NAS1801-3-6   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                                                                                                                                                                                                                                                                      | 438459            | 4                    |
| 260                                                     | NAS1149D0332J | .WASHER<br>-----*-----                                                                                                                                                                                                                                                                                               | 438459            | 4                    |
| 265                                                     | 4L500403-17   | .ANGLE-<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                                                                                                                                                                                                                                                               | 438459            | 4                    |
| 270                                                     | NAS1801-3-6   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                                                                                                                                                                                                                                                                      | 438459            | 4                    |
| 275                                                     | NAS1149D0332J | .WASHER<br>-----*-----                                                                                                                                                                                                                                                                                               | 438459            | 4                    |
| 280                                                     | 1L500105-16   | .THRESHOLD-<br>SUPPLIER CODE:<br>V6S8D7                                                                                                                                                                                                                                                                              | 438459            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |               |                                                                                                                                                                                                                                                                                                                      |                   |                      |

— ITEM NOT ILLUSTRATED

RYR

25-40-15-09U

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-15  
 FIG. 09U  
 PAGE 4  
 APR 15/23




**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 NOMENCLATURE                                                                | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|-------------------------------------------------------------------------------------------|-------------------|----------------------|
| 9U                                                      |                |                                                                                           |                   |                      |
| 285                                                     | NAS8703A4      | ATTACHING PARTS<br>.BOLT<br>STANDARD SUBSTITUTION:<br>BACB30ZE3K4<br>-----*-----          | 438459            | 4                    |
| 290                                                     | 1L500109-147   | .SPACER-THRESHOLD<br>SUPPLIER CODE:<br>V6S8D7                                             | 438459            | 1                    |
| 295                                                     | 1L400040-42    | .COVER-TRASH TRAP<br>SUPPLIER CODE:<br>V6S8D7                                             | 438459            | 1                    |
| 300                                                     | NAS8303-7      | ATTACHING PARTS<br>.SCREW<br>-----*-----                                                  | 438459            | 1                    |
| 305                                                     | 1L400109-404BA | .KICKSTRIP ASSY-<br>SUPPLIER CODE:<br>V6S8D7                                              | 438459            | 1                    |
| 310                                                     | NAS514P832-5   | ATTACHING PARTS<br>.SCREW                                                                 | 438459            | 3                    |
| 315                                                     | NAS514P632-5   | .SCREW<br>-----*-----                                                                     | 438459            | 1                    |
| 320                                                     | 1L500109-463BA | ..ENDCAP-<br>SUPPLIER CODE:<br>V6S8D7                                                     | 438459            | 1                    |
| 325                                                     | 1L500109-472BA | ..ENDCAP-<br>SUPPLIER CODE:<br>V6S8D7                                                     | 438459            | 1                    |
| 330                                                     | 1L500109-474BA | ..RETAINER-<br>SUPPLIER CODE:<br>V6S8D7                                                   | 438459            | 1                    |
| - 335                                                   | 1L360051-1241B | .LAVATORY ASSY-LAV E<br>SUPPLIER CODE:<br>V16827                                          | 438459            | 1                    |
| 340                                                     | 1L306051-155EE | ..STRUCTURE INSTL-<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-40-15-12S        | 438459            | 1                    |
| 345                                                     | 3L306050-111   | ..ELECTRICAL INSTL-STRUCT<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-40-15-55C | 438459            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |                                                                                           |                   |                      |

- ITEM NOT ILLUSTRATED


R Y R

25-40-15-09U

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-15  
FIG. 09U  
PAGE 5  
APR 15/23

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

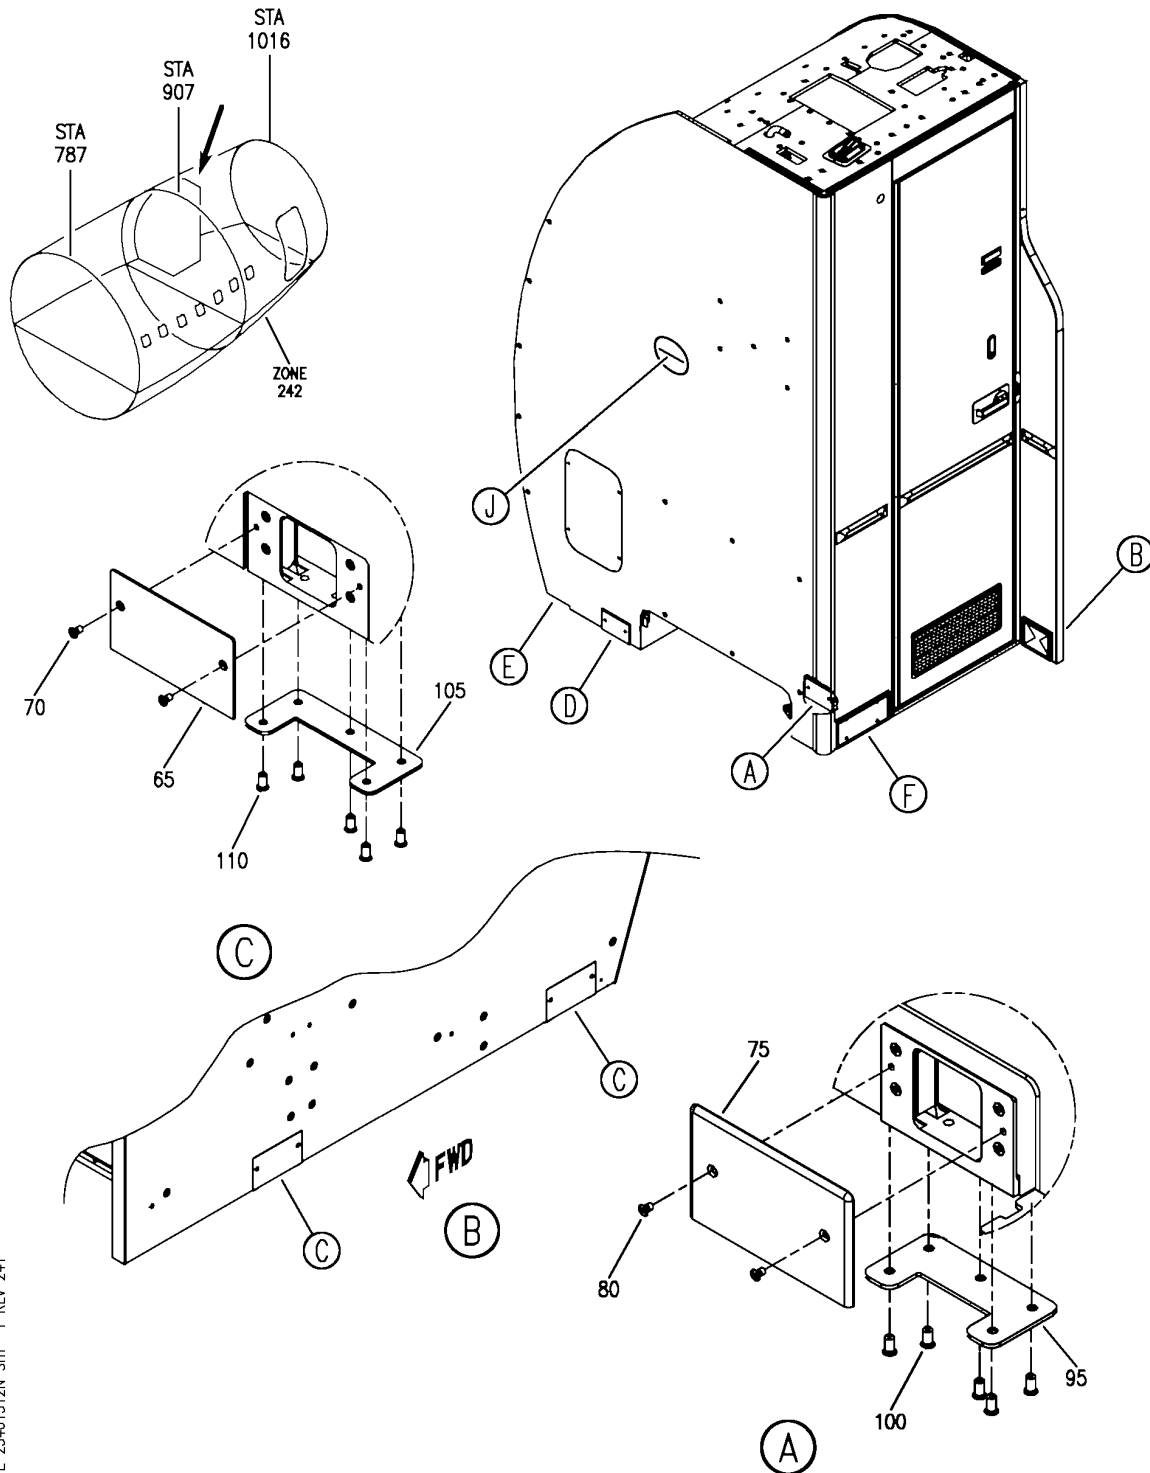

E 25401512N SHT 1 REV 241

STRUCTURE ASSY  
FIGURE 12N (SHEET 1)


**25-40-15-12N**

R Y R  
A P R 15 / 25

25-40-15-12N  
P A G E 0

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

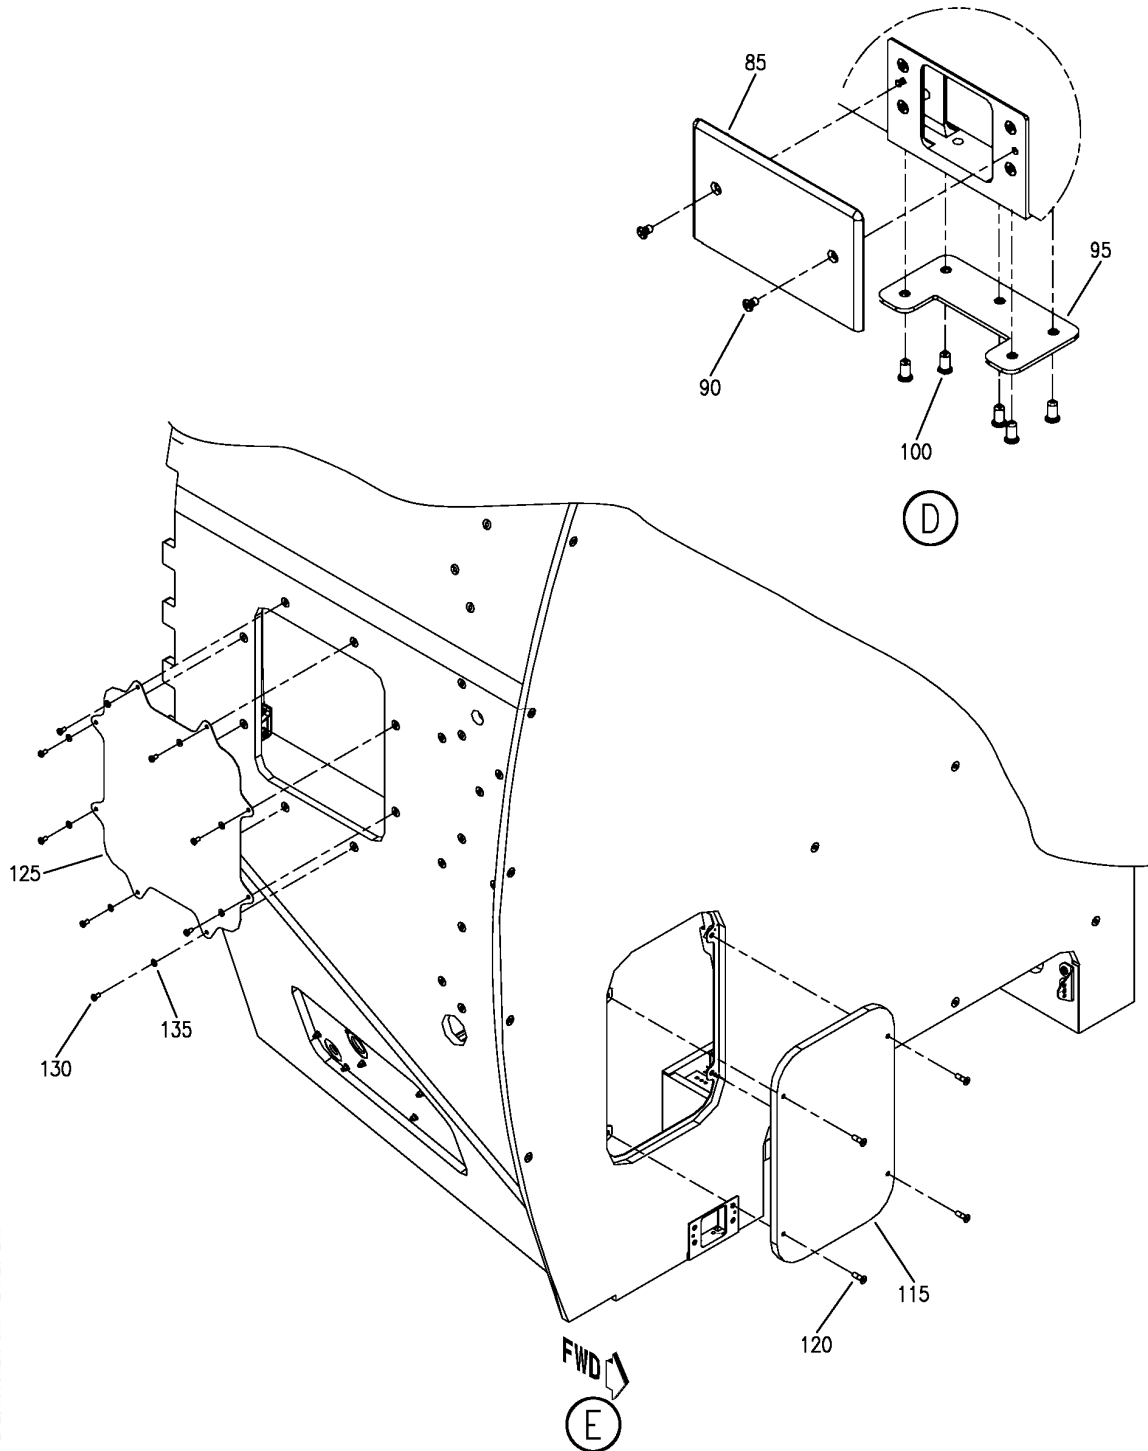

E 25401512N SHT 2 REV 241

STRUCTURE ASSY  
FIGURE 12N (SHEET 2)


**25-40-15-12N**

R Y R  
APR 15/25

25-40-15-12N  
PAGE 0A

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

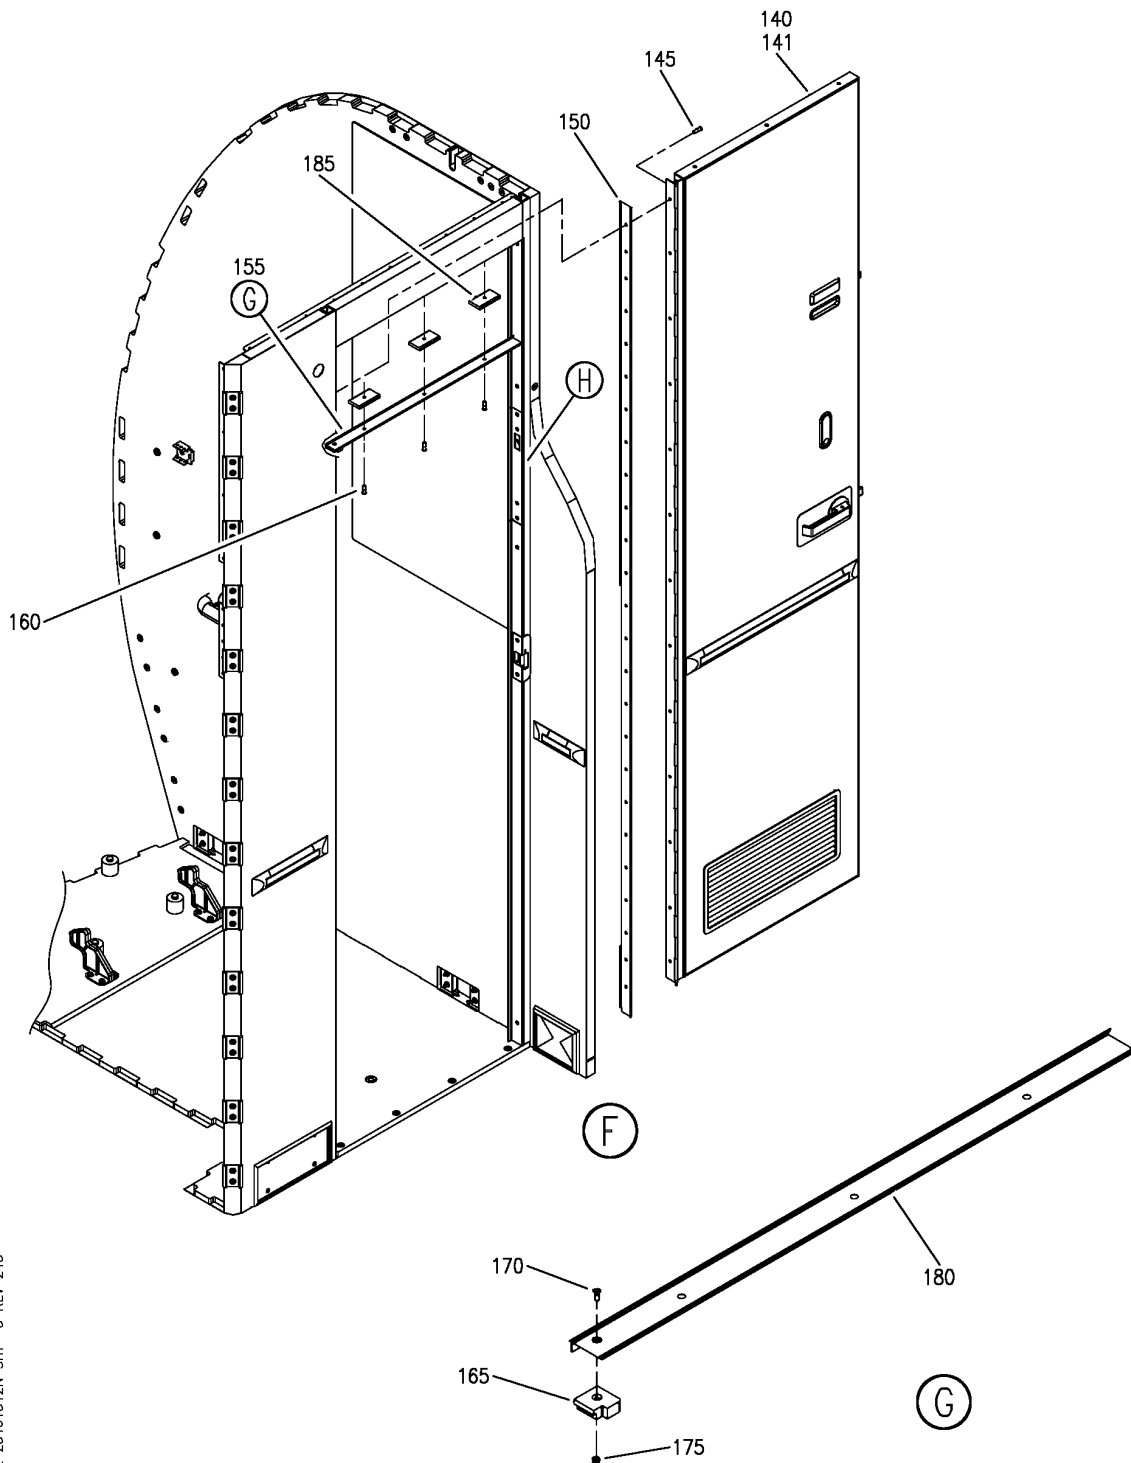

E 25401512N SHT 3 REV 243

STRUCTURE ASSY  
FIGURE 12N (SHEET 3)


**25-40-15-12N**

R/YR  
APR 15/25

25-40-15-12N  
PAGE 08

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

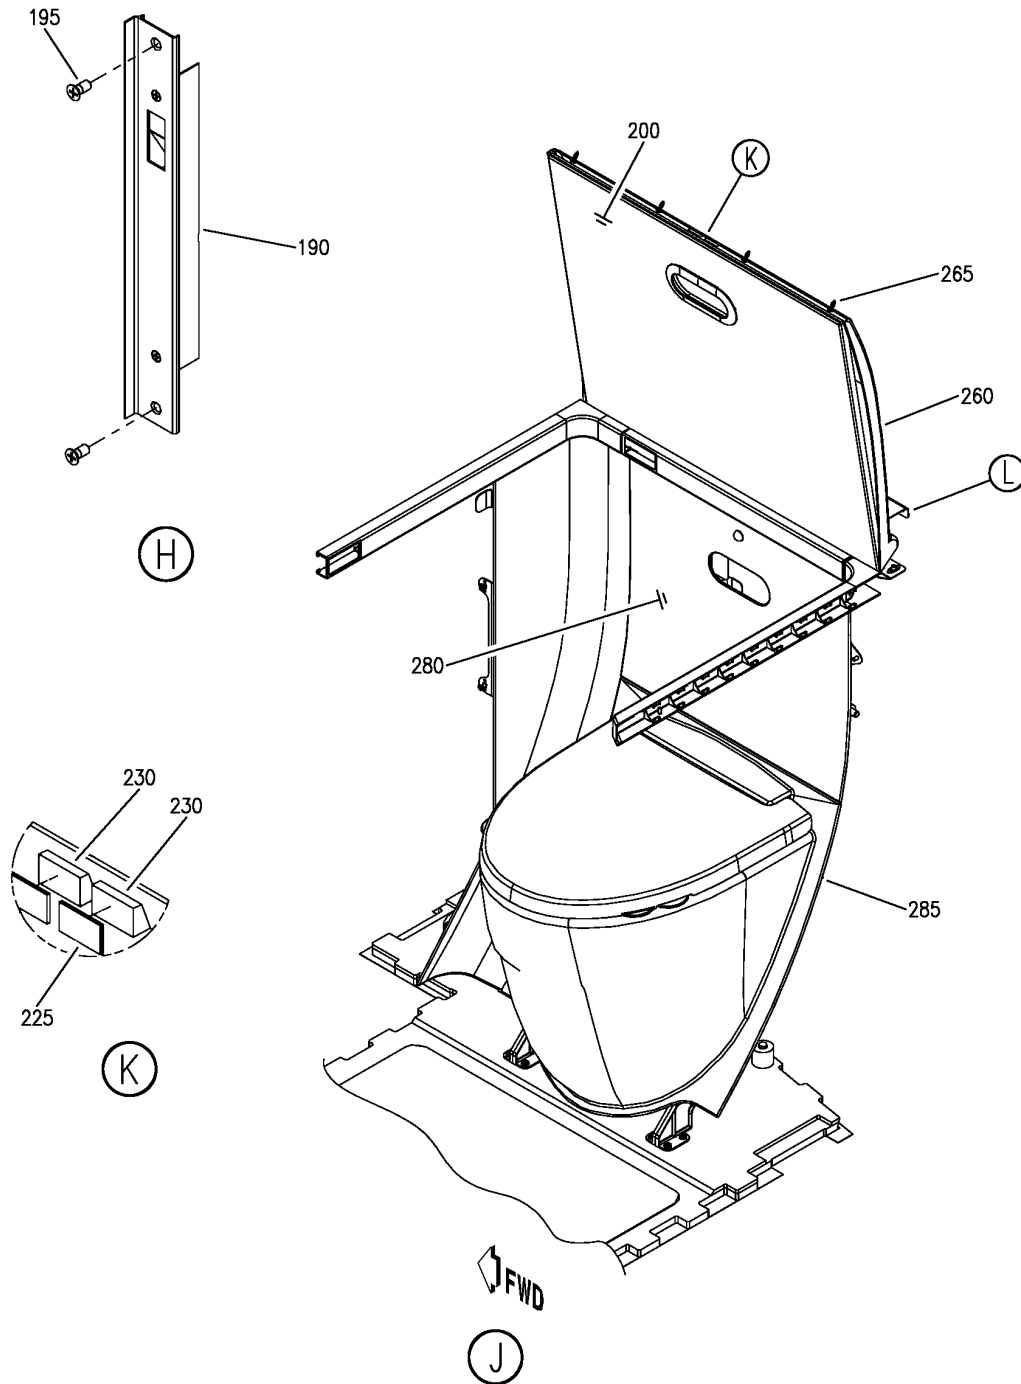

E 25401512N SHT 4 REV 241

STRUCTURE ASSY  
FIGURE 12N (SHEET 4)


**25-40-15-12N**

R Y R  
APR 15 / 25

25-40-15-12N  
PAGE 0C

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

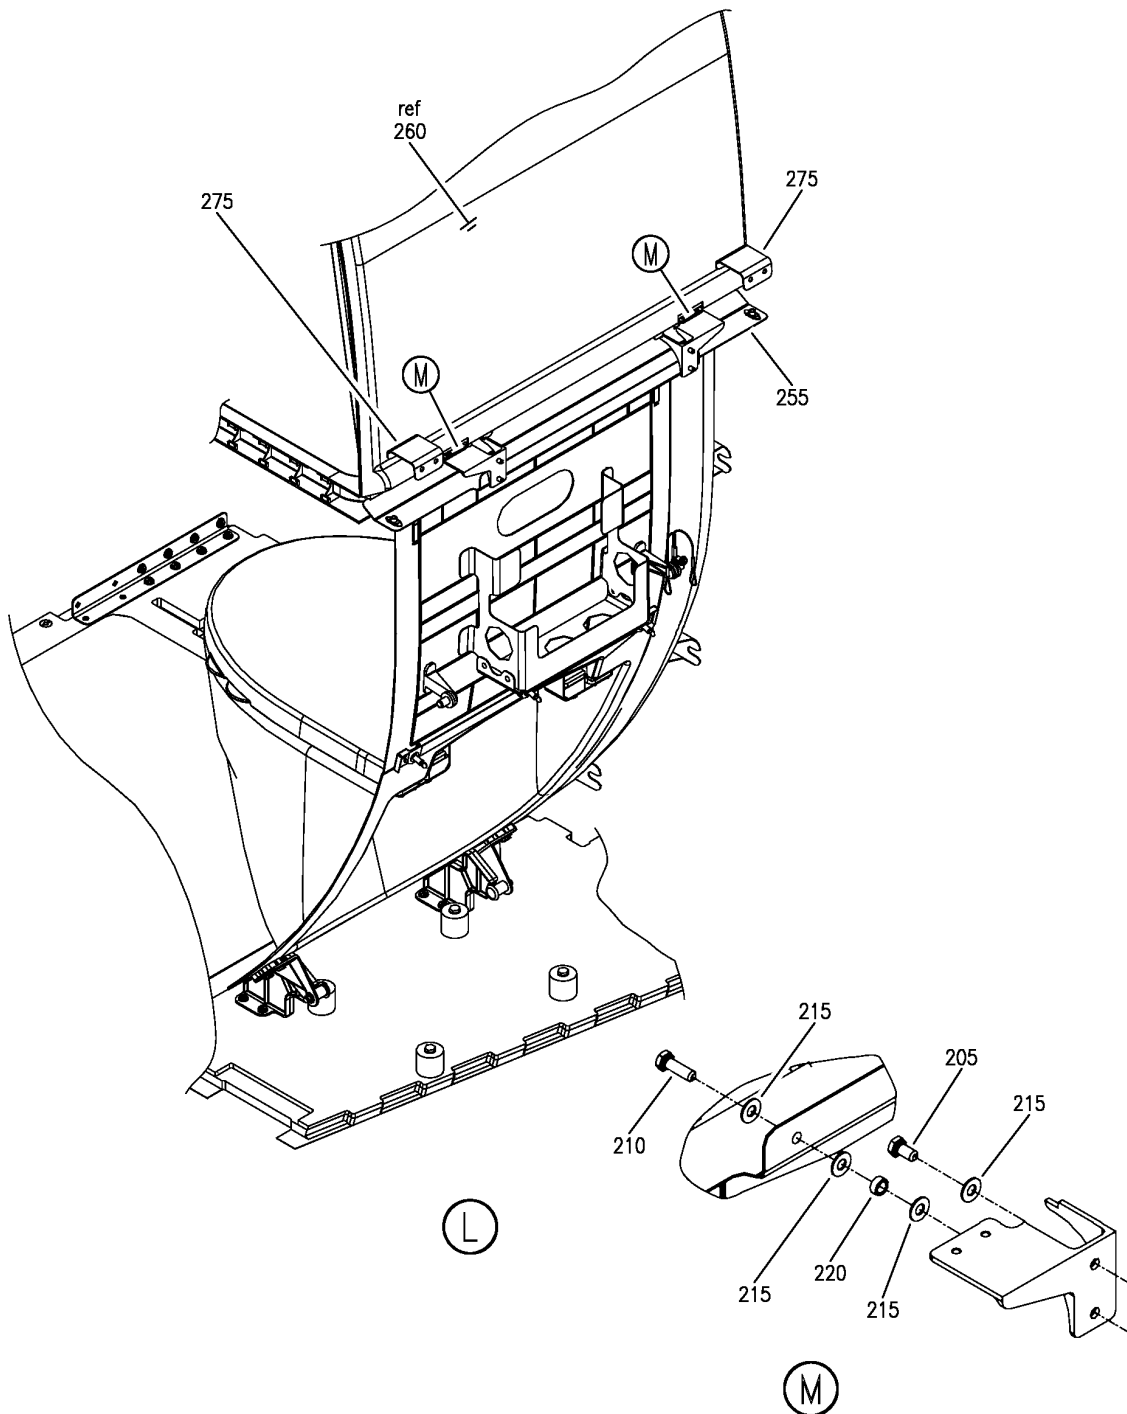

E 25401512N SHT 5 REV 345

STRUCTURE ASSY  
FIGURE 12N (SHEET 5)

**25-40-15-12N**

R Y R  
APR 15/25

25-40-15-12N  
PAGE 0D

ECCN 9E991 BOEING PROPRIETARY – See title page for details.


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER     | 1 2 3 4 5 6 7<br>NOMENCLATURE                                                                                                                                                                                                 | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|-----------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 12N                                                     |                 |                                                                                                                                                                                                                               |                   |                      |
| - 1                                                     | 1L306051-155CH  | STRUCTURE ASSY<br>STRUCTURE INSTL-LAV E<br>SUPPLIER CODE:<br>V6S8D7<br>FOR NHA SEE:<br>25-40-15-09F                                                                                                                           | 417437<br>417437  | RF                   |
| - 50                                                    | 1L306051-155CH1 | .STRUCTURE INSTL-<br>SUPPLIER CODE:<br>V6S8D7<br>MISCELLANEOUS DATA:<br>NON PROCURABLE<br>FUNCTIONAL REFERENCE:<br>EQUIPMENT/FURNISHINGS<br>FOR DETAILS SEE<br>25-41-51-04S<br>LIGHTS<br>FOR DETAILS SEE<br>33-26-03-18Y      | 417437            | RF                   |
| - 55                                                    | 1L306051-155CH2 | .STRUCTURE INSTL-<br>SUPPLIER CODE:<br>V6S8D7<br>MISCELLANEOUS DATA:<br>NON PROCURABLE<br>FUNCTIONAL REFERENCE:<br>EQUIPMENT/FURNISHINGS<br>FOR DETAILS SEE<br>25-40-15-55K<br>WATER/WASTE<br>FOR DETAILS SEE<br>38-11-51-15B | 417437            | RF                   |
| - 60                                                    | 1L306051-155CH3 | .STRUCTURE INSTL-<br>SUPPLIER CODE:<br>V6S8D7<br>MISCELLANEOUS DATA:<br>NON PROCURABLE<br>FOR DETAILS SEE:<br>25-40-15-55L                                                                                                    | 417437            | RF                   |
| 65                                                      | 1L500409-841CH  | .PLATE-COVER<br>SUPPLIER CODE:<br>V6S8D7<br>MISCELLANEOUS DATA:<br>BAC93319<br>ATTACHING PARTS                                                                                                                                | 417437            | 2                    |
| 70                                                      | NAS514P632-5    | .SCREW<br>-----*-----                                                                                                                                                                                                         | 417437            | 4                    |
| 75                                                      | 1L500409-263    | .PLATE-COVER<br>SUPPLIER CODE:<br>V6S8D7                                                                                                                                                                                      | 417437            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                 |                                                                                                                                                                                                                               |                   |                      |

— ITEM NOT ILLUSTRATED

RYR

25-40-15-12N

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

25-40-15  
FIG. 12N  
PAGE 1  
APR 15/25


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER   | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                                              | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|---------------|-----------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 12N                                                     |               |                                                                                                                                         |                   |                      |
| 80                                                      | NAS514P632-5  | ATTACHING PARTS<br>.SCREW<br>-----*-----                                                                                                | 417437            | 2                    |
| 85                                                      | 1L500409-313  | .PLATE-COVER<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS<br>.SCREW<br>-----*-----                                                    | 417437            | 1                    |
| 90                                                      | NAS514P632-5  | .PLATE-SHEAR<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS<br>.BOLT<br>-----*-----                                                     | 417437            | 2                    |
| 95                                                      | 1L500409-257  | .PLATE-SHEAR<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS<br>.BOLT<br>-----*-----                                                     | 417437            | 2                    |
| 100                                                     | BACB30VF3K1   | .BOLT<br>-----*-----                                                                                                                    | 417437            | 10                   |
| 105                                                     | 1L500409-253  | .PLATE-SHEAR<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS<br>.BOLT<br>-----*-----                                                     | 417437            | 2                    |
| 110                                                     | BACB30VF3K1   | .BOLT<br>-----*-----                                                                                                                    | 417437            | 10                   |
| 115                                                     | 1L500409-155  | .PANEL-<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS<br>.SCREW<br>STANDARD SUBSTITUTION:<br>BACB30LU3-5<br>BACB30LH3-5<br>-----*----- | 417437            | 1                    |
| 120                                                     | NAS517-3-5    | .SCREW<br>STANDARD SUBSTITUTION:<br>BACB30LU3-5<br>BACB30LH3-5<br>-----*-----                                                           | 417437            | 4                    |
| 125                                                     | 1L500407-211  | .PAN-COVER<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS<br>.SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6<br>-----*-----             | 417437            | 1                    |
| 130                                                     | NAS1801-3-6   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6<br>-----*-----                                                                          | 417437            | 8                    |
| 135                                                     | NAS1149D0332J | .WASHER<br>-----*-----                                                                                                                  | 417437            | 8                    |
| 140                                                     | 1L400105-34CH | .DOOR ASSY-<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-41-17-14F<br>ATTACHING PARTS<br>.BOLT<br>-----*-----                  | 417437            | 1                    |
| 145                                                     | NAS8603-4     | ATTACHING PARTS<br>.BOLT<br>-----*-----                                                                                                 | 417437            | 13                   |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |               |                                                                                                                                         |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R

25-40-15-12N

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-15  
FIG. 12N  
PAGE 2  
JUN 15/24




**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER  | 1 2 3 4 5 6 7 NOMENCLATURE                                                                           | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|--------------|------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 12N<br>150                                              | 1L500109-302 | .TRIM-EDGE<br>SUPPLIER CODE:<br>V6S8D7                                                               | 417437            | 1                    |
| 155                                                     | 1L500109-462 | .TRIM ASSY-DOOR<br>SUPPLIER CODE:<br>V6S8D7                                                          | 417437            | 1                    |
| 160                                                     | NAS8703A4    | ATTACHING PARTS<br>.BOLT<br>STANDARD SUBSTITUTION:<br>BACB30ZE3K4<br>-----*-----                     | 417437            | 3                    |
| 165                                                     | 1L500105-170 | ..BLOCK-CLOSE, OUT<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                                    | 417437            | 1                    |
| 170                                                     | NAS514P440-5 | ..SCREW                                                                                              | 417437            | 1                    |
| 175                                                     | MS21042-04   | ..NUT<br>STANDARD SUBSTITUTION:<br>MS21042L04<br>BACN11AG04<br>-----*-----                           | 417437            | 1                    |
| 180                                                     | 1L500109-460 | ..TRIM-OPENING<br>SUPPLIER CODE:<br>V6S8D7<br>CONFIG CHG DATA FROM A CMM:<br>SUPSD BY 1L500109-628   | 417437            | 1                    |
| 180                                                     | 1L500109-628 | ..TRIM-OPENING<br>SUPPLIER CODE:<br>V6S8D7<br>CONFIG CHG DATA FROM A CMM:<br>SUPERSEDES 1L500109-460 | 417437            | 1                    |
| 185                                                     | 1L500409-267 | .SPACER-BLOCK<br>SUPPLIER CODE:<br>V6S8D7                                                            | 417437            | 3                    |
| 190                                                     | 1L400109-94  | .SWITCH ASSY-<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>33-26-03-28P<br>ATTACHING PARTS     | 417437            | 1                    |
| 195                                                     | NAS8703A1    | .BOLT<br>STANDARD SUBSTITUTION:<br>BACB30ZE3K1<br>-----*-----                                        | 417437            | 2                    |
| 200                                                     | 1L460070-253 | .STATION ASSY-BABY CHANGING<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-41-52-02H          | 417437            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |              |                                                                                                      |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R

25-40-15-12N

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-15  
 FIG. 12N  
 PAGE 3  
 JUN 15/24


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER   | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                                                                      | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|---------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 12N                                                     |               |                                                                                                                                                                 |                   |                      |
| 205                                                     | NAS1801-3-6   | ATTACHING PARTS<br>.SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                                                                                              | 417437            | 2                    |
| 210                                                     | NAS1801-3-10  | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-10                                                                                                                | 417437            | 2                    |
| 215                                                     | NAS1149C0332R | .WASHER                                                                                                                                                         | 417437            | 8                    |
| 220                                                     | NAS43DD3-8N   | .SPACER<br>STANDARD SUBSTITUTION:<br>NAS43DD3-8FC<br>-----*-----                                                                                                | 417437            | 2                    |
| 225                                                     | 65PWF02       | .MAGNET-RECTANGULAR<br>SUPPLIER CODE:<br>V1B3S4<br>MISCELLANEOUS DATA:<br>ORDER LCCS7-2A                                                                        | 417437            | 2                    |
| 225                                                     | LCCS7-2A      | .MAGNET-RECTANGULAR<br>SUPPLIER CODE:<br>V6S8D7<br>TRUE PART NUMBER:<br>LCCS-7-2-A<br>MISCELLANEOUS DATA:<br>ADAMS MAGNETIC PRODUCTS<br>CO. PART NUMBER 65PWF02 | 417437            | 2                    |
| 230                                                     | 1L500411-67   | .SPACER-MAGNET<br>SUPPLIER CODE:<br>V6S8D7                                                                                                                      | 417437            | 2                    |
| - 235                                                   | 9L500001-310  | .MOUNTING INSTL-TIE<br>ELECTRICAL<br>SUPPLIER CODE:<br>V6S8D7                                                                                                   | 417437            | 1                    |
| - 240                                                   | MS3367-5-9    | ..STRAP<br>STANDARD SUBSTITUTION:<br>BACS38K5                                                                                                                   | 417437            | 1                    |
| - 245                                                   | TM3S10        | ..MOUNT-CABLE<br>SUPPLIER CODE:<br>V06383<br>ATTACHING PARTS                                                                                                    | 417437            | 1                    |
| - 250                                                   | NAS514P1032-8 | ..SCREW<br>-----*-----                                                                                                                                          | 417437            | 1                    |
| 255                                                     | 1L400100-103  | .SHIELD-TRAP<br>SUPPLIER CODE:<br>V6S8D7                                                                                                                        | 417437            | 1                    |
| 260                                                     | 1L400411-57   | .SHROUD-BABY CHANGING TABLE<br>SUPPLIER CODE:<br>V6S8D7                                                                                                         | 417437            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |               |                                                                                                                                                                 |                   |                      |

- ITEM NOT ILLUSTRATED

R Y R

25-40-15-12N

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-15  
FIG. 12N  
PAGE 4  
JUN 15/24


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER  | 1 2 3 4 5 6 7 | NOMENCLATURE                                                                                                                          | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|--------------|---------------|---------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 12N                                                     |              |               |                                                                                                                                       |                   |                      |
| 265                                                     | 09T203       |               | ATTACHING PARTS<br>.SCREW-<br>SUPPLIER CODE:<br>V94222<br>TRUE PART NUMBER:<br>09-T-203<br>-----*-----                                | 417437            | 4                    |
| - 270                                                   | BAC1521-827  |               | .SEAL-                                                                                                                                | 417437            | AR                   |
|                                                         |              |               | MISCELLANEOUS DATA:<br>ORDER LCSR000010                                                                                               |                   |                      |
| - 270                                                   | LCSR000010   |               | .SEAL-EXTRUDED SILICONE<br>RUBBER<br>SUPPLIER CODE:<br>V6S8D7<br>MISCELLANEOUS DATA:<br>THE BOEING COMPANY PART<br>NUMBER BAC1521-827 | 417437            | AR                   |
| 275                                                     | 1L500100-101 |               | .STABILIZER-BABY CHANGING<br>TABLE SHROUD<br>SUPPLIER CODE:<br>V6S8D7                                                                 | 417437            | 2                    |
| 280                                                     | 1L400407-53  |               | .FACE ASSY-SEAT COVER<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-41-21-18M                                                 | 417437            | 1                    |
| 285                                                     | 1L400407-51  |               | .SHROUD ASSY-TOILET LID<br>SEAT<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-41-21-18N                                       | 417437            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |              |               |                                                                                                                                       |                   |                      |

— ITEM NOT ILLUSTRATED


R Y R

25-40-15-12N

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-15  
 FIG. 12N  
 PAGE 5  
 APR 15/25

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

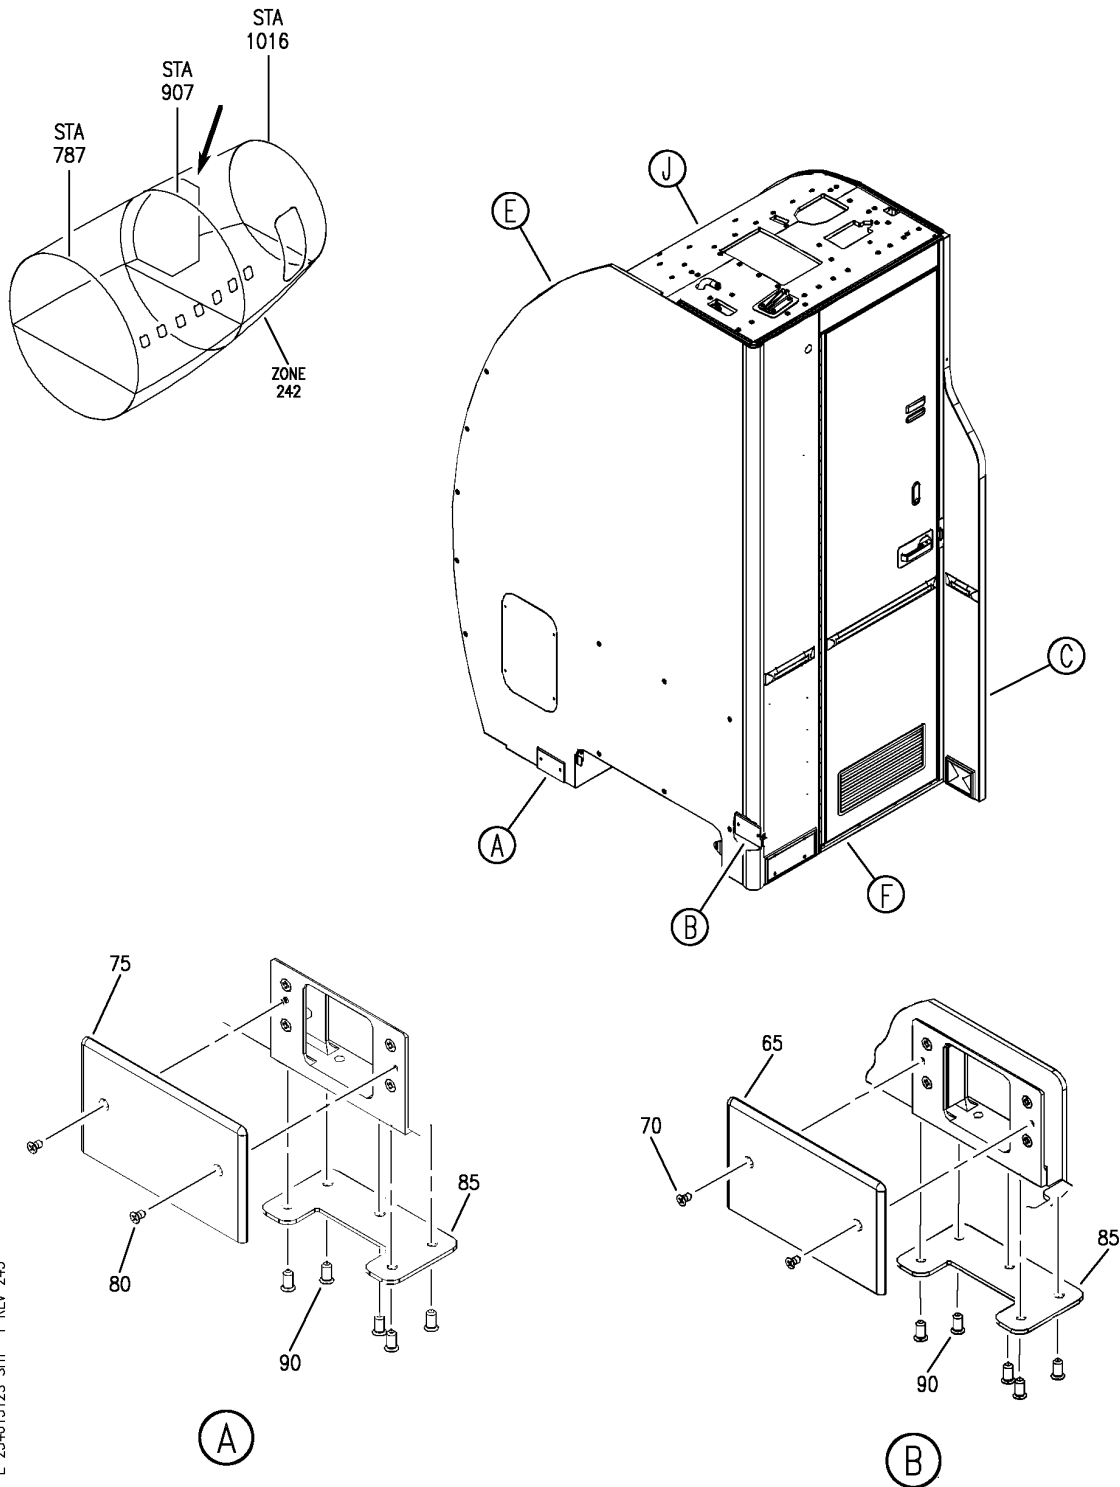

E 25401512S SHT 1 REV 245

STRUCTURE INSTL  
FIGURE 12S (SHEET 1)


**25-40-15-12S**

R Y R  
APR 15/25

25-40-15-12S  
PAGE 0

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

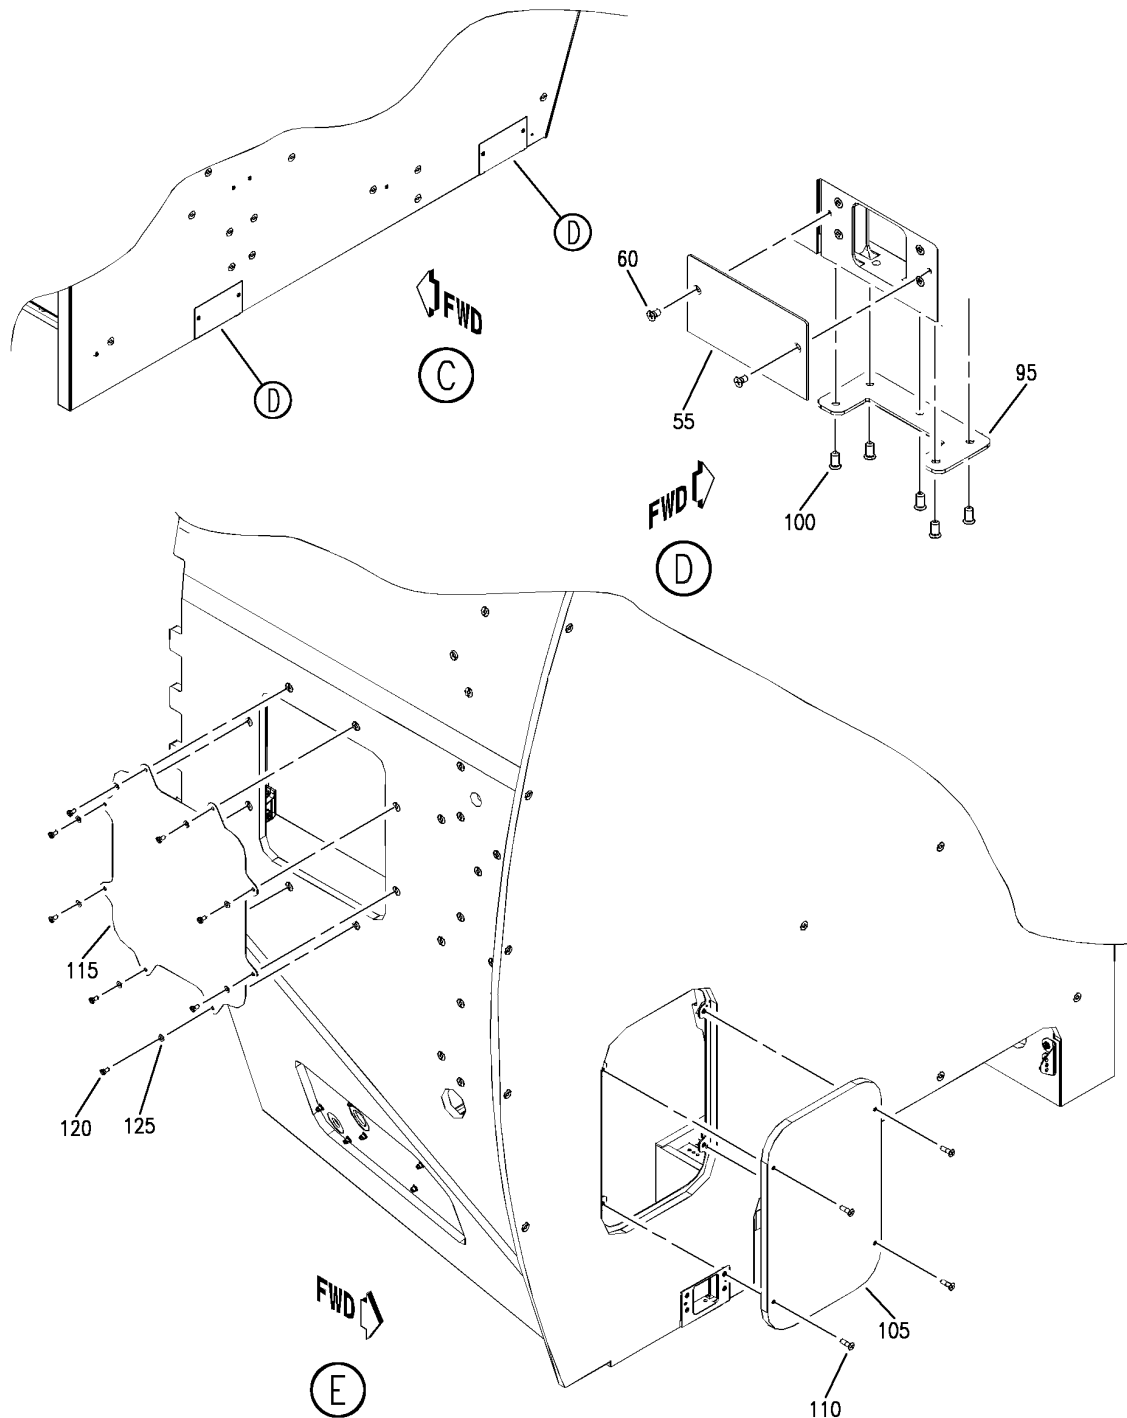

E 25401512S SHT 2 REV 245

STRUCTURE INSTL  
FIGURE 12S (SHEET 2)


**25-40-15-12S**

R/YR  
APR 15/25

25-40-15-12S  
PAGE 0A

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

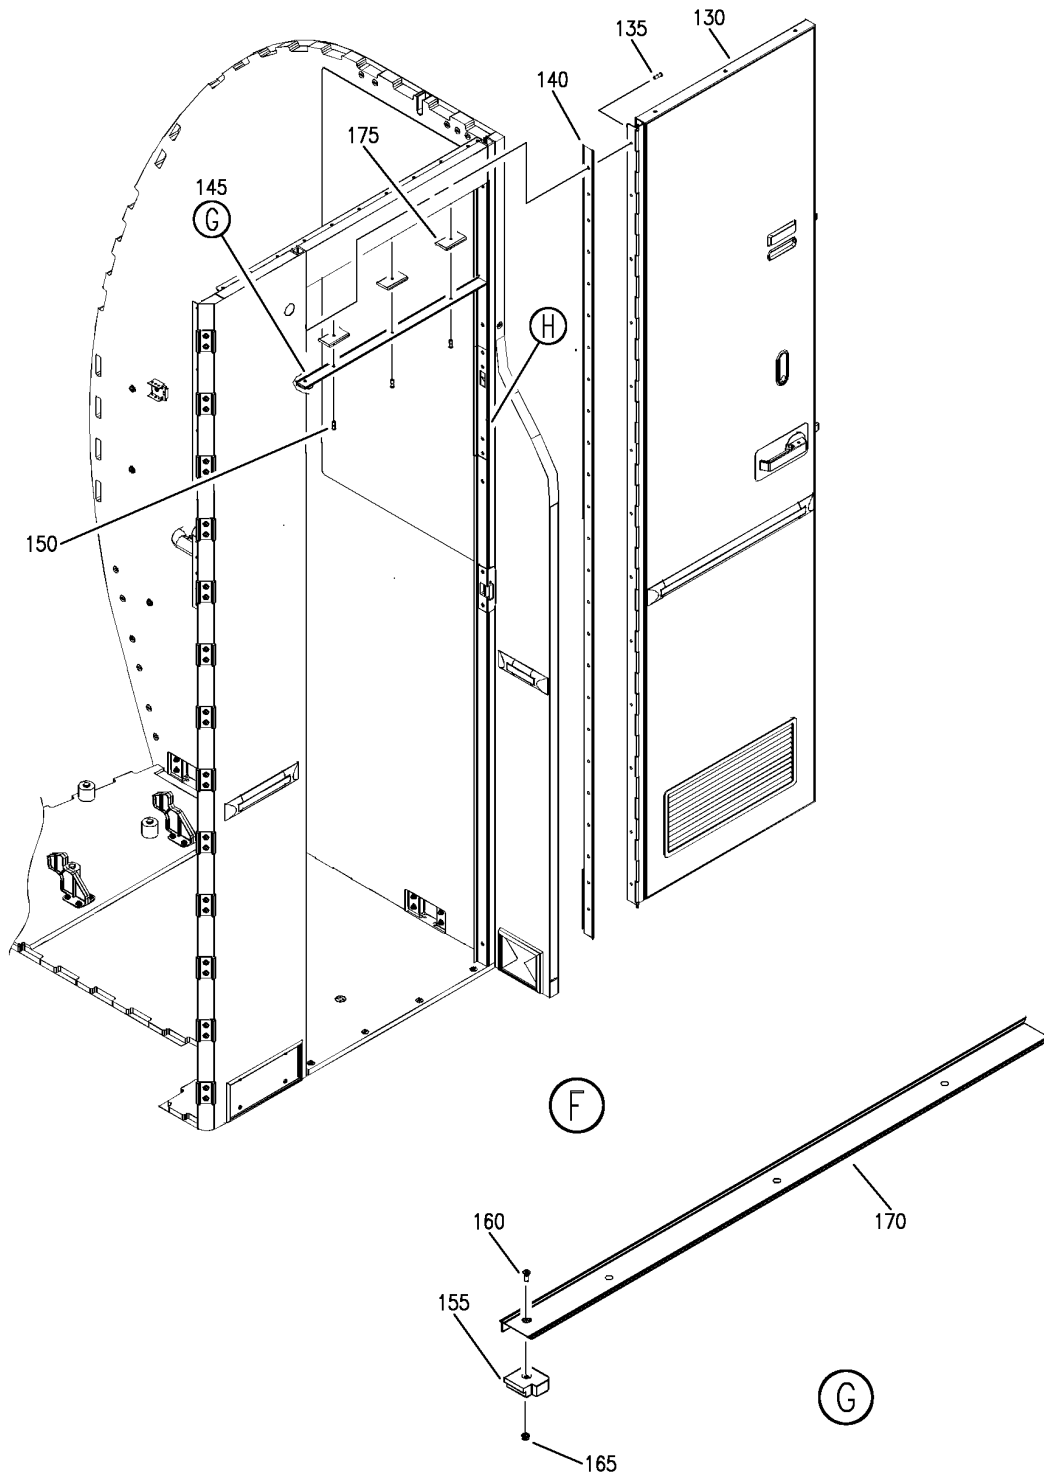

E 25401512S SHT 3 REV 245

STRUCTURE INSTL  
FIGURE 12S (SHEET 3)


**25-40-15-12S**

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

RJR  
APR 15/25

25-40-15-12S  
PAGE 0B

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

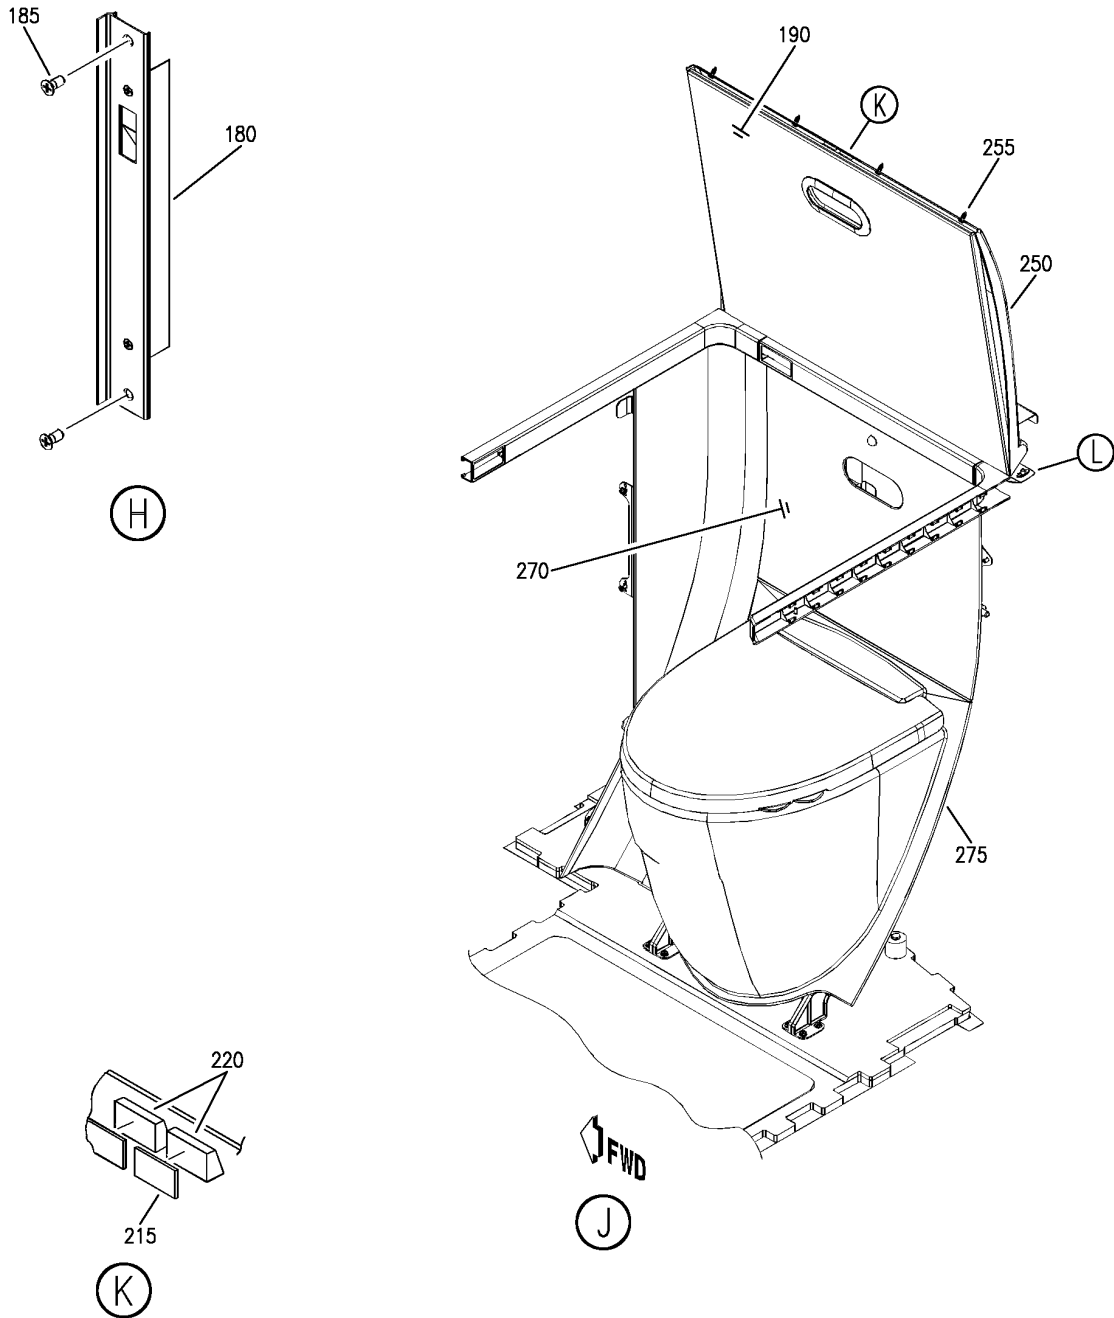

E 25401512S SHT 4 REV 245

STRUCTURE INSTL  
FIGURE 12S (SHEET 4)


**25-40-15-12S**

R Y R  
APR 15 / 25

25-40-15-12S  
PAGE 0C

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

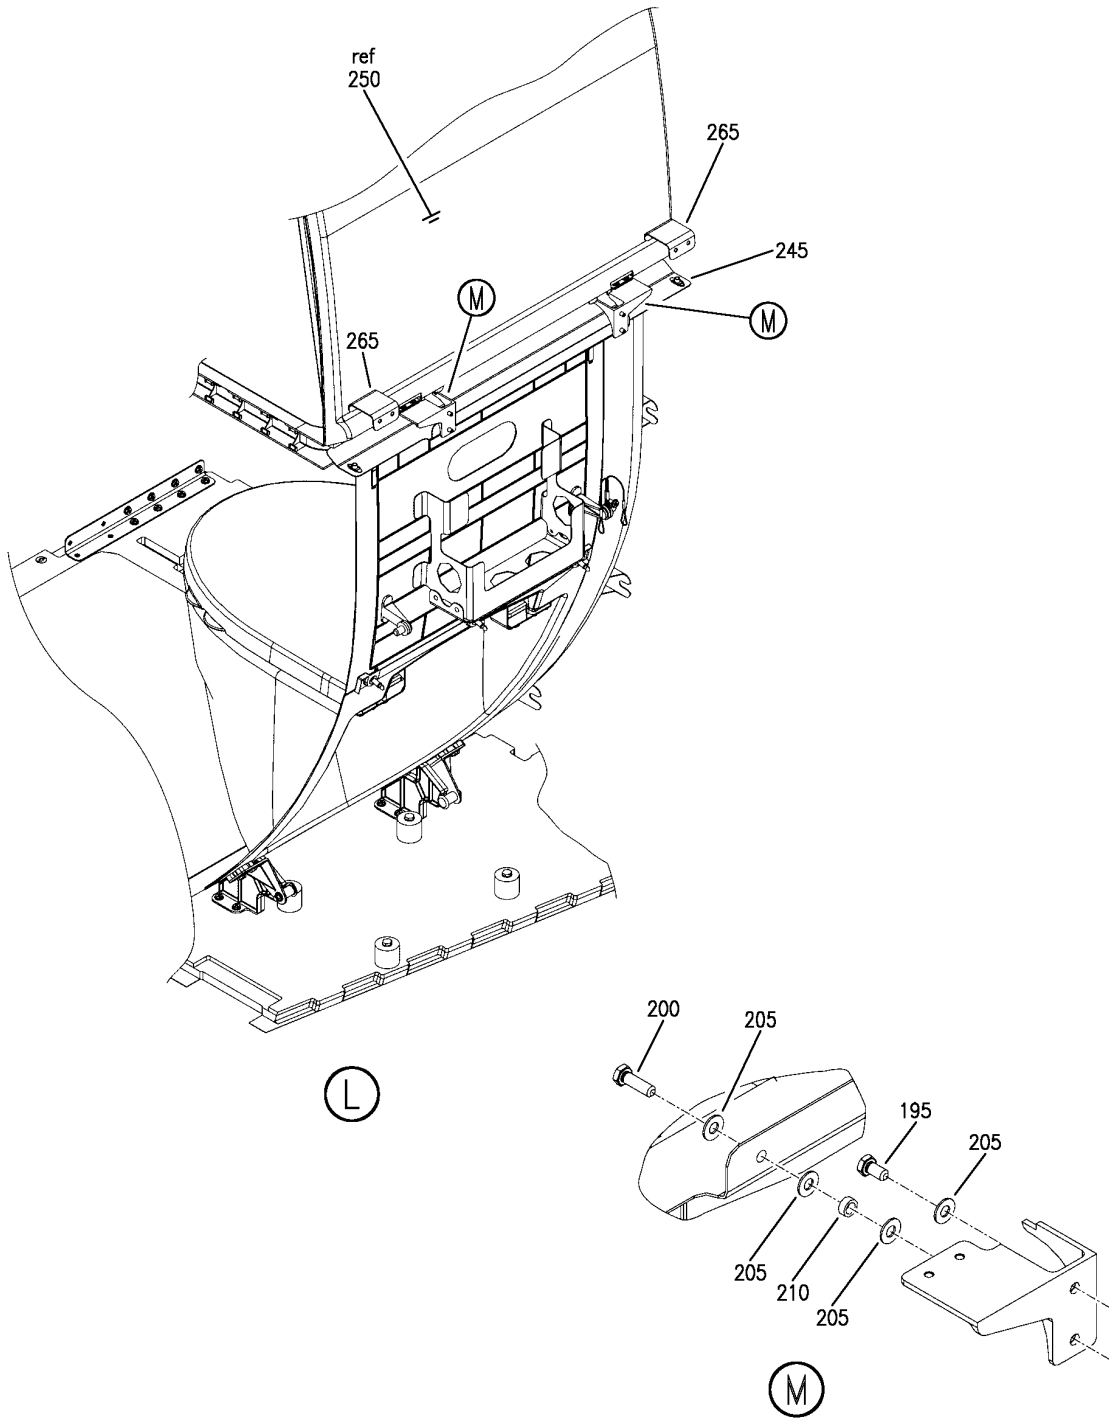

E 25401512S SHT 5 REV 345

STRUCTURE INSTL  
FIGURE 12S (SHEET 5)

**25-40-15-12S**

R Y R  
APR 15 / 25

25-40-15-12S  
PAGE 0D




**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER     | 1 2 3 4 5 6 7<br>NOMENCLATURE                                                                                                                                                                                      | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|-----------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 12S                                                     |                 |                                                                                                                                                                                                                    |                   |                      |
| - 1                                                     | 1L306051-155EE  | STRUCTURE INSTL<br>STRUCTURE INSTL-LAV E<br>SUPPLIER CODE:<br>V6S8D7<br>FOR NHA SEE:<br>25-40-15-09U                                                                                                               | 438459<br>438459  | RF                   |
| - 50                                                    | 1L306051-155EE1 | .STRUCTURE INSTL-<br>SUPPLIER CODE:<br>V6S8D7<br>USED ON:<br>1L306051-155EE<br>FUNCTIONAL REFERENCE:<br>EQUIPMENT/FURNISHINGS<br>FOR DETAILS SEE<br>25-41-51-04T<br>LIGHTS<br>FOR DETAILS SEE<br>33-26-03-21V      | 438459            | RF                   |
| - 52                                                    | 1L306051-155EE2 | .STRUCTURE INSTL-<br>SUPPLIER CODE:<br>V6S8D7<br>USED ON:<br>1L306051-155EE<br>FUNCTIONAL REFERENCE:<br>EQUIPMENT/FURNISHINGS<br>FOR DETAILS SEE<br>25-40-15-55M<br>WATER/WASTE<br>FOR DETAILS SEE<br>38-11-51-15C | 438459            | RF                   |
| - 54                                                    | 1L306051-155EE3 | .STRUCTURE INSTL-<br>SUPPLIER CODE:<br>V6S8D7<br>USED ON:<br>1L306051-155EE<br>FOR DETAILS SEE:<br>25-40-15-55N                                                                                                    | 438459            | RF                   |
| 55                                                      | 1L500409-841CH  | .PLATE-COVER<br>SUPPLIER CODE:<br>V6S8D7<br>USED ON:<br>1L306051-155EE<br>ATTACHING PARTS                                                                                                                          | 438459            | 2                    |
| 60                                                      | NAS514P632-5    | .SCREW<br>-----*-----                                                                                                                                                                                              | 438459            | 4                    |
| 65                                                      | 1L500409-263    | .PLATE-COVER<br>SUPPLIER CODE:<br>V6S8D7                                                                                                                                                                           | 438459            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                 |                                                                                                                                                                                                                    |                   |                      |

— ITEM NOT ILLUSTRATED

RYR

25-40-15-12S

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

25-40-15  
 FIG. 12S  
 PAGE 1  
 APR 15/25


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER   | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                                   | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|---------------|------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 12S                                                     |               |                                                                                                                              |                   |                      |
| 70                                                      | NAS514P632-5  | ATTACHING PARTS<br>.SCREW<br>-----*-----                                                                                     | 438459            | 2                    |
| 75                                                      | 1L500409-313  | .PLATE-COVER<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                                                                  | 438459            | 1                    |
| 80                                                      | NAS514P632-5  | .SCREW<br>-----*-----                                                                                                        | 438459            | 2                    |
| 85                                                      | 1L500409-257  | .PLATE-SHEAR<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                                                                  | 438459            | 2                    |
| 90                                                      | BACB30VF3K1   | .BOLT<br>-----*-----                                                                                                         | 438459            | 10                   |
| 95                                                      | 1L500409-253  | .PLATE-SHEAR<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                                                                  | 438459            | 2                    |
| 100                                                     | BACB30VF3K1   | .BOLT<br>-----*-----                                                                                                         | 438459            | 10                   |
| 105                                                     | 1L500409-155  | .PANEL-<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                                                                       | 438459            | 1                    |
| 110                                                     | NAS517-3-5    | .SCREW<br>STANDARD SUBSTITUTION:<br>BACB30LU3-5<br>BACB30LH3-5<br>-----*-----                                                | 438459            | 4                    |
| 115                                                     | 1L500407-211  | .PAN-COVER<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                                                                    | 438459            | 1                    |
| 120                                                     | NAS1801-3-6   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                                                                              | 438459            | 8                    |
| 125                                                     | NAS1149D0332J | .WASHER<br>-----*-----                                                                                                       | 438459            | 8                    |
| 130                                                     | 1L400105-34EE | .DOOR ASSY-<br>SUPPLIER CODE:<br>V16827<br>USED ON:<br>1L306051-155EE<br>FOR DETAILS SEE:<br>25-41-17-14H<br>ATTACHING PARTS | 438459            | 1                    |
| 135                                                     | NAS8603-4     | .BOLT<br>-----*-----                                                                                                         | 438459            | 13                   |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |               |                                                                                                                              |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R

25-40-15-12S

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-15  
FIG. 12S  
PAGE 2  
APR 15/23


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER  | 1 2 3 4 5 6 7 NOMENCLATURE                                                                           | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|--------------|------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 12S<br>140                                              | 1L500109-302 | .TRIM-EDGE<br>SUPPLIER CODE:<br>V6S8D7                                                               | 438459            | 1                    |
| 145                                                     | 1L500109-462 | .TRIM ASSY-DOOR<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                                       | 438459            | 1                    |
| 150                                                     | NAS8703A4    | .BOLT<br>STANDARD SUBSTITUTION:<br>BACB30ZE3K4<br>-----*-----                                        | 438459            | 3                    |
| 155                                                     | 1L500105-170 | ..BLOCK-CLOSE OUT<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                                     | 438459            | 1                    |
| 160                                                     | NAS514P440-5 | ..SCREW                                                                                              | 438459            | 1                    |
| 165                                                     | MS21042-04   | ..NUT<br>STANDARD SUBSTITUTION:<br>MS21042L04<br>BACN11AG04<br>-----*-----                           | 438459            | 1                    |
| 170                                                     | 1L500109-460 | ..TRIM-OPENING<br>SUPPLIER CODE:<br>V6S8D7<br>CONFIG CHG DATA FROM A CMM:<br>SUPSD BY 1L500109-628   | 438459            | 1                    |
| 170                                                     | 1L500109-628 | ..TRIM-OPENING<br>SUPPLIER CODE:<br>V6S8D7<br>CONFIG CHG DATA FROM A CMM:<br>SUPERSEDES 1L500109-460 | 438459            | 1                    |
| 175                                                     | 1L500409-267 | .SPACER-BLOCK<br>SUPPLIER CODE:<br>V6S8D7                                                            | 438459            | 3                    |
| 180                                                     | 1L400109-94  | .SWITCH ASSY-<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>33-26-03-28P<br>ATTACHING PARTS     | 438459            | 1                    |
| 185                                                     | NAS8703A1    | .BOLT<br>STANDARD SUBSTITUTION:<br>BACB30ZE3K1<br>-----*-----                                        | 438459            | 2                    |
| 190                                                     | 1L460070-253 | .STATION ASSY-BABY CHANGING<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-41-52-02H          | 438459            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |              |                                                                                                      |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R

25-40-15-12S

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-15  
 FIG. 12S  
 PAGE 3  
 APR 15/23


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER   | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                                                                      | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|---------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 12S                                                     |               |                                                                                                                                                                 |                   |                      |
| 195                                                     | NAS1801-3-6   | .ATTACHING PARTS<br>.SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                                                                                             | 438459            | 2                    |
| 200                                                     | NAS1801-3-10  | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-10                                                                                                                | 438459            | 2                    |
| 205                                                     | NAS1149C0332R | .WASHER                                                                                                                                                         | 438459            | 8                    |
| 210                                                     | NAS43DD3-8N   | .SPACER<br>STANDARD SUBSTITUTION:<br>NAS43DD3-8FC<br>-----*-----                                                                                                | 438459            | 2                    |
| 215                                                     | 65PWF02       | .MAGNET-RECTANGULAR<br>SUPPLIER CODE:<br>V1B3S4<br>MISCELLANEOUS DATA:<br>ORDER LCCS7-2A                                                                        | 438459            | 2                    |
| 215                                                     | LCCS7-2A      | .MAGNET-RECTANGULAR<br>SUPPLIER CODE:<br>V6S8D7<br>TRUE PART NUMBER:<br>LCCS-7-2-A<br>MISCELLANEOUS DATA:<br>ADAMS MAGNETIC PRODUCTS<br>CO. PART NUMBER 65PWF02 | 438459            | 2                    |
| 220                                                     | 1L500411-67   | .SPACER-MAGNET<br>SUPPLIER CODE:<br>V6S8D7                                                                                                                      | 438459            | 2                    |
| - 225                                                   | 9L500001-310  | .MOUNTING INSTL-TIE<br>ELECTRICAL<br>SUPPLIER CODE:<br>V6S8D7                                                                                                   | 438459            | 1                    |
| - 230                                                   | MS3367-5-9    | ..STRAP<br>STANDARD SUBSTITUTION:<br>BACS38K5                                                                                                                   | 438459            | 1                    |
| - 235                                                   | TM3S10        | ..MOUNT-CABLE TIE<br>SUPPLIER CODE:<br>V06383                                                                                                                   | 438459            | 1                    |
| - 240                                                   | NAS514P1032-8 | ATTACHING PARTS<br>..SCREW<br>-----*-----                                                                                                                       | 438459            | 1                    |
| 245                                                     | 1L400100-103  | .SHIELD-TRAP<br>SUPPLIER CODE:<br>V6S8D7                                                                                                                        | 438459            | 1                    |
| 250                                                     | 1L400411-57   | .SHROUD-BABY CHANGING TABLE<br>SUPPLIER CODE:<br>V6S8D7                                                                                                         | 438459            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |               |                                                                                                                                                                 |                   |                      |

- ITEM NOT ILLUSTRATED

R Y R

25-40-15-12S

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-15  
FIG. 12S  
PAGE 4  
JUN 15/24


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER  | 1 2 3 4 5 6 7 | NOMENCLATURE                                                                                                                          | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|--------------|---------------|---------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 12S                                                     |              |               | ATTACHING PARTS                                                                                                                       |                   |                      |
| 255                                                     | 09T203       |               | .SCREW-<br>SUPPLIER CODE:<br>V94222<br>TRUE PART NUMBER:<br>09-T-203<br>-----*-----                                                   | 438459            | 4                    |
| - 260                                                   | BAC1521-827  |               | .SEAL-<br>MISCELLANEOUS DATA:<br>ORDER LCSR000010                                                                                     | 438459            | AR                   |
| - 260                                                   | LCSR000010   |               | .SEAL-EXTRUDED SILICONE<br>RUBBER<br>SUPPLIER CODE:<br>V6S8D7<br>MISCELLANEOUS DATA:<br>THE BOEING COMPANY PART<br>NUMBER BAC1521-827 | 438459            | AR                   |
| 265                                                     | 1L500100-101 |               | .STABILIZER-BABY CHANGING<br>TABLE SHROUD<br>SUPPLIER CODE:<br>V6S8D7                                                                 | 438459            | 2                    |
| 270                                                     | 1L400407-53  |               | .FACE ASSY-SEAT COVER<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-41-21-18M                                                 | 438459            | 1                    |
| 275                                                     | 1L400407-51  |               | .SHROUD ASSY-TOILET LID<br>SEAT<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-41-21-18N                                       | 438459            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |              |               |                                                                                                                                       |                   |                      |

— ITEM NOT ILLUSTRATED


R Y R

25-40-15-12S

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-15  
 FIG. 12S  
 PAGE 5  
 APR 15/25

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

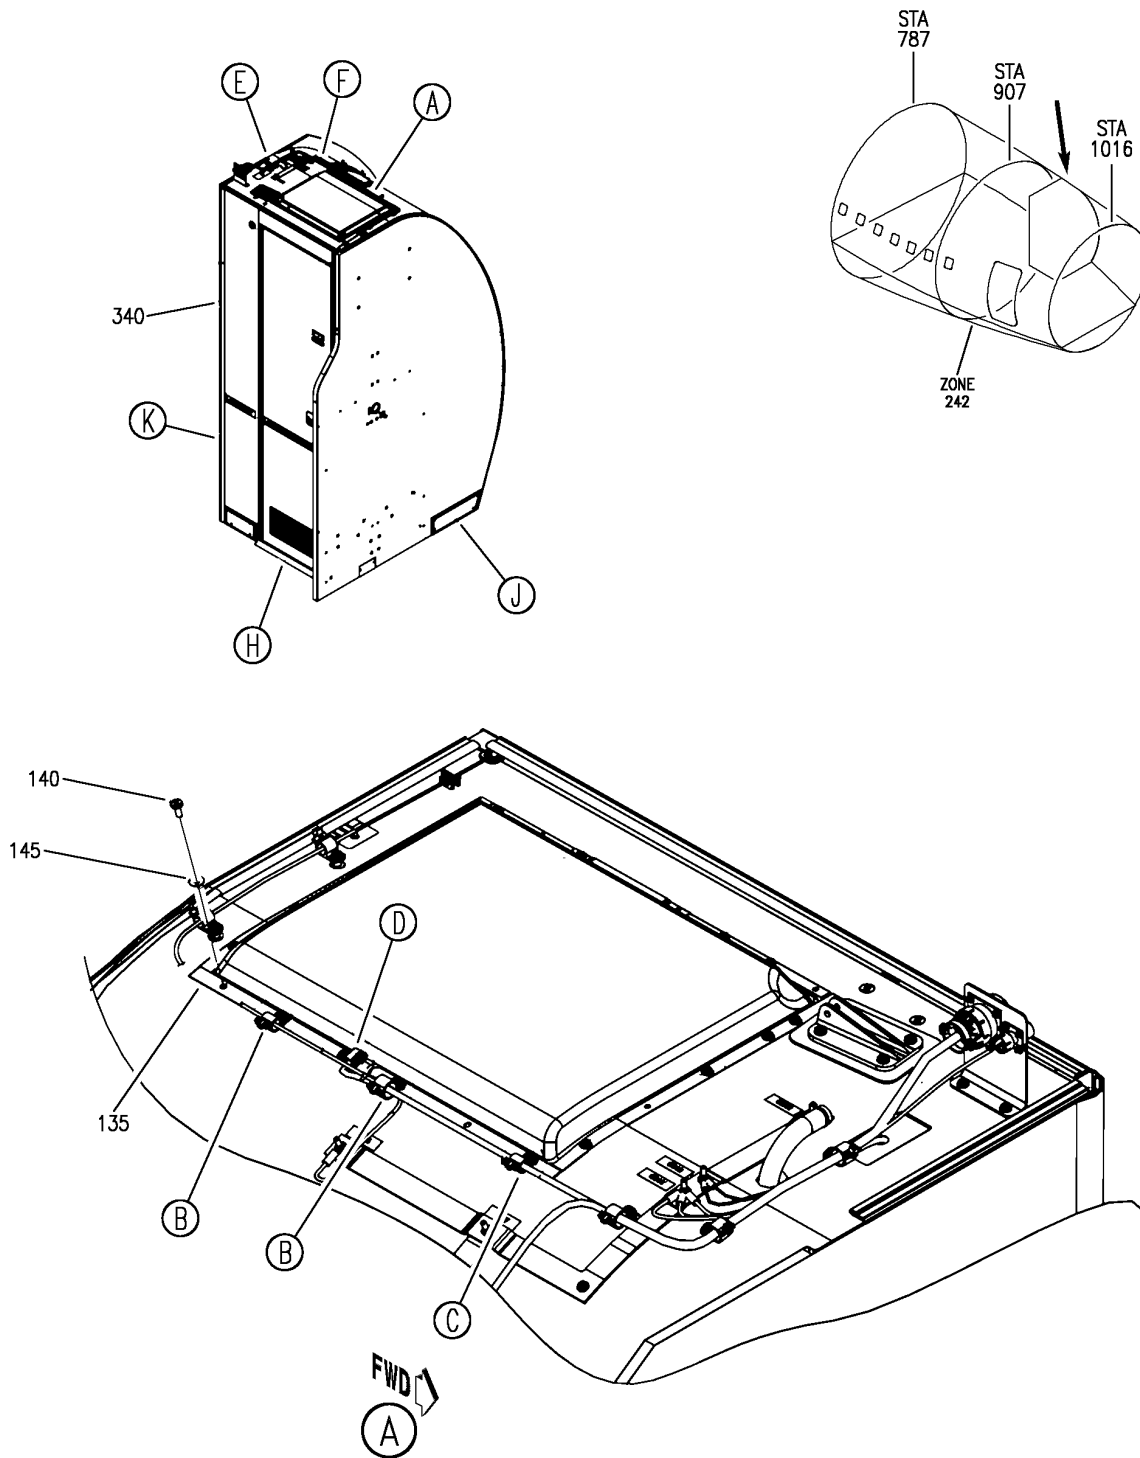

E 25401513D SHT 1 REV 249

MODULE ASSY-LAV E (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 13D (SHEET 1)


**25-40-15-13D**

R Y R  
AUG 15/19

25-40-15-13D  
PAGE 0

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

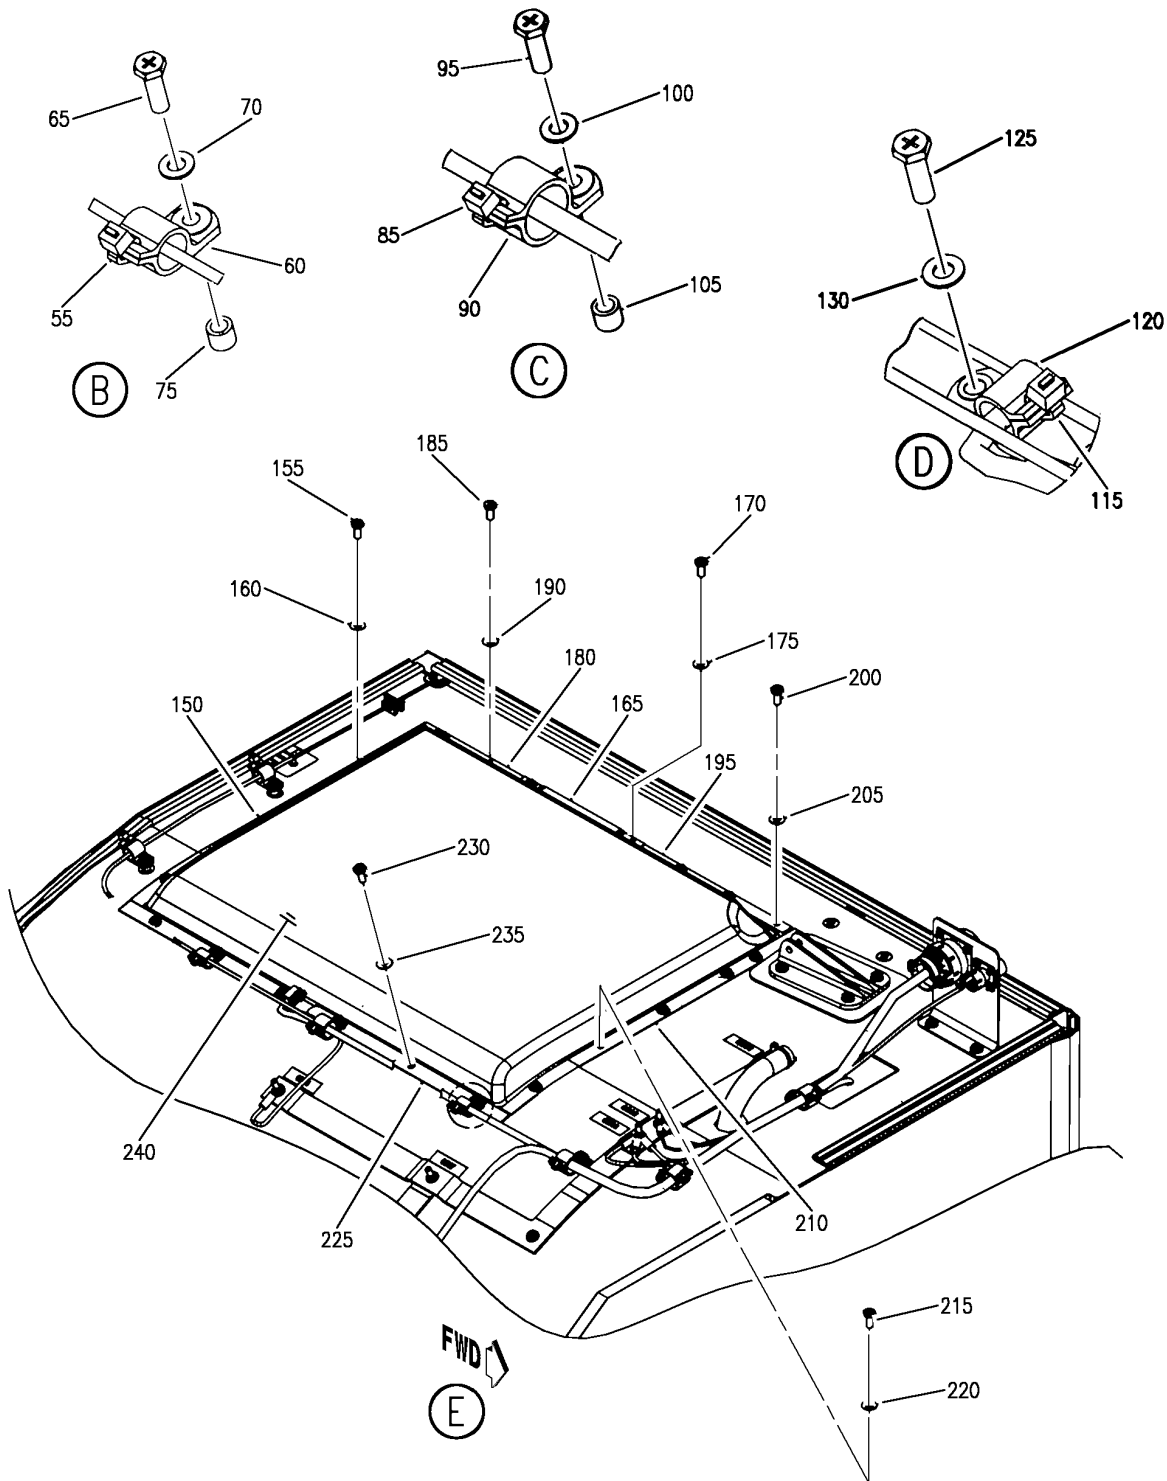

E 25401513D SHT 2 REV 249

MODULE ASSY-LAV E (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 13D (SHEET 2)




**25-40-15-13D**

R/YR  
AUG 15/19

25-40-15-13D  
PAGE 0A

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

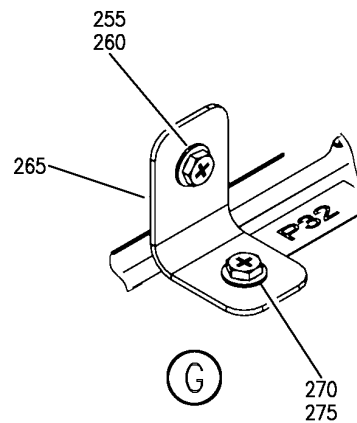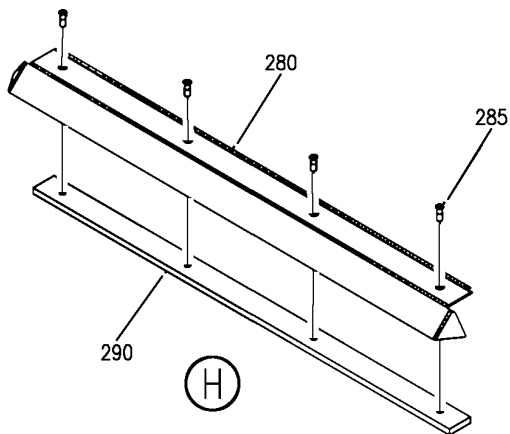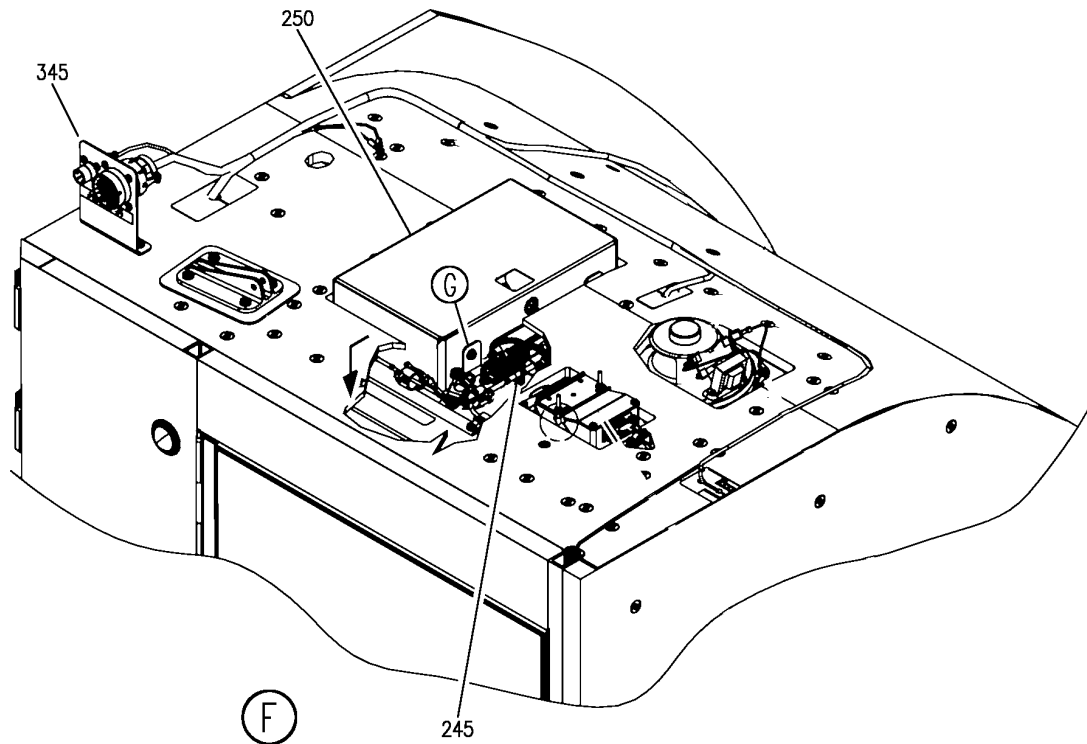

E 25401513D SHT 3 REV 249

MODULE ASSY-LAV E (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 13D (SHEET 3)

**25-40-15-13D**



R Y R  
AUG 15 / 19

25-40-15-13D  
PAGE 0B

ECCN 9E991 BOEING PROPRIETARY – See title page for details.



**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

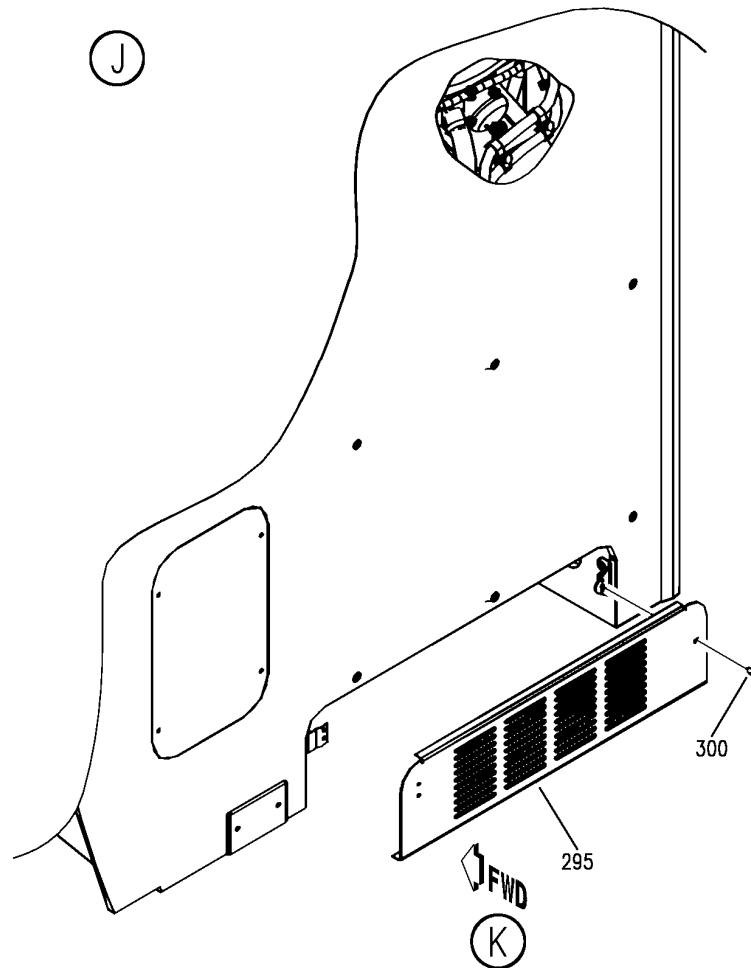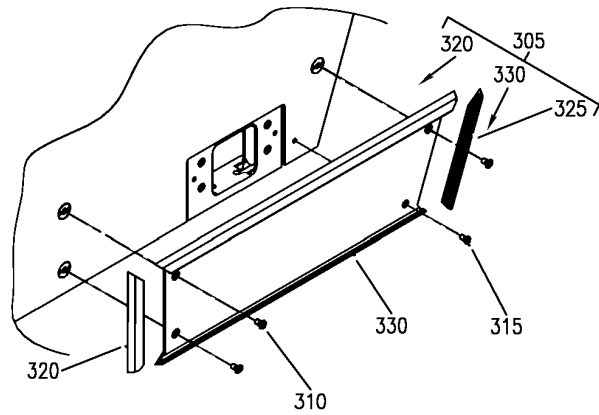

E 25401513D SHT 4 REV 249

MODULE ASSY-LAV E (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 13D (SHEET 4)

**25-40-15-13D**

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

R/YR  
AUG 15/19

25-40-15-13D  
PAGE 0C


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 | NOMENCLATURE                                                                                                                                                                                                                                                                                            | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|---------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 13D                                                     |                |               | MODULE ASSY-LAV E<br>(EQUIPMENT/FURNISHINGS<br>ONLY)                                                                                                                                                                                                                                                    | 460475            |                      |
| - 1                                                     | 1L300050-1241C |               | MODULE ASSY-LAV E<br>(EQUIPMENT/FURNISHINGS<br>ONLY)<br>SUPPLIER CODE:<br>V6S8D7<br>FUNCTIONAL DESCRIPTION:<br>PROVIDES LAVATORY<br>FACILITIES FOR<br>PASSENGERS AND CREW<br>ELECTRICAL EQUIP NUMBER:<br>M01419<br>COMPONENT MAINT MANUAL REF:<br>25-40-56<br>FOR NHA/OTHER SYS DET SEE:<br>25-40-15-01 | 460475            | RF                   |
| - 50                                                    | 9L500001-106   |               | .CLAMP INSTL-ELECTRICAL<br>SUPPLIER CODE:<br>V6S8D7                                                                                                                                                                                                                                                     | 460475            | 1                    |
| 55                                                      | MS3367-5-9     |               | ..STRAP<br>STANDARD SUBSTITUTION:<br>BACS38K5                                                                                                                                                                                                                                                           | 460475            | 1                    |
| 60                                                      | CA2030-2       |               | ..CLAMP-<br>SUPPLIER CODE:<br>V03296<br>ATTACHING PARTS                                                                                                                                                                                                                                                 | 460475            | 1                    |
| 65                                                      | NAS1801-3-10   |               | ..SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-10                                                                                                                                                                                                                                                       | 460475            | 1                    |
| 70                                                      | NAS1149D0316K  |               | ..WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J                                                                                                                                                                                                                                                     | 460475            | 1                    |
| 75                                                      | NAS43DD3-16N   |               | ..SPACER<br>STANDARD SUBSTITUTION:<br>NAS43DD3-16FC<br>-----*-----                                                                                                                                                                                                                                      | 460475            | 1                    |
| - 80                                                    | 9L500001-107   |               | .CLAMP INSTL-ELECTRICAL<br>SUPPLIER CODE:<br>V6S8D7                                                                                                                                                                                                                                                     | 460475            | 1                    |
| 85                                                      | MS3367-5-9     |               | ..STRAP<br>STANDARD SUBSTITUTION:<br>BACS38K5                                                                                                                                                                                                                                                           | 460475            | 1                    |
| 90                                                      | CA2030-3       |               | ..CLAMP-<br>SUPPLIER CODE:<br>V03296                                                                                                                                                                                                                                                                    | 460475            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |               |                                                                                                                                                                                                                                                                                                         |                   |                      |

- ITEM NOT ILLUSTRATED

RYR

25-40-15-13D

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-15  
FIG. 13D  
PAGE 1  
APR 15/23


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER   | 1 2 3 4 5 6 7 NOMENCLATURE                                           | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|---------------|----------------------------------------------------------------------|-------------------|----------------------|
| 13D                                                     |               |                                                                      |                   |                      |
| 95                                                      | NAS1801-3-10  | ATTACHING PARTS<br>..SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-10 | 460475            | 1                    |
| 100                                                     | NAS1149D0316K | ..WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J                  | 460475            | 1                    |
| 105                                                     | NAS43DD3-16N  | ..SPACER<br>STANDARD SUBSTITUTION:<br>NAS43DD3-16FC<br>-----*-----   | 460475            | 1                    |
| - 110                                                   | 9L500001-103  | .CLAMP INSTL-ELECTRICAL<br>SUPPLIER CODE:<br>V6S8D7                  | 460475            | 2                    |
| 115                                                     | MS3367-5-9    | ..STRAP<br>STANDARD SUBSTITUTION:<br>BACS38K5                        | 460475            | 1                    |
| 120                                                     | CA2030-3      | ..CLAMP-<br>SUPPLIER CODE:<br>V03296<br>ATTACHING PARTS              | 460475            | 1                    |
| 125                                                     | NAS1801-3-6   | ..SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                     | 460475            | 1                    |
| 130                                                     | NAS1149D0316K | ..WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J<br>-----*-----   | 460475            | 1                    |
| 135                                                     | 1L500409-795  | .STRAP-FIRE BLANKET<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS   | 460475            | 1                    |
| 140                                                     | NAS1801-3-6   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                      | 460475            | 1                    |
| 145                                                     | NAS1149D0316K | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J<br>-----*-----    | 460475            | 1                    |
| 150                                                     | 1L500409-781  | .STRAP-FIRE BLANKET<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS   | 460475            | 1                    |
| 155                                                     | NAS1801-3-6   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                      | 460475            | 5                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |               |                                                                      |                   |                      |

- ITEM NOT ILLUSTRATED

R Y R

25-40-15-13D

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-15  
 FIG. 13D  
 PAGE 2  
 APR 15/23


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER   | 1 2 3 4 5 6 7 | NOMENCLATURE                                                      | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|---------------|---------------|-------------------------------------------------------------------|-------------------|----------------------|
| 13D<br>160                                              | NAS1149D0316K | .             | WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J<br>-----*-----  | 460475            | 5                    |
| 165                                                     | 1L500409-791  | .             | STRAP-FIRE BLANKET<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS | 460475            | 1                    |
| 170                                                     | NAS1801-3-6   | .             | SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                    | 460475            | 2                    |
| 175                                                     | NAS1149D0316K | .             | WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J<br>-----*-----  | 460475            | 2                    |
| 180                                                     | 1L500409-723  | .             | STRAP-FIRE BLANKET<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS | 460475            | 1                    |
| 185                                                     | NAS1801-3-6   | .             | SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                    | 460475            | 2                    |
| 190                                                     | NAS1149D0316K | .             | WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J<br>-----*-----  | 460475            | 2                    |
| 195                                                     | 1L500409-721  | .             | STRAP-FIRE BLANKET<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS | 460475            | 1                    |
| 200                                                     | NAS1801-3-6   | .             | SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                    | 460475            | 3                    |
| 205                                                     | NAS1149D0316K | .             | WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J<br>-----*-----  | 460475            | 3                    |
| 210                                                     | 1L500409-787  | .             | STRAP-FIRE BLANKET<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS | 460475            | 1                    |
| 215                                                     | NAS1801-3-6   | .             | SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                    | 460475            | 5                    |
| 220                                                     | NAS1149D0316K | .             | WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J<br>-----*-----  | 460475            | 5                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |               |               |                                                                   |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R

25-40-15-13D

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-15  
 FIG. 13D  
 PAGE 3  
 APR 15/23


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER   | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                                                                                                                                                                                                                           | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|---------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 13D<br>225                                              | 1L500409-797  | .STRAP-FIRE BLANKET<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                                                                                                                                                                                                                                                   | 460475            | 1                    |
| 230                                                     | NAS1801-3-6   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                                                                                                                                                                                                                                                                      | 460475            | 1                    |
| 235                                                     | NAS1149D0316K | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J<br>-----*-----                                                                                                                                                                                                                                                    | 460475            | 1                    |
| 240                                                     | 1L500409-793  | .BLANKET-FIRE<br>SUPPLIER CODE:<br>V6S8D7                                                                                                                                                                                                                                                                            | 460475            | 1                    |
| 245                                                     | MS3367-5-9    | .STRAP<br>STANDARD SUBSTITUTION:<br>BACS38K5                                                                                                                                                                                                                                                                         | 460475            | AR                   |
| 250                                                     | 4576001-101   | .BOX ASSY-OXY<br>SUPPLIER CODE:<br>V16827<br>FUNCTIONAL DESCRIPTION:<br>STORES OXYGEN AND MASK<br>ASSEMBLIES. CONTROLS THE<br>DELIVERY OF OXYGEN TO<br>EACH MASK AND<br>COMMUNICATES WITH THE<br>AIRPLANE NETWORK.<br>COMPONENT MAINT MANUAL REF:<br>25-23-68<br>FOR DETAILS SEE:<br>35-21-00-01A<br>ATTACHING PARTS | 460475            | 1                    |
| 255                                                     | NAS1801-3-6   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                                                                                                                                                                                                                                                                      | 460475            | 4                    |
| 260                                                     | NAS1149D0332J | .WASHER<br>-----*-----                                                                                                                                                                                                                                                                                               | 460475            | 4                    |
| 265                                                     | 4L500403-17   | .ANGLE-<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                                                                                                                                                                                                                                                               | 460475            | 4                    |
| 270                                                     | NAS1801-3-6   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                                                                                                                                                                                                                                                                      | 460475            | 4                    |
| 275                                                     | NAS1149D0332J | .WASHER<br>-----*-----                                                                                                                                                                                                                                                                                               | 460475            | 4                    |
| 280                                                     | 1L500105-16   | .THRESHOLD-<br>SUPPLIER CODE:<br>V6S8D7                                                                                                                                                                                                                                                                              | 460475            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |               |                                                                                                                                                                                                                                                                                                                      |                   |                      |

— ITEM NOT ILLUSTRATED

RYR

25-40-15-13D

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-15  
 FIG. 13D  
 PAGE 4  
 APR 15/23


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 | NOMENCLATURE                                                                      | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|---------------|-----------------------------------------------------------------------------------|-------------------|----------------------|
| 13D                                                     |                |               |                                                                                   |                   |                      |
| 285                                                     | NAS8703A4      |               | ATTACHING PARTS<br>.BOLT<br>STANDARD SUBSTITUTION:<br>BACB30ZE3K4<br>-----*-----  | 460475            | 4                    |
| 290                                                     | 1L500109-147   |               | .SPACER-THRESHOLD<br>SUPPLIER CODE:<br>V6S8D7                                     | 460475            | 1                    |
| 295                                                     | 1L400040-42    |               | .COVER-TRASH TRAP<br>SUPPLIER CODE:<br>V6S8D7                                     | 460475            | 1                    |
| 300                                                     | NAS8303-7      |               | ATTACHING PARTS<br>.SCREW<br>-----*-----                                          | 460475            | 1                    |
| 305                                                     | 1L400109-404BA |               | .KICKSTRIP ASSY-<br>SUPPLIER CODE:<br>V6S8D7                                      | 460475            | 1                    |
| 310                                                     | NAS514P832-5   |               | ATTACHING PARTS<br>.SCREW                                                         | 460475            | 3                    |
| 315                                                     | NAS514P632-5   |               | .SCREW<br>-----*-----                                                             | 460475            | 1                    |
| 320                                                     | 1L500109-463BA |               | ..CAP-KICKSTRIP<br>SUPPLIER CODE:<br>V6S8D7                                       | 460475            | 1                    |
| 325                                                     | 1L500109-472BA |               | ..ENDCAP-KICKSTRIP<br>SUPPLIER CODE:<br>V6S8D7                                    | 460475            | 1                    |
| 330                                                     | 1L500109-474BA |               | ..RETAINER-KICKSTRIP<br>SUPPLIER CODE:<br>V6S8D7                                  | 460475            | 1                    |
| - 335                                                   | 1L360051-1241C |               | .LAVATORY ASSY-<br>SUPPLIER CODE:<br>V6S8D7                                       | 460475            | 1                    |
| 340                                                     | 1L306051-155EW |               | ..STRUCTURE ASSY-<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-40-15-55D | 460475            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |               |                                                                                   |                   |                      |

— ITEM NOT ILLUSTRATED

RYR

25-40-15-13D

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-15  
FIG. 13D  
PAGE 5  
APR 15/23


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER  | 1 2 3 4 5 6 7 | NOMENCLATURE                                                                                                                                                                                                                              | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|--------------|---------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 13D<br>345                                              | 3L306050-111 |               | ..ELECTRICAL INSTL-STRUCT<br>SUPPLIER CODE:<br>V6S8D7<br>FUNCTIONAL REFERENCE:<br>EQUIPMENT/FURNISHINGS<br>FOR DETAILS SEE<br>25-40-15-55H<br>LIGHTS<br>FOR DETAILS SEE<br>33-27-51-14C<br>WATER/WASTE<br>FOR DETAILS SEE<br>38-32-04-06F | 460475            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |              |               |                                                                                                                                                                                                                                           |                   |                      |

— ITEM NOT ILLUSTRATED


R Y R

# 25-40-15-13D

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

25-40-15  
 FIG. 13D  
 PAGE 6  
 AUG 15/19

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

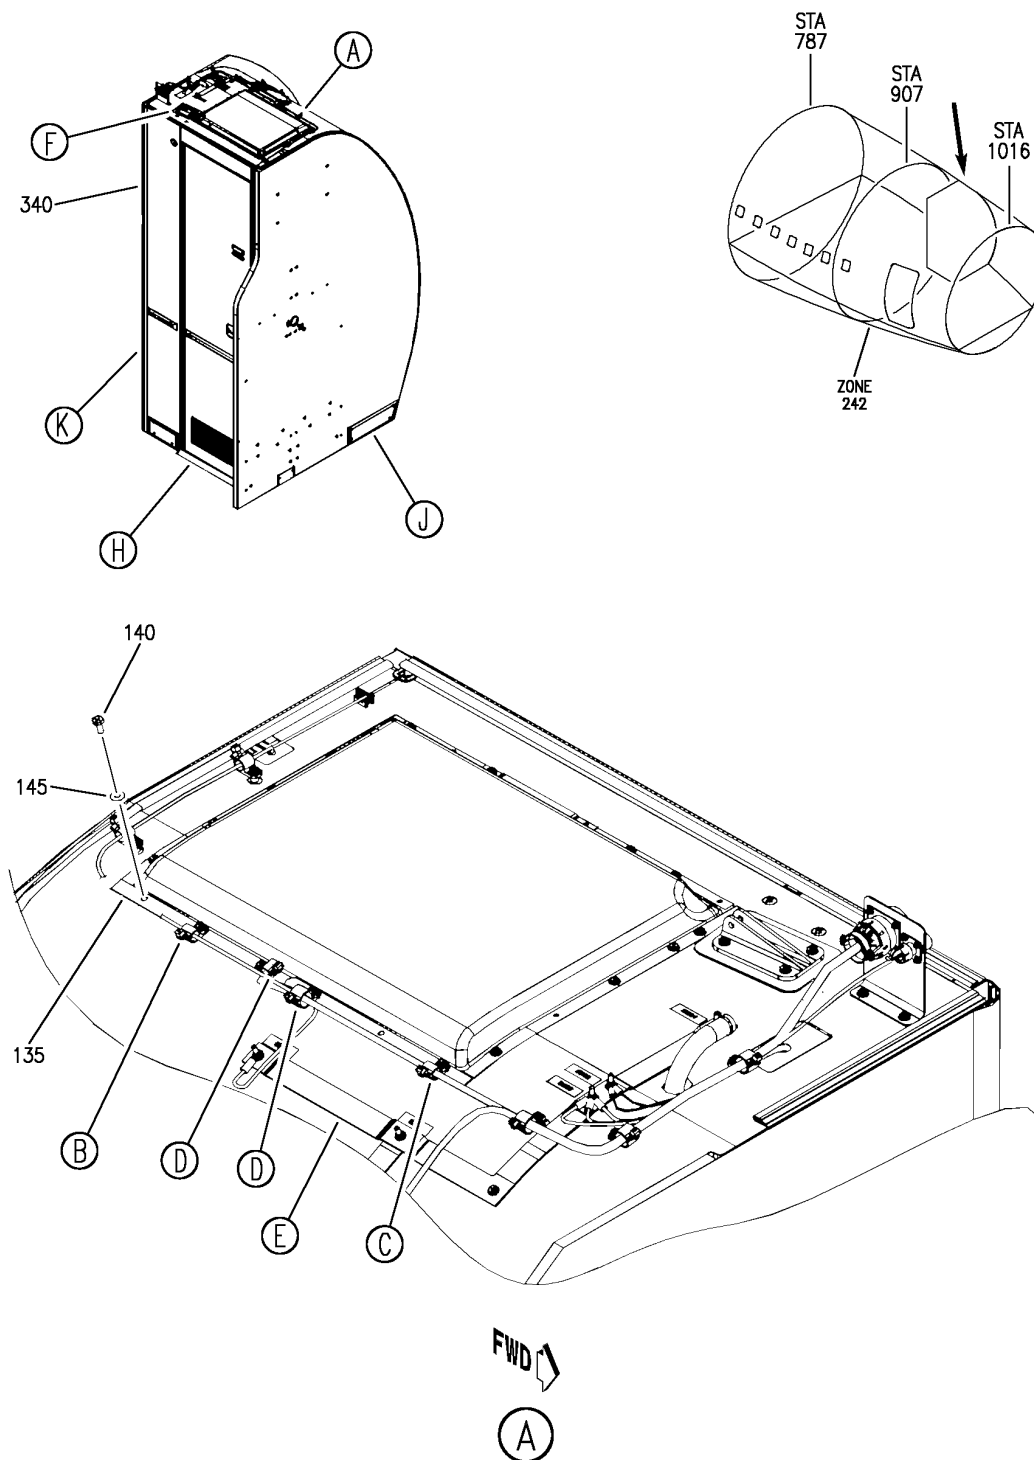

E 25401513S SHT 1 REV 255

MODULE ASSY-LAV E (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 13S (SHEET 1)

**25-40-15-13S**


ECCN 9E991 BOEING PROPRIETARY – See title page for details.

RJR  
OCT 15/17

25-40-15-13S  
PAGE 0



**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

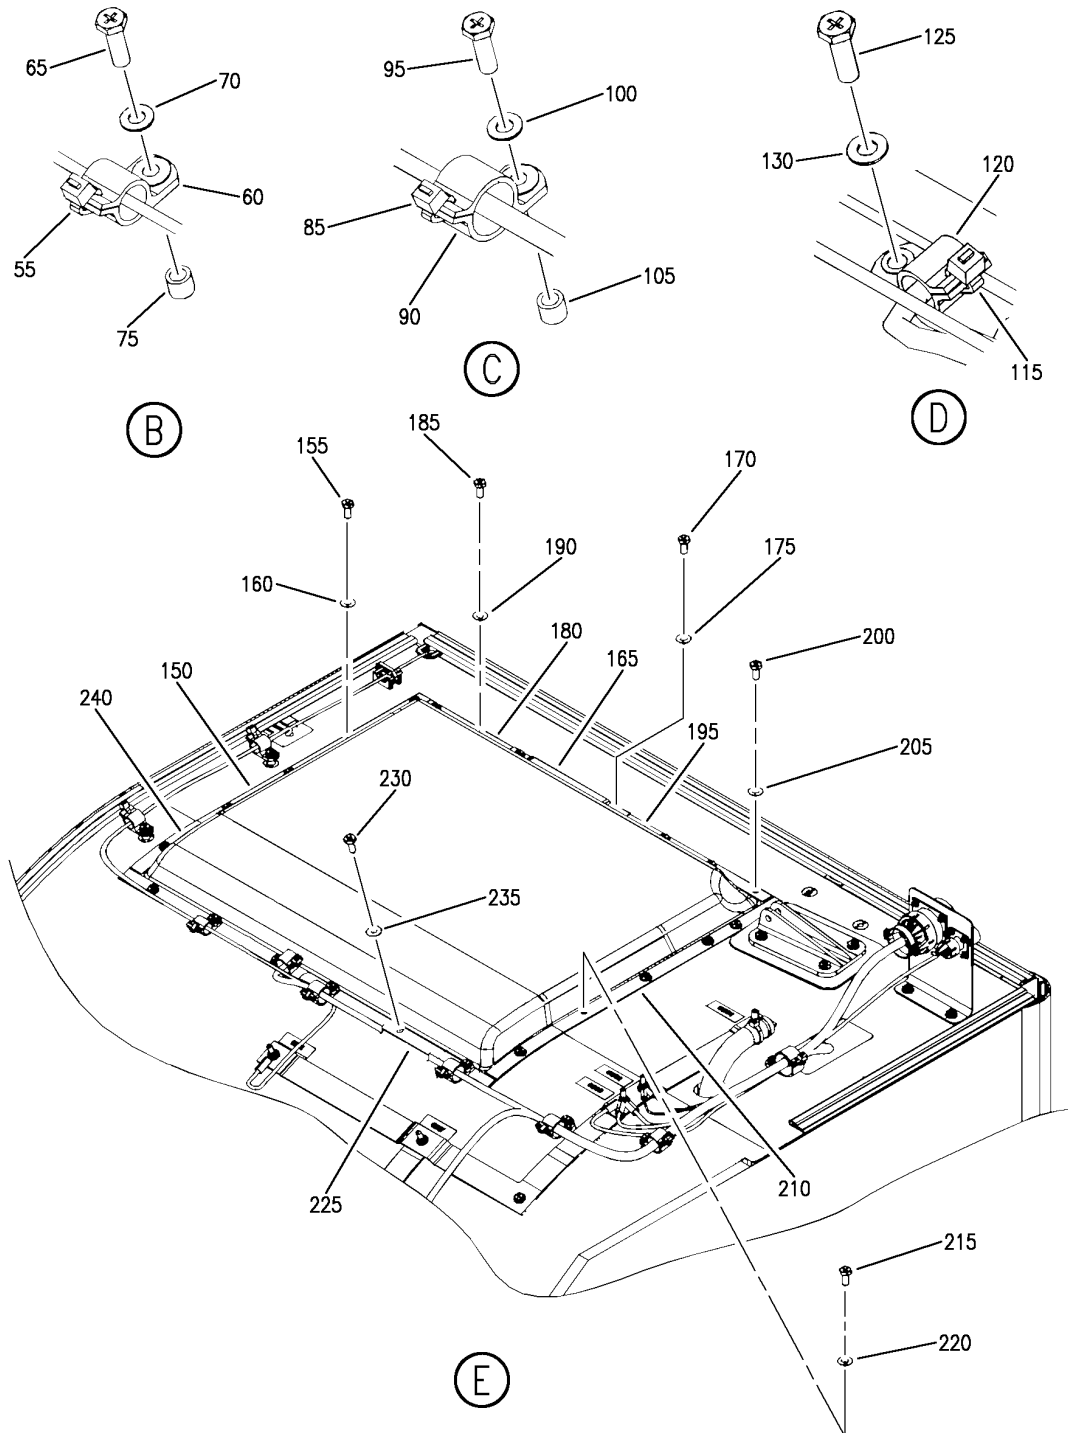

E 25401513S SHT 2 REV 255

MODULE ASSY-LAV E (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 13S (SHEET 2)



**25-40-15-13S**

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

R/YR  
OCT 15/17

25-40-15-13S  
PAGE 0A

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

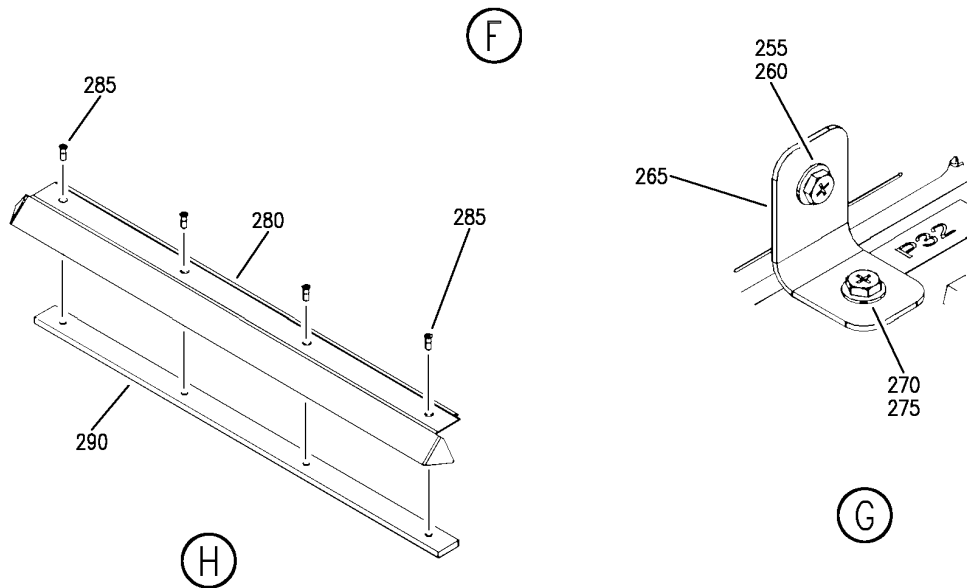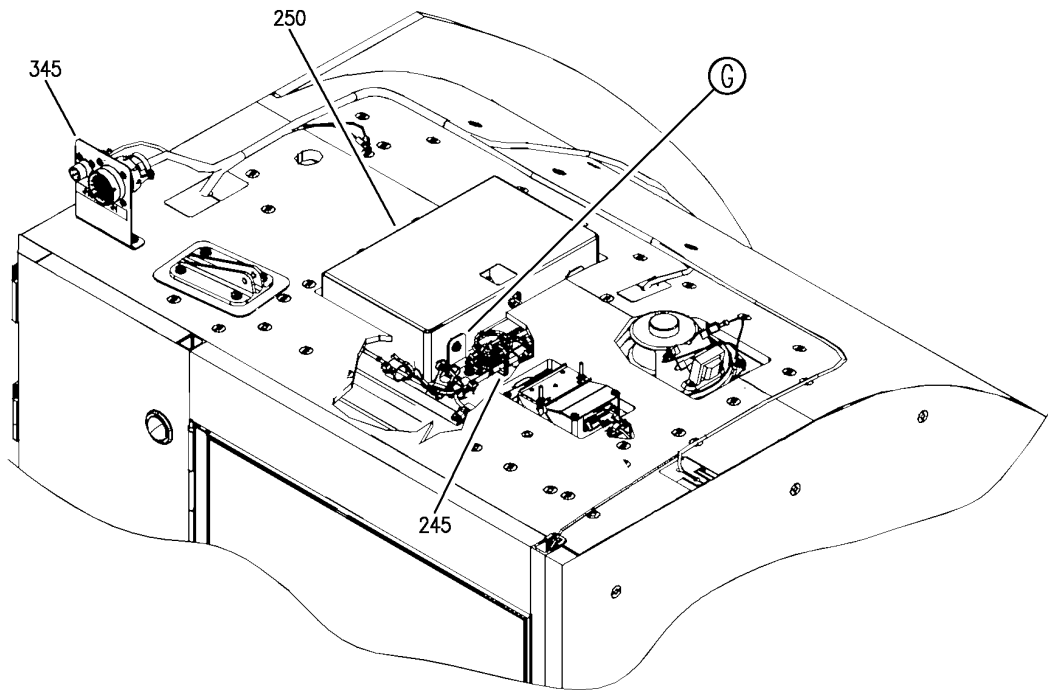

E 25401513S SHT 3 REV 255

MODULE ASSY-LAV E (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 13S (SHEET 3)


**25-40-15-13S**

R Y R  
O C T 15 / 17

25-40-15-13S  
PAGE 0B

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

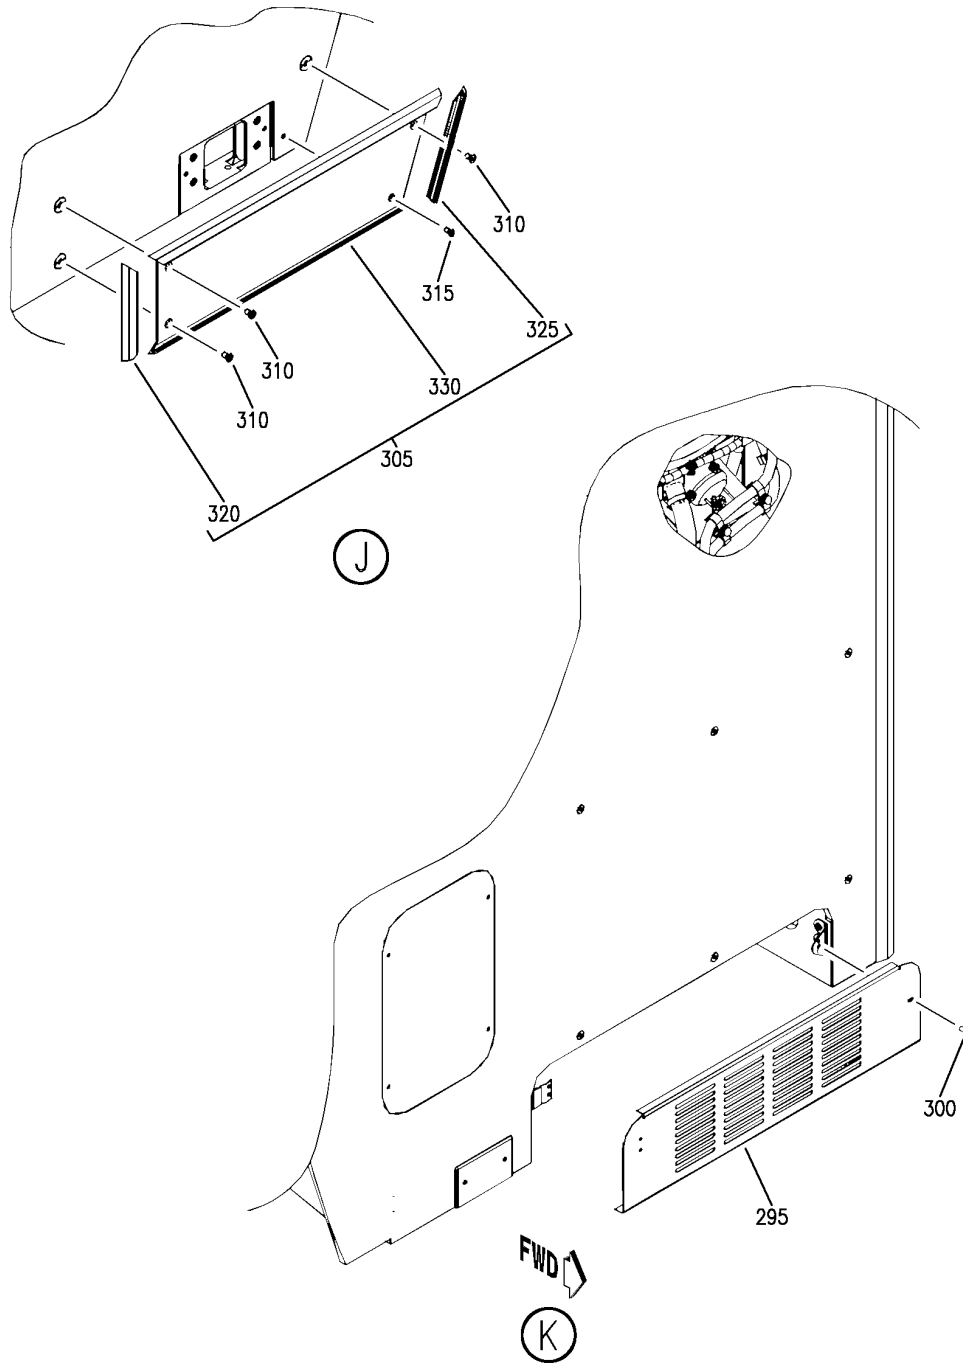

E 25401513S SHT 4 REV 255

MODULE ASSY-LAV E (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 13S (SHEET 4)

**25-40-15-13S**

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

RJR  
OCT 15/17

25-40-15-13S  
PAGE 0C


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 | NOMENCLATURE                                                                                                                                                                                                                                                                                             | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|---------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 13S                                                     |                |               | MODULE ASSY-LAV E<br>(EQUIPMENT/FURNISHINGS<br>ONLY)                                                                                                                                                                                                                                                     | 476481            |                      |
| - 1                                                     | 1L300050-1285A |               | MODULE ASSY-LAV E<br>(EQUIPMENT/FURNISHINGS<br>ONLY)<br>SUPPLIER CODE:<br>V6S8D7<br>FUNCTIONAL DESCRIPTION:<br>PROVIDES LAVATORY<br>FACILITIES FOR<br>PASSENGERS AND CREW<br>ELECTRICAL EQUIP NUMBER:<br>M01419<br>COMPONENT MAINT MANUAL REF:<br>25-40-56<br>FOR NHA/OTHER SYS DET SEE:<br>25-40-15-01B | 476481            | RF                   |
| - 50                                                    | 9L500001-106   |               | .CLAMP INSTL-ELECTRICAL<br>SUPPLIER CODE:<br>V6S8D7                                                                                                                                                                                                                                                      | 476481            | 1                    |
| 55                                                      | MS3367-5-9     |               | ..STRAP<br>STANDARD SUBSTITUTION:<br>BACS38K5                                                                                                                                                                                                                                                            | 476481            | 1                    |
| 60                                                      | CA2030-2       |               | ..CLAMP-<br>SUPPLIER CODE:<br>V03296<br>ATTACHING PARTS                                                                                                                                                                                                                                                  | 476481            | 1                    |
| 65                                                      | NAS1801-3-10   |               | ..SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-10                                                                                                                                                                                                                                                        | 476481            | 1                    |
| 70                                                      | NAS1149D0316K  |               | ..WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J                                                                                                                                                                                                                                                      | 476481            | 1                    |
| 75                                                      | NAS43DD3-16N   |               | ..SPACER<br>STANDARD SUBSTITUTION:<br>NAS43DD3-16FC<br>-----*-----                                                                                                                                                                                                                                       | 476481            | 1                    |
| - 80                                                    | 9L500001-107   |               | .CLAMP INSTL-ELECTRICAL<br>SUPPLIER CODE:<br>V6S8D7                                                                                                                                                                                                                                                      | 476481            | 1                    |
| 85                                                      | MS3367-5-9     |               | ..STRAP<br>STANDARD SUBSTITUTION:<br>BACS38K5                                                                                                                                                                                                                                                            | 476481            | 1                    |
| 90                                                      | CA2030-3       |               | ..CLAMP-<br>SUPPLIER CODE:<br>V03296                                                                                                                                                                                                                                                                     | 476481            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |               |                                                                                                                                                                                                                                                                                                          |                   |                      |

- ITEM NOT ILLUSTRATED

RYR

25-40-15-13S

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-15  
FIG. 13S  
PAGE 1  
APR 15/23


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER   | 1 2 3 4 5 6 7 NOMENCLATURE                                           | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|---------------|----------------------------------------------------------------------|-------------------|----------------------|
| 13S                                                     |               |                                                                      |                   |                      |
| 95                                                      | NAS1801-3-10  | ATTACHING PARTS<br>..SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-10 | 476481            | 1                    |
| 100                                                     | NAS1149D0316K | ..WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J                  | 476481            | 1                    |
| 105                                                     | NAS43DD3-16N  | ..SPACER<br>STANDARD SUBSTITUTION:<br>NAS43DD3-16FC<br>-----*-----   | 476481            | 1                    |
| - 110                                                   | 9L500001-103  | .CLAMP INSTL-ELECTRICAL<br>SUPPLIER CODE:<br>V6S8D7                  | 476481            | 2                    |
| 115                                                     | MS3367-5-9    | ..STRAP<br>STANDARD SUBSTITUTION:<br>BACS38K5                        | 476481            | 1                    |
| 120                                                     | CA2030-3      | ..CLAMP-<br>SUPPLIER CODE:<br>V03296<br>ATTACHING PARTS              | 476481            | 1                    |
| 125                                                     | NAS1801-3-6   | ..SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                     | 476481            | 1                    |
| 130                                                     | NAS1149D0316K | ..WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J<br>-----*-----   | 476481            | 1                    |
| 135                                                     | 1L500409-795  | .STRAP-FIRE BLANKET<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS   | 476481            | 1                    |
| 140                                                     | NAS1801-3-6   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                      | 476481            | 1                    |
| 145                                                     | NAS1149D0316K | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J<br>-----*-----    | 476481            | 1                    |
| 150                                                     | 1L500409-781  | .STRAP-FIRE BLANKET<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS   | 476481            | 1                    |
| 155                                                     | NAS1801-3-6   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                      | 476481            | 5                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |               |                                                                      |                   |                      |

- ITEM NOT ILLUSTRATED

R Y R

25-40-15-13S

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-15  
 FIG. 13S  
 PAGE 2  
 APR 15/23


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER   | 1 2 3 4 5 6 7 | NOMENCLATURE                                                      | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|---------------|---------------|-------------------------------------------------------------------|-------------------|----------------------|
| 13S<br>160                                              | NAS1149D0316K | .             | WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J<br>-----*-----  | 476481            | 5                    |
| 165                                                     | 1L500409-791  | .             | STRAP-FIRE BLANKET<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS | 476481            | 1                    |
| 170                                                     | NAS1801-3-6   | .             | SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                    | 476481            | 2                    |
| 175                                                     | NAS1149D0316K | .             | WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J<br>-----*-----  | 476481            | 2                    |
| 180                                                     | 1L500409-723  | .             | STRAP-FIRE BLANKET<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS | 476481            | 1                    |
| 185                                                     | NAS1801-3-6   | .             | SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                    | 476481            | 2                    |
| 190                                                     | NAS1149D0316K | .             | WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J<br>-----*-----  | 476481            | 2                    |
| 195                                                     | 1L500409-721  | .             | STRAP-FIRE BLANKET<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS | 476481            | 1                    |
| 200                                                     | NAS1801-3-6   | .             | SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                    | 476481            | 3                    |
| 205                                                     | NAS1149D0316K | .             | WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J<br>-----*-----  | 476481            | 3                    |
| 210                                                     | 1L500409-787  | .             | STRAP-FIRE BLANKET<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS | 476481            | 1                    |
| 215                                                     | NAS1801-3-6   | .             | SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                    | 476481            | 5                    |
| 220                                                     | NAS1149D0316K | .             | WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J<br>-----*-----  | 476481            | 5                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |               |               |                                                                   |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R

25-40-15-13S

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-15  
 FIG. 13S  
 PAGE 3  
 APR 15/23


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER   | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                                                                                                                                                                                                                           | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|---------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 13S<br>225                                              | 1L500409-797  | .STRAP-FIRE BLANKET<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                                                                                                                                                                                                                                                   | 476481            | 1                    |
| 230                                                     | NAS1801-3-6   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                                                                                                                                                                                                                                                                      | 476481            | 1                    |
| 235                                                     | NAS1149D0316K | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J<br>-----*-----                                                                                                                                                                                                                                                    | 476481            | 1                    |
| 240                                                     | 1L500409-793  | .BLANKET-FIRE<br>SUPPLIER CODE:<br>V6S8D7                                                                                                                                                                                                                                                                            | 476481            | 1                    |
| 245                                                     | MS3367-5-9    | .STRAP<br>STANDARD SUBSTITUTION:<br>BACS38K5                                                                                                                                                                                                                                                                         | 476481            | AR                   |
| 250                                                     | 4576001-101   | .BOX ASSY-OXY<br>SUPPLIER CODE:<br>V16827<br>FUNCTIONAL DESCRIPTION:<br>STORES OXYGEN AND MASK<br>ASSEMBLIES. CONTROLS THE<br>DELIVERY OF OXYGEN TO<br>EACH MASK AND<br>COMMUNICATES WITH THE<br>AIRPLANE NETWORK.<br>COMPONENT MAINT MANUAL REF:<br>25-23-68<br>FOR DETAILS SEE:<br>35-21-00-01A<br>ATTACHING PARTS | 476481            | 1                    |
| 255                                                     | NAS1801-3-6   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                                                                                                                                                                                                                                                                      | 476481            | 4                    |
| 260                                                     | NAS1149D0332J | .WASHER<br>-----*-----                                                                                                                                                                                                                                                                                               | 476481            | 4                    |
| 265                                                     | 4L500403-17   | .ANGLE-<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                                                                                                                                                                                                                                                               | 476481            | 4                    |
| 270                                                     | NAS1801-3-6   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                                                                                                                                                                                                                                                                      | 476481            | 4                    |
| 275                                                     | NAS1149D0332J | .WASHER<br>-----*-----                                                                                                                                                                                                                                                                                               | 476481            | 4                    |
| 280                                                     | 1L500105-16   | .THRESHOLD-<br>SUPPLIER CODE:<br>V6S8D7                                                                                                                                                                                                                                                                              | 476481            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |               |                                                                                                                                                                                                                                                                                                                      |                   |                      |

— ITEM NOT ILLUSTRATED

RYR

25-40-15-13S

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-15  
 FIG. 13S  
 PAGE 4  
 APR 15/23


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 | NOMENCLATURE                                                                       | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|---------------|------------------------------------------------------------------------------------|-------------------|----------------------|
| 13S                                                     |                |               |                                                                                    |                   |                      |
| 285                                                     | NAS8703A4      |               | ATTACHING PARTS<br>.BOLT<br>STANDARD SUBSTITUTION:<br>BACB30ZE3K4<br>-----*-----   | 476481            | 4                    |
| 290                                                     | 1L500109-147   |               | .SPACER-THRESHOLD<br>SUPPLIER CODE:<br>V6S8D7                                      | 476481            | 1                    |
| 295                                                     | 1L400040-42    |               | .COVER-TRASH TRAP<br>SUPPLIER CODE:<br>V6S8D7                                      | 476481            | 1                    |
| 300                                                     | NAS8303-7      |               | ATTACHING PARTS<br>.SCREW<br>-----*-----                                           | 476481            | 1                    |
| 305                                                     | 1L400109-404BA |               | .KICKSTRIP ASSY-<br>SUPPLIER CODE:<br>V6S8D7                                       | 476481            | 1                    |
| 310                                                     | NAS514P832-5   |               | ATTACHING PARTS<br>.SCREW                                                          | 476481            | 3                    |
| 315                                                     | NAS514P632-5   |               | .SCREW<br>-----*-----                                                              | 476481            | 1                    |
| 320                                                     | 1L500109-463BA |               | ..CAP-KICKSTRIP<br>SUPPLIER CODE:<br>V6S8D7                                        | 476481            | 1                    |
| 325                                                     | 1L500109-472BA |               | ..ENDCAP-KICKSTRIP<br>SUPPLIER CODE:<br>V6S8D7                                     | 476481            | 1                    |
| 330                                                     | 1L500109-474BA |               | ..RETAINER-KICKSTRIP<br>SUPPLIER CODE:<br>V6S8D7                                   | 476481            | 1                    |
| - 335                                                   | 1L360051-1285A |               | .LAVATORY ASSY-<br>SUPPLIER CODE:<br>V6S8D7                                        | 476481            | 1                    |
| 340                                                     | 1L306051-221EW |               | ..STRUCTURE INSTL-<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-40-15-55D | 476481            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |               |                                                                                    |                   |                      |

- ITEM NOT ILLUSTRATED

RYR

25-40-15-13S

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-15  
 FIG. 13S  
 PAGE 5  
 APR 15/23




**BOEING**  
 737-600/700/800/900  
 PARTS CATALOG (MAINTENANCE)

| FIG<br>ITEM                                             | PART NUMBER  | 1 2 3 4 5 6 7 | NOMENCLATURE                                                                                                                                                                                                                              | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|--------------|---------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 13S<br>345                                              | 3L306050-111 |               | ..ELECTRICAL INSTL-STRUCT<br>SUPPLIER CODE:<br>V6S8D7<br>FUNCTIONAL REFERENCE:<br>EQUIPMENT/FURNISHINGS<br>FOR DETAILS SEE<br>25-40-15-55H<br>LIGHTS<br>FOR DETAILS SEE<br>33-27-51-14C<br>WATER/WASTE<br>FOR DETAILS SEE<br>38-32-04-06F | 476481            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |              |               |                                                                                                                                                                                                                                           |                   |                      |

— ITEM NOT ILLUSTRATED




R Y R

25-40-15-13S

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

25-40-15  
 FIG. 13S  
 PAGE 6  
 OCT 15/17

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

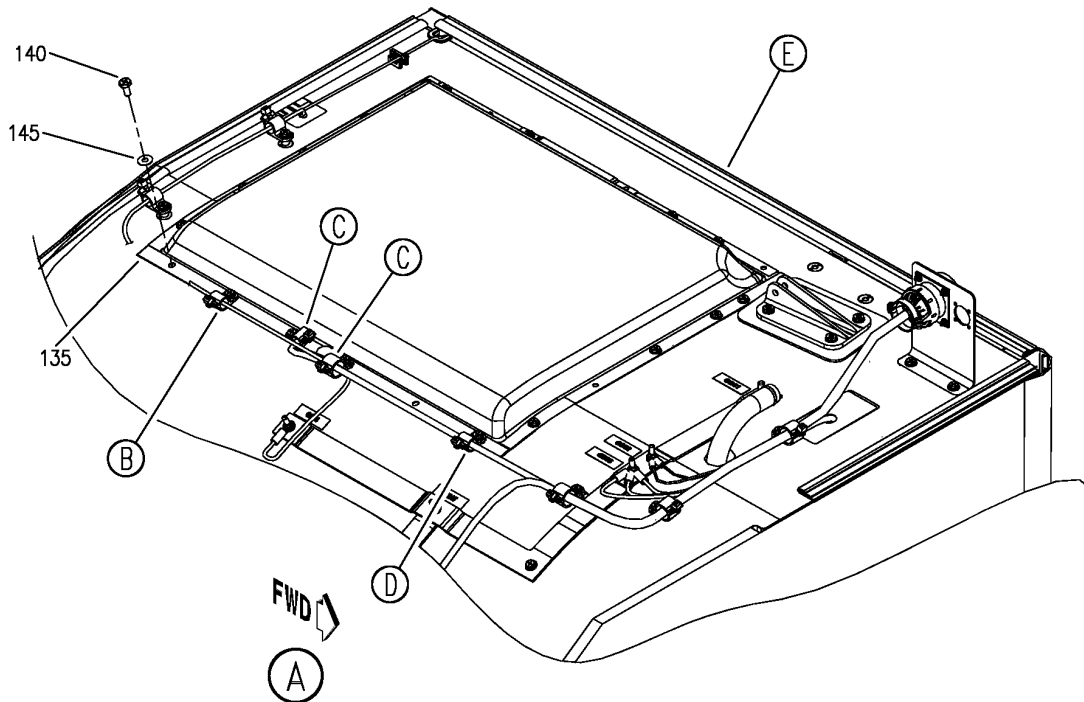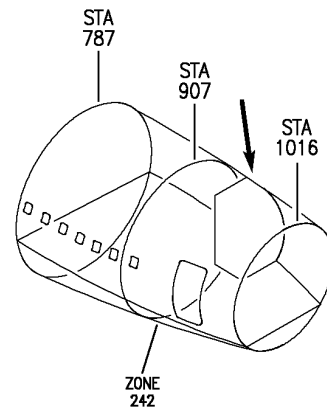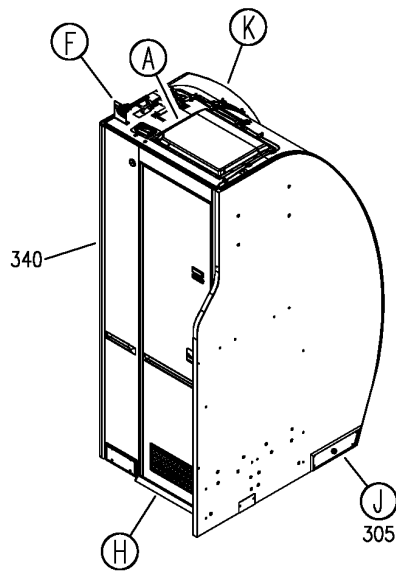

E 25401513T SHT 1 REV 257

MODULE ASSY-LAV E (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 13T (SHEET 1)




**25-40-15-13T**

RJR  
AUG 15/19

25-40-15-13T  
PAGE 0

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

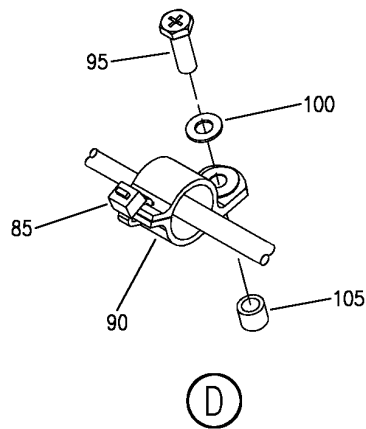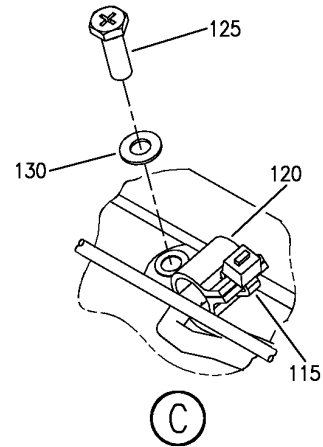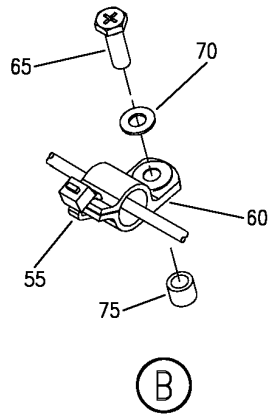

E 25401513T SH1 2 REV 257

MODULE ASSY-LAV E (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 13T (SHEET 2)


**25-40-15-13T**

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

R Y R  
AUG 15 / 19

25-40-15-13T  
PAGE 0A

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

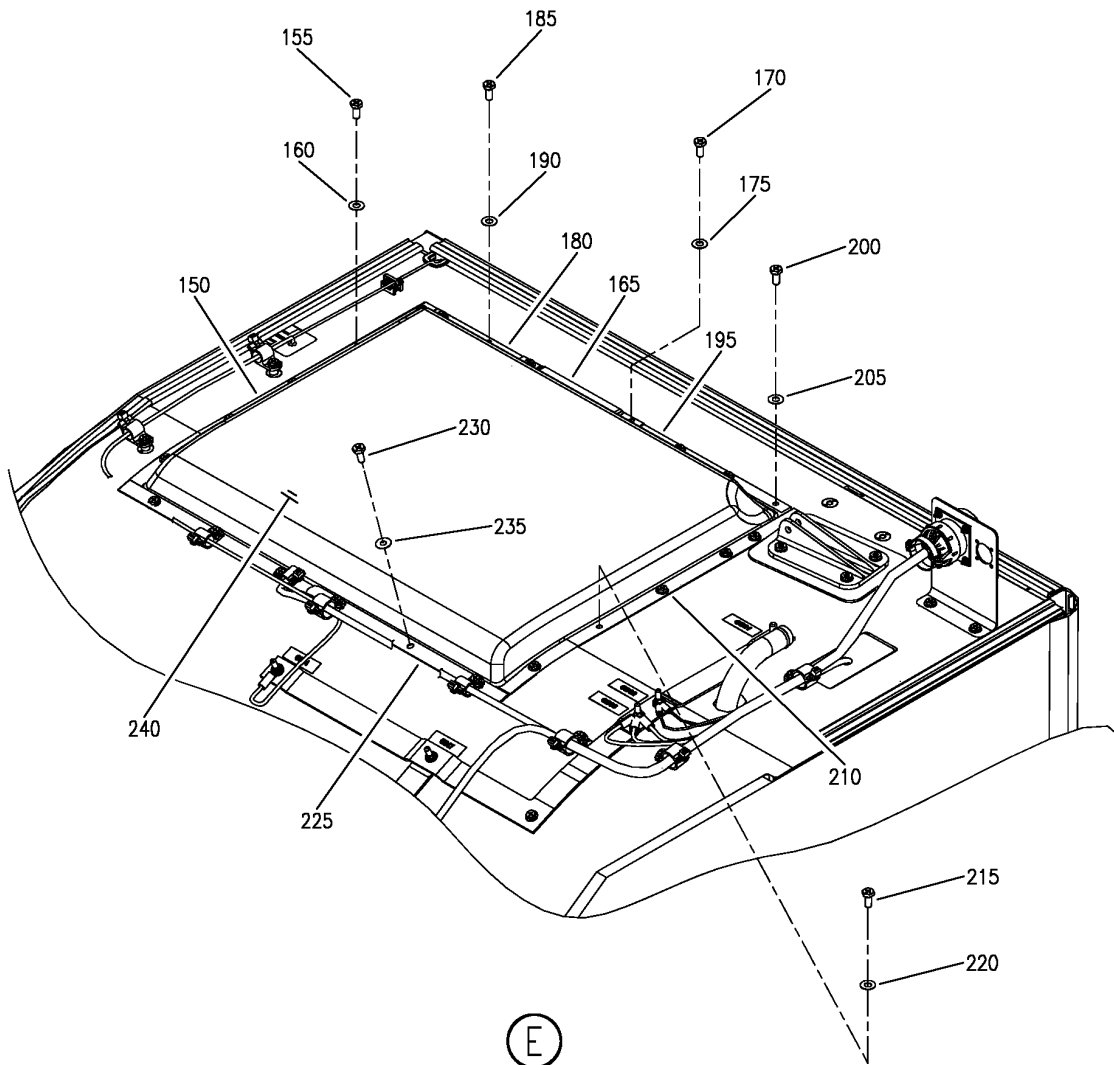

E 25401513T SH1 3 REV 257

MODULE ASSY-LAV E (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 13T (SHEET 3)


**25-40-15-13T**

R Y R  
AUG 15/19

25-40-15-13T  
PAGE 0B

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

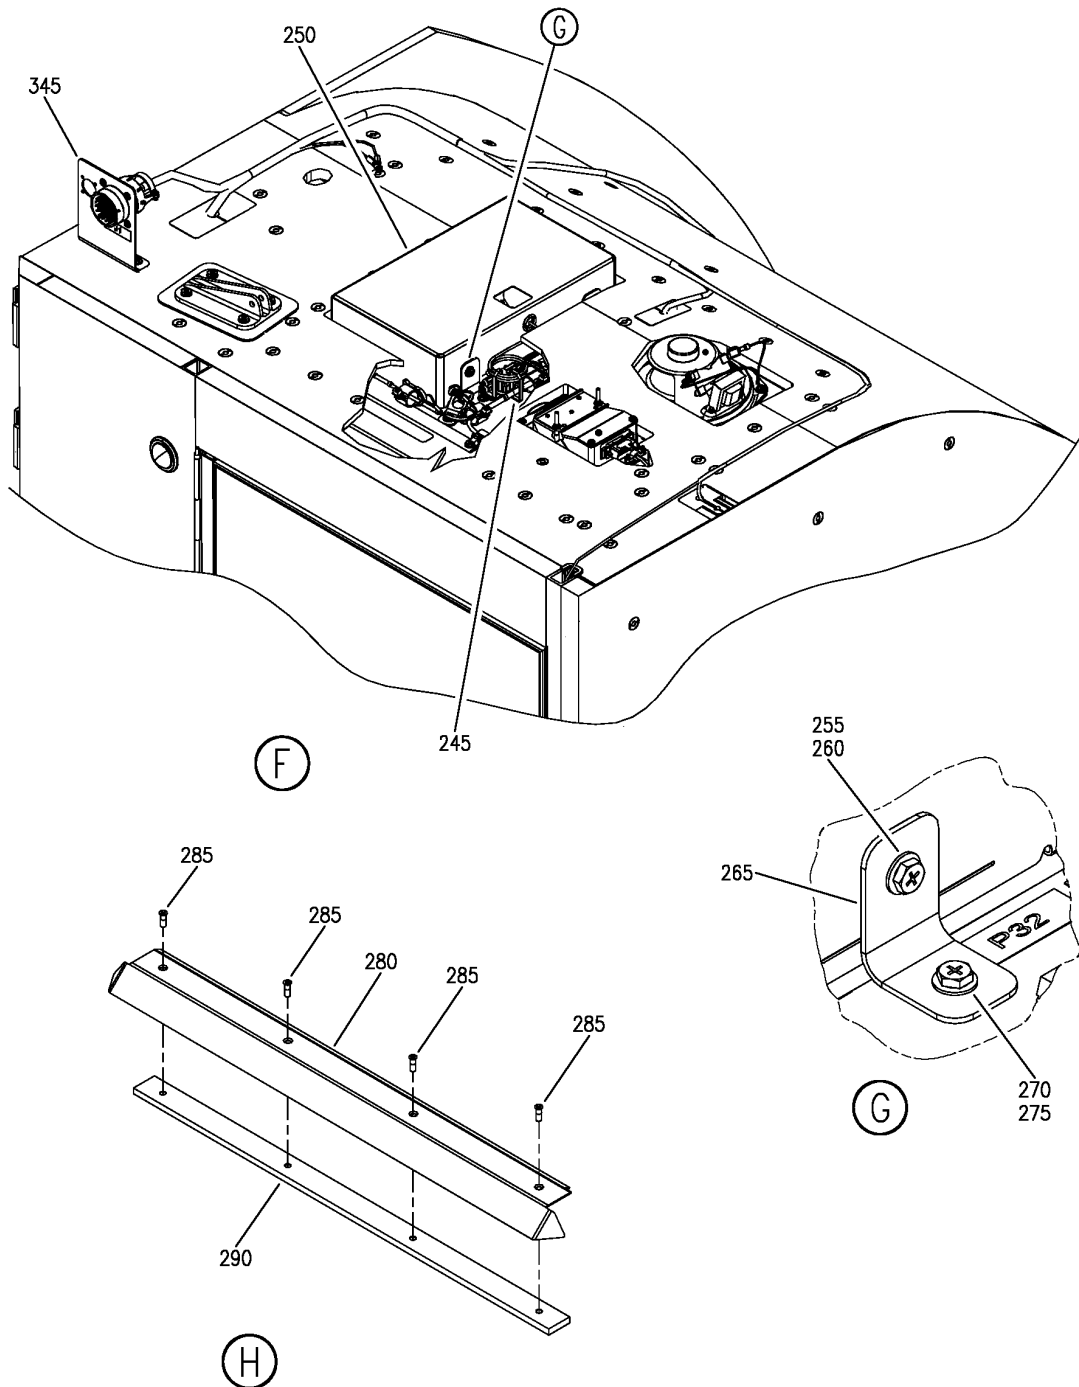

E 25401513T SHIT 4 REV 257

MODULE ASSY-LAV E (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 13T (SHEET 4)


**25-40-15-13T**

R Y R  
AUG 15/19

25-40-15-13T  
PAGE 0C

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

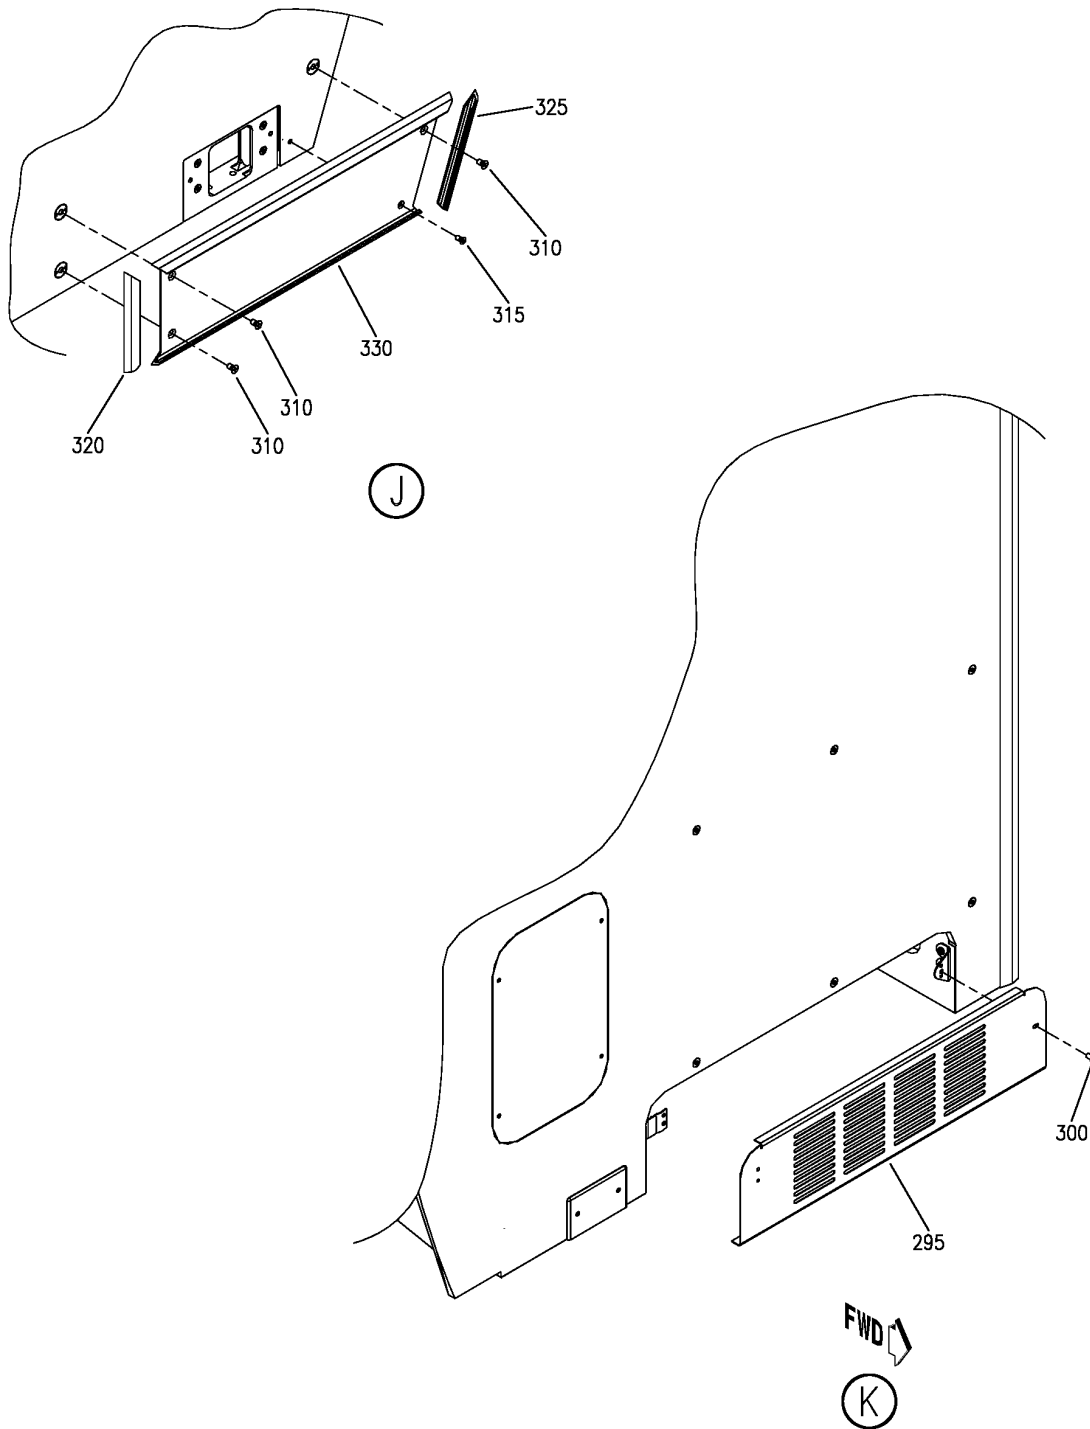

E 25401513T SHIT 5 REV 257

MODULE ASSY-LAV E (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 13T (SHEET 5)

**25-40-15-13T**

R Y R  
AUG 15/19

25-40-15-13T  
PAGE 0D

ECCN 9E991 BOEING PROPRIETARY - See title page for details.


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 | NOMENCLATURE                                                                                                                                                                                                                                                                                             | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|---------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 13T                                                     |                |               | MODULE ASSY-LAV E<br>(EQUIPMENT/FURNISHINGS<br>ONLY)                                                                                                                                                                                                                                                     | 482508            |                      |
| - 1                                                     | 1L300050-1285B |               | MODULE ASSY-LAV E<br>(EQUIPMENT/FURNISHINGS<br>ONLY)<br>SUPPLIER CODE:<br>V6S8D7<br>FUNCTIONAL DESCRIPTION:<br>PROVIDES LAVATORY<br>FACILITIES FOR<br>PASSENGERS AND CREW<br>ELECTRICAL EQUIP NUMBER:<br>M01419<br>COMPONENT MAINT MANUAL REF:<br>25-40-56<br>FOR NHA/OTHER SYS DET SEE:<br>25-40-15-01B | 482508            | RF                   |
| - 50                                                    | 9L500001-106   |               | .CLAMP INSTL-ELECTRICAL<br>SUPPLIER CODE:<br>V6S8D7                                                                                                                                                                                                                                                      | 482508            | 1                    |
| 55                                                      | MS3367-5-9     |               | ..STRAP<br>STANDARD SUBSTITUTION:<br>BACS38K5                                                                                                                                                                                                                                                            | 482508            | 1                    |
| 60                                                      | CA2030-2       |               | ..CLAMP-<br>SUPPLIER CODE:<br>V03296<br>ATTACHING PARTS                                                                                                                                                                                                                                                  | 482508            | 1                    |
| 65                                                      | NAS1801-3-10   |               | ..SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-10                                                                                                                                                                                                                                                        | 482508            | 1                    |
| 70                                                      | NAS1149D0316K  |               | ..WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J                                                                                                                                                                                                                                                      | 482508            | 1                    |
| 75                                                      | NAS43DD3-16N   |               | ..SPACER<br>STANDARD SUBSTITUTION:<br>NAS43DD3-16FC<br>-----*-----                                                                                                                                                                                                                                       | 482508            | 1                    |
| - 80                                                    | 9L500001-107   |               | .CLAMP INSTL-ELECTRICAL<br>SUPPLIER CODE:<br>V6S8D7                                                                                                                                                                                                                                                      | 482508            | 1                    |
| 85                                                      | MS3367-5-9     |               | ..STRAP<br>STANDARD SUBSTITUTION:<br>BACS38K5                                                                                                                                                                                                                                                            | 482508            | 1                    |
| 90                                                      | CA2030-3       |               | ..CLAMP-<br>SUPPLIER CODE:<br>V03296                                                                                                                                                                                                                                                                     | 482508            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |               |                                                                                                                                                                                                                                                                                                          |                   |                      |

- ITEM NOT ILLUSTRATED

RYR

25-40-15-13T

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-15  
FIG. 13T  
PAGE 1  
APR 15/23


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER   | 1 2 3 4 5 6 7 NOMENCLATURE                                           | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|---------------|----------------------------------------------------------------------|-------------------|----------------------|
| 13T                                                     |               |                                                                      |                   |                      |
| 95                                                      | NAS1801-3-10  | ATTACHING PARTS<br>..SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-10 | 482508            | 1                    |
| 100                                                     | NAS1149D0316K | ..WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J                  | 482508            | 1                    |
| 105                                                     | NAS43DD3-16N  | ..SPACER<br>STANDARD SUBSTITUTION:<br>NAS43DD3-16FC                  | 482508            | 1                    |
| - 110                                                   | 9L500001-103  | -----*-----<br>.CLAMP INSTL-ELECTRICAL<br>SUPPLIER CODE:<br>V6S8D7   | 482508            | 2                    |
| 115                                                     | MS3367-5-9    | ..STRAP<br>STANDARD SUBSTITUTION:<br>BACS38K5                        | 482508            | 1                    |
| 120                                                     | CA2030-3      | ..CLAMP-<br>SUPPLIER CODE:<br>V03296<br>ATTACHING PARTS              | 482508            | 1                    |
| 125                                                     | NAS1801-3-6   | ..SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                     | 482508            | 1                    |
| 130                                                     | NAS1149D0316K | ..WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J<br>-----*-----   | 482508            | 1                    |
| 135                                                     | 1L500409-795  | .STRAP-FIRE BLANKET<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS   | 482508            | 1                    |
| 140                                                     | NAS1801-3-6   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                      | 482508            | 1                    |
| 145                                                     | NAS1149D0316K | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J<br>-----*-----    | 482508            | 1                    |
| 150                                                     | 1L500409-781  | .STRAP-FIRE BLANKET<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS   | 482508            | 1                    |
| 155                                                     | NAS1801-3-6   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                      | 482508            | 5                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |               |                                                                      |                   |                      |

- ITEM NOT ILLUSTRATED

R Y R

25-40-15-13T

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-15  
 FIG. 13T  
 PAGE 2  
 APR 15/23




**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER   | 1 2 3 4 5 6 7 | NOMENCLATURE                                                      | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|---------------|---------------|-------------------------------------------------------------------|-------------------|----------------------|
| 13T<br>160                                              | NAS1149D0316K | .             | WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J<br>-----*-----  | 482508            | 5                    |
| 165                                                     | 1L500409-791  | .             | STRAP-FIRE BLANKET<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS | 482508            | 1                    |
| 170                                                     | NAS1801-3-6   | .             | SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                    | 482508            | 2                    |
| 175                                                     | NAS1149D0316K | .             | WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J<br>-----*-----  | 482508            | 2                    |
| 180                                                     | 1L500409-723  | .             | STRAP-FIRE BLANKET<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS | 482508            | 1                    |
| 185                                                     | NAS1801-3-6   | .             | SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                    | 482508            | 2                    |
| 190                                                     | NAS1149D0316K | .             | WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J<br>-----*-----  | 482508            | 2                    |
| 195                                                     | 1L500409-721  | .             | STRAP-FIRE BLANKET<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS | 482508            | 1                    |
| 200                                                     | NAS1801-3-6   | .             | SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                    | 482508            | 3                    |
| 205                                                     | NAS1149D0316K | .             | WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J<br>-----*-----  | 482508            | 3                    |
| 210                                                     | 1L500409-787  | .             | STRAP-FIRE BLANKET<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS | 482508            | 1                    |
| 215                                                     | NAS1801-3-6   | .             | SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                    | 482508            | 5                    |
| 220                                                     | NAS1149D0316K | .             | WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J<br>-----*-----  | 482508            | 5                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |               |               |                                                                   |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R

25-40-15-13T

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-15  
 FIG. 13T  
 PAGE 3  
 APR 15/23


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER   | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                                                                                                                                                                                                                           | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|---------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 13T<br>225                                              | 1L500409-797  | .STRAP-FIRE BLANKET<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                                                                                                                                                                                                                                                   | 482508            | 1                    |
| 230                                                     | NAS1801-3-6   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                                                                                                                                                                                                                                                                      | 482508            | 1                    |
| 235                                                     | NAS1149D0316K | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J<br>-----*-----                                                                                                                                                                                                                                                    | 482508            | 1                    |
| 240                                                     | 1L500409-793  | .BLANKET-FIRE<br>SUPPLIER CODE:<br>V6S8D7                                                                                                                                                                                                                                                                            | 482508            | 1                    |
| 245                                                     | MS3367-5-9    | .STRAP<br>STANDARD SUBSTITUTION:<br>BACS38K5                                                                                                                                                                                                                                                                         | 482508            | AR                   |
| 250                                                     | 4576001-101   | .BOX ASSY-OXY<br>SUPPLIER CODE:<br>V16827<br>FUNCTIONAL DESCRIPTION:<br>STORES OXYGEN AND MASK<br>ASSEMBLIES. CONTROLS THE<br>DELIVERY OF OXYGEN TO<br>EACH MASK AND<br>COMMUNICATES WITH THE<br>AIRPLANE NETWORK.<br>COMPONENT MAINT MANUAL REF:<br>25-23-68<br>FOR DETAILS SEE:<br>35-21-00-01A<br>ATTACHING PARTS | 482508            | 1                    |
| 255                                                     | NAS1801-3-6   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                                                                                                                                                                                                                                                                      | 482508            | 4                    |
| 260                                                     | NAS1149D0332J | .WASHER<br>-----*-----                                                                                                                                                                                                                                                                                               | 482508            | 4                    |
| 265                                                     | 4L500403-17   | .ANGLE-<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                                                                                                                                                                                                                                                               | 482508            | 4                    |
| 270                                                     | NAS1801-3-6   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                                                                                                                                                                                                                                                                      | 482508            | 4                    |
| 275                                                     | NAS1149D0332J | .WASHER<br>-----*-----                                                                                                                                                                                                                                                                                               | 482508            | 4                    |
| 280                                                     | 1L500105-16   | .THRESHOLD-<br>SUPPLIER CODE:<br>V6S8D7                                                                                                                                                                                                                                                                              | 482508            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |               |                                                                                                                                                                                                                                                                                                                      |                   |                      |

— ITEM NOT ILLUSTRATED

RYR

25-40-15-13T

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-15  
 FIG. 13T  
 PAGE 4  
 APR 15/23


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 | NOMENCLATURE                                                                      | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|---------------|-----------------------------------------------------------------------------------|-------------------|----------------------|
| 13T                                                     |                |               |                                                                                   |                   |                      |
| 285                                                     | NAS8703A4      |               | ATTACHING PARTS<br>.BOLT<br>STANDARD SUBSTITUTION:<br>BACB30ZE3K4<br>-----*-----  | 482508            | 4                    |
| 290                                                     | 1L500109-147   |               | .SPACER-THRESHOLD<br>SUPPLIER CODE:<br>V6S8D7                                     | 482508            | 1                    |
| 295                                                     | 1L400040-42    |               | .COVER-TRASH TRAP<br>SUPPLIER CODE:<br>V6S8D7                                     | 482508            | 1                    |
| 300                                                     | NAS8303-7      |               | ATTACHING PARTS<br>.SCREW<br>-----*-----                                          | 482508            | 1                    |
| 305                                                     | 1L400109-404BA |               | .KICKSTRIP ASSY-<br>SUPPLIER CODE:<br>V6S8D7                                      | 482508            | 1                    |
| 310                                                     | NAS514P832-5   |               | ATTACHING PARTS<br>.SCREW                                                         | 482508            | 3                    |
| 315                                                     | NAS514P632-5   |               | .SCREW<br>-----*-----                                                             | 482508            | 1                    |
| 320                                                     | 1L500109-463BA |               | ..CAP-<br>SUPPLIER CODE:<br>V6S8D7                                                | 482508            | 1                    |
| 325                                                     | 1L500109-472BA |               | ..ENDCAP-<br>SUPPLIER CODE:<br>V6S8D7                                             | 482508            | 1                    |
| 330                                                     | 1L500109-474BA |               | ..RETAINER-<br>SUPPLIER CODE:<br>V6S8D7                                           | 482508            | 1                    |
| - 335                                                   | 1L360051-1285B |               | .LAVATORY ASSY-<br>SUPPLIER CODE:<br>V6S8D7                                       | 482508            | 1                    |
| 340                                                     | 1L306051-221HF |               | ..STRUCTURE ASSY-<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-40-15-55D | 482508            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |               |                                                                                   |                   |                      |

- ITEM NOT ILLUSTRATED

R Y R

25-40-15-13T

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-15  
 FIG. 13T  
 PAGE 5  
 APR 15/23


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER  | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                                                                                                                                                | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|--------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 13T<br>345                                              | 3L306050-111 | ..ELECTRICAL INSTL-STRUCT<br>SUPPLIER CODE:<br>V6S8D7<br>FUNCTIONAL REFERENCE:<br>EQUIPMENT/FURNISHINGS<br>FOR DETAILS SEE<br>25-40-15-55H<br>LIGHTS<br>FOR DETAILS SEE<br>33-27-51-14C<br>WATER/WASTE<br>FOR DETAILS SEE<br>38-32-04-06F | 482508            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |              |                                                                                                                                                                                                                                           |                   |                      |


— ITEM NOT ILLUSTRATED

R Y R

25-40-15-13T

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

25-40-15  
 FIG. 13T  
 PAGE 6  
 AUG 15/19

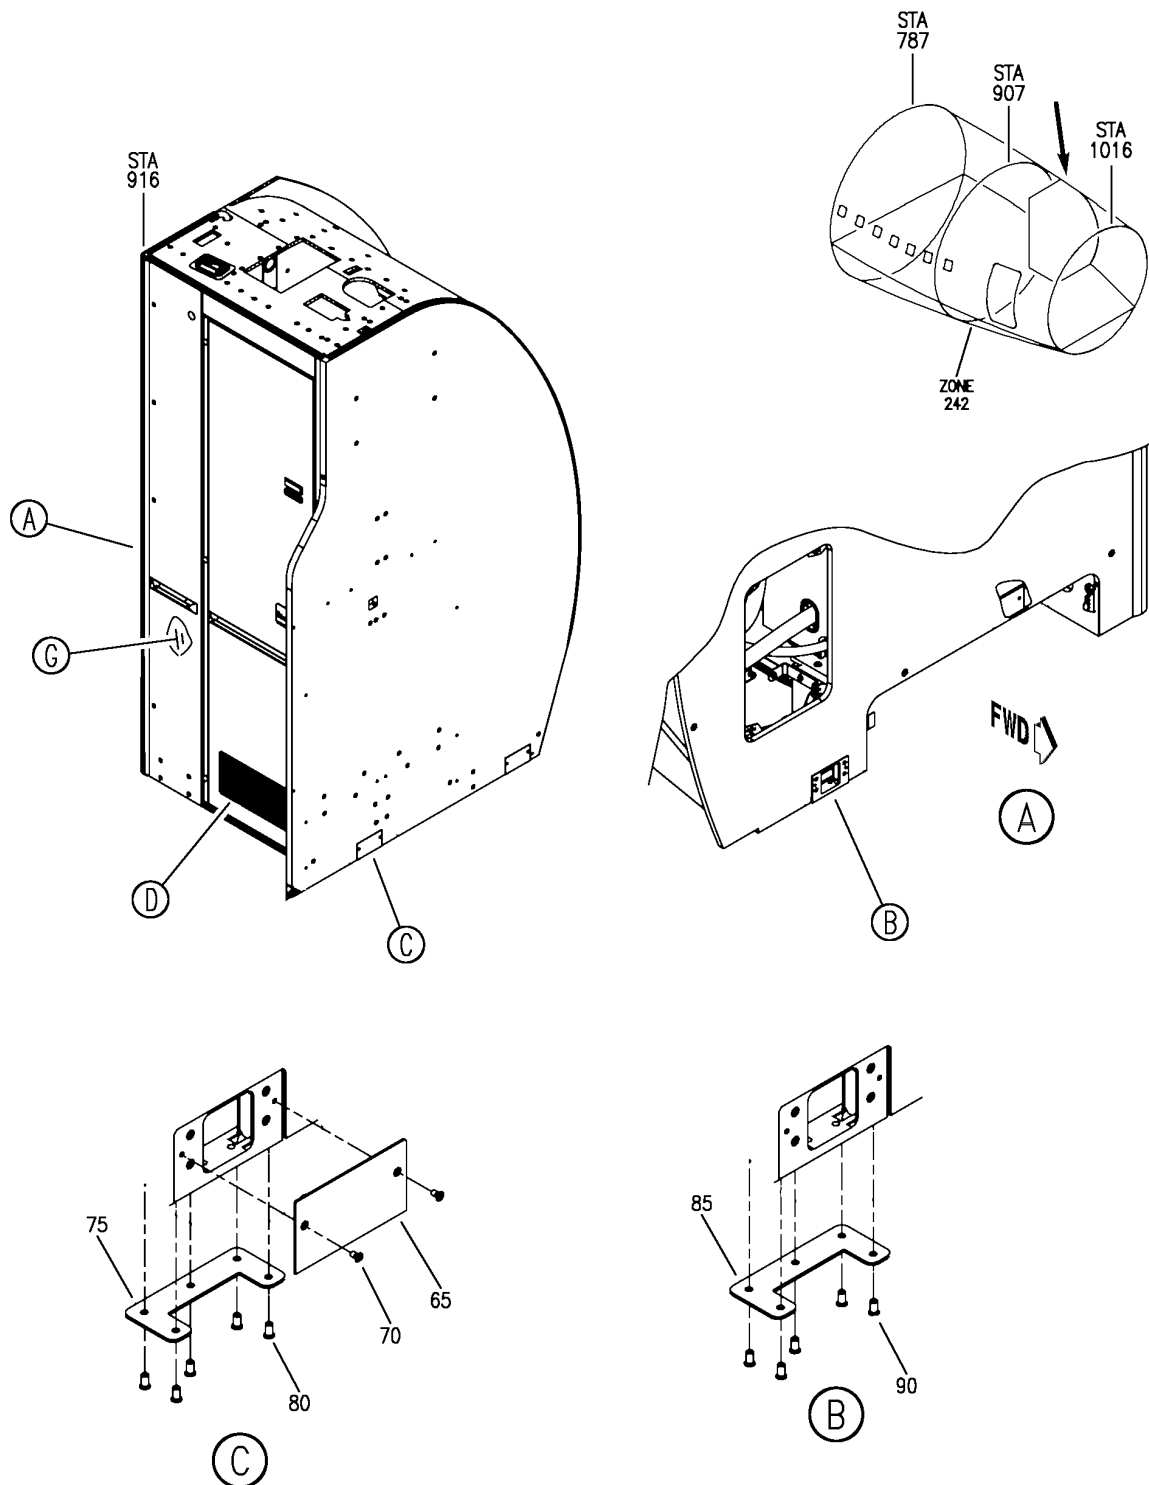


E 25401516C SHT 1 REV 253

STRUCTURE INSTL-LAV  
FIGURE 16C (SHEET 1)

**25-40-15-16C**

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

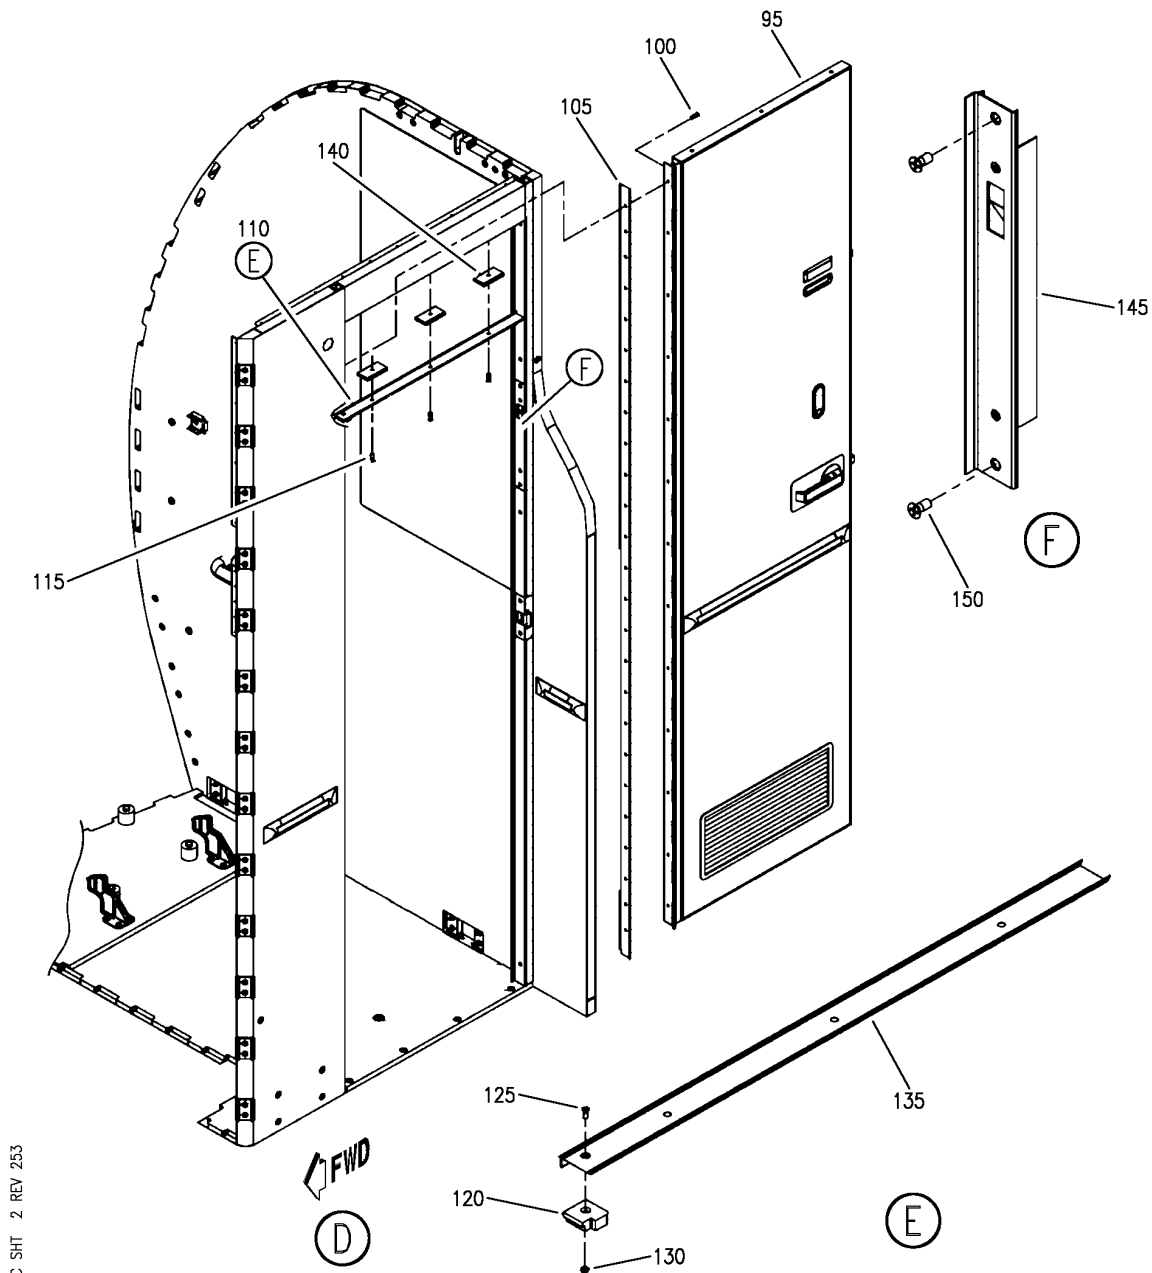

E 25401516C SHT 2 REV 253


STRUCTURE INSTL-LAV  
FIGURE 16C (SHEET 2)

**25-40-15-16C**

R/YR  
APR 15/18

25-40-15-16C  
PAGE 0A

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

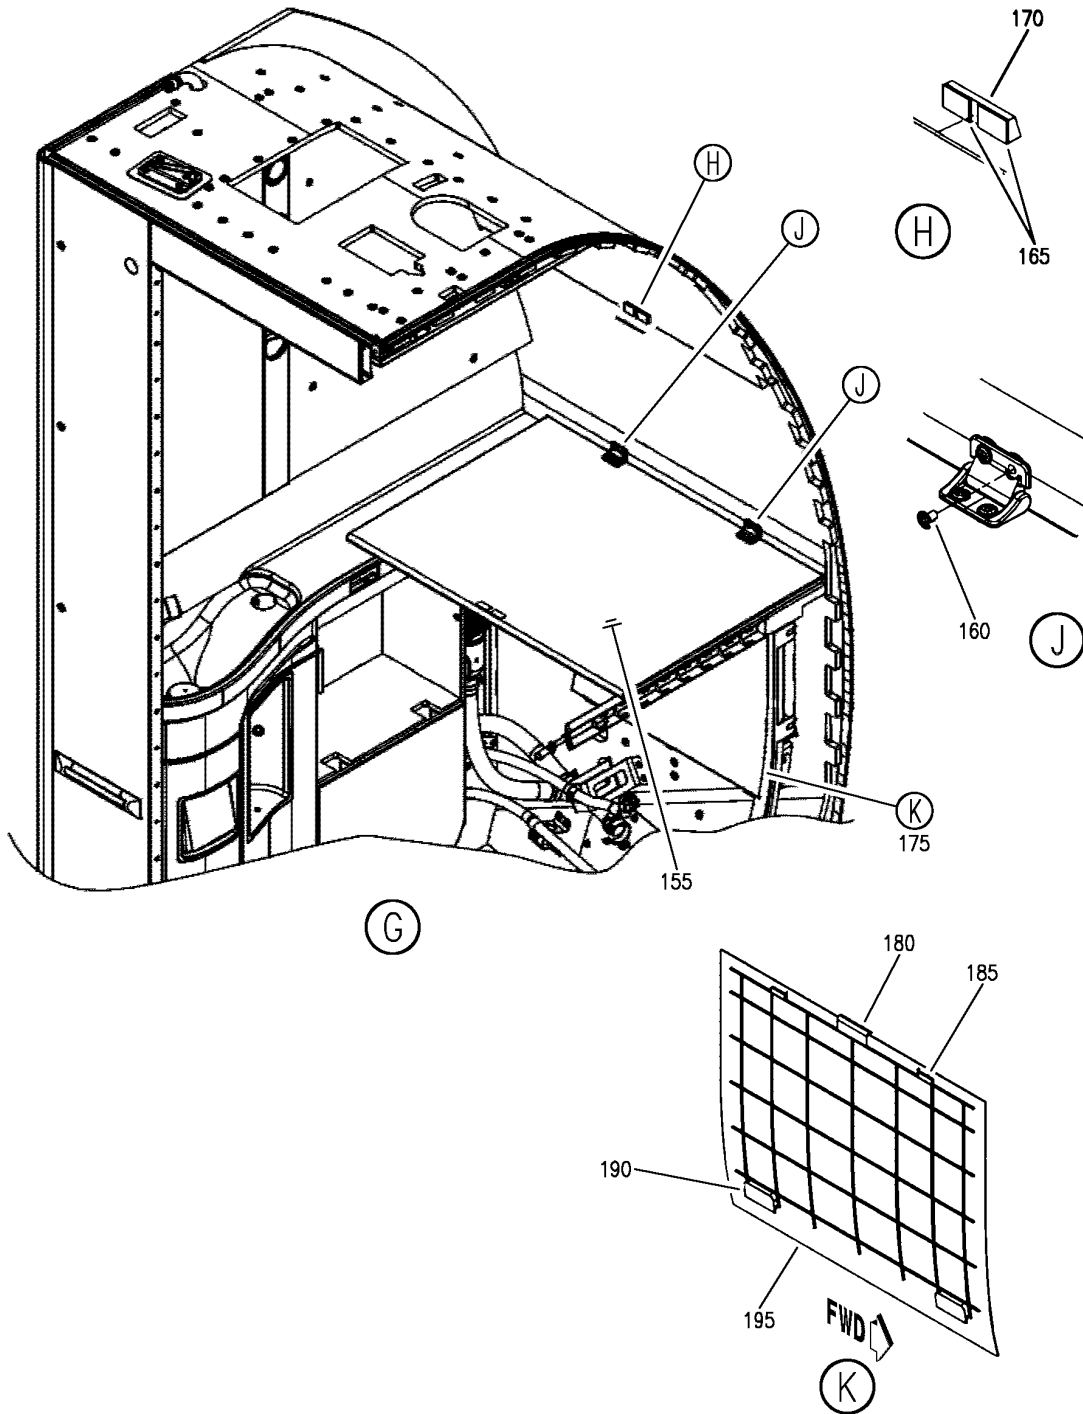

E 25401516C SHT 3 REV 261

STRUCTURE INSTL-LAV  
FIGURE 16C (SHEET 3)

**25-40-15-16C**

R Y R  
APR 15/18

25-40-15-16C  
PAGE 0B


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER     | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                                                                                                                               | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|-----------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 16C                                                     |                 |                                                                                                                                                                                                                          |                   |                      |
| - 1                                                     | 1L306051-437HF  | STRUCTURE INSTL-LAV<br>STRUCTURE ASSY-LAV E<br>SUPPLIER CODE:<br>V6S8D7<br>FOR NHA SEE:<br>25-40-15-23P                                                                                                                  | 509999<br>509999  | RF                   |
| - 50                                                    | 1L306051-437HF1 | .STRUCTURE INSTL-<br>SUPPLIER CODE:<br>V6S8D7<br>MISCELLANEOUS DATA:<br>NON PROCURABLE<br>FUNCTIONAL REFERENCE:<br>EQUIPMENT/FURNISHINGS<br>FOR DETAILS SEE<br>25-40-15-18D<br>LIGHTS<br>FOR DETAILS SEE<br>33-26-03-33M | 509999            | RF                   |
| - 55                                                    | 1L306051-437HF2 | .STRUCTURE INSTL-<br>SUPPLIER CODE:<br>V6S8D7<br>MISCELLANEOUS DATA:<br>NON PROCURABLE<br>FOR DETAILS SEE:<br>25-40-15-20C                                                                                               | 509999            | RF                   |
| - 60                                                    | 1L306051-437HF3 | .STRUCTURE INSTL-<br>SUPPLIER CODE:<br>V6S8D7<br>MISCELLANEOUS DATA:<br>NON PROCURABLE<br>FOR DETAILS SEE:<br>25-40-15-20D                                                                                               | 509999            | RF                   |
| 65                                                      | 1L500409-841CH  | .PLATE-COVER<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                                                                                                                                                              | 509999            | 2                    |
| 70                                                      | NAS514P632-5    | .SCREW<br>-----*-----                                                                                                                                                                                                    | 509999            | 4                    |
| 75                                                      | 1L500409-253    | .PLATE-SHEAR<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                                                                                                                                                              | 509999            | 2                    |
| 80                                                      | BACB30VF3K1     | .BOLT<br>-----*-----                                                                                                                                                                                                     | 509999            | 10                   |
| 85                                                      | 1L500409-257    | .PLATE-SHEAR<br>SUPPLIER CODE:<br>V6S8D7                                                                                                                                                                                 | 509999            | 2                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                 |                                                                                                                                                                                                                          |                   |                      |

— ITEM NOT ILLUSTRATED

RYR

25-40-15-16C

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-15  
FIG. 16C  
PAGE 1  
APR 15/18




**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER   | 1 2 3 4 5 6 7 | NOMENCLATURE                                                                                                                                              | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|---------------|---------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 16C                                                     |               |               |                                                                                                                                                           |                   |                      |
| 90                                                      | BACB30VF3K1   |               | ATTACHING PARTS<br>.BOLT<br>-----*-----                                                                                                                   | 509999            | 10                   |
| 95                                                      | 1L400105-34HF |               | .DOOR ASSY-<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-41-17-05M<br>ATTACHING PARTS<br>.BOLT<br>-----*-----                                    | 509999            | 1                    |
| 100                                                     | NAS8603-4     |               | .TRIM-EDGE<br>SUPPLIER CODE:<br>V6S8D7                                                                                                                    | 509999            | 13                   |
| 105                                                     | 1L500109-302  |               | .TRIM ASSY-DOOR<br>SUPPLIER CODE:<br>V6S8D7                                                                                                               | 509999            | 1                    |
| 110                                                     | 1L500109-462  |               | ATTACHING PARTS<br>.BOLT<br>STANDARD SUBSTITUTION:<br>BACB30ZE3K4<br>-----*-----                                                                          | 509999            | 3                    |
| 120                                                     | 1L500105-170  |               | ..BLOCK-CLOSE-OUT<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS<br>..SCREW<br>..NUT<br>STANDARD SUBSTITUTION:<br>MS21042L04<br>BACN11AG04<br>-----*----- | 509999            | 1                    |
| 125                                                     | NAS514P440-5  |               | ..TRIM-OPENING<br>SUPPLIER CODE:<br>V6S8D7<br>CONFIG CHG DATA FROM A CMM:<br>SUPSD BY 1L500109-628                                                        | 509999            | 1                    |
| 130                                                     | MS21042-04    |               | ..TRIM-OPENING<br>SUPPLIER CODE:<br>V6S8D7<br>CONFIG CHG DATA FROM A CMM:<br>SUPERSEDES 1L500109-460                                                      | 509999            | 1                    |
| 135                                                     | 1L500109-460  |               | .SPACER-BLK<br>SUPPLIER CODE:<br>V6S8D7                                                                                                                   | 509999            | 3                    |
| 135                                                     | 1L500109-628  |               |                                                                                                                                                           |                   |                      |
| 140                                                     | 1L500409-267  |               |                                                                                                                                                           |                   |                      |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |               |               |                                                                                                                                                           |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R

25-40-15-16C

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-15  
FIG. 16C  
PAGE 2  
APR 15/23


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER  | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                                                                                                                                                          | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|--------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 16C<br>145                                              | 1L400109-94  | .SWITCH ASSY-<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>33-26-03-53A<br>ATTACHING PARTS                                                                                                                                                    | 509999            | 1                    |
| 150                                                     | NAS8703A1    | .BOLT<br>STANDARD SUBSTITUTION:<br>BACB30ZE3K1<br>-----*-----                                                                                                                                                                                       | 509999            | 2                    |
| 155                                                     | 1L460070-255 | .TABLE ASSY-BABY CHANGING<br>SUPPLIER CODE:<br>VH1XK6<br>FOR DETAILS SEE:<br>25-41-52-04<br>ATTACHING PARTS                                                                                                                                         | 509999            | 1                    |
| 160                                                     | NAS8302-5    | .SCREW<br>-----*-----                                                                                                                                                                                                                               | 509999            | 4                    |
| 165                                                     | 65PWF02      | .MAGNET-RECTANGULAR<br>SUPPLIER CODE:<br>V1B3S4<br>CONFIG CHG DATA FROM A CMM:<br>SUPSD BY 65PWF02-45<br>MISCELLANEOUS DATA:<br>ORDER LCCS7-2A                                                                                                      | 509999            | 2                    |
| 165                                                     | 65PWF02-45   | .MAGNET-RECTANGULAR<br>SUPPLIER CODE:<br>V1B3S4<br>CONFIG CHG DATA FROM A CMM:<br>SUPERSEDES 65PWF02<br>MISCELLANEOUS DATA:<br>ORDER LCCS7-6A                                                                                                       | 509999            | 2                    |
| 165                                                     | LCCS7-2A     | .MAGNET-RECTANGULAR<br>SUPPLIER CODE:<br>V6S8D7<br>TRUE PART NUMBER:<br>LCCS-7-2-A<br>CONFIG CHG DATA FROM A CMM:<br>SUPSD BY LCCS7-6A<br>MISCELLANEOUS DATA:<br>TRUE PART NO: LCCS-7-2-A<br><br>ADAMS MAGNETIC PRODUCTS<br>CO. PART NUMBER 65PWF02 | 509999            | 2                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |              |                                                                                                                                                                                                                                                     |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R

25-40-15-16C

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-15  
FIG. 16C  
PAGE 3  
FEB 15/24


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER  | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                                                                                                                                                                  | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|--------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 16C<br>165                                              | LCCS7-6A     | .MAGNET-RECTANGULAR<br>SUPPLIER CODE:<br>V6S8D7<br>TRUE PART NUMBER:<br>LCCS-7-6-A<br>CONFIG CHG DATA FROM A CMM:<br>SUPERSEDES LCCS7-2A<br>MISCELLANEOUS DATA:<br>TRUE PART NO: LCCS-7-6-A<br><br>ADAMS MAGNETIC PRODUCTS<br>CO. PART NUMBER<br>65PWF02-45 | 509999            | 2                    |
| 170                                                     | 1L500411-69  | .SPACER-MAGNET<br>SUPPLIER CODE:<br>V6S8D7                                                                                                                                                                                                                  | 509999            | 1                    |
| 175                                                     | 1L400107-17  | .SHROUD ASSY-CTR<br>SUPPLIER CODE:<br>V6S8D7                                                                                                                                                                                                                | 509999            | 1                    |
| 180                                                     | 1L500107-73  | ..HANDLE-PULL<br>SUPPLIER CODE:<br>V6S8D7                                                                                                                                                                                                                   | 509999            | 1                    |
| 185                                                     | 02-14-301-14 | ..STRIKER-SELF-ADHESIVE<br>SUPPLIER CODE:<br>V94222                                                                                                                                                                                                         | 509999            | 2                    |
| 190                                                     | 1L500407-117 | ..BLOCK-GUIDE<br>SUPPLIER CODE:<br>V6S8D7                                                                                                                                                                                                                   | 509999            | 2                    |
| 195                                                     | 1L500107-71  | ..SHROUD-CTR<br>SUPPLIER CODE:<br>V6S8D7                                                                                                                                                                                                                    | 509999            | 1                    |
| - 200                                                   | SJ5327       | .BUMPER-<br>SUPPLIER CODE:<br>V07080<br>TRUE PART NUMBER:<br>SJ-5327                                                                                                                                                                                        | 509999            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |              |                                                                                                                                                                                                                                                             |                   |                      |

— ITEM NOT ILLUSTRATED


RYR

25-40-15-16C

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

25-40-15  
FIG. 16C  
PAGE 4  
FEB 15/24

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

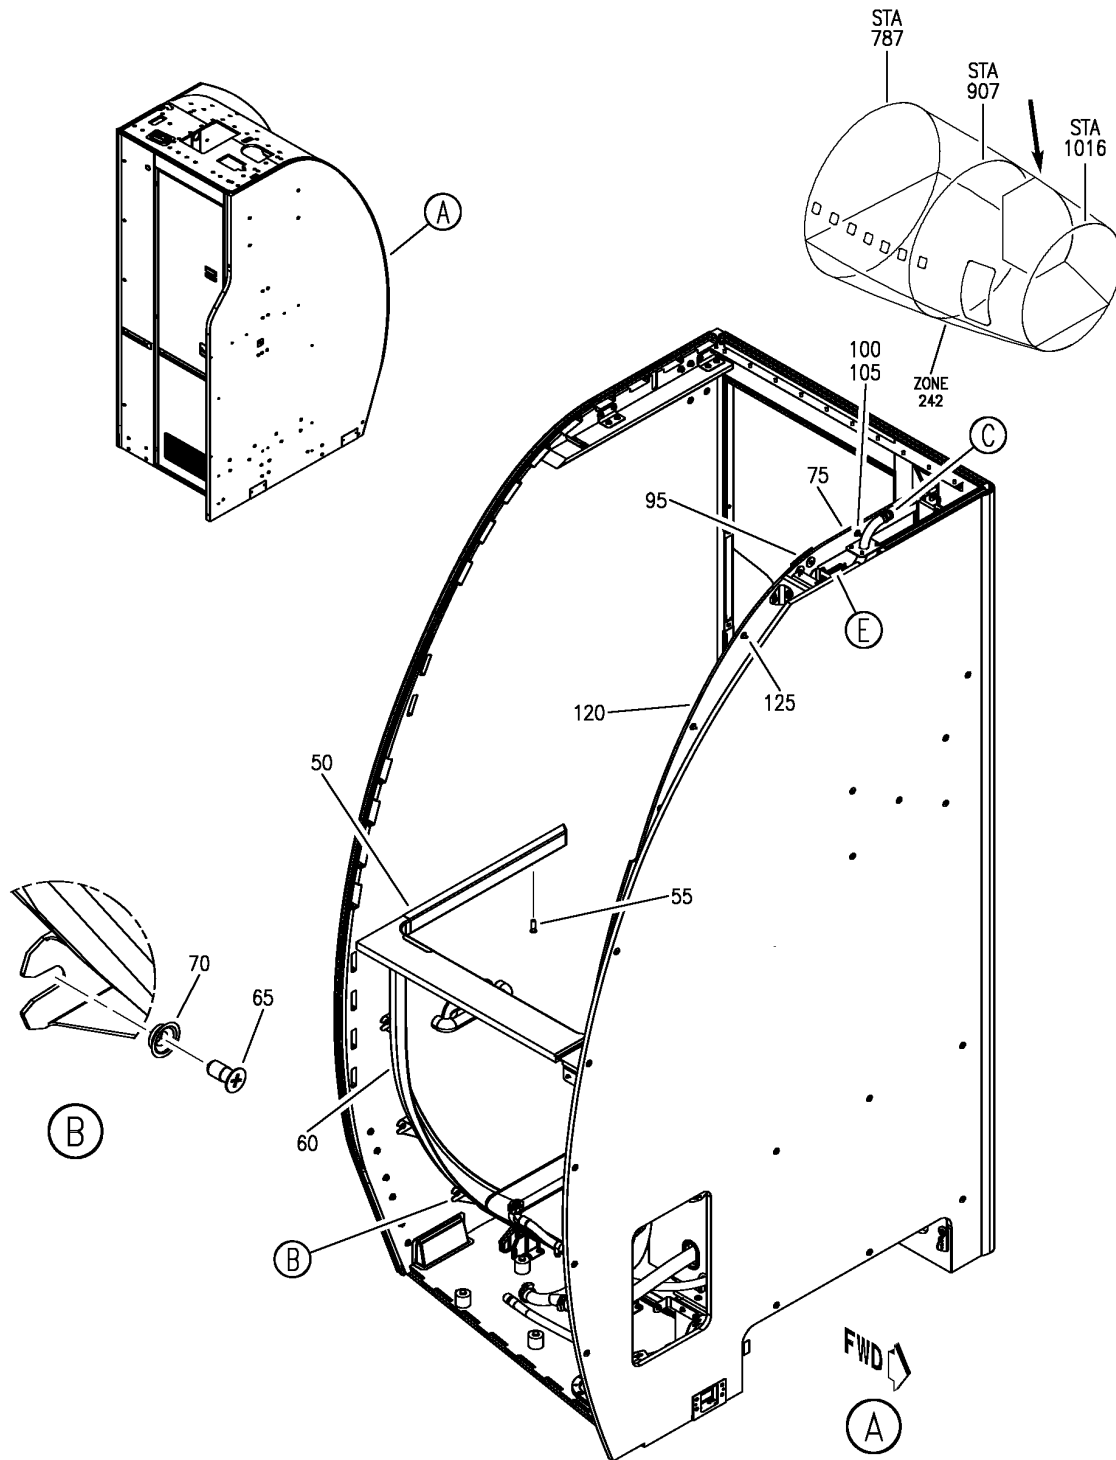

E 25401518D SHT 1 REV 251

STRUCTURE INSTL-LAV (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 18D (SHEET 1)


**25-40-15-18D**

RJR  
APR 15/18

25-40-15-18D  
PAGE 0

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

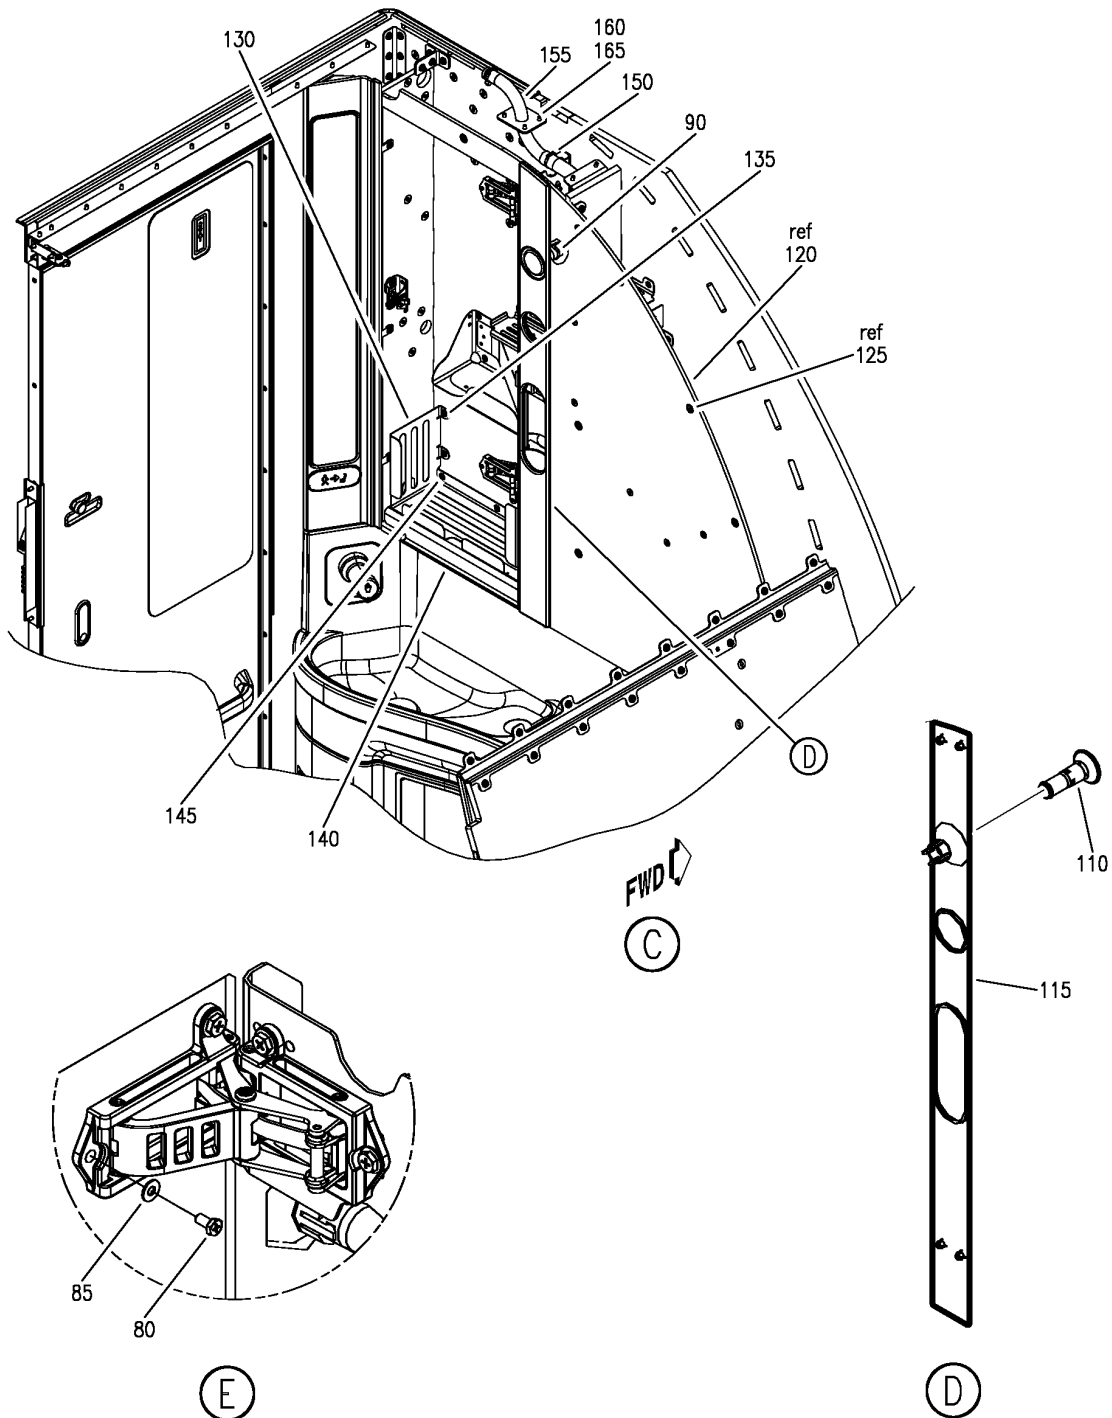

E 25401518D SHT 2 REV 251

STRUCTURE INSTL-LAV (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 18D (SHEET 2)

**25-40-15-18D**

R Y R  
APR 15 / 18

25-40-15-18D  
PAGE 0A


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER     | 1 2 3 4 5 6 7 | NOMENCLATURE                                                                                                                      | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|-----------------|---------------|-----------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 18D                                                     |                 |               | STRUCTURE INSTL-LAV<br>(EQUIPMENT/FURNISHINGS<br>ONLY)                                                                            | 509999            |                      |
| - 1                                                     | 1L306051-437HF1 |               | STRUCTURE INSTL-LAV<br>E(EQUIPMENT/FURNISHINGS<br>ONLY)<br>SUPPLIER CODE:<br>V6S8D7<br>FOR NHA/OTHER SYS DET SEE:<br>25-40-15-16C | 509999            | RF                   |
| 50                                                      | 1L500413-95     |               | .TRIM-AFT WALL<br>SUPPLIER CODE:<br>V6S8D7                                                                                        | 509999            | 1                    |
| 55                                                      | NAS514P832-8    |               | ATTACHING PARTS<br>.SCREW                                                                                                         | 509999            | 1                    |
| 60                                                      | 1L500407-106    |               | -----*-----<br>.SHROUD-RH-OUTBD TOILET<br>SUPPLIER CODE:<br>V6S8D7                                                                | 509999            | 1                    |
| 65                                                      | NAS514P1032-6   |               | ATTACHING PARTS<br>.SCREW                                                                                                         | 509999            | 4                    |
| 70                                                      | 1L500407-203    |               | -----*-----<br>.FASTENER-SNAP<br>SUPPLIER CODE:<br>V6S8D7                                                                         | 509999            | 4                    |
| 75                                                      | 1L400503-107    |               | .MIRROR ASSY-HINGED<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-41-51-06B                                               | 509999            | 1                    |
| 80                                                      | NAS1801-3-5     |               | ATTACHING PARTS<br>.SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-5                                                                | 509999            | 6                    |
| 85                                                      | NAS1149D0332J   |               | .WASHER                                                                                                                           | 509999            | 6                    |
| 90                                                      | MS3367-5-9      |               | -----*-----<br>.STRAP<br>STANDARD SUBSTITUTION:<br>BACS38K5                                                                       | 509999            | 1                    |
| 95                                                      | 1L400403-28     |               | .STRIP ASSY-AMENITIES<br>SUPPLIER CODE:<br>V6S8D7                                                                                 | 509999            | 1                    |
| 100                                                     | NAS1801-08-6    |               | ATTACHING PARTS<br>.SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN08-6                                                               | 509999            | 4                    |
| 105                                                     | AN970-3         |               | .WASHER<br>-----*-----                                                                                                            | 509999            | 4                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                 |               |                                                                                                                                   |                   |                      |

- ITEM NOT ILLUSTRATED

RYR

25-40-15-18D

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-15  
FIG. 18D  
PAGE 1  
APR 15/23


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7                                                                                       | NOMENCLATURE                        | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|-----------------------------------------------------------------------------------------------------|-------------------------------------|-------------------|----------------------|
| 18D                                                     |                |                                                                                                     |                                     |                   |                      |
| 110                                                     | 1L400203-13    | ..                                                                                                  | GASPER-<br>SUPPLIER CODE:<br>V6S8D7 | 509999            | 1                    |
| 115                                                     | 1L500403-20    | ..                                                                                                  | STRIP-<br>SUPPLIER CODE:<br>V6S8D7  | 509999            | 1                    |
| 120                                                     | 1L460050-325   | .VANITY ASSY-UPR<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-41-51-06C<br>ATTACHING PARTS |                                     | 509999            | 1                    |
| 125                                                     | NAS514P1032-10 | .SCREW<br>-----*-----                                                                               |                                     | 509999            | 11                   |
| 130                                                     | 1L500403-251   | .BRACKET-PAPER TOWEL<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                                 |                                     | 509999            | 1                    |
| 135                                                     | NAS8303-5      | .SCREW<br>-----*-----                                                                               |                                     | 509999            | 4                    |
| 140                                                     | 1L500103-216   | .SHROUD-LT<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                                           |                                     | 509999            | 1                    |
| 145                                                     | NAS8303-4      | .SCREW<br>-----*-----                                                                               |                                     | 509999            | 6                    |
| 150                                                     | MS3367-5-9     | .STRAP<br>STANDARD SUBSTITUTION:<br>BACS38K5                                                        |                                     | 509999            | 2                    |
| 155                                                     | 1L400403-61    | .INTERFACE-GASPER<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                                    |                                     | 509999            | 1                    |
| 160                                                     | NAS1801-3-6    | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                                                     |                                     | 509999            | 4                    |
| 165                                                     | NAS1149D0332K  | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0332J<br>-----*-----                                   |                                     | 509999            | 4                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |                                                                                                     |                                     |                   |                      |


— ITEM NOT ILLUSTRATED

R Y R

25-40-15-18D

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-15  
 FIG. 18D  
 PAGE 2  
 APR 15/23

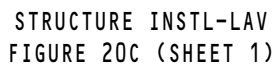


25-40-15-20C

ECCN 9E991 BOEING PROPRIETARY – See title page for details.



**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

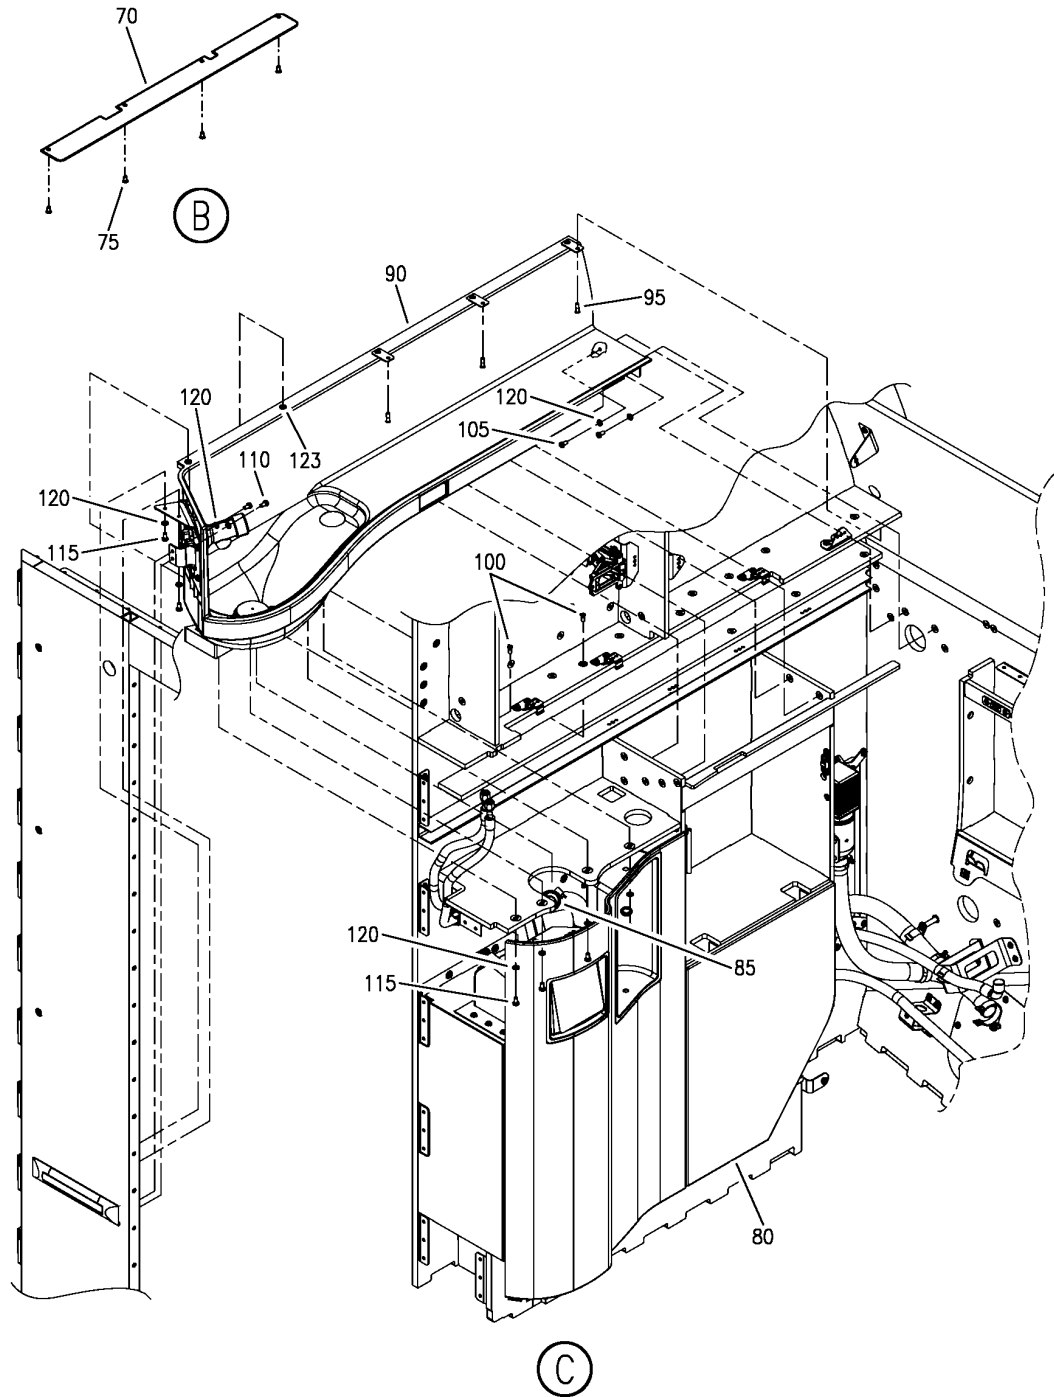

E 25401520C SHT 2 REV 251

STRUCTURE INSTL-LAV  
FIGURE 20C (SHEET 2)


**25-40-15-20C**

R Y R  
APR 15/18

25-40-15-20C  
PAGE 0A

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

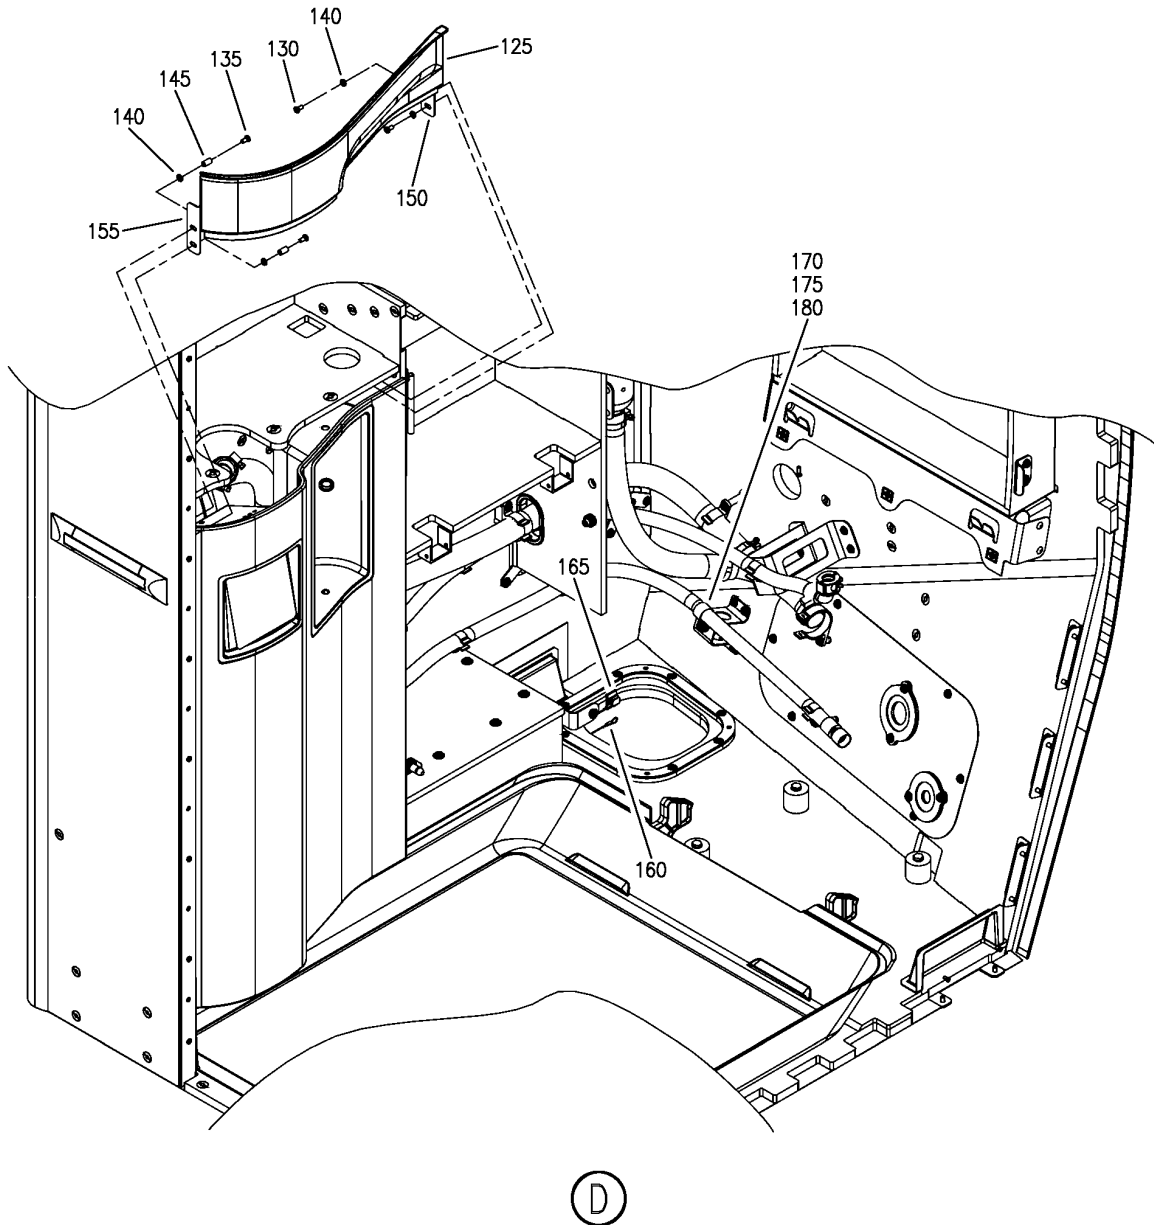

E 25401520C SHT 3 REV 251

STRUCTURE INSTL-LAV  
FIGURE 20C (SHEET 3)


**25-40-15-20C**

R Y R  
A P R 15 / 18

25-40-15-20C  
PAGE 0B

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

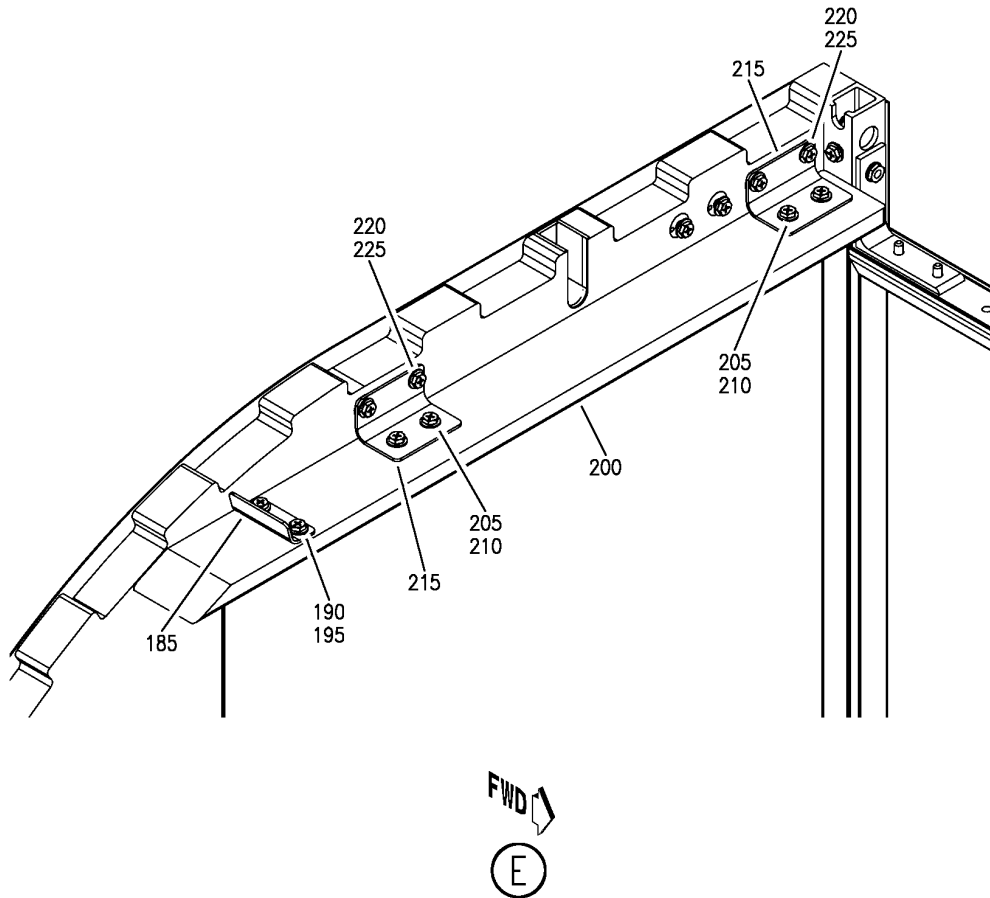

E 25401520C SHT 4 REV 251

STRUCTURE INSTL-LAV  
FIGURE 20C (SHEET 4)

**25-40-15-20C**

R Y R  
A P R 15 / 18

25-40-15-20C  
PAGE 0C

ECCN 9E991 BOEING PROPRIETARY – See title page for details.


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER     | 1 2 3 4 5 6 7 | NOMENCLATURE                                                                                                                                                                                  | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|-----------------|---------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 20C                                                     |                 |               |                                                                                                                                                                                               |                   |                      |
| - 1                                                     | 1L306051-437HF2 |               | STRUCTURE INSTL-LAV<br>STRUCTURE INSTL-LAV E<br>SUPPLIER CODE:<br>V6S8D7<br>FOR NHA SEE:<br>25-40-15-16C                                                                                      | 509999<br>509999  | RF                   |
| 50                                                      | 1L460050-351    |               | .LIGHT ASSY-<br>SUPPLIER CODE:<br>V6S8D7<br>FUNCTIONAL REFERENCE:<br>LIGHTS<br>FOR DETAILS SEE<br>33-26-03-17N<br>PLACARDS AND MARKINGS<br>FOR DETAILS SEE<br>11-32-05-25Z<br>ATTACHING PARTS | 509999            | 1                    |
| 55                                                      | NAS1801-3-7     |               | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-7                                                                                                                                               | 509999            | 6                    |
| 60                                                      | NAS1149D0332J   |               | .WASHER<br>-----*-----                                                                                                                                                                        | 509999            | 6                    |
| 65                                                      | 1L500403-89     |               | .SHIM-<br>SUPPLIER CODE:<br>V6S8D7                                                                                                                                                            | 509999            | 1                    |
| 70                                                      | 1L500403-271    |               | .LENS-TASK LT<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                                                                                                                                  | 509999            | 1                    |
| 75                                                      | NAS8303-5       |               | .SCREW<br>-----*-----                                                                                                                                                                         | 509999            | 4                    |
| 80                                                      | 1L400501-105    |               | .PANEL ASSY-ACCESS<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-41-40-03H                                                                                                            | 509999            | 1                    |
| 85                                                      | NAS1922-0125-3  |               | .CLAMP                                                                                                                                                                                        | 509999            | 1                    |
| 90                                                      | 1L400501-101    |               | .COUNTERTOP ASSY-<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-41-11-17B<br>ATTACHING PARTS                                                                                          | 509999            | 1                    |
| 95                                                      | NAS514P1032-5   |               | .SCREW                                                                                                                                                                                        | 509999            | 3                    |
| 100                                                     | NAS514P1032-12  |               | .SCREW                                                                                                                                                                                        | 509999            | 2                    |
| 105                                                     | NAS1801-3-5     |               | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-5                                                                                                                                               | 509999            | 6                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                 |               |                                                                                                                                                                                               |                   |                      |

- ITEM NOT ILLUSTRATED

RYR

25-40-15-20C

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-15  
FIG. 20C  
PAGE 1  
APR 15/23


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER   | 1 2 3 4 5 6 7                    | NOMENCLATURE                           | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|---------------|----------------------------------|----------------------------------------|-------------------|----------------------|
| 20C                                                     |               |                                  |                                        |                   |                      |
| 110                                                     | NAS1801-3-6   | .SCREW                           | STANDARD SUBSTITUTION:<br>BACS12HN3-6  | 509999            | 2                    |
| 115                                                     | NAS1801-3-9   | .SCREW                           | STANDARD SUBSTITUTION:<br>BACS12HN3-9  | 509999            | 6                    |
| 120                                                     | NAS1149D0332J | .WASHER                          |                                        | 509999            | 14                   |
| 123                                                     | NAS1149D0363J | .WASHER                          |                                        | 509999            | 2                    |
|                                                         |               | -----*-----                      |                                        |                   |                      |
| 125                                                     | 1L400513-1    | .FACADE ASSY-                    | SUPPLIER CODE:<br>V6S8D7               | 509999            | 1                    |
|                                                         |               | ATTACHING PARTS                  |                                        |                   |                      |
| 130                                                     | NAS1801-3-5   | .SCREW                           | STANDARD SUBSTITUTION:<br>BACS12HN3-5  | 509999            | 2                    |
| 135                                                     | NAS1801-3-11  | .SCREW                           | STANDARD SUBSTITUTION:<br>BACS12HN3-11 | 509999            | 2                    |
| 140                                                     | NAS1149D0332J | .WASHER                          |                                        | 509999            | 4                    |
| 145                                                     | NAS43DD3-24FC | .SPACER                          |                                        | 509999            | 2                    |
|                                                         |               | -----*-----                      |                                        |                   |                      |
| 150                                                     | 1L500113-52   | ..BRACKET-OUTBD                  | SUPPLIER CODE:<br>V6S8D7               | 509999            | 1                    |
| 155                                                     | 1L500113-46   | ..BRACKET-INBD                   | SUPPLIER CODE:<br>V6S8D7               | 509999            | 1                    |
| 160                                                     | 4595339-012   | .LANYARD-                        | SUPPLIER CODE:<br>V16827               | 509999            | 1                    |
| 165                                                     | LWC19AC14     | .CLIP-ADHESIVE BACKED            | SUPPLIER CODE:<br>V06383               | 509999            | 1                    |
|                                                         |               | TRUE PART NUMBER:<br>LWC19-A-C14 |                                        |                   |                      |
| 170                                                     | MS25281F11    | .CLAMP-                          | TRUE PART NUMBER:<br>MS25281-F11       | 509999            | 1                    |
|                                                         |               | ATTACHING PARTS                  |                                        |                   |                      |
| 175                                                     | NAS1801-3-10  | .SCREW                           | STANDARD SUBSTITUTION:<br>BACS12HN3-10 | 509999            | 1                    |
| 180                                                     | NAS1149D0332J | .WASHER                          |                                        | 509999            | 1                    |
|                                                         |               | -----*-----                      |                                        |                   |                      |
| 185                                                     | 4L500403-53   | .BRACKET-                        | SUPPLIER CODE:<br>V6S8D7               | 509999            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |               |                                  |                                        |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R

25-40-15-20C

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-15  
 FIG. 20C  
 PAGE 2  
 APR 15/23


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER   | 1 2 3 4 5 6 7 | NOMENCLATURE                                                       | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|---------------|---------------|--------------------------------------------------------------------|-------------------|----------------------|
| 20C                                                     |               |               |                                                                    |                   |                      |
| 190                                                     | NAS1801-3-6   |               | ATTACHING PARTS<br>.SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6 | 509999            | 2                    |
| 195                                                     | NAS1149D0332J |               | .WASHER<br>-----*-----                                             | 509999            | 2                    |
| 200                                                     | 4L400403-12   |               | .PANEL-<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS             | 509999            | 1                    |
| 205                                                     | NAS1801-3-6   |               | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                    | 509999            | 4                    |
| 210                                                     | NAS1149D0332J |               | .WASHER<br>-----*-----                                             | 509999            | 4                    |
| 215                                                     | 4L500403-55   |               | .BRACKET-<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS           | 509999            | 2                    |
| 220                                                     | NAS1801-3-6   |               | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                    | 509999            | 4                    |
| 225                                                     | NAS1149D0332K |               | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0332J<br>-----*-----  | 509999            | 4                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |               |               |                                                                    |                   |                      |

— ITEM NOT ILLUSTRATED


R Y R

25-40-15-20C

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-15  
 FIG. 20C  
 PAGE 3  
 APR 15/23

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

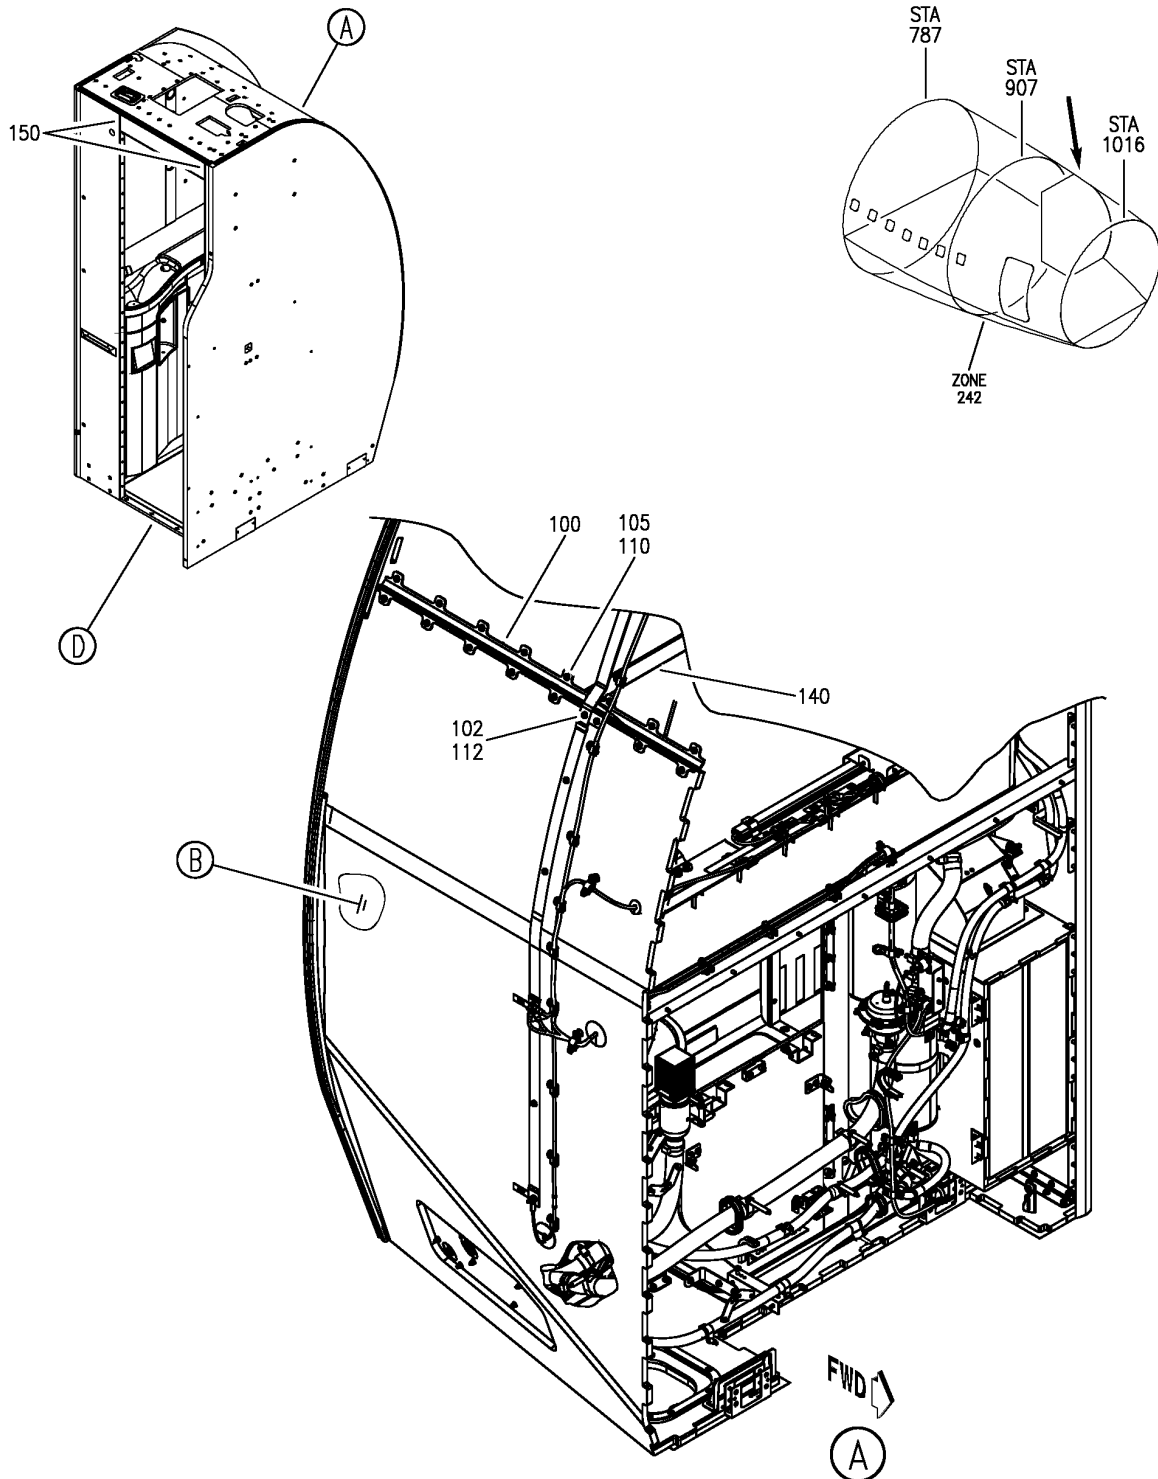

E 25401520D SHT 1 REV 261



STRUCTURE INSTL-LAV E  
FIGURE 20D (SHEET 1)

**25-40-15-20D**

RJR  
JUN 15/23

25-40-15-20D  
PAGE 0

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

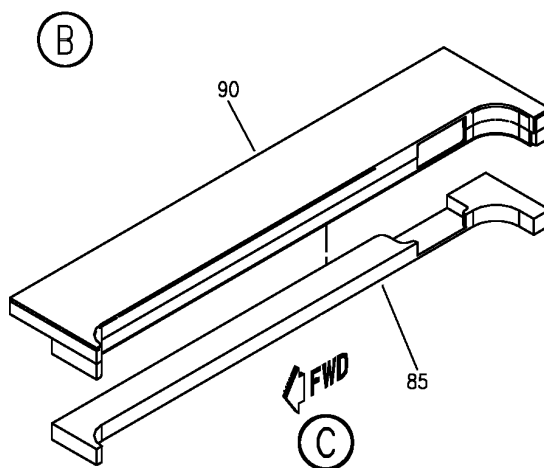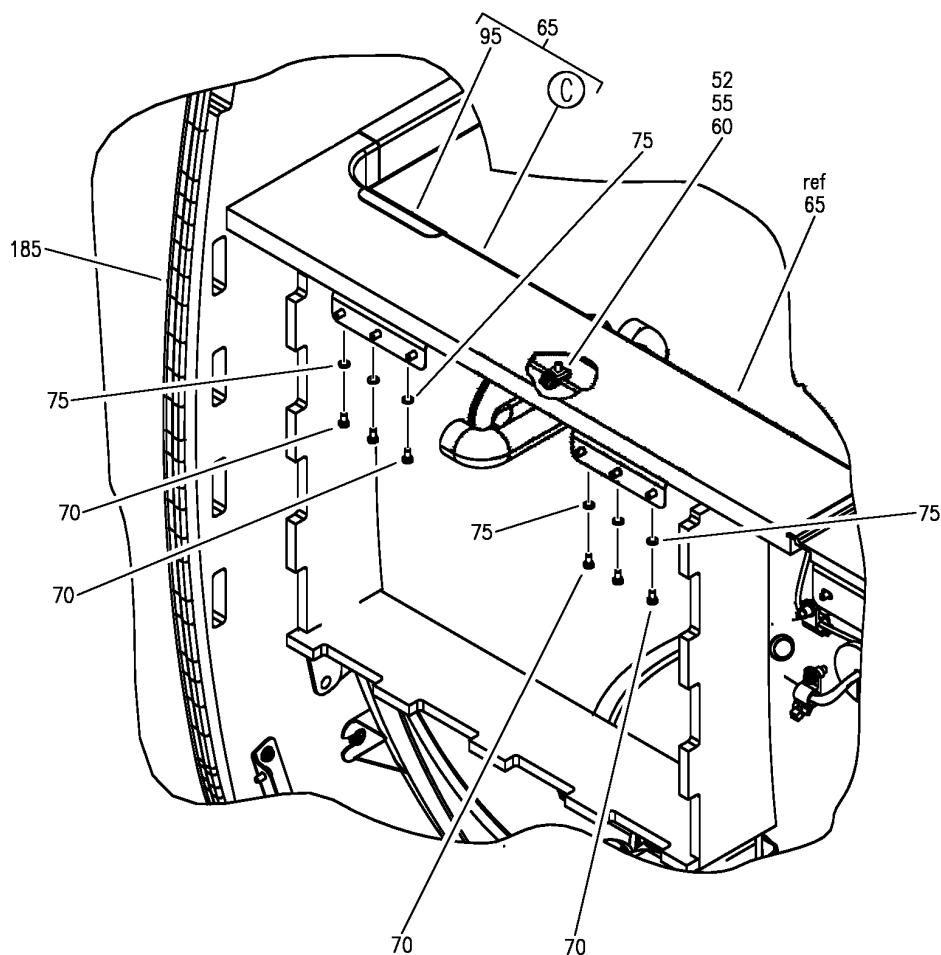

STRUCTURE INSTL-LAV E  
FIGURE 20D (SHEET 2)


25-40-15-20D

25-40-15-20D  
PAGE 0A

ECCN 9E991 BOEING PROPRIETARY – See title page for details.



**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

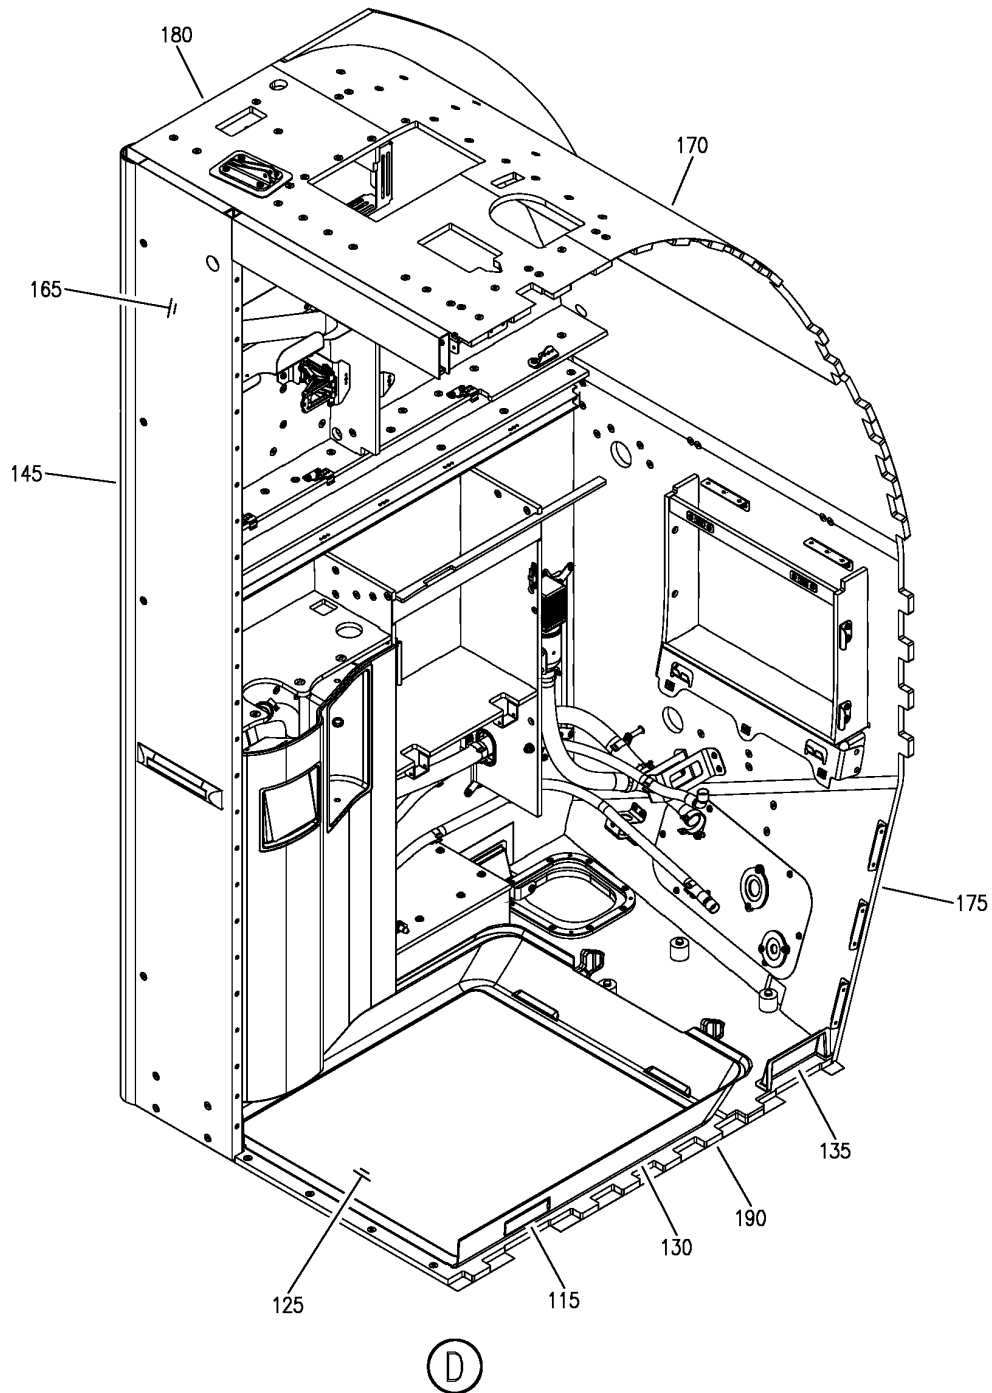

E 25401520D SHT 3 REV 251

STRUCTURE INSTL-LAV E  
FIGURE 20D (SHEET 3)

R Y R  
JUN 15 / 23

**25-40-15-20D**

25-40-15-20D  
PAGE 08

ECCN 9E991 BOEING PROPRIETARY – See title page for details.


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER     | 1 2 3 4 5 6 7 | NOMENCLATURE                                                                                               | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|-----------------|---------------|------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 20D                                                     |                 |               |                                                                                                            |                   |                      |
| - 1                                                     | 1L306051-437HF3 |               | STRUCTURE INSTL-LAV E<br>STRUCTURE INSTL-LAV E<br>SUPPLIER CODE:<br>V6S8D7<br>FOR NHA SEE:<br>25-40-15-16C | 509999<br>509999  | RF                   |
| - 50                                                    | 9L500001-301    |               | .MOUNTING INSTL-TIE,<br>ELECTRICAL<br>SUPPLIER CODE:<br>V6S8D7                                             | 509999            | 4                    |
| 52                                                      | MS3367-5-9      |               | ..STRAP<br>STANDARD SUBSTITUTION:<br>BACS38K5                                                              | 509999            | 1                    |
| 55                                                      | TM2S8           |               | ..MOUNT-CABLE<br>SUPPLIER CODE:<br>V06383<br>ATTACHING PARTS                                               | 509999            | 1                    |
| 60                                                      | NAS1801-08-5    |               | ..SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN08-5<br>-----*-----                                           | 509999            | 1                    |
| 65                                                      | 1L460050-401    |               | .COUNTER ASSY-OUTBD<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                                         | 509999            | 1                    |
| 70                                                      | NAS1801-3-6     |               | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                                                            | 509999            | 6                    |
| 75                                                      | NAS1149D0332J   |               | .WASHER<br>-----*-----                                                                                     | 509999            | 6                    |
| - 80                                                    | 1L406050-331    |               | ..COUNTER ASSY-<br>SUPPLIER CODE:<br>V6S8D7                                                                | 509999            | 1                    |
| 85                                                      | 1L500409-14     |               | ...PANEL-<br>SUPPLIER CODE:<br>V6S8D7                                                                      | 509999            | 1                    |
| 90                                                      | 1L500409-12     |               | ...PANEL-<br>SUPPLIER CODE:<br>V6S8D7                                                                      | 509999            | 1                    |
| 95                                                      | 1L500409-15     |               | ..BRACKET-FLUSH SWITCH<br>SUPPLIER CODE:<br>V6S8D7                                                         | 509999            | 1                    |
| 100                                                     | 1L500419-368    |               | .EXTRUSION-<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                                                 | 509999            | 1                    |
| 102                                                     | NAS1801-3-8     |               | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-8                                                            | 509999            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                 |               |                                                                                                            |                   |                      |

- ITEM NOT ILLUSTRATED

RYR

25-40-15-20D

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-15  
FIG. 20D  
PAGE 1  
JUN 15/23


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER   | 1 2 3 4 5 6 7           | NOMENCLATURE                                                                                      | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|---------------|-------------------------|---------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 20D                                                     |               |                         |                                                                                                   |                   |                      |
| 105                                                     | NAS1801-3-6   | .SCREW                  | STANDARD SUBSTITUTION:<br>BACS12HN3-6                                                             | 509999            | 16                   |
| 110                                                     | NAS1149D0332K | .WASHER                 | STANDARD SUBSTITUTION:<br>NAS1149D0332J                                                           | 509999            | 16                   |
| 112                                                     | NAS1149F0332P | .WASHER                 | -----*-----                                                                                       | 509999            | 1                    |
| 115                                                     | 1L500407-207  | .PLATE-COVER            | SUPPLIER CODE:<br>V6S8D7                                                                          | 509999            | 2                    |
| - 120                                                   | 1L400407-78B  | .PAN ASSY-FLOOR         | SUPPLIER CODE:<br>V6S8D7                                                                          | 509999            | 1                    |
| 125                                                     | 1L400407-87B  | ..MAT-                  | SUPPLIER CODE:<br>V6S8D7                                                                          | 509999            | 1                    |
| 130                                                     | 1L400407-16   | ..PAN-                  | SUPPLIER CODE:<br>V6S8D7<br>CONFIG CHG DATA FROM A CMM:<br>SUPSD BY 1L400407-138                  | 509999            | 1                    |
| 130                                                     | 1L400407-138  | ..PAN-                  | SUPPLIER CODE:<br>V6S8D7<br>CONFIG CHG DATA FROM A CMM:<br>SUPERSEDES 1L400407-16                 | 509999            | 1                    |
| 135                                                     | 1L500109-347  | .CLOSEOUT-FLOOR         | SUPPLIER CODE:<br>V6S8D7                                                                          | 509999            | 2                    |
| 140                                                     | 1L500413-131  | .TRIM-AFT WALL CLOSEOUT | SUPPLIER CODE:<br>V6S8D7                                                                          | 509999            | 1                    |
| 145                                                     | 1L500419-299  | .TRIM-FLAT WALL         | SUPPLIER CODE:<br>V6S8D7                                                                          | 509999            | 1                    |
| 150                                                     | 1L500709-661  | .TRIM-HEADER            | SUPPLIER CODE:<br>V6S8D7                                                                          | 509999            | 2                    |
| - 155                                                   | 415U9010-82   | .EXTRUSION-             | MISCELLANEOUS DATA:<br>ORDER LCPE000013                                                           | 509999            | AR                   |
| - 155                                                   | LCPE000013    | .EXTRUSION-             | SUPPLIER CODE:<br>V6S8D7<br>MISCELLANEOUS DATA:<br>THE BOEING COMPANY,<br>PART NUMBER 415U9010-82 | 509999            | AR                   |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |               |                         |                                                                                                   |                   |                      |

- ITEM NOT ILLUSTRATED

R Y R

25-40-15-20D

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-15  
FIG. 20D  
PAGE 2  
DEC 15/23


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 | NOMENCLATURE                                                                                      | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|---------------|---------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 20D<br>- 160                                            | MS21266-2N     |               | .GROMMET-<br>STANDARD SUBSTITUTION:<br>BACG20Z-B001275<br>MISCELLANEOUS DATA:<br>ORDER LCEE000003 | 509999            | AR                   |
| - 160                                                   | LCEE000003     |               | .GROMMET-<br>SUPPLIER CODE:<br>V6S8D7                                                             | 509999            | AR                   |
| 165                                                     | 1L460051-313HF |               | .WALL ASSY-INBD<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-41-40-06H                   | 509999            | 1                    |
| 170                                                     | 1L460051-277   |               | .CEILING ASSY-UPR<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-41-45-08B                 | 509999            | 1                    |
| 175                                                     | 1L460051-243   |               | .WALL ASSY-OUTBD<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-41-40-06J                  | 509999            | 1                    |
| 180                                                     | 1L460051-383HF |               | .WALL INSTL-FWD<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-41-40-06E                   | 509999            | 1                    |
| 185                                                     | 1L460051-455HF |               | .WALL ASSY-ATTENDANT<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-41-40-06K              | 509999            | 1                    |
| 190                                                     | 1L460051-495   |               | .FLOOR ASSY-<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-41-21-35D                      | 509999            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |               |                                                                                                   |                   |                      |

— ITEM NOT ILLUSTRATED


R Y R

25-40-15-20D

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

25-40-15  
FIG. 20D  
PAGE 3  
DEC 15/23

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

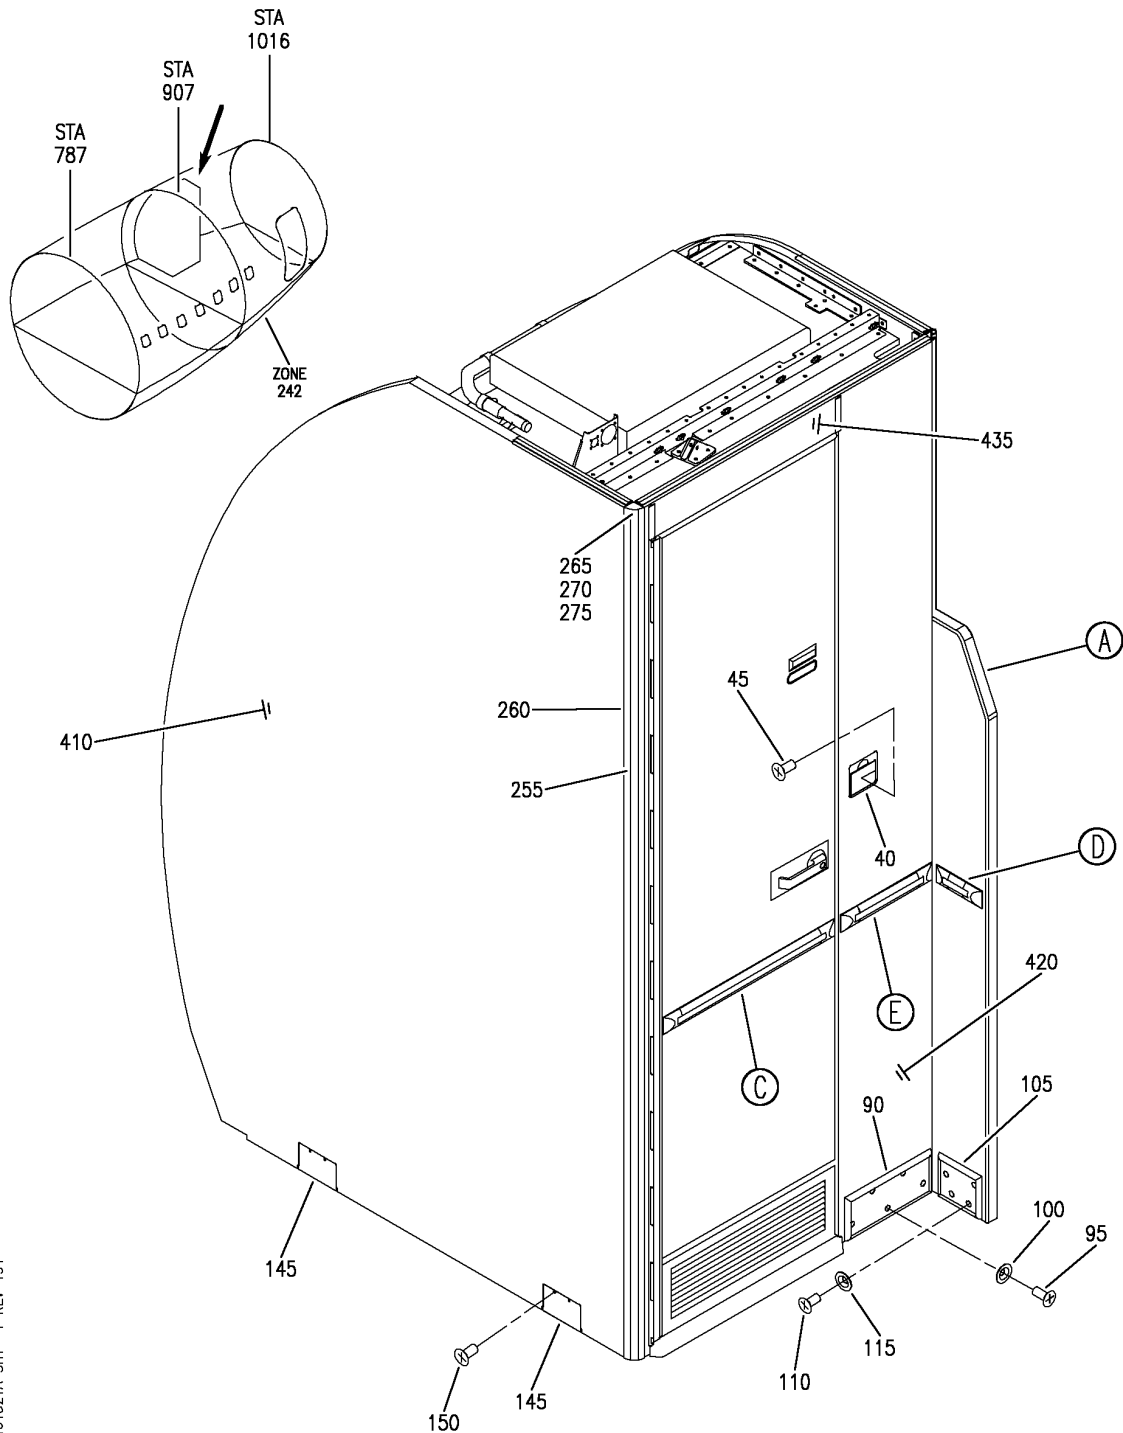

E 25401521A SHT 1 REV 191

MODULE ASSY-LAV E (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 21A (SHEET 1)


**25-40-15-21A**

RJR  
JUN 15/12

25-40-15-21A  
PAGE 0

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

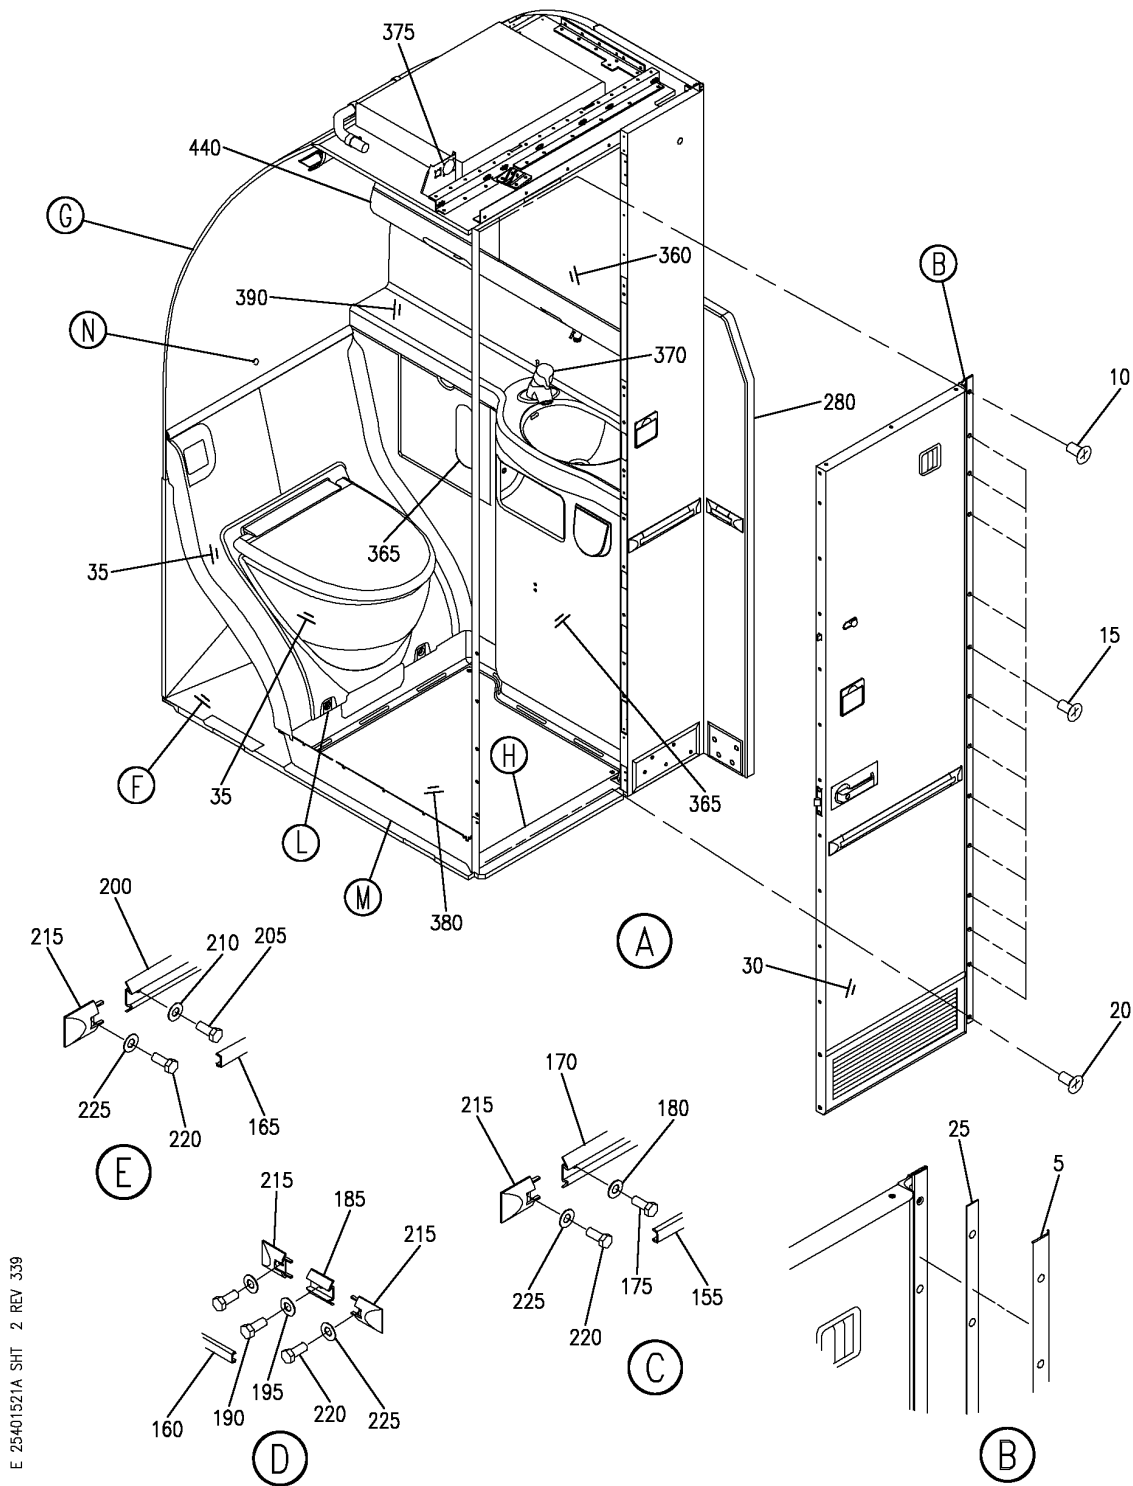

E 25401521A SHT 2 REV 339

MODULE ASSY-LAV E (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 21A (SHEET 2)


**25-40-15-21A**

R/YR  
OCT 15/24

25-40-15-21A  
PAGE 0A

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

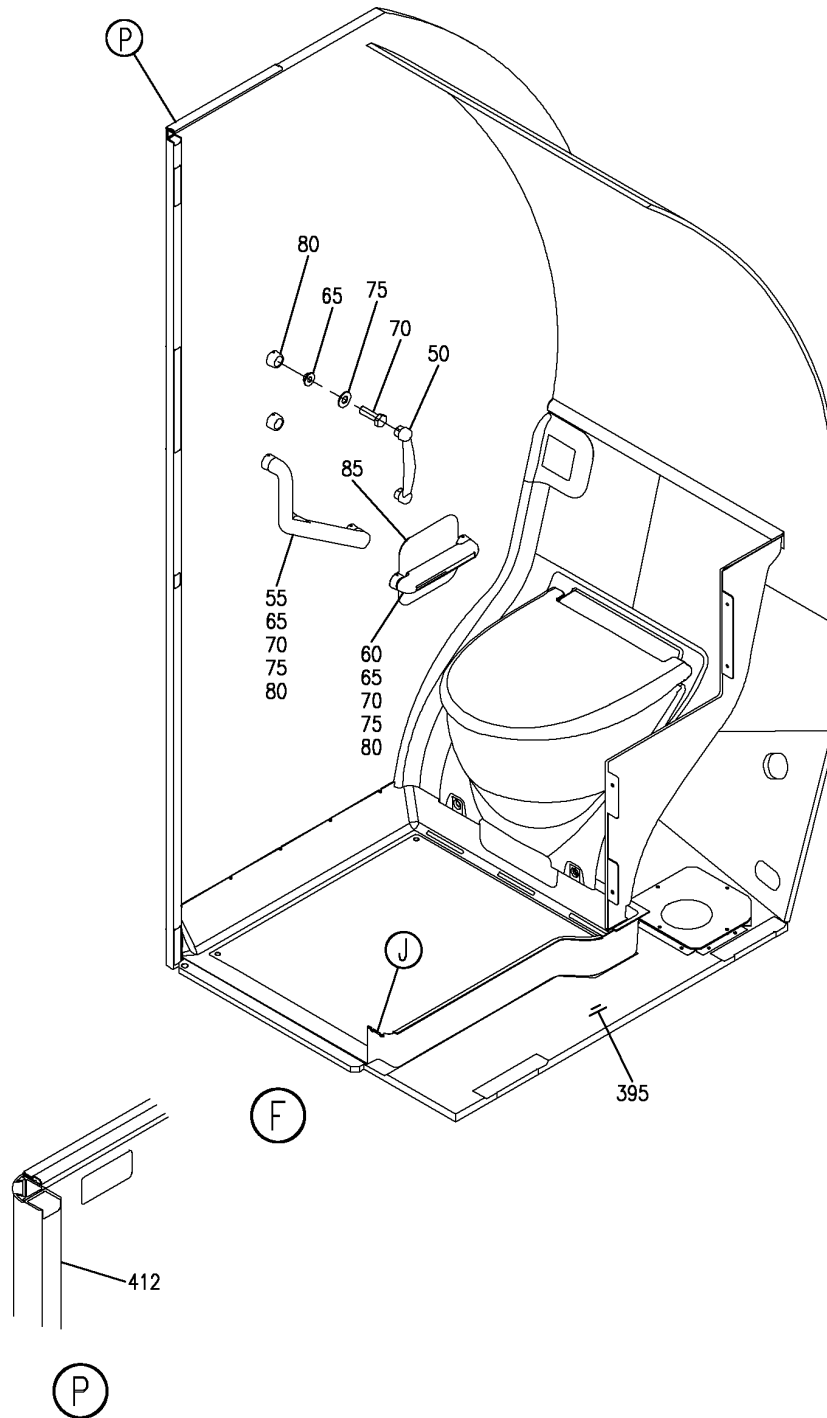

E 25401521A SHT 3 REV 339

MODULE ASSY-LAV E (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 21A (SHEET 3)


**25-40-15-21A**

R Y R  
O C T 15 / 24

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

25-40-15-21A  
PAGE 0B

**BOEING**  
 737-600/700/800/900  
 PARTS CATALOG (MAINTENANCE)

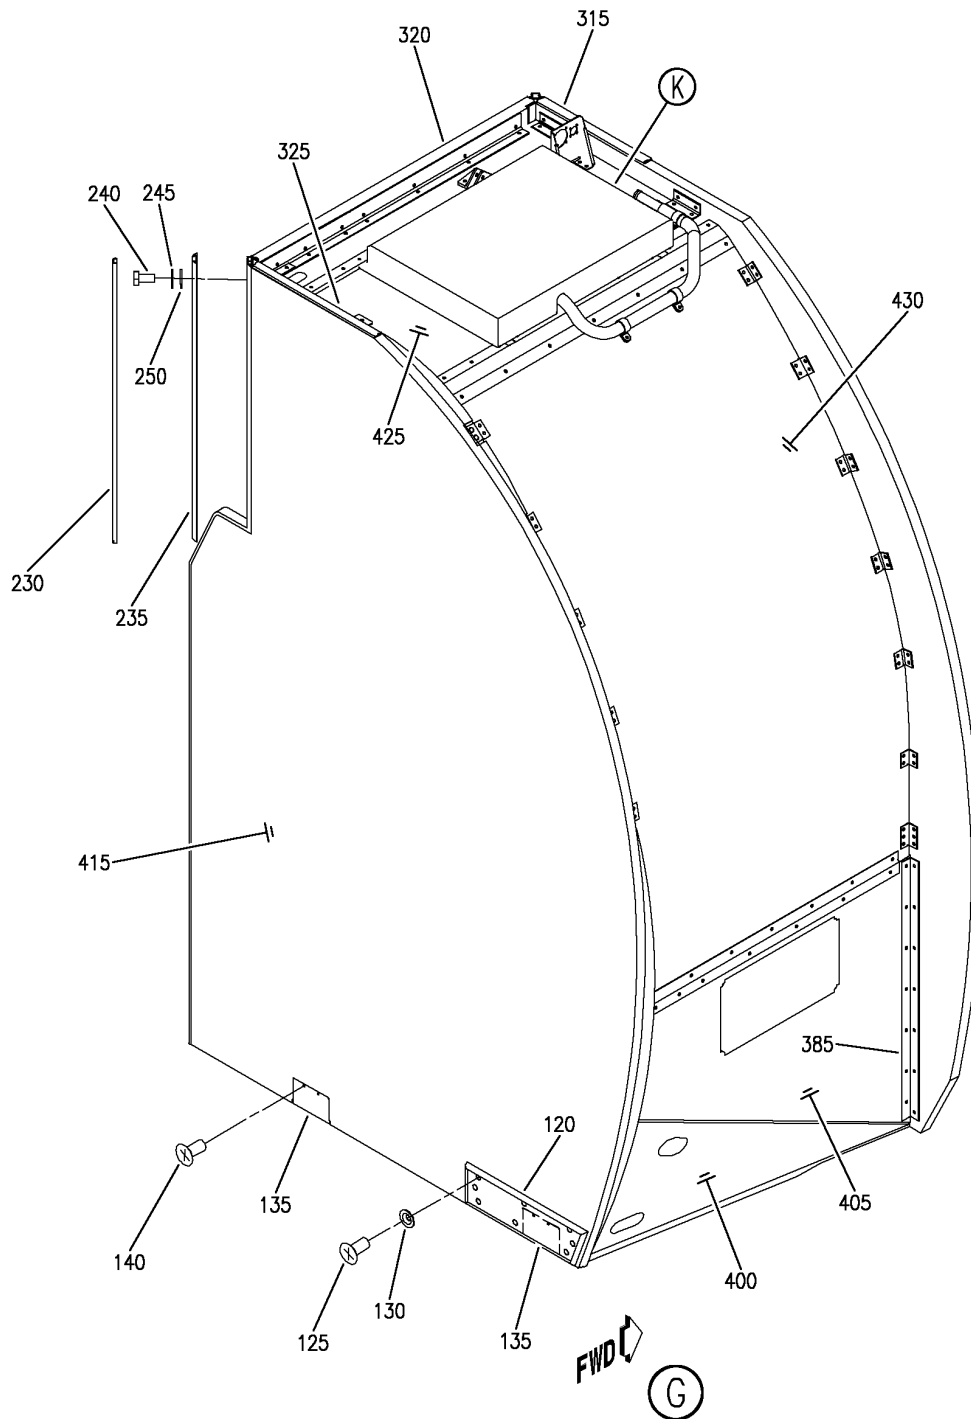

E 25401521A SHT 4 REV 191

MODULE ASSY-LAV E (EQUIPMENT/FURNISHINGS ONLY)  
 FIGURE 21A (SHEET 4)

**25-40-15-21A**


ECCN 9E991 BOEING PROPRIETARY - See title page for details.

RJR  
 JUN 15/12

25-40-15-21A  
 PAGE 0C



**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

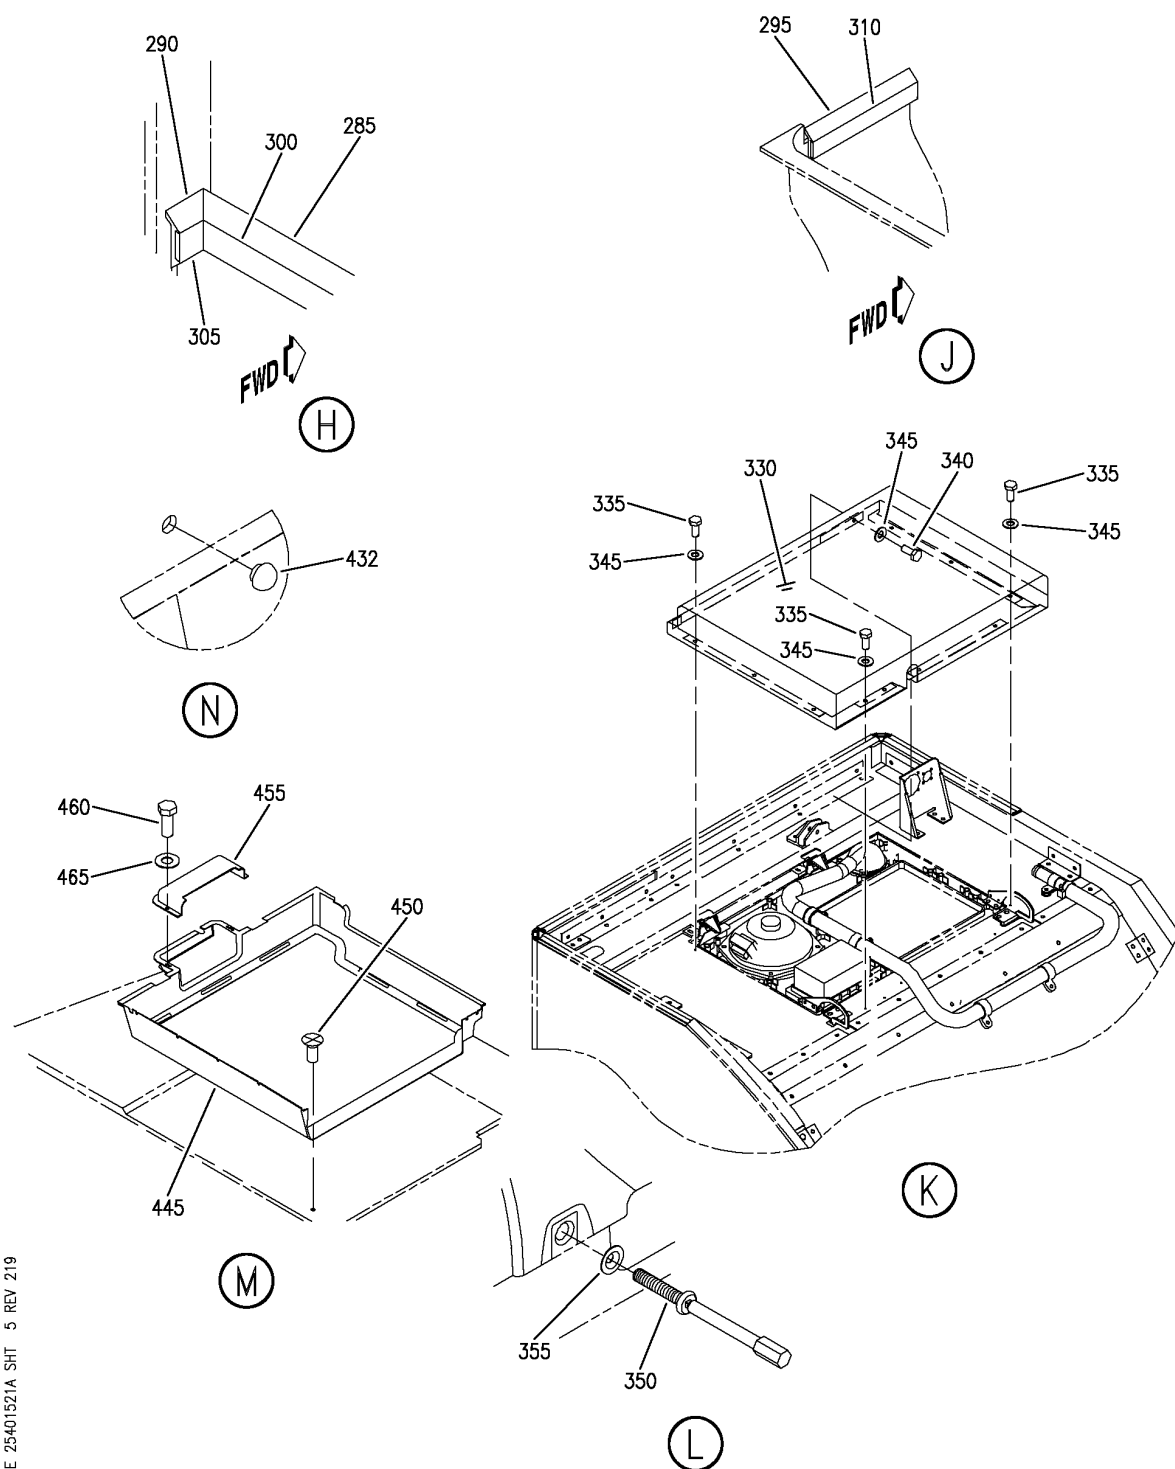

E 25401521A SHT 5 REV 219

MODULE ASSY-LAV E (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 21A (SHEET 5)

**25-40-15-21A**

RYR  
OCT 15/14

25-40-15-21A  
PAGE 0D

ECCN 9E991 BOEING PROPRIETARY – See title page for details.


**BOEING**  
**737-600/700/800/900**  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 | NOMENCLATURE                                                                                                                                                                                                                                                                                              | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|---------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 21A                                                     |                |               | MODULE ASSY-LAV E<br>(EQUIPMENT/FURNISHINGS<br>ONLY)                                                                                                                                                                                                                                                      | 336416            |                      |
| - 1                                                     | D72001401-111A |               | MODULE ASSY-LAV E<br>(EQUIPMENT/FURNISHINGS<br>ONLY)<br>SUPPLIER CODE:<br>VJ4577<br>FUNCTIONAL DESCRIPTION:<br>THIS PART PROVIDES A<br>RESTROOM FOR PASSENGERS<br>AND CREW.<br>ELECTRICAL EQUIP NUMBER:<br>M01419<br>COMPONENT MAINT MANUAL REF:<br>25-48-31<br>FOR NHA/OTHER SYS DET SEE:<br>25-40-15-01 | 336353            | RF                   |
| - 1                                                     | D72001401-111F |               | MODULE ASSY-LAV E<br>(EQUIPMENT/FURNISHINGS<br>ONLY)<br>SUPPLIER CODE:<br>VJ4577<br>FUNCTIONAL DESCRIPTION:<br>THIS PART PROVIDES A<br>RESTROOM FOR PASSENGERS<br>AND CREW.<br>ELECTRICAL EQUIP NUMBER:<br>M01419<br>COMPONENT MAINT MANUAL REF:<br>25-48-31<br>FOR NHA/OTHER SYS DET SEE:<br>25-40-15-01 | 354377            | RF                   |
| - 1                                                     | D72001401-111G |               | MODULE ASSY-LAV E<br>(EQUIPMENT/FURNISHINGS<br>ONLY)<br>SUPPLIER CODE:<br>VJ4577<br>FUNCTIONAL DESCRIPTION:<br>THIS PART PROVIDES A<br>RESTROOM FOR PASSENGERS<br>AND CREW.<br>ELECTRICAL EQUIP NUMBER:<br>M01419<br>COMPONENT MAINT MANUAL REF:<br>25-48-31<br>FOR NHA/OTHER SYS DET SEE:<br>25-40-15-01 | 378416            | RF                   |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |               |                                                                                                                                                                                                                                                                                                           |                   |                      |

- ITEM NOT ILLUSTRATED

RYR

25-40-15-21A

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-15  
FIG. 21A  
PAGE 1  
OCT 15/24


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                                           | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|--------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 21A                                                     |                |                                                                                                                                      |                   |                      |
| 5                                                       | D72D70987-211  | .RETAINER-SEAL RUBBER<br>SUPPLIER CODE:<br>VS5825<br>ATTACHING PARTS                                                                 | 336416            | 1                    |
| 10                                                      | NAS514P1032-12 | .SCREW                                                                                                                               | 336416            | 1                    |
| 15                                                      | NAS514P1032-8  | .SCREW                                                                                                                               | 336416            | 12                   |
| 20                                                      | NAS514P1032-22 | .SCREW                                                                                                                               | 336416            | 1                    |
|                                                         |                | -----*-----                                                                                                                          |                   |                      |
| 25                                                      | D72D70988-111  | .SEAL-RUBBER<br>SUPPLIER CODE:<br>VS5825                                                                                             | 336416            | 1                    |
| 30                                                      | D72W13511-211C | .DOOR ASSY-SLAB<br>SUPPLIER CODE:<br>VS5825<br>FOR DETAILS SEE:<br>25-41-17-21A                                                      | 336416            | 1                    |
| 35                                                      | D72W15501-111  | .TOILET AND FLOOR PAN ASSY-<br>SUPPLIER CODE:<br>VS5825<br>MISCELLANEOUS DATA:<br>NON PROCURABLE<br>FOR DETAILS SEE:<br>25-41-21-21A | 336416            | RF                   |
| 40                                                      | D72D70434-111  | .ASHTRAY-<br>SUPPLIER CODE:<br>VS5825<br>ATTACHING PARTS                                                                             | 336416            | 1                    |
| 45                                                      | NAS514P1032-5P | .SCREW<br>-----*-----                                                                                                                | 336416            | 2                    |
| 50                                                      | 65-5458-20N    | .HANDLE                                                                                                                              | 336416            | 1                    |
| 55                                                      | 65C22388-13    | .HANDLE                                                                                                                              | 336416            | 1                    |
| 60                                                      | 69-72416-5     | .HANDLE-<br>SUPPLIER CODE:<br>V26835                                                                                                 | 336416            | 1                    |
| 65                                                      | 66-4302-1      | .COLLAR<br>ATTACHING PARTS                                                                                                           | 336416            | 7                    |
| 70                                                      | NAS1801-3-10   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-10                                                                                     | 336416            | 7                    |
| 75                                                      | NAS1149D0332K  | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0332J                                                                                   | 336416            | 7                    |
| 80                                                      | 65-5458-21N    | .NUT<br>-----*-----                                                                                                                  | 336416            | 7                    |
| 85                                                      | D75D70952-163  | .PAN-<br>SUPPLIER CODE:<br>VS5825                                                                                                    | 336416            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |                                                                                                                                      |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R

25-40-15-21A

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-15  
FIG. 21A  
PAGE 2  
OCT 15/24


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER     | 1 2 3 4 5 6 7 NOMENCLATURE                                                         | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|-----------------|------------------------------------------------------------------------------------|-------------------|----------------------|
| 21A                                                     |                 |                                                                                    |                   |                      |
| 90                                                      | D72D80015-111G  | .KICKSTRIP-<br>SUPPLIER CODE:<br>VS5825<br>ATTACHING PARTS                         | 336416            | 1                    |
| 95                                                      | NAS514P1032-5P  | .SCREW                                                                             | 336416            | 5                    |
| 100                                                     | NAS1169DD10     | .WASHER<br>-----*-----                                                             | 336416            | 5                    |
| 105                                                     | D72D80020-211F  | .KICKSTRIP-<br>SUPPLIER CODE:<br>VS5825<br>ATTACHING PARTS                         | 336416            | 1                    |
| 110                                                     | NAS514P1032-5P  | .SCREW                                                                             | 336416            | 4                    |
| 115                                                     | NAS1169DD10     | .WASHER<br>-----*-----                                                             | 336416            | 4                    |
| 120                                                     | D72D80021-211F  | .KICKSTRIP-<br>SUPPLIER CODE:<br>VS5825<br>ATTACHING PARTS                         | 336416            | 1                    |
| 125                                                     | NAS514P1032-6P  | .SCREW                                                                             | 336416            | 8                    |
| 130                                                     | NAS1169DD10     | .WASHER<br>-----*-----                                                             | 336416            | 8                    |
| 135                                                     | D72D70947-111B  | .PLATE-COVER<br>SUPPLIER CODE:<br>VS5825<br>ATTACHING PARTS                        | 336416            | 2                    |
| 140                                                     | NAS514P632-4    | .SCREW<br>-----*-----                                                              | 336416            | 4                    |
| 145                                                     | D72D70947-111S  | .PLATE-COVER<br>SUPPLIER CODE:<br>VS5825                                           | 336377            | 2                    |
| 145                                                     | D72D70947-111FG | .COVER PLATE-<br>SUPPLIER CODE:<br>VS5825<br>ATTACHING PARTS                       | 378416            | 2                    |
| 150                                                     | NAS514P632-4    | .SCREW<br>-----*-----                                                              | 336416            | 4                    |
| 155                                                     | D72D80025-911A  | .RUBSTRIP-<br>SUPPLIER CODE:<br>VS5825<br>MISCELLANEOUS DATA:<br>BAC1522-547-70229 | 336416            | 1                    |
| 160                                                     | D72D80025-912A  | .RUBSTRIP-<br>SUPPLIER CODE:<br>VS5825<br>MISCELLANEOUS DATA:<br>BAC1522-547-70229 | 336416            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                 |                                                                                    |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R

25-40-15-21A

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-15  
 FIG. 21A  
 PAGE 3  
 JUN 15/16


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 | NOMENCLATURE                                                                       | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|---------------|------------------------------------------------------------------------------------|-------------------|----------------------|
| 21A<br>165                                              | D72D80025-913A |               | .RUBSTRIP-<br>SUPPLIER CODE:<br>VS5825<br>MISCELLANEOUS DATA:<br>BAC1522-547-70229 | 336416            | 1                    |
| 170                                                     | D72D80024-111B |               | .RETAINER-RUBSTRIP<br>SUPPLIER CODE:<br>VS5825<br>ATTACHING PARTS                  | 336416            | 1                    |
| 175                                                     | NAS1801-08-5   |               | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN08-5                                   | 336416            | 3                    |
| 180                                                     | NAS1149DN832K  |               | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149DN832J<br>-----*-----                  | 336416            | 3                    |
| 185                                                     | D72D80023-111B |               | .RETAINER-RUBSTRIP<br>SUPPLIER CODE:<br>VS5825<br>ATTACHING PARTS                  | 336416            | 1                    |
| 190                                                     | NAS1801-08-5   |               | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN08-5                                   | 336416            | 1                    |
| 195                                                     | NAS1149DN832K  |               | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149DN832J<br>-----*-----                  | 336416            | 1                    |
| 200                                                     | D72D80022-111B |               | .RETAINER-RUBSTRIP<br>SUPPLIER CODE:<br>VS5825<br>ATTACHING PARTS                  | 336416            | 1                    |
| 205                                                     | NAS1801-08-5   |               | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN08-5                                   | 336416            | 2                    |
| 210                                                     | NAS1149DN832K  |               | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149DN832J<br>-----*-----                  | 336416            | 2                    |
| 215                                                     | 432W7101-6J    |               | .ENDCAP<br>ATTACHING PARTS                                                         | 336416            | 6                    |
| 220                                                     | NAS1801-08-5   |               | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN08-5                                   | 336416            | 6                    |
| 225                                                     | NAS1149DN832K  |               | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149DN832J<br>-----*-----                  | 336416            | 6                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |               |                                                                                    |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R

25-40-15-21A

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-15  
 FIG. 21A  
 PAGE 4  
 APR 15/23


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                                                                                                                             | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 21A<br>230                                              | D72D80018-911B | .RUBSTRIP-<br>SUPPLIER CODE:<br>VS5825<br>MISCELLANEOUS DATA:<br>BAC1522-547-7802                                                                                                                                      | 336416            | 1                    |
| 235                                                     | D72D80011-111B | .RETAINER-RUBSTRIP<br>SUPPLIER CODE:<br>VS5825<br>ATTACHING PARTS                                                                                                                                                      | 336416            | 1                    |
| 240                                                     | NAS1801-08-7   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN08-7                                                                                                                                                                       | 336416            | 5                    |
| 245                                                     | NAS1149DN816K  | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149DN816J                                                                                                                                                                     | 336416            | 5                    |
| 250                                                     | 130008         | .NUT-CLIP ON<br>SUPPLIER CODE:<br>V60119<br>SPECIFICATION NUMBER:<br>BACN10FX84<br>OPTIONAL PART:<br>RM52LHA4972-6-8<br>V72962<br>SL211-08-1<br>V97393<br>A11330-6-82<br>V72962<br>A4972-6-82<br>V72962<br>-----*----- | 336416            | 5                    |
| 255                                                     | D72D80018-913B | .RUBSTRIP-<br>SUPPLIER CODE:<br>VS5825<br>MISCELLANEOUS DATA:<br>BAC1522-547-7802                                                                                                                                      | 336416            | 1                    |
| 260                                                     | D72D80012-111B | .RETAINER-RUBSTRIP<br>SUPPLIER CODE:<br>VS5825<br>ATTACHING PARTS                                                                                                                                                      | 336416            | 1                    |
| 265                                                     | NAS1801-08-7   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN08-7                                                                                                                                                                       | 336416            | 12                   |
| 270                                                     | NAS1149DN816K  | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149DN816J                                                                                                                                                                     | 336416            | 12                   |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |                                                                                                                                                                                                                        |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R

25-40-15-21A

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-15  
 FIG. 21A  
 PAGE 5  
 APR 15/23


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                                                                                                                             | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 21A<br>275                                              | 130008         | .NUT-CLIP ON<br>SUPPLIER CODE:<br>V60119<br>SPECIFICATION NUMBER:<br>BACN10FX84<br>OPTIONAL PART:<br>RM52LHA4972-6-8<br>V72962<br>SL211-08-1<br>V97393<br>A11330-6-82<br>V72962<br>A4972-6-82<br>V72962<br>-----*----- | 336416            | 12                   |
| 280                                                     | D72D70548-211  | .TRIM-WALL EDGE<br>SUPPLIER CODE:<br>VS5825                                                                                                                                                                            | 336416            | 1                    |
| 285                                                     | D72D71109-111B | .TRIM-RTNR,FLOOR PAN<br>SUPPLIER CODE:<br>VS5825                                                                                                                                                                       | 336416            | 1                    |
| 290                                                     | D72D71110-111B | .TRIM-RTNR,FLOOR PAN<br>SUPPLIER CODE:<br>VS5825                                                                                                                                                                       | 336416            | 1                    |
| 295                                                     | D72D71111-111B | .TRIM-RTNR,FLOOR PAN<br>SUPPLIER CODE:<br>VS5825                                                                                                                                                                       | 336416            | 1                    |
| 300                                                     | D72D71112-911B | .TRIM-INSERT,FLOOR PAN<br>SUPPLIER CODE:<br>VS5825                                                                                                                                                                     | 336416            | 1                    |
| 305                                                     | D72D71112-912B | .TRIM-INSERT,FLOOR PAN<br>SUPPLIER CODE:<br>VS5825                                                                                                                                                                     | 336416            | 1                    |
| 310                                                     | D72D71112-913B | .TRIM-INSERT,FLOOR PAN<br>SUPPLIER CODE:<br>VS5825                                                                                                                                                                     | 336416            | 1                    |
| 315                                                     | D72D70301-911  | .SEAL-RTNR<br>SUPPLIER CODE:<br>VS5825                                                                                                                                                                                 | 336416            | 1                    |
| 320                                                     | D72D70301-913  | .SEAL-RTNR<br>SUPPLIER CODE:<br>VS5825                                                                                                                                                                                 | 336416            | 1                    |
| 325                                                     | D72D70301-915  | .SEAL-RTNR<br>SUPPLIER CODE:<br>VS5825                                                                                                                                                                                 | 336416            | 1                    |
| 330                                                     | D72D70795-111  | .BLANKET-FIRE<br>SUPPLIER CODE:<br>VS5825                                                                                                                                                                              | 336416            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |                                                                                                                                                                                                                        |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R

25-40-15-21A

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-15  
 FIG. 21A  
 PAGE 6  
 JUN 15/16


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER   | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                                                                                                                                                                | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|---------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 21A                                                     |               | ATTACHING PARTS                                                                                                                                                                                                                                           |                   |                      |
| 335                                                     | NAS1801-3-4   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-4                                                                                                                                                                                                           | 336416            | 10                   |
| 340                                                     | NAS1801-3-8   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-8                                                                                                                                                                                                           | 336416            | 5                    |
| 345                                                     | NAS1149D0332K | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0332J<br>-----*-----                                                                                                                                                                                         | 336416            | 15                   |
| 350                                                     | D72D72683-111 | .SCREW-TAMPER PROOF<br>SUPPLIER CODE:<br>VS5825<br>CONFIG CHG DATA FROM A CMM:<br>SUPSD BY D72D72683-913                                                                                                                                                  | 336416            | 2                    |
| 350                                                     | D72D72683-913 | .SCREW-TAMPER PROOF<br>SUPPLIER CODE:<br>VS5825<br>CONFIG CHG DATA FROM A CMM:<br>SUPERSEDES D72D72683-111                                                                                                                                                | 336416            | 2                    |
| 355                                                     | NAS1149C0332R | .WASHER                                                                                                                                                                                                                                                   | 336416            | 2                    |
| 360                                                     | D72W16510-111 | .DISPENSER ASSY-<br>SUPPLIER CODE:<br>VS5825<br>POSITION DATA:<br>UPR<br>MISCELLANEOUS DATA:<br>NON PROCURABLE<br>FOR DETAILS SEE:<br>25-41-51-21A                                                                                                        | 336416            | RF                   |
| 365                                                     | D72W17505-111 | .DISPENSER ASSY-<br>SUPPLIER CODE:<br>VS5825<br>POSITION DATA:<br>LWR<br>MISCELLANEOUS DATA:<br>NON PROCURABLE<br>FUNCTIONAL REFERENCE:<br>EQUIPMENT/FURNISHINGS<br>FOR DETAILS SEE<br>25-41-51-12A<br>FIRE PROTECTION<br>FOR DETAILS SEE<br>26-24-01-21A | 336416            | RF                   |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |               |                                                                                                                                                                                                                                                           |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R

25-40-15-21A

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-15  
 FIG. 21A  
 PAGE 7  
 OCT 15/24




**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                                                                                                                                                                                                                                                                                                            | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 21A<br>370                                              | D72W26514-111  | .PLUMBING ASSY-<br>SUPPLIER CODE:<br>VS5825<br>MISCELLANEOUS DATA:<br>NON PROCURABLE<br>FUNCTIONAL REFERENCE:<br>AIR CONDITIONING<br>FOR DETAILS SEE<br>21-24-51-20A<br>WATER/WASTE<br>FOR DETAILS SEE<br>38-11-05-21A<br>38-11-51-21B<br>38-13-01-21A                                                                                                                                                | 336416            | RF                   |
| 375                                                     | D72W27511-111  | .ELECTRICAL ASSY-<br>SUPPLIER CODE:<br>VS5825<br>MISCELLANEOUS DATA:<br>NON PROCURABLE<br>FUNCTIONAL REFERENCE:<br>COMMUNICATIONS<br>FOR DETAILS SEE<br>23-31-05-21A<br>EQUIPMENT/FURNISHINGS<br>FOR DETAILS SEE<br>25-41-60-21D<br>FIRE PROTECTION<br>FOR DETAILS SEE<br>26-14-01-21A<br>LIGHTS<br>FOR DETAILS SEE<br>33-26-03-21J<br>33-27-51-21A<br>WATER/WASTE<br>FOR DETAILS SEE<br>38-32-04-21A | 336416            | RF                   |
| 380                                                     | D72D80006-111B | .MAT-FLOOR<br>SUPPLIER CODE:<br>VS5825                                                                                                                                                                                                                                                                                                                                                                | 336416            | 1                    |
| 385                                                     | D72W12514-111  | .OUTWALL ASSY-<br>SUPPLIER CODE:<br>VS5825<br>MISCELLANEOUS DATA:<br>NON PROCURABLE<br>FOR DETAILS SEE:<br>25-41-40-21A                                                                                                                                                                                                                                                                               | 336416            | RF                   |
| 390                                                     | D72W59240-111A | .DECK-SINK<br>SUPPLIER CODE:<br>VS5825                                                                                                                                                                                                                                                                                                                                                                | 336416            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |                                                                                                                                                                                                                                                                                                                                                                                                       |                   |                      |

— ITEM NOT ILLUSTRATED

RYR

25-40-15-21A

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-15  
 FIG. 21A  
 PAGE 8  
 OCT 15/24


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER     | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                   | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|-----------------|--------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 21A                                                     |                 |                                                                                                              |                   |                      |
| 395                                                     | D72D41012-111   | .PANEL-FL00R<br>SUPPLIER CODE:<br>VS5825                                                                     | 336416            | 1                    |
| 400                                                     | D72D46516-111   | .PANEL-OUTBD LWR<br>SUPPLIER CODE:<br>VS5825                                                                 | 336416            | 1                    |
| 405                                                     | D72D46017-111   | .PANEL-OUTBD UPR<br>SUPPLIER CODE:<br>VS5825                                                                 | 336416            | 1                    |
| 410                                                     | D72W52524-111B  | .PANEL-SIDE WALL<br>SUPPLIER CODE:<br>VS5825                                                                 | 336377            | 1                    |
| 410                                                     | D72W52524-111AJ | .PANEL-SIDE WALL<br>SUPPLIER CODE:<br>VS5825                                                                 | 378416            | 1                    |
| 412                                                     | D72D70709-111   | ..TUBE-FRAME, SIDE WALL<br>SUPPLIER CODE:<br>VS5825<br>MISCELLANEOUS DATA:<br>NO DECORATIVE LAMINATE<br>PART | 336416            | 1                    |
| 415                                                     | D72W53522-111A  | .PANEL-SINK WALL<br>SUPPLIER CODE:<br>VS5825                                                                 | 336416            | 1                    |
| 420                                                     | D72W54516-111B  | .PANEL-DOOR WALL<br>SUPPLIER CODE:<br>VS5825                                                                 | 336416            | 1                    |
| 425                                                     | D72W55507-111A  | .PANEL-CLG<br>SUPPLIER CODE:<br>VS5825                                                                       | 336416            | 1                    |
| 430                                                     | D72W56513-111A  | .PANEL ASSY-LINING<br>SUPPLIER CODE:<br>VS5825                                                               | 336416            | 1                    |
| 432                                                     | 4A114-0016-1    | ..BUMPER-<br>SUPPLIER CODE:<br>VS5825                                                                        | 336416            | 1                    |
| 435                                                     | D72W57009-111B  | .PANEL-HEADER, BIFOLD<br>SUPPLIER CODE:<br>VS5825                                                            | 336416            | 1                    |
| 440                                                     | D72W59259-111A  | .PANEL-DISP CABINET<br>SUPPLIER CODE:<br>VS5825                                                              | 336416            | 1                    |
| 445                                                     | D72D70699-111B  | .PAN ASSY-FL00R<br>SUPPLIER CODE:<br>VS5825                                                                  | 336416            | 1                    |
| 450                                                     | NAS514P1032-6P  | ATTACHING PARTS<br>.SCREW<br>-----*-----                                                                     | 336416            | 4                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                 |                                                                                                              |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R

25-40-15-21A

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-15  
FIG. 21A  
PAGE 9  
OCT 15/24


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 | NOMENCLATURE                                                      | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|---------------|-------------------------------------------------------------------|-------------------|----------------------|
| 21A<br>455                                              | D72D70438-111B |               | .COVER-FLOOR PAN<br>SUPPLIER CODE:<br>VS5825<br>ATTACHING PARTS   | 336416            | 1                    |
| 460                                                     | NAS1801-08-7   |               | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN08-7                  | 336416            | 2                    |
| 465                                                     | NAS1149DN816K  |               | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149DN816J<br>-----*----- | 336416            | 2                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |               |                                                                   |                   |                      |

— ITEM NOT ILLUSTRATED


R Y R

25-40-15-21A

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

25-40-15  
 FIG. 21A  
 PAGE 10  
 OCT 15/24

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

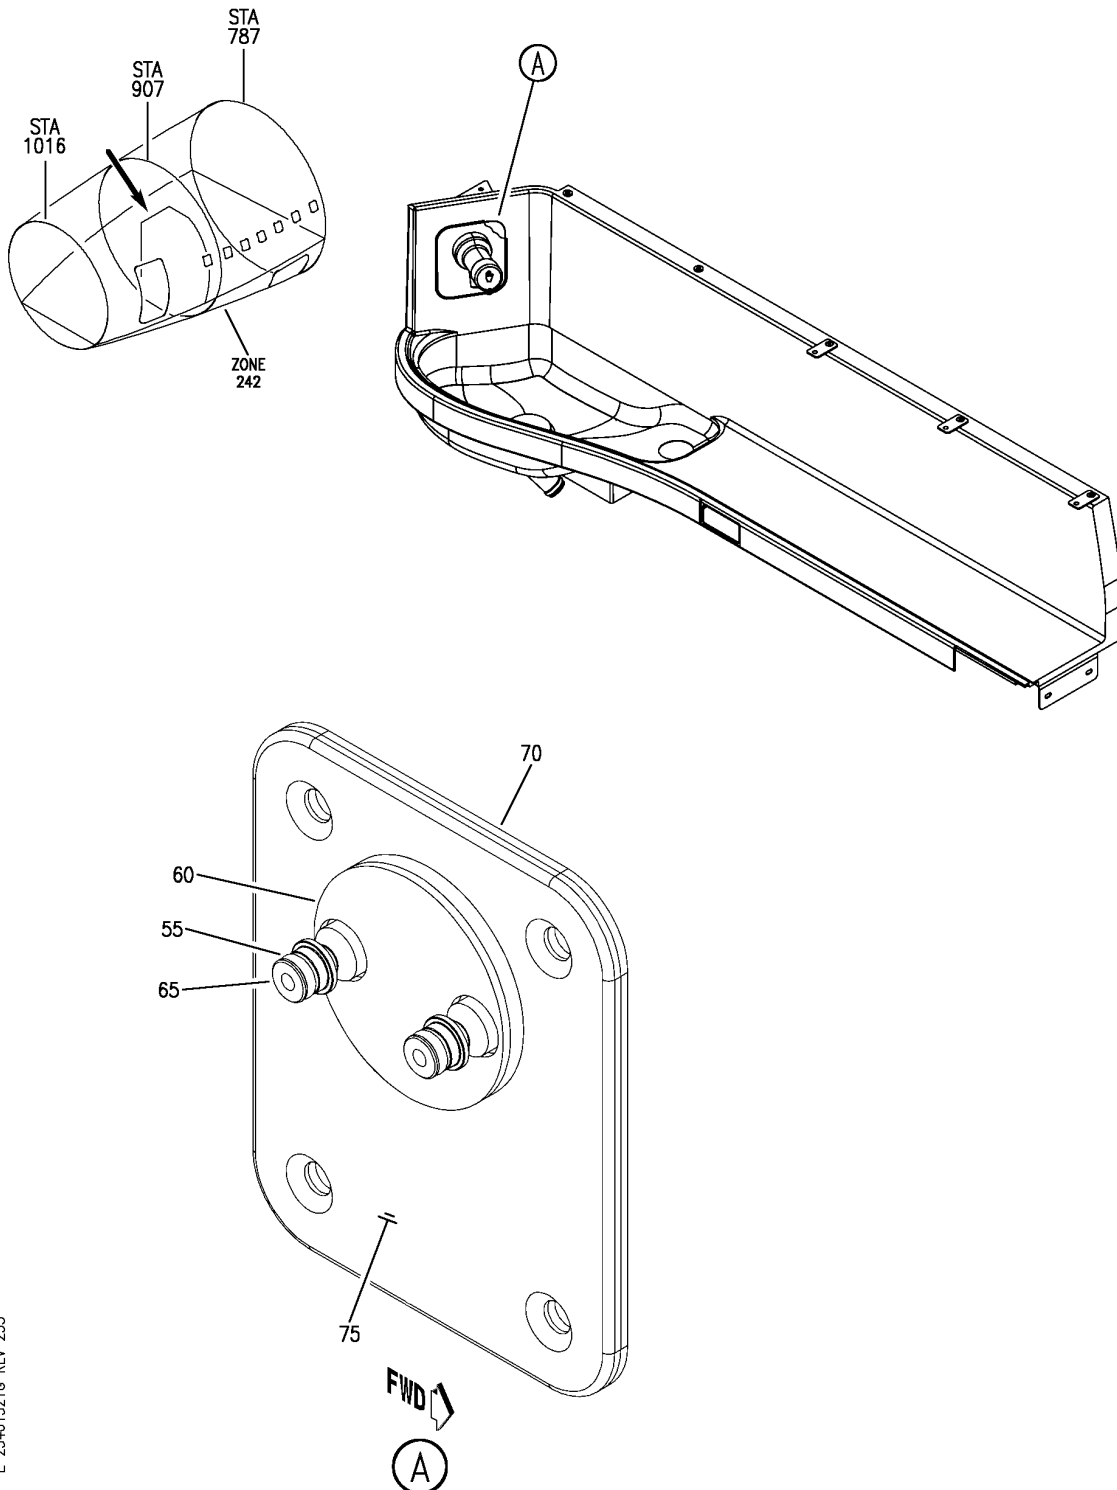

E 25401521G REV 253

PLATE ASSY-FAUCET MTG, LAV  
FIGURE 216

**25-40-15-21G**

R Y R  
APR 15 / 18

25-40-15-21G  
PAGE 0

ECCN 9E991 BOEING PROPRIETARY – See title page for details.


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER  | 1 2 3 4 5 6 7 | NOMENCLATURE                                                                                                                                                      | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|--------------|---------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 21G                                                     |              |               |                                                                                                                                                                   |                   |                      |
| - 1                                                     | SC4L500301-2 |               | PLATE ASSY-FAUCET MTG, LAV<br>PLATE ASSY-FAUCET MTG, LAV<br>SUPPLIER CODE:<br>V6S8D7<br>MISCELLANEOUS DATA:<br>ORDER 4W200301-201<br>FOR NHA SEE:<br>25-41-11-17B | 509999<br>509999  | RF                   |
| - 1                                                     | 4W200301-201 |               | PLATE ASSY-FAUCET MTG, LAV<br>SUPPLIER CODE:<br>V6S8D7<br>FOR NHA SEE:<br>25-41-11-17B                                                                            | 509999            | RF                   |
| - 50                                                    | 4W400301-201 |               | . PLATE ASSY-<br>SUPPLIER CODE:<br>V6S8D7                                                                                                                         | 509999            | 1                    |
| 55                                                      | LCCS14-007B  |               | .. PACKING-<br>SUPPLIER CODE:<br>V6S8D7<br>TRUE PART NUMBER:<br>LCCS-14-007B                                                                                      | 509999            | 2                    |
| 60                                                      | 4W500301-31  |               | .. GASKET-<br>SUPPLIER CODE:<br>V6S8D7                                                                                                                            | 509999            | 1                    |
| 65                                                      | 4W500301-21  |               | .. NIPPLE-<br>SUPPLIER CODE:<br>V6S8D7                                                                                                                            | 509999            | 2                    |
| 70                                                      | 4W500301-29  |               | .. GASKET-<br>SUPPLIER CODE:<br>V6S8D7                                                                                                                            | 509999            | 1                    |
| 75                                                      | 4W500301-27  |               | .. PLATE-<br>SUPPLIER CODE:<br>V6S8D7                                                                                                                             | 509999            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |              |               |                                                                                                                                                                   |                   |                      |

- ITEM NOT ILLUSTRATED


RYR

25-40-15-21G

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-15  
FIG. 21G  
PAGE 1  
JUN 15/18

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

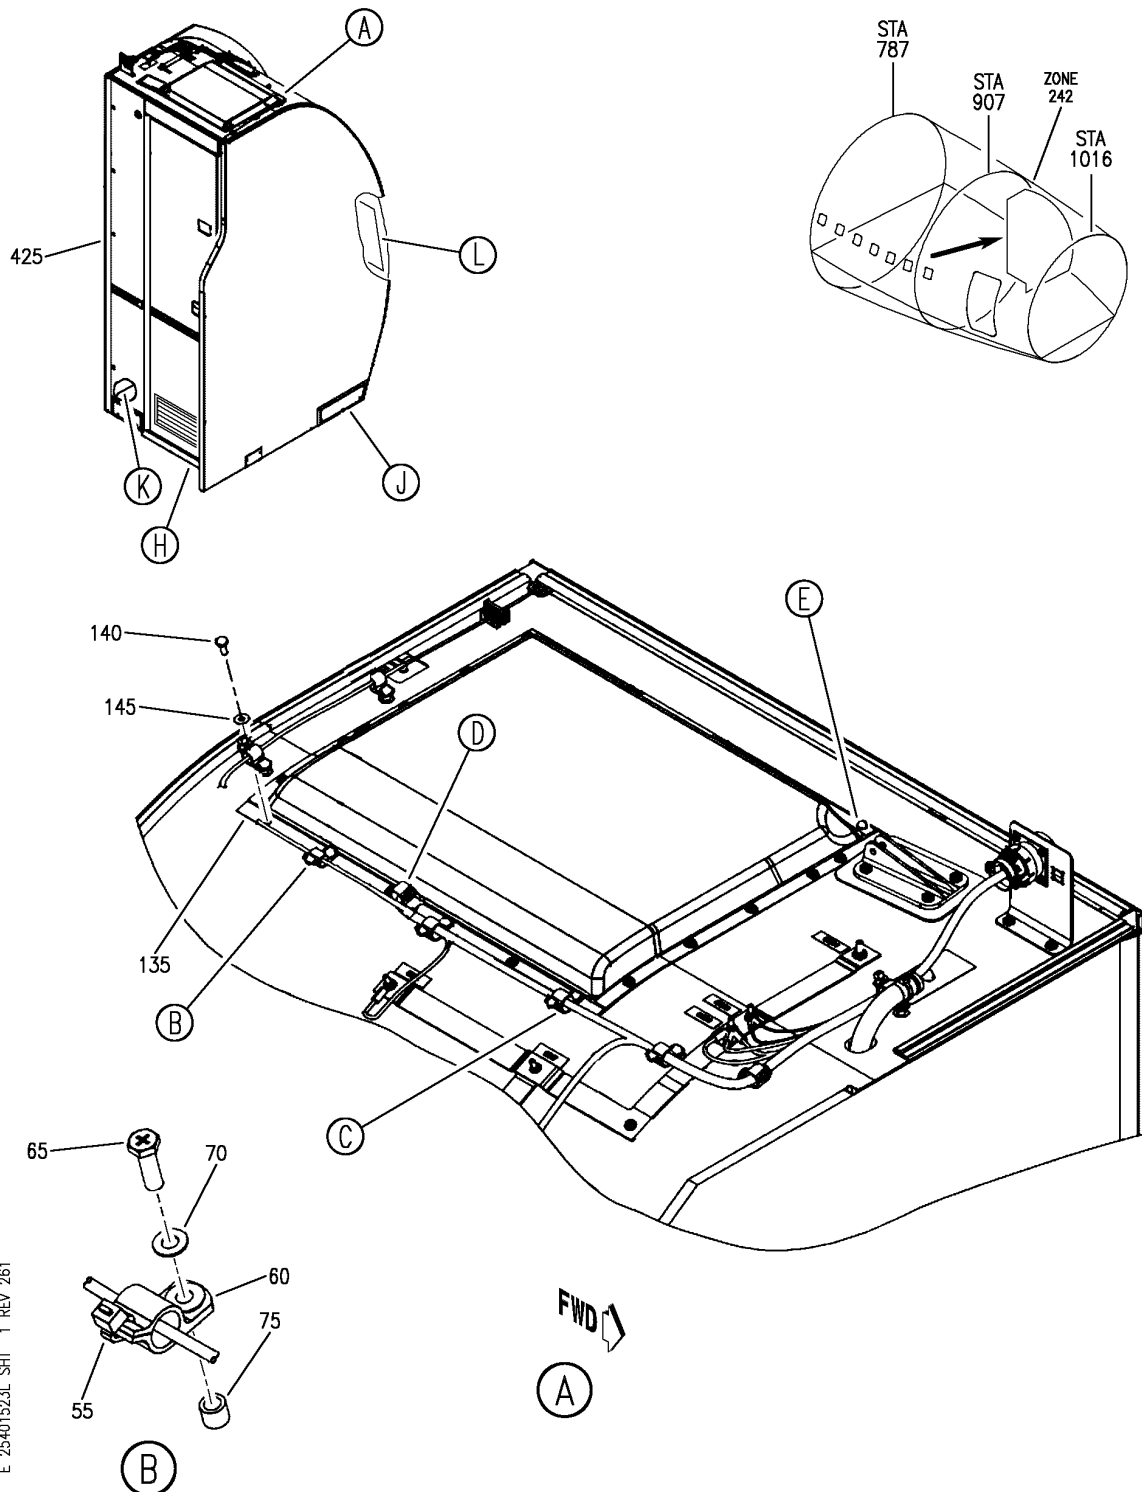

E 25401523L SHT 1 REV 261

MODULE ASSY-LAV E (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 23L (SHEET 1)


**25-40-15-23L**

R/YR  
AUG 15/19

25-40-15-23L  
PAGE 0

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

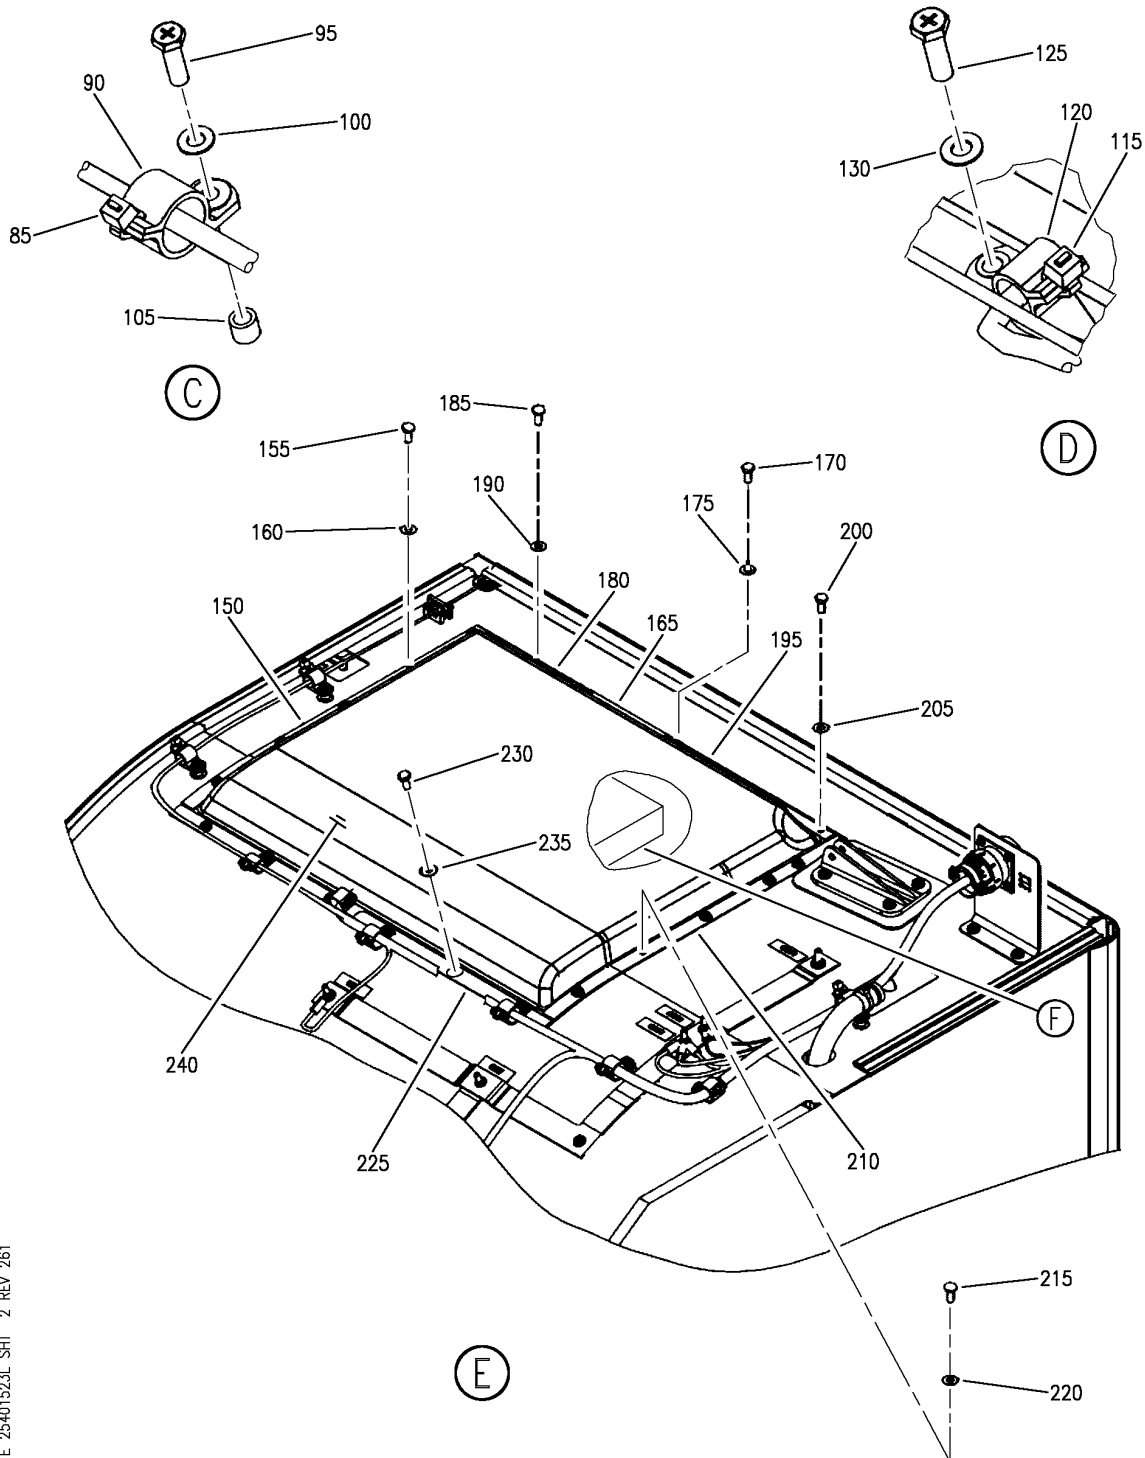

E 25401523L SHT 2 REV 261

MODULE ASSY-LAV E (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 23L (SHEET 2)




**25-40-15-23L**

R/YR  
AUG 15/19

25-40-15-23L  
PAGE 0A

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

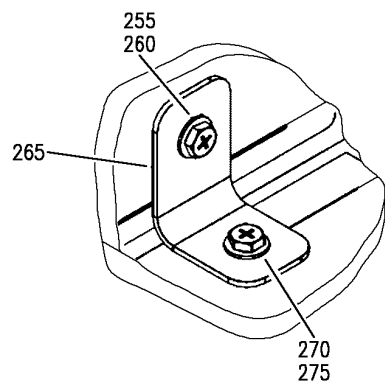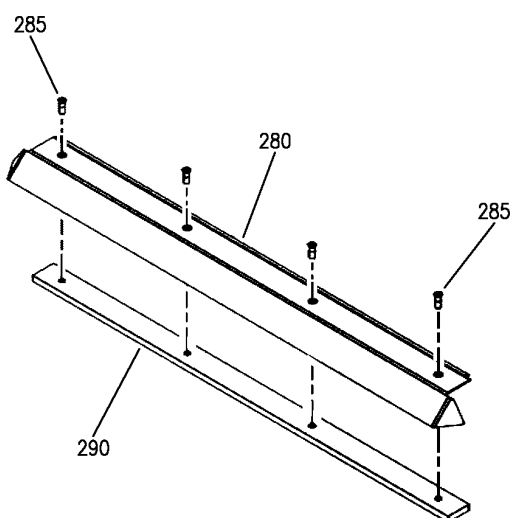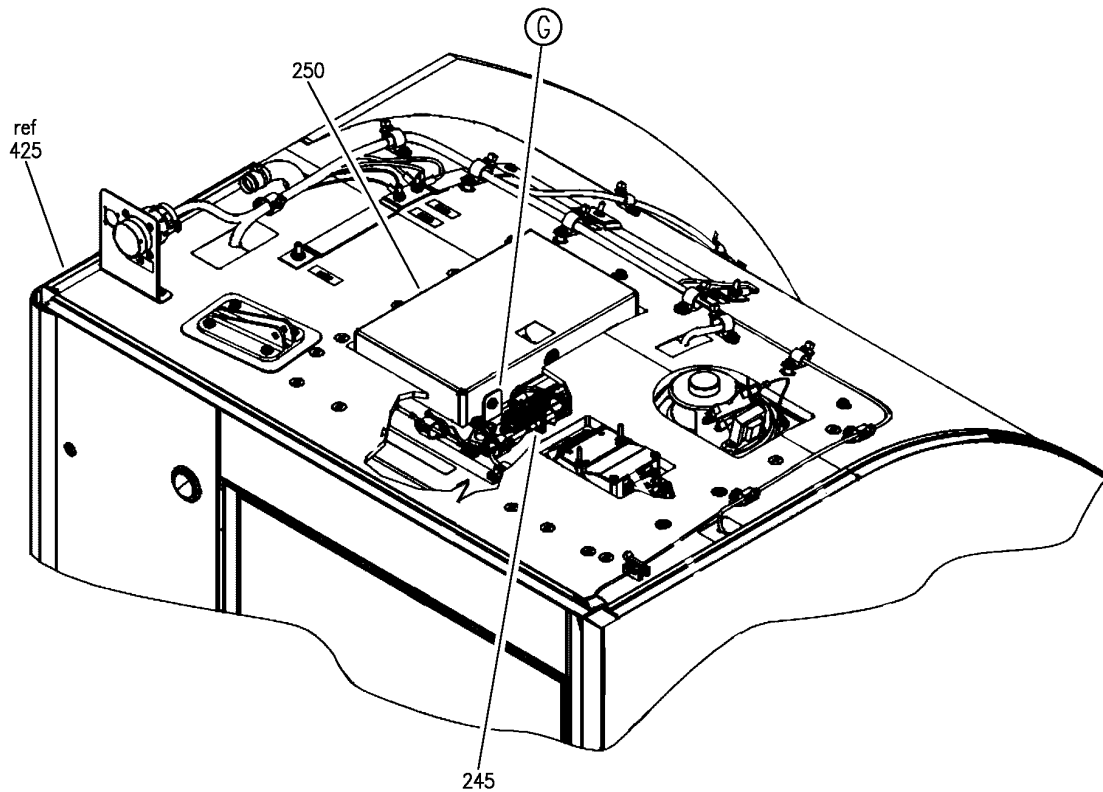

E 25401523L SHT 3 REV 261

MODULE ASSY-LAV E (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 23L (SHEET 3)

**25-40-15-23L**


R/YR  
AUG 15/19

25-40-15-23L  
PAGE 08

ECCN 9E991 BOEING PROPRIETARY - See title page for details.



**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

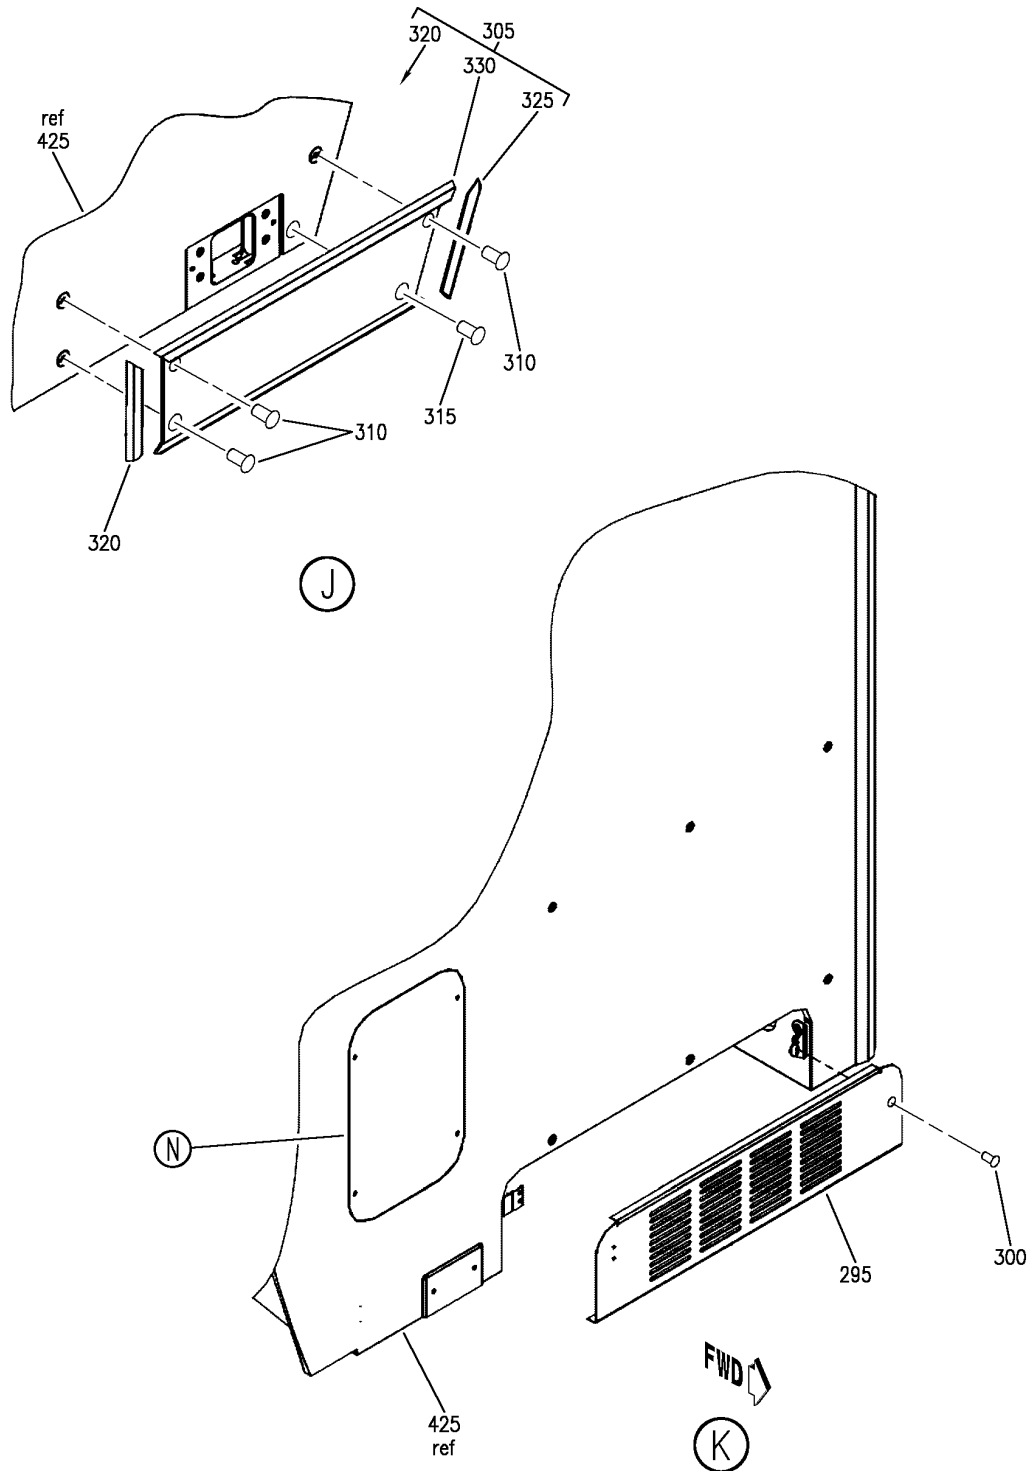

E 25401523L SHIT 4 REV 261

MODULE ASSY-LAV E (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 23L (SHEET 4)


**25-40-15-23L**

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

R/YR  
AUG 15/19

25-40-15-23L  
PAGE 0C

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

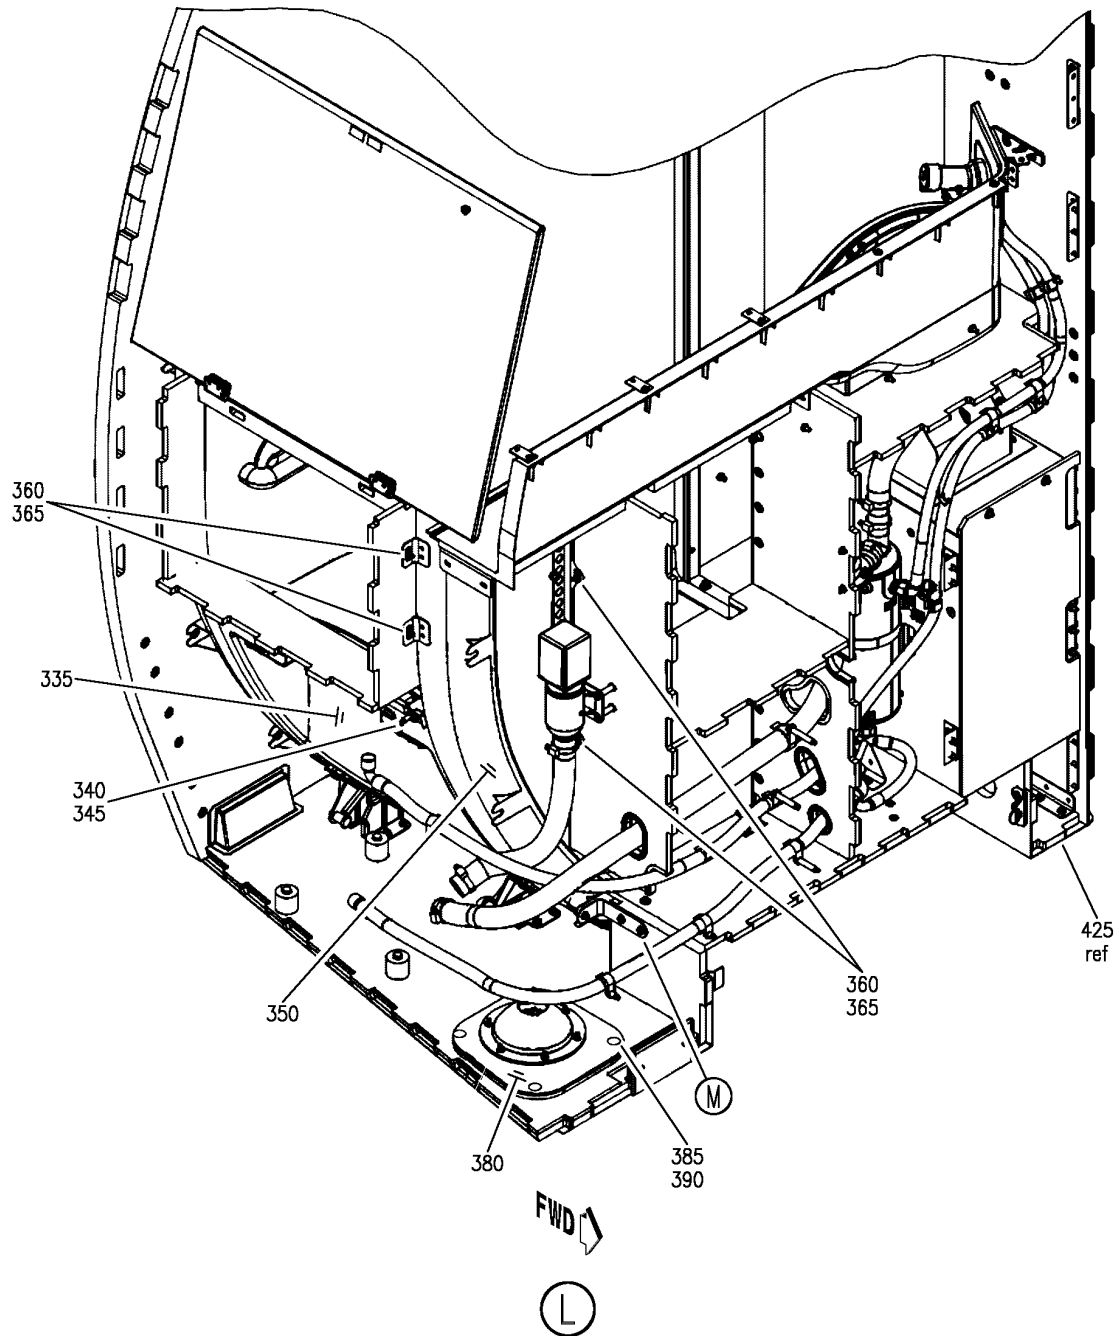

E 25401523L SHT 5 REV 261

MODULE ASSY-LAV E (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 23L (SHEET 5)



**25-40-15-23L**

R/YR  
AUG 15/19

25-40-15-23L  
PAGE 00

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

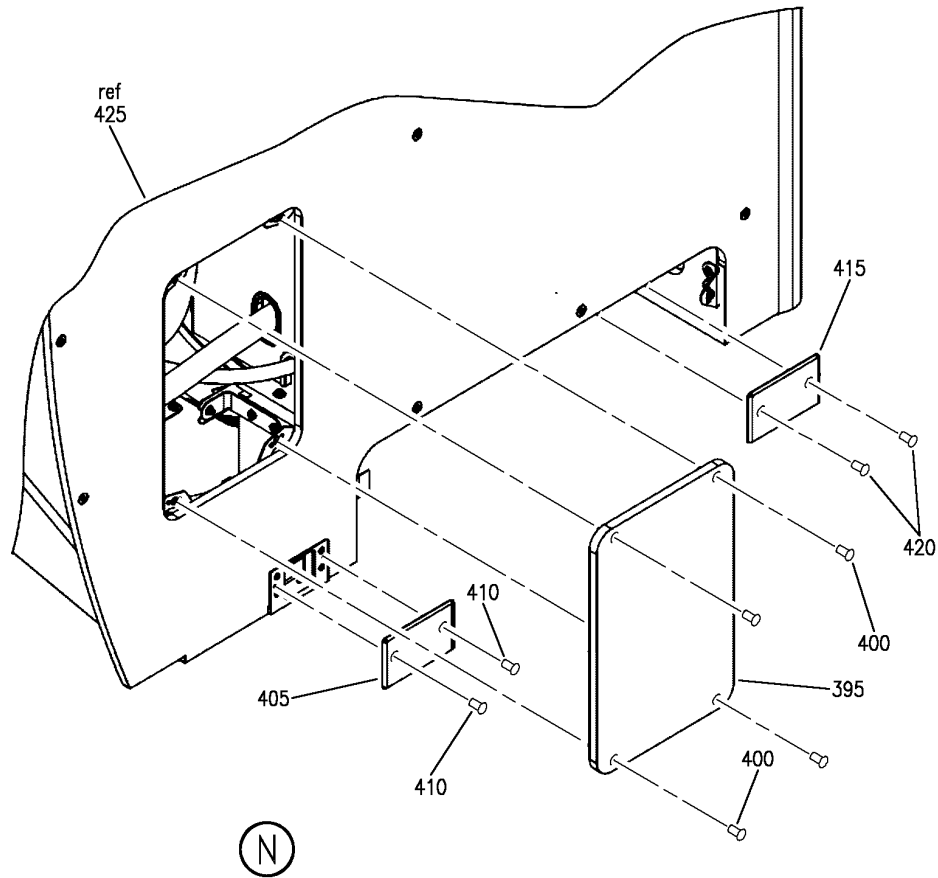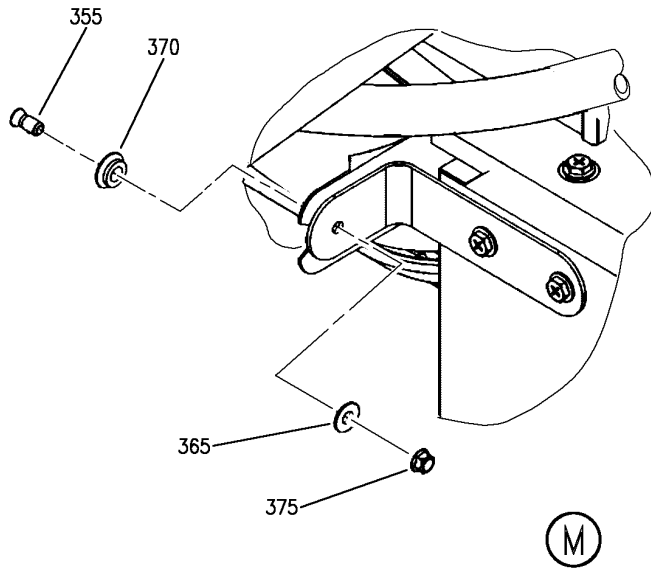

E 25401523L SH1 6 REV 261

MODULE ASSY-LAV E (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 23L (SHEET 6)

**25-40-15-23L**

R Y R  
AUG 15/19

25-40-15-23L  
PAGE 0E

ECCN 9E991 BOEING PROPRIETARY - See title page for details.


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 | NOMENCLATURE                                                                                                                                                                                                                                                                                             | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|---------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 23L                                                     |                |               | MODULE ASSY-LAV E<br>(EQUIPMENT/FURNISHINGS<br>ONLY)                                                                                                                                                                                                                                                     | 509999            |                      |
| - 1                                                     | 1L300050-1397A |               | MODULE ASSY-LAV E<br>(EQUIPMENT/FURNISHINGS<br>ONLY)<br>SUPPLIER CODE:<br>V6S8D7<br>FUNCTIONAL DESCRIPTION:<br>PROVIDES LAVATORY<br>FACILITIES FOR<br>PASSENGERS AND CREW<br>ELECTRICAL EQUIP NUMBER:<br>M01419<br>COMPONENT MAINT MANUAL REF:<br>25-40-51<br>FOR NHA/OTHER SYS DET SEE:<br>25-40-15-01B | 509999            | RF                   |
| - 50                                                    | 9L500001-106   |               | .CLAMP INSTL-ELECTRICAL<br>SUPPLIER CODE:<br>V6S8D7                                                                                                                                                                                                                                                      | 509999            | 1                    |
| 55                                                      | MS3367-5-9     |               | ..STRAP<br>STANDARD SUBSTITUTION:<br>BACS38K5                                                                                                                                                                                                                                                            | 509999            | 1                    |
| 60                                                      | CA2030-2       |               | ..CLAMP-<br>SUPPLIER CODE:<br>V03296<br>ATTACHING PARTS                                                                                                                                                                                                                                                  | 509999            | 1                    |
| 65                                                      | NAS1801-3-10   |               | ..SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-10                                                                                                                                                                                                                                                        | 509999            | 1                    |
| 70                                                      | NAS1149D0316K  |               | ..WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J                                                                                                                                                                                                                                                      | 509999            | 1                    |
| 75                                                      | NAS43DD3-16N   |               | ..SPACER<br>STANDARD SUBSTITUTION:<br>NAS43DD3-16FC<br>-----*-----                                                                                                                                                                                                                                       | 509999            | 1                    |
| - 80                                                    | 9L500001-107   |               | .CLAMP INSTL-ELECTRICAL<br>SUPPLIER CODE:<br>V6S8D7                                                                                                                                                                                                                                                      | 509999            | 1                    |
| 85                                                      | MS3367-5-9     |               | ..STRAP<br>STANDARD SUBSTITUTION:<br>BACS38K5                                                                                                                                                                                                                                                            | 509999            | 1                    |
| 90                                                      | CA2030-3       |               | ..CLAMP-<br>SUPPLIER CODE:<br>V03296                                                                                                                                                                                                                                                                     | 509999            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |               |                                                                                                                                                                                                                                                                                                          |                   |                      |

- ITEM NOT ILLUSTRATED

RYR

25-40-15-23L

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-15  
FIG. 23L  
PAGE 1  
APR 15/23


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER   | 1 2 3 4 5 6 7 NOMENCLATURE                                           | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|---------------|----------------------------------------------------------------------|-------------------|----------------------|
| 23L                                                     |               |                                                                      |                   |                      |
| 95                                                      | NAS1801-3-10  | ATTACHING PARTS<br>..SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-10 | 509999            | 1                    |
| 100                                                     | NAS1149D0316K | ..WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J                  | 509999            | 1                    |
| 105                                                     | NAS43DD3-16N  | ..SPACER<br>STANDARD SUBSTITUTION:<br>NAS43DD3-16FC                  | 509999            | 1                    |
| - 110                                                   | 9L500001-103  | -----*-----<br>.CLAMP INSTL-ELECTRICAL<br>SUPPLIER CODE:<br>V6S8D7   | 509999            | 2                    |
| 115                                                     | MS3367-5-9    | ..STRAP<br>STANDARD SUBSTITUTION:<br>BACS38K5                        | 509999            | 1                    |
| 120                                                     | CA2030-3      | ..CLAMP-<br>SUPPLIER CODE:<br>V03296                                 | 509999            | 1                    |
| 125                                                     | NAS1801-3-6   | ATTACHING PARTS<br>..SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6  | 509999            | 1                    |
| 130                                                     | NAS1149D0316K | ..WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J                  | 509999            | 1                    |
| 135                                                     | 1L500409-795  | -----*-----<br>.STRAP-FIRE BLANKET<br>SUPPLIER CODE:<br>V6S8D7       | 509999            | 1                    |
| 140                                                     | NAS1801-3-6   | ATTACHING PARTS<br>.SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6   | 509999            | 1                    |
| 145                                                     | NAS1149D0316K | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J                   | 509999            | 1                    |
| 150                                                     | 1L500409-781  | -----*-----<br>.STRAP-FIRE BLANKET<br>SUPPLIER CODE:<br>V6S8D7       | 509999            | 1                    |
| 155                                                     | NAS1801-3-6   | ATTACHING PARTS<br>.SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6   | 509999            | 5                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |               |                                                                      |                   |                      |

- ITEM NOT ILLUSTRATED

R Y R

25-40-15-23L

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-15  
FIG. 23L  
PAGE 2  
APR 15/23


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER   | 1 2 3 4 5 6 7 NOMENCLATURE                                         | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|---------------|--------------------------------------------------------------------|-------------------|----------------------|
| 23L<br>160                                              | NAS1149D0316K | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J<br>-----*-----  | 509999            | 5                    |
| 165                                                     | 1L500409-791  | .STRAP-FIRE BLANKET<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS | 509999            | 1                    |
| 170                                                     | NAS1801-3-6   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                    | 509999            | 2                    |
| 175                                                     | NAS1149D0316K | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J<br>-----*-----  | 509999            | 2                    |
| 180                                                     | 1L500409-723  | .STRAP-FIRE BLANKET<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS | 509999            | 1                    |
| 185                                                     | NAS1801-3-6   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                    | 509999            | 2                    |
| 190                                                     | NAS1149D0316K | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J<br>-----*-----  | 509999            | 2                    |
| 195                                                     | 1L500409-721  | .STRAP-FIRE BLANKET<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS | 509999            | 1                    |
| 200                                                     | NAS1801-3-6   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                    | 509999            | 3                    |
| 205                                                     | NAS1149D0316K | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J<br>-----*-----  | 509999            | 3                    |
| 210                                                     | 1L500409-787  | .STRAP-FIRE BLANKET<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS | 509999            | 1                    |
| 215                                                     | NAS1801-3-6   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                    | 509999            | 5                    |
| 220                                                     | NAS1149D0316K | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J<br>-----*-----  | 509999            | 5                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |               |                                                                    |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R

25-40-15-23L

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-15  
 FIG. 23L  
 PAGE 3  
 APR 15/23


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER   | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                                                                                                                                                                                                                           | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|---------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 23L<br>225                                              | 1L500409-797  | .STRAP-FIRE BLANKET<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                                                                                                                                                                                                                                                   | 509999            | 1                    |
| 230                                                     | NAS1801-3-6   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                                                                                                                                                                                                                                                                      | 509999            | 1                    |
| 235                                                     | NAS1149D0316K | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J<br>-----*-----                                                                                                                                                                                                                                                    | 509999            | 1                    |
| 240                                                     | 1L500409-793  | .BLANKET-FIRE<br>SUPPLIER CODE:<br>V6S8D7                                                                                                                                                                                                                                                                            | 509999            | 1                    |
| 245                                                     | MS3367-5-9    | .STRAP<br>STANDARD SUBSTITUTION:<br>BACS38K5                                                                                                                                                                                                                                                                         | 509999            | AR                   |
| 250                                                     | 4576001-101   | .BOX ASSY-OXY<br>SUPPLIER CODE:<br>V16827<br>FUNCTIONAL DESCRIPTION:<br>STORES OXYGEN AND MASK<br>ASSEMBLIES. CONTROLS THE<br>DELIVERY OF OXYGEN TO<br>EACH MASK AND<br>COMMUNICATES WITH THE<br>AIRPLANE NETWORK.<br>COMPONENT MAINT MANUAL REF:<br>25-23-68<br>FOR DETAILS SEE:<br>35-21-00-01A<br>ATTACHING PARTS | 509999            | 1                    |
| 255                                                     | NAS1801-3-6   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                                                                                                                                                                                                                                                                      | 509999            | 4                    |
| 260                                                     | NAS1149D0332J | .WASHER<br>-----*-----                                                                                                                                                                                                                                                                                               | 509999            | 4                    |
| 265                                                     | 4L500403-17   | .ANGLE-<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                                                                                                                                                                                                                                                               | 509999            | 4                    |
| 270                                                     | NAS1801-3-6   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                                                                                                                                                                                                                                                                      | 509999            | 4                    |
| 275                                                     | NAS1149D0332J | .WASHER<br>-----*-----                                                                                                                                                                                                                                                                                               | 509999            | 4                    |
| 280                                                     | 1L500105-16   | .THRESHOLD-<br>SUPPLIER CODE:<br>V6S8D7                                                                                                                                                                                                                                                                              | 509999            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |               |                                                                                                                                                                                                                                                                                                                      |                   |                      |

— ITEM NOT ILLUSTRATED

RYR

25-40-15-23L

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-15  
 FIG. 23L  
 PAGE 4  
 APR 15/23


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 NOMENCLATURE                                                                      | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|-------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 23L                                                     |                |                                                                                                 |                   |                      |
| 285                                                     | NAS8703A4      | ATTACHING PARTS<br>.BOLT<br>STANDARD SUBSTITUTION:<br>BACB30ZE3K4<br>-----*-----                | 509999            | 4                    |
| 290                                                     | 1L500109-147   | .SPACER-THRESHOLD<br>SUPPLIER CODE:<br>V6S8D7                                                   | 509999            | 1                    |
| 295                                                     | 1L400040-42    | .COVER-TRASH TRAP<br>SUPPLIER CODE:<br>V6S8D7                                                   | 509999            | 1                    |
| 300                                                     | NAS8303-7      | ATTACHING PARTS<br>.SCREW<br>-----*-----                                                        | 509999            | 1                    |
| 305                                                     | 1L400109-404BA | .KICKSTRIP ASSY-<br>SUPPLIER CODE:<br>V6S8D7                                                    | 509999            | 1                    |
| 310                                                     | NAS514P832-5   | ATTACHING PARTS<br>.SCREW                                                                       | 509999            | 3                    |
| 315                                                     | NAS514P632-5   | .SCREW<br>-----*-----                                                                           | 509999            | 1                    |
| 320                                                     | 1L500109-463BA | ..CAP-<br>SUPPLIER CODE:<br>V6S8D7                                                              | 509999            | 1                    |
| 325                                                     | 1L500109-472BA | ..ENDCAP-<br>SUPPLIER CODE:<br>V6S8D7                                                           | 509999            | 1                    |
| 330                                                     | 1L500109-474BA | ..RETAINER-<br>SUPPLIER CODE:<br>V6S8D7                                                         | 509999            | 1                    |
| 335                                                     | 1L400407-51    | .SHROUD ASSY-TOILET LID<br>SEAT<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-41-21-24E | 509999            | 1                    |
| 340                                                     | 85-99-541-20   | .FASTENER-QUARTER TURN<br>SUPPLIER CODE:<br>V94222                                              | 509999            | 3                    |
| 345                                                     | 85-34-301-12   | ATTACHING PARTS<br>.RETAINER-QUARTER TURN STUD<br>SUPPLIER CODE:<br>V94222<br>-----*-----       | 509999            | 3                    |
| 350                                                     | 1L400407-260   | .SHROUD-<br>SUPPLIER CODE:<br>V6S8D7                                                            | 509999            | 1                    |
| 355                                                     | NAS514P1032-7  | ATTACHING PARTS<br>.SCREW                                                                       | 509999            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |                                                                                                 |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R

25-40-15-23L

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-15  
FIG. 23L  
PAGE 5  
APR 15/23




**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER                   | 1 2 3 4 5 6 7 NOMENCLATURE                                                                              | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|-------------------------------|---------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 23L<br>360                                              | 09T305                        | .SCREW-<br>SUPPLIER CODE:<br>V94222<br>TRUE PART NUMBER:<br>09-T-305                                    | 509999            | 4                    |
| 365<br>370                                              | NAS1149D0332J<br>1L500407-203 | .WASHER<br>.FASTENER-SNAP<br>SUPPLIER CODE:<br>V6S8D7                                                   | 509999<br>509999  | 5<br>1               |
| 375                                                     | MS21042L3                     | .NUT<br>STANDARD SUBSTITUTION:<br>BACN11AG3<br>-----*-----                                              | 509999            | 1                    |
| 380                                                     | 4L400401-25                   | .PLATE ASSY-CLOSEOUT<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-41-11-17A<br>ATTACHING PARTS | 509999            | 1                    |
| 385                                                     | NAS1801-3-11                  | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-11                                                        | 509999            | 4                    |
| 390                                                     | NAS1149D0332J                 | .WASHER<br>-----*-----                                                                                  | 509999            | 4                    |
| 395                                                     | 1L500409-907                  | .PANEL-ACCESS<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                                            | 509999            | 1                    |
| 400                                                     | D4-99-161                     | .FASTENER-QUARTER TURN<br>SUPPLIER CODE:<br>V94222<br>-----*-----                                       | 509999            | 4                    |
| 405                                                     | 1L500409-313                  | .PLATE-COVER<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                                             | 509999            | 1                    |
| 410                                                     | NAS514P632-5                  | .SCREW<br>-----*-----                                                                                   | 509999            | 2                    |
| 415                                                     | 1L500409-263                  | .PLATE-COVER<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                                             | 509999            | 1                    |
| 420                                                     | NAS514P632-5                  | .SCREW<br>-----*-----                                                                                   | 509999            | 2                    |
| 425                                                     | 1L360051-1397A                | .LAVATORY ASSY-LAV E<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-40-15-23P                    | 509999            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                               |                                                                                                         |                   |                      |

— ITEM NOT ILLUSTRATED


R Y R

25-40-15-23L

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

25-40-15  
 FIG. 23L  
 PAGE 6  
 APR 15/23

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

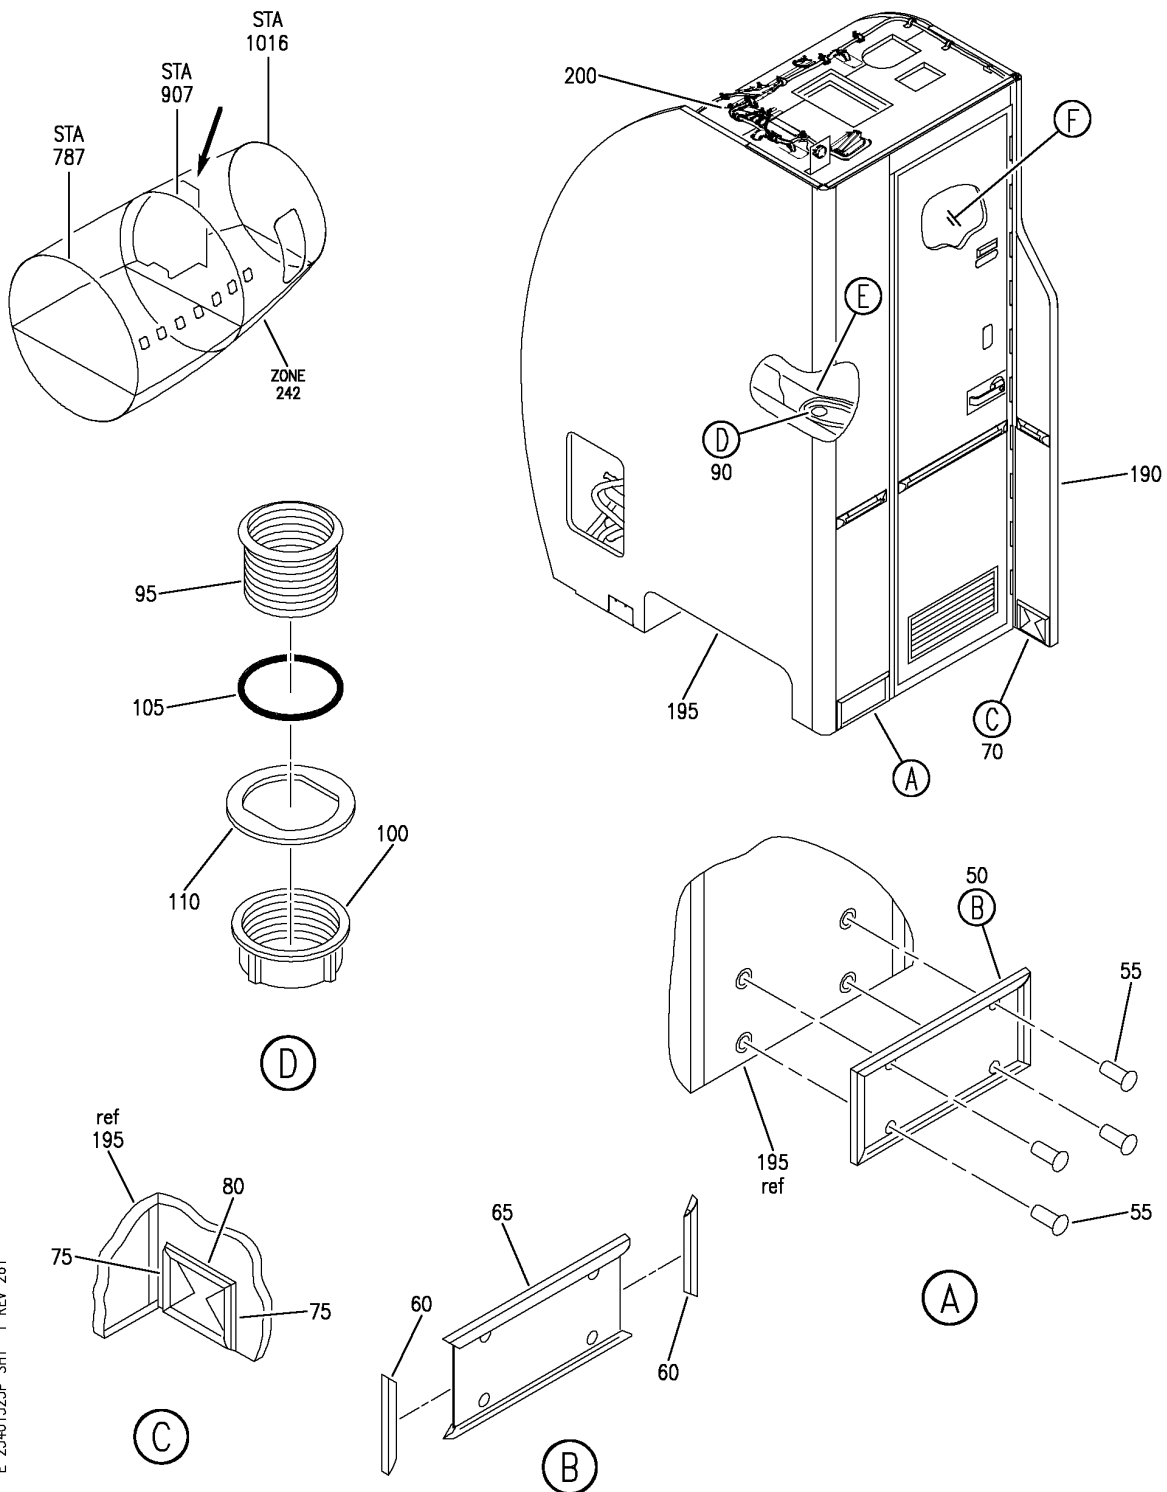

E 25401523P SHT 1 REV 261

LAVATORY ASSY-LAV  
FIGURE 23P (SHEET 1)


**25-40-15-23P**

R Y R  
APR 15/18

25-40-15-23P  
PAGE 0

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

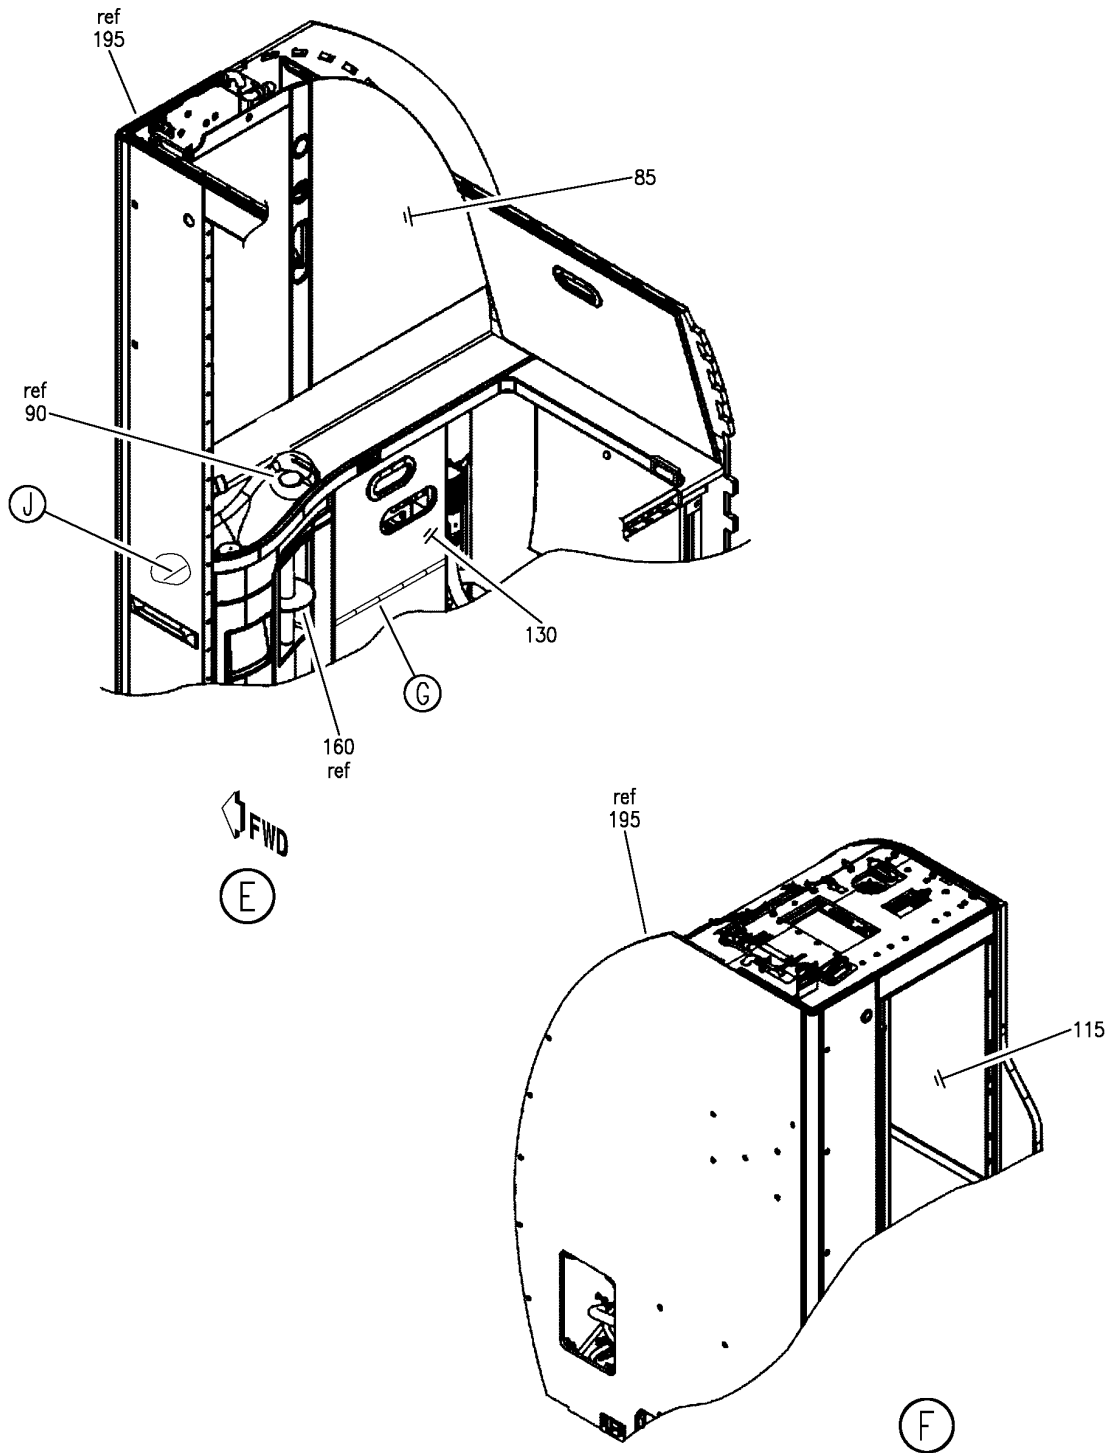

E 25401523P SHT 2 REV 261

LAVATORY ASSY-LAV  
FIGURE 23P (SHEET 2)




**25-40-15-23P**

R Y R  
APR 15/18

25-40-15-23P  
PAGE 0A

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

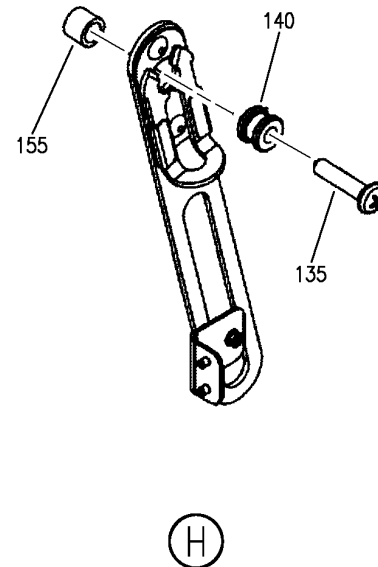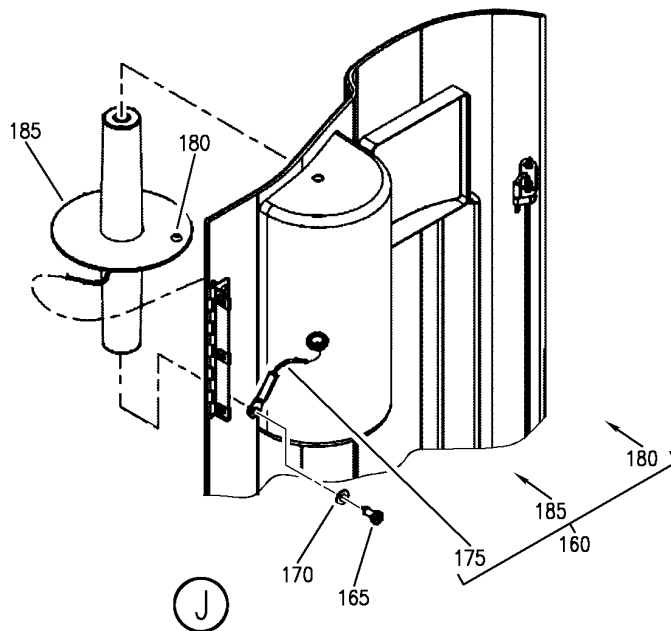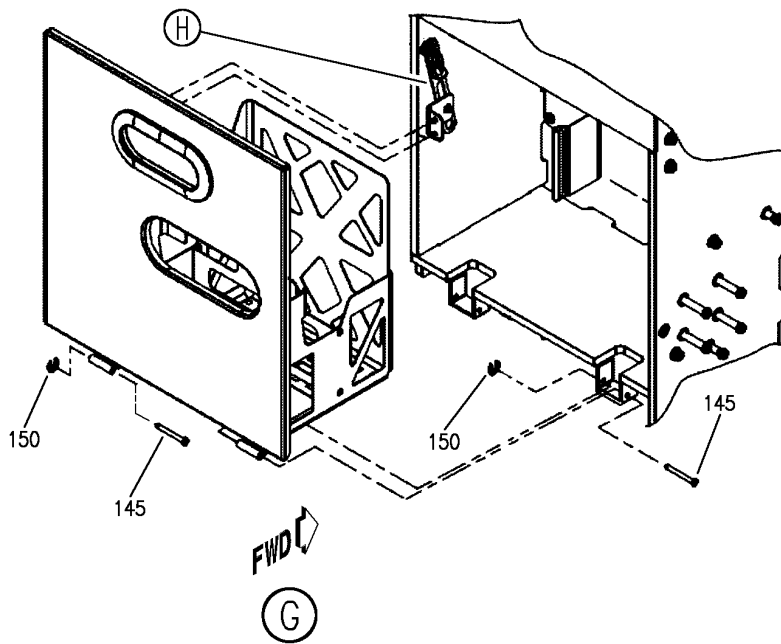

E 25401523P SHT 3 REV 261

LAVATORY ASSY-LAV  
FIGURE 23P (SHEET 3)

**25-40-15-23P**

R Y R  
A P R 15 / 18

25-40-15-23P  
PAGE 0B

ECCN 9E991 BOEING PROPRIETARY - See title page for details.


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 NOMENCLATURE                                                                           | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 23P                                                     |                |                                                                                                      |                   |                      |
| - 1                                                     | 1L360051-1397A | LAVATORY ASSY-LAV<br>LAVATORY ASSY-LAV E<br>SUPPLIER CODE:<br>V6S8D7<br>FOR NHA SEE:<br>25-40-15-23L | 509999<br>509999  | R F                  |
| 50                                                      | 1L500109-957BA | .KICKSTRIP ASSY-<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                                      | 509999            | 1                    |
| 55                                                      | NAS514P832-5   | .SCREW<br>-----*-----                                                                                | 509999            | 4                    |
| 60                                                      | 1L500109-463BA | ..CAP-END<br>SUPPLIER CODE:<br>V6S8D7                                                                | 509999            | 2                    |
| 65                                                      | 1L500109-955BA | ..RETAINER-<br>SUPPLIER CODE:<br>V6S8D7                                                              | 509999            | 1                    |
| 70                                                      | 1L400109-473BA | .KICKSTRIP ASSY-<br>SUPPLIER CODE:<br>V6S8D7                                                         | 509999            | 1                    |
| 75                                                      | 1L500109-493BA | ..CAP-END<br>SUPPLIER CODE:<br>V6S8D7                                                                | 509999            | 2                    |
| 80                                                      | 1L500109-513BA | ..RETAINER-<br>SUPPLIER CODE:<br>V6S8D7                                                              | 509999            | 1                    |
| 85                                                      | 1L400403-87    | .MIRROR ASSY-FXD<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-41-51-60Q                     | 509999            | 1                    |
| 90                                                      | 1L400401-211   | .SOAP DISPENSER ASSY-<br>THREADED, ADP<br>SUPPLIER CODE:<br>V6S8D7                                   | 509999            | 1                    |
| 95                                                      | 1L500401-233   | ..FITTING-<br>SUPPLIER CODE:<br>V6S8D7<br>CONFIG CHG DATA FROM A CMM:<br>SUPSD BY 1L500401-441       | 509999            | 1                    |
| 95                                                      | 1L500401-441   | ..FITTING-<br>SUPPLIER CODE:<br>V6S8D7<br>CONFIG CHG DATA FROM A CMM:<br>SUPERSEDES 1L500401-233     | 509999            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |                                                                                                      |                   |                      |

- ITEM NOT ILLUSTRATED

R Y R

25-40-15-23P

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-15  
FIG. 23P  
PAGE 1  
JUN 15/23


**BOEING**  
**737-600/700/800/900**  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER   | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|---------------|-----------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 23P                                                     |               |                                                                                                           |                   |                      |
| 100                                                     | 1L500401-171  | ATTACHING PARTS<br>..NUT-<br>SUPPLIER CODE:<br>V6S8D7<br>-----*-----                                      | 509999            | 1                    |
| - 102                                                   | MS3367-32-9   | ..TIE                                                                                                     | 509999            | 1                    |
| 105                                                     | MS28775-031   | ..PACKING                                                                                                 | 509999            | 1                    |
| 110                                                     | 1L500401-415  | ..WASHER-LOCK<br>SUPPLIER CODE:<br>V6S8D7                                                                 | 509999            | 1                    |
| 115                                                     | 1L400403-231  | .MIRROR ASSY-AFT WALL<br>SUPPLIER CODE:<br>V6S8D7                                                         | 509999            | 1                    |
| - 120                                                   | 1L500403-231  | ..MIRROR-<br>SUPPLIER CODE:<br>V6S8D7                                                                     | 509999            | 1                    |
| 130                                                     | 1L400201-111  | .DRAWER ASSY-AMENITIES<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-41-51-59F<br>ATTACHING PARTS | 509999            | 1                    |
| 135                                                     | NAS602-12P    | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12CK08-12                                                         | 509999            | 1                    |
| 140                                                     | TL05-117-52   | .KEEPER-SLIDE-LATCH<br>SUPPLIER CODE:<br>V94222<br>TRUE PART NUMBER:<br>TL-05-117-52                      | 509999            | 1                    |
| 145                                                     | CPG3-151B     | .PIN-GROOVED-CLEVIS<br>SUPPLIER CODE:<br>VOCUJ4<br>TRUE PART NUMBER:<br>CPG3-151-B                        | 509999            | 2                    |
| 150                                                     | MS16633-1018  | .RING<br>STANDARD SUBSTITUTION:<br>MS16633-2018                                                           | 509999            | 2                    |
| 155                                                     | NAS43DD3-16FC | .SPACER<br>-----*-----                                                                                    | 509999            | 1                    |
| 160                                                     | 1L400401-219  | .HOLDER ASSY-TOILET PAPER<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                                  | 509999            | 1                    |
| 165                                                     | NAS1801-3-5   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-5                                                           | 509999            | 1                    |
| 170                                                     | NAS1149D0332J | .WASHER<br>-----*-----                                                                                    | 509999            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |               |                                                                                                           |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R

25-40-15-23P

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-15  
FIG. 23P  
PAGE 2  
OCT 15/23


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                                                                                                                          | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 23P<br>175                                              | L94B1000S3     | ..LANYARD-<br>SUPPLIER CODE:<br>VOCUJ4<br>TRUE PART NUMBER:<br>L94B-1000S-3<br>MISCELLANEOUS DATA:<br>ORDER LCCS5-3BB1000                                                                                           | 509999            | 1                    |
| 175                                                     | LCCS5-3BB1000  | ..LANYARD-<br>SUPPLIER CODE:<br>V6S8D7<br>TRUE PART NUMBER:<br>LCCS-5-3-BB-1000<br>MISCELLANEOUS DATA:<br>TRUE PART NO:<br>LCCS-5-3-BB-1000<br><br>PIVOT POINT, INC. PART<br>NUMBER L94B-1000S-3<br>ATTACHING PARTS | 509999            | 1                    |
| 180                                                     | MS20470AD6-6   | ..RIVET-<br>STANDARD SUBSTITUTION:<br>BACR15BB6AD6C<br>CONFIG CHG DATA FROM A CMM:<br>SUPSD BY MS20470A6-6                                                                                                          | 509999            | 1                    |
| 180                                                     | MS20470A6-6    | ..RIVET-<br>STANDARD SUBSTITUTION:<br>BACR15BB6A6C<br>CONFIG CHG DATA FROM A CMM:<br>SUPERSEDES MS20470AD6-6<br>-----*-----                                                                                         | 509999            | 1                    |
| 185                                                     | 1L400401-145   | ..HOLDER-<br>SUPPLIER CODE:<br>V6S8D7                                                                                                                                                                               | 509999            | 1                    |
| 190                                                     | 1L500409-815   | .TRIM-EDGE<br>SUPPLIER CODE:<br>V6S8D7                                                                                                                                                                              | 509999            | 1                    |
| 195                                                     | 1L306051-437HF | .STRUCTURE ASSY-<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-40-15-16C                                                                                                                                    | 509999            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |                                                                                                                                                                                                                     |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R

25-40-15-23P

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

25-40-15  
 FIG. 23P  
 PAGE 3  
 JUN 15/24


**BOEING**  
**737-600/700/800/900**  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER  | 1 2 3 4 5 6 7 | NOMENCLATURE                                                                                                                                                                                                                             | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|--------------|---------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 23P<br>200                                              | 3L306050-145 |               | .ELECTRICAL INSTL-STRUCT<br>SUPPLIER CODE:<br>V6S8D7<br>FUNCTIONAL REFERENCE:<br>EQUIPMENT/FURNISHINGS<br>FOR DETAILS SEE<br>25-41-60-60G<br>LIGHTS<br>FOR DETAILS SEE<br>33-27-51-20B<br>WATER/WASTE<br>FOR DETAILS SEE<br>38-32-04-11X | 509999            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |              |               |                                                                                                                                                                                                                                          |                   |                      |

— ITEM NOT ILLUSTRATED

RYR


25-40-15-23P

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

25-40-15  
 FIG. 23P  
 PAGE 4  
 DEC 15/23



**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

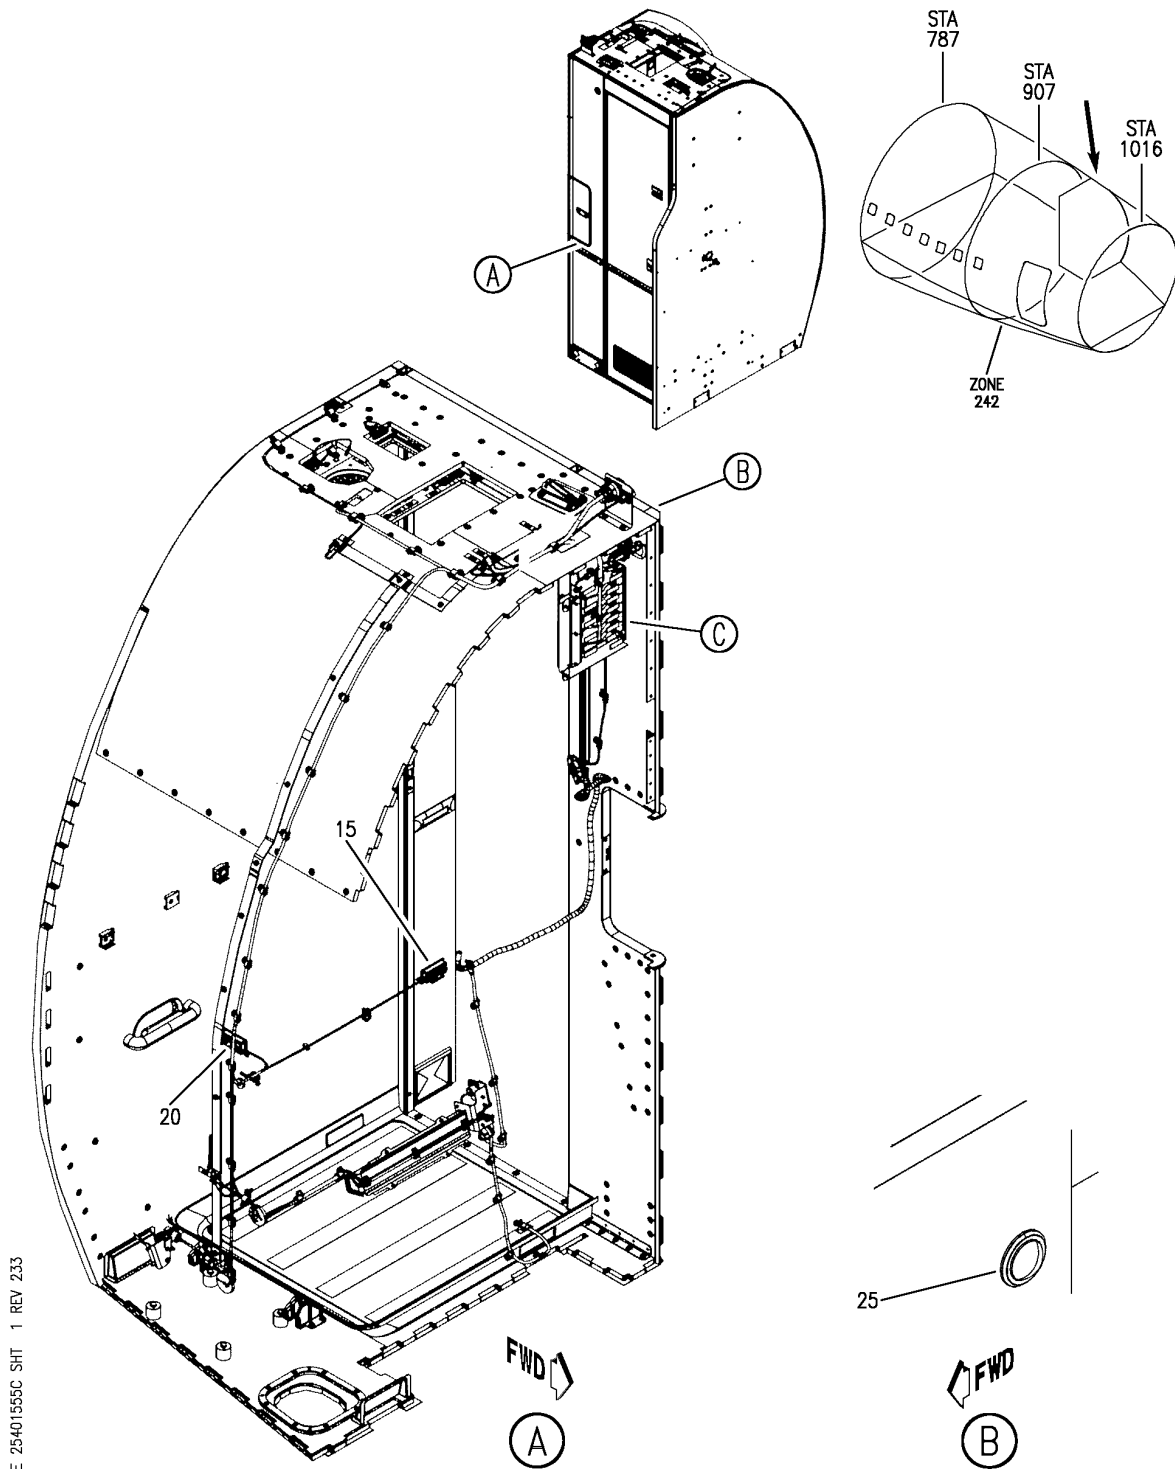

E 25401555C SHT 1 REV 233

ELECTRICAL INSTL-STRUCT, LAV (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 55C (SHEET 1)


**25-40-15-55C**

R/YR  
OCT 15/16

25-40-15-55C  
PAGE 0

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

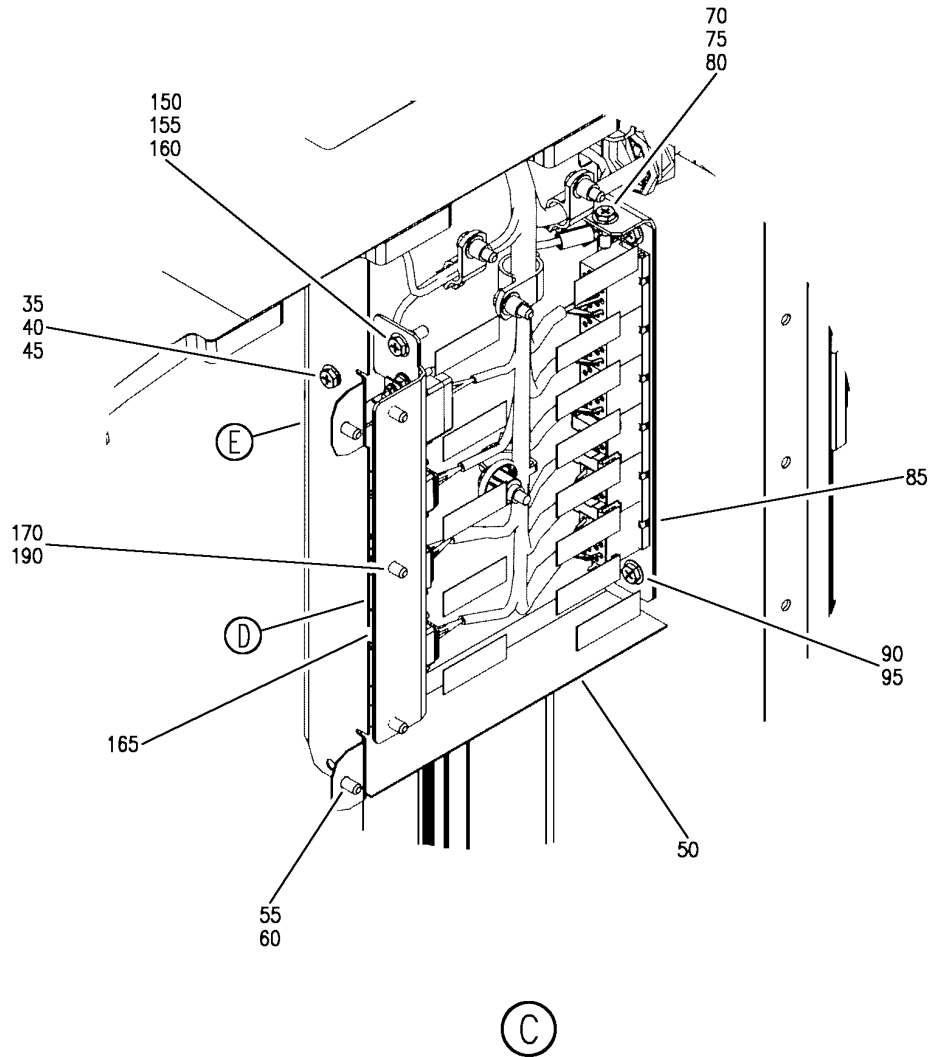

E 25401555C SHT 2 REV 233

ELECTRICAL INSTL-STRUCT, LAV (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 55C (SHEET 2)



**25-40-15-55C**

R/YR  
OCT 15/16

25-40-15-55C  
PAGE 0A

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

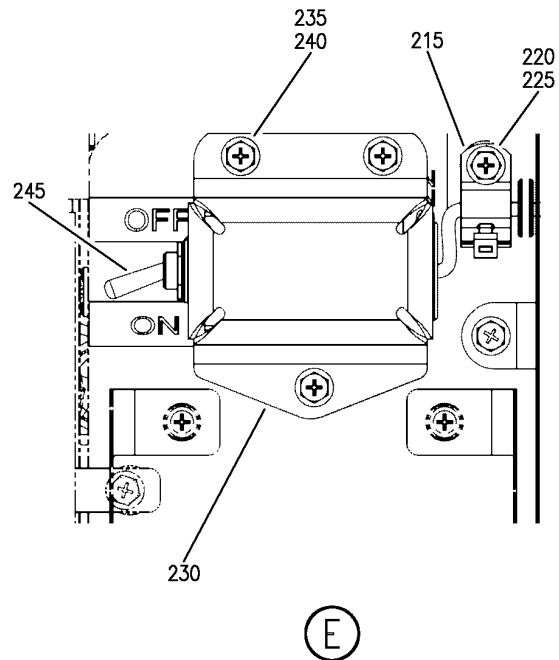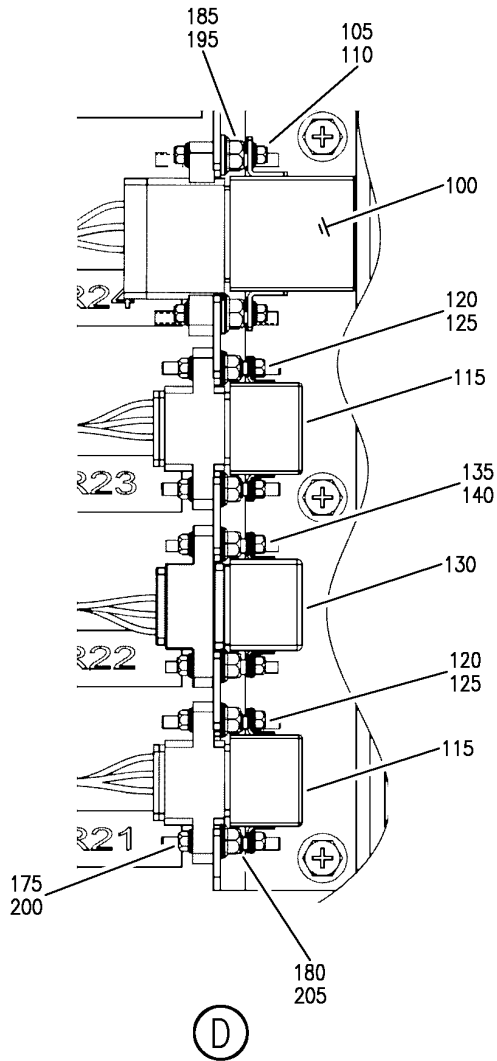

E 25401555C SHT 3 REV 233

ELECTRICAL INSTL-STRUCT, LAV (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 55C (SHEET 3)

**25-40-15-55C**

R/YR  
OCT 15/16

25-40-15-55C  
PAGE 0B

ECCN 9E991 BOEING PROPRIETARY - See title page for details.


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER   | 1 2 3 4 5 6 7 | NOMENCLATURE                                                                                                                                                   | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|---------------|---------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 55C                                                     |               |               | ELECTRICAL INSTL-STRUCT,<br>LAV (EQUIPMENT/FURNISHINGS<br>ONLY)                                                                                                | 417459            |                      |
| - 1                                                     | 3L306050-111  |               | ELECTRICAL INSTL-STRUCT,<br>LAV E<br>(EQUIPMENT/FURNISHINGS<br>ONLY)<br>SUPPLIER CODE:<br>V6S8D7<br>FOR NHA/OTHER SYS DET SEE:<br>25-40-15-09F<br>25-40-15-09U | 417459            | RF                   |
| - 5                                                     | MS3367-4-9    |               | .STRAP-<br>STANDARD SUBSTITUTION:<br>BACS38K4<br>SUPPLIER SPEC NUMBER:<br>2504695-4<br>V07187                                                                  | 417459            | AR                   |
| - 10                                                    | MS3367-5-9    |               | .STRAP<br>STANDARD SUBSTITUTION:<br>BACS38K5                                                                                                                   | 417459            | AR                   |
| 15                                                      | 0206081-101   |               | .SWITCH-ATTENDANT CALL<br>SUPPLIER CODE:<br>VOVDA9<br>CONFIG CHG DATA FROM A CMM:<br>SUPSD BY SC3L500007-1                                                     | 417459            | 1                    |
| 15                                                      | SC3L500007-1  |               | .SWITCH-ATTENDANT CALL<br>SUPPLIER CODE:<br>V6S8D7<br>CONFIG CHG DATA FROM A CMM:<br>SUPERSEDES 0206081-101                                                    | 417459            | 1                    |
| 15                                                      | SC3L500007-01 |               | .SWITCH-ATTENDANT CALL<br>SUPPLIER CODE:<br>V6S8D7                                                                                                             | 417459            | 1                    |
| 20                                                      | 0206453-101   |               | .SWITCH-FLUSH<br>SUPPLIER CODE:<br>VOVDA9<br>CONFIG CHG DATA FROM A CMM:<br>SUPSD BY SC3L500002-2                                                              | 417459            | 1                    |
| 20                                                      | SC3L500002-02 |               | .SWITCH-FLUSH<br>SUPPLIER CODE:<br>V6S8D7                                                                                                                      | 417459            | 1                    |
| 20                                                      | SC3L500002-2  |               | .SWITCH-FLUSH<br>SUPPLIER CODE:<br>V6S8D7<br>CONFIG CHG DATA FROM A CMM:<br>SUPERSEDES 0206453-101                                                             | 417459            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |               |               |                                                                                                                                                                |                   |                      |

- ITEM NOT ILLUSTRATED

RYR

25-40-15-55C

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-15  
 FIG. 55C  
 PAGE 1  
 AUG 15/23


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER   | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                                                               | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|---------------|----------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 55C                                                     |               |                                                                                                                                                          |                   |                      |
| 25                                                      | 0206082-101   | .SWITCH ASSY-ATTENDANT CALL<br>RESET<br>SUPPLIER CODE:<br>VOVDA9<br>CONFIG CHG DATA FROM A CMM:<br>SUPSD BY SC3L500001-1                                 | 417459            | 1                    |
| 25                                                      | SC3L500001-1  | .SWITCH ASSY-ATTENDANT CALL<br>RESET<br>SUPPLIER CODE:<br>V6S8D7<br>CONFIG CHG DATA FROM A CMM:<br>SUPERSEDES 0206082-101                                | 417459            | 1                    |
| 25                                                      | SC3L500001-01 | .SWITCH ASSY-ATTENDANT CALL<br>RESET<br>SUPPLIER CODE:<br>V6S8D7                                                                                         | 417459            | 1                    |
| - 30                                                    | 9L500001-003  | .STUD INSTL-GND<br>SUPPLIER CODE:<br>V6S8D7                                                                                                              | 417459            | 1                    |
| 35                                                      | NAS1801-3-10  | ..SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-10                                                                                                        | 417459            | 1                    |
| 40                                                      | NAS1149D0316H | ..WASHER                                                                                                                                                 | 417459            | 3                    |
| 45                                                      | MS21042L3     | ..NUT<br>STANDARD SUBSTITUTION:<br>BACN11AG3                                                                                                             | 417459            | 1                    |
| 50                                                      | 3L500401-22   | .SHROUD-<br>SUPPLIER CODE:<br>V6S8D7<br>CONFIG CHG DATA FROM A CMM:<br>SUPSD BY 3L560401-28<br>USED ON:<br>3L306050-111                                  | 417459            | 1                    |
| 50                                                      | 3L560401-28   | .SHROUD ASSY-<br>SUPPLIER CODE:<br>V6S8D7<br>CONFIG CHG DATA FROM A CMM:<br>SUPERSEDES 3L500401-22<br>SUPERSEDES 3L502001-20<br>USED ON:<br>3L306050-111 | 417459            | 1                    |
| 55                                                      | NAS1801-3-6   | ATTACHING PARTS<br>.SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                                                                                       | 417459            | 4                    |
| 60                                                      | NAS1149D0316K | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J<br>-----*-----                                                                                        | 417459            | 4                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |               |                                                                                                                                                          |                   |                      |

— ITEM NOT ILLUSTRATED

RYR

25-40-15-55C

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-15  
FIG. 55C  
PAGE 2  
APR 15/23


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER   | 1 2 3 4 5 6 7 NOMENCLATURE                                                                | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|---------------|-------------------------------------------------------------------------------------------|-------------------|----------------------|
| 55C                                                     |               |                                                                                           |                   |                      |
| - 65                                                    | 9L500001-003  | .STUD INSTL-GND<br>SUPPLIER CODE:<br>V6S8D7                                               | 417459            | 1                    |
| 70                                                      | NAS1801-3-10  | ..SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-10                                         | 417459            | 1                    |
| 75                                                      | NAS1149D0316H | ..WASHER                                                                                  | 417459            | 3                    |
| 80                                                      | MS21042L3     | ..NUT<br>STANDARD SUBSTITUTION:<br>BACN11AG3                                              | 417459            | 1                    |
| 85                                                      | 3L406500-001  | .BRACKET-TERM.<br>SUPPLIER CODE:<br>V6S8D7<br>USED ON:<br>3L306050-111<br>ATTACHING PARTS | 417459            | 1                    |
| 90                                                      | NAS1801-3-6   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                                           | 417459            | 2                    |
| 95                                                      | NAS1149D0316K | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J                                        | 417459            | 2                    |
| 100                                                     | M8353611-002L | -----*-----<br>.RELAY<br>ATTACHING PARTS                                                  | 417459            | 1                    |
| 105                                                     | NAS620-4L     | .WASHER                                                                                   | 417459            | 2                    |
| 110                                                     | MS21042L04    | .NUT<br>STANDARD SUBSTITUTION:<br>BACN11AG04                                              | 417459            | 2                    |
| 115                                                     | M835362-024L  | -----*-----<br>.RELAY<br>ATTACHING PARTS                                                  | 417459            | 2                    |
| 120                                                     | NAS620-4L     | .WASHER                                                                                   | 417459            | 4                    |
| 125                                                     | MS21042L04    | .NUT<br>STANDARD SUBSTITUTION:<br>BACN11AG04                                              | 417459            | 4                    |
| 130                                                     | M835366-022L  | -----*-----<br>.RELAY<br>ATTACHING PARTS                                                  | 417459            | 1                    |
| 135                                                     | NAS620-4L     | .WASHER                                                                                   | 417459            | 3                    |
| 140                                                     | MS21042L04    | .NUT<br>STANDARD SUBSTITUTION:<br>BACN11AG04                                              | 417459            | 3                    |
| - 145                                                   | 9L500001-003  | -----*-----<br>.STUD INSTL-GND<br>SUPPLIER CODE:<br>V6S8D7                                | 417459            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |               |                                                                                           |                   |                      |

- ITEM NOT ILLUSTRATED

R Y R

25-40-15-55C

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-15  
FIG. 55C  
PAGE 3  
APR 15/23


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER   | 1 2 3 4 5 6 7 NOMENCLATURE                                         | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|---------------|--------------------------------------------------------------------|-------------------|----------------------|
| 55C                                                     |               |                                                                    |                   |                      |
| 150                                                     | NAS1801-3-10  | ..SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-10                  | 417459            | 1                    |
| 155                                                     | NAS1149D0316H | ..WASHER                                                           | 417459            | 3                    |
| 160                                                     | MS21042L3     | ..NUT<br>STANDARD SUBSTITUTION:<br>BACN11AG3                       | 417459            | 1                    |
| 165                                                     | 3L500401-8    | .BRACKET-RELAY<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS      | 417459            | 1                    |
| 170                                                     | NAS1801-3-6   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                    | 417459            | 3                    |
| 175                                                     | NAS620-4L     | .WASHER                                                            | 417459            | 9                    |
| 180                                                     | NAS620-8L     | .WASHER                                                            | 417459            | 7                    |
| 185                                                     | NAS620-10L    | .WASHER                                                            | 417459            | 2                    |
| 190                                                     | NAS1149D0316K | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J                 | 417459            | 3                    |
| 195                                                     | MS21042L3     | .NUT<br>STANDARD SUBSTITUTION:<br>BACN11AG3                        | 417459            | 2                    |
| 200                                                     | MS21042L04    | .NUT<br>STANDARD SUBSTITUTION:<br>BACN11AG04                       | 417459            | 9                    |
| 205                                                     | MS21042L08    | .NUT<br>STANDARD SUBSTITUTION:<br>BACN11AG08<br>-----*-----        | 417459            | 7                    |
| - 210                                                   | 9L500001-101  | .CLAMP INSTL-<br>SUPPLIER CODE:<br>V6S8D7                          | 417459            | 1                    |
| 215                                                     | CA2030-1      | ..CLAMP-<br>SUPPLIER CODE:<br>V03296<br>ATTACHING PARTS            | 417459            | 1                    |
| 220                                                     | NAS1801-3-6   | ..SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                   | 417459            | 1                    |
| 225                                                     | NAS1149D0316K | ..WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J<br>-----*----- | 417459            | 1                    |
| 230                                                     | 3L500401-14   | .BRACKET-SVCE TG SWITCH<br>SUPPLIER CODE:<br>V6S8D7                | 417459            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |               |                                                                    |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R

25-40-15-55C

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-15  
FIG. 55C  
PAGE 4  
APR 15/23


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 NOMENCLATURE                                                         | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|------------------------------------------------------------------------------------|-------------------|----------------------|
| 55C                                                     |                | ATTACHING PARTS                                                                    |                   |                      |
| 235                                                     | NAS1801-3-6    | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                                    | 417459            | 3                    |
| 240                                                     | NAS1149D0316K  | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J<br>-----*-----                  | 417459            | 3                    |
| 245                                                     | MS27407-3      | .SWITCH-TG                                                                         | 417459            | 1                    |
| - 250                                                   | 3L306050-111-1 | .ELECTRICAL INSTL-<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-41-60-18L | 417459            | RF                   |
| - 255                                                   | 3L306050-111-2 | .ELECTRICAL INSTL-<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-41-21-18L | 417459            | RF                   |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |                                                                                    |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R


25-40-15-55C

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-15  
 FIG. 55C  
 PAGE 5  
 APR 15/23



**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

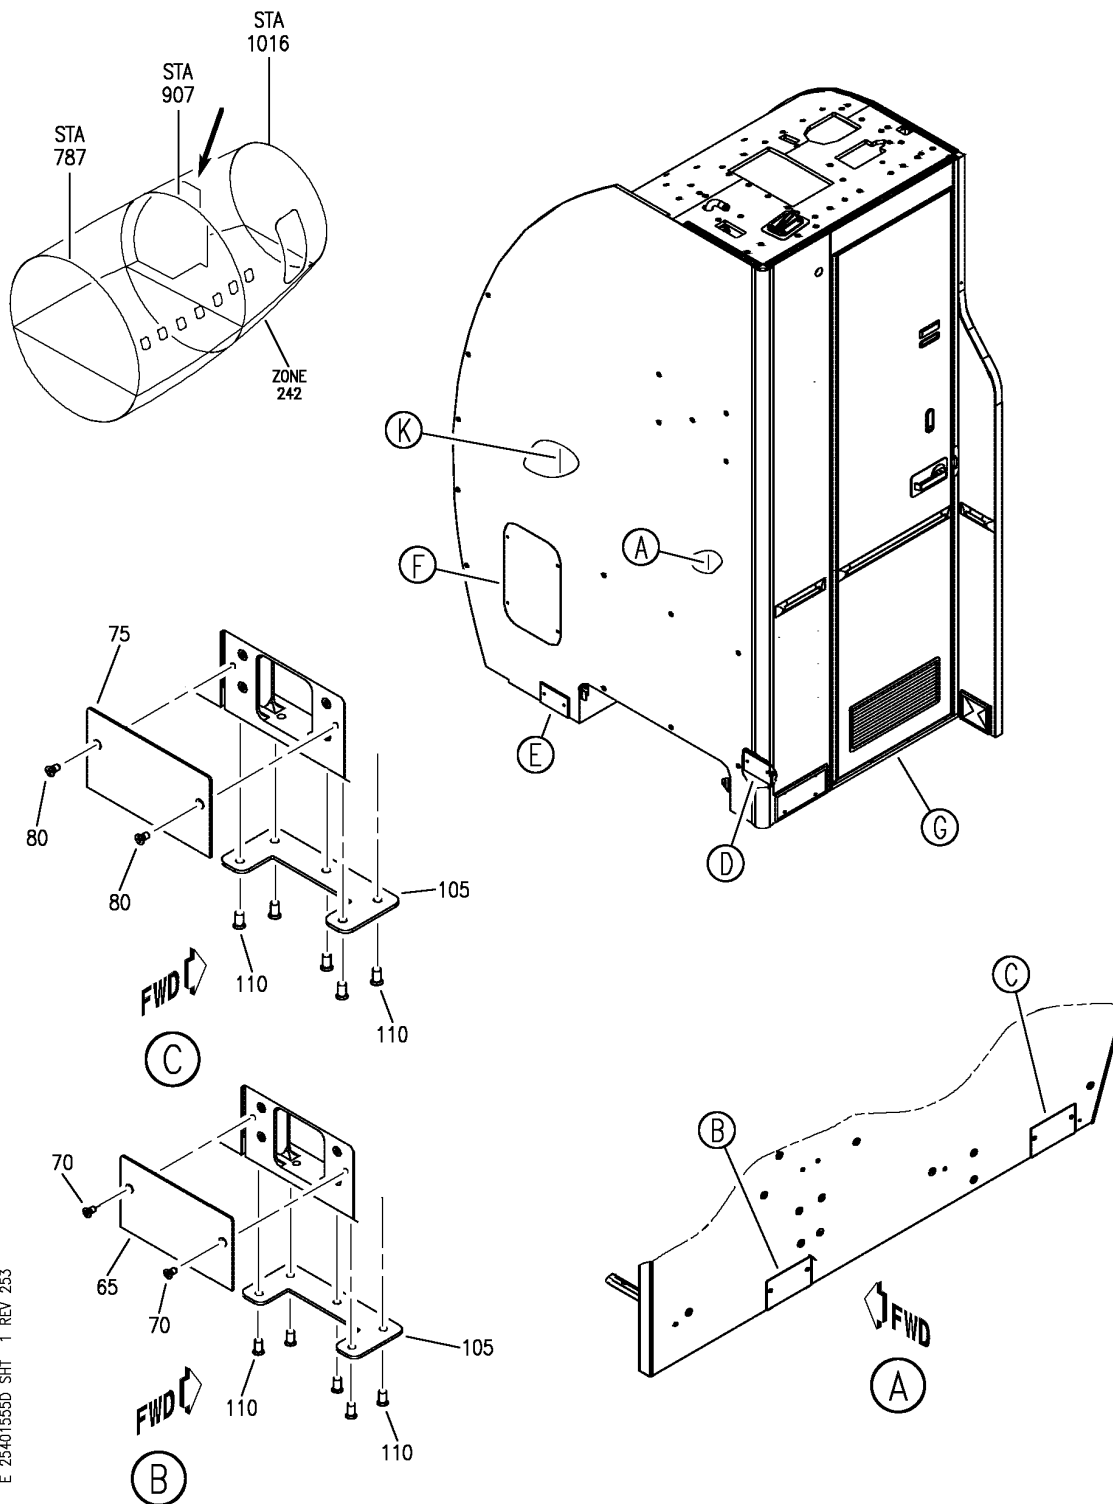

E 25401555D SHT 1 REV 253

STRUCTURE ASSY  
FIGURE 55D (SHEET 1)


**25-40-15-55D**

R/YR  
APR 15/25

25-40-15-55D  
PAGE 0

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

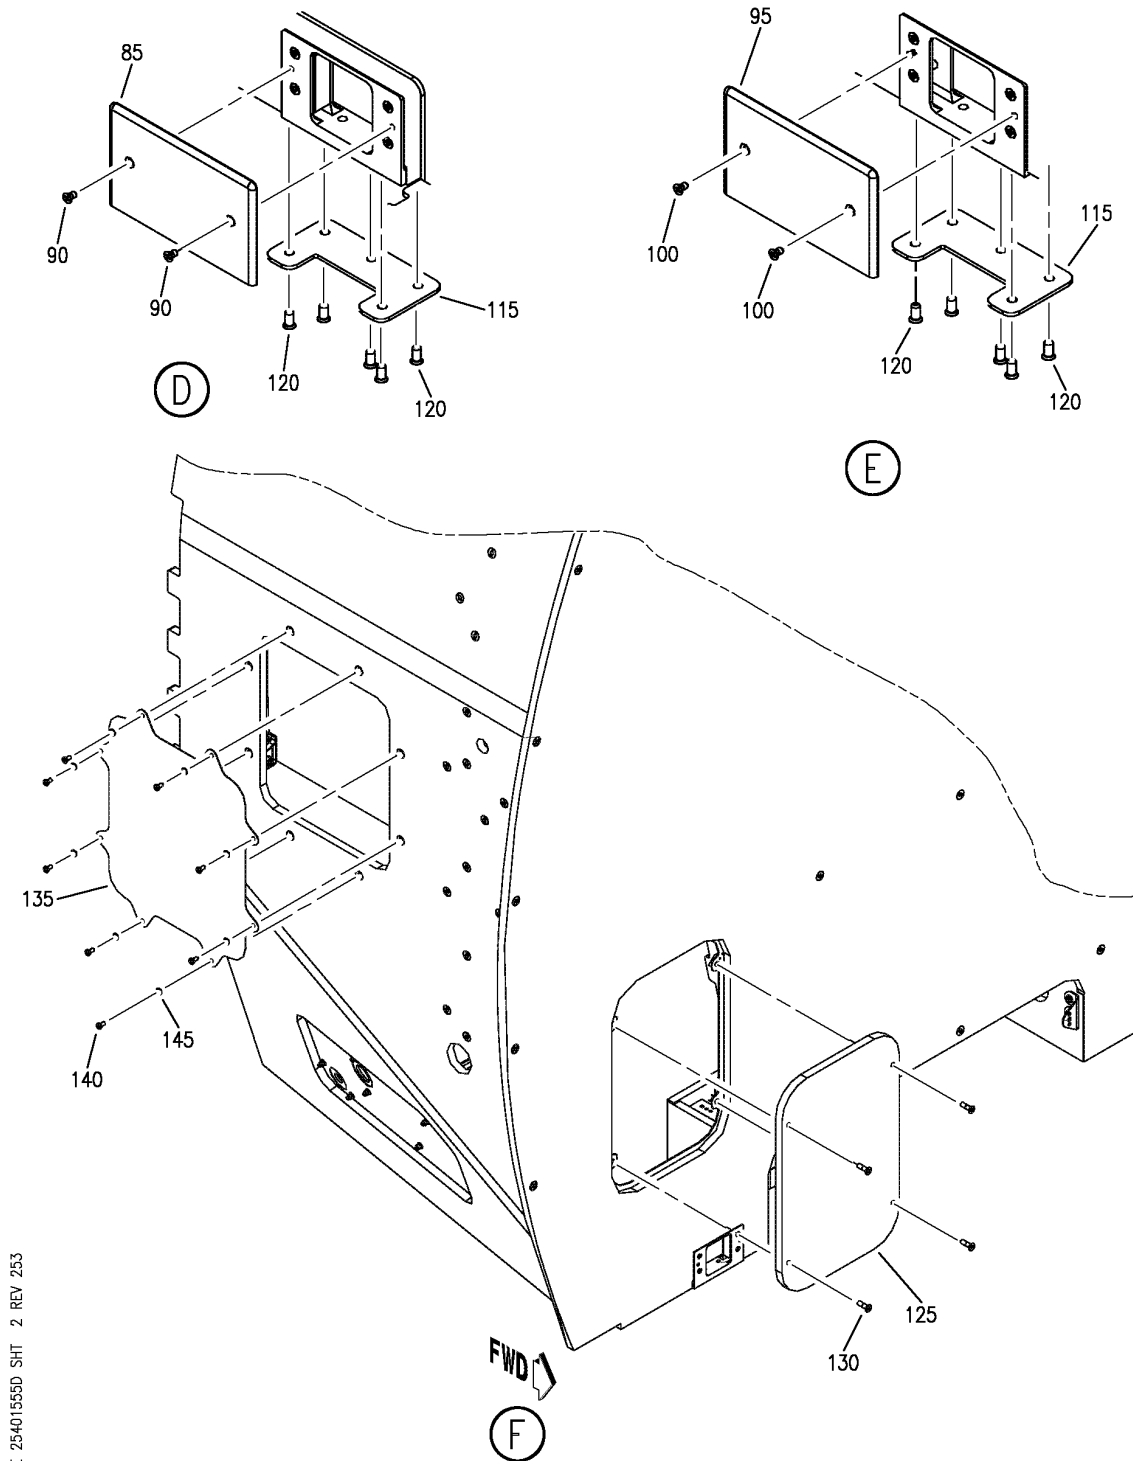

E 25401555D SHT 2 REV 253

STRUCTURE ASSY  
FIGURE 55D (SHEET 2)

**25-40-15-55D**

R/YR  
APR 15/25

25-40-15-55D  
PAGE 0A


ECCN 9E991 BOEING PROPRIETARY – See title page for details.



25-40-15-55D

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

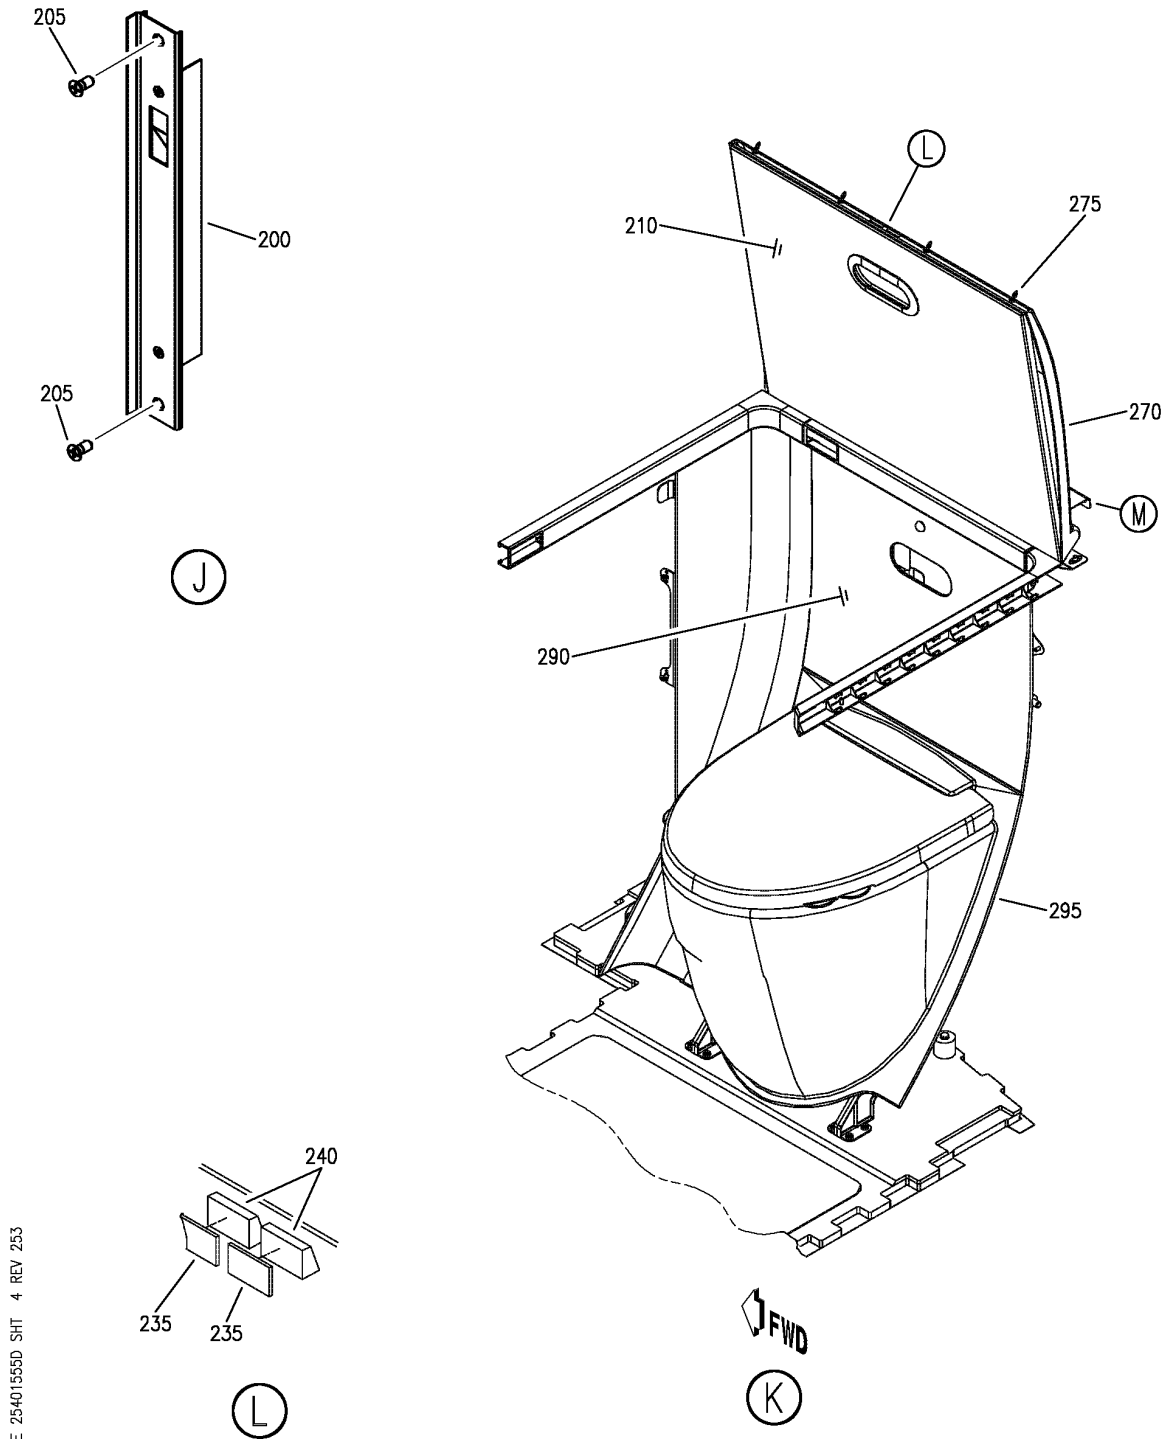

E 25401555D SHT 4 REV 253

STRUCTURE ASSY  
FIGURE 55D (SHEET 4)


**25-40-15-55D**

R Y R  
APR 15 / 25

25-40-15-55D  
PAGE 0C

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

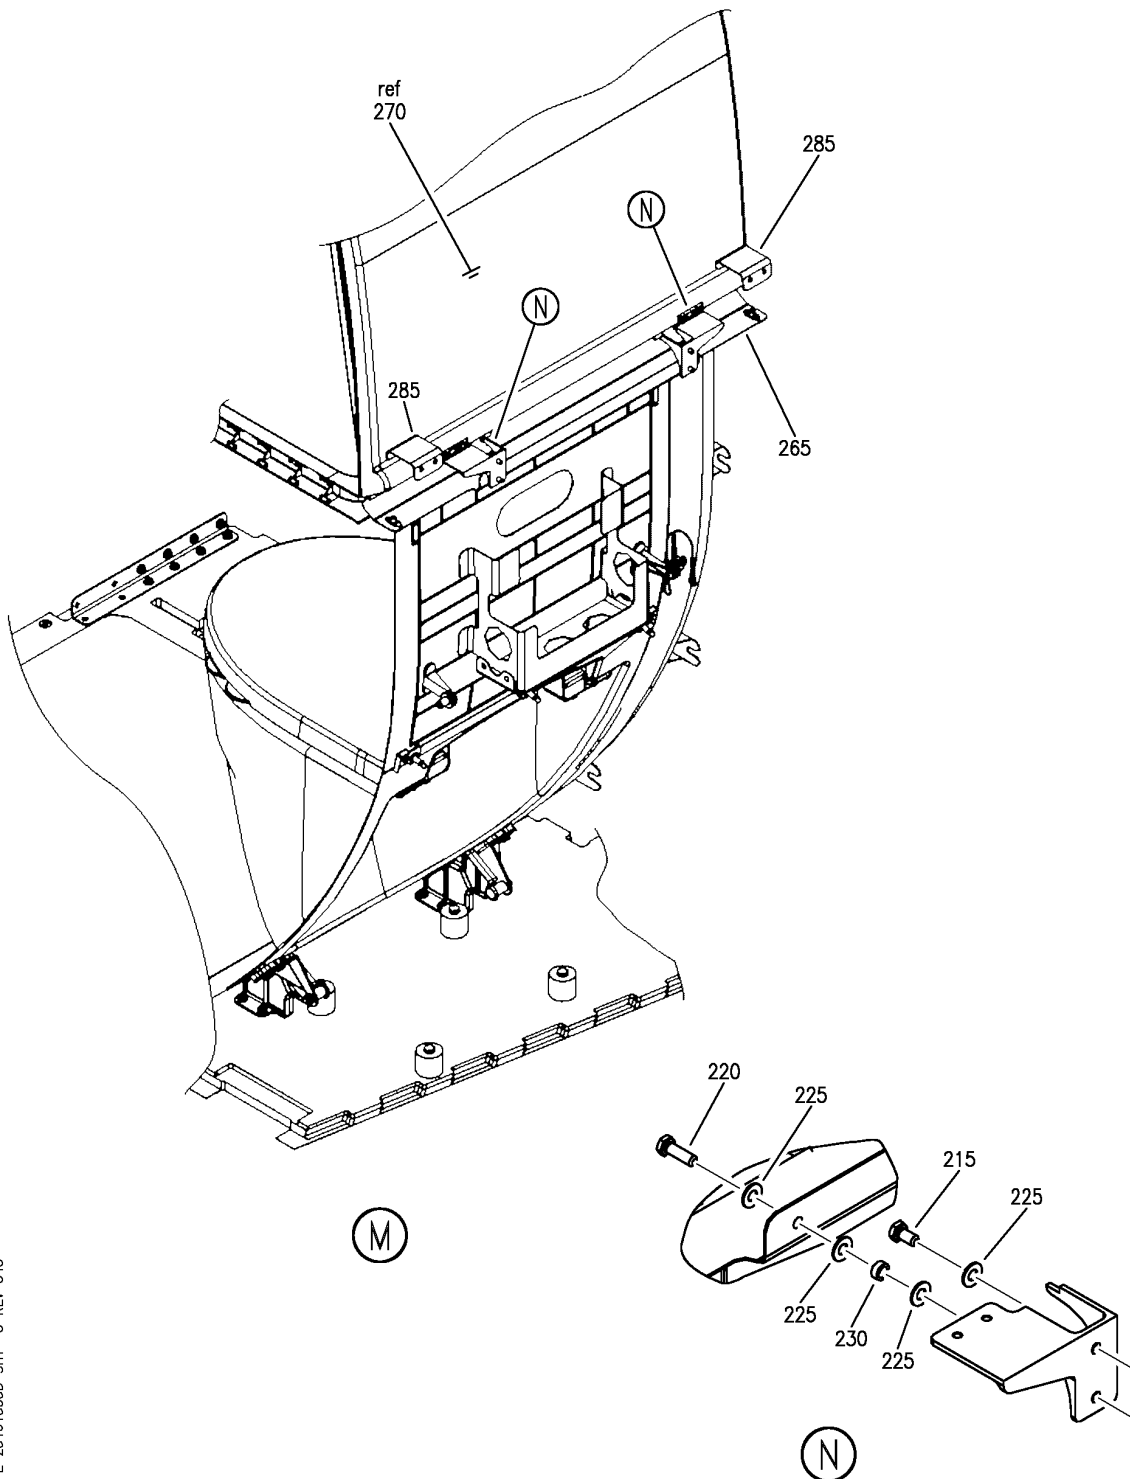

E 25401555D SHT 5 REV 345

STRUCTURE ASSY  
FIGURE 55D (SHEET 5)

**25-40-15-55D**

R Y R  
APR 15/25

25-40-15-55D  
PAGE 0D

ECCN 9E991 BOEING PROPRIETARY – See title page for details.


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER     | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                                                                                                                               | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|-----------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 55D                                                     |                 |                                                                                                                                                                                                                          |                   |                      |
| - 1                                                     | 1L306051-155EW  | STRUCTURE ASSY<br>STRUCTURE ASSY-LAV E<br>SUPPLIER CODE:<br>V6S8D7<br>FOR NHA SEE:<br>25-40-15-13D                                                                                                                       | 460508<br>460475  | RF                   |
| - 2                                                     | 1L306051-221EW  | STRUCTURE INSTL-LAV E<br>SUPPLIER CODE:<br>V6S8D7<br>FOR NHA SEE:<br>25-40-15-13S                                                                                                                                        | 476481            | RF                   |
| - 2                                                     | 1L306051-221HF  | STRUCTURE ASSY-LAV E<br>SUPPLIER CODE:<br>V6S8D7<br>FOR NHA SEE:<br>25-40-15-13T                                                                                                                                         | 482508            | RF                   |
| - 50                                                    | 1L306051-155EW1 | .STRUCTURE ASSY-<br>SUPPLIER CODE:<br>V6S8D7<br>FUNCTIONAL REFERENCE:<br>EQUIPMENT/FURNISHINGS<br>FOR DETAILS SEE<br>25-40-15-55E<br>LIGHTS<br>FOR DETAILS SEE<br>33-26-03-42J                                           | 460475            | RF                   |
| - 50                                                    | 1L306051-221EW1 | .STRUCTURE INSTL-<br>SUPPLIER CODE:<br>V6S8D7<br>FUNCTIONAL REFERENCE:<br>EQUIPMENT/FURNISHINGS<br>FOR DETAILS SEE<br>25-40-15-55E<br>LIGHTS<br>FOR DETAILS SEE<br>33-26-03-42J                                          | 476481            | RF                   |
| - 52                                                    | 1L306051-221HF1 | .STRUCTURE INSTL-<br>SUPPLIER CODE:<br>V6S8D7<br>MISCELLANEOUS DATA:<br>NON PROCURABLE<br>FUNCTIONAL REFERENCE:<br>EQUIPMENT/FURNISHINGS<br>FOR DETAILS SEE<br>25-40-15-55E<br>LIGHTS<br>FOR DETAILS SEE<br>33-26-03-42J | 482508            | RF                   |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                 |                                                                                                                                                                                                                          |                   |                      |

- ITEM NOT ILLUSTRATED

RYR

25-40-15-55D

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-15  
 FIG. 55D  
 PAGE 1  
 APR 15/25


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER     | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                                                                                                                                    | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|-----------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 55D<br>- 55                                             | 1L306051-155EW2 | .STRUCTURE INSTL-<br>SUPPLIER CODE:<br>V6S8D7<br>FUNCTIONAL REFERENCE:<br>EQUIPMENT/FURNISHINGS<br>FOR DETAILS SEE<br>25-40-15-55F<br>WATER/WASTE<br>FOR DETAILS SEE<br>38-11-51-26J                                          | 460475            | RF                   |
| - 55                                                    | 1L306051-221EW2 | .STRUCTURE INSTL-<br>SUPPLIER CODE:<br>V6S8D7<br>FUNCTIONAL REFERENCE:<br>EQUIPMENT/FURNISHINGS<br>FOR DETAILS SEE<br>25-40-15-55F<br>WATER/WASTE<br>FOR DETAILS SEE<br>38-11-51-26J                                          | 476481            | RF                   |
| - 57                                                    | 1L306051-221HF2 | .STRUCTURE INSTL-<br>SUPPLIER CODE:<br>V6S8D7<br>MISCELLANEOUS DATA:<br>NON PROCURABLE<br>FUNCTIONAL REFERENCE:<br>EQUIPMENT/FURNISHINGS<br>FOR DETAILS SEE<br>25-40-15-55F<br>WATER/WASTE<br>FOR DETAILS SEE<br>38-11-51-26J | 482508            | RF                   |
| - 60                                                    | 1L306051-155EW3 | .STRUCTURE ASSY-<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-40-15-55G                                                                                                                                              | 460475            | RF                   |
| - 60                                                    | 1L306051-221EW3 | .STRUCTURE INSTL-<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-40-15-55G                                                                                                                                             | 476481            | RF                   |
| - 62                                                    | 1L306051-221HF3 | .STRUCTURE INSTL-<br>SUPPLIER CODE:<br>V6S8D7<br>MISCELLANEOUS DATA:<br>NON PROCURABLE<br>FOR DETAILS SEE:<br>25-40-15-55G                                                                                                    | 482508            | RF                   |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                 |                                                                                                                                                                                                                               |                   |                      |

- ITEM NOT ILLUSTRATED

RYR

25-40-15-55D

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-15  
 FIG. 55D  
 PAGE 2  
 JUN 15/18


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 NOMENCLATURE                                                    | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|-------------------------------------------------------------------------------|-------------------|----------------------|
| 55D                                                     |                |                                                                               |                   |                      |
| 65                                                      | 1L500409-841CH | .PLATE-COVER<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                   | 460508            | 1                    |
| 70                                                      | NAS514P632-5   | .SCREW<br>-----*-----                                                         | 460508            | 2                    |
| 75                                                      | 1L500409-841CH | .PLATE-COVER<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                   | 460508            | 1                    |
| 80                                                      | NAS514P632-5   | .SCREW<br>-----*-----                                                         | 460508            | 2                    |
| 85                                                      | 1L500409-263   | .PLATE-COVER<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                   | 460508            | 1                    |
| 90                                                      | NAS514P632-5   | .SCREW<br>-----*-----                                                         | 460508            | 2                    |
| 95                                                      | 1L500409-313   | .PLATE-COVER<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                   | 460508            | 1                    |
| 100                                                     | NAS514P632-5   | .SCREW<br>-----*-----                                                         | 460508            | 2                    |
| 105                                                     | 1L500409-253   | .PLATE-SHEAR<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                   | 460508            | 2                    |
| 110                                                     | BACB30VF3K1    | .BOLT<br>-----*-----                                                          | 460508            | 10                   |
| 115                                                     | 1L500409-257   | .PLATE-SHEAR<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                   | 460508            | 2                    |
| 120                                                     | BACB30VF3K1    | .BOLT<br>-----*-----                                                          | 460508            | 10                   |
| 125                                                     | 1L500409-155   | .PANEL-<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                        | 460508            | 1                    |
| 130                                                     | NAS517-3-5     | .SCREW<br>STANDARD SUBSTITUTION:<br>BACB30LU3-5<br>BACB30LH3-5<br>-----*----- | 460508            | 4                    |
| 135                                                     | 1L500407-211   | .PAN-COVER<br>SUPPLIER CODE:<br>V6S8D7                                        | 460508            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |                                                                               |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R

25-40-15-55D

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-15  
 FIG. 55D  
 PAGE 3  
 APR 15/23




**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER   | 1 2 3 4 5 6 7 NOMENCLATURE                                                                              | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|---------------|---------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 55D                                                     |               |                                                                                                         |                   |                      |
| 140                                                     | NAS1801-3-6   | ATTACHING PARTS<br>.SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                                      | 460508            | 8                    |
| 145                                                     | NAS1149D0332J | .WASHER<br>-----*-----                                                                                  | 460508            | 8                    |
| 150                                                     | 1L400105-34EW | .DOOR ASSY-<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-41-17-14J                             | 460481            | 1                    |
| 150                                                     | 1L400105-34HF | .DOOR ASSY-<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-41-17-14J                             | 482508            | 1                    |
| 155                                                     | NAS8603-4     | ATTACHING PARTS<br>.BOLT<br>-----*-----                                                                 | 460508            | 13                   |
| 160                                                     | 1L500109-302  | .TRIM-EDGE<br>SUPPLIER CODE:<br>V6S8D7                                                                  | 460508            | 1                    |
| 165                                                     | 1L500109-462  | .TRIM ASSY-DOOR<br>SUPPLIER CODE:<br>V6S8D7                                                             | 460508            | 1                    |
| 170                                                     | NAS8703A4     | ATTACHING PARTS<br>.BOLT<br>STANDARD SUBSTITUTION:<br>BACB30ZE3K4<br>-----*-----                        | 460508            | 3                    |
| 175                                                     | 1L500105-170  | ..BLOCK-CLOSE OUT<br>SUPPLIER CODE:<br>V6S8D7                                                           | 460508            | 1                    |
| 180                                                     | NAS514P440-5  | ATTACHING PARTS<br>..SCREW                                                                              | 460508            | 1                    |
| 185                                                     | MS21042-04    | ..NUT<br>STANDARD SUBSTITUTION:<br>MS21042L04<br>BACN11AG04<br>-----*-----                              | 460508            | 1                    |
| 190                                                     | 1L500109-460  | ..TRIM-DOOR OPENING<br>SUPPLIER CODE:<br>V6S8D7<br>CONFIG CHG DATA FROM A CMM:<br>SUPSD BY 1L500109-628 | 460508            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |               |                                                                                                         |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R

25-40-15-55D

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-15  
FIG. 55D  
PAGE 4  
APR 15/23

 **BOEING**  
737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER   | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                                                                            | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|---------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 55D<br>190                                              | 1L500109-628  | ..TRIM-DOOR OPENING<br>SUPPLIER CODE:<br>V6S8D7<br>CONFIG CHG DATA FROM A CMM:<br>SUPERSEDES 1L500109-460                                                             | 460508            | 1                    |
| 195                                                     | 1L500409-267  | .SPACER-BLK<br>SUPPLIER CODE:<br>V6S8D7                                                                                                                               | 460508            | 3                    |
| 200                                                     | 1L400109-94   | .SWITCH ASSY-<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>33-26-03-42M<br>ATTACHING PARTS                                                                      | 460508            | 1                    |
| 205                                                     | NAS8703A1     | .BOLT<br>STANDARD SUBSTITUTION:<br>BACB30ZE3K1<br>-----*-----                                                                                                         | 460508            | 2                    |
| 210                                                     | 1L460070-253  | .STATION ASSY-BABY CHANGING<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-41-52-02L<br>ATTACHING PARTS                                                        | 460508            | 1                    |
| 215                                                     | NAS1801-3-6   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                                                                                                                       | 460508            | 2                    |
| 220                                                     | NAS1801-3-10  | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-10                                                                                                                      | 460508            | 2                    |
| 225                                                     | NAS1149C0332R | .WASHER                                                                                                                                                               | 460508            | 8                    |
| 230                                                     | NAS43DD3-8N   | .SPACER<br>STANDARD SUBSTITUTION:<br>NAS43DD3-8FC<br>-----*-----                                                                                                      | 460508            | 2                    |
| 235                                                     | 65PWF02       | .MAGNET-RECTANGULAR<br>SUPPLIER CODE:<br>V1B3S4<br>MISCELLANEOUS DATA:<br>ORDER LCCS7-2A                                                                              | 460508            | 2                    |
| 235                                                     | LCCS7-2A      | .MAGNET-RECTANGULAR<br>SUPPLIER CODE:<br>V6S8D7<br>TRUE PART NUMBER:<br>LCCS-7-2-A<br>MISCELLANEOUS DATA:<br>ADAMS MAGNETIC PRODUCTS<br>CO. PART NUMBER<br>65PWF02-45 | 460508            | 2                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |               |                                                                                                                                                                       |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R

25-40-15-55D

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-15  
FIG. 55D  
PAGE 5  
APR 15/25


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER   | 1 2 3 4 5 6 7 | NOMENCLATURE                                                                                                                          | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|---------------|---------------|---------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 55D                                                     |               |               |                                                                                                                                       |                   |                      |
| 240                                                     | 1L500411-67   |               | .SPACER-MAGNET<br>SUPPLIER CODE:<br>V6S8D7                                                                                            | 460508            | 2                    |
| - 245                                                   | 9L500001-310  |               | .MOUNTING INSTL-TIE,<br>ELECTRICAL<br>SUPPLIER CODE:<br>V6S8D7                                                                        | 460508            | 1                    |
| - 250                                                   | MS3367-5-9    |               | ..STRAP<br>STANDARD SUBSTITUTION:<br>BACS38K5                                                                                         | 460508            | 1                    |
| - 255                                                   | TM3S10        |               | ..MOUNT-CABLE<br>SUPPLIER CODE:<br>V06383<br>ATTACHING PARTS                                                                          | 460508            | 1                    |
| - 260                                                   | NAS514P1032-8 |               | ..SCREW<br>-----*-----                                                                                                                | 460508            | 1                    |
| 265                                                     | 1L400100-103  |               | .SHIELD-TRAP<br>SUPPLIER CODE:<br>V6S8D7                                                                                              | 460508            | 1                    |
| 270                                                     | 1L400411-57   |               | .SHROUD-BCT<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                                                                            | 460508            | 1                    |
| 275                                                     | 09T203        |               | .SCREW-<br>SUPPLIER CODE:<br>V94222<br>TRUE PART NUMBER:<br>09-T-203<br>-----*-----                                                   | 460508            | 4                    |
| - 280                                                   | BAC1521-827   |               | .SEAL-<br>MISCELLANEOUS DATA:<br>ORDER LCSR000010                                                                                     | 460508            | 2                    |
| - 280                                                   | LCSR000010    |               | .SEAL-EXTRUDED SILICONE<br>RUBBER<br>SUPPLIER CODE:<br>V6S8D7<br>MISCELLANEOUS DATA:<br>THE BOEING COMPANY PART<br>NUMBER BAC1521-827 | 460508            | 2                    |
| 285                                                     | 1L500100-101  |               | .STABILIZER-BCT SHROUD<br>SUPPLIER CODE:<br>V6S8D7                                                                                    | 460508            | 2                    |
| 290                                                     | 1L400407-53   |               | .FACE ASSY-SEAT COVER<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-41-21-19Y                                                 | 460508            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |               |               |                                                                                                                                       |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R

25-40-15-55D

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-15  
FIG. 55D  
PAGE 6  
APR 15/25


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER | 1 2 3 4 5 6 7 | NOMENCLATURE                                                                                    | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|-------------|---------------|-------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 55D<br>295                                              | 1L400407-51 |               | .SHROUD ASSY-TOILET LID<br>SEAT<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-41-21-21P | 460508            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |             |               |                                                                                                 |                   |                      |

— ITEM NOT ILLUSTRATED


R Y R

25-40-15-55D

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

25-40-15  
 FIG. 55D  
 PAGE 7  
 APR 15/25

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

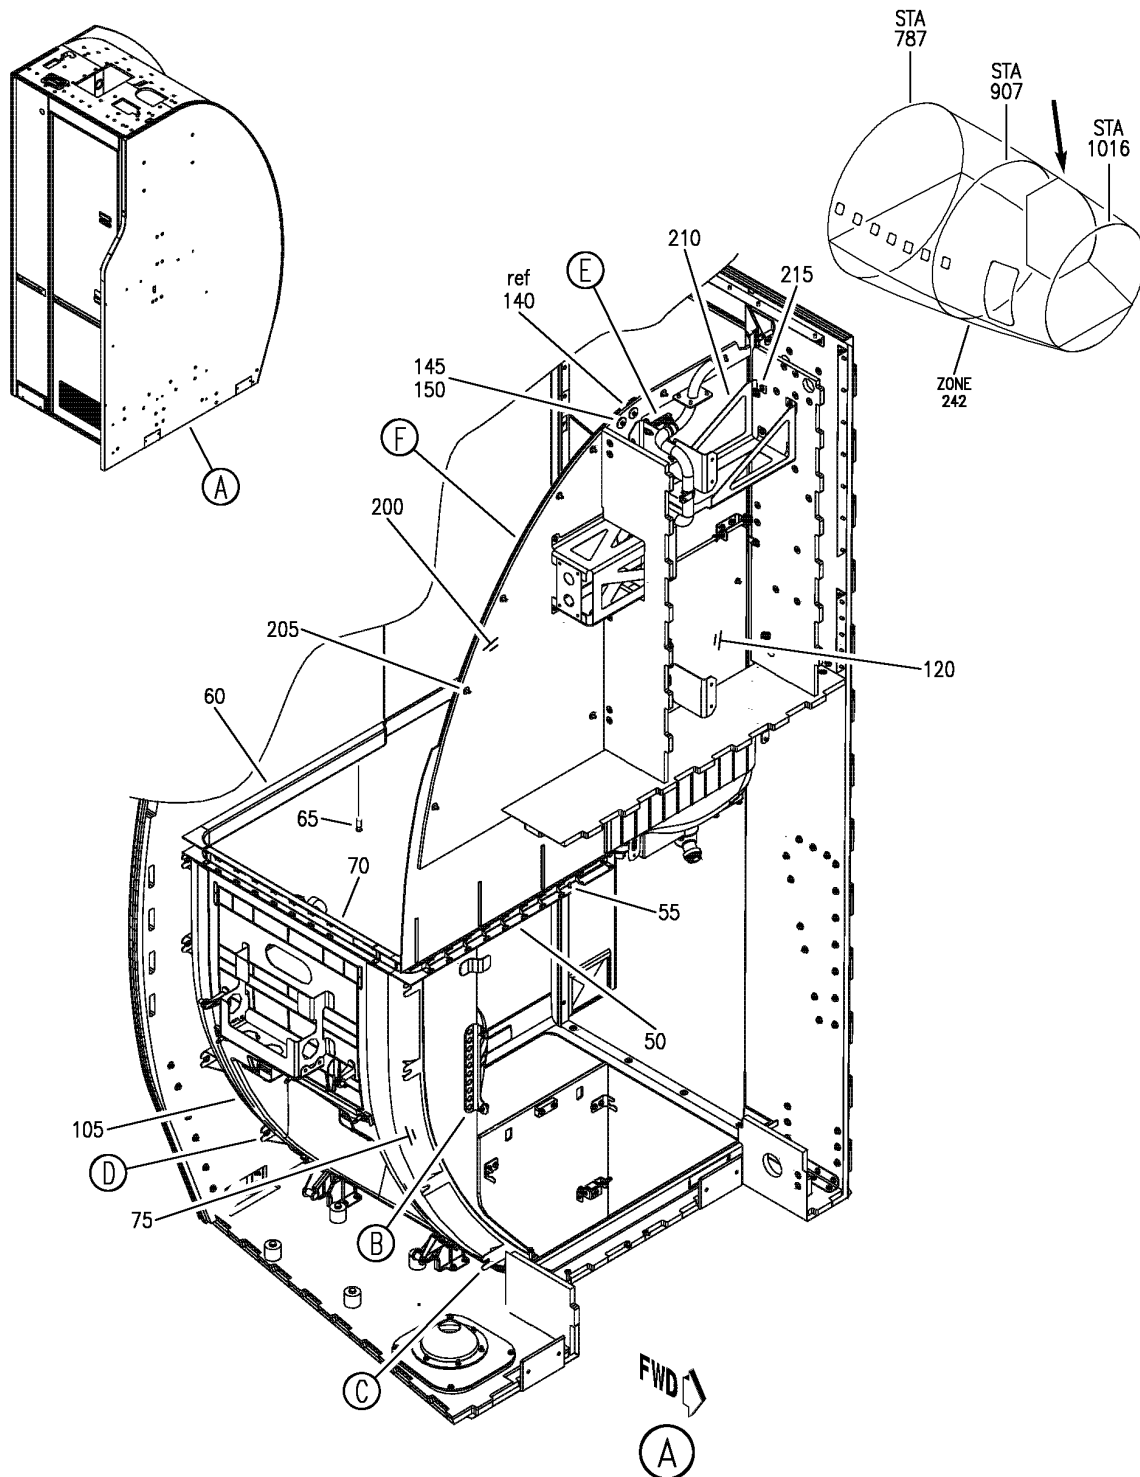

E 25401555E SHT 1 REV 247

STRUCTURE INSTL-LAV (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 55E (SHEET 1)


**25-40-15-55E**

R/YR  
APR 15/17

25-40-15-55E  
PAGE 0

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

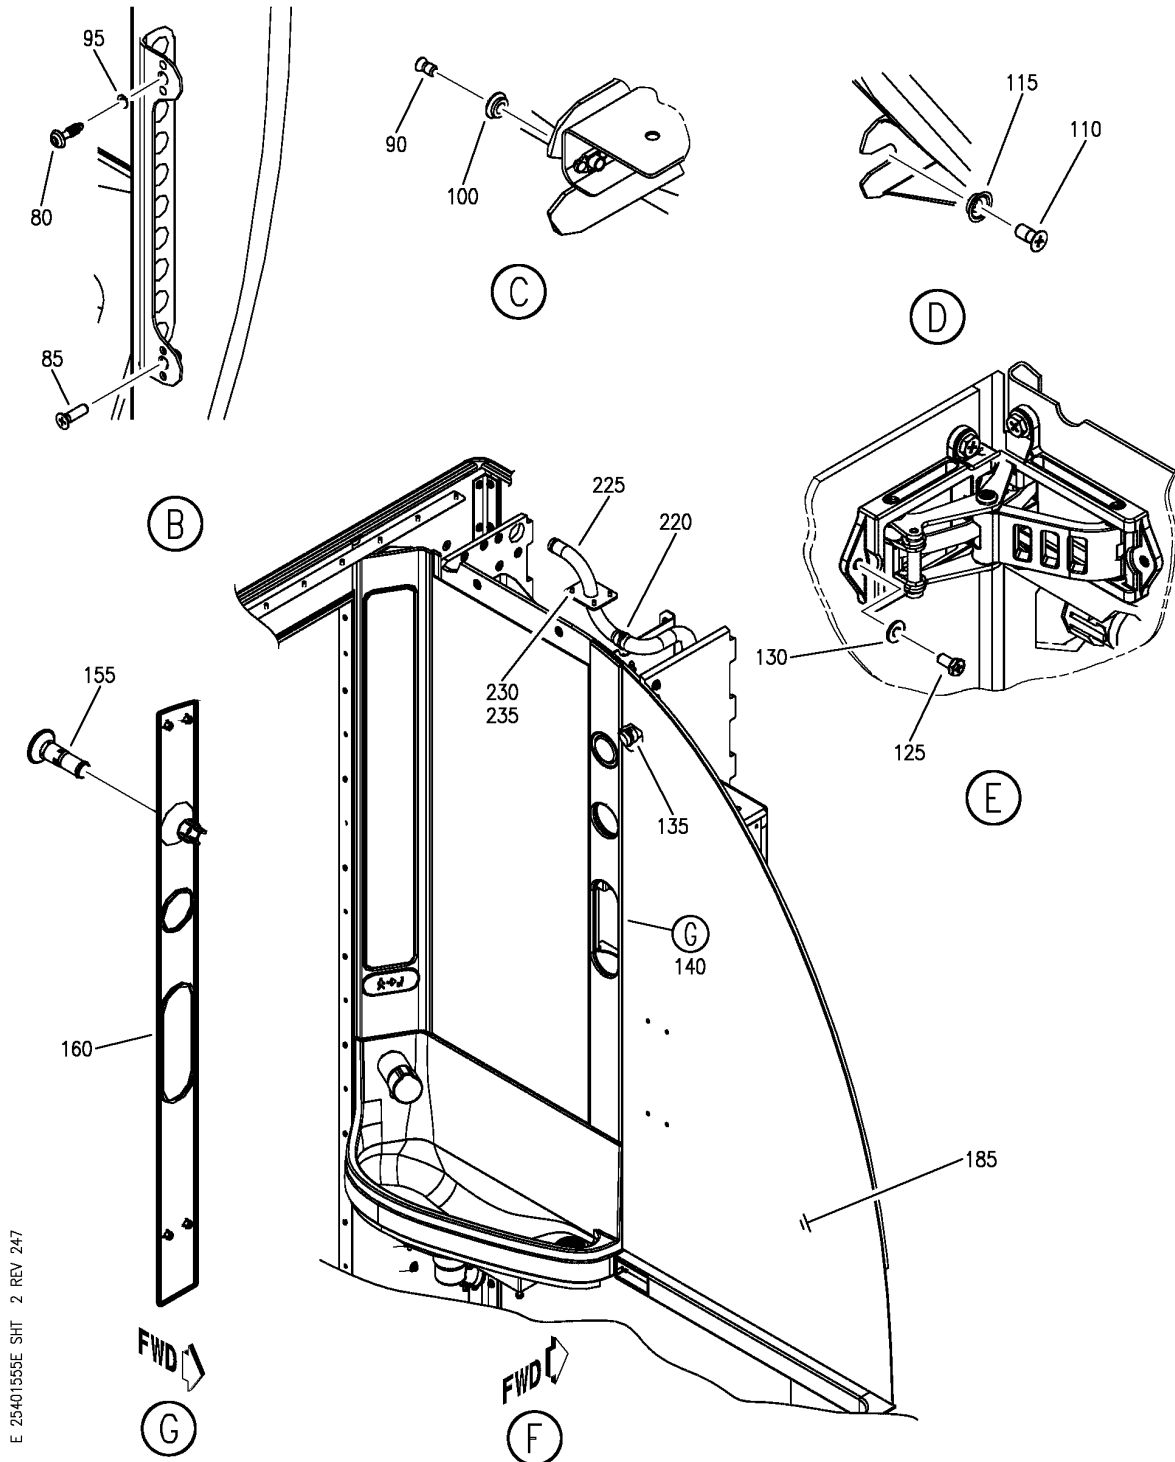

E 25401555E SHT 2 REV 247

STRUCTURE INSTL-LAV (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 55E (SHEET 2)

**25-40-15-55E**

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

R Y R  
A P R 15 / 17

25-40-15-55E  
PAGE 0A


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER     | 1 2 3 4 5 6 7 | NOMENCLATURE                                                                                                                        | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|-----------------|---------------|-------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 55 E                                                    |                 |               | STRUCTURE INSTL-LAV<br>(EQUIPMENT/FURNISHINGS<br>ONLY)                                                                              | 460508            |                      |
| - 1                                                     | 1L306051-155EW1 |               | STRUCTURE ASSY-LAV E<br>(EQUIPMENT/FURNISHINGS<br>ONLY)<br>SUPPLIER CODE:<br>V6S8D7<br>FOR NHA/OTHER SYS DET SEE:<br>25-40-15-55D   | 460475            | RF                   |
| - 2                                                     | 1L306051-221EW1 |               | STRUCTURE INSTL-LAV E<br>(EQUIPMENT/ FURNISHINGS<br>ONLY)<br>SUPPLIER CODE:<br>V6S8D7<br>FOR NHA/OTHER SYS DET SEE:<br>25-40-15-55D | 476481            | RF                   |
| - 2                                                     | 1L306051-221HF1 |               | STRUCTURE INSTL-LAV E<br>(EQUIPMENT/ FURNISHINGS<br>ONLY)<br>SUPPLIER CODE:<br>V6S8D7<br>FOR NHA/OTHER SYS DET SEE:<br>25-40-15-55D | 482508            | RF                   |
| 50                                                      | 1L500413-64     |               | .TRIM-S WALL<br>SUPPLIER CODE:<br>V6S8D7                                                                                            | 460508            | 1                    |
| 55                                                      | NAS514P832-8    |               | ATTACHING PARTS<br>.SCREW<br>-----*-----                                                                                            | 460508            | 1                    |
| 60                                                      | 1L500413-92     |               | .TRIM-AFT WALL<br>SUPPLIER CODE:<br>V6S8D7                                                                                          | 460508            | 1                    |
| 65                                                      | NAS514P832-8    |               | ATTACHING PARTS<br>.SCREW<br>-----*-----                                                                                            | 460508            | 1                    |
| 70                                                      | 1L500413-7      |               | .TRIM-OUTBD WALL<br>SUPPLIER CODE:<br>V6S8D7                                                                                        | 460508            | 1                    |
| 75                                                      | 1L400407-39     |               | .SHROUD-LH<br>SUPPLIER CODE:<br>V6S8D7<br>SB DATA FROM A CMM:<br>PRE SB 1L3-25-0057                                                 | 460475            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                 |               |                                                                                                                                     |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R

25-40-15-55E

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

25-40-15  
FIG. 55E  
PAGE 1  
DEC 15/18


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                                           | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|--------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 55E                                                     |                |                                                                                                                                      |                   |                      |
| 80                                                      | 09T305         | ATTACHING PARTS<br>.SCREW-<br>SUPPLIER CODE:<br>V94222<br>TRUE PART NUMBER:<br>09-T-305<br>SB DATA FROM A CMM:<br>PRE SB 1L3-25-0057 | 460475            | 1                    |
| 85                                                      | NAS514P1032-12 | .SCREW-<br>SB DATA FROM A CMM:<br>PRE SB 1L3-25-0057                                                                                 | 460475            | 1                    |
| 90                                                      | NAS514P1032-10 | .SCREW                                                                                                                               | 460475            | 1                    |
| 95                                                      | NAS1149D0332J  | .WASHER-<br>SB DATA FROM A CMM:<br>PRE SB 1L3-25-0057<br>-----*-----                                                                 | 460475            | 1                    |
| 100                                                     | 1L500407-203   | .FASTENER-SNAP<br>SUPPLIER CODE:<br>V6S8D7                                                                                           | 460475            | 1                    |
| 105                                                     | 1L500407-106   | .SHROUD-RH OUTBD TOILET<br>SUPPLIER CODE:<br>V6S8D7                                                                                  | 460508            | 1                    |
| 110                                                     | NAS514P1032-6  | ATTACHING PARTS                                                                                                                      | 460508            | 4                    |
| 115                                                     | 1L500407-203   | .SCREW<br>.FASTENER-SNAP<br>SUPPLIER CODE:<br>V6S8D7<br>-----*-----                                                                  | 460508            | 4                    |
| 120                                                     | 1L400503-99    | .MIRROR ASSY-HINGED<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-41-51-18Z                                                  | 460508            | 1                    |
| 125                                                     | NAS1801-3-5    | ATTACHING PARTS<br>.SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-5                                                                   | 460508            | 6                    |
| 130                                                     | NAS1149D0332J  | .WASHER<br>-----*-----                                                                                                               | 460508            | 6                    |
| 135                                                     | MS3367-5-9     | .STRAP<br>STANDARD SUBSTITUTION:<br>BACS38K5                                                                                         | 460508            | 1                    |
| 140                                                     | 1L400403-28    | .STRIP ASSY-AMENITIES<br>SUPPLIER CODE:<br>V6S8D7                                                                                    | 460508            | 1                    |
| 145                                                     | NAS1801-08-6   | ATTACHING PARTS<br>.SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN08-6                                                                  | 460508            | 4                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |                                                                                                                                      |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R

25-40-15-55E

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-15  
 FIG. 55E  
 PAGE 2  
 APR 15/23




**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER  | 1 2 3 4 5 6 7 NOMENCLATURE                                                                              | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|--------------|---------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 55E                                                     |              |                                                                                                         |                   |                      |
| 150                                                     | AN970-3      | . WASHER<br>-----*-----                                                                                 | 460508            | 4                    |
| 155                                                     | 1L400203-13  | .. GASPER-<br>SUPPLIER CODE:<br>V6S8D7                                                                  | 460508            | 1                    |
| 160                                                     | 1L500403-20  | .. STRIP-<br>SUPPLIER CODE:<br>V6S8D7                                                                   | 460508            | 1                    |
| - 165                                                   | 1L500045-43  | . BRACKET-CUP HOLDER<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                                     | 460475            | 2                    |
| - 170                                                   | NAS514P832-6 | . SCREW                                                                                                 | 460475            | 2                    |
| - 175                                                   | NAS1169-8L   | . WASHER<br>-----*-----                                                                                 | 460475            | 2                    |
| - 180                                                   | 1L400045-1   | . HOLDER-<br>SUPPLIER CODE:<br>V6S8D7                                                                   | 460475            | 1                    |
| 185                                                     | 1L400403-156 | . MIRROR ASSY-FXD<br>SUPPLIER CODE:<br>V6S8D7<br>CONFIG CHG DATA FROM A CMM:<br>SUPSD BY 1L400403-720   | 460475            | 1                    |
| 185                                                     | 1L400403-72  | . MIRROR ASSY-FXD<br>SUPPLIER CODE:<br>V6S8D7<br>CONFIG CHG DATA FROM A CMM:<br>SUPSD BY 1L400403-712   | 476508            | 1                    |
| 185                                                     | 1L400403-720 | . MIRROR ASSY-FXD<br>SUPPLIER CODE:<br>V6S8D7<br>CONFIG CHG DATA FROM A CMM:<br>SUPERSEDES 1L400403-156 | 460475            | 1                    |
| 185                                                     | 1L400403-712 | . MIRROR ASSY-FXD<br>SUPPLIER CODE:<br>V6S8D7<br>CONFIG CHG DATA FROM A CMM:<br>SUPERSEDES 1L400403-72  | 476508            | 1                    |
| - 195                                                   | 1L500403-352 | .. MIRROR-<br>SUPPLIER CODE:<br>V6S8D7                                                                  | 460475            | 1                    |
| - 195                                                   | 1L500403-342 | .. MIRROR-<br>SUPPLIER CODE:<br>V6S8D7                                                                  | 476508            | 1                    |
| - 196                                                   | 1L500045-67  | .. DOUBLER-<br>SUPPLIER CODE:<br>V6S8D7                                                                 | 460508            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |              |                                                                                                         |                   |                      |

- ITEM NOT ILLUSTRATED

R Y R

25-40-15-55E

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-15  
 FIG. 55E  
 PAGE 3  
 DEC 15/18


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                         | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|--------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 55E<br>200                                              | 1L460050-349   | .VANITY ASSY-UPR<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-41-51-33E<br>ATTACHING PARTS                | 460508            | 1                    |
| 205                                                     | NAS514P1032-10 | .SCREW<br>-----*-----                                                                                              | 460508            | 11                   |
| 210                                                     | 1L500403-157   | .BRACKET-HAND TOWEL<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                                                 | 460508            | 1                    |
| 215                                                     | NAS8303-4      | .SCREW<br>-----*-----                                                                                              | 460508            | 4                    |
| 220                                                     | MS3367-5-9     | .STRAP<br>STANDARD SUBSTITUTION:<br>BACS38K5                                                                       | 460508            | 2                    |
| 225                                                     | 1L400403-61    | .INTERFACE-GASPER<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                                                   | 460508            | 1                    |
| 230                                                     | NAS1801-3-6    | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                                                                    | 460508            | 4                    |
| 235                                                     | NAS1149D0332K  | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0332J<br>-----*-----                                                  | 460508            | 4                    |
| - 240                                                   | 1L400407-260   | .SHROUD-<br>SUPPLIER CODE:<br>V6S8D7                                                                               | 476508            | 1                    |
| - 240                                                   | 1L400407-260   | .SHROUD-<br>SUPPLIER CODE:<br>V6S8D7<br>SB DATA FROM A CMM:<br>POST SB 1L3-25-0057<br>ATTACHING PARTS              | 460475            | 1                    |
| - 245                                                   | 09T305         | .SCREW-<br>SUPPLIER CODE:<br>V94222<br>TRUE PART NUMBER:<br>09-T-305                                               | 476508            | 4                    |
| - 245                                                   | 09T407         | .SCREW-<br>SUPPLIER CODE:<br>V94222<br>TRUE PART NUMBER:<br>09-T-407<br>SB DATA FROM A CMM:<br>POST SB 1L3-25-0057 | 460475            | 4                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |                                                                                                                    |                   |                      |

- ITEM NOT ILLUSTRATED

R Y R

25-40-15-55E

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-15  
 FIG. 55E  
 PAGE 4  
 APR 15/23


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 | NOMENCLATURE                               | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|---------------|--------------------------------------------|-------------------|----------------------|
| 55E                                                     |                |               |                                            |                   |                      |
| - 250                                                   | NAS514P1032-10 | .             | SCREW                                      | 476508            | 1                    |
| - 255                                                   | NAS1149D0332J  | .             | WASHER                                     | 476508            | 4                    |
|                                                         |                | -----*        |                                            |                   |                      |
| - 260                                                   | 1L500407-203   | .             | FASTENER-                                  | 476508            | 1                    |
|                                                         |                |               | SUPPLIER CODE:<br>V6S8D7                   |                   |                      |
| - 265                                                   | NAS1149DN832J  | .             | WASHER-                                    | 460475            | 3                    |
|                                                         |                |               | SB DATA FROM A CMM:<br>POST SB 1L3-25-0057 |                   |                      |
| - 270                                                   | NAS1801-3-26   | .             | SCREW-                                     | 460508            | 1                    |
|                                                         |                |               | STANDARD SUBSTITUTION:<br>BACS12HN3-26     |                   |                      |
|                                                         |                |               | SB DATA FROM A CMM:<br>POST SB 1L3-25-0057 |                   |                      |
| - 275                                                   | MS21042-3      | .             | NUT-                                       | 460508            | 1                    |
|                                                         |                |               | STANDARD SUBSTITUTION:<br>MS21042L3        |                   |                      |
|                                                         |                |               | BACN11AG3                                  |                   |                      |
|                                                         |                |               | SB DATA FROM A CMM:<br>POST SB 1L3-25-0057 |                   |                      |
| - 280                                                   | NAS1149D0332J  | .             | WASHER-                                    | 460508            | 2                    |
|                                                         |                |               | SB DATA FROM A CMM:<br>POST SB 1L3-25-0057 |                   |                      |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |               |                                            |                   |                      |

— ITEM NOT ILLUSTRATED


R Y R

25-40-15-55E

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-15  
 FIG. 55E  
 PAGE 5  
 APR 15/23

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

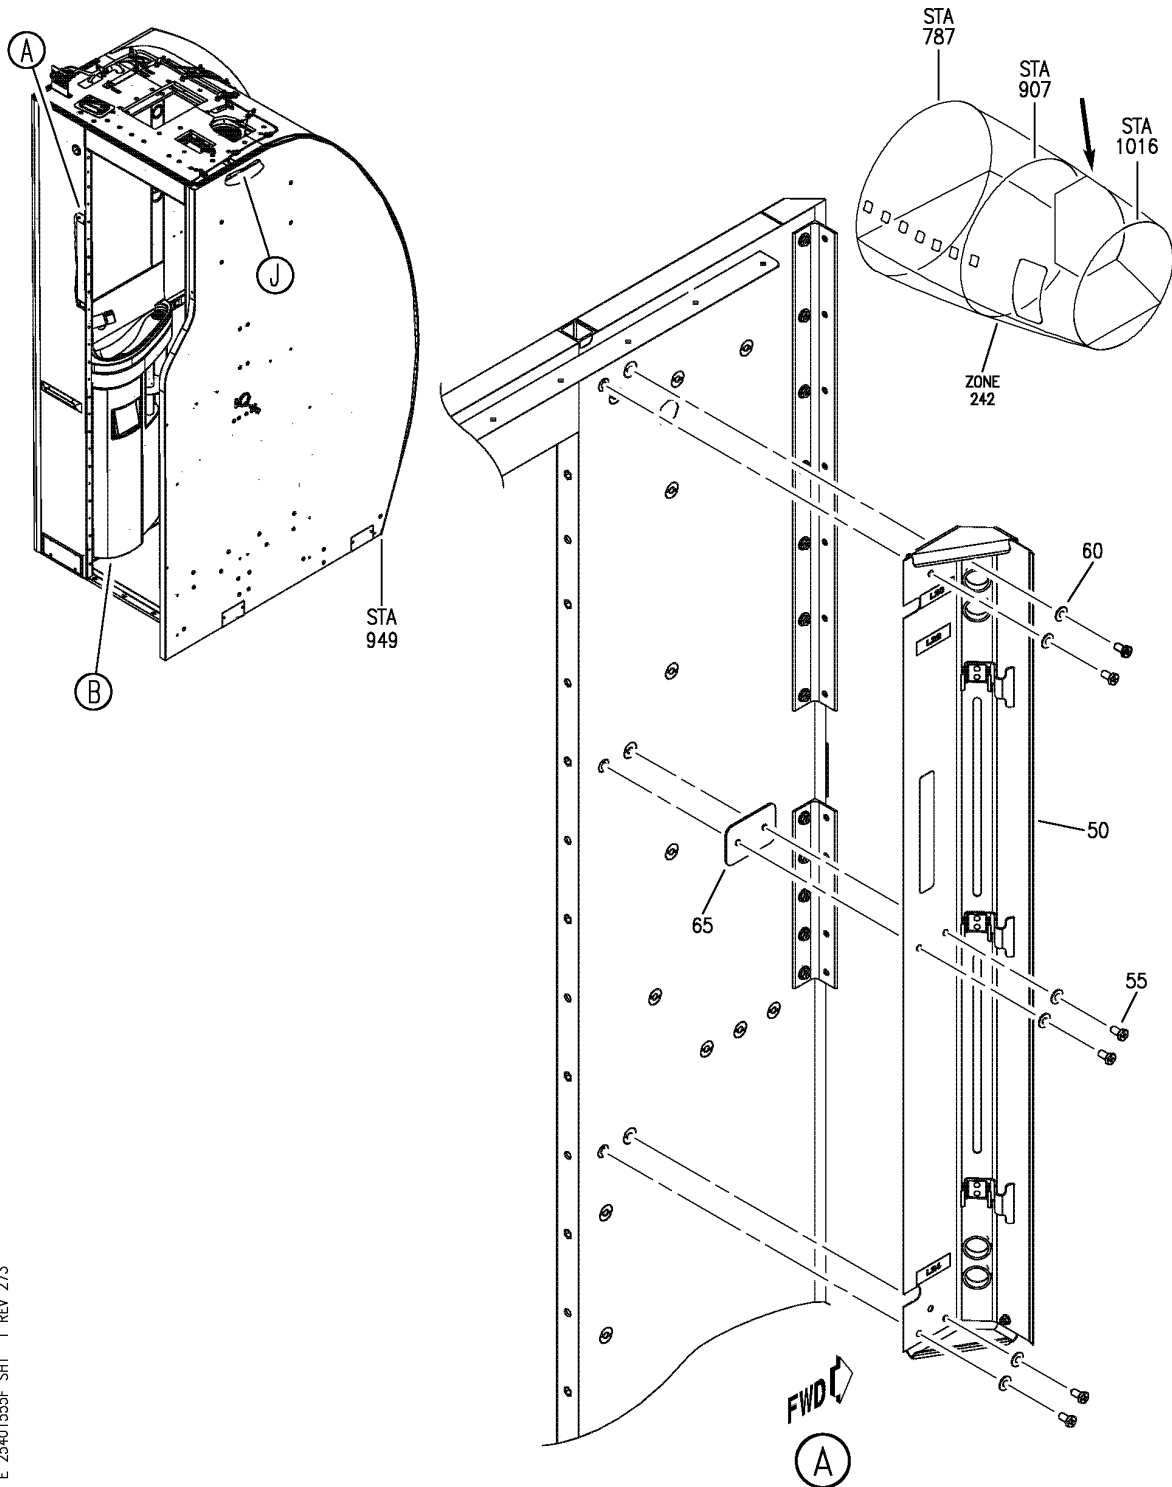

E 25401555F SHT 1 REV 273

STRUCTURE INSTL-LAV E  
FIGURE 55F (SHEET 1)


**25-40-15-55F**

R Y R  
AUG 15/21

25-40-15-55F  
PAGE 0

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

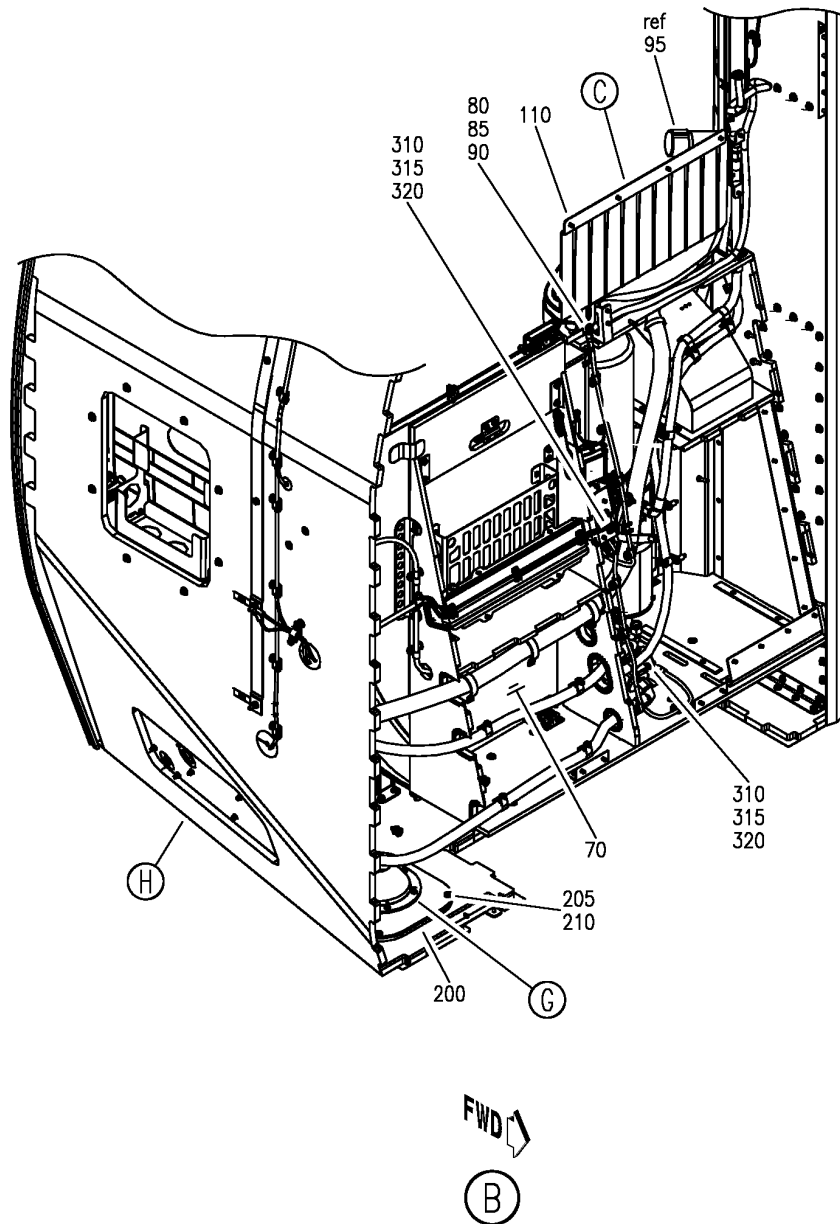

E 25401555F SHT 2 REV 273

STRUCTURE INSTL-LAV E  
FIGURE 55F (SHEET 2)


R Y R  
AUG 15/21

**25-40-15-55F**


ECCN 9E991 BOEING PROPRIETARY – See title page for details.

25-40-15-55F  
PAGE 0A

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

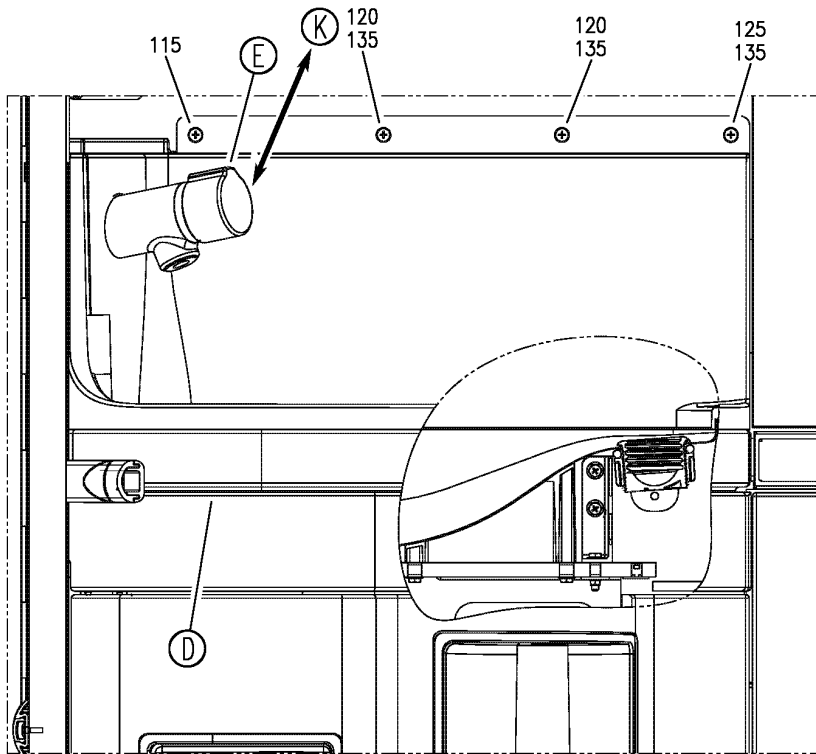

(C)

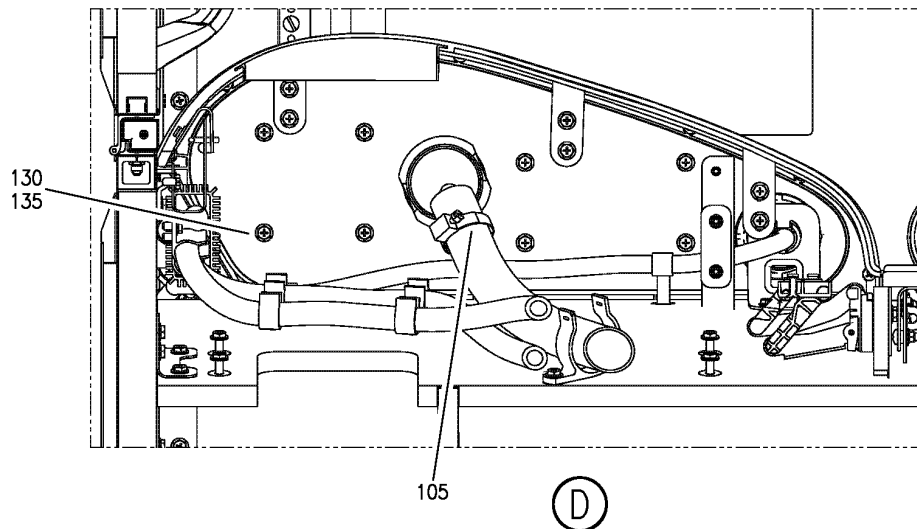

E 25401555F SHT 3 REV 273

STRUCTURE INSTL-LAV E  
FIGURE 55F (SHEET 3)


**25-40-15-55F**

R Y R  
AUG 15/21

25-40-15-55F  
PAGE 0B

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

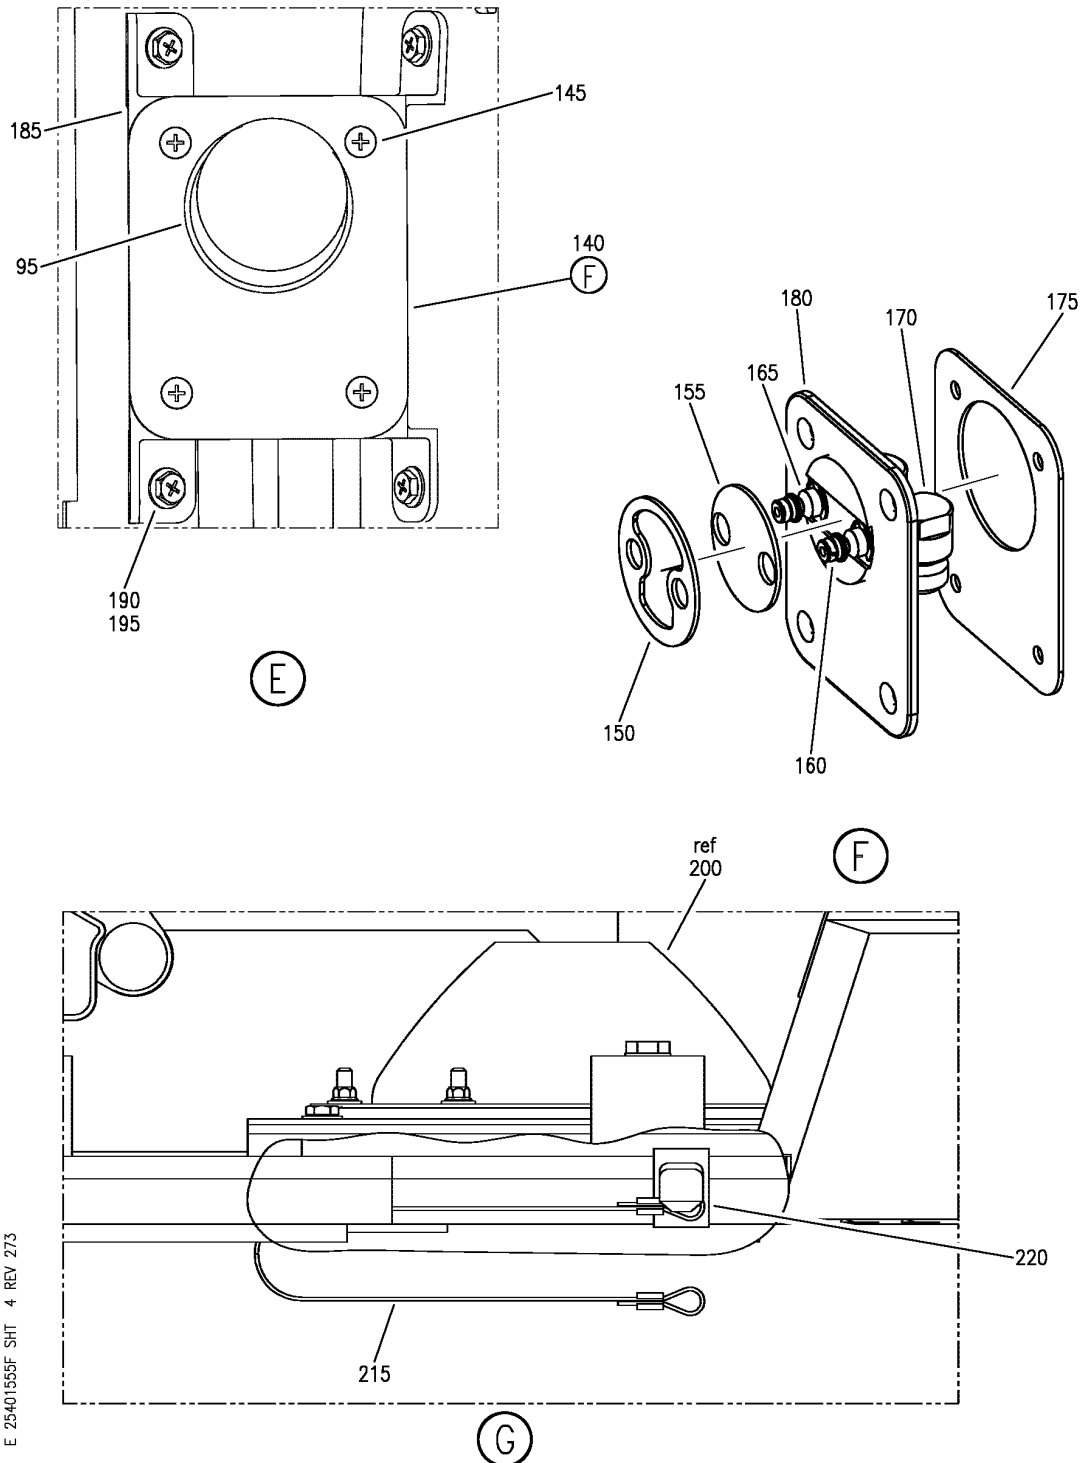

E 25401555F SHT 4 REV 273

STRUCTURE INSTL-LAV E  
FIGURE 55F (SHEET 4)


**25-40-15-55F**

R/YR  
AUG 15/21

25-40-15-55F  
PAGE 0C

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

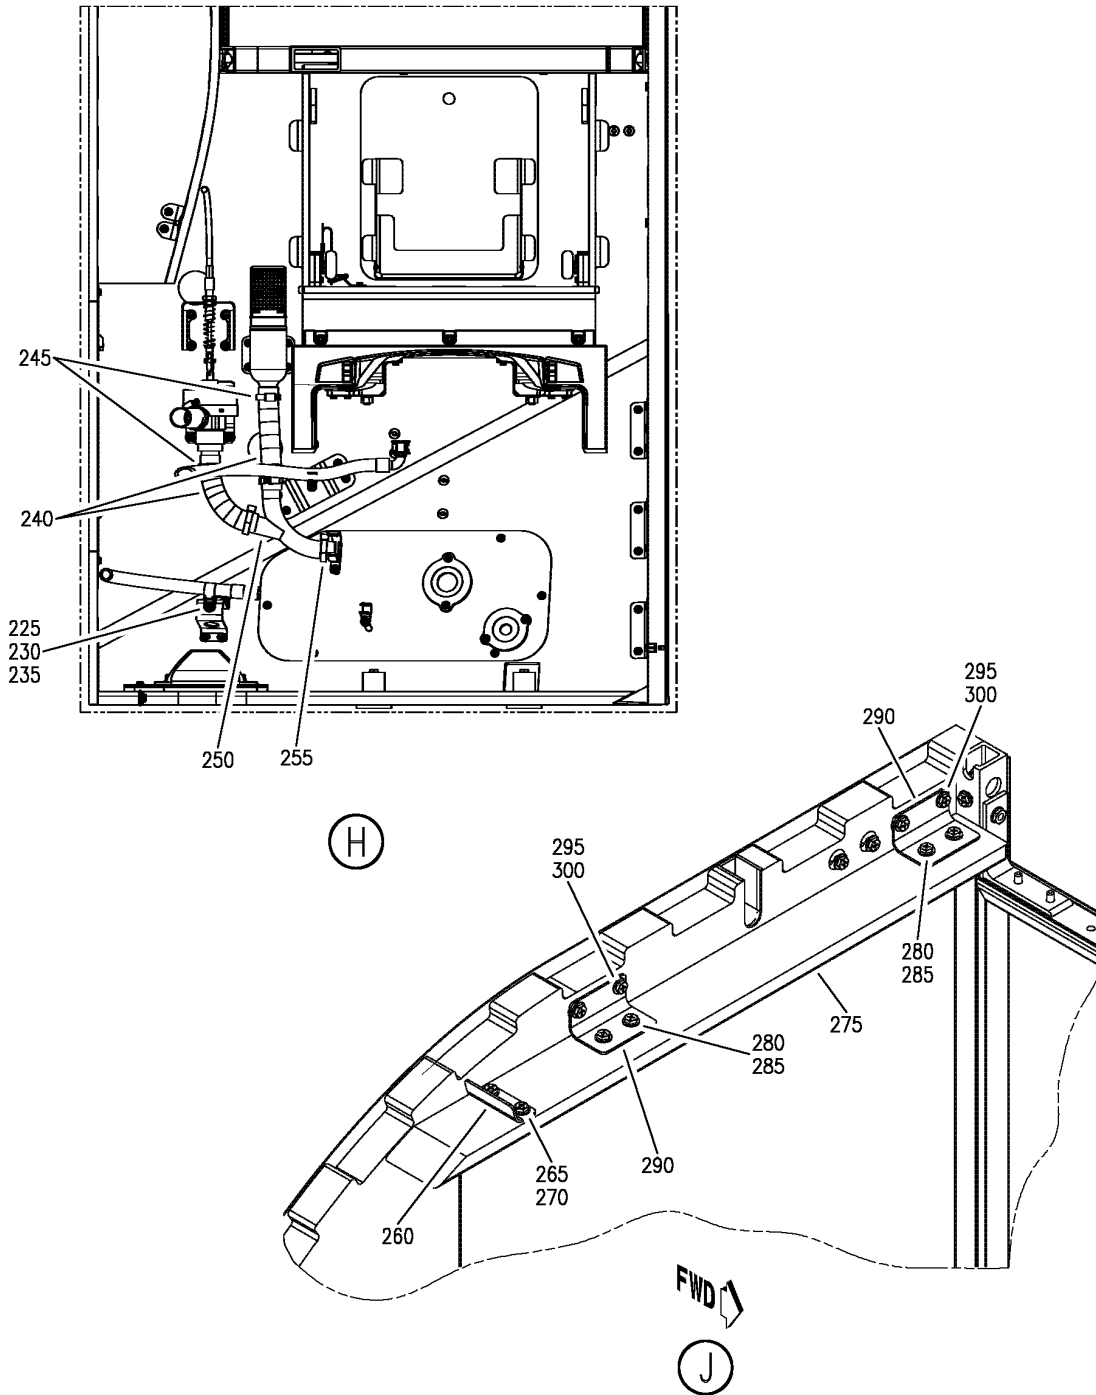

E 25401555F SHT 5 REV 273

STRUCTURE INSTL-LAV E  
FIGURE 55F (SHEET 5)

**25-40-15-55F**



R Y R  
AUG 15/21

25-40-15-55F  
PAGE 00

ECCN 9E991 BOEING PROPRIETARY – See title page for details.



**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

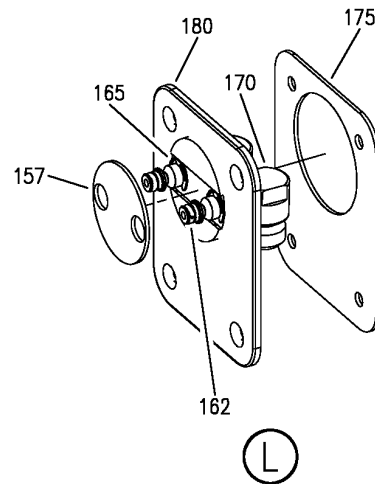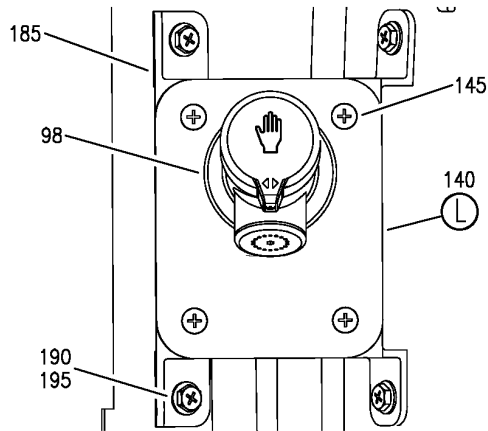

E 25401555F SHT 6 REV 273

STRUCTURE INSTL-LAV E  
FIGURE 55F (SHEET 6)

**25-40-15-55F**

R Y R  
AUG 15/21

25-40-15-55F  
PAGE 0E

ECCN 9E991 BOEING PROPRIETARY – See title page for details.


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER     | 1 2 3 4 5 6 7 | NOMENCLATURE                                                                                                                                                                                  | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|-----------------|---------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 55 F                                                    |                 |               |                                                                                                                                                                                               |                   |                      |
| - 1                                                     | 1L306051-155EW2 |               | STRUCTURE INSTL-LAV E<br>STRUCTURE INSTL-LAV E<br>SUPPLIER CODE:<br>V6S8D7<br>FOR NHA/OTHER SYS DET SEE:<br>25-40-15-55D                                                                      | 460508<br>460475  | RF                   |
| - 2                                                     | 1L306051-221EW2 |               | STRUCTURE INSTL-LAV E<br>SUPPLIER CODE:<br>V6S8D7<br>FOR NHA/OTHER SYS DET SEE:<br>25-40-15-55D                                                                                               | 476481            | RF                   |
| - 2                                                     | 1L306051-221HF2 |               | STRUCTURE INSTL-LAV E<br>SUPPLIER CODE:<br>V6S8D7<br>FOR NHA/OTHER SYS DET SEE:<br>25-40-15-55D                                                                                               | 482508            | RF                   |
| 50                                                      | 1L460050-351    |               | .LIGHT ASSY-<br>SUPPLIER CODE:<br>V6S8D7<br>FUNCTIONAL REFERENCE:<br>LIGHTS<br>FOR DETAILS SEE<br>33-26-03-42N<br>PLACARDS AND MARKINGS<br>FOR DETAILS SEE<br>11-32-05-18V<br>ATTACHING PARTS | 460508            | 1                    |
| 55                                                      | NAS1801-3-7     |               | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-7                                                                                                                                               | 460508            | 6                    |
| 60                                                      | NAS1149D0332J   |               | .WASHER<br>-----*-----                                                                                                                                                                        | 460508            | 6                    |
| 65                                                      | 1L500403-89     |               | .SHIM-<br>SUPPLIER CODE:<br>V6S8D7                                                                                                                                                            | 460508            | 1                    |
| 70                                                      | 1L400401-97     |               | .PANEL ASSY-<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-41-51-55R                                                                                                                  | 460508            | 1                    |
| - 75                                                    | 9L500001-003    |               | .STUD INSTL-GND ELECTRICAL<br>SUPPLIER CODE:<br>V6S8D7                                                                                                                                        | 460508            | 1                    |
| 80                                                      | NAS1801-3-10    |               | ..SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-10                                                                                                                                             | 460508            | 1                    |
| 85                                                      | MS21042L3       |               | ..NUT<br>STANDARD SUBSTITUTION:<br>BACN11AG3                                                                                                                                                  | 460508            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                 |               |                                                                                                                                                                                               |                   |                      |

- ITEM NOT ILLUSTRATED

R Y R

25-40-15-55F

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-15  
FIG. 55F  
PAGE 1  
OCT 15/23


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 | NOMENCLATURE                                                                                                                                                                                                                                                                         | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|---------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 55 F                                                    |                |               |                                                                                                                                                                                                                                                                                      |                   |                      |
| 90                                                      | NAS1149D0316H  |               | . . WASHER                                                                                                                                                                                                                                                                           | 460508            | 3                    |
| 95                                                      | AR9472-3W1D492 |               | . FAUCET ASSY-<br>SUPPLIER CODE:<br>V80477<br>SB DATA FROM A CMM:<br>PRE SB 1L3-25-0072<br>PRE SB 1L3-25-0114<br>CONFIG CHG DATA FROM A CMM:<br>SUPSD BY 4W200301-11<br>SUPSD BY 4101800-001<br>COMPONENT MAINT MANUAL REF:<br>38-11-71<br>FOR DETAILS SEE:<br>38-11-05-18Y          | 460508            | 1                    |
| 95                                                      | SC4L500002-2   |               | . FAUCET ASSY-<br>SUPPLIER CODE:<br>V6S8D7<br>SB DATA FROM A CMM:<br>PRE SB 1L3-25-0072<br>PRE SB 1L3-25-0114<br>CONFIG CHG DATA FROM A CMM:<br>SUPSD BY SC4L500301-5<br>MISCELLANEOUS DATA:<br>ORDER AR9472-3W1D492<br><br>ADAMS RITE<br>AEROSPACE PART NUMBER<br>AR9472-3W1D492    | 460508            | 1                    |
| 98                                                      | 4W200301-11    |               | . FAUCET ASSY-<br>SUPPLIER CODE:<br>V6S8D7<br>SB DATA FROM A CMM:<br>POST SB 1L3-25-0072<br>PRE SB 1L3-25-0114<br>CONFIG CHG DATA FROM A CMM:<br>SUPERSEDES<br>AR9472-3W1D492<br>SUPSD BY 4101800-001<br>COMPONENT MAINT MANUAL REF:<br>38-10-01<br>FOR DETAILS SEE:<br>38-11-05-60C | 460508            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |               |                                                                                                                                                                                                                                                                                      |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R

25-40-15-55F

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

25-40-15  
 FIG. 55F  
 PAGE 2  
 OCT 15/23


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER  | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                                                                                                                                                                                                                                                   | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|--------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 55 F<br>98                                              | SC4L500301-4 | . FAUCET ASSY-<br>SUPPLIER CODE:<br>V6S8D7<br>SB DATA FROM A CMM:<br>POST SB 1L3-25-0072<br>PRE SB 1L3-25-0114<br>CONFIG CHG DATA FROM A CMM:<br>SUPSD BY SC4L500301-5<br>MISCELLANEOUS DATA:<br>ORDER 4W200301-11<br>COMPONENT MAINT MANUAL REF:<br>38-10-01<br>OPTIONAL PART:<br>4W200301-11<br>V6S8D7<br>FOR DETAILS SEE:<br>38-11-05-60C | 460508            | 1                    |
| 98                                                      | 4101800-001  | . FAUCET ASSY-<br>SUPPLIER CODE:<br>V5E3E9<br>SB DATA FROM A CMM:<br>POST SB 1L3-25-0114<br>CONFIG CHG DATA FROM A CMM:<br>SUPERSEDES<br>AR9472-3W1D492<br>SUPERSEDES 4W200301-11<br>COMPONENT MAINT MANUAL REF:<br>38-10-03<br>FOR DETAILS SEE:<br>38-11-05-60E                                                                             | 460508            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |              |                                                                                                                                                                                                                                                                                                                                              |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R

25-40-15-55F

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

25-40-15  
 FIG. 55F  
 PAGE 3  
 AUG 15/24


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                     | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 55 F<br>98                                              | SC4L500301-5   | . FAUCET ASSY-<br>SUPPLIER CODE:<br>V6S8D7<br>FUNCTIONAL DESCRIPTION:<br>ASSEMBLY ALLOWS<br>DISPENSING OF POTABLE<br>WATER IN THE LAVATORY<br>SINK.<br>SB DATA FROM A CMM:<br>POST SB 1L3-25-0114<br>CONFIG CHG DATA FROM A CMM:<br>SUPERSEDES SC4L500002-2<br>SUPERSEDES SC4L500301-4<br>MISCELLANEOUS DATA:<br>ORDER 4101800-001<br><br>SC4L500301-5 IS AN<br>EQUIVALENT P/N FOR THE<br>4101800-001 FAUCET WHICH<br>IS COVERED BY CMM<br>38-10-03.<br>COMPONENT MAINT MANUAL REF:<br>38-10-03<br>OPTIONAL PART:<br>4101800-001<br>V5E3E9<br>FOR DETAILS SEE:<br>38-11-05-60E | 460508            | 1                    |
| 105                                                     | NAS1922-0125-3 | . CLAMP                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                        | 460508            | 1                    |
| 110                                                     | 1L460050-267   | . SINK ASSY-<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-41-11-21R<br>ATTACHING PARTS                                                                                                                                                                                                                                                                                                                                                                                                                                                                                | 460508            | 1                    |
| 115                                                     | NAS514P1032-4  | . SCREW                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                        | 460508            | 1                    |
| 120                                                     | NAS514P1032-5  | . SCREW                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                        | 460508            | 2                    |
| 125                                                     | NAS514P1032-6  | . SCREW                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                        | 460508            | 1                    |
| 130                                                     | NAS1801-3-9    | . SCREW                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                        | 460508            | 8                    |
|                                                         |                | STANDARD SUBSTITUTION:<br>BACS12HN3-9                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                          |                   |                      |
| 135                                                     | NAS1149D0332J  | . WASHER-<br>MISCELLANEOUS DATA:<br>USE AS REQUIRED TO<br><br>MAINTAIN FLUSHNESS WITH<br><br>THE REST OF THE VANITY<br>-----*-----                                                                                                                                                                                                                                                                                                                                                                                                                                             | 460508            | AR                   |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R

25-40-15-55F

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-15  
 FIG. 55F  
 PAGE 4  
 DEC 15/24


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER   | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                                                       | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|---------------|--------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 55 F<br>140                                             | 77586-1       | .PLATE ASSY-FAUCET MTG<br>SUPPLIER CODE:<br>V80477<br>COMPONENT MAINT MANUAL REF:<br>38-11-80                                                    | 460508            | 1                    |
| 140                                                     | SC4L500002-3  | .PLATE ASSY-FAUCET MTG<br>SUPPLIER CODE:<br>V6S8D7<br>MISCELLANEOUS DATA:<br>ORDER 77586-1<br>ATTACHING PARTS                                    | 460508            | 1                    |
| 145                                                     | NAS514P1032-9 | .SCREW<br>-----*-----                                                                                                                            | 460508            | 4                    |
| 150                                                     | 77593-1       | ..GASKET-<br>SUPPLIER CODE:<br>V80477<br>SB DATA FROM A CMM:<br>PRE SB 1L3-25-0072                                                               | 460508            | 1                    |
| 155                                                     | 77644-1       | ..GASKET-<br>SUPPLIER CODE:<br>V80477<br>SB DATA FROM A CMM:<br>PRE SB 1L3-25-0072                                                               | 460508            | 1                    |
| 157                                                     | 4W500301-31   | ..GASKET-<br>SUPPLIER CODE:<br>V6S8D7<br>SB DATA FROM A CMM:<br>POST SB 1L3-25-0072<br>POST SB 1L3-25-0114                                       | 460508            | 1                    |
| 160                                                     | 20166-007     | ..PACKING-<br>SUPPLIER CODE:<br>V80477<br>SB DATA FROM A CMM:<br>PRE SB 1L3-25-0072                                                              | 460508            | 2                    |
| 162                                                     | LCCS14-007B   | ..PACKING-<br>SUPPLIER CODE:<br>V6S8D7<br>TRUE PART NUMBER:<br>LCCS-14-007B<br>SB DATA FROM A CMM:<br>POST SB 1L3-25-0072<br>POST SB 1L3-25-0114 | 460508            | 2                    |
| 165                                                     | 20058-31      | ..RING-<br>SUPPLIER CODE:<br>V80477                                                                                                              | 460508            | 2                    |
| 170                                                     | 77592-1       | ..FITTING-<br>SUPPLIER CODE:<br>V80477                                                                                                           | 460508            | 2                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |               |                                                                                                                                                  |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R

25-40-15-55F

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-15  
 FIG. 55F  
 PAGE 5  
 AUG 15/24


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER   | 1 2 3 4 5 6 7 NOMENCLATURE                                                                               | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|---------------|----------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 55 F                                                    |               |                                                                                                          |                   |                      |
| 175                                                     | 77599-1       | .. GASKET-<br>SUPPLIER CODE:<br>V80477                                                                   | 460508            | 1                    |
| 180                                                     | 77585-1       | .. PLATE-<br>SUPPLIER CODE:<br>V80477                                                                    | 460508            | 1                    |
| 185                                                     | 4W400401-6    | . BRACKET-FAUCET MTG<br>SUPPLIER CODE:<br>V6S8D7                                                         | 460508            | 1                    |
| 190                                                     | NAS1801-3-6   | ATTACHING PARTS<br>. SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                                      | 460508            | 4                    |
| 195                                                     | NAS1149D0332J | . WASHER<br>-----*-----                                                                                  | 460508            | 4                    |
| 200                                                     | 4L400401-25   | . PLATE ASSY-CLOSEOUT<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-41-11-40E<br>ATTACHING PARTS | 460508            | 1                    |
| 205                                                     | NAS1801-3-11  | . SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-11                                                        | 460508            | 4                    |
| 210                                                     | NAS1149D0332J | . WASHER<br>-----*-----                                                                                  | 460508            | 4                    |
| 215                                                     | 4595339-012   | . LANYARD-<br>SUPPLIER CODE:<br>V16827                                                                   | 460508            | 1                    |
| 220                                                     | LWC19AC14     | . CLIP-ADHESIVE BACKED<br>SUPPLIER CODE:<br>V06383<br>TRUE PART NUMBER:<br>LWC19-A-C14                   | 460508            | 1                    |
| 225                                                     | MS25281F11    | . CLAMP-<br>TRUE PART NUMBER:<br>MS25281-F11<br>ATTACHING PARTS                                          | 460508            | 1                    |
| 230                                                     | NAS1801-3-10  | . SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-10                                                        | 460508            | 1                    |
| 235                                                     | NAS1149D0332J | . WASHER<br>-----*-----                                                                                  | 460508            | 1                    |
| 260                                                     | 4L500403-53   | . BRACKET-<br>SUPPLIER CODE:<br>V6S8D7                                                                   | 460508            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |               |                                                                                                          |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R

25-40-15-55F

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-15  
FIG. 55F  
PAGE 6  
AUG 15/24


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER   | 1 2 3 4 5 6 7 | NOMENCLATURE                                                      | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|---------------|---------------|-------------------------------------------------------------------|-------------------|----------------------|
| 55 F                                                    |               |               | ATTACHING PARTS                                                   |                   |                      |
| 265                                                     | NAS1801-3-6   | .             | SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                    | 460508            | 2                    |
| 270                                                     | NAS1149D0332J | .             | WASHER<br>-----*-----                                             | 460508            | 2                    |
| 275                                                     | 4L400403-12   | .             | PANEL-<br>SUPPLIER CODE:<br>V6S8D7                                | 460508            | 1                    |
| 280                                                     | NAS1801-3-6   | .             | ATTACHING PARTS<br>SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6 | 460508            | 4                    |
| 285                                                     | NAS1149D0332J | .             | WASHER<br>-----*-----                                             | 460508            | 4                    |
| 290                                                     | 4L500403-55   | .             | BRACKET-<br>SUPPLIER CODE:<br>V6S8D7                              | 460508            | 2                    |
| 295                                                     | NAS1801-3-6   | .             | ATTACHING PARTS<br>SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6 | 460508            | 4                    |
| 300                                                     | NAS1149D0332K | .             | WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0332J<br>-----*-----  | 460508            | 4                    |
| - 305                                                   | 9L500001-003  | .             | STUD INSTL-GND<br>SUPPLIER CODE:<br>V6S8D7                        | 460508            | 3                    |
| 310                                                     | NAS1801-3-10  | ..            | SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-10                   | 460508            | 1                    |
| 315                                                     | MS21042L3     | ..            | NUT<br>STANDARD SUBSTITUTION:<br>BACN11AG3                        | 460508            | 1                    |
| 320                                                     | NAS1149D0316H | ..            | WASHER                                                            | 460508            | 3                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |               |               |                                                                   |                   |                      |

- ITEM NOT ILLUSTRATED

R Y R


25-40-15-55F

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-15  
 FIG. 55F  
 PAGE 7  
 AUG 15/24



**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

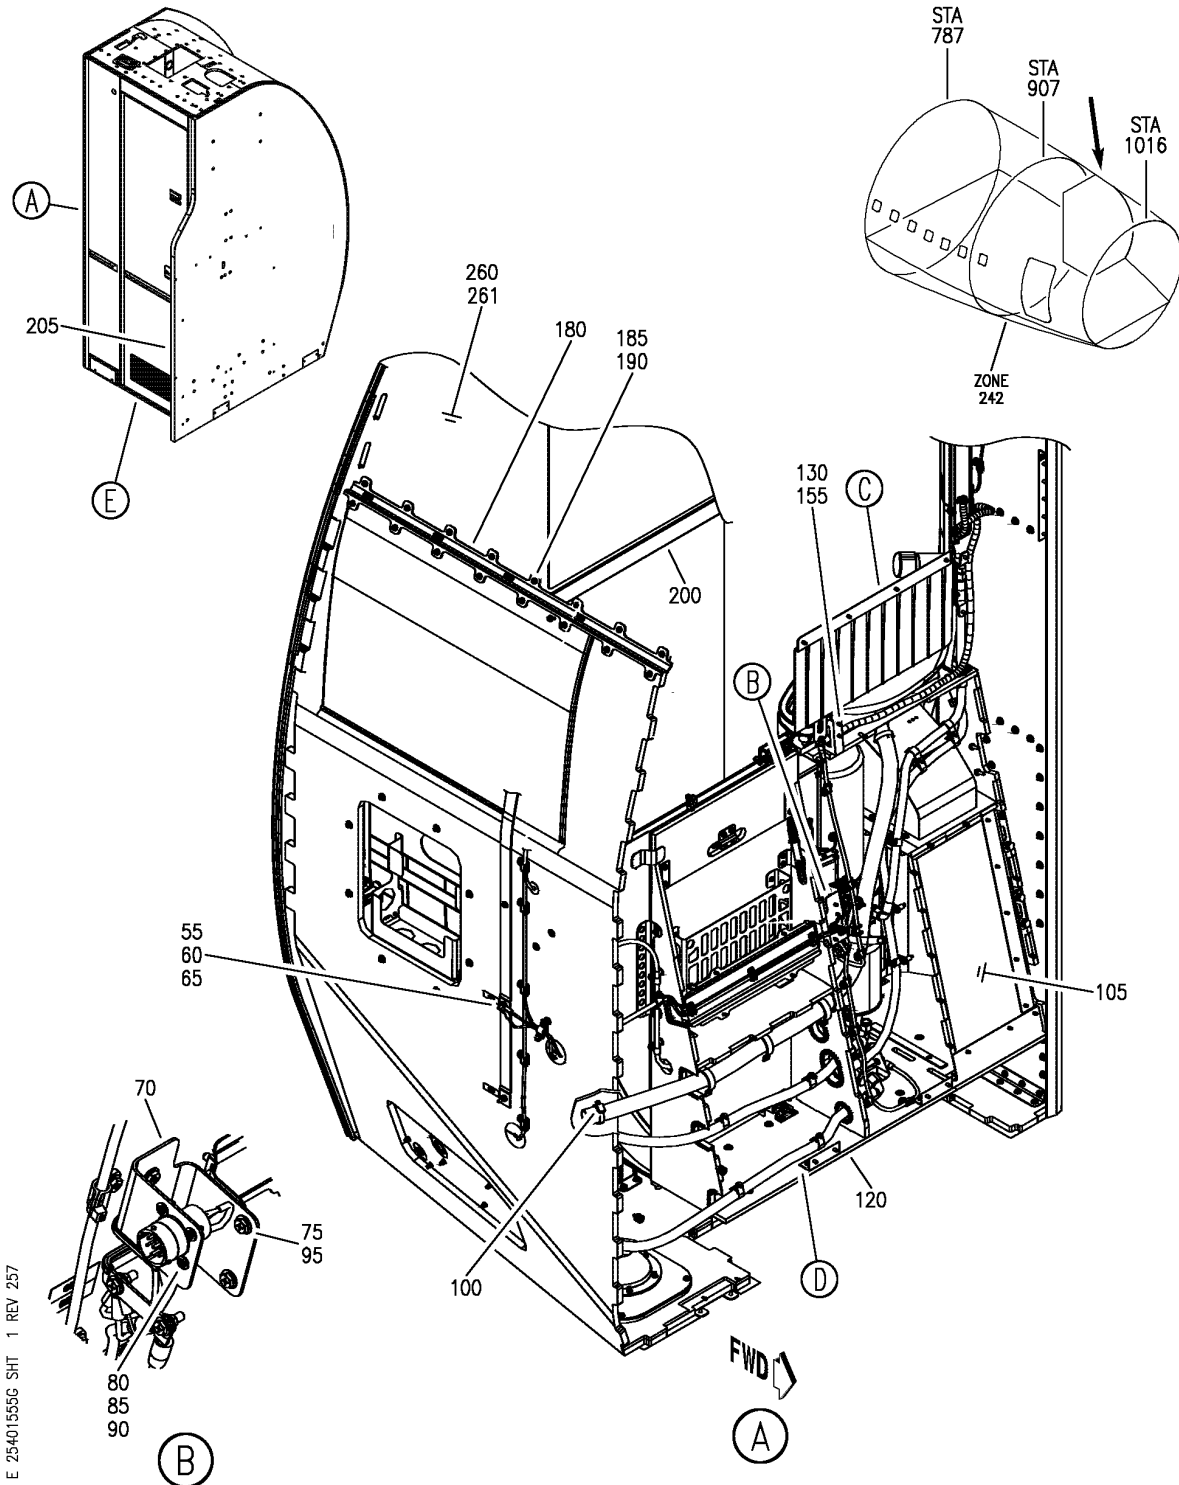

E 25401555G SHT 1 REV 257

STRUCTURE INSTL-LAV  
FIGURE 55G (SHEET 1)


**25-40-15-55G**

R/YR  
DEC 15/17


25-40-15-55G  
PAGE 0

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

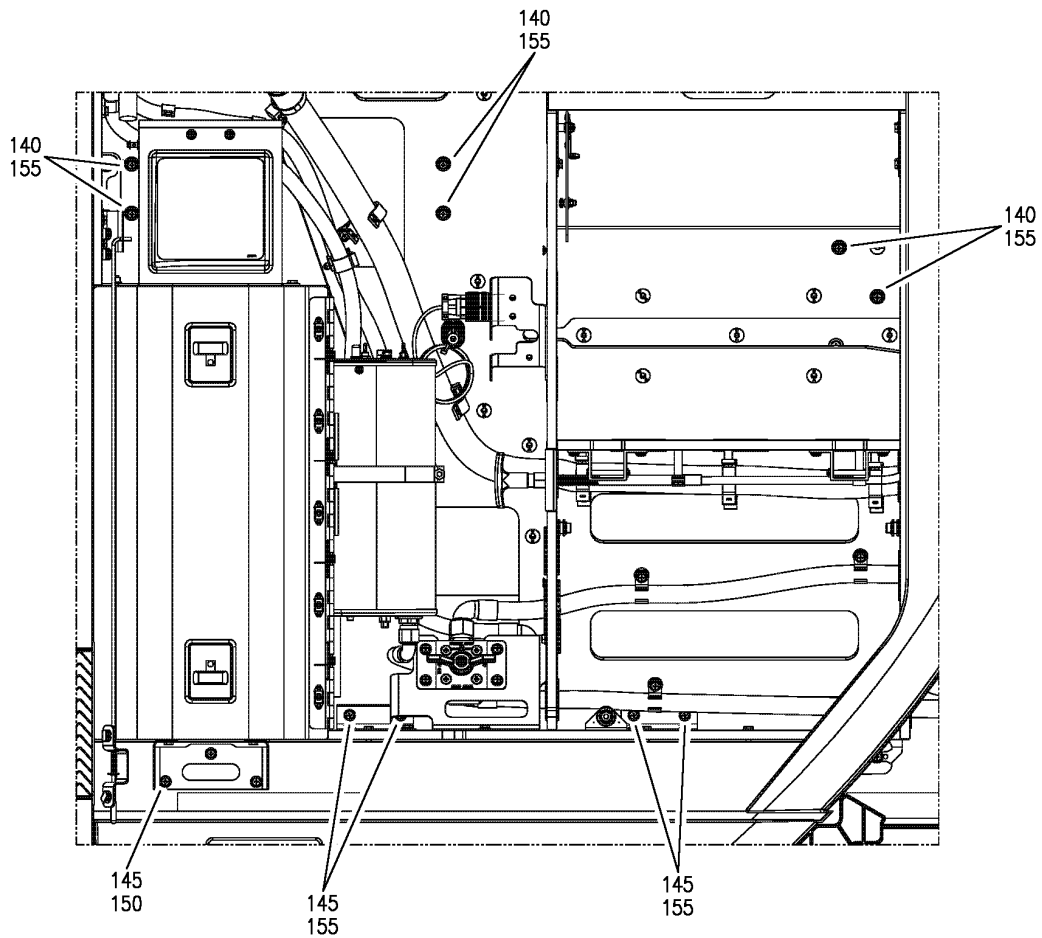

(C)

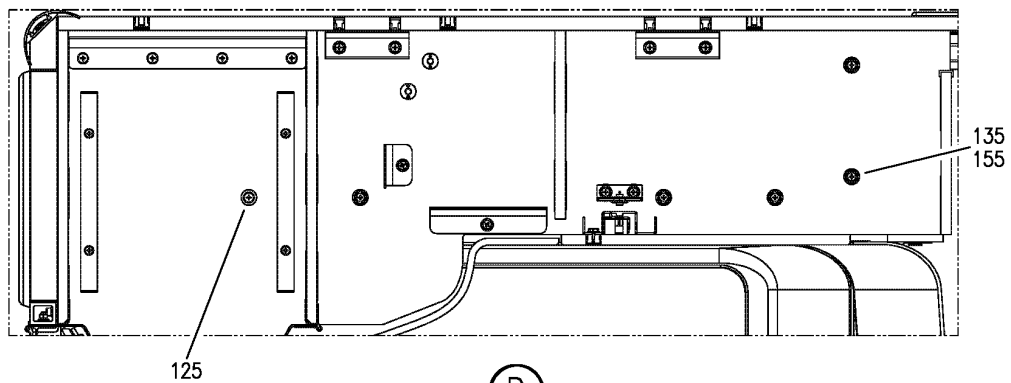

(D)

E 25401555G SHT 2 REV 257

STRUCTURE INSTL-LAV  
FIGURE 55G (SHEET 2)


**25-40-15-55G**

RJR  
DEC 15/17

25-40-15-55G  
PAGE 0A

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

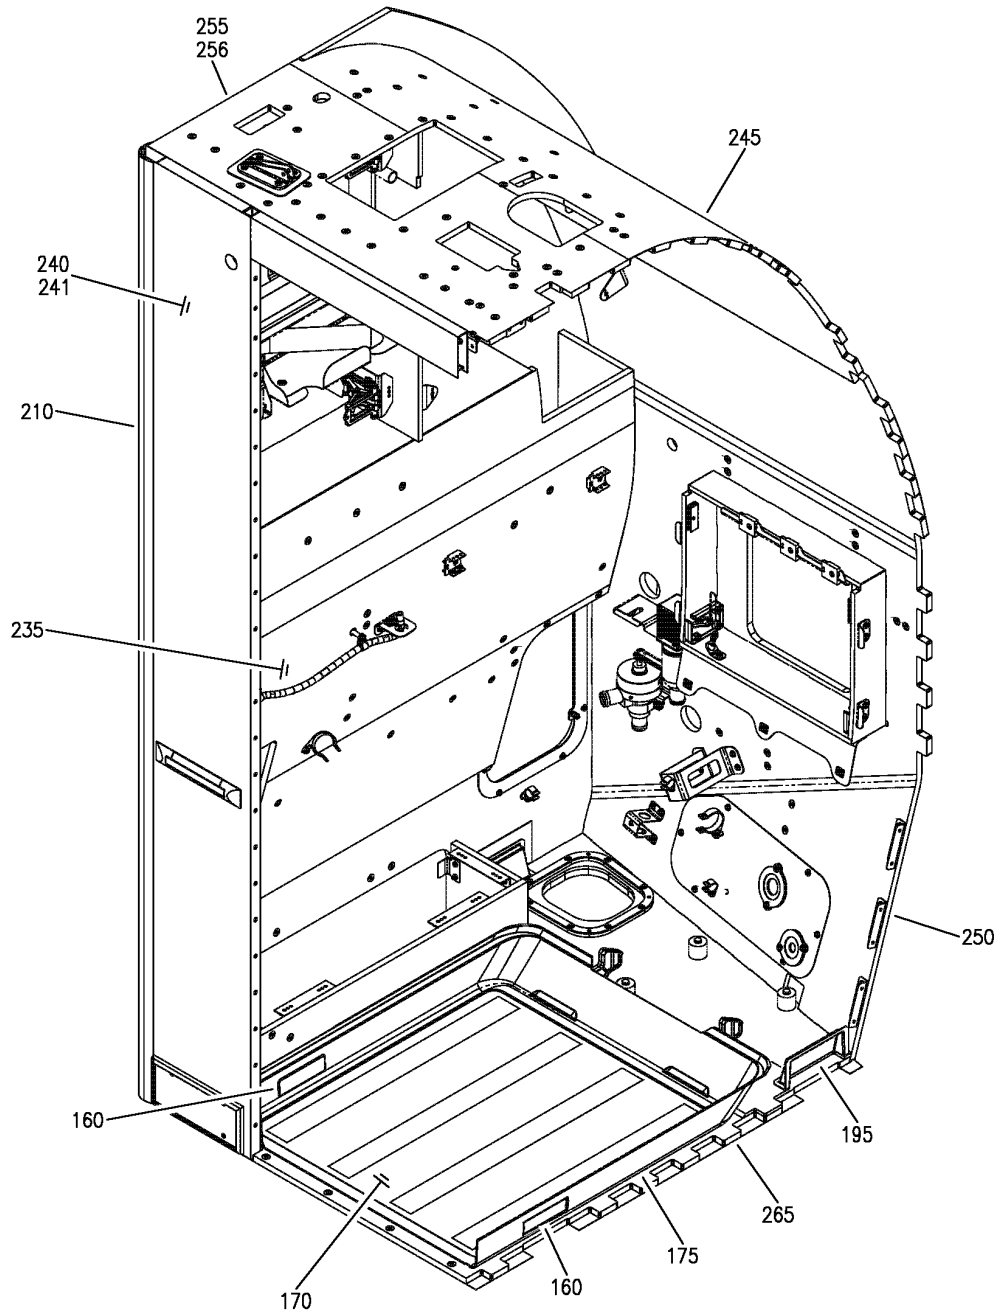

(E)

STRUCTURE INSTL-LAV  
FIGURE 55G (SHEET 3)

**25-40-15-55G**

R Y R  
DEC 15 / 17

25-40-15-55G  
PAGE 08

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

E 25401555G SHT 3 REV 257


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER     | 1 2 3 4 5 6 7 | NOMENCLATURE                                                                                            | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|-----------------|---------------|---------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 55G                                                     |                 |               |                                                                                                         |                   |                      |
| - 1                                                     | 1L306051-155EW3 |               | STRUCTURE INSTL-LAV<br>STRUCTURE ASSY-LAV E<br>SUPPLIER CODE:<br>V6S8D7<br>FOR NHA SEE:<br>25-40-15-55D | 460508<br>460475  | RF                   |
| - 2                                                     | 1L306051-221EW3 |               | STRUCTURE INSTL-LAV E<br>SUPPLIER CODE:<br>V6S8D7<br>FOR NHA SEE:<br>25-40-15-55D                       | 476481            | RF                   |
| - 2                                                     | 1L306051-221HF3 |               | STRUCTURE INSTL-<br>SUPPLIER CODE:<br>V6S8D7<br>FOR NHA SEE:<br>25-40-15-55D                            | 482508            | RF                   |
| - 50                                                    | 9L500001-051    |               | .STRAP INSTL-GND ELECTRICAL<br>SUPPLIER CODE:<br>V6S8D7                                                 | 460508            | 1                    |
| 55                                                      | MS21042L3       |               | ..NUT<br>STANDARD SUBSTITUTION:<br>BACN11AG3                                                            | 460508            | 1                    |
| 60                                                      | NAS1149D0332H   |               | ..WASHER                                                                                                | 460508            | 2                    |
| 65                                                      | 9L500001-201    |               | ..STANDOFF-HEX<br>SUPPLIER CODE:<br>V6S8D7                                                              | 460508            | 1                    |
| 70                                                      | 1L500401-194    |               | .BRACKET-DISC.<br>SUPPLIER CODE:<br>V6S8D7                                                              | 460508            | 1                    |
| 75                                                      | NAS1801-3-5     |               | ATTACHING PARTS<br>.SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-5                                      | 460508            | 5                    |
| 80                                                      | NAS1801-04-6    |               | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN04-6                                                        | 460508            | 4                    |
| 85                                                      | MS21042L04      |               | .NUT<br>STANDARD SUBSTITUTION:<br>BACN11AG04                                                            | 460508            | 4                    |
| 90                                                      | NAS1149DN432J   |               | .WASHER                                                                                                 | 460508            | 8                    |
| 95                                                      | NAS1149D0332J   |               | .WASHER<br>-----*-----                                                                                  | 460508            | 5                    |
| 100                                                     | NAS1922-0125-3  |               | .CLAMP                                                                                                  | 460508            | 1                    |
| 105                                                     | 1L400101-67     |               | .CAN ASSY-WASTE<br>SUPPLIER CODE:<br>V6S8D7                                                             | 460508            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                 |               |                                                                                                         |                   |                      |

- ITEM NOT ILLUSTRATED

R Y R

25-40-15-55G

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-15  
FIG. 55G  
PAGE 1  
APR 15/23


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                                          | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|-------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 55G<br>- 107                                            | SL00201        | ..GROMMET-<br>SUPPLIER CODE:<br>VOHESO<br>MISCELLANEOUS DATA:<br>ORDER LCEE000022                                                   | 460508            | AR                   |
| - 107                                                   | LCEE000022     | ..GROMMET-<br>SUPPLIER CODE:<br>V6S8D7<br>MISCELLANEOUS DATA:<br>DEVICE TECHNOLOGIES<br>INCORPORATION PART<br>NUMBER SL00201        | 460508            | AR                   |
| - 110                                                   | CBR1MM         | .TIE-CABLE<br>SUPPLIER CODE:<br>V06383<br>TRUE PART NUMBER:<br>CBR1M-M                                                              | 482508            | 2                    |
| - 113                                                   | MS3367-5-9     | .STRAP<br>STANDARD SUBSTITUTION:<br>BACS38K5                                                                                        | 460508            | AR                   |
| 120                                                     | 1L406500-323   | .VANITY INSTL-LWR<br>SUPPLIER CODE:<br>V6S8D7<br>USED ON:<br>1L306051-155EW3<br>FOR DETAILS SEE:<br>25-41-51-33F<br>ATTACHING PARTS | 460508            | 1                    |
| 125                                                     | NAS514P1032-12 | .SCREW                                                                                                                              | 460508            | 1                    |
| 130                                                     | NAS1801-3-5    | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-5                                                                                     | 460508            | 2                    |
| 135                                                     | NAS1801-3-13   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-13                                                                                    | 460508            | 5                    |
| 140                                                     | NAS1801-3-11   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-11                                                                                    | 460508            | 6                    |
| 145                                                     | NAS1801-3-6    | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                                                                                     | 460508            | 7                    |
| 150                                                     | NAS1149D0316K  | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J                                                                                  | 460508            | 3                    |
| 155                                                     | NAS1149D0332J  | .WASHER<br>-----*-----                                                                                                              | 460508            | 17                   |
| 160                                                     | 1L500407-207   | .PLATE-COVER<br>SUPPLIER CODE:<br>V6S8D7                                                                                            | 460508            | 2                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |                                                                                                                                     |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R

25-40-15-55G

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-15  
 FIG. 55G  
 PAGE 2  
 APR 15/25


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER   | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                                | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|---------------|---------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 55G<br>- 165                                            | 1L400407-68   | .PAN ASSY-FLOOR<br>SUPPLIER CODE:<br>V6S8D7                                                                               | 460508            | 1                    |
| 170                                                     | 1L400407-117  | ..MAT-<br>SUPPLIER CODE:<br>V6S8D7                                                                                        | 460508            | 1                    |
| 175                                                     | 1L400407-16   | ..PAN-<br>SUPPLIER CODE:<br>V6S8D7                                                                                        | 460508            | 1                    |
| 180                                                     | 1L400419-154  | .EXTRUSION-<br>SUPPLIER CODE:<br>V6S8D7                                                                                   | 460508            | 1                    |
| 185                                                     | NAS1801-3-6   | ATTACHING PARTS<br>.SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                                                        | 460508            | 16                   |
| 190                                                     | NAS1149D0332K | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0332J                                                                        | 460508            | 16                   |
| 195                                                     | 1L500109-347  | -----*-----<br>.CLOSEOUT-FLOOR<br>SUPPLIER CODE:<br>V6S8D7                                                                | 460508            | 2                    |
| 200                                                     | 1L500413-131  | .TRIM-WALL CLOSEOUT<br>SUPPLIER CODE:<br>V6S8D7                                                                           | 460508            | 1                    |
| 205                                                     | 1L500409-815  | .TRIM-EDGE<br>SUPPLIER CODE:<br>V6S8D7                                                                                    | 460508            | 1                    |
| 210                                                     | 1L500419-299  | .TRIM-FLAT WALL<br>SUPPLIER CODE:<br>V6S8D7                                                                               | 460508            | 1                    |
| - 215                                                   | 1L500709-661  | .TRIM-HEADER<br>SUPPLIER CODE:<br>V6S8D7                                                                                  | 460508            | 2                    |
| - 225                                                   | 415U9010-82   | .EXTRUSION-RTNR, CLIP<br>MISCELLANEOUS DATA:<br>ORDER LCPE000013                                                          | 460508            | AR                   |
| - 225                                                   | LCPE000013    | .EXTRUSION-RTNR, CLIP<br>SUPPLIER CODE:<br>V6S8D7<br>MISCELLANEOUS DATA:<br>THE BOEING COMPANY PART<br>NUMBER 415U9010-82 | 460508            | AR                   |
| - 230                                                   | MS21266-2N    | .GROMMET-<br>STANDARD SUBSTITUTION:<br>BACG20Z-B001275<br>MISCELLANEOUS DATA:<br>ORDER LCEE000003                         | 460508            | AR                   |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |               |                                                                                                                           |                   |                      |

- ITEM NOT ILLUSTRATED

R Y R

25-40-15-55G

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-15  
 FIG. 55G  
 PAGE 3  
 APR 15/25


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 NOMENCLATURE                                                           | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|--------------------------------------------------------------------------------------|-------------------|----------------------|
| 55G<br>- 230                                            | LCEE000003     | .GROMMET-<br>SUPPLIER CODE:<br>V6S8D7                                                | 460508            | AR                   |
| 235                                                     | 1L460051-255   | .WALL ASSY-SPACE<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-41-40-28H     | 460508            | 1                    |
| 240                                                     | 1L460051-303EW | .WALL ASSY-INBD<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-41-40-28J      | 460481            | 1                    |
| 240                                                     | 1L460051-303HF | .WALL ASSY-INBD<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-41-40-28J      | 482508            | 1                    |
| 245                                                     | 1L460051-287   | .CEILING INSTL-UPR<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-41-45-06S   | 460508            | 1                    |
| 250                                                     | 1L460051-305   | .WALL ASSY-OUTBD<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-41-40-28Q     | 460508            | 1                    |
| 255                                                     | 1L460051-397EW | .WALL ASSY-FWD<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-41-40-28L       | 460481            | 1                    |
| 255                                                     | 1L460051-397HF | .WALL INSTL-FWD<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-41-40-28L      | 482508            | 1                    |
| 260                                                     | 1L460051-423EW | .WALL ASSY-ATTENDANT<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-41-40-28T | 460481            | 1                    |
| 260                                                     | 1L460051-423HF | .WALL ASSY-ATTENDANT<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-41-40-28T | 482508            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |                                                                                      |                   |                      |

- ITEM NOT ILLUSTRATED

R Y R

25-40-15-55G

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-15  
 FIG. 55G  
 PAGE 4  
 APR 15/25


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER  | 1 2 3 4 5 6 7 | NOMENCLATURE                                                                  | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|--------------|---------------|-------------------------------------------------------------------------------|-------------------|----------------------|
| 55G<br>265                                              | 1L460051-395 |               | . FLOOR ASSY-<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-41-21-21R | 460508            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |              |               |                                                                               |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R


# 25-40-15-55G

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

25-40-15  
 FIG. 55G  
 PAGE 5  
 APR 15/25



**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

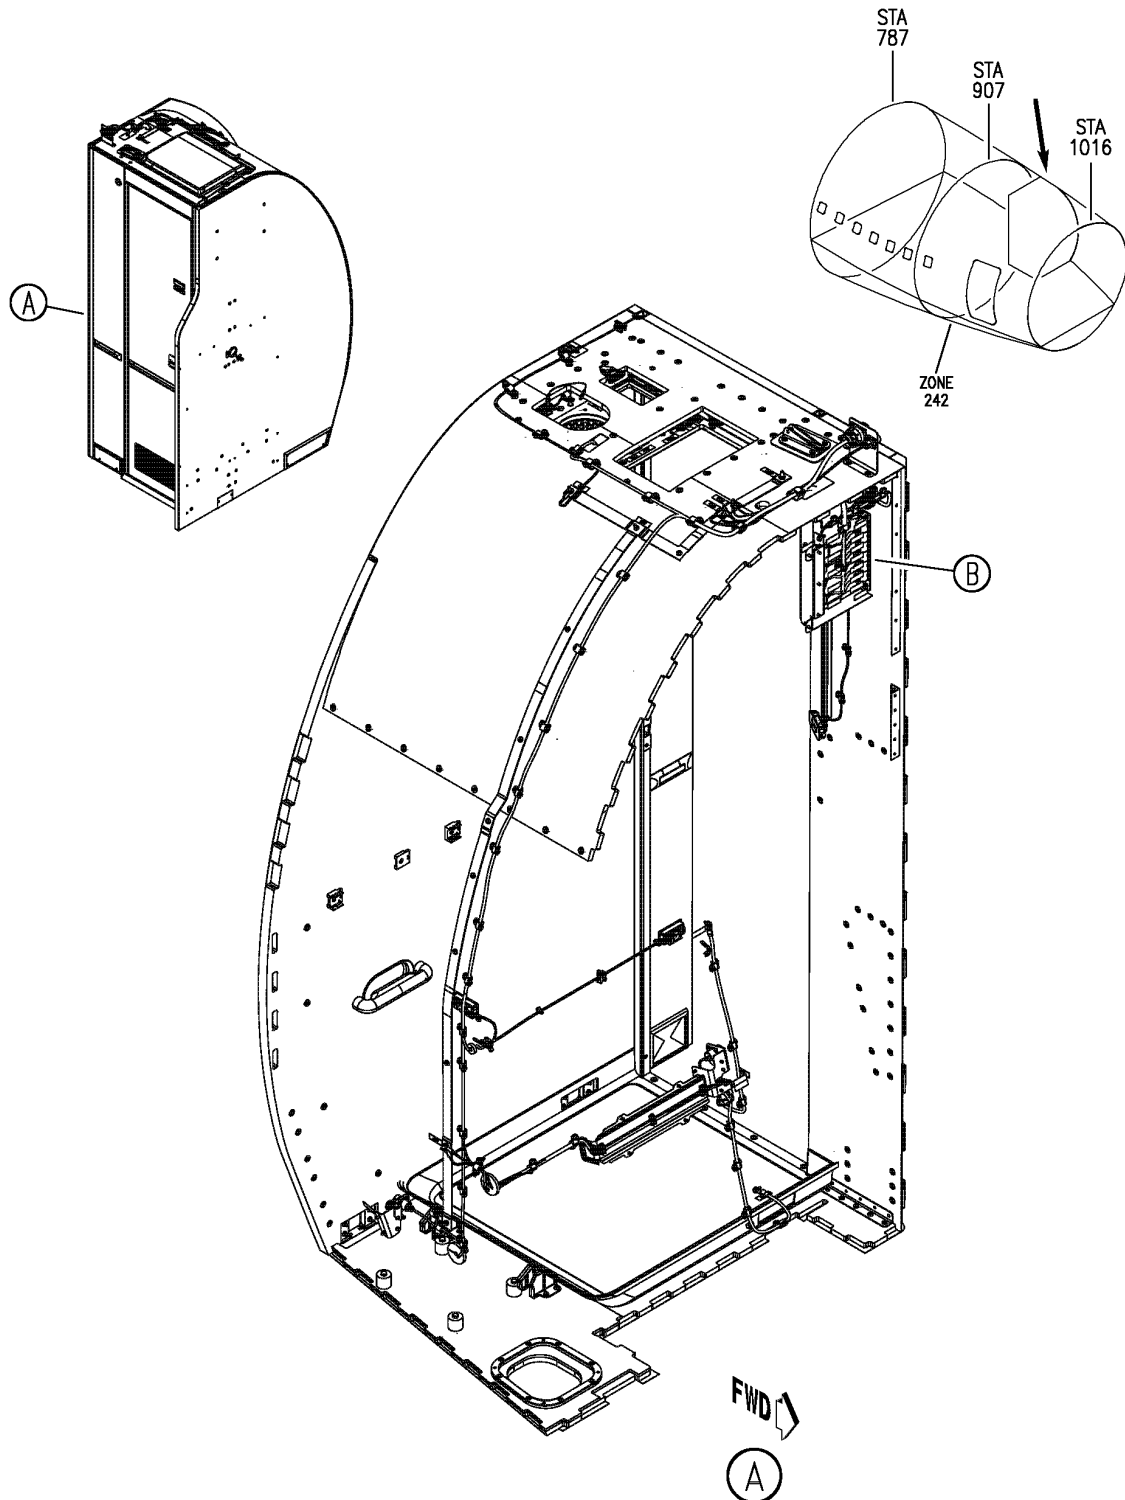

E 25401555H SHT 1 REV 255

ELECTRICAL INSTL-STRUCT, LAV (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 55H (SHEET 1)


**25-40-15-55H**

RJR  
OCT 15/17

25-40-15-55H  
PAGE 0

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

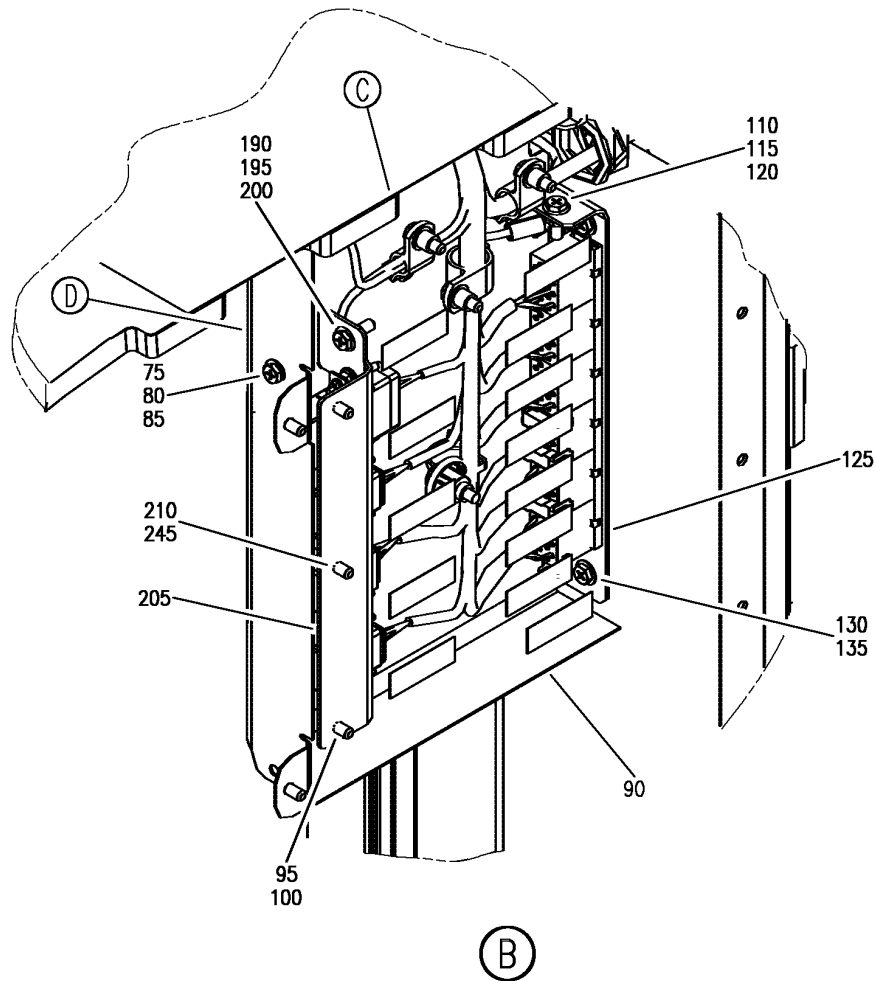

E 25401555H SHT 2 REV 255

ELECTRICAL INSTL-STRUCT, LAV (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 55H (SHEET 2)


**25-40-15-55H**

RJR  
OCT 15/17


25-40-15-55H  
PAGE 0A

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

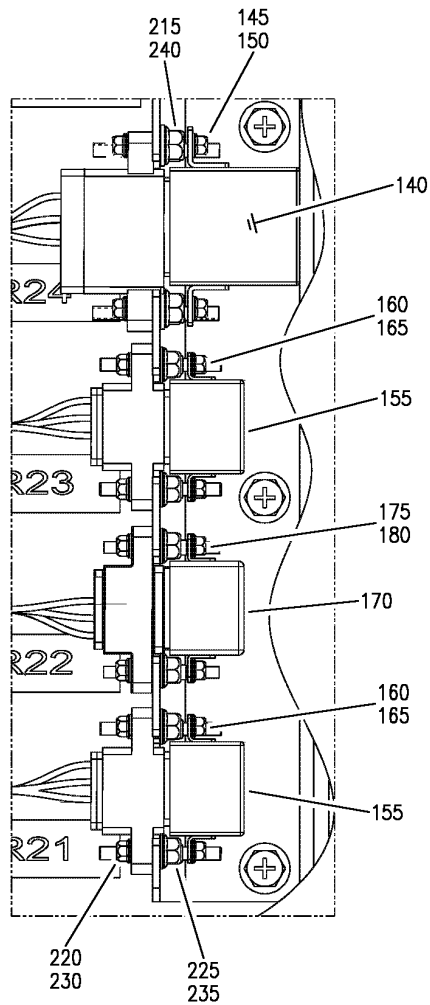

(C)

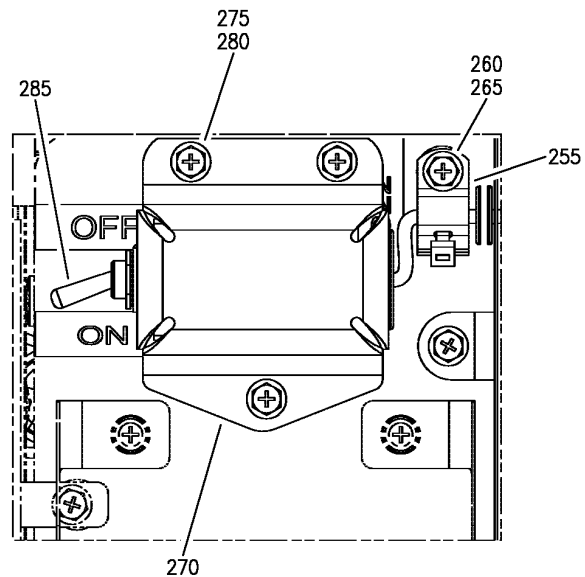

(D)

E 25401555H SHT 3 REV 255

ELECTRICAL INSTL-STRUCT, LAV (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 55H (SHEET 3)

**25-40-15-55H**

R Y R  
O C T 15 / 17

25-40-15-55H  
PAGE 0B

ECCN 9E991 BOEING PROPRIETARY - See title page for details.


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 | NOMENCLATURE                                                                                                                                                                   | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|---------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 55H                                                     |                |               | ELECTRICAL INSTL-STRUCT,<br>LAV (EQUIPMENT/FURNISHINGS<br>ONLY)                                                                                                                | 460508            |                      |
| - 1                                                     | 3L306050-111   |               | ELECTRICAL INSTL-STRUCT,<br>LAV E<br>(EQUIPMENT/FURNISHINGS<br>ONLY)<br>SUPPLIER CODE:<br>V6S8D7<br>FOR NHA/OTHER SYS DET SEE:<br>25-40-15-13D<br>25-40-15-13S<br>25-40-15-13T | 460508            | RF                   |
| - 50                                                    | 3L306050-111-1 |               | .ELECTRICAL INSTL-<br>SUPPLIER CODE:<br>V6S8D7<br>MISCELLANEOUS DATA:<br>NON PROCURABLE<br>FOR DETAILS SEE:<br>25-41-60-22U                                                    | 460508            | RF                   |
| - 55                                                    | 3L306050-111-2 |               | .ELECTRICAL INSTL-<br>SUPPLIER CODE:<br>V6S8D7<br>MISCELLANEOUS DATA:<br>NON PROCURABLE<br>FOR DETAILS SEE:<br>25-41-60-22V                                                    | 460508            | RF                   |
| - 60                                                    | MS3367-4-9     |               | .STRAP-<br>STANDARD SUBSTITUTION:<br>BACS38K4<br>SUPPLIER SPEC NUMBER:<br>2504695-4<br>V07187                                                                                  | 460508            | AR                   |
| - 65                                                    | MS3367-5-9     |               | .STRAP<br>STANDARD SUBSTITUTION:<br>BACS38K5                                                                                                                                   | 460508            | AR                   |
| - 70                                                    | 9L500001-003   |               | .STUD INSTL-GND<br>SUPPLIER CODE:<br>V6S8D7                                                                                                                                    | 460508            | 1                    |
| 75                                                      | NAS1801-3-10   |               | ..SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-10                                                                                                                              | 460508            | 1                    |
| 80                                                      | MS21042L3      |               | ..NUT<br>STANDARD SUBSTITUTION:<br>BACN11AG3                                                                                                                                   | 460508            | 1                    |
| 85                                                      | NAS1149D0316H  |               | ..WASHER                                                                                                                                                                       | 460508            | 3                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |               |                                                                                                                                                                                |                   |                      |

- ITEM NOT ILLUSTRATED

R Y R

25-40-15-55H

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-15  
FIG. 55H  
PAGE 1  
AUG 15/23


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                            | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|-----------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 55H                                                     |                |                                                                                                                       |                   |                      |
| 90                                                      | 3L500401-22    | .SHROUD-<br>SUPPLIER CODE:<br>V6S8D7<br>CONFIG CHG DATA FROM A CMM:<br>SUPSD BY 3L560401-28                           | 460508            | 1                    |
| 90                                                      | 3L560401-28    | .SHROUD ASSY-<br>SUPPLIER CODE:<br>V6S8D7<br>CONFIG CHG DATA FROM A CMM:<br>SUPERSEDES 3L500401-22<br>ATTACHING PARTS | 460508            | 1                    |
| 95                                                      | NAS1801-3-6    | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                                                                       | 460508            | 4                    |
| 100                                                     | NAS1149D0316K  | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J<br>-----*-----                                                     | 460508            | 4                    |
| - 105                                                   | 9L500001-003   | .STUD INSTL-GND<br>SUPPLIER CODE:<br>V6S8D7                                                                           | 460508            | 1                    |
| 110                                                     | NAS1801-3-10   | ..SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-10                                                                     | 460508            | 1                    |
| 115                                                     | MS21042L3      | ..NUT<br>STANDARD SUBSTITUTION:<br>BACN11AG3                                                                          | 460508            | 1                    |
| 120                                                     | NAS1149D0316H  | ..WASHER                                                                                                              | 460508            | 3                    |
| 125                                                     | 3L406500-001   | .BRACKET-TERM.<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                                                         | 460508            | 1                    |
| 130                                                     | NAS1801-3-6    | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                                                                       | 460508            | 2                    |
| 135                                                     | NAS1149D0316K  | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J<br>-----*-----                                                     | 460508            | 2                    |
| 140                                                     | M83536-11-002L | .RELAY-<br>STANDARD SUBSTITUTION:<br>M83536/11-002L<br>TRUE PART NUMBER:<br>M83536/11-002L<br>ATTACHING PARTS         | 460508            | 1                    |
| 145                                                     | MS21042L04     | .NUT<br>STANDARD SUBSTITUTION:<br>BACN11AG04                                                                          | 460508            | 2                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |                                                                                                                       |                   |                      |

- ITEM NOT ILLUSTRATED

R Y R

25-40-15-55H

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-15  
 FIG. 55H  
 PAGE 2  
 AUG 15/23


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER   | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                   | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|---------------|--------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 55H                                                     |               |                                                                                                              |                   |                      |
| 150                                                     | NAS620-4L     | . WASHER<br>-----*-----                                                                                      | 460508            | 2                    |
| 155                                                     | M83536-2-024L | . RELAY-<br>TRUE PART NUMBER:<br>M83536/2-024L<br>ATTACHING PARTS                                            | 460508            | 2                    |
| 160                                                     | MS21042L04    | . NUT<br>STANDARD SUBSTITUTION:<br>BACN11AG04                                                                | 460508            | 4                    |
| 165                                                     | NAS620-4L     | . WASHER<br>-----*-----                                                                                      | 460508            | 4                    |
| 170                                                     | M83536-6-022L | . RELAY-<br>STANDARD SUBSTITUTION:<br>M83536/6-022L<br>TRUE PART NUMBER:<br>M83536/6-022L<br>ATTACHING PARTS | 460508            | 1                    |
| 175                                                     | MS21042L04    | . NUT<br>STANDARD SUBSTITUTION:<br>BACN11AG04                                                                | 460508            | 3                    |
| 180                                                     | NAS620-4L     | . WASHER<br>-----*-----                                                                                      | 460508            | 3                    |
| - 185                                                   | 9L500001-003  | . STUD INSTL-GND<br>SUPPLIER CODE:<br>V6S8D7                                                                 | 460508            | 1                    |
| 190                                                     | NAS1801-3-10  | .. SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-10                                                           | 460508            | 1                    |
| 195                                                     | MS21042L3     | .. NUT<br>STANDARD SUBSTITUTION:<br>BACN11AG3                                                                | 460508            | 1                    |
| 200                                                     | NAS1149D0316H | .. WASHER                                                                                                    | 460508            | 3                    |
| 205                                                     | 3L500401-8    | . BRACKET-<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                                                    | 460508            | 1                    |
| 210                                                     | NAS1801-3-6   | . SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                                                             | 460508            | 3                    |
| 215                                                     | MS21042L3     | . NUT<br>STANDARD SUBSTITUTION:<br>BACN11AG3                                                                 | 460508            | 2                    |
| 220                                                     | MS21042L04    | . NUT<br>STANDARD SUBSTITUTION:<br>BACN11AG04                                                                | 460508            | 9                    |
| 225                                                     | MS21042L08    | . NUT<br>STANDARD SUBSTITUTION:<br>BACN11AG08                                                                | 460508            | 7                    |
| 230                                                     | NAS620-4L     | . WASHER                                                                                                     | 460508            | 9                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |               |                                                                                                              |                   |                      |

- ITEM NOT ILLUSTRATED

R Y R

# 25-40-15-55H

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-15  
 FIG. 55H  
 PAGE 3  
 AUG 15/23


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER   | 1 2 3 4 5 6 7 | NOMENCLATURE                                                          | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|---------------|---------------|-----------------------------------------------------------------------|-------------------|----------------------|
| 55H                                                     |               |               |                                                                       |                   |                      |
| 235                                                     | NAS620-8L     | .             | WASHER                                                                | 460508            | 7                    |
| 240                                                     | NAS620-10L    | .             | WASHER                                                                | 460508            | 2                    |
| 245                                                     | NAS1149D0316K | .             | WASHER                                                                | 460508            | 3                    |
|                                                         |               |               | STANDARD SUBSTITUTION:<br>NAS1149D0316J<br>-----*-----                |                   |                      |
| - 250                                                   | 9L500001-101  | .             | CLAMP INSTL-<br>SUPPLIER CODE:<br>V6S8D7                              | 460508            | 1                    |
| 255                                                     | CA2030-1      | ..            | CLAMP-<br>SUPPLIER CODE:<br>V03296<br>ATTACHING PARTS                 | 460508            | 1                    |
| 260                                                     | NAS1801-3-6   | ..            | SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                        | 460508            | 1                    |
| 265                                                     | NAS1149D0316K | ..            | WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J<br>-----*-----      | 460508            | 1                    |
| 270                                                     | 3L500401-14   | .             | BRACKET-SVCE TG SWITCH<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS | 460508            | 1                    |
| 275                                                     | NAS1801-3-6   | .             | SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                        | 460508            | 3                    |
| 280                                                     | NAS1149D0316K | .             | WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J<br>-----*-----      | 460508            | 3                    |
| 285                                                     | MS27407-3     | .             | SWITCH-TG                                                             | 460508            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |               |               |                                                                       |                   |                      |

— ITEM NOT ILLUSTRATED


RYR

25-40-15-55H

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

25-40-15  
 FIG. 55H  
 PAGE 4  
 AUG 15/23

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

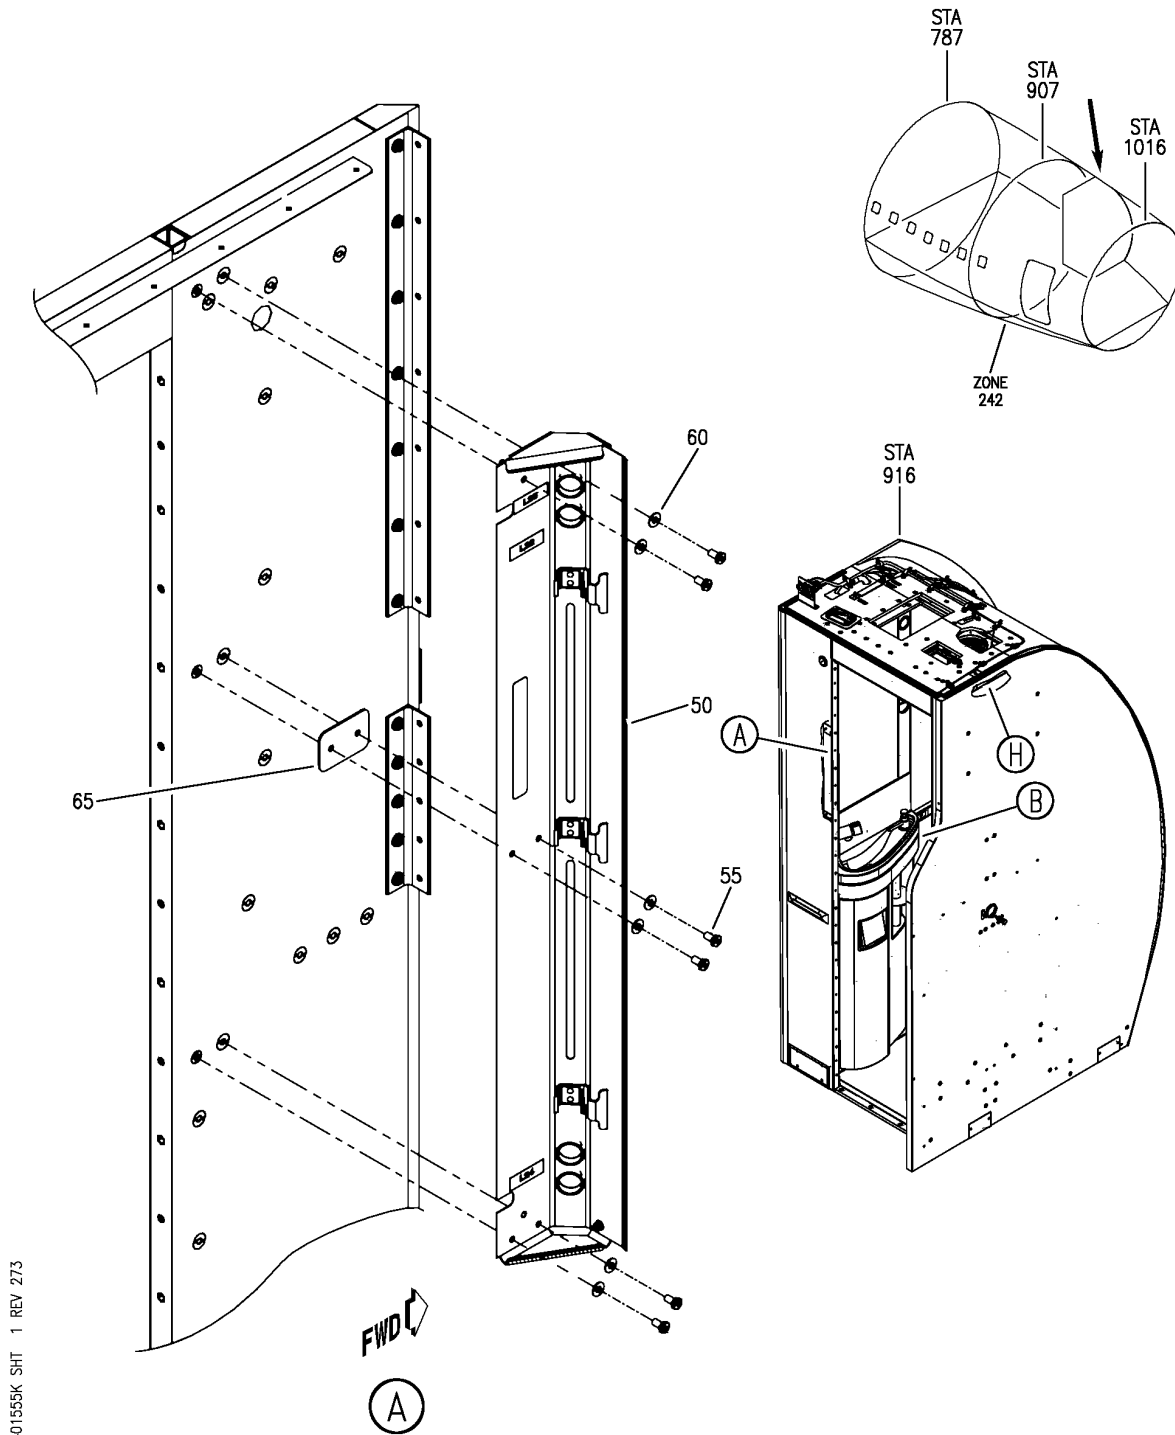

E 25401555K SHT 1 REV 273

STRUCTURE INSTL-LAV E (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 55K (SHEET 1)

**25-40-15-55K**


R/YR  
AUG 15/21

25-40-15-55K  
PAGE 0

ECCN 9E991 BOEING PROPRIETARY – See title page for details.



**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

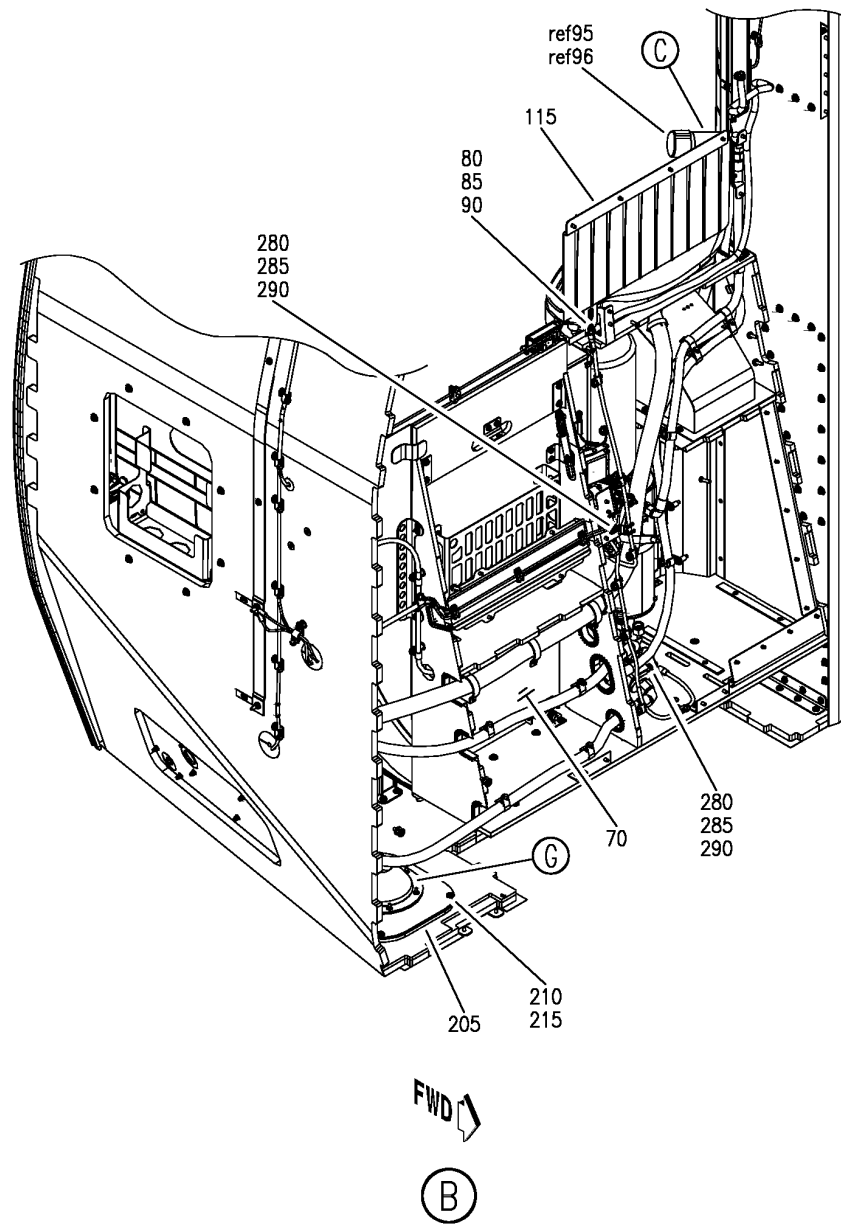

E 25401555K SHT 2 REV 273

STRUCTURE INSTL-LAV E (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 55K (SHEET 2)


**25-40-15-55K**

ECCN 9E991 BOEING PROPRIETARY - See title page for details.


R/YR  
AUG 15/21

25-40-15-55K  
PAGE 0A

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

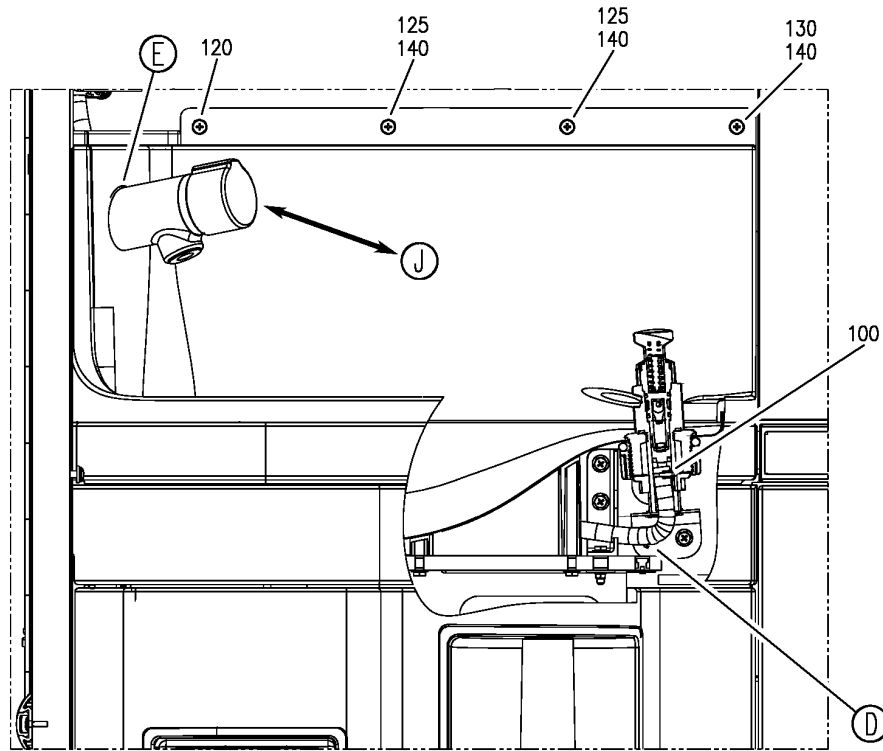

(C)

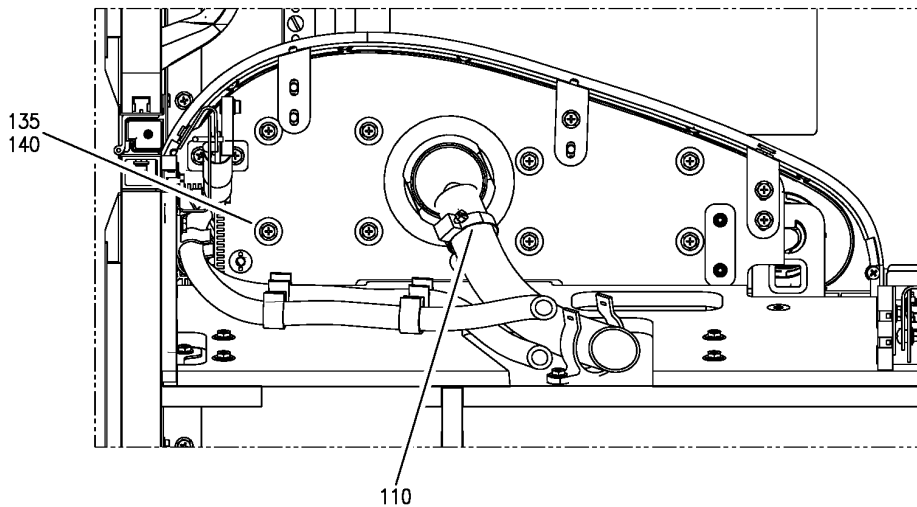

(D)

E 25401555K SHT 3 REV 273

STRUCTURE INSTL-LAV E (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 55K (SHEET 3)


**25-40-15-55K**

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

R/YR  
AUG 15/21


25-40-15-55K  
PAGE 0B

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

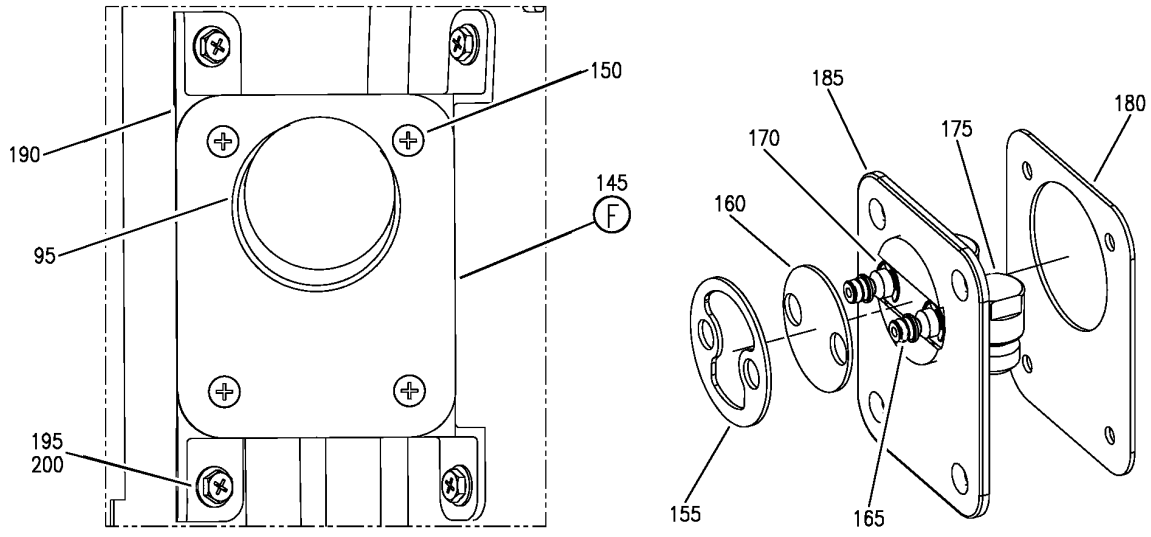

(E)

(F)

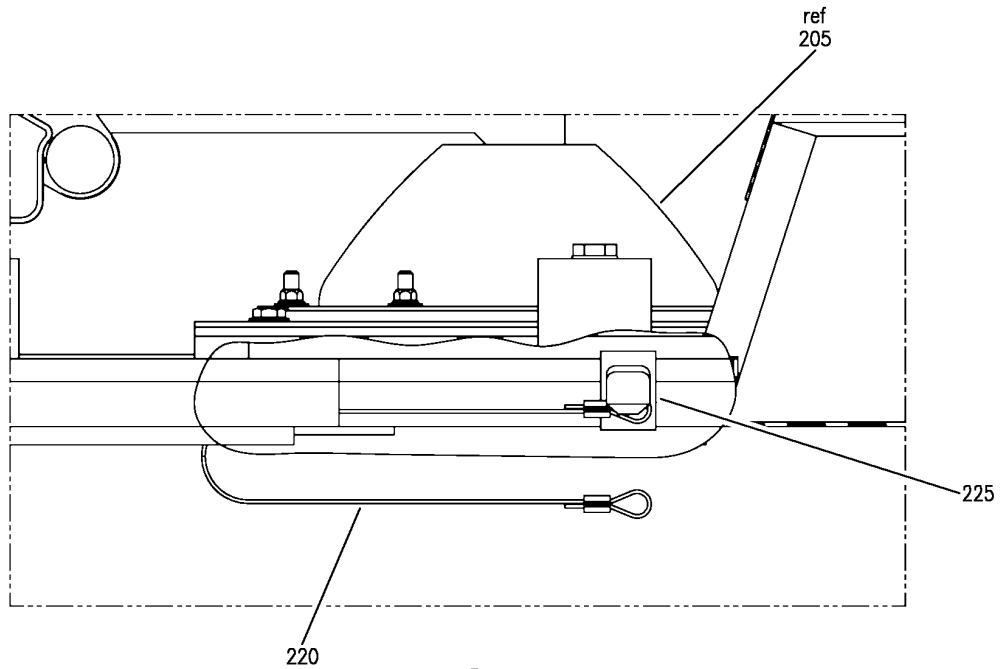

(G)

E 25401555K SHT 4 REV 273

STRUCTURE INSTL-LAV E (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 55K (SHEET 4)


**25-40-15-55K**

R/YR  
AUG 15/21


25-40-15-55K  
PAGE 0C

ECCN 9E991 BOEING PROPRIETARY - See title page for details.


**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

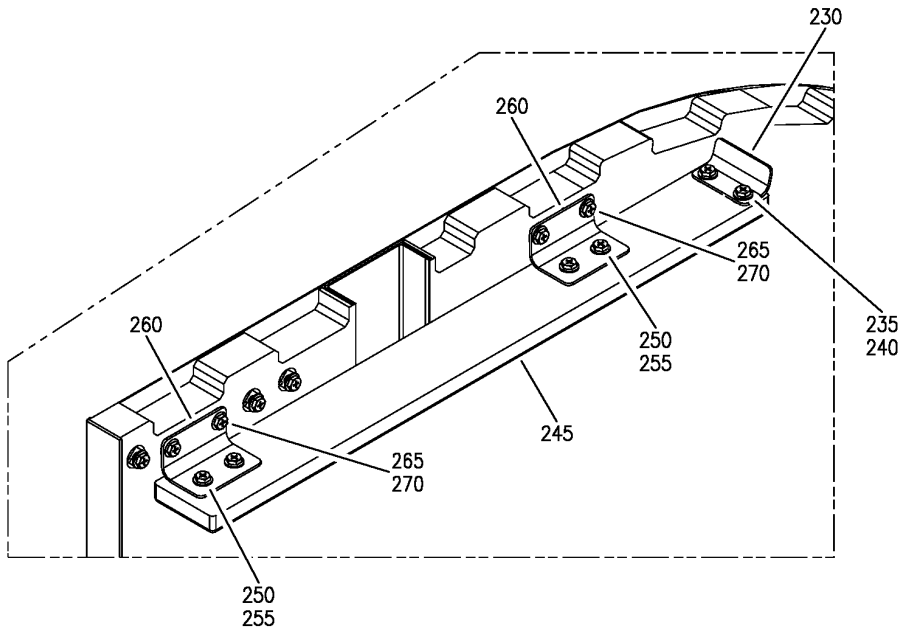

(H)

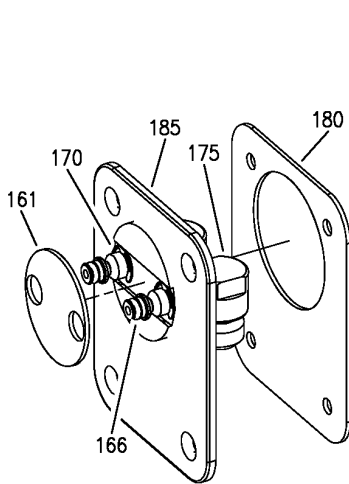

(K)

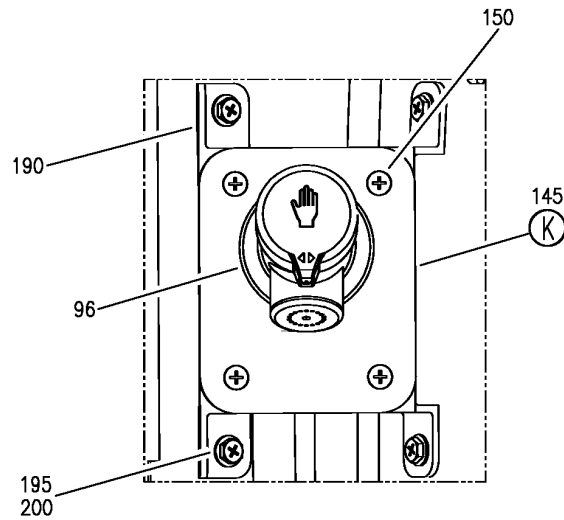

(J)

E 25401555K SHT 5 REV 273

STRUCTURE INSTL-LAV E (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 55K (SHEET 5)

**25-40-15-55K**

R Y R  
AUG 15/21

25-40-15-55K  
PAGE 0D

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

 **BOEING**  
737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER     | 1 2 3 4 5 6 7 | NOMENCLATURE                                                                                                                       | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|-----------------|---------------|------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 55K                                                     |                 |               | STRUCTURE INSTL-LAV E<br>(EQUIPMENT/FURNISHINGS<br>ONLY)                                                                           | 417437            |                      |
| - 1                                                     | 1L306051-155CH2 |               | STRUCTURE INSTL-LAV E<br>(EQUIPMENT/FURNISHINGS<br>ONLY)<br>SUPPLIER CODE:<br>V6S8D7<br>FOR NHA/OTHER SYS DET SEE:<br>25-40-15-12N | 417437            | RF                   |
| 50                                                      | 1L460050-351    |               | .LIGHT ASSY-<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>33-26-03-25X<br>ATTACHING PARTS                                    | 417437            | 1                    |
| 55                                                      | NAS1801-3-7     |               | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-7                                                                                    | 417437            | 6                    |
| 60                                                      | NAS1149D0332J   |               | .WASHER<br>-----*-----                                                                                                             | 417437            | 6                    |
| 65                                                      | 1L500403-89     |               | .SHIM-<br>SUPPLIER CODE:<br>V6S8D7                                                                                                 | 417437            | 1                    |
| 70                                                      | 1L400401-97     |               | .PANEL ASSY-<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-41-51-54M                                                       | 417437            | 1                    |
| - 75                                                    | 9L500001-003    |               | .STUD INSTL-GND ELECTRICAL<br>SUPPLIER CODE:<br>V6S8D7                                                                             | 417437            | 1                    |
| 80                                                      | NAS1801-3-10    |               | ..SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-10                                                                                  | 417437            | 1                    |
| 85                                                      | MS21042L3       |               | ..NUT<br>STANDARD SUBSTITUTION:<br>BACN11AG3                                                                                       | 417437            | 1                    |
| 90                                                      | NAS1149D0316H   |               | ..WASHER                                                                                                                           | 417437            | 3                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                 |               |                                                                                                                                    |                   |                      |

- ITEM NOT ILLUSTRATED

RYR

25-40-15-55K

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-15  
FIG. 55K  
PAGE 1  
APR 15/23


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 | NOMENCLATURE                                                                                                                                                                                                                                                                                                      | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|---------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 55K<br>95                                               | AR9472-3W1D492 |               | . FAUCET ASSY-<br>SUPPLIER CODE:<br>V80477<br>SB DATA FROM A CMM:<br>PRE SB 1L3-25-0072<br>PRE SB 1L3-25-0114<br>CONFIG CHG DATA FROM A CMM:<br>SUPSD BY 4W200301-11<br>SUPSD BY 4101800-001<br>COMPONENT MAINT MANUAL REF:<br>38-11-71<br>FOR DETAILS SEE:<br>38-11-05-18Y                                       | 417437            | 1                    |
| 95                                                      | SC4L500002-2   |               | . FAUCET ASSY-<br>SUPPLIER CODE:<br>V6S8D7<br>SB DATA FROM A CMM:<br>PRE SB 1L3-25-0072<br>PRE SB 1L3-25-0114<br>CONFIG CHG DATA FROM A CMM:<br>SUPSD BY SC4L500301-5<br>SUPSD BY SC4L500301-4<br>MISCELLANEOUS DATA:<br>ORDER AR9472-3W1D492<br><br>REF TO ADAMS RITE<br>AEROSPACE PART NUMBER<br>AR9472-3W1D492 | 417437            | 1                    |
| 96                                                      | 4W200301-11    |               | . FAUCET ASSY-<br>SUPPLIER CODE:<br>V6S8D7<br>SB DATA FROM A CMM:<br>POST SB 1L3-25-0072<br>PRE SB 1L3-25-0114<br>CONFIG CHG DATA FROM A CMM:<br>SUPSD BY 4101800-001<br>SUPERSEDES<br>AR9472-3W1D492<br>COMPONENT MAINT MANUAL REF:<br>38-10-01<br>FOR DETAILS SEE:<br>38-11-05-60C                              | 417437            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |               |                                                                                                                                                                                                                                                                                                                   |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R

25-40-15-55K

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

25-40-15  
 FIG. 55K  
 PAGE 2  
 DEC 15/24


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER  | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                                                                                                                                                                                                                                                                              | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|--------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 55K<br>96                                               | SC4L500301-4 | . FAUCET ASSY-<br>SUPPLIER CODE:<br>V6S8D7<br>SB DATA FROM A CMM:<br>POST SB 1L3-25-0072<br>PRE SB 1L3-25-0114<br>CONFIG CHG DATA FROM A CMM:<br>SUPSD BY SC4L500301-5<br>SUPERSEDES SC4L500002-2<br>MISCELLANEOUS DATA:<br>ORDER 4W200301-11<br>COMPONENT MAINT MANUAL REF:<br>38-10-01<br>OPTIONAL PART:<br>4W200301-11<br>V6S8D7<br>FOR DETAILS SEE:<br>38-11-05-60C | 417437            | 1                    |
| 96                                                      | 4101800-001  | . FAUCET ASSY-<br>SUPPLIER CODE:<br>V5E3E9<br>SB DATA FROM A CMM:<br>POST SB 1L3-25-0114<br>CONFIG CHG DATA FROM A CMM:<br>SUPERSEDES<br>AR9472-3W1D492<br>SUPERSEDES 4W200301-11<br>COMPONENT MAINT MANUAL REF:<br>38-10-03<br>FOR DETAILS SEE:<br>38-11-05-60E                                                                                                        | 417437            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |              |                                                                                                                                                                                                                                                                                                                                                                         |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R

25-40-15-55K

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

25-40-15  
 FIG. 55K  
 PAGE 3  
 AUG 15/24


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                     | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 55K<br>96                                               | SC4L500301-5   | . FAUCET ASSY-<br>SUPPLIER CODE:<br>V6S8D7<br>FUNCTIONAL DESCRIPTION:<br>ASSEMBLY ALLOWS<br>DISPENSING OF POTABLE<br>WATER IN THE LAVATORY<br>SINK.<br>SB DATA FROM A CMM:<br>POST SB 1L3-25-0114<br>CONFIG CHG DATA FROM A CMM:<br>SUPERSEDES SC4L500002-2<br>SUPERSEDES SC4L500301-4<br>MISCELLANEOUS DATA:<br>ORDER 4101800-001<br><br>SC4L500301-5 IS AN<br>EQUIVALENT P/N FOR THE<br>4101800-001 FAUCET WHICH<br>IS COVERED BY CMM<br>38-10-03.<br>COMPONENT MAINT MANUAL REF:<br>38-10-03<br>OPTIONAL PART:<br>4101800-001<br>V5E3E9<br>FOR DETAILS SEE:<br>38-11-05-60E | 417437            | 1                    |
| 110                                                     | NAS1922-0125-3 | . CLAMP                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                        | 417437            | 1                    |
| 115                                                     | 1L460050-267   | . SINK ASSY-<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-41-11-26G<br>ATTACHING PARTS                                                                                                                                                                                                                                                                                                                                                                                                                                                                                | 417437            | 1                    |
| 120                                                     | NAS514P1032-4  | . SCREW                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                        | 417437            | 1                    |
| 125                                                     | NAS514P1032-5  | . SCREW                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                        | 417437            | 2                    |
| 130                                                     | NAS514P1032-6  | . SCREW                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                        | 417437            | 1                    |
| 135                                                     | NAS1801-3-9    | . SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-9                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                               | 417437            | 8                    |
| 140                                                     | NAS1149D0332J  | . WASHER<br>-----*-----                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                        | 417437            | AR                   |
| 145                                                     | 77586-1        | . PLATE ASSY-FAUCET MTG<br>SUPPLIER CODE:<br>V80477<br>COMPONENT MAINT MANUAL REF:<br>38-11-80                                                                                                                                                                                                                                                                                                                                                                                                                                                                                 | 417437            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R

25-40-15-55K

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-15  
 FIG. 55K  
 PAGE 4  
 DEC 15/24




**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER   | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                                                                                 | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|---------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 55K<br>145                                              | SC4L500002-3  | .PLATE ASSY-FAUCET MTG<br>SUPPLIER CODE:<br>V6S8D7<br>MISCELLANEOUS DATA:<br>ORDER 77586-1<br><br>REF TO ADAMS RITE<br>AEROSPACE PART NUMBER<br>77586-1<br>ATTACHING PARTS | 417437            | 1                    |
| 150                                                     | NAS514P1032-9 | .SCREW<br>-----*-----                                                                                                                                                      | 417437            | 4                    |
| 155                                                     | 77593-1       | ..GASKET-<br>SUPPLIER CODE:<br>V80477<br>SB DATA FROM A CMM:<br>PRE SB 1L3-25-0072                                                                                         | 417437            | 1                    |
| 160                                                     | 77644-1       | ..GASKET-<br>SUPPLIER CODE:<br>V80477<br>SB DATA FROM A CMM:<br>PRE SB 1L3-25-0072                                                                                         | 417437            | 1                    |
| 161                                                     | 4W500301-31   | ..GASKET-<br>SUPPLIER CODE:<br>V6S8D7<br>SB DATA FROM A CMM:<br>POST SB 1L3-25-0072<br>POST SB 1L3-25-0114                                                                 | 417437            | 1                    |
| 165                                                     | 20166-007     | ..PACKING-<br>SUPPLIER CODE:<br>V80477<br>SB DATA FROM A CMM:<br>PRE SB 1L3-25-0072<br>MISCELLANEOUS DATA:<br>ORDER LCCS14-007B                                            | 417437            | 2                    |
| 165                                                     | LCCS14-007B   | ..PACKING-<br>SUPPLIER CODE:<br>V6S8D7<br>TRUE PART NUMBER:<br>LCCS-14-007B<br>SB DATA FROM A CMM:<br>POST SB 1L3-25-0072<br>POST SB 1L3-25-0114                           | 417437            | 2                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |               |                                                                                                                                                                            |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R

25-40-15-55K

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

25-40-15  
 FIG. 55K  
 PAGE 5  
 APR 15/25

 **BOEING**  
737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER   | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                                                       | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|---------------|--------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 55K<br>166                                              | LCCS14-007B   | ..PACKING-<br>SUPPLIER CODE:<br>V6S8D7<br>TRUE PART NUMBER:<br>LCCS-14-007B<br>SB DATA FROM A CMM:<br>POST SB 1L3-25-0072<br>POST SB 1L3-25-0114 | 417437            | 2                    |
| 170                                                     | 20058-31      | ..RING-<br>SUPPLIER CODE:<br>V80477                                                                                                              | 417437            | 2                    |
| 175                                                     | 77592-1       | ..FITTING-<br>SUPPLIER CODE:<br>V80477                                                                                                           | 417437            | 2                    |
| 180                                                     | 77599-1       | ..GASKET-<br>SUPPLIER CODE:<br>V80477                                                                                                            | 417437            | 1                    |
| 185                                                     | 77585-1       | ..PLATE-<br>SUPPLIER CODE:<br>V80477                                                                                                             | 417437            | 1                    |
| 190                                                     | 4W400401-6    | .BRACKET-FAUCET MTG<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                                                                               | 417437            | 1                    |
| 195                                                     | NAS1801-3-6   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                                                                                                  | 417437            | 4                    |
| 200                                                     | NAS1149D0332J | .WASHER<br>-----*-----                                                                                                                           | 417437            | 4                    |
| 205                                                     | 4L400401-25   | .PLATE ASSY-CLOSEOUT<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-41-11-40D<br>ATTACHING PARTS                                          | 417437            | 1                    |
| 210                                                     | NAS1801-3-11  | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-11                                                                                                 | 417437            | 4                    |
| 215                                                     | NAS1149D0332J | .WASHER<br>-----*-----                                                                                                                           | 417437            | 4                    |
| 220                                                     | 4595339-012   | .LANYARD-<br>SUPPLIER CODE:<br>V16827                                                                                                            | 417437            | 1                    |
| 225                                                     | LWC19AC14     | .CLIP-ADHESIVE BACKED<br>SUPPLIER CODE:<br>V06383<br>TRUE PART NUMBER:<br>LWC19-A-C14                                                            | 417437            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |               |                                                                                                                                                  |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R

25-40-15-55K

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-15  
FIG. 55K  
PAGE 6  
APR 15/25


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER   | 1 2 3 4 5 6 7 | NOMENCLATURE                                                      | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|---------------|---------------|-------------------------------------------------------------------|-------------------|----------------------|
| 55K<br>230                                              | 4L500403-53   |               | .BRACKET-<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS          | 417437            | 1                    |
| 235                                                     | NAS1801-3-6   |               | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                   | 417437            | 2                    |
| 240                                                     | NAS1149D0332J |               | .WASHER<br>-----*-----                                            | 417437            | 2                    |
| 245                                                     | 4L400403-12   |               | .PANEL-<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS            | 417437            | 1                    |
| 250                                                     | NAS1801-3-6   |               | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                   | 417437            | 4                    |
| 255                                                     | NAS1149D0332J |               | .WASHER<br>-----*-----                                            | 417437            | 4                    |
| 260                                                     | 4L500403-55   |               | .BRACKET-<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS          | 417437            | 2                    |
| 265                                                     | NAS1801-3-6   |               | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                   | 417437            | 4                    |
| 270                                                     | NAS1149D0332K |               | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0332J<br>-----*----- | 417437            | 4                    |
| - 275                                                   | 9L500001-003  |               | .STUD INSTL-GND ELECTRICAL<br>SUPPLIER CODE:<br>V6S8D7            | 417437            | 3                    |
| 280                                                     | NAS1801-3-10  |               | ..SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-10                 | 417437            | 1                    |
| 285                                                     | MS21042L3     |               | ..NUT<br>STANDARD SUBSTITUTION:<br>BACN11AG3                      | 417437            | 1                    |
| 290                                                     | NAS1149D0316H |               | ..WASHER                                                          | 417437            | 3                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |               |               |                                                                   |                   |                      |

- ITEM NOT ILLUSTRATED


R Y R

25-40-15-55K

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-15  
FIG. 55K  
PAGE 7  
APR 15/25

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

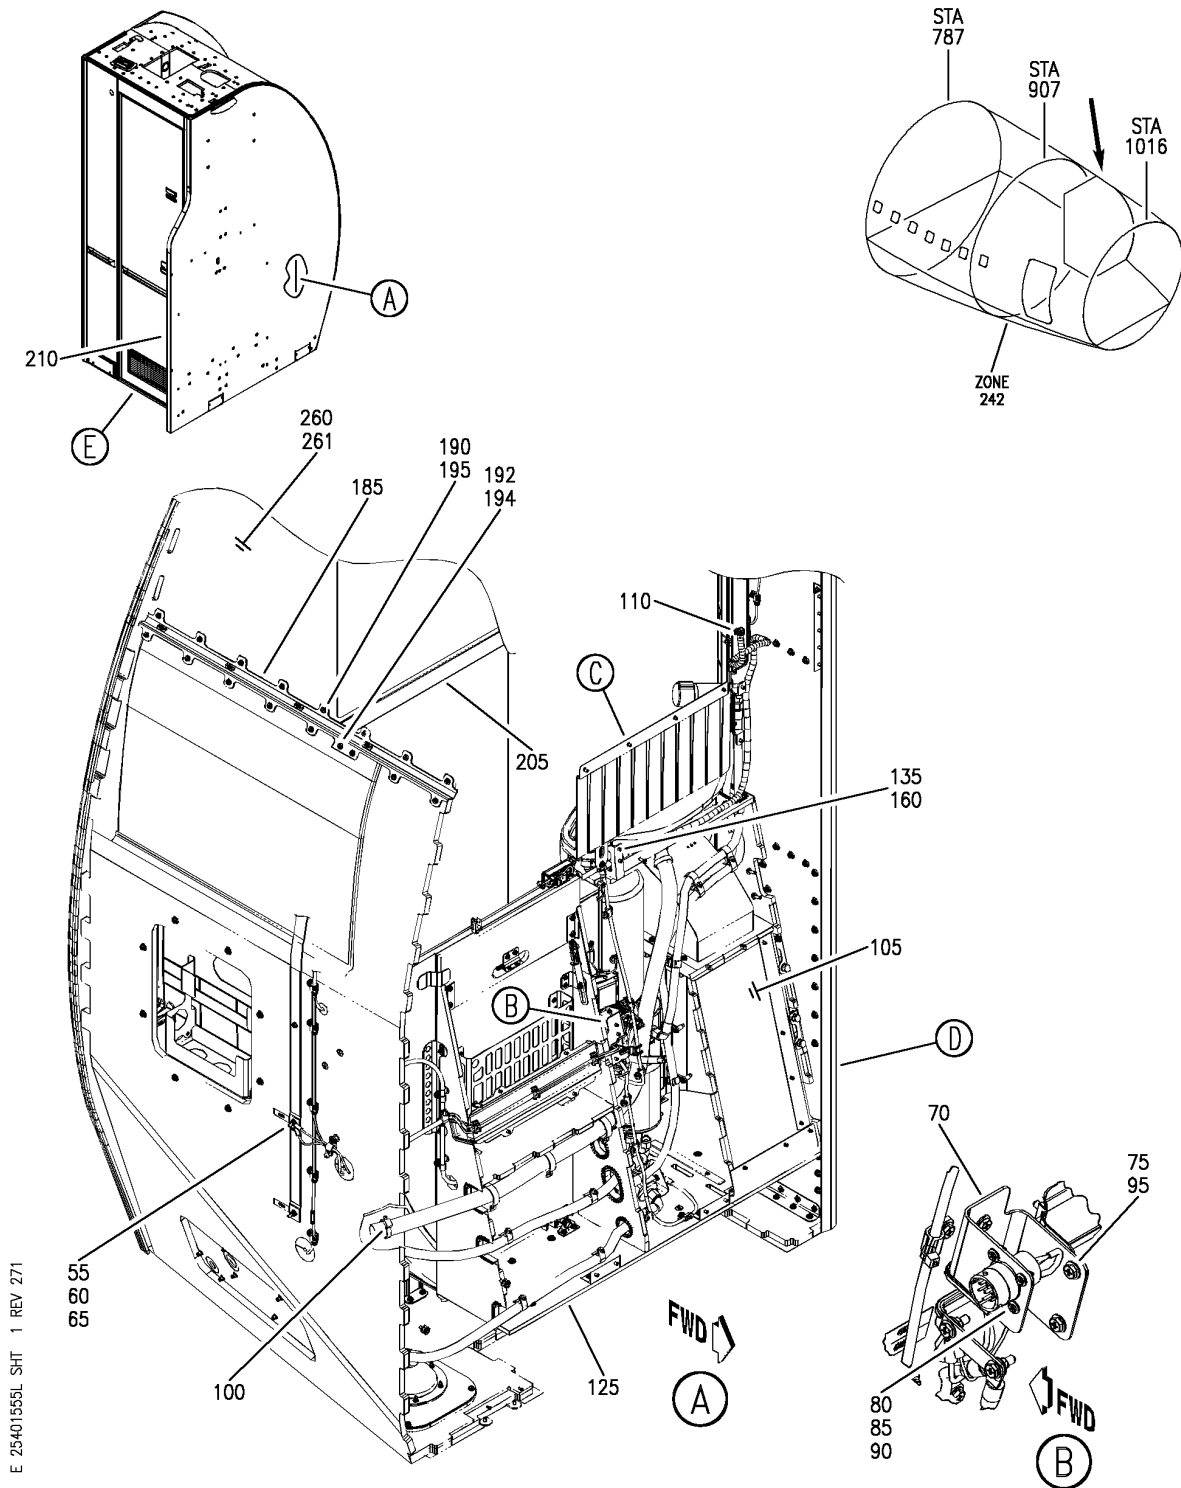

E 25401555L SHT 1 REV 271

STRUCTURE INSTL-LAV E  
FIGURE 55L (SHEET 1)


**25-40-15-55L**

R/YR  
OCT 15/20

25-40-15-55L  
PAGE 0

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

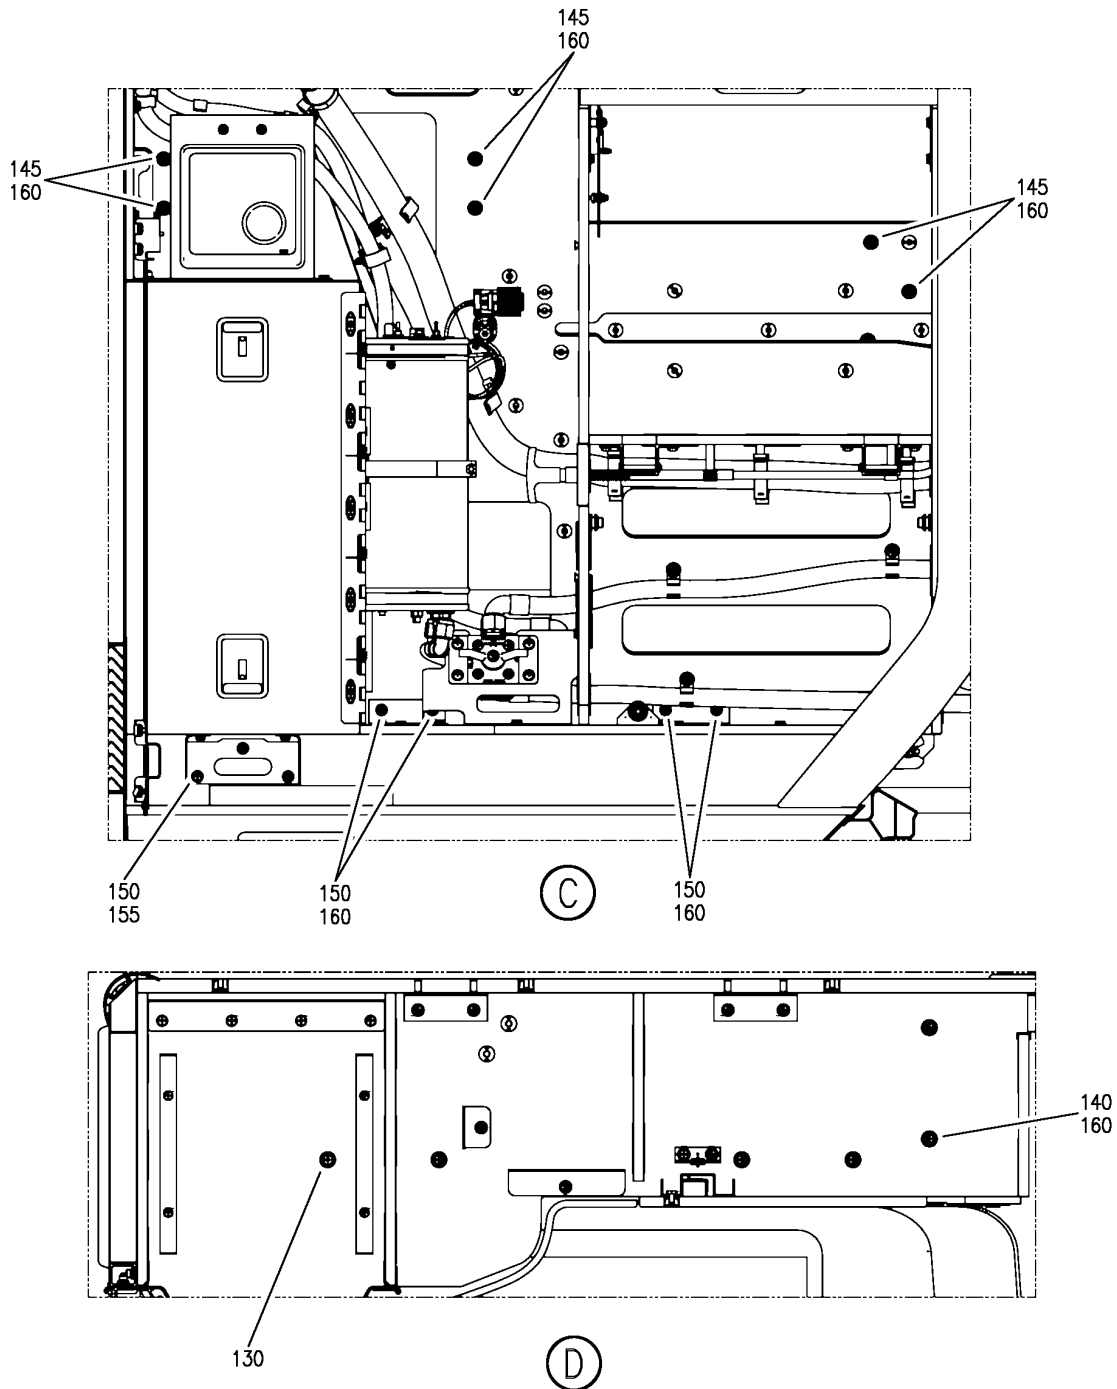

E 25401555L SHT 2 REV 291

STRUCTURE INSTL-LAV E  
FIGURE 55L (SHEET 2)


**25-40-15-55L**

R Y R  
O C T 15 / 20

25-40-15-55L  
PAGE 0A

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

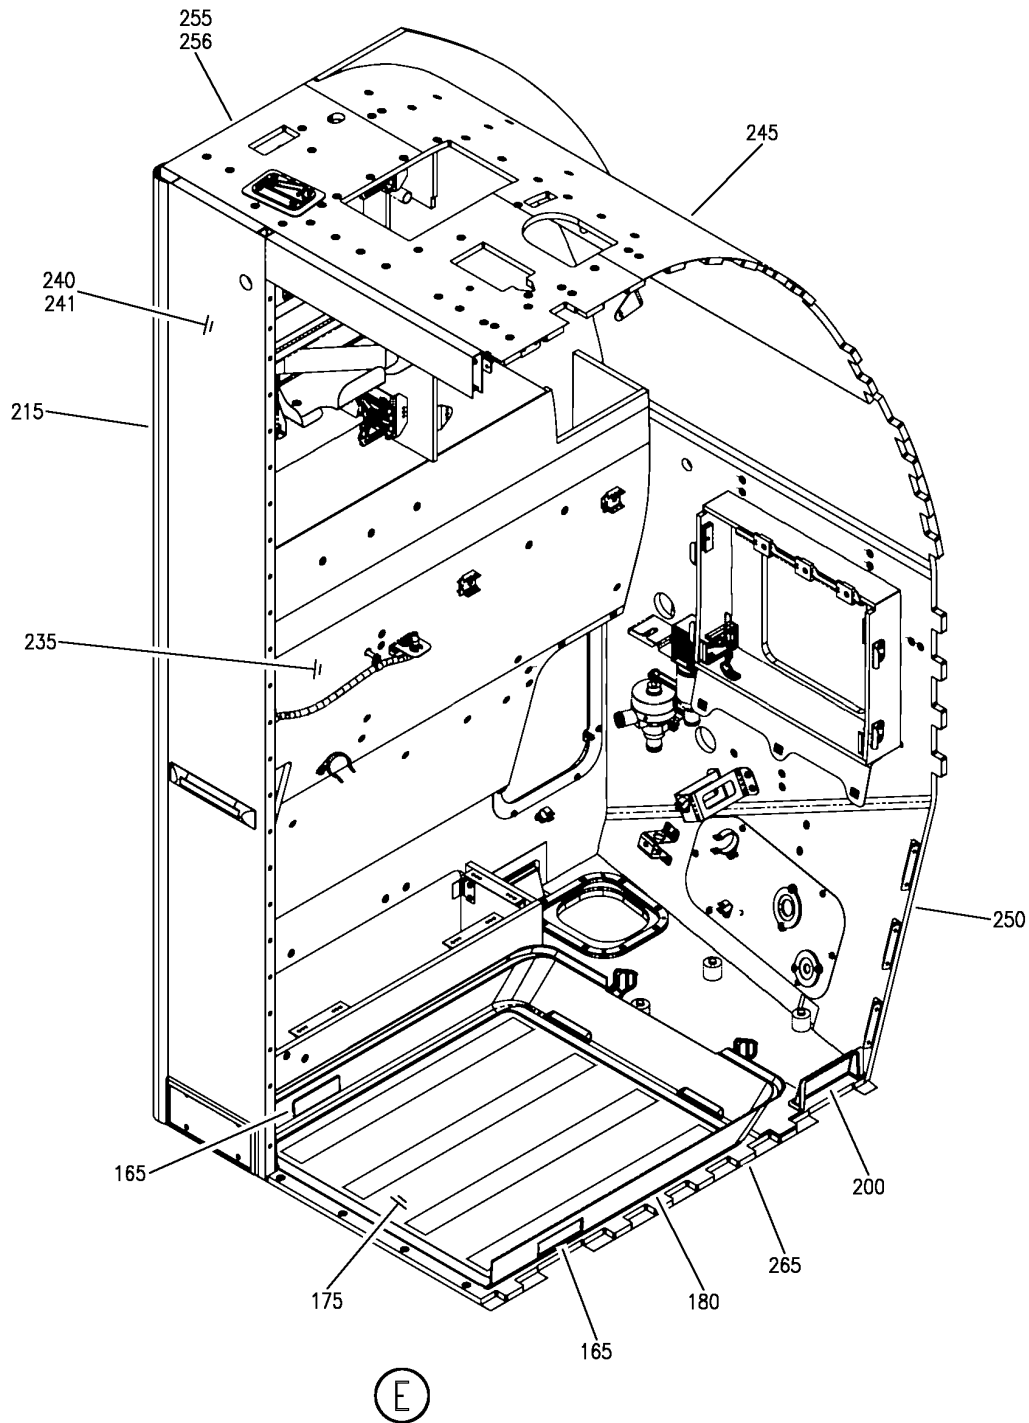

E 25401555L SHT 3 REV 243

STRUCTURE INSTL-LAV E  
FIGURE 55L (SHEET 3)

**25-40-15-55L**

R Y R  
O C T 15 / 20

25-40-15-55L  
PAGE 0B

ECCN 9E991 BOEING PROPRIETARY – See title page for details.


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER     | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                                  | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|-----------------|-----------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 55L                                                     |                 |                                                                                                                             |                   |                      |
| - 1                                                     | 1L306051-155CH3 | STRUCTURE INSTL-LAV E<br>STRUCTURE INSTL-LAV E<br>SUPPLIER CODE:<br>V6S8D7<br>FOR NHA SEE:<br>25-40-15-12N                  | 417437<br>417437  | RF                   |
| - 50                                                    | 9L500001-051    | .STRAP INSTL-GND ELECTRICAL<br>SUPPLIER CODE:<br>V6S8D7                                                                     | 417437            | 1                    |
| 55                                                      | MS21042L3       | ..NUT<br>STANDARD SUBSTITUTION:<br>BACN11AG3                                                                                | 417437            | 1                    |
| 60                                                      | NAS1149D0332H   | ..WASHER                                                                                                                    | 417437            | 2                    |
| 65                                                      | 9L500001-201    | ..STANDOFF-HEXAGONAL<br>SUPPLIER CODE:<br>V6S8D7                                                                            | 417437            | 1                    |
| 70                                                      | 1L500401-194    | .BRACKET-DISC.<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                                                               | 417437            | 1                    |
| 75                                                      | NAS1801-3-5     | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-5                                                                             | 417437            | 5                    |
| 80                                                      | NAS1801-04-6    | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN04-6                                                                            | 417437            | 4                    |
| 85                                                      | MS21042L04      | .NUT<br>STANDARD SUBSTITUTION:<br>BACN11AG04                                                                                | 417437            | 4                    |
| 90                                                      | NAS1149DN432J   | .WASHER                                                                                                                     | 417437            | 8                    |
| 95                                                      | NAS1149D0332J   | .WASHER<br>-----*-----                                                                                                      | 417437            | 5                    |
| 100                                                     | NAS1922-0125-3  | .CLAMP                                                                                                                      | 417437            | 1                    |
| 105                                                     | 1L400101-67     | .CAN ASSY-WASTE<br>SUPPLIER CODE:<br>V6S8D7                                                                                 | 417437            | 1                    |
| - 107                                                   | SL00201         | ..GROMMET-<br>SUPPLIER CODE:<br>VOHESO<br>MISCELLANEOUS DATA:<br>ORDER LCEE000022                                           | 417437            | AR                   |
| - 107                                                   | LCEE000022      | ..GROMMET-<br>SUPPLIER CODE:<br>V6S8D7<br>MISCELLANEOUS DATA:<br>DEVICE TECHNOLOGIES<br>INCORPORATED PART NUMBER<br>SL00201 | 417437            | AR                   |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                 |                                                                                                                             |                   |                      |

- ITEM NOT ILLUSTRATED

RYR

25-40-15-55L

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-15  
FIG. 55L  
PAGE 1  
APR 15/25


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                                                                                                                                                       | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 55L<br>- 120                                            | MS3367-5-9     | .STRAP<br>STANDARD SUBSTITUTION:<br>BACS38K5                                                                                                                                                                                                     | 417437            | AR                   |
| 125                                                     | 1L406500-323   | .VANITY INSTL-LWR<br>SUPPLIER CODE:<br>V6S8D7<br>USED ON:<br>1L306051-155CH3<br>FUNCTIONAL REFERENCE:<br>EQUIPMENT/FURNISHINGS<br>FOR DETAILS SEE<br>25-41-51-54N<br>PLACARDS AND MARKINGS<br>FOR DETAILS SEE<br>11-32-05-52R<br>ATTACHING PARTS | 417437            | 1                    |
| 130                                                     | NAS514P1032-12 | .SCREW                                                                                                                                                                                                                                           | 417437            | 1                    |
| 135                                                     | NAS1801-3-5    | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-5                                                                                                                                                                                                  | 417437            | 2                    |
| 140                                                     | NAS1801-3-13   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-13                                                                                                                                                                                                 | 417437            | 5                    |
| 145                                                     | NAS1801-3-11   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-11                                                                                                                                                                                                 | 417437            | 6                    |
| 150                                                     | NAS1801-3-6    | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                                                                                                                                                                                                  | 417437            | 7                    |
| 155                                                     | NAS1149D0316K  | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J                                                                                                                                                                                               | 417437            | 3                    |
| 160                                                     | NAS1149D0332J  | .WASHER<br>-----*-----                                                                                                                                                                                                                           | 417437            | 17                   |
| 165                                                     | 1L500407-207   | .PLATE-COVER<br>SUPPLIER CODE:<br>V6S8D7                                                                                                                                                                                                         | 417437            | 2                    |
| - 170                                                   | 1L400407-68    | .PAN ASSY-FLOOR<br>SUPPLIER CODE:<br>V6S8D7                                                                                                                                                                                                      | 417437            | 1                    |
| 175                                                     | 1L400407-117   | ..MAT-<br>SUPPLIER CODE:<br>V6S8D7                                                                                                                                                                                                               | 417437            | 1                    |
| 180                                                     | 1L400407-16    | ..PAN-<br>SUPPLIER CODE:<br>V6S8D7                                                                                                                                                                                                               | 417437            | 1                    |
| 185                                                     | 1L400419-154   | .EXTRUSION-<br>SUPPLIER CODE:<br>V6S8D7                                                                                                                                                                                                          | 417437            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |                                                                                                                                                                                                                                                  |                   |                      |

- ITEM NOT ILLUSTRATED

R Y R

25-40-15-55L

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-15  
 FIG. 55L  
 PAGE 2  
 JUN 15/24




**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER   | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                      | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|---------------|-----------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 55 L                                                    |               | ATTACHING PARTS                                                                                                 |                   |                      |
| 190                                                     | NAS1801-3-6   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                                                                 | 417437            | 16                   |
| 192                                                     | NAS1801-3-8   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-8                                                                 | 417437            | 1                    |
| 194                                                     | NAS1149F0332P | .WASHER                                                                                                         | 417437            | 1                    |
| 195                                                     | NAS1149D0332K | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0332J<br>-----*-----                                               | 417437            | 16                   |
| 200                                                     | 1L500109-347  | .CLOSEOUT-FL00R<br>SUPPLIER CODE:<br>V6S8D7                                                                     | 417437            | 2                    |
| 205                                                     | 1L500413-131  | .TRIM-AFT WALL CLOSEOUT<br>SUPPLIER CODE:<br>V6S8D7                                                             | 417437            | 1                    |
| 210                                                     | 1L500409-815  | .TRIM-EDGE<br>SUPPLIER CODE:<br>V6S8D7                                                                          | 417437            | 1                    |
| 215                                                     | 1L500419-299  | .TRIM-FLAT WALL<br>SUPPLIER CODE:<br>V6S8D7                                                                     | 417437            | 1                    |
| - 220                                                   | 1L500709-661  | .TRIM-HEADER<br>SUPPLIER CODE:<br>V6S8D7                                                                        | 417437            | 2                    |
| - 225                                                   | 415U9010-82   | .EXTRUSION-<br>MISCELLANEOUS DATA:<br>ORDER LCPE000013                                                          | 417437            | AR                   |
| - 225                                                   | LCPE000013    | .EXTRUSION-<br>SUPPLIER CODE:<br>V6S8D7<br>MISCELLANEOUS DATA:<br>THE BOEING COMPANY PART<br>NUMBER 415U9010-82 | 417437            | AR                   |
| - 230                                                   | MS21266-2N    | .GROMMET-<br>STANDARD SUBSTITUTION:<br>BACG20Z-B001275<br>MISCELLANEOUS DATA:<br>ORDER LCEE000003               | 417437            | AR                   |
| - 230                                                   | LCEE000003    | .GROMMET-<br>SUPPLIER CODE:<br>V6S8D7                                                                           | 417437            | AR                   |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |               |                                                                                                                 |                   |                      |

- ITEM NOT ILLUSTRATED

R Y R

25-40-15-55L

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-15  
 FIG. 55L  
 PAGE 3  
 JUN 15/24


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                                                                                                          | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 55L<br>235                                              | 1L460051-255   | .WALL ASSY-SPACE<br>SUPPLIER CODE:<br>V6S8D7<br>USED ON:<br>1L306051-155CH3<br>FOR DETAILS SEE:<br>25-41-40-26L                                                                                     | 417437            | 1                    |
| 240                                                     | 1L460051-303CH | .WALL ASSY-INBD<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-41-40-26M                                                                                                                     | 417437            | 1                    |
| 245                                                     | 1L460051-287   | .CEILING INSTL-UPR<br>SUPPLIER CODE:<br>V6S8D7<br>USED ON:<br>1L306051-155CH3<br>FOR DETAILS SEE:<br>25-41-45-06F                                                                                   | 417437            | 1                    |
| 250                                                     | 1L460051-305   | .WALL ASSY-OUTBD<br>SUPPLIER CODE:<br>V6S8D7<br>FUNCTIONAL REFERENCE:<br>EQUIPMENT/FURNISHINGS<br>FOR DETAILS SEE<br>25-41-40-24F<br>WATER/WASTE<br>FOR DETAILS SEE<br>38-11-08-15T<br>38-11-51-24M | 417437            | 1                    |
| 255                                                     | 1L460051-397CH | .WALL ASSY-FWD<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-41-40-26N                                                                                                                      | 417437            | 1                    |
| 260                                                     | 1L460051-423CH | .WALL ASSY-ATTENDANT<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-41-40-26Q                                                                                                                | 417437            | 1                    |
| 265                                                     | 1L460051-395   | .FLOOR ASSY-<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-41-21-18Q                                                                                                                        | 417437            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |                                                                                                                                                                                                     |                   |                      |

— ITEM NOT ILLUSTRATED


R Y R

25-40-15-55L

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

25-40-15  
FIG. 55L  
PAGE 4  
JUN 15/24

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

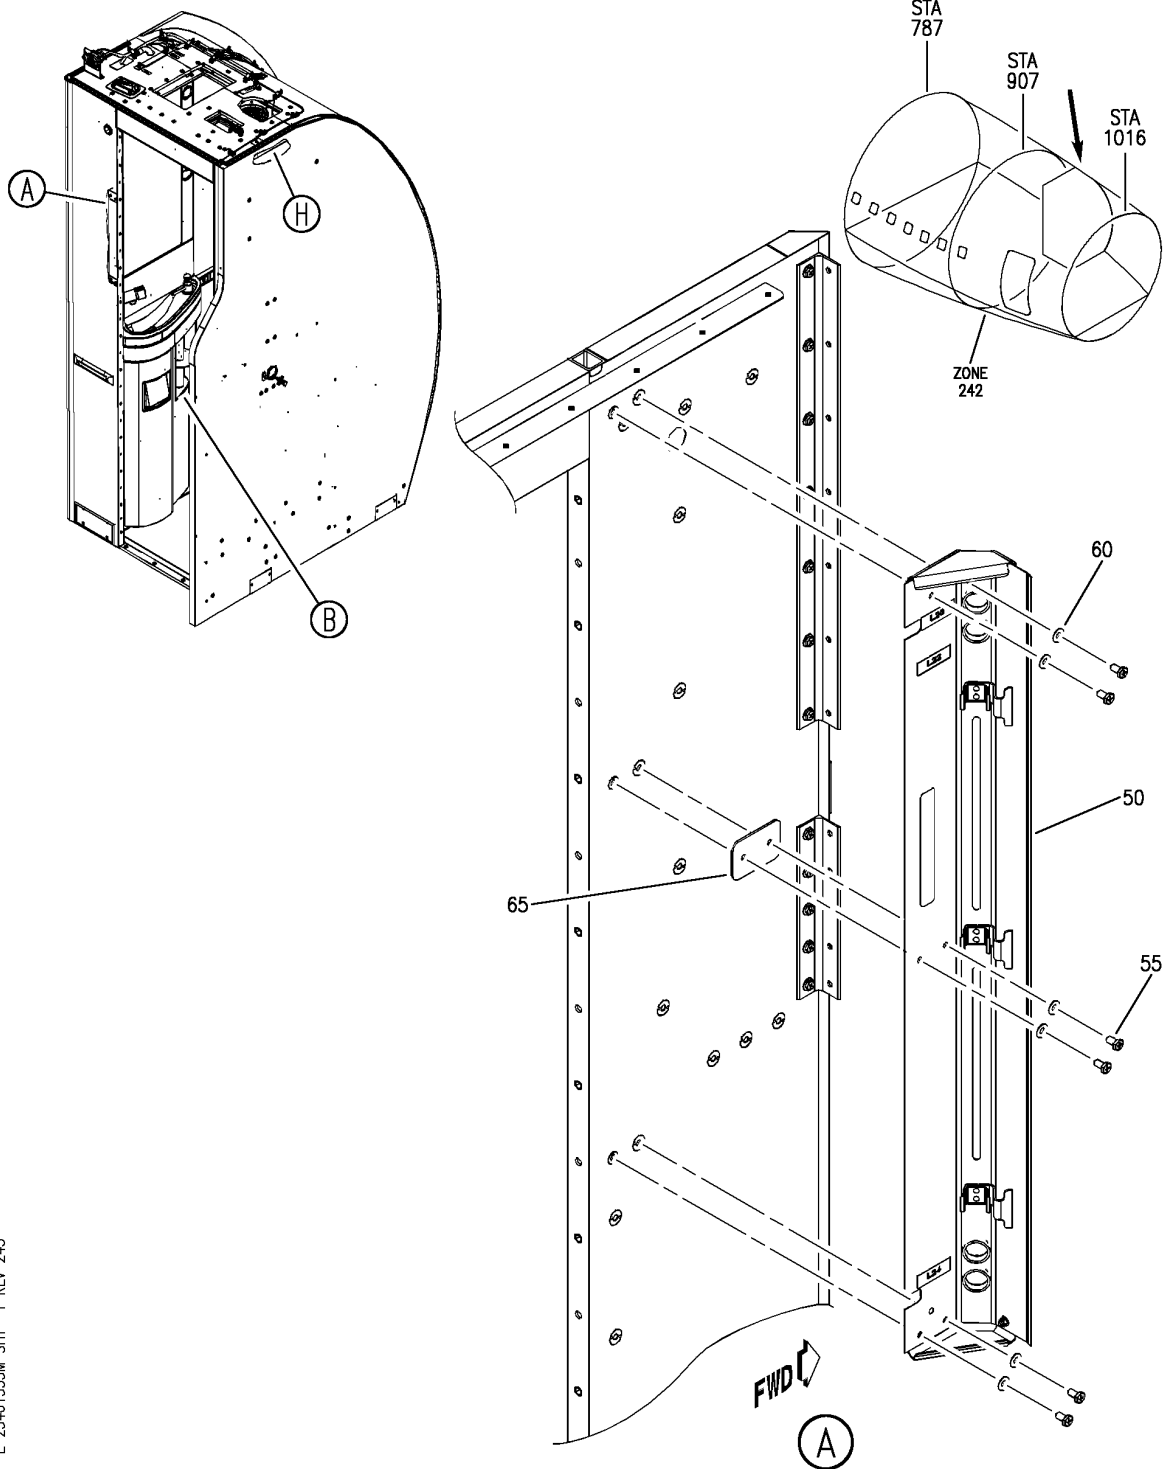

E 25401555M SHT 1 REV 245

STRUCTURE INSTL-LAV E (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 55M (SHEET 1)


**25-40-15-55M**

RJR  
AUG 15/21

25-40-15-55M  
PAGE 0

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

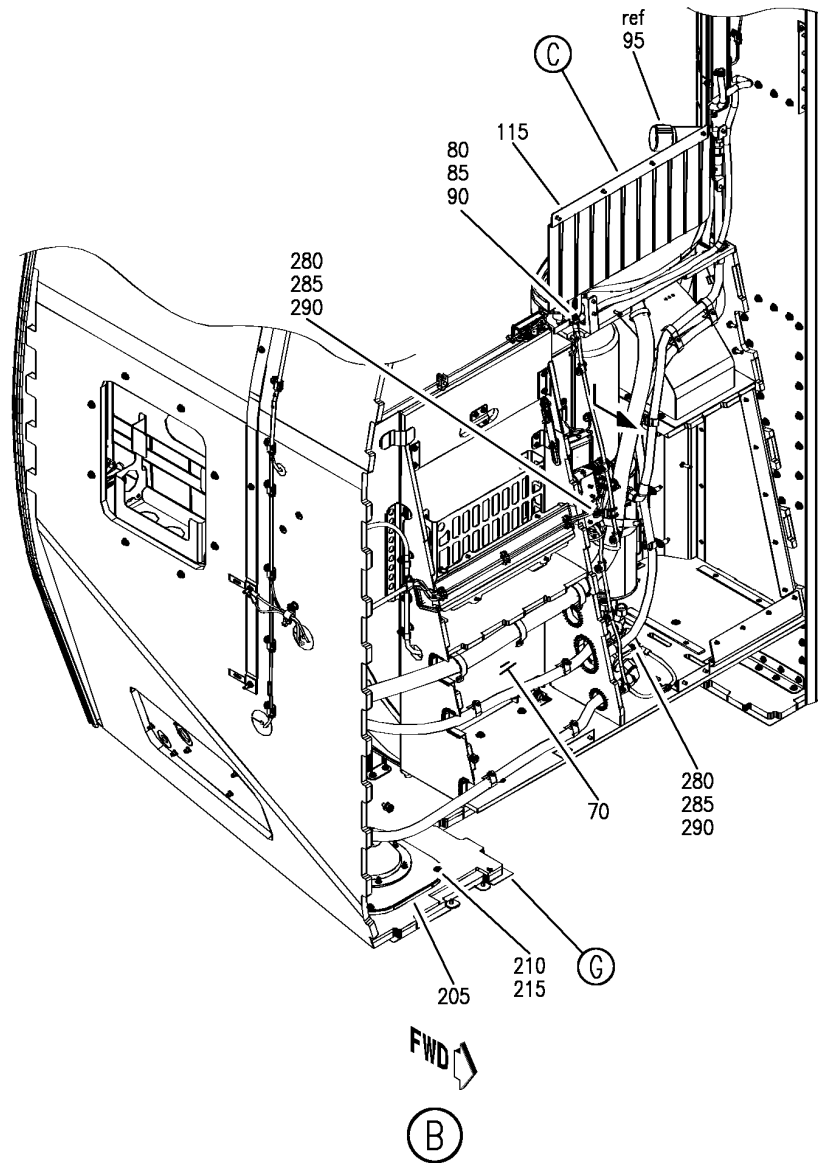

E 25401555M SHT 2 REV 273

STRUCTURE INSTL-LAV E (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 55M (SHEET 2)


**25-40-15-55M**

ECCN 9E991 BOEING PROPRIETARY - See title page for details.


R Y R  
AUG 15/21

25-40-15-55M  
PAGE 0A

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

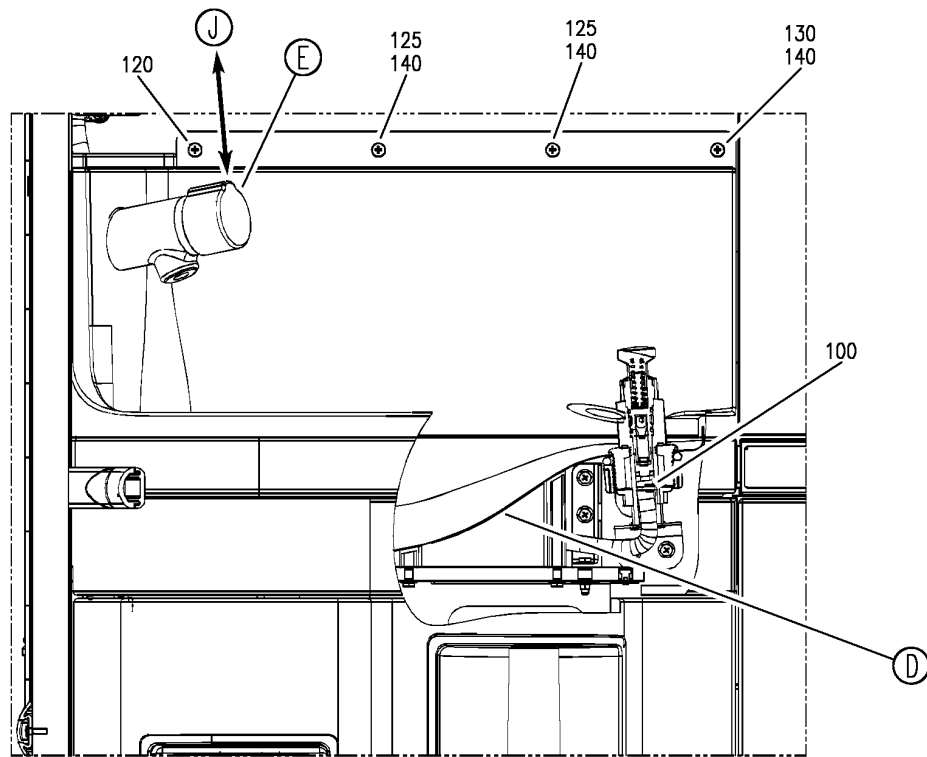

(C)

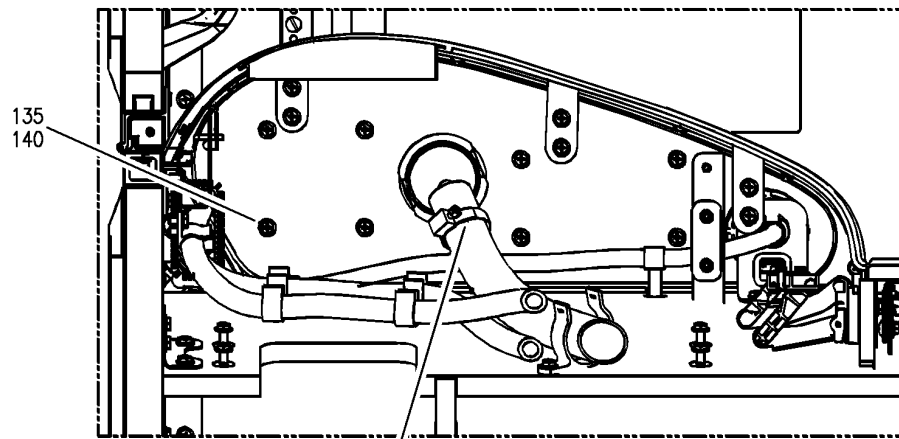

(D)

E 25401555M SHT 3 REV 273

STRUCTURE INSTL-LAV E (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 55M (SHEET 3)


**25-40-15-55M**

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

RJR  
AUG 15/21


25-40-15-55M  
PAGE 0B

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

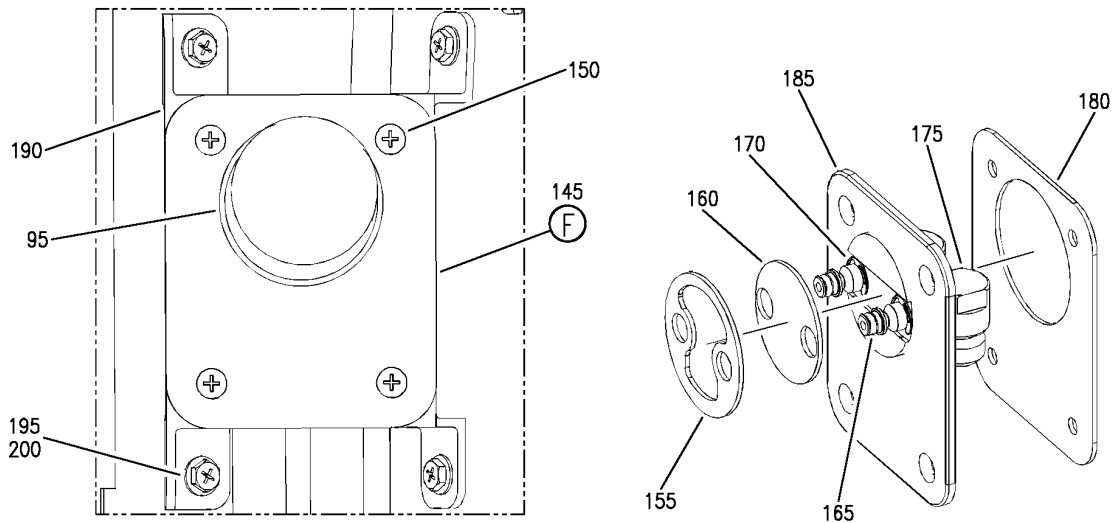

(E)

(F)

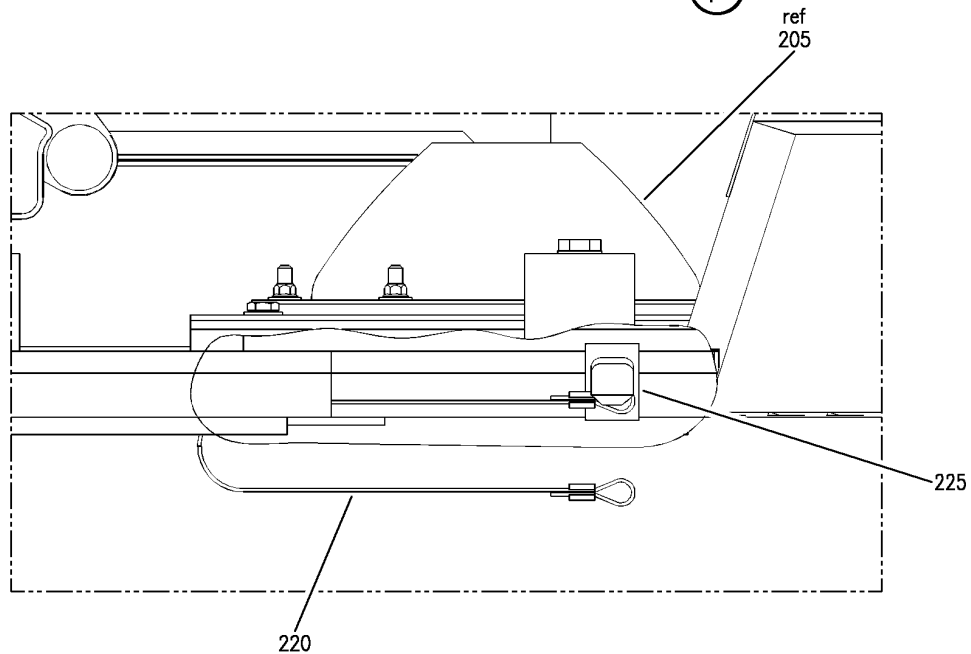

(G)

E 25401555M SHT 4 REV 273

STRUCTURE INSTL-LAV E (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 55M (SHEET 4)




**25-40-15-55M**

R/YR  
AUG 15/21

25-40-15-55M  
PAGE 0C

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

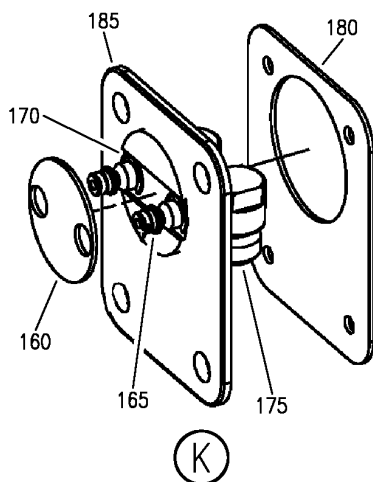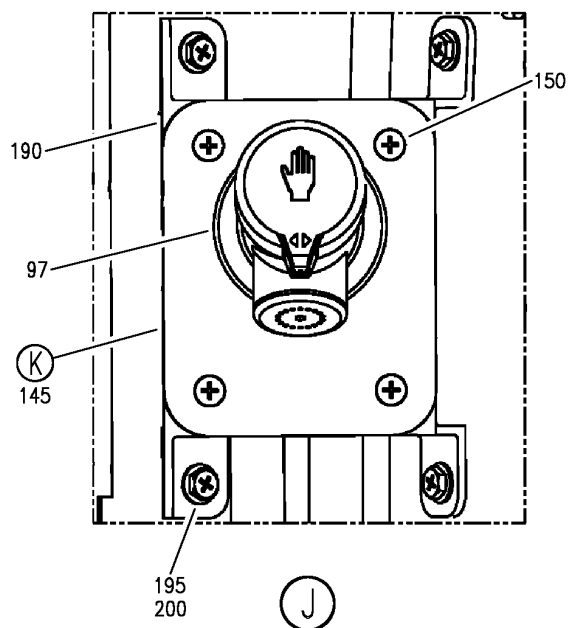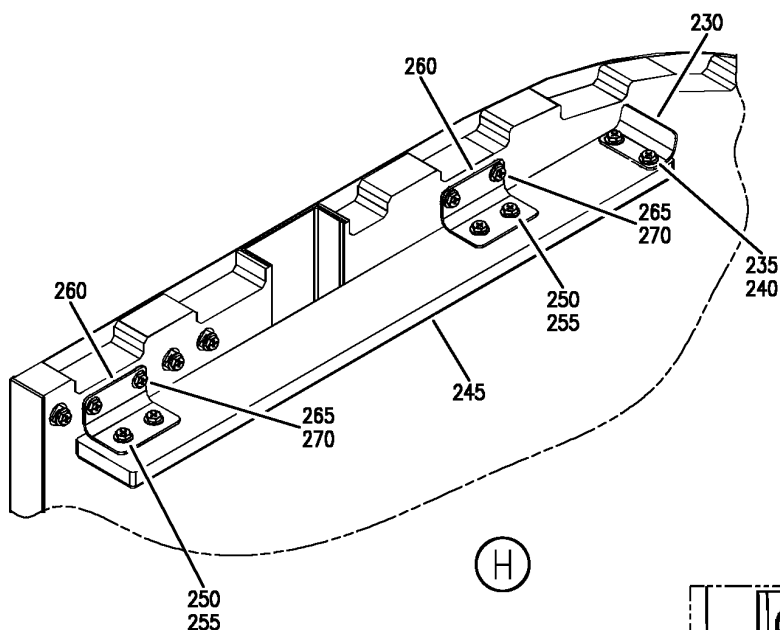

E 25401555M SHT 5 REV 273

STRUCTURE INSTL-LAV E (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 55M (SHEET 5)

**25-40-15-55M**

R Y R  
AUG 15/21

25-40-15-55M  
PAGE 0D

ECCN 9E991 BOEING PROPRIETARY - See title page for details.


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER     | 1 2 3 4 5 6 7 | NOMENCLATURE                                                                                                                       | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|-----------------|---------------|------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 55M                                                     |                 |               | STRUCTURE INSTL-LAV E<br>(EQUIPMENT/FURNISHINGS<br>ONLY)                                                                           | 438459            |                      |
| - 1                                                     | 1L306051-155EE2 |               | STRUCTURE INSTL-LAV E<br>(EQUIPMENT/FURNISHINGS<br>ONLY)<br>SUPPLIER CODE:<br>V6S8D7<br>FOR NHA/OTHER SYS DET SEE:<br>25-40-15-12S | 438459            | RF                   |
| 50                                                      | 1L460050-351    |               | .LIGHT ASSY-<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>33-26-03-25X<br>ATTACHING PARTS                                    | 438459            | 1                    |
| 55                                                      | NAS1801-3-7     |               | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-7                                                                                    | 438459            | 6                    |
| 60                                                      | NAS1149D0332J   |               | .WASHER<br>-----*-----                                                                                                             | 438459            | 6                    |
| 65                                                      | 1L500403-89     |               | .SHIM-<br>SUPPLIER CODE:<br>V6S8D7                                                                                                 | 438459            | 1                    |
| 70                                                      | 1L400401-97     |               | .PANEL ASSY-<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-41-51-54M                                                       | 438459            | 1                    |
| - 75                                                    | 9L500001-003    |               | .STUD INSTL-GND ELECTRICAL<br>SUPPLIER CODE:<br>V6S8D7                                                                             | 438459            | 1                    |
| 80                                                      | NAS1801-3-10    |               | ..SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-10                                                                                  | 438459            | 1                    |
| 85                                                      | MS21042L3       |               | ..NUT<br>STANDARD SUBSTITUTION:<br>BACN11AG3                                                                                       | 438459            | 1                    |
| 90                                                      | NAS1149D0316H   |               | ..WASHER                                                                                                                           | 438459            | 3                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                 |               |                                                                                                                                    |                   |                      |

- ITEM NOT ILLUSTRATED

RYR

25-40-15-55M

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-15  
FIG. 55M  
PAGE 1  
APR 15/23




**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 | NOMENCLATURE                                                                                                                                                                                                                                                                                               | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|---------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 55M<br>95                                               | AR9472-3W1D492 |               | . FAUCET ASSY-<br>SUPPLIER CODE:<br>V80477<br>SB DATA FROM A CMM:<br>PRE SB 1L3-25-0072<br>PRE SB 1L3-25-0114<br>CONFIG CHG DATA FROM A CMM:<br>SUPSD BY 4W200301-11<br>SUPSD BY 4101800-001<br>COMPONENT MAINT MANUAL REF:<br>38-11-71<br>FOR DETAILS SEE:<br>38-11-05-18Y                                | 438459            | 1                    |
| 95                                                      | SC4L500002-2   |               | . FAUCET ASSY-<br>SUPPLIER CODE:<br>V6S8D7<br>SB DATA FROM A CMM:<br>PRE SB 1L3-25-0072<br>PRE SB 1L3-25-0114<br>CONFIG CHG DATA FROM A CMM:<br>SUPSD BY SC4L500301-5<br>SUPSD BY SC4L500301-4<br>MISCELLANEOUS DATA:<br>ORDER AR9472-3W1D492                                                              | 438459            | 1                    |
| 97                                                      | 4W200301-11    |               | . FAUCET ASSY-<br>SUPPLIER CODE:<br>V6S8D7<br>SB DATA FROM A CMM:<br>POST SB 1L3-25-0072<br>PRE SB 1L3-25-0114<br>PRE SB 1L3-25-0120<br>CONFIG CHG DATA FROM A CMM:<br>SUPERSEDES<br>AR9472-3W1D492<br>SUPSD BY 4101800-001<br>COMPONENT MAINT MANUAL REF:<br>38-10-01<br>FOR DETAILS SEE:<br>38-11-05-60C | 438459            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |               |                                                                                                                                                                                                                                                                                                            |                   |                      |

— ITEM NOT ILLUSTRATED

RYR

25-40-15-55M

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

25-40-15  
 FIG. 55M  
 PAGE 2  
 DEC 15/24


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER  | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                                                                                                                                                                                                                                                                             | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|--------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 55M<br>97                                               | SC4L500301-4 | . FAUCET ASSY-<br>SUPPLIER CODE:<br>V6S8D7<br>SB DATA FROM A CMM:<br>PRE SB 1L3-25-0114<br>PRE SB 1L3-25-0120<br>CONFIG CHG DATA FROM A CMM:<br>SUPSD BY SC4L500301-5<br>SUPERSEDES SC4L500002-2<br>MISCELLANEOUS DATA:<br>ORDER 4W200301-11<br>COMPONENT MAINT MANUAL REF:<br>38-10-01<br>OPTIONAL PART:<br>4W200301-11<br>V6S8D7<br>FOR DETAILS SEE:<br>38-11-05-60C | 438459            | 1                    |
| - 99                                                    | 4101800-001  | . FAUCET ASSY-<br>SUPPLIER CODE:<br>V5E3E9<br>SB DATA FROM A CMM:<br>POST SB 1L3-25-0114<br>POST SB 1L3-25-0120<br>CONFIG CHG DATA FROM A CMM:<br>SUPERSEDES<br>AR9472-3W1D492<br>SUPERSEDES 4W200301-11<br>COMPONENT MAINT MANUAL REF:<br>38-10-03<br>FOR DETAILS SEE:<br>38-11-05-60E                                                                                | 438459            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |              |                                                                                                                                                                                                                                                                                                                                                                        |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R

25-40-15-55M

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

25-40-15  
 FIG. 55M  
 PAGE 3  
 FEB 15/22


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM | PART NUMBER    | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                               | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|-------------|----------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 55M<br>- 99 | SC4L500301-5   | . FAUCET ASSY-<br>SUPPLIER CODE:<br>V6S8D7<br>FUNCTIONAL DESCRIPTION:<br>ASSEMBLY ALLOWS<br>DISPENSING OF POTABLE<br>WATER IN THE LAVATORY<br>SINK.<br>SB DATA FROM A CMM:<br>POST SB 1L3-25-0114<br>POST SB 1L3-25-0120<br>CONFIG CHG DATA FROM A CMM:<br>SUPERSEDES<br>SC4L500002-2<br>SUPERSEDES SC4L500301-4<br>MISCELLANEOUS DATA:<br>ORDER 4101800-001<br><br>SC4L500301-5 IS AN<br>EQUIVALENT P/N FOR THE<br>4101800-001 FAUCET WHICH<br>IS COVERED BY CMM<br>38-10-03.<br>COMPONENT MAINT MANUAL REF:<br>38-10-03<br>OPTIONAL PART:<br>4101800-001<br>V5E3E9<br>FOR DETAILS SEE:<br>38-11-05-60E | 438459            | 1                    |
| 110         | NAS1922-0125-3 | . CLAMP                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                  | 438459            | 1                    |
| 115         | 1L460050-267   | . SINK ASSY-<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-41-11-26G<br>ATTACHING PARTS                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                          | 438459            | 1                    |
| 120         | NAS514P1032-4  | . SCREW                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                  | 438459            | 1                    |
| 125         | NAS514P1032-5  | . SCREW                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                  | 438459            | 2                    |
| 130         | NAS514P1032-6  | . SCREW                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                  | 438459            | 1                    |
| 135         | NAS1801-3-9    | . SCREW                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                  | 438459            | 8                    |
| 140         | NAS1149D0332J  | STANDARD SUBSTITUTION:<br>BACS12HN3-9<br>. WASHER-<br>MISCELLANEOUS DATA:<br>USE AS REQUIRED TO<br>MAINTAIN FLUSHNESS WITH<br>THE REST OF THE VANITY<br>-----*-----<br><br>ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE                                                                                                                                                                                                                                                                                                                                                                       | 438459            | AR                   |

- ITEM NOT ILLUSTRATED

R Y R

25-40-15-55M

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-15  
 FIG. 55M  
 PAGE 4  
 DEC 15/24


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER   | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                                                                              | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|---------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 55M<br>145                                              | 77586-1       | .PLATE ASSY-FAUCET MTG<br>SUPPLIER CODE:<br>V80477<br>COMPONENT MAINT MANUAL REF:<br>38-11-80                                                                           | 438459            | 1                    |
| 145                                                     | SC4L500002-3  | .PLATE ASSY-FAUCET MTG<br>SUPPLIER CODE:<br>V6S8D7<br>MISCELLANEOUS DATA:<br>ORDER 77586-1<br>ATTACHING PARTS                                                           | 438459            | 1                    |
| 150                                                     | NAS514P1032-9 | .SCREW<br>-----*-----                                                                                                                                                   | 438459            | 4                    |
| 155                                                     | 77593-1       | ..GASKET-<br>SUPPLIER CODE:<br>V80477<br>SB DATA FROM A CMM:<br>PRE SB 1L3-25-0072                                                                                      | 438459            | 1                    |
| 160                                                     | 77644-1       | ..GASKET-<br>SUPPLIER CODE:<br>V80477<br>SB DATA FROM A CMM:<br>PRE SB 1L3-25-0072                                                                                      | 438459            | 1                    |
| 160                                                     | 4W500301-31   | ..GASKET-<br>SUPPLIER CODE:<br>V6S8D7<br>SB DATA FROM A CMM:<br>POST SB 1L3-25-0072<br>POST SB 1L3-25-0114<br>POST SB 1L3-25-0120                                       | 438459            | 1                    |
| 165                                                     | 20166-007     | ..PACKING-<br>SUPPLIER CODE:<br>V80477<br>SB DATA FROM A CMM:<br>PRE SB 1L3-25-0072                                                                                     | 438459            | 2                    |
| 165                                                     | LCCS14-007B   | ..PACKING-<br>SUPPLIER CODE:<br>V6S8D7<br>TRUE PART NUMBER:<br>LCCS-14-007B<br>SB DATA FROM A CMM:<br>POST SB 1L3-25-0072<br>POST SB 1L3-25-0114<br>POST SB 1L3-25-0120 | 438459            | 2                    |
| 170                                                     | 20058-31      | ..RING-<br>SUPPLIER CODE:<br>V80477                                                                                                                                     | 438459            | 2                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |               |                                                                                                                                                                         |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R

25-40-15-55M

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-15  
 FIG. 55M  
 PAGE 5  
 AUG 15/24


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER   | 1 2 3 4 5 6 7 NOMENCLATURE                                                                              | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|---------------|---------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 55M                                                     |               |                                                                                                         |                   |                      |
| 175                                                     | 77592-1       | ..FITTING-<br>SUPPLIER CODE:<br>V80477                                                                  | 438459            | 2                    |
| 180                                                     | 77599-1       | ..GASKET-<br>SUPPLIER CODE:<br>V80477                                                                   | 438459            | 1                    |
| 185                                                     | 77585-1       | ..PLATE-<br>SUPPLIER CODE:<br>V80477                                                                    | 438459            | 1                    |
| 190                                                     | 4W400401-6    | .BRACKET-FAUCET MTG<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                                      | 438459            | 1                    |
| 195                                                     | NAS1801-3-6   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                                                         | 438459            | 4                    |
| 200                                                     | NAS1149D0332J | .WASHER<br>-----*-----                                                                                  | 438459            | 4                    |
| 205                                                     | 4L400401-25   | .PLATE ASSY-CLOSEOUT<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-41-11-40D<br>ATTACHING PARTS | 438459            | 1                    |
| 210                                                     | NAS1801-3-11  | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-11                                                        | 438459            | 4                    |
| 215                                                     | NAS1149D0332J | .WASHER<br>-----*-----                                                                                  | 438459            | 4                    |
| 220                                                     | 4595339-012   | .LANYARD-<br>SUPPLIER CODE:<br>V16827                                                                   | 438459            | 1                    |
| 225                                                     | LWC19AC14     | .CLIP-ADHESIVE BACKED<br>SUPPLIER CODE:<br>V06383<br>TRUE PART NUMBER:<br>LWC19-A-C14                   | 438459            | 1                    |
| 230                                                     | 4L500403-53   | .BRACKET-<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                                                | 438459            | 1                    |
| 235                                                     | NAS1801-3-6   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                                                         | 438459            | 2                    |
| 240                                                     | NAS1149D0332J | .WASHER<br>-----*-----                                                                                  | 438459            | 2                    |
| 245                                                     | 4L400403-12   | .PANEL-<br>SUPPLIER CODE:<br>V6S8D7                                                                     | 438459            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |               |                                                                                                         |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R

25-40-15-55M

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-15  
FIG. 55M  
PAGE 6  
AUG 15/24


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER   | 1 2 3 4 5 6 7 | NOMENCLATURE                                                      | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|---------------|---------------|-------------------------------------------------------------------|-------------------|----------------------|
| 55M                                                     |               |               | ATTACHING PARTS                                                   |                   |                      |
| 250                                                     | NAS1801-3-6   | .             | SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                    | 438459            | 4                    |
| 255                                                     | NAS1149D0332J | .             | WASHER<br>-----*-----                                             | 438459            | 4                    |
| 260                                                     | 4L500403-55   | .             | BRACKET-<br>SUPPLIER CODE:<br>V6S8D7                              | 438459            | 2                    |
| 265                                                     | NAS1801-3-6   | .             | ATTACHING PARTS<br>SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6 | 438459            | 4                    |
| 270                                                     | NAS1149D0332K | .             | WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0332J<br>-----*-----  | 438459            | 4                    |
| - 275                                                   | 9L500001-003  | .             | STUD INSTL-GND ELECTRICAL<br>SUPPLIER CODE:<br>V6S8D7             | 438459            | 3                    |
| 280                                                     | NAS1801-3-10  | ..            | SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-10                   | 438459            | 1                    |
| 285                                                     | MS21042L3     | ..            | NUT<br>STANDARD SUBSTITUTION:<br>BACN11AG3                        | 438459            | 1                    |
| 290                                                     | NAS1149D0316H | ..            | WASHER                                                            | 438459            | 3                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |               |               |                                                                   |                   |                      |

— ITEM NOT ILLUSTRATED


R Y R

25-40-15-55M

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-15  
 FIG. 55M  
 PAGE 7  
 AUG 15/24

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

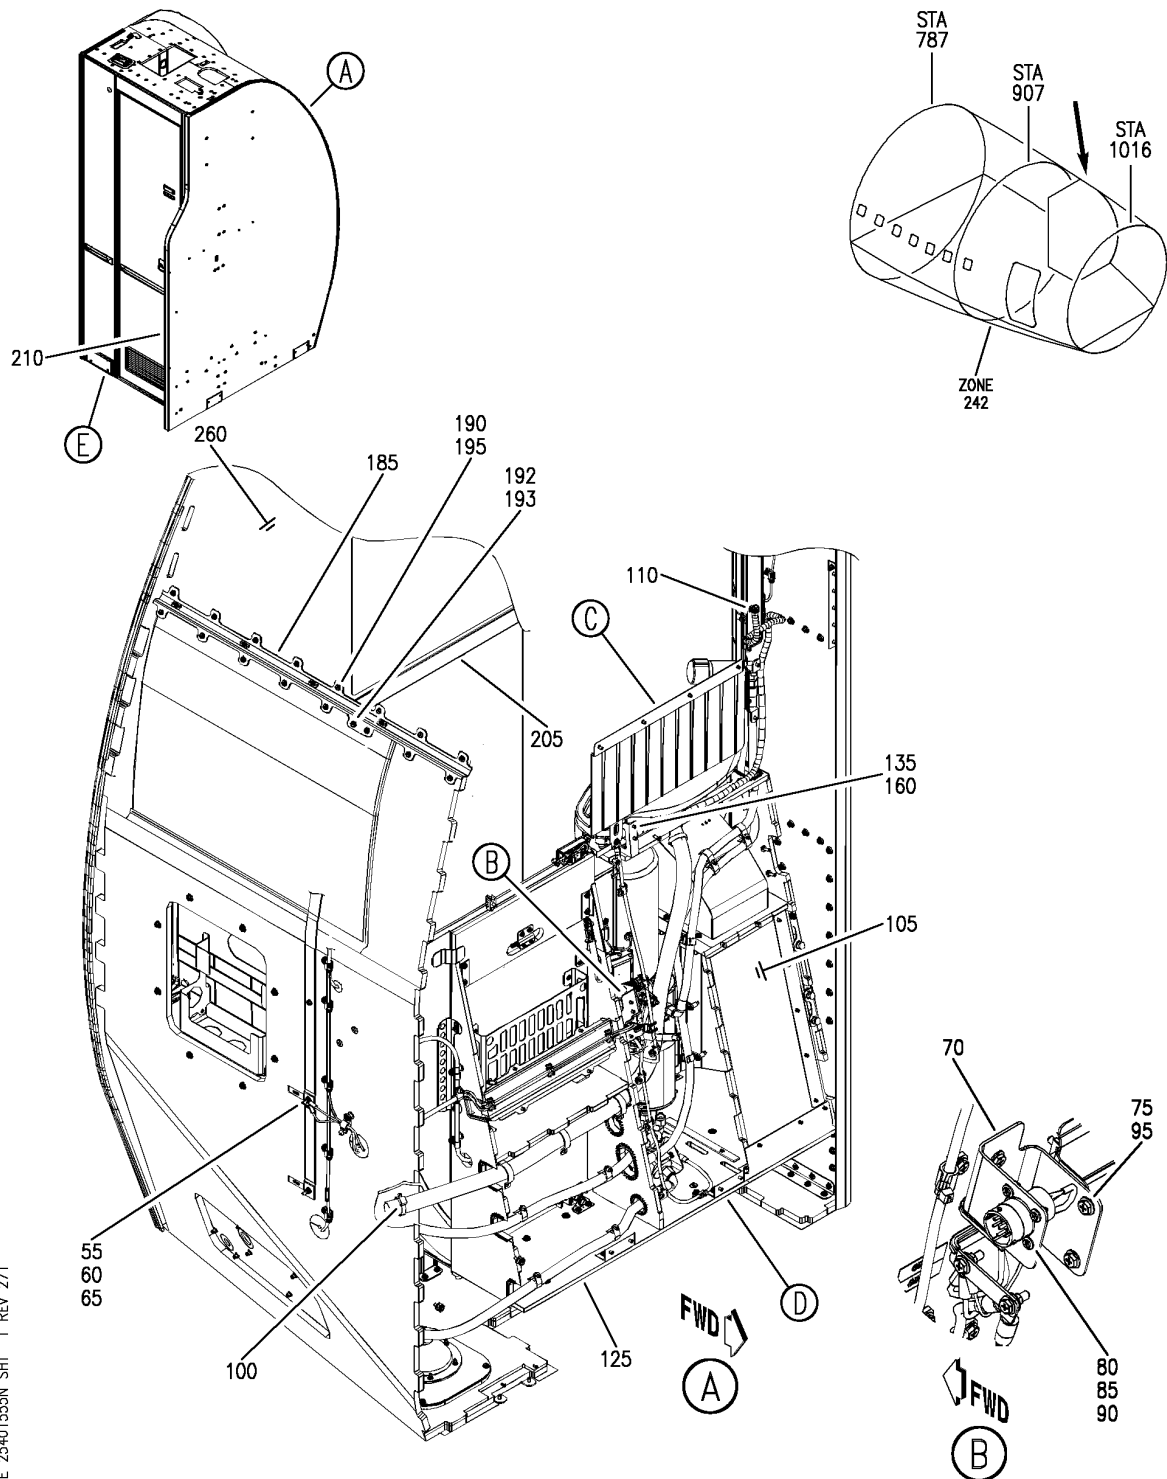

E 25401555N SHT 1 REV 271

STRUCTURE INSTL-LAV E  
FIGURE 55N (SHEET 1)



**25-40-15-55N**

R/YR  
OCT 15/20

25-40-15-55N  
PAGE 0

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

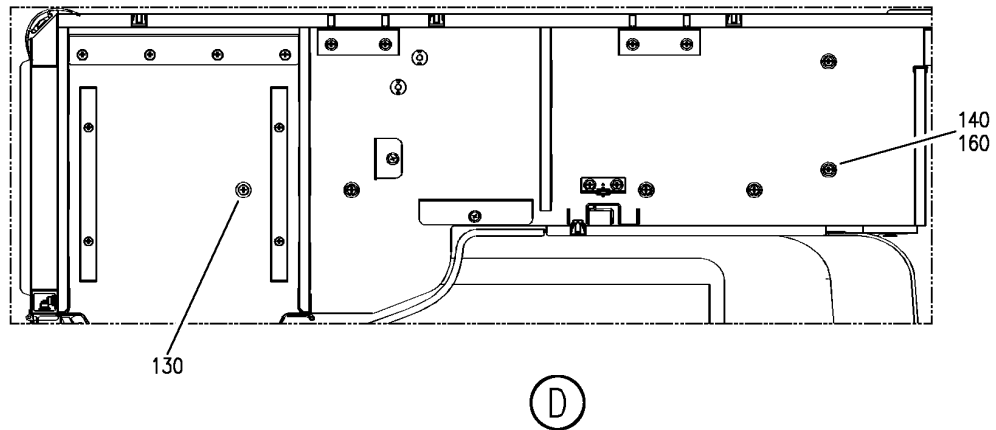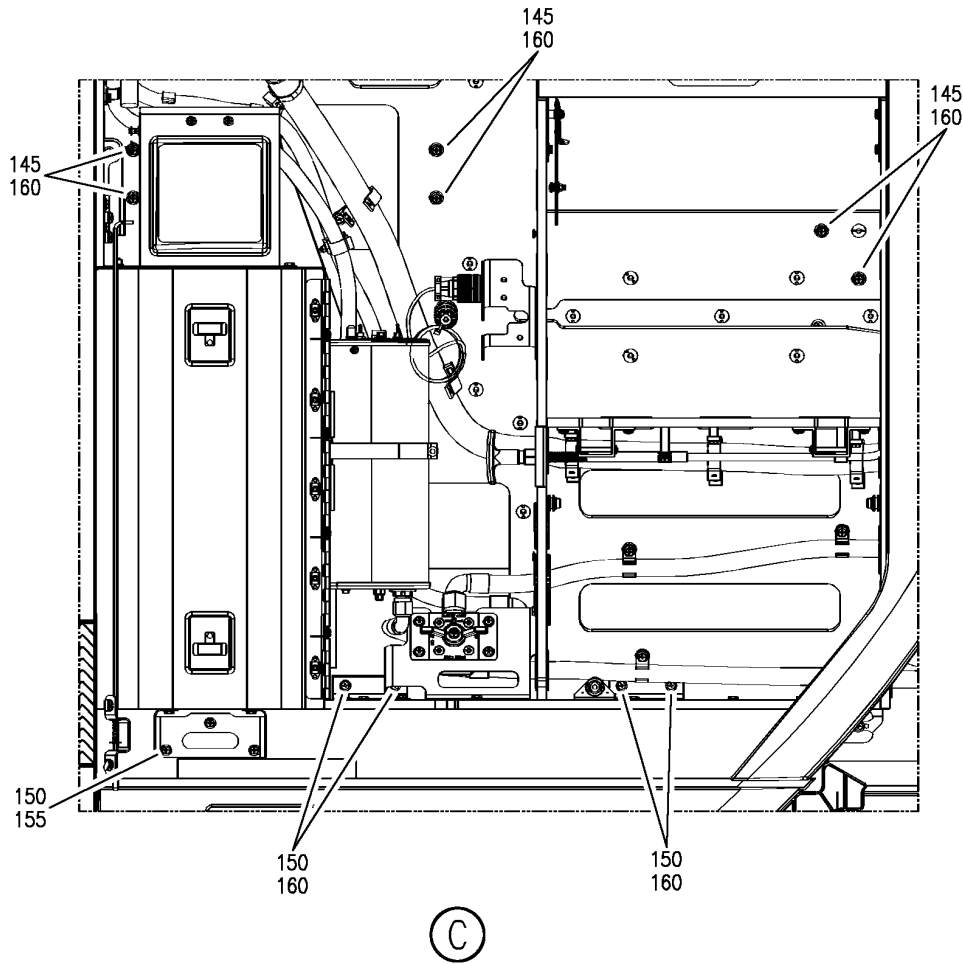

E 25401555N SHT 2 REV 291

STRUCTURE INSTL-LAV E  
FIGURE 55N (SHEET 2)

**25-40-15-55N**


R Y R  
O C T 15 / 20

25-40-15-55N  
PAGE 0A

ECCN 9E991 BOEING PROPRIETARY – See title page for details.



**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

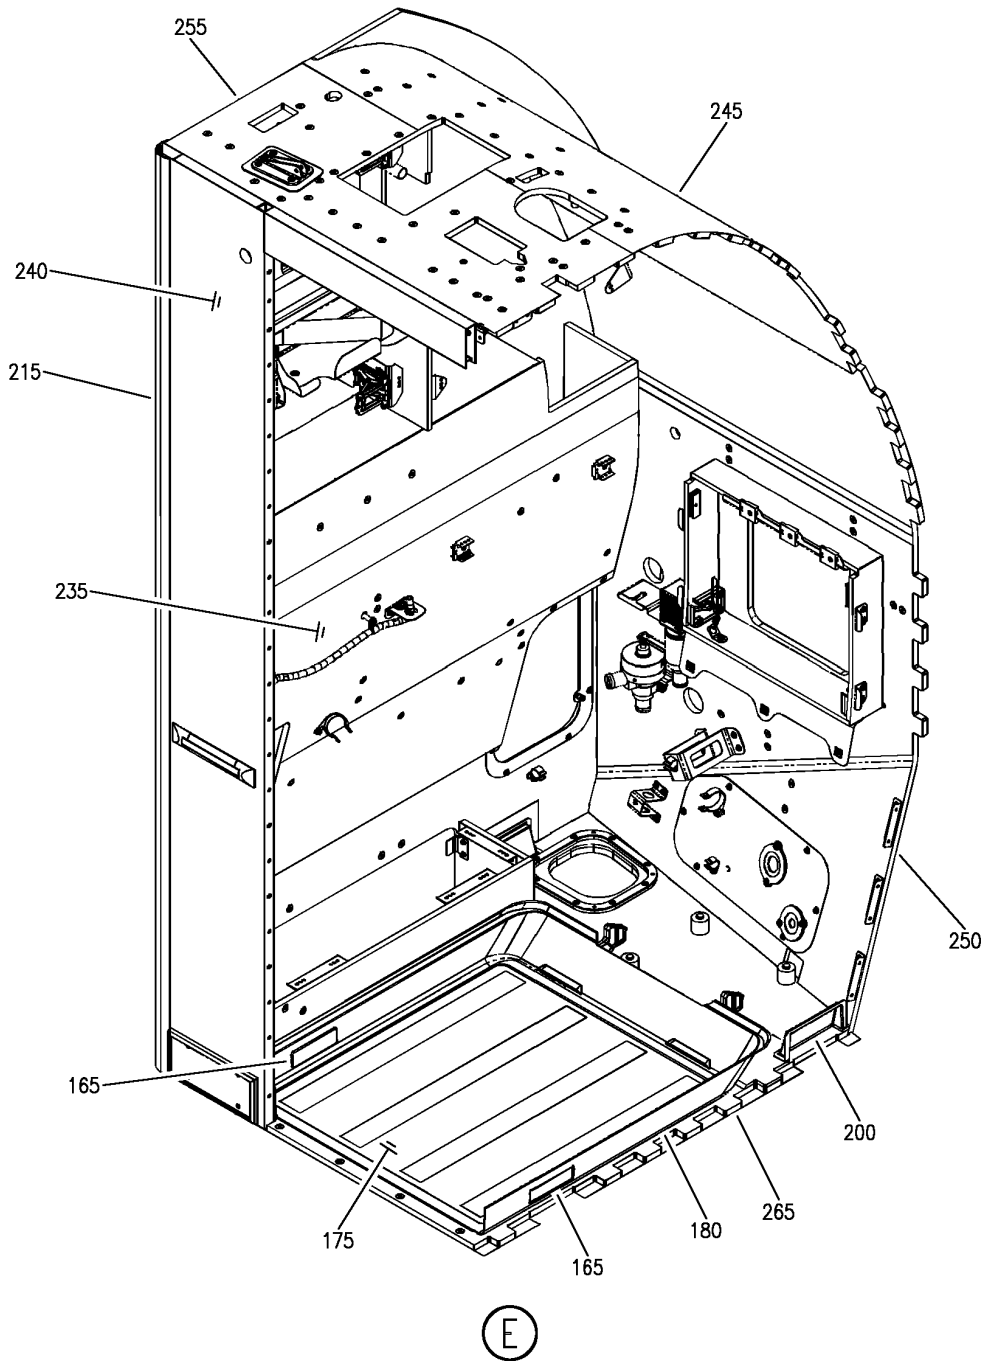

E 25401555N SHT 3 REV 271

STRUCTURE INSTL-LAV E  
FIGURE 55N (SHEET 3)

**25-40-15-55N**

R Y R  
O C T 15 / 20

25-40-15-55N  
PAGE 0B

ECCN 9E991 BOEING PROPRIETARY – See title page for details.


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER     | 1 2 3 4 5 6 7 | NOMENCLATURE                                                                                               | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|-----------------|---------------|------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 55N                                                     |                 |               |                                                                                                            |                   |                      |
| - 1                                                     | 1L306051-155EE3 |               | STRUCTURE INSTL-LAV E<br>STRUCTURE INSTL-LAV E<br>SUPPLIER CODE:<br>V6S8D7<br>FOR NHA SEE:<br>25-40-15-12S | 438459<br>438459  | RF                   |
| - 50                                                    | 9L500001-051    |               | .STRAP INSTL-GND ELECTRICAL<br>SUPPLIER CODE:<br>V6S8D7                                                    | 438459            | 1                    |
| 55                                                      | MS21042L3       |               | ..NUT<br>STANDARD SUBSTITUTION:<br>BACN11AG3                                                               | 438459            | 1                    |
| 60                                                      | NAS1149D0332H   |               | ..WASHER                                                                                                   | 438459            | 2                    |
| 65                                                      | 9L500001-201    |               | ..STANDOFF-HEXAGONAL<br>SUPPLIER CODE:<br>V6S8D7                                                           | 438459            | 1                    |
| 70                                                      | 1L500401-194    |               | .BRACKET-DISC.<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                                              | 438459            | 1                    |
| 75                                                      | NAS1801-3-5     |               | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-5                                                            | 438459            | 5                    |
| 80                                                      | NAS1801-04-6    |               | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN04-6                                                           | 438459            | 4                    |
| 85                                                      | MS21042L04      |               | .NUT<br>STANDARD SUBSTITUTION:<br>BACN11AG04                                                               | 438459            | 4                    |
| 90                                                      | NAS1149DN432J   |               | .WASHER                                                                                                    | 438459            | 8                    |
| 95                                                      | NAS1149D0332J   |               | .WASHER<br>-----*-----                                                                                     | 438459            | 5                    |
| 100                                                     | NAS1922-0125-3  |               | .CLAMP                                                                                                     | 438459            | 1                    |
| 105                                                     | 1L400101-67     |               | .CAN ASSY-WASTE<br>SUPPLIER CODE:<br>V6S8D7                                                                | 438459            | 1                    |
| - 106                                                   | SL00201         |               | ..GROMMET-<br>SUPPLIER CODE:<br>VOHESO<br>MISCELLANEOUS DATA:<br>ORDER LCEE000022                          | 438459            | AR                   |
| - 106                                                   | LCEE000022      |               | ..GROMMET-<br>SUPPLIER CODE:<br>V6S8D7                                                                     | 438459            | AR                   |
| - 120                                                   | MS3367-5-9      |               | .STRAP<br>STANDARD SUBSTITUTION:<br>BACS38K5                                                               | 438459            | AR                   |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                 |               |                                                                                                            |                   |                      |

- ITEM NOT ILLUSTRATED

R Y R

25-40-15-55N

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-15  
 FIG. 55N  
 PAGE 1  
 JUN 15/24

 **BOEING**  
737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                                                                                                                        | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 55N<br>125                                              | 1L406500-323   | .VANITY INSTL-LWR<br>SUPPLIER CODE:<br>V6S8D7<br>FUNCTIONAL REFERENCE:<br>EQUIPMENT/FURNISHINGS<br>FOR DETAILS SEE<br>25-41-51-54N<br>PLACARDS AND MARKINGS<br>FOR DETAILS SEE<br>11-32-05-52R<br>ATTACHING PARTS | 438459            | 1                    |
| 130                                                     | NAS514P1032-12 | .SCREW                                                                                                                                                                                                            | 438459            | 1                    |
| 135                                                     | NAS1801-3-5    | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-5                                                                                                                                                                   | 438459            | 2                    |
| 140                                                     | NAS1801-3-13   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-13                                                                                                                                                                  | 438459            | 5                    |
| 145                                                     | NAS1801-3-11   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-11                                                                                                                                                                  | 438459            | 6                    |
| 150                                                     | NAS1801-3-6    | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                                                                                                                                                                   | 438459            | 7                    |
| 155                                                     | NAS1149D0316K  | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0316J                                                                                                                                                                | 438459            | 3                    |
| 160                                                     | NAS1149D0332J  | .WASHER<br>-----*-----                                                                                                                                                                                            | 438459            | 17                   |
| 165                                                     | 1L500407-207   | .PLATE-COVER<br>SUPPLIER CODE:<br>V6S8D7                                                                                                                                                                          | 438459            | 2                    |
| - 170                                                   | 1L400407-68    | .PAN ASSY-FLOOR<br>SUPPLIER CODE:<br>V6S8D7                                                                                                                                                                       | 438459            | 1                    |
| 175                                                     | 1L400407-117   | ..MAT-<br>SUPPLIER CODE:<br>V6S8D7                                                                                                                                                                                | 438459            | 1                    |
| 180                                                     | 1L400407-16    | ..PAN-<br>SUPPLIER CODE:<br>V6S8D7                                                                                                                                                                                | 438459            | 1                    |
| 185                                                     | 1L400419-154   | .EXTRUSION-<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                                                                                                                                                        | 438459            | 1                    |
| 190                                                     | NAS1801-3-6    | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-6                                                                                                                                                                   | 438459            | 16                   |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |                                                                                                                                                                                                                   |                   |                      |

- ITEM NOT ILLUSTRATED

R Y R

25-40-15-55N

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-15  
FIG. 55N  
PAGE 2  
APR 15/23


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER   | 1 2 3 4 5 6 7<br>NOMENCLATURE                                                                                             | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|---------------|---------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 55N<br>192                                              | NAS1801-3-8   | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HN3-8                                                                           | 438459            | 1                    |
| 193                                                     | NAS1149F0332P | .WASHER                                                                                                                   | 438459            | 1                    |
| 195                                                     | NAS1149D0332K | .WASHER<br>STANDARD SUBSTITUTION:<br>NAS1149D0332J<br>-----*-----                                                         | 438459            | 16                   |
| 200                                                     | 1L500109-347  | .CLOSEOUT-FLLOOR<br>SUPPLIER CODE:<br>V6S8D7                                                                              | 438459            | 2                    |
| 205                                                     | 1L500413-131  | .TRIM-AFT WALL CLOSEOUT<br>SUPPLIER CODE:<br>V6S8D7                                                                       | 438459            | 1                    |
| 210                                                     | 1L500409-815  | .TRIM-EDGE<br>SUPPLIER CODE:<br>V6S8D7                                                                                    | 438459            | 1                    |
| 215                                                     | 1L500419-299  | .TRIM-FLAT WALL<br>SUPPLIER CODE:<br>V6S8D7                                                                               | 438459            | 1                    |
| - 220                                                   | 1L500709-661  | .TRIM-HEADER<br>SUPPLIER CODE:<br>V6S8D7                                                                                  | 438459            | 2                    |
| - 225                                                   | 415U9010-82   | .EXTRUSION-<br>MISCELLANEOUS DATA:<br>ORDER LCPE000013                                                                    | 438459            | AR                   |
| - 225                                                   | LCPE000013    | .EXTRUSION-CLIP, RTNR<br>SUPPLIER CODE:<br>V6S8D7<br>MISCELLANEOUS DATA:<br>THE BOEING COMPANY<br>PART NUMBER 415U9010-82 | 438459            | AR                   |
| - 230                                                   | MS21266-2N    | .GROMMET-<br>STANDARD SUBSTITUTION:<br>BACG20Z-B001275<br>MISCELLANEOUS DATA:<br>ORDER LCEE000003                         | 438459            | AR                   |
| - 230                                                   | LCEE000003    | .GROMMET-<br>SUPPLIER CODE:<br>V6S8D7                                                                                     | 438459            | AR                   |
| 235                                                     | 1L460051-255  | .WALL ASSY-SPACE<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-41-40-26L                                          | 438459            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |               |                                                                                                                           |                   |                      |

- ITEM NOT ILLUSTRATED

R Y R

25-40-15-55N

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-15  
 FIG. 55N  
 PAGE 3  
 JUN 15/24


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                                                                                                          | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 55N<br>240                                              | 1L460051-303EE | .WALL ASSY-INBD<br>SUPPLIER CODE:<br>V16827<br>FOR DETAILS SEE:<br>25-41-40-28G                                                                                                                     | 438459            | 1                    |
| 245                                                     | 1L460051-287   | .CEILING INSTL-UPR<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-41-45-06F                                                                                                                  | 438459            | 1                    |
| 250                                                     | 1L460051-305   | .WALL ASSY-OUTBD<br>SUPPLIER CODE:<br>V6S8D7<br>FUNCTIONAL REFERENCE:<br>EQUIPMENT/FURNISHINGS<br>FOR DETAILS SEE<br>25-41-40-24F<br>WATER/WASTE<br>FOR DETAILS SEE<br>38-11-08-15T<br>38-11-51-24M | 438459            | 1                    |
| 255                                                     | 1L460051-397EE | .WALL ASSY-FWD<br>SUPPLIER CODE:<br>V16827<br>FOR DETAILS SEE:<br>25-41-40-26N                                                                                                                      | 438459            | 1                    |
| 260                                                     | 1L460051-423EE | .WALL ASSY-ATTENDANT<br>SUPPLIER CODE:<br>V16827<br>FOR DETAILS SEE:<br>25-41-40-26G                                                                                                                | 438459            | 1                    |
| 265                                                     | 1L460051-395   | .FLOOR ASSY-<br>SUPPLIER CODE:<br>V6S8D7<br>FOR DETAILS SEE:<br>25-41-21-18Q                                                                                                                        | 438459            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |                                                                                                                                                                                                     |                   |                      |

— ITEM NOT ILLUSTRATED


RYR

25-40-15-55N

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

25-40-15  
FIG. 55N  
PAGE 4  
JUN 15/24

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

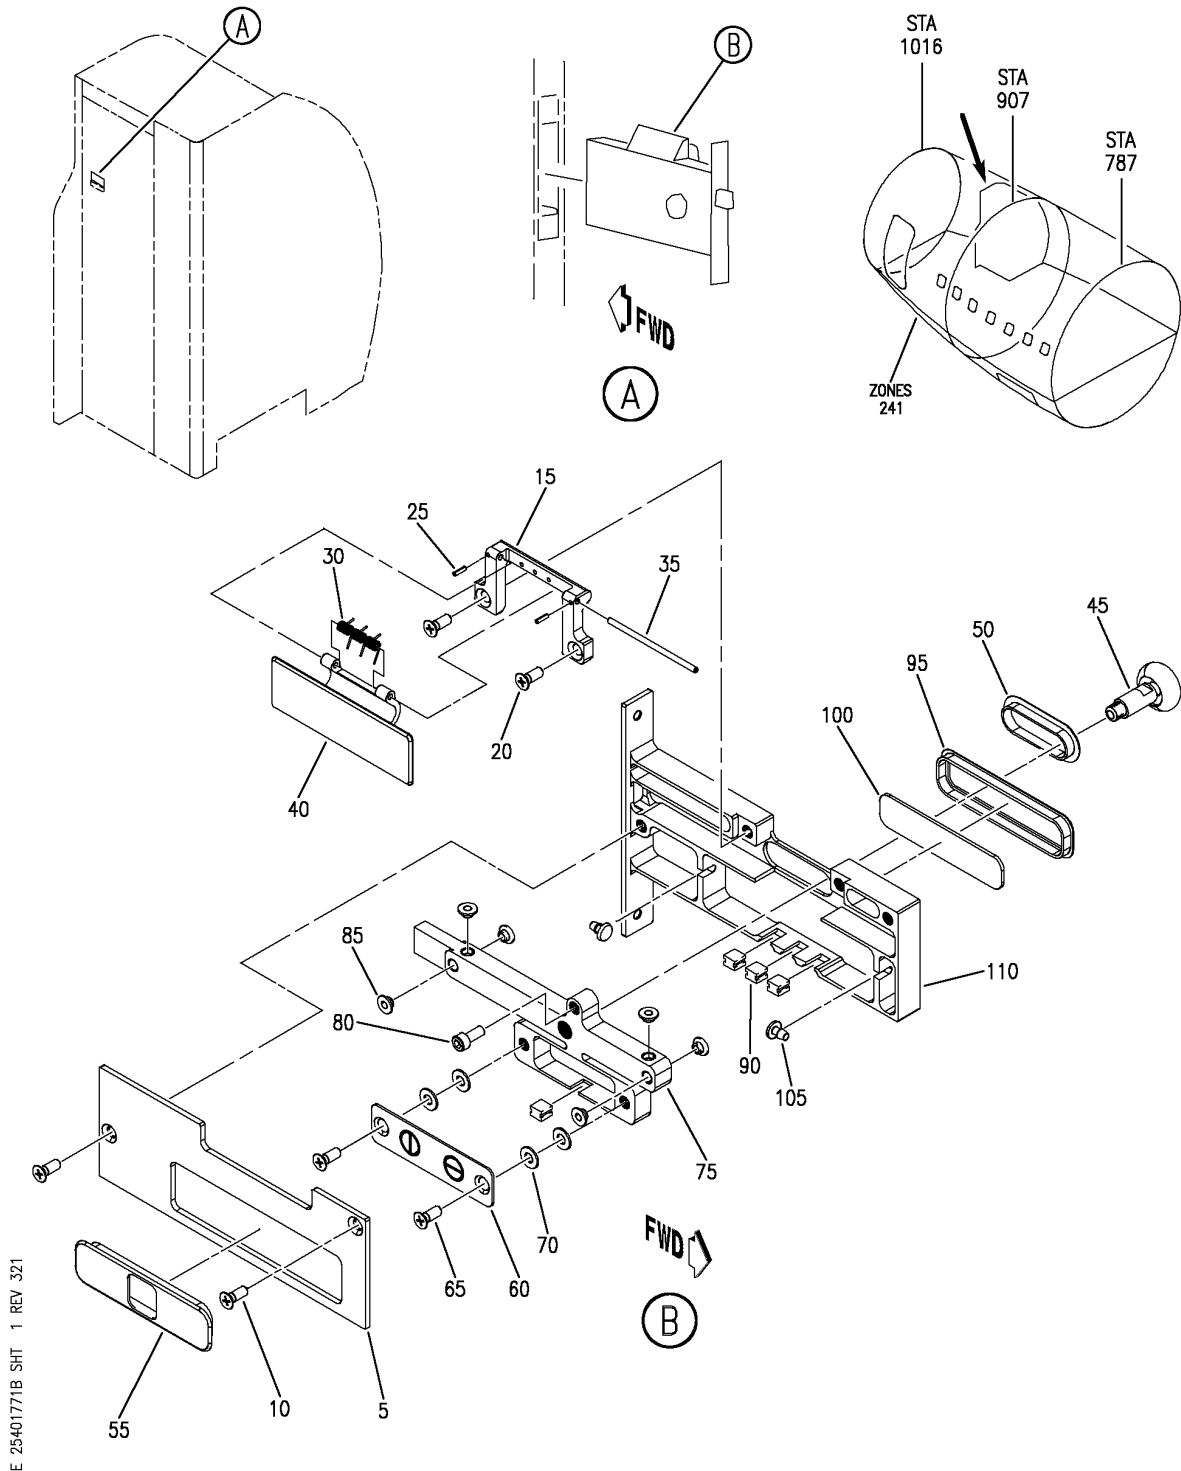

LOCK ASSY-IND  
FIGURE 71B

**25-40-17-71B**

R/YR  
APR 15/23

25-40-17-71B  
PAGE 0

ECCN 9E991 BOEING PROPRIETARY – See title page for details.


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER   | 1 2 3 4 5 6 7 | NOMENCLATURE                                                                                                                        | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|---------------|---------------|-------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 71B                                                     |               |               |                                                                                                                                     |                   |                      |
| - 1                                                     | 1L400115-11   |               | LOCK ASSY-IND<br>LOCK ASSY-IND<br>SUPPLIER CODE:<br>V6S8D7<br>FOR NHA SEE:<br>25-41-17-13F                                          | 460508<br>460508  | RF                   |
| - 1                                                     | SC1L500037-1  |               | LOCK ASSY-IND<br>SUPPLIER CODE:<br>V6S8D7<br>MISCELLANEOUS DATA:<br>B\ E PART NUMBER<br>1L400115-11<br>FOR NHA SEE:<br>25-41-17-13F | 460508            | RF                   |
| 5                                                       | 1L500105-229  |               | .COVER-HSG<br>SUPPLIER CODE:<br>V6S8D7                                                                                              | 460508            | 1                    |
| 10                                                      | NAS514P832-7  |               | ATTACHING PARTS<br>.SCREW<br>-----*-----                                                                                            | 460508            | 2                    |
| 15                                                      | 1L500105-233  |               | .HINGE-OVERRIDE<br>SUPPLIER CODE:<br>V6S8D7                                                                                         | 460508            | 1                    |
| 20                                                      | NAS514P832-7  |               | ATTACHING PARTS<br>.SCREW<br>-----*-----                                                                                            | 460508            | 2                    |
| 25                                                      | MS16562-190   |               | .PIN<br>STANDARD SUBSTITUTION:<br>BACP18BE4C0250U                                                                                   | 460508            | 2                    |
| 30                                                      | LTML060D03SMD |               | .SPRING-HELICAL<br>SUPPLIER CODE:<br>V1A699                                                                                         | 460508            | 3                    |
| 35                                                      | MS20253-2-200 |               | .PIN                                                                                                                                | 460508            | 1                    |
| 40                                                      | 1L500105-235  |               | .COVER-OVERRIDE<br>SUPPLIER CODE:<br>V6S8D7                                                                                         | 460508            | 1                    |
| 45                                                      | 2016004-9     |               | .KN0B-<br>SUPPLIER CODE:<br>VH1XK6                                                                                                  | 460508            | 1                    |
| 50                                                      | 1L500105-241  |               | .TRIM-KN0B<br>SUPPLIER CODE:<br>V6S8D7                                                                                              | 460508            | 1                    |
| 55                                                      | 1L500105-237  |               | .TRIM-<br>SUPPLIER CODE:<br>V6S8D7                                                                                                  | 460508            | 1                    |
| 60                                                      | 1L500105-231  |               | .TRIM-<br>SUPPLIER CODE:<br>V6S8D7                                                                                                  | 460508            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |               |               |                                                                                                                                     |                   |                      |

- ITEM NOT ILLUSTRATED

RYR

25-40-17-71B

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-17  
FIG. 71B  
PAGE 1  
APR 15/25


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER   | 1 2 3 4 5 6 7 NOMENCLATURE                                                                         | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|---------------|----------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 71B                                                     |               | ATTACHING PARTS                                                                                    |                   |                      |
| 65                                                      | NAS514P832-7  | .SCREW                                                                                             | 460508            | 2                    |
| 70                                                      | NAS1149FN832P | .WASHER                                                                                            | 460508            | 4                    |
|                                                         |               | -----*-----                                                                                        |                   |                      |
| 75                                                      | 1L500105-223  | .TRIM-STRIKE, LATCH<br>SUPPLIER CODE:<br>V6S8D7                                                    | 460508            | 1                    |
|                                                         |               | ATTACHING PARTS                                                                                    |                   |                      |
| 80                                                      | NAS1352-08-6  | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HM08B6                                                   | 460508            | 1                    |
|                                                         |               | -----*-----                                                                                        |                   |                      |
| 85                                                      | GF10203-02    | .BEARING-FLANGE<br>SUPPLIER CODE:<br>VBTQ06<br>MISCELLANEOUS DATA:<br>TRUE PART NO:<br>GFI-0203-02 | 460508            | 6                    |
| 90                                                      | SB4431N       | .MAGNET-BLK<br>SUPPLIER CODE:<br>V6S8D7<br>MISCELLANEOUS DATA:<br>TRUE PART NO: SB443-IN           | 460508            | 4                    |
| 95                                                      | 1L500105-239  | .TRIM-SIGHT PLATE<br>SUPPLIER CODE:<br>V6S8D7                                                      | 460508            | 1                    |
| 100                                                     | 1L500105-273  | .TRIM-SIGHT PLATE<br>SUPPLIER CODE:<br>V6S8D7                                                      | 460508            | 1                    |
| 105                                                     | POF40022WHT   | .GROMMET-BUMPER<br>SUPPLIER CODE:<br>VL7267<br>TRUE PART NUMBER:<br>POF-40022WHT                   | 460508            | 2                    |
| 110                                                     | 1L500105-221  | .LATCH-HSG<br>SUPPLIER CODE:<br>V6S8D7                                                             | 460508            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |               |                                                                                                    |                   |                      |

— ITEM NOT ILLUSTRATED

RYR



25-40-17-71B

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-17  
 FIG. 71B  
 PAGE 2  
 APR 15/25



**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

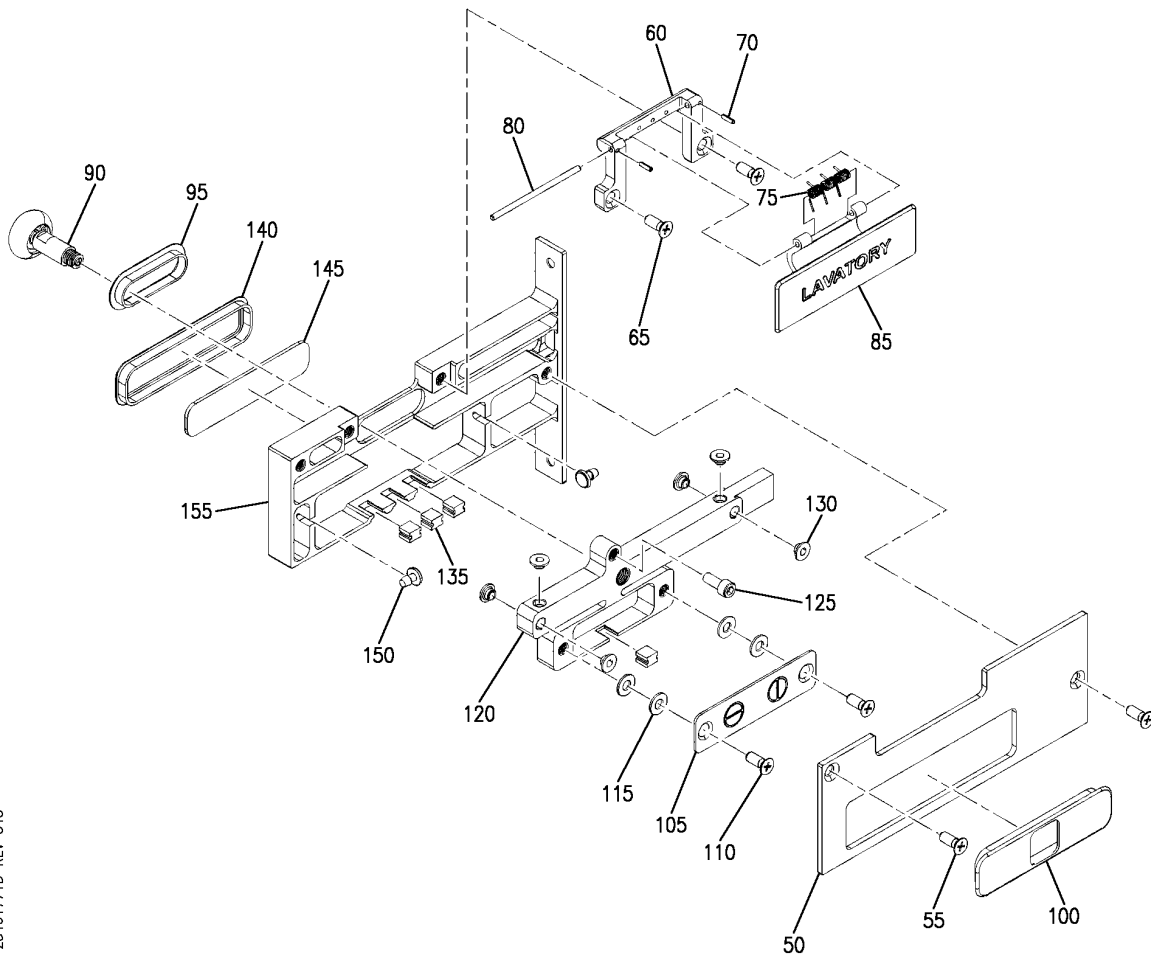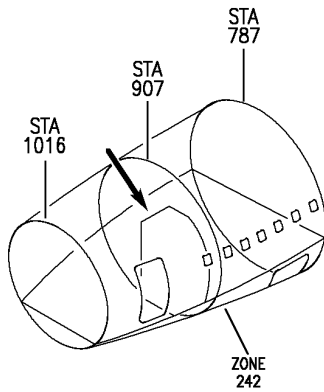

E 25401771D REV 345

LOCK ASSY-IND  
FIGURE 71D

**25-40-17-71D**

RYR  
APR 15/25

25-40-17-71D  
PAGE 0

ECCN 9E991 BOEING PROPRIETARY – See title page for details.


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER   | 1 2 3 4 5 6 7 | NOMENCLATURE                                                                                      | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|---------------|---------------|---------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 71D                                                     |               |               |                                                                                                   |                   |                      |
| - 1                                                     | 1L400115-12   |               | LOCK ASSY-IND<br>LOCK ASSY-IND, LAV E<br>SUPPLIER CODE:<br>V6S8D7<br>FOR NHA SEE:<br>25-41-17-14J | 460508<br>460508  | RF                   |
| - 1                                                     | SC1L500037-2  |               | LOCK ASSY-IND, LAV E<br>SUPPLIER CODE:<br>V6S8D7<br>FOR NHA SEE:<br>25-41-17-14J                  | 460508            | RF                   |
| 50                                                      | 1L500105-230  |               | .COVER-HSG<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                                         | 460508            | 1                    |
| 55                                                      | NAS514P832-7  |               | .SCREW<br>-----*-----                                                                             | 460508            | 2                    |
| 60                                                      | 1L500105-233  |               | .HINGE-OVERRIDE<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                                    | 460508            | 1                    |
| 65                                                      | NAS514P832-7  |               | .SCREW<br>-----*-----                                                                             | 460508            | 2                    |
| 70                                                      | MS16562-190   |               | .PIN<br>STANDARD SUBSTITUTION:<br>BACP18BE4C0250U                                                 | 460508            | 2                    |
| 75                                                      | LTML060D03SMD |               | .SPRING-HELICAL<br>SUPPLIER CODE:<br>V1A699                                                       | 460508            | 3                    |
| 80                                                      | MS20253-2-200 |               | .PIN                                                                                              | 460508            | 1                    |
| 85                                                      | 1L500105-235  |               | .COVER-OVERRIDE<br>SUPPLIER CODE:<br>V6S8D7                                                       | 460508            | 1                    |
| 90                                                      | 2016004-9     |               | .KN0B-<br>SUPPLIER CODE:<br>VH1XK6                                                                | 460508            | 1                    |
| 95                                                      | 1L500105-241  |               | .TRIM-KN0B<br>SUPPLIER CODE:<br>V6S8D7                                                            | 460508            | 1                    |
| 100                                                     | 1L500105-237  |               | .TRIM-<br>SUPPLIER CODE:<br>V6S8D7                                                                | 460508            | 1                    |
| 105                                                     | 1L500105-231  |               | .TRIM-<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                                             | 460508            | 1                    |
| 110                                                     | NAS514P832-7  |               | .SCREW                                                                                            | 460508            | 2                    |
| 115                                                     | NAS1149FN832P |               | .WASHER<br>-----*-----                                                                            | 460508            | 4                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |               |               |                                                                                                   |                   |                      |

— ITEM NOT ILLUSTRATED

RYR

25-40-17-71D

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-17  
FIG. 71D  
PAGE 1  
APR 15/25


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER  | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                        | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|--------------|-------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 71D<br>120                                              | 1L500105-223 | .TRIM-STRIKE, LATCH<br>SUPPLIER CODE:<br>V6S8D7                                                                   | 460508            | 1                    |
| 125                                                     | NAS1352-08-6 | ATTACHING PARTS<br>.SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HM08B6                                               | 460508            | 1                    |
| 130                                                     | GF10203-02   | -----*-----<br>.BEARING-FLANGE<br>SUPPLIER CODE:<br>VBTQ06<br>MISCELLANEOUS DATA:<br>TRUE PART NO:<br>GFI-0203-02 | 460508            | 6                    |
| 135                                                     | SB4431N      | .MAGNET-BLK<br>SUPPLIER CODE:<br>V6S8D7<br>MISCELLANEOUS DATA:<br>TRUE PART NO: SB443-IN                          | 460508            | 4                    |
| 140                                                     | 1L500105-239 | .TRIM-SIGHT PLATE<br>SUPPLIER CODE:<br>V6S8D7                                                                     | 460508            | 1                    |
| 145                                                     | 1L500105-273 | .TRIM-SIGHT PLATE<br>SUPPLIER CODE:<br>V6S8D7                                                                     | 460508            | 1                    |
| 150                                                     | POF40022WHT  | .GROMMET-BUMPER<br>SUPPLIER CODE:<br>VL7267<br>TRUE PART NUMBER:<br>POF-40022WHT                                  | 460508            | 2                    |
| 155                                                     | 1L500105-222 | .LATCH-HSG<br>SUPPLIER CODE:<br>V6S8D7                                                                            | 460508            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |              |                                                                                                                   |                   |                      |



— ITEM NOT ILLUSTRATED

RYR

25-40-17-71D

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

25-40-17  
 FIG. 71D  
 PAGE 2  
 APR 15/25

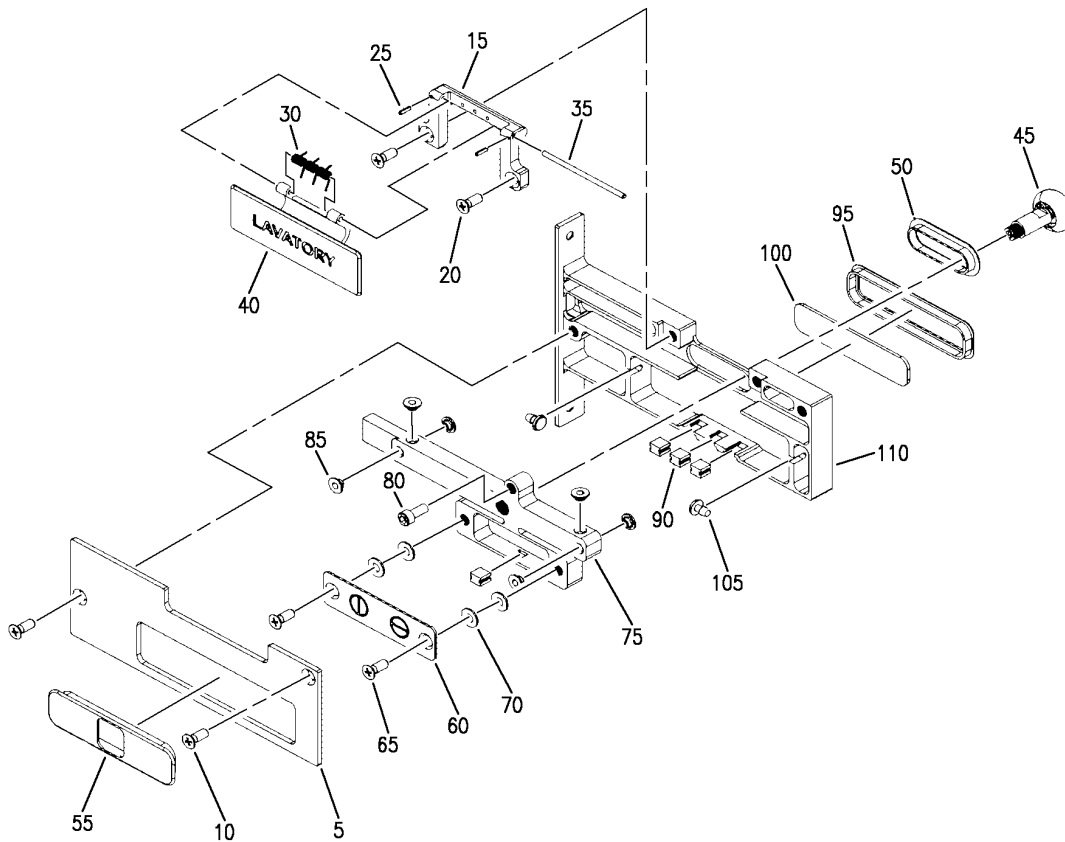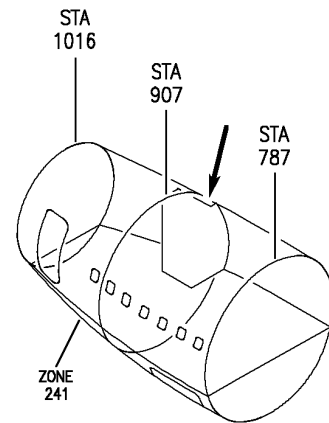

E 25401771F REV 335

LOCK ASSY-IND, LAV D  
FIGURE 71F

**25-40-17-71F**

RJR  
JUN 15/24

25-40-17-71F  
PAGE 0

 **BOEING**  
737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER   | 1 2 3 4 5 6 7 NOMENCLATURE                                                                                                                                 | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|---------------|------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 71 F                                                    |               |                                                                                                                                                            |                   |                      |
| - 1                                                     | 1L400115-11   | LOCK ASSY-IND, LAV D<br>LOCK ASSY-IND, LAV D<br>SUPPLIER CODE:<br>V6S8D7<br>FOR NHA SEE:<br>25-41-17-14A<br>25-41-17-14G                                   | 417459<br>417459  | RF                   |
| - 1                                                     | SC1L500037-1  | LOCK ASSY-IND, LAV D<br>SUPPLIER CODE:<br>V6S8D7<br>MISCELLANEOUS DATA:<br>B\ E PART NUMBER<br>1L400115-11<br>FOR NHA SEE:<br>25-41-17-14A<br>25-41-17-14G | 417459            | RF                   |
| 5                                                       | 1L500105-229  | .COVER-HSG<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                                                                                                  | 417459            | 1                    |
| 10                                                      | NAS514P832-7  | .SCREW<br>-----*-----                                                                                                                                      | 417459            | 2                    |
| 15                                                      | 1L500105-233  | .HINGE-OVERRIDE<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                                                                                             | 417459            | 1                    |
| 20                                                      | NAS514P832-7  | .SCREW<br>-----*-----                                                                                                                                      | 417459            | 2                    |
| 25                                                      | MS16562-190   | .PIN<br>STANDARD SUBSTITUTION:<br>BACP18BE4C0250U                                                                                                          | 417459            | 2                    |
| 30                                                      | LTML060D03SMD | .SPRING-HELICAL<br>SUPPLIER CODE:<br>V1A699                                                                                                                | 417459            | 3                    |
| 35                                                      | MS20253-2-200 | .PIN                                                                                                                                                       | 417459            | 1                    |
| 40                                                      | 1L500105-235  | .COVER-OVERRIDE<br>SUPPLIER CODE:<br>V6S8D7                                                                                                                | 417459            | 1                    |
| 45                                                      | 2016004-9     | .KNOB-ASSY<br>SUPPLIER CODE:<br>VH1XK6                                                                                                                     | 417459            | 1                    |
| 50                                                      | 1L500105-241  | .TRIM-KNOB<br>SUPPLIER CODE:<br>V6S8D7                                                                                                                     | 417459            | 1                    |
| 55                                                      | 1L500105-237  | .TRIM-<br>SUPPLIER CODE:<br>V6S8D7                                                                                                                         | 417459            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |               |                                                                                                                                                            |                   |                      |

- ITEM NOT ILLUSTRATED

RYR

25-40-17-71F

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-17  
FIG. 71F  
PAGE 1  
JUN 15/24


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER   | 1 2 3 4 5 6 7 | NOMENCLATURE                                                                     | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|---------------|---------------|----------------------------------------------------------------------------------|-------------------|----------------------|
| 71 F                                                    |               |               |                                                                                  |                   |                      |
| 60                                                      | 1L500105-231  |               | .TRIM-<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS                            | 417459            | 1                    |
| 65                                                      | NAS514P832-7  |               | .SCREW                                                                           | 417459            | 2                    |
| 70                                                      | NAS1149FN832P |               | .WASHER<br>-----*-----                                                           | 417459            | 4                    |
| 75                                                      | 1L500105-223  |               | .TRIM-STRIKE, LATCH<br>SUPPLIER CODE:<br>V6S8D7<br>ATTACHING PARTS               | 417459            | 1                    |
| 80                                                      | NAS1352-08-6  |               | .SCREW<br>STANDARD SUBSTITUTION:<br>BACS12HM08B6<br>-----*-----                  | 417459            | 1                    |
| 85                                                      | GFI0203-02    |               | .BEARING-FLANGE<br>SUPPLIER CODE:<br>VBTQ06<br>TRUE PART NUMBER:<br>GFI-0203-02  | 417459            | 6                    |
| 90                                                      | SB443IN       |               | .STRIKE-MAGNET, BLK<br>SUPPLIER CODE:<br>V6S8D7<br>TRUE PART NUMBER:<br>SB443-IN | 417459            | 4                    |
| 95                                                      | 1L500105-239  |               | .TRIM-SIGHT PLATE<br>SUPPLIER CODE:<br>V6S8D7                                    | 417459            | 1                    |
| 100                                                     | 1L500105-273  |               | .TRIM-SIGHT PLATE<br>SUPPLIER CODE:<br>V6S8D7                                    | 417459            | 1                    |
| 105                                                     | POF40022WHT   |               | .GROMMET-BUMPER<br>SUPPLIER CODE:<br>VL7267<br>TRUE PART NUMBER:<br>POF-40022WHT | 417459            | 2                    |
| 110                                                     | 1L500105-221  |               | .LATCH-HSG<br>SUPPLIER CODE:<br>V6S8D7                                           | 417459            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |               |               |                                                                                  |                   |                      |

— ITEM NOT ILLUSTRATED


R Y R

25-40-17-71F

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

25-40-17  
FIG. 71F  
PAGE 2  
JUN 15/24

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

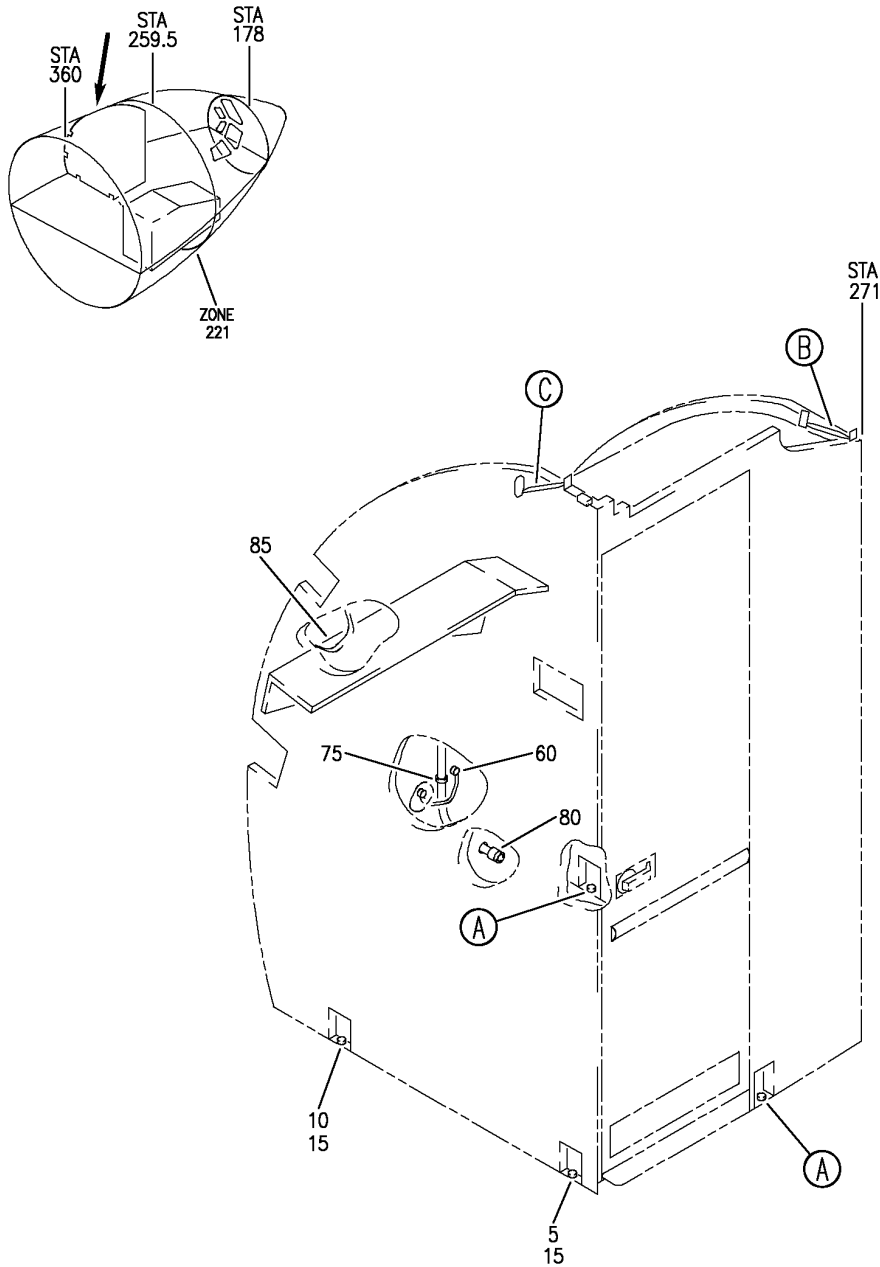

E 25405111 SHT 1 REV 202

HARDWARE INSTL-LAV A (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 11 (SHEET 1)


**25-40-51-11**

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

RJR  
JUN 15/16

25-40-51-11  
PAGE 0

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

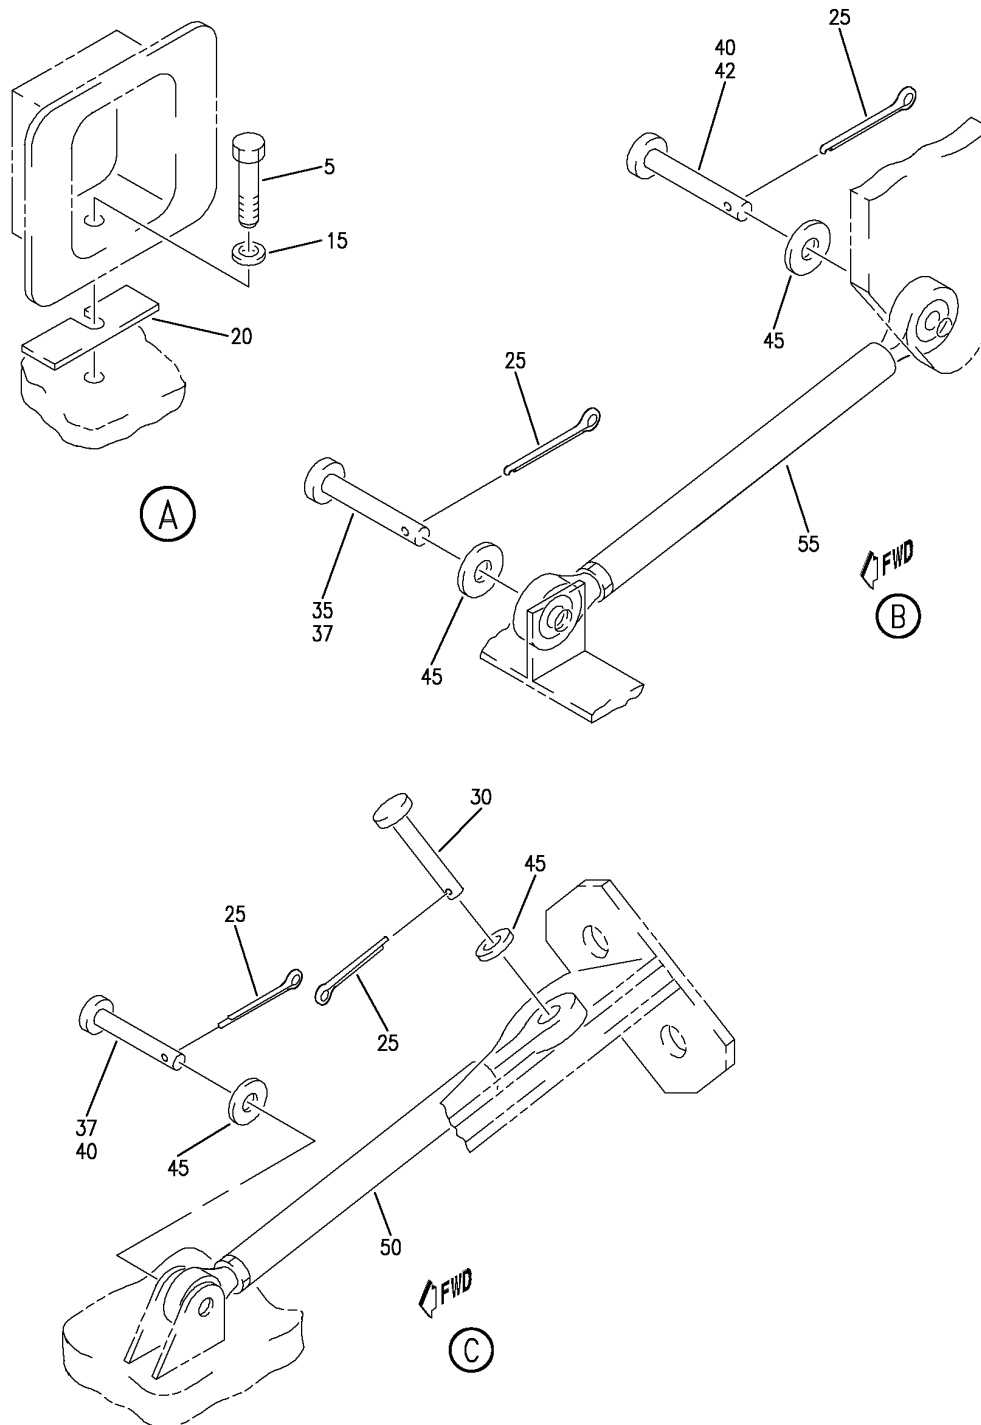

E 25405111 SHT 2 REV 257

HARDWARE INSTL-LAV A (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 11 (SHEET 2)

**25-40-51-11**

R/YR  
DEC 15/17

25-40-51-11  
PAGE 0A

ECCN 9E991 BOEING PROPRIETARY - See title page for details.




**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 | NOMENCLATURE                                                                                                                                              | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|---------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 11                                                      |                |               | HARDWARE INSTL-LAV A<br>(EQUIPMENT/FURNISHINGS<br>ONLY)                                                                                                   | 417999            |                      |
| - 1                                                     | MODREF696328   |               | HARDWARE INSTL-LAV A<br>(EQUIPMENT/FURNISHINGS<br>ONLY)<br>MODULE NUMBER:<br>417A1160-1 REV E<br>FOR OTHER SYS DETAILS SEE:<br>21-23-51-90<br>38-31-51-70 | 417481            | RF                   |
| - 1                                                     | MODREF752534   |               | HARDWARE INSTL-LAV A<br>(EQUIPMENT/FURNISHINGS<br>ONLY)<br>MODULE NUMBER:<br>417A1160-1 REV F<br>FOR OTHER SYS DETAILS SEE:<br>21-23-51-90<br>38-31-51-70 | 482493            | RF                   |
| - 1                                                     | MODREF763687   |               | HARDWARE INSTL-LAV A<br>(EQUIPMENT/FURNISHINGS<br>ONLY)<br>MODULE NUMBER:<br>417A1160-1 REV G<br>FOR OTHER SYS DETAILS SEE:<br>21-23-51-90<br>38-31-51-70 | 494503            | RF                   |
| - 1                                                     | MODREF766949   |               | HARDWARE INSTL-LAV A<br>(EQUIPMENT/FURNISHINGS<br>ONLY)<br>MODULE NUMBER:<br>417A1160-1 REV H<br>FOR OTHER SYS DETAILS SEE:<br>21-23-51-90<br>38-31-51-70 | 504999            | RF                   |
| 5                                                       | BACB30NM5K22   | .BOLT         |                                                                                                                                                           | 417999            | 3                    |
| 10                                                      | BACB30NM5K24   | .BOLT         |                                                                                                                                                           | 417999            | 1                    |
| 15                                                      | NAS1149C0532R  | .WASHER       |                                                                                                                                                           | 417999            | 4                    |
| 20                                                      | 417A1130-6     | .SHIM-        |                                                                                                                                                           | 417999            | AR                   |
| 20                                                      | 417A1130-64    | .SHIM-        |                                                                                                                                                           | 417999            | AR                   |
| 25                                                      | BACP18BC02C06P | .PIN          |                                                                                                                                                           | 417999            | 4                    |
| 30                                                      | BACP18T4-27    | .PIN          |                                                                                                                                                           | 417999            | 1                    |
| 35                                                      | BACP18T4-33    | .PIN          |                                                                                                                                                           | 417481            | 1                    |
| 37                                                      | BACP18T4-33    | .PIN          |                                                                                                                                                           | 482999            | 2                    |
| 40                                                      | BACP18T4-41    | .PIN          |                                                                                                                                                           | 417481            | 2                    |
| 42                                                      | BACP18T4-41    | .PIN          |                                                                                                                                                           | 482999            | 1                    |
| 45                                                      | NAS1149D0463J  | .WASHER       |                                                                                                                                                           | 417999            | 4                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |               |                                                                                                                                                           |                   |                      |

- ITEM NOT ILLUSTRATED

R Y R

# 25-40-51-11

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-51  
 FIG. 11  
 PAGE 1  
 JUN 15/18


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER     | 1 2 3 4 5 6 7            | NOMENCLATURE | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|-----------------|--------------------------|--------------|-------------------|----------------------|
| 11                                                      |                 |                          |              |                   |                      |
| 50                                                      | USC737-003-652  | .ROD-TIE                 |              | 417999            | 1                    |
|                                                         |                 | SUPPLIER CODE:           |              |                   |                      |
|                                                         |                 | V31293                   |              |                   |                      |
|                                                         |                 | SPECIFICATION NUMBER:    |              |                   |                      |
|                                                         |                 | S401W121-652             |              |                   |                      |
| 55                                                      | USC737-004-654  | .ROD-TIE                 |              | 417999            | 1                    |
|                                                         |                 | SUPPLIER CODE:           |              |                   |                      |
|                                                         |                 | V34742                   |              |                   |                      |
|                                                         |                 | SPECIFICATION NUMBER:    |              |                   |                      |
|                                                         |                 | S401W121-654             |              |                   |                      |
| 55                                                      | 777050-654      | .ROD-TIE                 |              | 417999            | 1                    |
|                                                         |                 | SUPPLIER CODE:           |              |                   |                      |
|                                                         |                 | V31293                   |              |                   |                      |
|                                                         |                 | SPECIFICATION NUMBER:    |              |                   |                      |
|                                                         |                 | S401W121-654             |              |                   |                      |
| 60                                                      | BACJ40A30-8     | .JUMPER                  |              | 417999            | 1                    |
|                                                         |                 | ATTACHING PARTS          |              |                   |                      |
| - 65                                                    | NAS1149D0416H   | .WASHER                  |              | 417999            | 2                    |
| - 70                                                    | PLH54CD         | .NUT                     |              | 417999            | 2                    |
|                                                         |                 | SUPPLIER CODE:           |              |                   |                      |
|                                                         |                 | VF0224                   |              |                   |                      |
|                                                         |                 | SPECIFICATION NUMBER:    |              |                   |                      |
|                                                         |                 | BACN10YR4CD              |              |                   |                      |
|                                                         |                 | OPTIONAL PART:           |              |                   |                      |
|                                                         |                 | H52732-4CD               |              |                   |                      |
|                                                         |                 | V15653                   |              |                   |                      |
| - 70                                                    | H52732-4CD      | .NUT-                    |              | 417999            | 2                    |
|                                                         |                 | SUPPLIER CODE:           |              |                   |                      |
|                                                         |                 | V15653                   |              |                   |                      |
|                                                         |                 | OPTIONAL PART:           |              |                   |                      |
|                                                         |                 | PLH54CD                  |              |                   |                      |
|                                                         |                 | V62554                   |              |                   |                      |
|                                                         |                 | -----*-----              |              |                   |                      |
| 75                                                      | NAS1922-0100-3  | .CLAMP                   |              | 417999            | 1                    |
| 80                                                      | BACC10JB018C026 | .CLAMP                   |              | 417999            | 1                    |
| 85                                                      | 411A4907-3149   | .BLANKET ASSY-INSULATION |              | 417999            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                 |                          |              |                   |                      |

- ITEM NOT ILLUSTRATED



R Y R

25-40-51-11

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-51  
 FIG. 11  
 PAGE 2  
 DEC 15/21

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

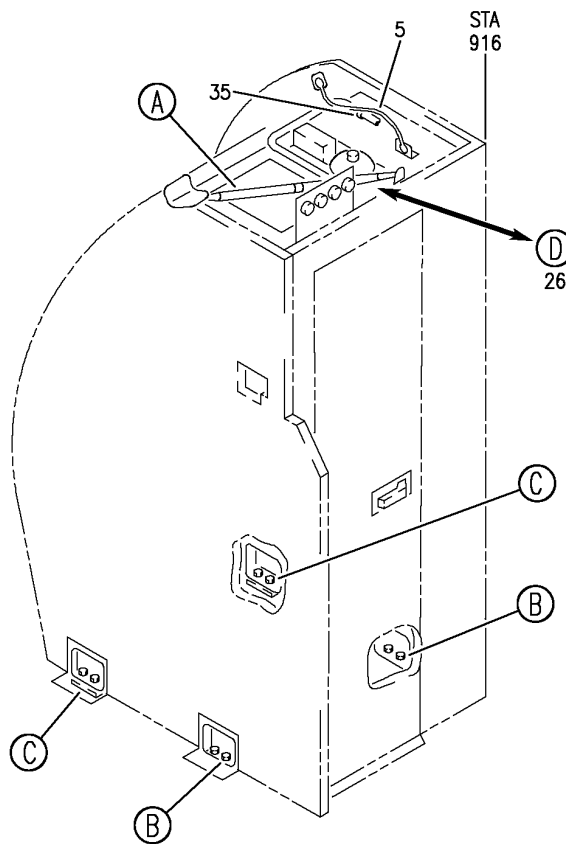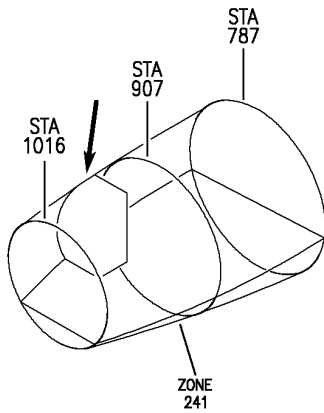

E 25405112 SHT 1 REV 265


HARDWARE INSTL-LAV D (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 12 (SHEET 1)

**25-40-51-12**

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

R Y R  
AUG 15/18

25-40-51-12  
PAGE 0

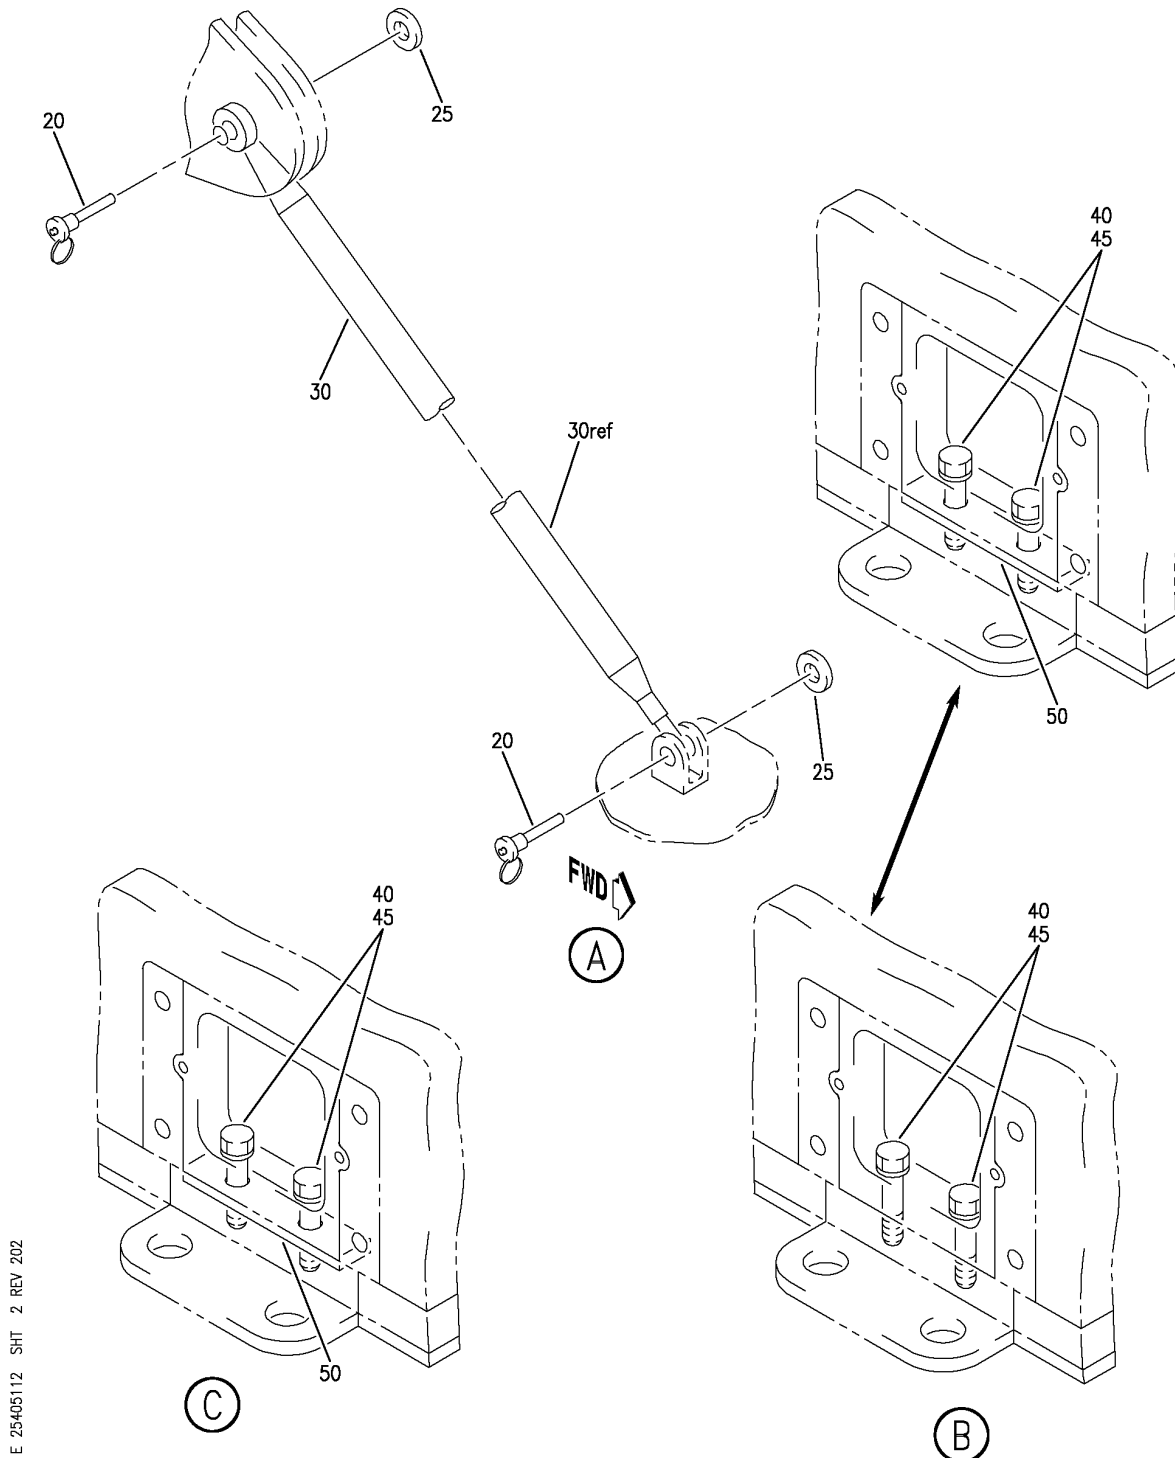

E 25405112 SHT 2 REV 202


HARDWARE INSTL-LAV D (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 12 (SHEET 2)

**25-40-51-12**

RJR  
JUN 15/16

25-40-51-12  
PAGE 0A

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

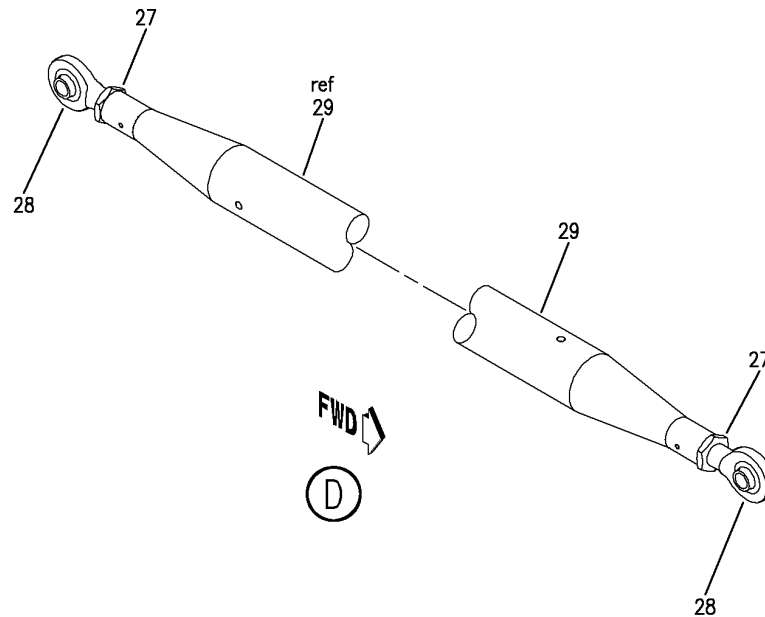

E 25405112 SH1 3 REV 265

HARDWARE INSTL-LAV D (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 12 (SHEET 3)

**25-40-51-12**

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

R Y R  
AUG 15/18

25-40-51-12  
PAGE 08


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER   | 1 2 3 4 5 6 7 | NOMENCLATURE                                                                                                                               | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|---------------|---------------|--------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 12                                                      |               |               | HARDWARE INSTL-LAV D<br>(EQUIPMENT/FURNISHINGS<br>ONLY)                                                                                    | 417999            |                      |
| - 1                                                     | MODREF696327  |               | HARDWARE INSTL-LAV D<br>(EQUIPMENT/FURNISHINGS<br>ONLY)<br>MODULE NUMBER:<br>417A1160-4 REV D<br>FOR OTHER SYS DETAILS SEE:<br>38-31-51-71 | 417503            | RF                   |
| - 1                                                     | MODREF766961  |               | HARDWARE INSTL-LAV D<br>(EQUIPMENT/FURNISHINGS<br>ONLY)<br>MODULE NUMBER:<br>417A1160-4 REV E<br>FOR OTHER SYS DETAILS SEE:<br>38-31-51-71 | 504530            | RF                   |
| - 1                                                     | MODREF789219  |               | HARDWARE INSTL-LAV D<br>(EQUIPMENT/FURNISHINGS<br>ONLY)<br>MODULE NUMBER:<br>417A1160-4 REV F<br>FOR OTHER SYS DETAILS SEE:<br>38-31-51-71 | 531999            | RF                   |
|                                                         | 5 1002CC15    |               | .JUMPER ASSY<br>SUPPLIER CODE:<br>V1FF12<br>SPECIFICATION NUMBER:<br>BACJ40A30-15<br>ATTACHING PARTS                                       | 417999            | 1                    |
| - 10                                                    | NAS1149D0416H |               | .WASHER                                                                                                                                    | 417999            | 2                    |
| - 15                                                    | PLH54CD       |               | .NUT<br>SUPPLIER CODE:<br>VF0224<br>SPECIFICATION NUMBER:<br>BACN10YR4CD<br>OPTIONAL PART:<br>H52732-4CD<br>V15653                         | 417999            | 2                    |
| - 15                                                    | PLH54CD       |               | .NUT-<br>SUPPLIER CODE:<br>V62554<br>MISCELLANEOUS DATA:<br>SPECIFICATION NUMBER<br>BACN10YR4CD                                            | 417999            | 2                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |               |               |                                                                                                                                            |                   |                      |

- ITEM NOT ILLUSTRATED

RYR

25-40-51-12

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-51  
 FIG. 12  
 PAGE 1  
 DEC 15/18


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 | NOMENCLATURE                                                                                                                                          | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|---------------|-------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 12                                                      |                |               |                                                                                                                                                       |                   |                      |
| - 15                                                    | H52732-4CD     |               | .NUT-<br>SUPPLIER CODE:<br>V15653<br>MISCELLANEOUS DATA:<br>SPECIFICATION NUMBER<br>BACN10YR4CD<br>OPTIONAL PART:<br>PLH54CD<br>V62554<br>-----*----- | 417999            | 2                    |
| 20                                                      | BLC4B08S       |               | .PIN<br>SUPPLIER CODE:<br>V84256<br>SPECIFICATION NUMBER:<br>BACP18AM4B08HC<br>OPTIONAL PART:<br>LG4CB08<br>V83014<br>SLC4B08<br>V16258               | 417999            | 2                    |
| 25                                                      | NAS1149E0463P  |               | .WASHER                                                                                                                                               | 417999            | 2                    |
| 26                                                      | 401W1290-272   |               | .ROD ASSY-TIE                                                                                                                                         | 417999            | 1                    |
| 27                                                      | BACN11U6CD2N   |               | ..NUT                                                                                                                                                 | 417999            | 2                    |
| 28                                                      | 411A1290-207   |               | ..ROD END                                                                                                                                             | 417999            | 2                    |
| 29                                                      | 401W1291-272   |               | ..ROD                                                                                                                                                 | 417999            | 1                    |
| 30                                                      | 1587-1         |               | .ROD-TIE<br>SUPPLIER CODE:<br>V34742<br>MISCELLANEOUS DATA:<br>401W1290-272 IS BOEING<br>PREFERRED SPARE PART.                                        | 417999            | 1                    |
| 30                                                      | 1454-3         |               | .ROD-TIE<br>SUPPLIER CODE:<br>V34742                                                                                                                  | 417999            | 1                    |
| 30                                                      | 401W1290-273   |               | .ROD ASSY-TIE                                                                                                                                         | 417999            | 1                    |
| 35                                                      | NAS1922-0100-3 |               | .CLAMP                                                                                                                                                | 417999            | 1                    |
| 40                                                      | BACB30NM3K9    |               | .BOLT                                                                                                                                                 | 417999            | 8                    |
| 45                                                      | NAS1149C0332R  |               | .WASHER                                                                                                                                               | 417999            | 8                    |
| 50                                                      | 417A1130-55    |               | .SHIM-                                                                                                                                                | 417999            | AR                   |
| 50                                                      | 417A1130-65    |               | .SHIM-                                                                                                                                                | 417999            | AR                   |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |               |                                                                                                                                                       |                   |                      |

- ITEM NOT ILLUSTRATED


R Y R

25-40-51-12

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-51  
FIG. 12  
PAGE 2  
DEC 15/23

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

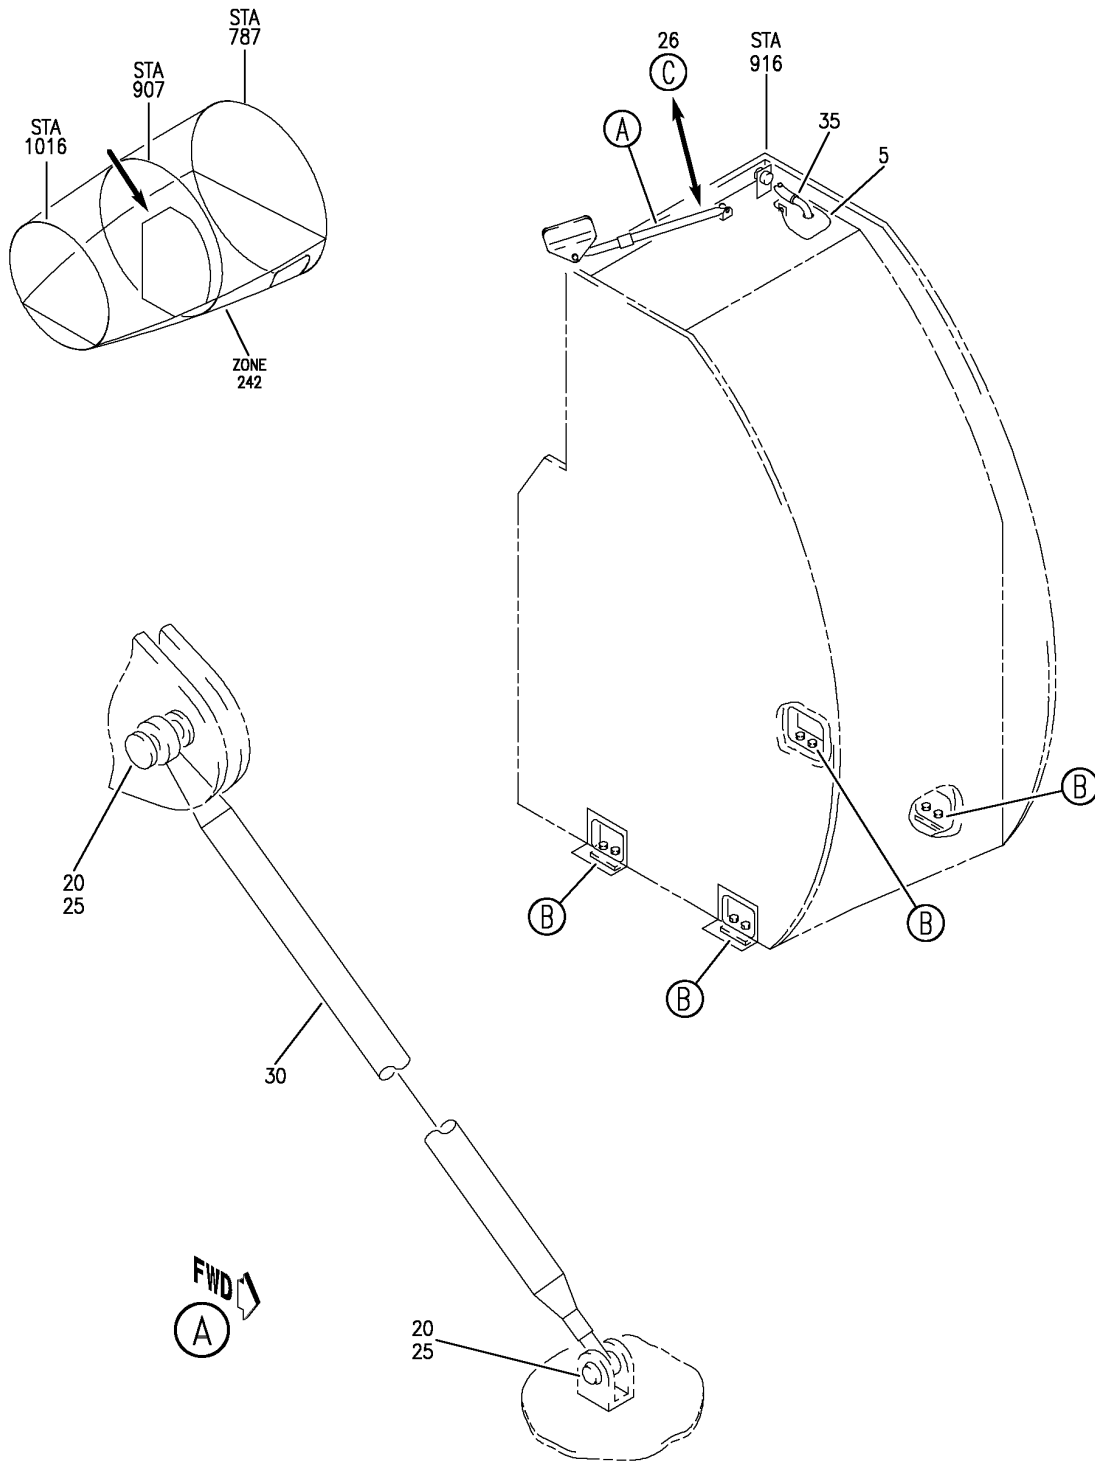

E 25405113 SHT 1 REV 265

HARDWARE INSTL-LAV E (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 13 (SHEET 1)

**25-40-51-13**


R/YR  
AUG 15/18

25-40-51-13  
PAGE 0


ECCN 9E991 BOEING PROPRIETARY - See title page for details.



**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

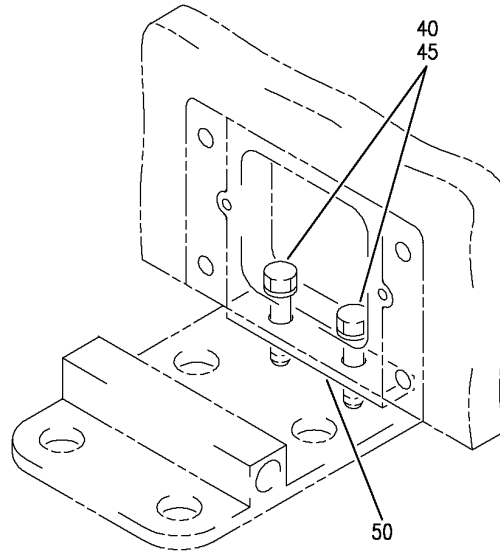

(B)

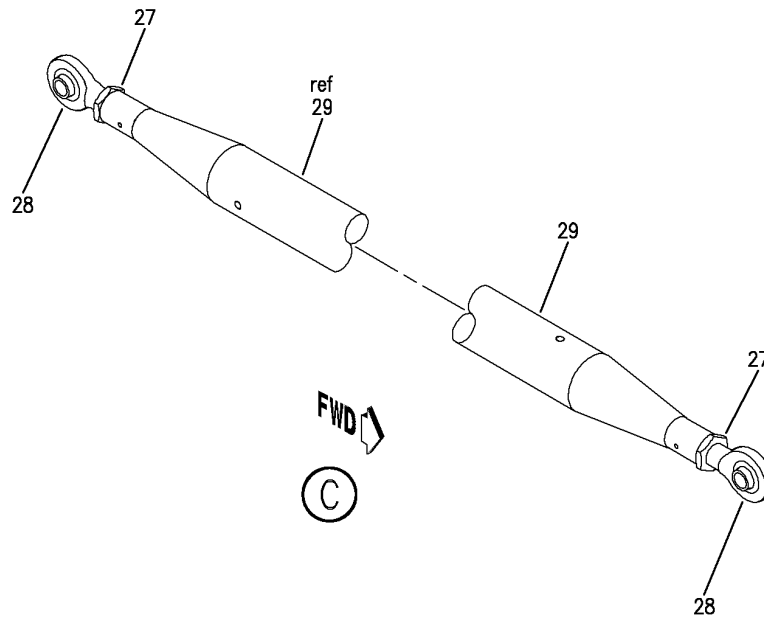

(C)

E 25405113 SH1 2 REV 265

HARDWARE INSTL-LAV E (EQUIPMENT/FURNISHINGS ONLY)  
FIGURE 13 (SHEET 2)

**25-40-51-13**

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

R Y R  
AUG 15/18

25-40-51-13  
PAGE 0A


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER   | 1 2 3 4 5 6 7 | NOMENCLATURE                                                                                                                               | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|---------------|---------------|--------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 13                                                      |               |               | HARDWARE INSTL-LAV E<br>(EQUIPMENT/FURNISHINGS<br>ONLY)                                                                                    | 417999            |                      |
| - 1                                                     | MODREF696326  |               | HARDWARE INSTL-LAV E<br>(EQUIPMENT/FURNISHINGS<br>ONLY)<br>MODULE NUMBER:<br>417A1160-5 REV D<br>FOR OTHER SYS DETAILS SEE:<br>38-31-51-72 | 417503            | RF                   |
| - 1                                                     | MODREF766957  |               | HARDWARE INSTL-LAV E<br>(EQUIPMENT/FURNISHINGS<br>ONLY)<br>MODULE NUMBER:<br>417A1160-5 REV E<br>FOR OTHER SYS DETAILS SEE:<br>38-31-51-72 | 504530            | RF                   |
| - 1                                                     | MODREF789220  |               | HARDWARE INSTL-LAV E<br>(EQUIPMENT/FURNISHINGS<br>ONLY)<br>MODULE NUMBER:<br>417A1160-5 REV F<br>FOR OTHER SYS DETAILS SEE:<br>38-31-51-72 | 531999            | RF                   |
|                                                         | 5 1002CC15    |               | .JUMPER ASSY<br>SUPPLIER CODE:<br>V1FF12<br>SPECIFICATION NUMBER:<br>BACJ40A30-15<br>ATTACHING PARTS                                       | 417999            | 1                    |
| - 10                                                    | NAS1149D0416H |               | .WASHER                                                                                                                                    | 417999            | 2                    |
| - 15                                                    | PLH54CD       |               | .NUT<br>SUPPLIER CODE:<br>VF0224<br>SPECIFICATION NUMBER:<br>BACN10YR4CD<br>OPTIONAL PART:<br>H52732-4CD<br>V15653                         | 417999            | 2                    |
| - 15                                                    | PLH54CD       |               | .NUT-<br>SUPPLIER CODE:<br>V62554<br>MISCELLANEOUS DATA:<br>SPECIFICATION NUMBER<br>BACN10YR4CD                                            | 417999            | 2                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |               |               |                                                                                                                                            |                   |                      |

- ITEM NOT ILLUSTRATED

RYR

25-40-51-13

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-51  
 FIG. 13  
 PAGE 1  
 DEC 15/18


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM | PART NUMBER   | 1 2 3 4 5 6 7 | NOMENCLATURE                                                                                                                                                              | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|-------------|---------------|---------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 13<br>- 15  | H52732-4CD    | .NUT-         | SUPPLIER CODE:<br>V15653<br>MISCELLANEOUS DATA:<br>SPECIFICATION NUMBER<br>BACN10YR4CD<br>OPTIONAL PART:<br>PLH54CD<br>V62554<br>-----*-----                              | 417999            | 2                    |
| 20          | SLC4B8        | .PIN-         | SUPPLIER CODE:<br>V16258<br>SPECIFICATION NUMBER:<br>BACP18AM4B8HC<br>OPTIONAL PART:<br>LG4CB8<br>V83014<br>BLC4B8S<br>V84256<br>STANDARD SUBSTITUTION:<br>BACP18AM4B08HC | 417999            | 2                    |
| 20          | BLC4B9S       | .PIN-         | SUPPLIER CODE:<br>V84256<br>SPECIFICATION NUMBER:<br>BACP18AM4B9HC<br>OPTIONAL PART:<br>LG4CB9<br>V83014<br>SLC4B9<br>V16258<br>STANDARD SUBSTITUTION:<br>BACP18AM4B09HC  | 417999            | 2                    |
| 25          | NAS1149E0463P | .WASHER       |                                                                                                                                                                           | 417999            | 2                    |
| 26          | 401W1290-272  | .ROD ASSY-TIE |                                                                                                                                                                           | 417999            | 1                    |
| 27          | BACN11U6CD2N  | ..NUT         |                                                                                                                                                                           | 417999            | 2                    |
| 28          | 411A1290-207  | ..ROD END     |                                                                                                                                                                           | 417999            | 2                    |
| 29          | 401W1291-272  | ..ROD         |                                                                                                                                                                           | 417999            | 1                    |
| 30          | 1587-1        | .ROD-TIE      | SUPPLIER CODE:<br>V34742<br>MISCELLANEOUS DATA:<br>401W1290-272 IS BOEING<br>PREFERRED SPARE PART.                                                                        | 417999            | 1                    |
| 30          | 1454-3        | .ROD-TIE      | SUPPLIER CODE:<br>V34742                                                                                                                                                  | 417999            | 1                    |
| 30          | 401W1290-273  | .ROD ASSY-TIE |                                                                                                                                                                           | 417999            | 1                    |

ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE

- ITEM NOT ILLUSTRATED

R Y R

25-40-51-13

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-51  
 FIG. 13  
 PAGE 2  
 DEC 15/23


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 | NOMENCLATURE | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|---------------|--------------|-------------------|----------------------|
| 13                                                      |                |               |              |                   |                      |
| 35                                                      | NAS1922-0100-3 | .             | CLAMP        | 417999            | 1                    |
| 40                                                      | BACB30NM3K9    | .             | BOLT         | 417999            | 8                    |
| 45                                                      | NAS1149C0332R  | .             | WASHER       | 417999            | 8                    |
| 50                                                      | 417A1130-55    | .             | SHIM-        | 417999            | AR                   |
| 50                                                      | 417A1130-65    | .             | SHIM-        | 417999            | AR                   |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |               |              |                   |                      |

— ITEM NOT ILLUSTRATED


R Y R

25-40-51-13

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

25-40-51  
 FIG. 13  
 PAGE 3  
 DEC 15/23

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

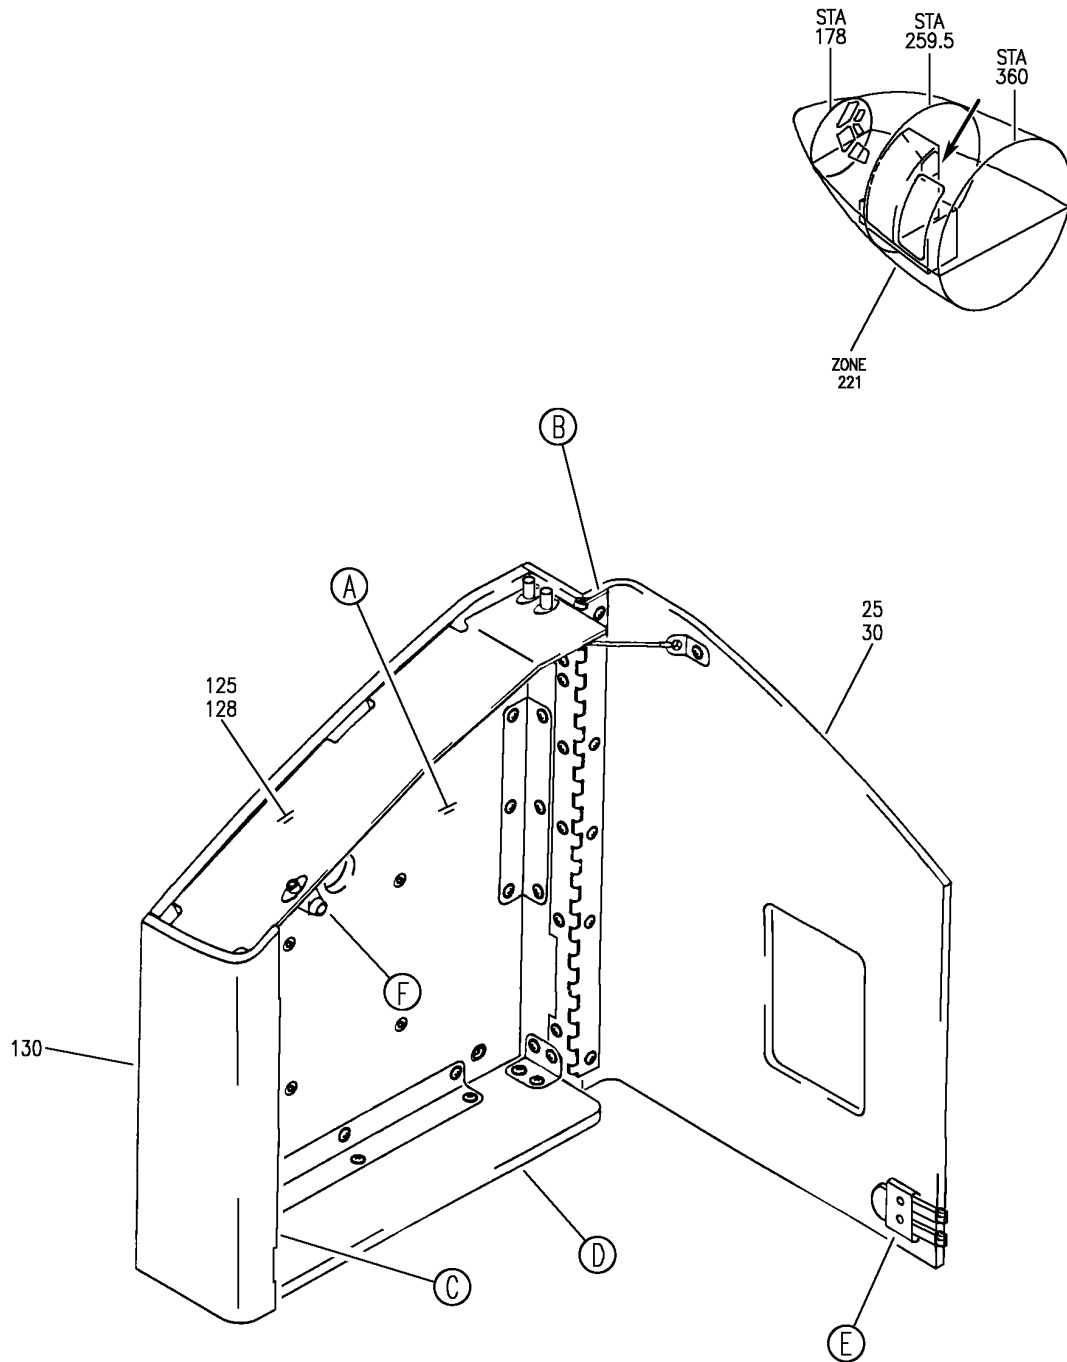


E 25405120 SHT 1 REV 321

BOX ASSY-STOWAGE  
FIGURE 20 (SHEET 1)

**25-40-51-20**

R/YR  
APR 15/23

25-40-51-20  
PAGE 0

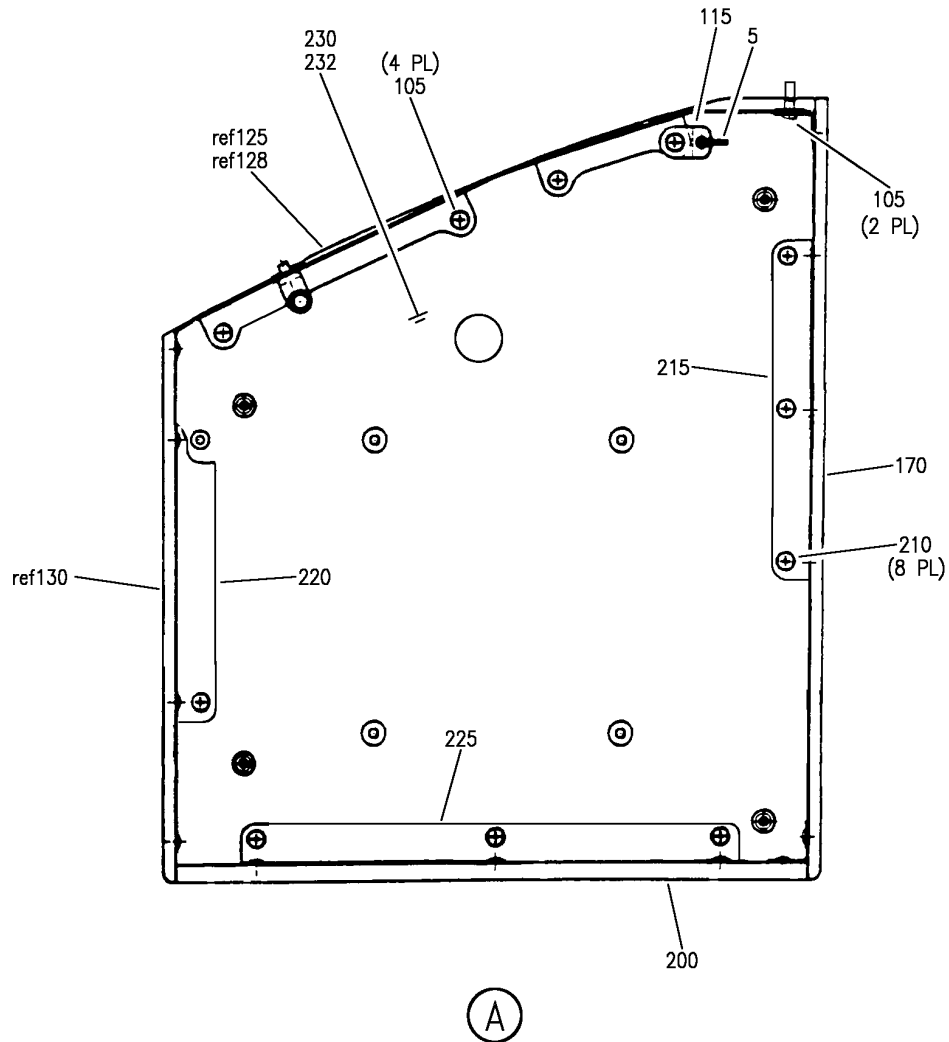

E 25405120 SHT 2 REV 321


BOX ASSY-STOWAGE  
FIGURE 20 (SHEET 2)

**25-40-51-20**

R Y R  
APR 15 / 23

25-40-51-20  
PAGE 0A

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

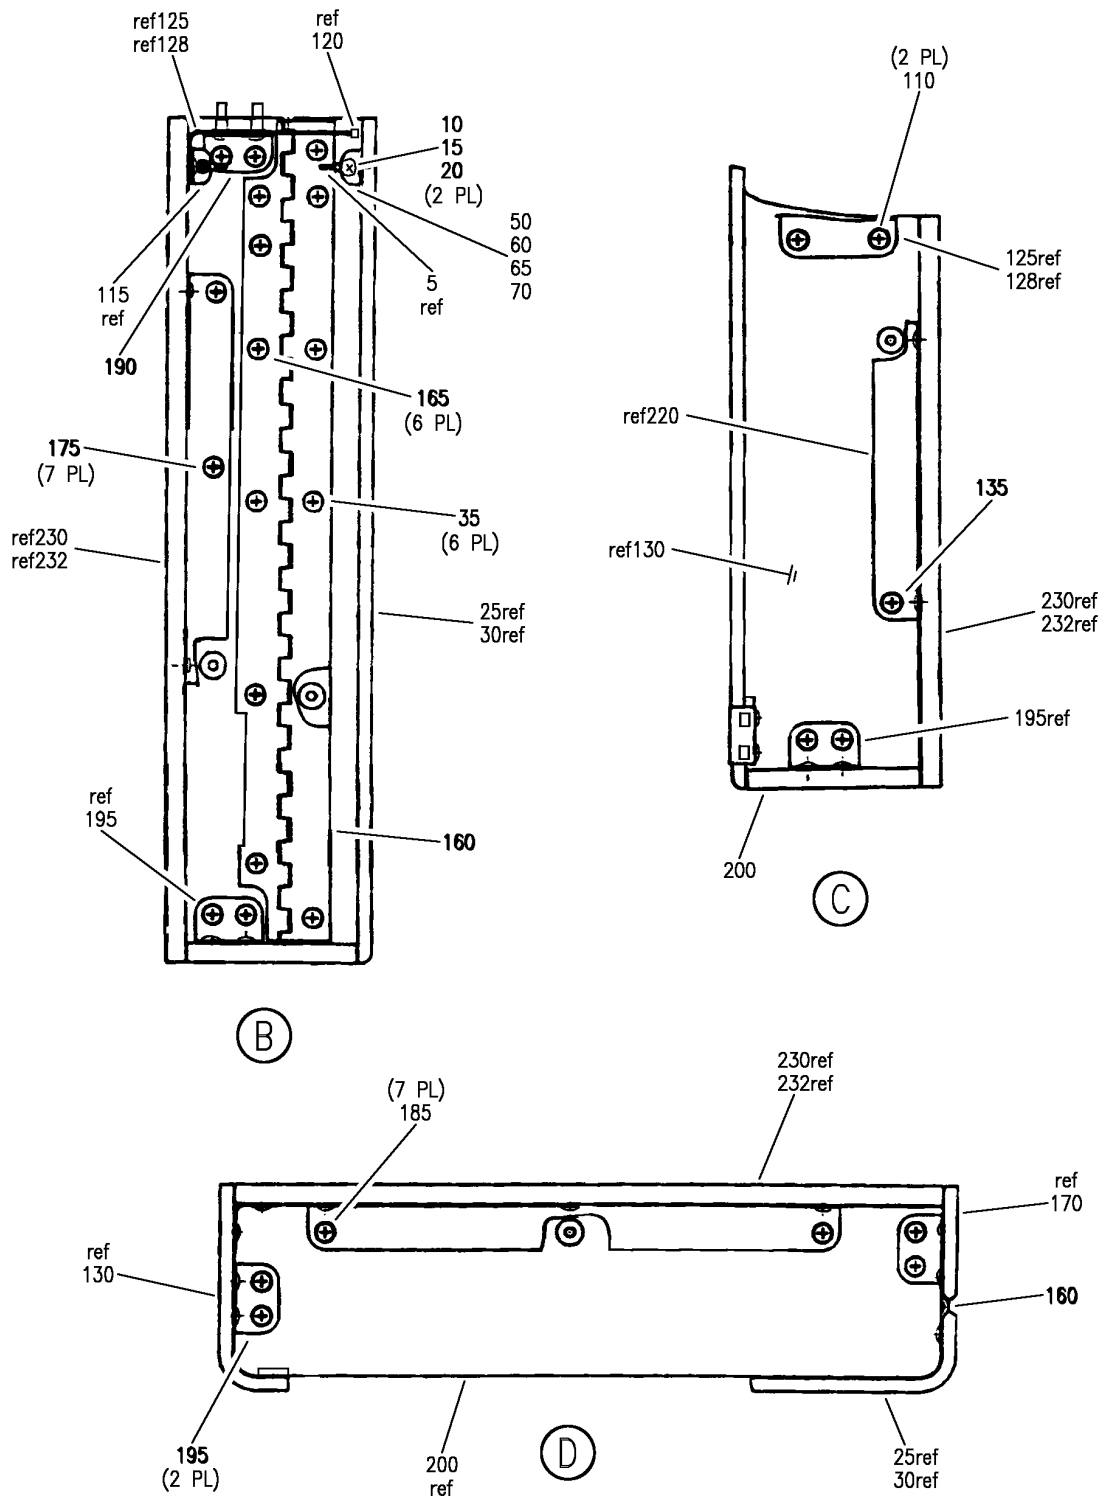



BOX ASSY-STOWAGE  
FIGURE 20 (SHEET 3)

**25-40-51-20**

R Y R  
APR 15 / 23

25-40-51-20  
PAGE 08

**BOEING**  
737-600/700/800/900  
PARTS CATALOG (MAINTENANCE)

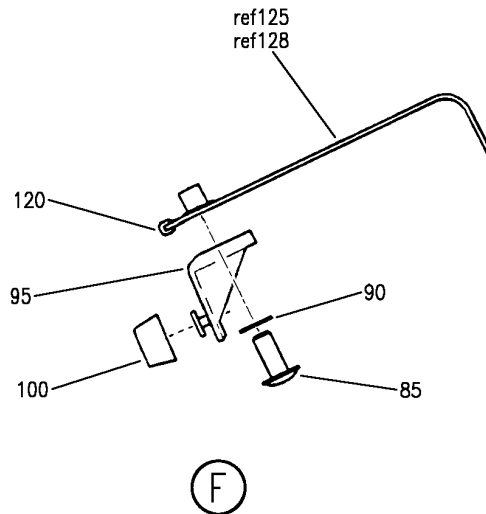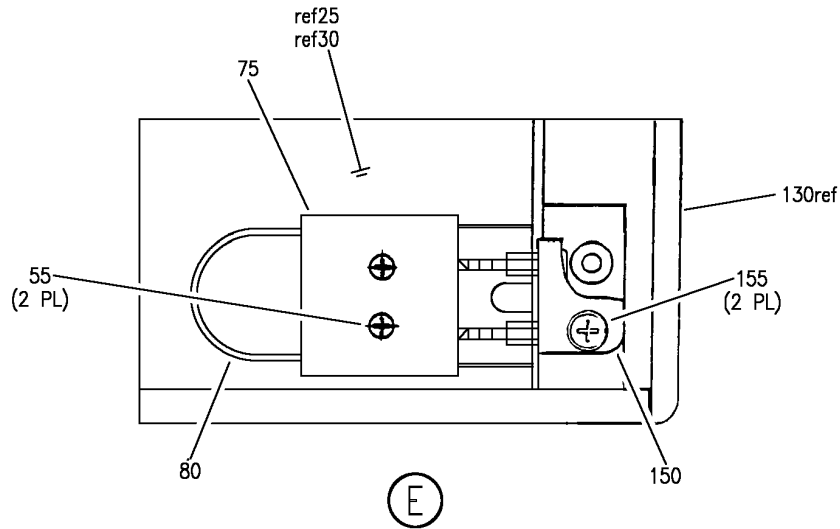

E 25405120 SHT 4 REV 321

BOX ASSY-STOWAGE  
FIGURE 20 (SHEET 4)

**25-40-51-20**

R Y R  
APR 15 / 23

25-40-51-20  
PAGE 0C

ECCN 9E991 BOEING PROPRIETARY – See title page for details.




**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER   | 1 2 3 4 5 6 7 | NOMENCLATURE                                                                                                                                                                                                                                                                                                                                                                                                                                                                     | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|---------------|---------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 20                                                      |               |               |                                                                                                                                                                                                                                                                                                                                                                                                                                                                                  |                   |                      |
| - 1                                                     | H0656-200P    |               | BOX ASSY-STOWAGE<br>BOX ASSY-STOWAGE<br>SUPPLIER CODE:<br>V12794<br>COMPONENT MAINT MANUAL REF:<br>25-21-01<br>QUALIFIED I/W DATA:<br>413A2100-200B CAN<br>REPLACE OR BE REPLACED<br>BY H0656-200P ON MODEL<br>SERIES: 737-700, -800<br>AND -900ER, ONLY IF<br>INSTALLED ONTO LAV A AND<br>ATTENDANT SEAT FAMILY<br>PARTS 2110-101, 2110-118<br>OR 2110-124 ARE<br>INSTALLED ONTO LAV A.<br>FOR NHA SEE:<br>25-60-51-06                                                          | 378999<br>378416  | RF                   |
| - 3                                                     | H0656-207P    |               | BOX ASSY-STOWAGE<br>SUPPLIER CODE:<br>V12794<br>FUNCTIONAL DESCRIPTION:<br>PART PROVIDES STORAGE<br>FOR EMERGENCY EQUIPMENT.<br>COMPONENT MAINT MANUAL REF:<br>25-21-01<br>QUALIFIED I/W DATA:<br>413A2100-407B CAN<br>REPLACE OR BE REPLACED<br>BY H0656-207P ON MODEL<br>SERIES: 737-800 AND<br>737-900ER, ONLY IF<br>INSTALLED ONTO LAV A AND<br>ATTENDANT SEAT FAMILY<br>PARTS 2110-101, 2110-118<br>OR 2110-124 ARE INSTALLED<br>ONTO LAV A.<br>FOR NHA SEE:<br>25-60-51-10 | 417999            | RF                   |
| 5                                                       | 1163323156-25 |               | . LANYARD-<br>SUPPLIER CODE:<br>V1VXG5<br>ATTACHING PARTS                                                                                                                                                                                                                                                                                                                                                                                                                        | 378999            | 1                    |
| 10                                                      | BACS12CK06-6  |               | . SCREW                                                                                                                                                                                                                                                                                                                                                                                                                                                                          | 378999            | 2                    |
| 15                                                      | NAS1149DN632J |               | . WASHER                                                                                                                                                                                                                                                                                                                                                                                                                                                                         | 378999            | 2                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |               |               |                                                                                                                                                                                                                                                                                                                                                                                                                                                                                  |                   |                      |

- ITEM NOT ILLUSTRATED

RYR

25-40-51-20

ECCN 9E991 BOEING PROPRIETARY - See title page for details.

25-40-51  
 FIG. 20  
 PAGE 1  
 APR 15/23

 **BOEING**  
737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER    | 1 2 3 4 5 6 7 NOMENCLATURE                                                                       | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|----------------|--------------------------------------------------------------------------------------------------|-------------------|----------------------|
| 20                                                      |                |                                                                                                  |                   |                      |
| 20                                                      | MS21042L06     | .NUT-<br>STANDARD SUBSTITUTION:<br>BACN11AG06<br>TRUE PART NUMBER:<br>MS21042-L06<br>-----*----- | 378999            | 2                    |
| 25                                                      | H0660-12P      | .PANEL-DOOR<br>SUPPLIER CODE:<br>V12794                                                          | 378416            | 1                    |
| 25                                                      | H0660-12P      | .PANEL-DOOR<br>SUPPLIER CODE:<br>V12794<br>ATTACHING PARTS                                       | 417999            | 1                    |
| 35                                                      | BACS12FA3K3    | .SCREW<br>-----*-----                                                                            | 378999            | 6                    |
| 50                                                      | BACS12FA3K4    | .SCREW                                                                                           | 378999            | 1                    |
| 55                                                      | BACS12CK3-4    | .SCREW                                                                                           | 378999            | 2                    |
| 60                                                      | MS35333-39     | .WASHER                                                                                          | 378999            | 1                    |
| 65                                                      | H0662-11       | .ANGLE-<br>SUPPLIER CODE:<br>V12794                                                              | 378999            | 1                    |
| 70                                                      | H0662-21       | .DOUBLER-<br>SUPPLIER CODE:<br>V12794                                                            | 378999            | 1                    |
| 75                                                      | H0662-23       | .CHANNEL-<br>SUPPLIER CODE:<br>V12794                                                            | 378999            | 1                    |
| 80                                                      | SAM271-7RD     | .LATCH ASSY-<br>SUPPLIER CODE:<br>V31845                                                         | 378999            | 1                    |
| 85                                                      | BACS12FA3K8    | .SCREW                                                                                           | 378999            | 1                    |
| 90                                                      | MS35333-39     | .WASHER                                                                                          | 378999            | 1                    |
| 95                                                      | 412N1162-1     | .BRACKET                                                                                         | 378999            | 1                    |
| 100                                                     | 412N1245-1     | .BUMPER                                                                                          | 378999            | 1                    |
| 105                                                     | BACS12FA3K5    | .SCREW                                                                                           | 378999            | 6                    |
| 110                                                     | BACS12FA3K3    | .SCREW                                                                                           | 378999            | 2                    |
| 115                                                     | H0662-13       | .ANGLE-<br>SUPPLIER CODE:<br>V12794                                                              | 378999            | 1                    |
| 120                                                     | BACG20ZA002000 | .GROMMET-<br>STANDARD SUBSTITUTION:<br>BACG20Z-A002000<br>TRUE PART NUMBER:<br>BACG20Z-A002000   | 378999            | 1                    |
| 125                                                     | H0661-5        | .TOP-<br>SUPPLIER CODE:<br>V12794                                                                | 378999            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |                |                                                                                                  |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R

25-40-51-20

ECCN 9E991 BOEING PROPRIETARY — See title page for details.

25-40-51  
FIG. 20  
PAGE 2  
AUG 15/24


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER | 1 2 3 4 5 6 7 | NOMENCLATURE                                                    | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|-------------|---------------|-----------------------------------------------------------------|-------------------|----------------------|
| 20                                                      |             |               |                                                                 |                   |                      |
| 130                                                     | H0659-13P   |               | .PANEL ASSY-SIDE<br>SUPPLIER CODE:<br>V12794<br>ATTACHING PARTS | 378999            | 1                    |
| 135                                                     | BACS12FA3K3 |               | .SCREW<br>-----*-----                                           | 378999            | 4                    |
| 150                                                     | H0664-1     |               | .STRIKER-<br>SUPPLIER CODE:<br>V12794<br>ATTACHING PARTS        | 378999            | 1                    |
| 155                                                     | BACS12FA3K4 |               | .SCREW<br>-----*-----                                           | 378999            | 2                    |
| 160                                                     | H0663-13    |               | .HINGE-<br>SUPPLIER CODE:<br>V12794<br>ATTACHING PARTS          | 378999            | 1                    |
| 165                                                     | BACS12FA3K3 |               | .SCREW<br>-----*-----                                           | 378999            | 6                    |
| 170                                                     | H0659-17P   |               | .PANEL ASSY-SIDE<br>SUPPLIER CODE:<br>V12794                    | 378416            | 1                    |
| 170                                                     | H0659-17P   |               | .PANEL ASSY-SIDE<br>SUPPLIER CODE:<br>V12794<br>ATTACHING PARTS | 417999            | 1                    |
| 175                                                     | BACS12FA3K3 |               | .SCREW<br>-----*-----                                           | 378999            | 7                    |
| 185                                                     | BACS12FA3K5 |               | .SCREW                                                          | 378999            | 7                    |
| 190                                                     | H0662-15    |               | .ANGLE ASSY-<br>SUPPLIER CODE:<br>V12794                        | 378999            | 1                    |
| 195                                                     | H0662-1     |               | .ANGLE-<br>SUPPLIER CODE:<br>V12794                             | 378999            | 2                    |
| 200                                                     | H0658-2     |               | .PANEL ASSY-BOTTOM<br>SUPPLIER CODE:<br>V12794                  | 378999            | 1                    |
| 210                                                     | BACS12FA3K5 |               | .SCREW                                                          | 378999            | 8                    |
| 215                                                     | H0662-17    |               | .ANGLE-<br>SUPPLIER CODE:<br>V12794                             | 378999            | 1                    |
| 220                                                     | H0662-5     |               | .ANGLE-<br>SUPPLIER CODE:<br>V12794                             | 378999            | 1                    |
| 225                                                     | H0662-7     |               | .ANGLE-<br>SUPPLIER CODE:<br>V12794                             | 378999            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |             |               |                                                                 |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R

25-40-51-20

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

25-40-51  
 FIG. 20  
 PAGE 3  
 AUG 15/24


**BOEING**  
 737-600/700/800/900  
**PARTS CATALOG (MAINTENANCE)**

| FIG<br>ITEM                                             | PART NUMBER | 1 2 3 4 5 6 7 | NOMENCLATURE                                 | EFFECT<br>FROM TO | UNITS<br>PER<br>ASSY |
|---------------------------------------------------------|-------------|---------------|----------------------------------------------|-------------------|----------------------|
| 20                                                      |             |               |                                              |                   |                      |
| 230                                                     | H0657-32P   |               | .PANEL ASSY-BACK<br>SUPPLIER CODE:<br>V12794 | 378416            | 1                    |
| 230                                                     | H0657-39P   |               | .PANEL ASSY-BACK<br>SUPPLIER CODE:<br>V12794 | 417999            | 1                    |
| ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE |             |               |                                              |                   |                      |

— ITEM NOT ILLUSTRATED

R Y R

# 25-40-51-20

ECCN 9E991 BOEING PROPRIETARY – See title page for details.

25-40-51  
 FIG. 20  
 PAGE 4  
 AUG 15/24