
KA ENGINEERING GROUP

ASMER HOUSE | ROOF SUPPORT LAYOUT ON CLIENT GA

P03 · ENGINEER REVIEW · ALL DIMENSIONS IN mm · WRITTEN SURVEY DIMENSIONS GOVERN · DO NOT SCALE

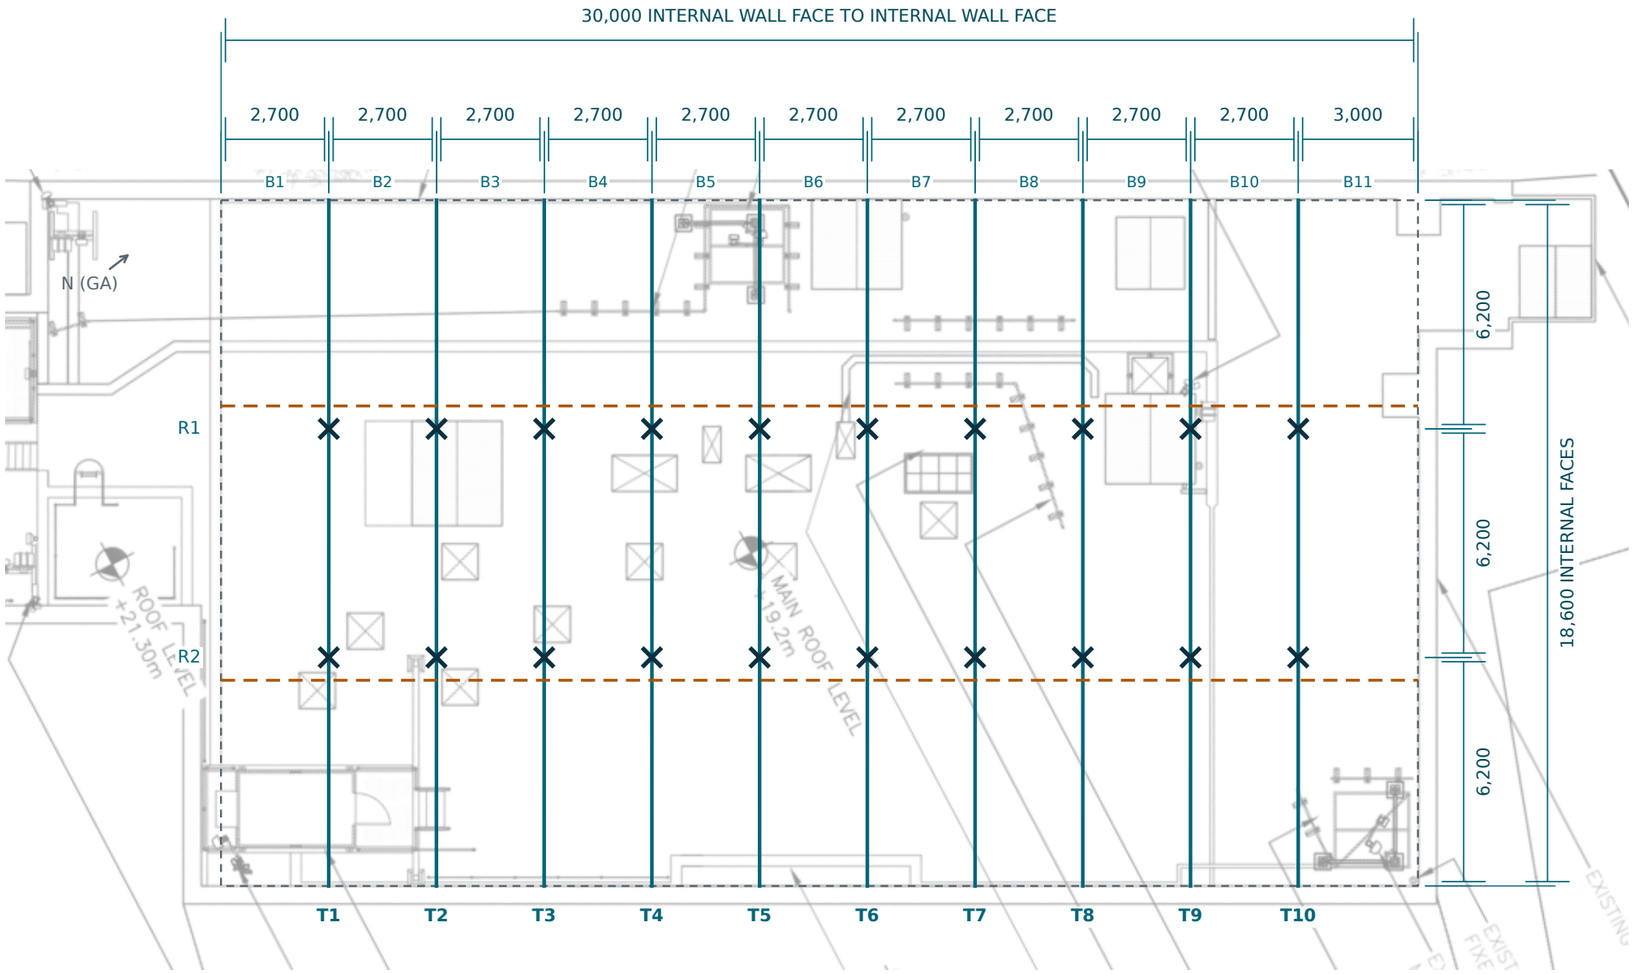

MAIN RECTANGLE ONLY — STEPPED SECTIONS AT BOTH ENDS EXCLUDED

DIMENSION REFERENCES


B1: internal wall face → T1 centreline. B2–B10: beam centreline → beam centreline. B11: T10 centreline → internal wall face.

Across roof: internal wall face → R1 column centreline → R2 column centreline → internal wall face; each span 6,200.

REVIEW NOTES

1. Blue solid lines: 10 internal transverse beams. Crosses: 20 internal columns. T1–T10 and R1/R2 are introduced review labels.
2. Orange dashed lines: longitudinal beams, continuous for this sketch and connected to transverse beams, not directly to columns.
   Their displayed offsets are schematic only; exact positions and section sizes were not verified. End details are unverified.
3. Transverse beam ends are assumed to terminate at external load-bearing walls; actual support details unverified. End-wall beams not confirmed.
4. Original GA retained as context, rotated for readability. Member marks are diagrammatic; no PDF-scale dimensions or setting-out coordinates inferred.
5. Review the selected main-rectangle extent and member arrangement. This sheet is not structural approval and is not for construction.

KA-ASM-SK-003 | P03 | Sources: Survey Notes p3, GA 200 Rev A (PDF p3), and engineering lead clarifications | A3 landscape

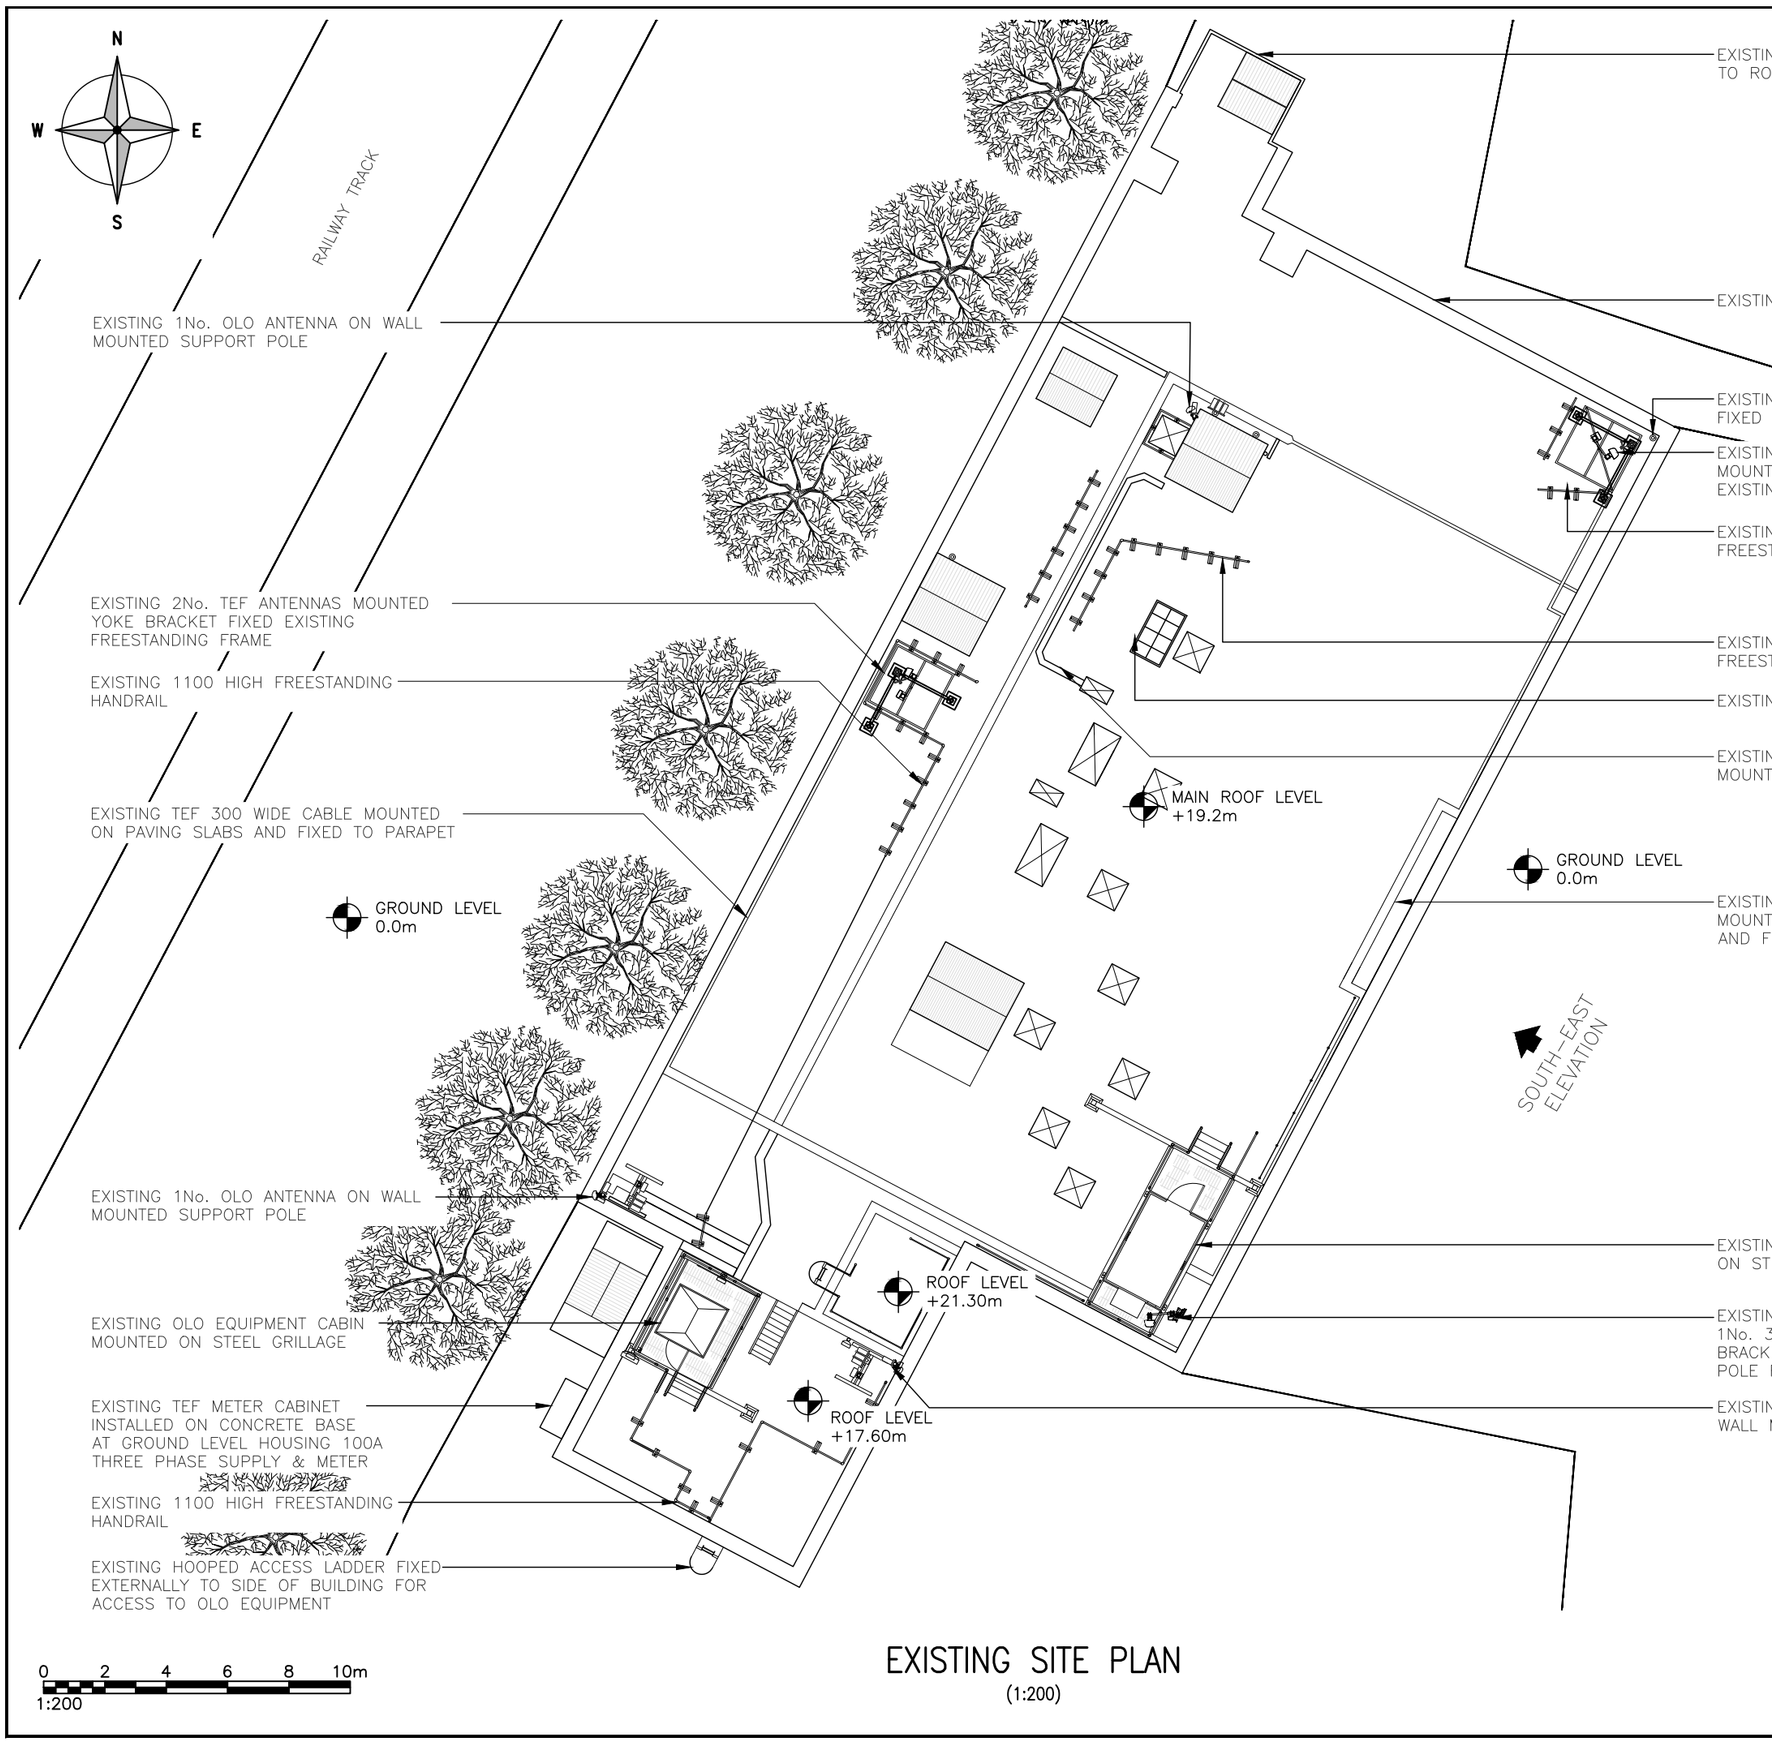

EXISTING SITE PLAN
(1:200)

SOURCE REFERENCE · CLIENT GA 200 REV A

Original drawing retained below. Review annotations and supplied survey dimensions are on page 1.