Measurement windows and boundary conditions, to scale

longitudinal (exp 1)
$\varphi = 90^\circ$, 3486 pts × 9 steps, mesh 2x2
length along y = 16.53 mm, width 8.72 mm
area 144.18 mm^2

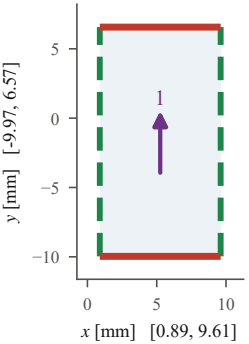

transverse-raw (exp 2)
$\varphi = 0^\circ$, 3485 pts × 9 steps, mesh 2x2
length along y = 16.96 mm, width 8.37 mm
area 142.01 mm^2

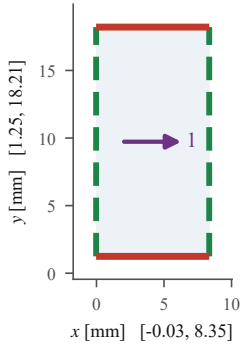

45deg (exp 3)
$\varphi = 45^\circ$, 1978 pts × 9 steps, mesh 2x2
length along y = 9.27 mm, width 8.87 mm
area 82.19 mm^2

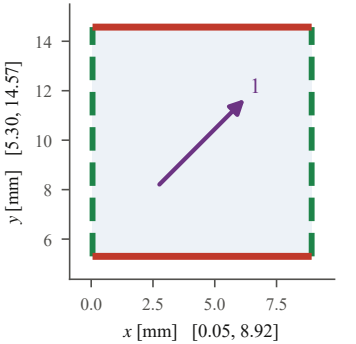

loaded cut (W, tangential slope, $W_{XY} = 0$; normal rotation carries M)
free edge (unconstrained: $M_{nn} = 0$, $V_n = 0$)
material 1-axis