

Description: Clay apron feeder left geared motor

Account Information

ID: 208948

Name: Reliance Heavy Industries

Address: Kattameya-Sokhna Road, Suez, 00000 EG

Sample Information

Sample ID: 26124405207

Service Level: **Enhanced**

Bottle ID: b105176151

Tested Lubricant: MOBIL SHC 630

Equipment Information

Asset Class: Gear Drive

Manufacturer: **BREVINI**


Model: SL2PLB08516/FS/223.8/IEC 225 C

Lubricant: MOBIL SHC 630


Sample Data & Trends

Sample Info	Report Status	Normal	Alert	Alert	Caution	Caution
	Sample ID	24268239205	25079203252	25258159251	25294210214	26124405207
	Service Level	Enhanced	Enhanced	Enhanced	Enhanced	Enhanced
	Bottle ID	b088838848	b098267666	b098287124	b098270692	b105176151
	Tested Lubricant	MOBIL SHC 630	MOBIL SHC 630	MOBIL SHC 630	MOBIL SHC 630	MOBIL SHC 630
	Sampled	10 Sep 2024	10 Mar 2025	09 Sep 2025	16 Oct 2025	26 Apr 2026
	Reported	25 Sep 2024	24 Mar 2025	17 Sep 2025	22 Oct 2025	05 May 2026
	Equipment Age					
	Oil Age					
	Make-up Volume					
Lubricant	Oil Changed					
	Filter Changed					
	Contamination Rating	Normal	Alert	Alert	Normal	Caution
	Equipment Rating	Normal	Alert	Alert	Normal	Normal
	Lubricant Rating	Normal	Alert	Caution	Caution	Normal
	ISO Code (4/6/14)	21/20/17			22/21/20	22/21/20
	Particle Count >4um	13956			23161	31900
	Particle Count >6um	7828			10076	19089
	Particle Count>14um	1003			5161	6160
	PQ Index	7	1150	262	5	6
Wear (ppm)	Visc@40C (cSt)	208.6	216.9	199.2	249.7	222.3
	TAN (mg KOH/g)	1.12	2.10	1.50	0.89	1.26
	Water (Vol%)	0.010	0.200	0.200	<0.003	0.010
	Ag (Silver)	0	0	0	0	0
	Al (Aluminum)	4	14	20	3	0
	Cr (Chromium)	1	3	6	0	0
	Cu (Copper)	0	3	5	2	0
	Fe (Iron)	29	99	314	0	15
	Mo (Molybdenum)	0	0	0	0	0
	Ni (Nickel)	0	0	0	0	0
Contaminant (ppm)	Pb (Lead)	0	0	0	0	0
	Sn (Tin)	0	0	0	0	0
	K (Potassium)	0	2	2	0	0
Additive (ppm)	Na (Sodium)	0	0	10	0	0
	Si (Silicon)	23	17	28	3	35
	B (Boron)	3	2	26	0	17
	Ba (Barium)	0	0	0	0	0
	Ca (Calcium)	1	71	110	8	16
	Mg (Magnesium)	0	10	3	0	0
	P (Phosphorus)	408	411	383	436	471
Zn (Zinc)	5	52	2	20	11	


Viscosity

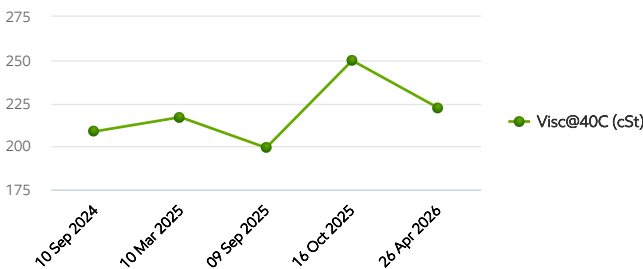


Wear

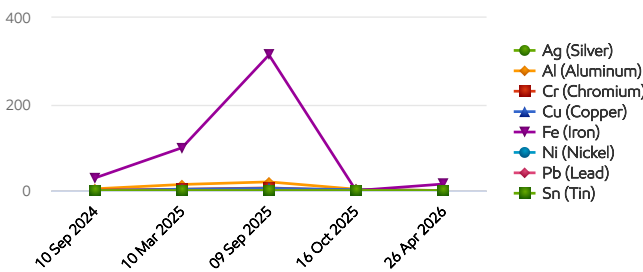

Contaminants

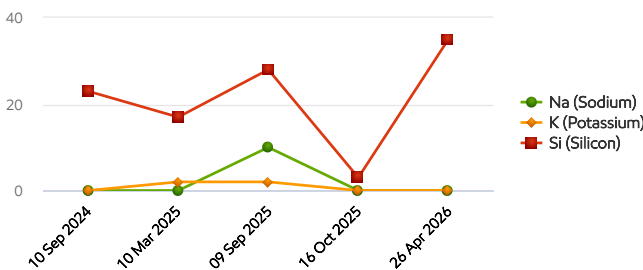

Physical Properties

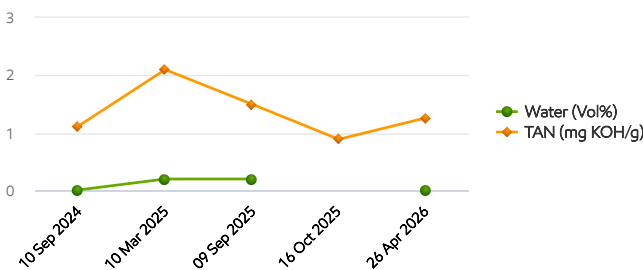

		Caution	
		Unit ID: 111.AF040 (L)	Asset ID: 30921624
		Description: Clay apron feeder left geared motor	
Account Information		Sample Information	Equipment Information
ID: 208948 Name: Reliance Heavy Industries Address: Kattameya-Sokhna Road, Suez, 00000 EG		Sample ID: 26124405207 Service Level: Enhanced Bottle ID: b105176151 Tested Lubricant: MOBIL SHC 630	Asset Class: Gear Drive Manufacturer: BREVINI Model: SL2PLB08516/FS/223.8/IEC 225 C Lubricant: MOBIL SHC 630
Recommendation/Comments			
CAUTION - ELEVATED SILICON LEVEL. Determine source of Silicon (Si) and take corrective action. If the silicon level is elevated for the first time with no history of an increasing trend, then resample immediately to confirm condition. If wear metals levels are low, then the silicon likely exists in a non-abrasive form. Possible sources of non-abrasive silicon include: a. Defoamants; b. Sealant compounds. If wear metal levels are elevated, then the silicon likely exists in an abrasive form. Possible sources of abrasive silicon include: a. Abrasive dirt remaining in equipment due to ineffective purification and / or filtration; b. Faulty seals, breather, fill caps; c. Improper sampling techniques that result in dirt contaminating the sample. The oil may be unfit for continued use and should be monitored closely for further condition regressions. Prolonged usage of lubricants with elevated levels of abrasive silicon can cause severe wear and damage to the equipment. Inspect the equipment for signs of excessive wear. Change the oil immediately if the condition escalates. Contact your ExxonMobil representative for further assistance if necessary.			
Sample Timeline			
<u>26 Apr 2026 10:23 AM - Hassan Mostafa - In Service Oil Sample</u>: Comments: Photo:			