Applying Automotive EDR Data to Traffic Crash Reconstruction

Instructors: Richard R. Ruth & Lisa Fodale

ID#: C1210



Produced by
SAE International
Professional Development

This program is protected by copyright. No portion of this program may be stored or reproduced in any form, or by any means, without prior written permission from SAE International. Any reuse, rebroadcast or retransmission of any of the information contained herein, in any media, is strictly prohibited.

Learning Objectives: General

1. ***Describe the EDR system to others***
2. ***Explain the CDR report in the context of the case***
3. ***Locate data important to case within CDR report***
4. ***Understand the accuracy & reliability of EDR information***

Learning Objectives – Specific

1. ***Determine if EDR recording is from your event (and which part of your event)***
2. ***Learn EDR speed is right if the speedometer is right – recognize 6 vehicle operational conditions and 3 equipment modifications affecting speed accuracy***
3. ***Calculate Min/Max range of speeds at impact from last EDR speed data point***

Learning Objectives - Specific:

4. ***Reconcile EDR speed at impact with other physical evidence***
5. ***Do time distance analysis and place EDR data on google earth photo or map of scene***
6. ***Use Accel Pedal, Brake, ABS, RPM, Wheel speed, and stability control data to better understand crash causation***
7. ***Use ADAS data when available***

Learning Objectives - Specific:

8. *Use Delta V of vehicle with EDR to get Delta V of vehicle without EDR*
9. *Calculate Speed at Impact from Delta V and Post Crash Travel to Uncontrolled Rest*
10. *Calculate Closing Speed by combining 2 Delta V's and adjusting for restitution and offset*
11. *Calculate Speed at impact of Vehicle without EDR from Closing Speed*
12. *Recognize special circumstances when Delta V is understated or overstated in EDR*

Learning Objectives - Specific:

13. ***Understand Principal Direction of Force (PDOF), what you can use it for and why it's important***

Instructor Intro

Rick Ruth



- Ford Motor Company Product Development Engineering - Airbag Design and Field Performance 1973-2006
- Ford's lead field user of EDR's, Ford EDR policy committee, Ford Rep to SAE & EDR Committee, Ford Rep to Bosch CDR
- 2007-present, Ruth Consulting LLC – Airbags and EDR in Recon
- Teach EDR tech, EDR Analyst 1 & 2 classes for IPTM and EDR for SAE. Presents regularly at national and regional conferences on reconstruction, on EDR's.
- Does research on EDR accuracy – 19 publications
- Helps prosecutors and cops nationwide in EDR cases – mostly for free (charge for written reports and testimony).
- Takes civil cases in airbags and EDR aspect of Recon

Instructor Intro

Lisa Fodale



- BSEE Ohio State ‘92, MSEE Oakland ‘94
- Dynamic Analysis Group 2024-current, Principal Engr
- Stellantis (Chrysler) 1992-2024
  - Product Analysis Group 2007-2024, Manager 21-24
  - Safety & Electronics Product Development 1992-2006
  - SAE EDR committee, Secretary of Committee
  - Stellantis Interface to Bosch CDR - compiled data limitations.
  - Fielded EDR Questions for Stellantis.
  - Recognized as lead reader and interpreter of Stellantis EDR’s.
- Holds two patents on airbag technology

Student Background = tell us

- **Our typical student works in accident reconstruction and has been trained to do slide to stop and momentum calculations. But many SAE students are not typical.**
- **1. Are you typical? More or less trained in reconstruction? Specialties?**
- **2. Any prior EDR training (none expected)?**
- **3. If you are not “typical”, what do you hope to learn from this class? NHTSA defect investigations?**

June 2025 Student Intros 1

First Name	Last Name	Company	Job Title
Amanda	Duran	Carr Engineering Inc	Principal Engineer
Andrew	Polk	Wolf Technical Services	Forensic engineer
Brandon	Line	Collison Analysis (Calgary) Ltd	Engineering in Training
Harriss	Ganey	HCN Ganey	Human Factors Scientist
Jeremy	Aparicio	Nederveld Inc	Forensic Mechanical Engineer
John	Abercrombie	BRC	Consultant
John	Foster	Waterloo Regional Police Service	Constable
John	Pierce	Exponent Inc	Senior Associate
Karen	Khachatryan		Unemployed
Kenneth	Ogbonnaya	S-E-A Limited	Mechanical Engineer

June 2025 Student Roster 2

Lance	Cook	University of North Florida	
Madelyn	Quirk	Explico Engineering Co	Human Factors Scientist
Matthew	Freda	SEA Limited	Mechanical Engineer
Nicholas	Civitanova	ESI	Staff Consultant
Nicholas	Gomez	Biomechanics Advanced	Bioengineer
Patricia	Donnelly	Explico Engineering Co	Associate Scientist
Susie	Xie	Kia America	Engineer
Tom	Bonadies	S-E-A	Mechanical Consultant
Yun	Cai	Explico Engineering Co	Senior Scientist
Zachary	Cathcart	Rimkus Consulting Group Inc	Mechanical Engineer VAR



EDR Data Analysis Overview

- Introduction
- EDR Data is a game changer and gives new insight into crash reconstruction
- Minimum “basic knowledge” required to understand and apply EDR Data
- Lots of Details to check before declaring success/understanding
- This training module outlines the basic knowledge required.

Some Brief History

1. Pre-1994 Early airbag sensors were mechanical

2. Electronic sensors were first introduced by GM in 1994. Decision to deploy airbags is made in working (RAM) memory which only functions when power is on.

3. GM decided they needed to know is system worked properly, designed system to record basic inputs and outputs in EEPROM memory that can be retrieved after crash.

Early decisions in EDR's

1. GM measured acceleration 800 times per second.
2. The airbag usually deploys early in the crash, in the first 10-20 milliseconds
3. The typical frontal crash pulse lasts 100 to 150 milliseconds.

Early Decisions

1. There was not enough EEPROM memory to record all the acceleration data in those early days.
2. GM decided to calculate the change in velocity from the raw acceleration data and record that once every 10ms.
3. At that time the sensor measured only acceleration in the frontal (longitudinal) direction.
4. GM recorded in airbag deployments, but also decided to record in non-deployments

Early EDR History

1. In 1999 GM attached the airbag control module to the vehicle CAN bus communication system so it could receive information from other modules in the car.
2. GM phased in recording vehicle speed, throttle, brake on/off, and RPM.
3. The purpose of recording was still for GM to know if its airbag system worked correctly.
4. The tool to read this data was proprietary to GM.

Early History Continued

1. GM asked the supplier of its “Tech 2” dealer diagnostic tool, Vetronix, to make a tool to read crash data for sale to the public.
2. The Vetronix **C**rash **D**ata **R**etrieval system was born in 2000.
3. **Bosch Diagnostics** bought Vetronix in the mid 2000’s.

History Marches On

1. Ford began phasing in electronic sensors in 1997 and recorded limited info.
2. Ford contracted with Vetronix/Bosch to read its limited EDR's in the early 2000's.
3. Chrysler added electronic sensors but did not record anything useful until 2005MY.
4. In 2007 they also chose Bosch CDR to allow their EDR's to be read.
5. Toyota began recording in 2001, had proprietary read out tool, switched to Bosch CDR in 2010

US Government Involvement

1. The US government was reluctant to require EDR's – "big brother is watching".
2. Started regulatory process in 2002. In 2006 they adopted a regulation that would eventually ***standardize minimum content*** of **voluntarily** installed EDR's
3. It also CHANGED THE **PURPOSE** to be for ***effective crash reconstruction***.
4. The regulation required that data could be accessed by a **publicly available** tool (no monopoly given to Bosch).
5. 49 CFR Part 563 became effective September 2012.

U.S. Part 563 EDR Regulation



Conceived in 2002
Adopted in 2006
Effective 9-1-2012
13 YEARS of GOOD EDR's
THANKS, NHTSA!!!
(& More to come 2028 MY)
(vs. China 2022/Europe 2022 for new vehicles, China 2024/Europe 2024 for exisiting platforms)

US Does not REQUIRE EDR in 2025, but if equipped MUST have standardized content! But almost all vehicles meet definition of "equipped".

Part 563 Min Data if EDR

EDR Mandatory in Europe July 2024

Table I—Data Elements Required for All Vehicles Equipped With an EDR

	Recording interval/time[1] (relative to time zero)	Data sample rate (samples per second)
Delta-V, longitudinal	0 to 250 ms or 0 to End of Event Time plus 30 ms, whichever is shorter	100
Maximum delta-V, longitudinal	0–300 ms or 0 to End of Event Time plus 30 ms, whichever is shorter	N/A
Time, maximum delta-V	0–300 ms or 0 to End of Event Time plus 30 ms, whichever is shorter	N/A
Speed, vehicle indicated	–5.0 to 0 sec	2
Engine throttle, % full (or accelerator pedal, % full)	–5.0 to 0 sec	2
Service brake, on/off	–5.0 to 0 sec	2
Ignition cycle, crash	–1.0 sec	N/A
Ignition cycle, download	At time of download[3]	N/A
Safety belt status, driver	–1.0 sec	N/A
Frontal air bag warning lamp, on/off[2]	–1.0 sec	N/A
Frontal air bag deployment, time to deploy, in the case of a single stage air bag, or time to first stage deployment, in the case of a multi-stage air bag, driver	Event	N/A
Frontal air bag deployment, time to deploy, in the case of a single stage air bag, or time to first stage deployment, in the case of a multi-stage air bag, right front passenger	Event	N/A
Multi-event, number of event	Event	N/A
Time from event 1 to 2	As needed	N/A
Complete file recorded (yes, no)	Following other data	N/A

Table II—Data Elements Required for Vehicles Under Specified Minimum Conditions

Data element name	Condition for requirement	Recording interval/ time[1] (relative to time zero)	Data sample rate (per second)
Lateral acceleration	If recorded[2]	N/A	N/A
Longitudinal acceleration	If recorded	N/A	N/A
Normal acceleration	If recorded	N/A	N/A
Delta-V, lateral	If recorded	0–250 ms or 0 to End of Event Time plus 30 ms, whichever is shorter	100
Maximum delta-V, lateral	If recorded	0–300 ms or 0 to End of Event Time plus 30 ms, whichever is shorter	N/A
Time maximum delta-V, lateral	If recorded	0–300 ms or 0 to End of Event Time plus 30 ms, whichever is shorter	N/A
Time for maximum delta-V, resultant	If recorded	0–300 ms or 0 to End of Event Time plus 30 ms, whichever is shorter	N/A
Engine rpm	If recorded	–5.0 to 0 sec	2
Vehicle roll angle	If recorded	–1.0 up to 5.0 sec[3]	10
ABS activity (engaged, non-engaged)	If recorded	–5.0 to 0 sec	2
Stability control (on, off, or engaged)	If recorded	–5.0 to 0 sec	2
Steering input	If recorded	–5.0 to 0 sec	2
Safety belt status, right front passenger (buckled, not buckled)	If recorded	–1.0 sec	N/A

EDR Mandatory in Europe July 2024

Table III—Reported Data Element Format

Details

Data element	Minimum range	Accuracy[1]	Resolution
Lateral acceleration	At option of manufacturer	At option of manufacturer	At option of manufacturer.
Longitudinal acceleration	At option of manufacturer	At option of manufacturer	At option of manufacturer.
Normal Acceleration	At option of manufacturer	At option of manufacturer	At option of manufacturer.
Longitudinal delta-V	−100 km/h to + 100 km/h	±10%	1 km/h.
Lateral delta-V	−100 km/h to + 100 km/h	±10%	1 km/h.
Maximum delta-V, longitudinal	−100 km/h to + 100 km/h	±10%	1 km/h.
Maximum delta-V, lateral	−100 km/h to + 100 km/h	±10%	1 km/h.
Time, maximum delta-V, longitudinal	0−300 ms, or 0−End of Event Time plus 30 ms, whichever is shorter	±3 ms	2.5 ms.
Time, maximum delta-V, lateral	0−300 ms, or 0−End of Event Time plus 30 ms, whichever is shorter	±3 ms	2.5 ms.
Time, maximum delta-V, resultant	0−300 ms, or 0−End of Event Time plus 30 ms, whichever is shorter	±3 ms	2.5 ms.
Vehicle Roll Angle	−1080 deg to + 1080 deg	±10%	10 deg.
Speed, vehicle indicated	0 km/h to 200 km/h	±1 km/h	1 km/h.
Engine throttle, percent full (accelerator pedal percent full)	0 to 100%	±5%	1%.
Engine rpm	0 to 10,000 rpm	±100 rpm	100 rpm.
Service brake	On or Off	N/A	On or Off.
ABS activity	On or Off	N/A	On or Off.
Stability control	On, Off, or Engaged	N/A	On, Off, or Engaged.
Steering input	−250 deg CW to + 250 deg CCW	±5%	±1%.

Are EDR's required in the US? NO

1. NHTSA issued NPRM Dec 2012 to **require** 563-EDR's 9/14
2. NPRM proposed EDR as FMVSS 405, OEM's would have to self certify EDR's and recall defective EDR's. OEM's objected.
3. Officially withdrawn Feb 2019 https://www.federalregister.gov/documents/2019/02/08/2019-01651/federal-motor-vehicle-safety-standards-event-data-recorders
4. Mfrs were NOT expected to remove EDR's – But one Land Rover model may have – now has Bosch freeze frame recorder.
5. NHTSA estimates 99.5% of new US vehicles have an EDR

Require More Data in US EDR's?

- December 4, 2015 Section 24303 of the Fixing America's Surface Transportation Act (FAST Act), Pub. L. No. 119-14 required NHTSA to conduct a study "to determine the amount of time event data recorders installed in passenger motor vehicles should capture and record"
- May 2017 Event Data Recorders Duration Study completed by Virginia Tech (poorly)
- September 2018 Report to Congress summarizing pre-crash time interval results in determining crash causation
- NHTSA issued NPRM 6-22-2022 Docket NHTSA-2022-0021

Part 563 Updates

1. NPRM 6-22/2022 Proposed increased precrash recording time to 20 sec @10X/sec for 7 data elements
2. Industry strongly disputed – others liked it
3. Final Rule issued Dec 2024, effective 9/2027
4. NHTSA has hired Jeff Muttart's human factors firm **May 2024** to come up with new desired data elements – but current political environment is "no new regulations"

UN160 (same as US Part 563 table 1)

Data element	Recording interval/time (relative to time zero)	Data sample rate
Delta-V, longitudinal	0 to 250 ms or 0 to End of Event Time plus 30 ms, whichever is shorter.	100
Maximum delta-V, longitudinal	0–300 ms or 0 to End of Event Time plus 30 ms, whichever is shorter.	N.A.
Time, maximum delta-V, longitudinal	0–300 ms or 0 to End of Event Time plus 30 ms, whichever is shorter.	N.A.
Speed, vehicle indicated	-5.0 to 0 sec	2
Engine throttle, % full (or accelerator pedal, % full)	-5.0 to 0 sec	2
Service brake pedal, on/off	-5.0 to 0 sec	2
Ignition cycle, crash	-1.0 sec	N.A.
Ignition cycle, download	At time of download	N.A.
Safety belt status, driver	-1.0 sec	N.A.
Airbag warning lamp, on/off	-1.0 sec	N.A.
Frontal airbag deployment, time to deploy, in the case of a single stage airbag, or time to first stage deployment, in the case of a multi- stage airbag, driver	Event	N.A.
Frontal airbag deployment, time to deploy, in the case of a single stage airbag, or time to first stage deployment, in the case of a multi- stage airbag, front passenger	Event	N.A.
Multi-event, number of events	Event	N.A.
Time from event 1 to 2	As needed	N.A.
Complete file recorded (1 ~ 14)	Y/N	N.A.

European Implementation

- EDR MANDATORY – Must meet UN160, Data Elements similar to US Part 563 Tables 1 & 2 (includes steering)
- New designs July 2022
- Existing designs July 2024
- UN160 Revision 1 Jan 2023 adds: (Effective Date? ’26?)

  Stability Control Data Lat/Long Accel, Yaw Rate

  Rear seat belt usage, Tire Pressure monitoring, adaptive cruise

  Auto brake status, Lane Departure, auto steering, call after crash
- Some manufacturers installed Part 563 recorders globally from the start, some became global along the way

China UDR Universal Data Recorder (UDR)

- Limited EDR (Level A) required by January 1, 2022
- More extensive EDR (Level B) required by January 1, 2024 with very specific EDR data record structure unique from any other country (the “China UDR”).
- Some models not covered in the US are supported in China

Recent EDR Upgrades

Mercedes ADS self driving module

GM ASCM's – data every .08 seconds vs 0.5 sec EDR

2020+ GM SDM50 – 8 sec precrash, strg, whl spds

2017+ Ford AB12 and RC8, speed @0.2 sec

2017+ Toyota 17 & 19/21/22 EDR – X and Y DV sych'd

Toyota VCH data every .15 sec, includes PICTURES (~~CDR~~)

GM FCM storing PICTURES CDR 21.2+

Pedestrian Protection events Toyota 2018+, Stellantis (EU)

Stellantis Driver Camera module 2024

GM Occupant Classification Module

EDR Propagation in US

1. There are 300+ million vehicles registered in the US. 65+% have an EDR with data accessible by the Bosch CDR system
2. 85+% of 2024's are supported by Bosch.
3. Another 15% have EDR accessible by other tools (10+% Kia/Hyundai, 3+% Tesla, Jag/Land Rover).
4. **99+%** have EDR.
5. Canada may have a few models/brands not in US

US Lt. Veh EDR & Tool Used

Manufacturer	2022 CY per Automotive News	Market Share	EDR First Known Use	Tool?
GM	2,258,283	16.3%	1994	Bosch CDR
Toyota	2,108,455	15.2%	2001	Bosch CDR
Ford	1,850,925	13.4%	1997	Bosch CDR 2001+
Stellantis	1,553,485	11.2%	2005	Bosch CDR
Hyundai/Kia	1,474,224	10.7%	2010	GIT tool co.
Honda	983,507	7.1%	2012	Bosch CDR 2012+
Nissan	729,350	5.3%	2006	Bosch CDR 2013+
VW/Audi	565,119	4.1%	2014	Bosch CDR
Subaru	556,581	4.0%	2012	Bosch CDR now
Tesla	491,000	3.5%	2012	Tesla Tool
BMW	363,612	2.6%	2013	Bosch CDR
Mercedes-Benz	350,949	2.5%	2014	Bosch CDR
Mazda	294,908	2.1%	2011	Bosch CDR 2011+
Geely (Volvo)	102,038	0.7%	2011	Bosch CDR 2011+
Mitsubishi	85,810	0.6%	2006	Bosch CDR now
Tata (Jag, LR)	65,602	0.5%	early	Send to Supplier
Other	7,944	0.1%		
			NO	N/A
Industry Total	13,841,792	100.0%	########	Bosch CDR 85%
updated April 2023				Non CDR 15%

Includes ASCM/ FCM/OCS

Techstream for VCH

Jeep Camera Module

New 2.0 ADL w/ADAS

Porsche 2020 Taycan

CDR 2.0 ADS

2024 US EDR Recording Capability

EDR Major Data Elements by Manufacturer (All Mfrs with EDR have the required 15 data elements, all are not listed)

Information is taken from Bosch CDR sample files, Ruth cases, and 2012 MY practice projected into 2019 model year


	Part 563 Table 1							Part 563 Table 2						Beyond 563										
Mfr	Event Complete	Key Cycles	Long. ΔV	Speed/Brake/ Throttle or Accel	Multi Event	Lateral ΔV	RPM	Steering Angle	ACM Acceleration	ABS on/off	Roll Angle	ESC Long Accel	ESC Lat Accel	Yaw Rate	Tire Pressure	Panic Brake Assist	Wheel Speeds	Roll Rate	Brake Pressure	OTHER
GM	X	X	X	5@0.5 TA	X	X	X	SDM50	, Z 300@2	X		50	50	50	LO		50	1 @ 10ms	50	50 GPS Location
Ford	X	X	X	5@0.5 A	X	X	X	5@0.1	-	X		5@0.1		5@0.1	LO		-	5@0.1	**	2017 AB12 precrash 0.2 sec
Chrysler	X	X	X	5@0.1 TA	X	X	X	5@0.1	-	X		-		5@0.1	PSI	X	X			2018 ACC set speed 2018, Avoidance
Toyota	X	X	X	5@0.5 TA	X	Side	X	5@0.5	-		Peak&atTRG	5	in roll	5@0.5	-	-	-	In Roll	5@0.5	Ped 2018, Veh history rpt
Honda	X	X	X	5@0.5 TA	X	X	X	5@0.5	X, Y, Z 250@10	X	-1+5@0.1	-		-	-	-	-			AEmBrk. Lanekeep
Nissan	X	X	X	5@0.5 A	X	X	X	5@0.5	X, Y 250@10	-	-	-		-	-	-	?			
Mazda	X	X	X	5@0.5 T	X	X	X		X, Y, Z 250@10	-							-			
Volvo	X	X	X	5@0.5T	X	2016 XC90	-	2016 XC90	X,Y,Z 250@10	2016 XC90	-1+0.3@0.1									
BMW	X	X	X	5@0.5A	X		X	5@0.5	X, Y 300@10ms	X	-									
Mercedes	X	X	X	5@0.5A	X	2017 E class adds														
VW	X	X	X	5@0.5A	X	X														Time of Crash
Hyundai/Kia	X	X	X	5@0.5	X	X	X	5@0.5	X,Y,Z 250@10	X	-1+5@0.1	-		-	-	-	-		19 Forte	
Subaru	X	X	X	5@0.5A	X	X	X	5@0.5		X								-1 to+1.5		Eyesight
Mitsubishi	X	X	X	5@0.5A	X	X	X	5@0.5	X, Y 250@10		-1+5@0.1									

Driver Cam

CDR 2.0 ADS

EDR 2.0 w/ADAS

The bigger vehicle data picture

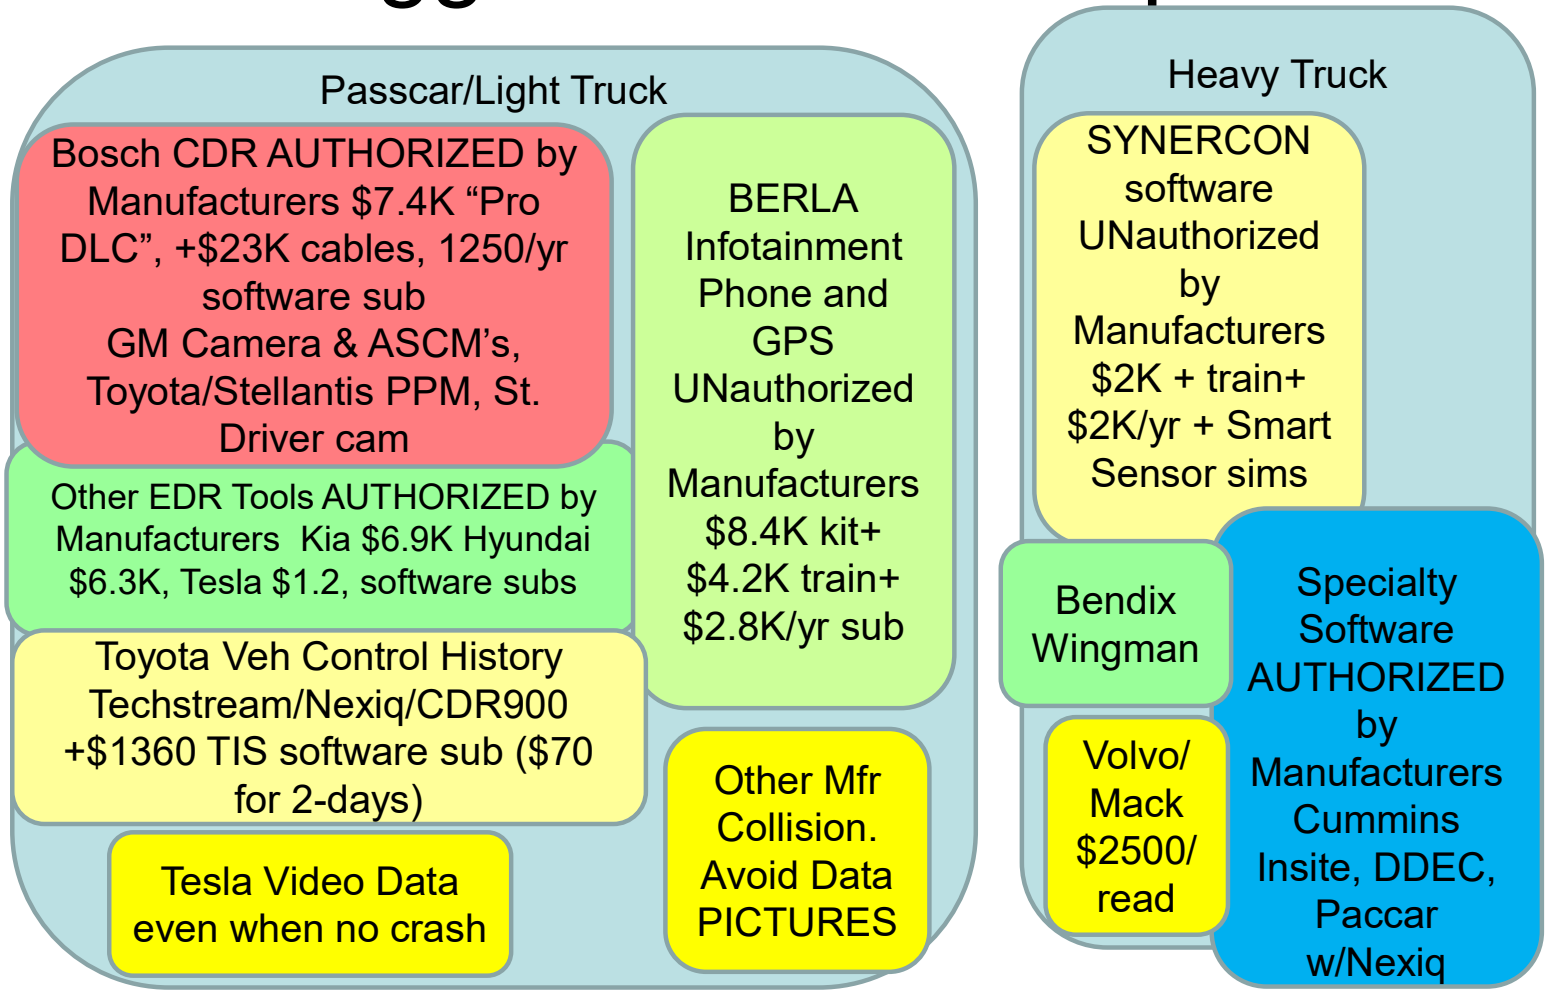

EDR available worldwide before regs?

- Toyota/Lexus/Scion beginning MY 2001 with CDR
- Volvo 2011+ w/CDR
- VW/Audi 2018+ with CDR
- BMW/Mini/RR 2019+ with CDR
- Subaru 2013+ with CDR
- Mitsubishi 2007+ with CDR
- Kia/Hyundai – some 2010+ w/US EDR kit, 2023+ Euro kit
- Mercedes – NOT with CDR – with police tool
- RAM/Chrysler/Jeep 2009+ with CDR
- Ford – Not officially yet, but some read with CDR

Recent CDR Software Updates

- 21.5 April 8– Ferrari, more ’22, mitsu
- 23.0 October 7– Many 2023’s
- 23.1 March 31, 2023 – Euro support, 2023/4’s
- 23.2 July 13 More Subaru 23.3 Oct. 18
- 23.4 Dec. 18 Mercedes ADS, Jeep Camera
- 24.0 March 29, 2024 2025 GM’s + patch
- 24.1 July 1 – more GM FCM’s, Toyota PPM
- 24.2 Oct. 3, 2024 – 2025’s, more GM FCM
- 24.3 Dec. 20, 2024 – CDR900 for Nissan, Ford
- 25.0 April 21, 2025 -

Which Interface Module by Manufacturer 2025

Bosch working to migrate all to CDR900

Manufacturer	CAN+ Only	CAN+ or CDR900	CDR900 Only
GM	All pre-2016, Some 2016+		Some SDM 2016+, All ASCM, FCM
Ford	All pre-2009, Some 2009-12	Most 2009+	Some 2021+
Chrysler	All Pre 2010	All 2010+ (24.1 added 2010-16)	Some 2021+
Toyota		All 2001-2020, some 2021+	Some 2021+
Honda		All 2012-2016, Some 2017-2023	Some 2017-2023, All 2024+
Nissan		All 2013-2020, Most US 2021+	Some 2021+ (China, Europe)
Mazda		All 2011+	Some 23+
Volvo		Most 2011-2024	Some 2022+
BMW		All 2013-2022	All 2023+
Mercedes		All 2014-2022	All 2023+
VW/Audi		All 2014-2023	All 2024
Subaru			All
Mitsubishi			All

CAN+ No longer available

The source of this informatin is the CDR help file softwareversion 24.3. Always check the help file for the latest information.

HARDWARE CHECKLIST 25.0

1699503814	Cable, ID858, CDR Maserati / Ferrari ACM	21.4
1699503636	Cable, ID859, CDR Lucid ACM	21.4
1699200985	Cable, ID852, CDR GM ACM	23.0
1699503637	Cable, ID854, CDR GM ASCM3	23.0
1699201001	Cable, USB to Serial, 6', DB9 Male (supersedes F00K108953)	23.0
1699200984	Cable, ID851, CDR Driver Cam	24.1
1699503924	Cable: ID860, CDR BMW ACM 6	24.1
1699504297	Cable, ID861, CDR VWG ACM 6	24.1
1699504347	Cable, ID863, CDR Mazda ACM	24.1
1699504348	Cable, ID864, CDR, VWG ACM 7	24.1
1699504349	Cable, ID856, CDR, GM, FCM1	24.1
1699504350	Cable, ID855, CDR, GM, ASCM4	24.1
1699504809	Cable, ID869, Volvo ACM	24.1
1699504808	Cable, ID868, CDR Stellantis ACM	24.2
1699505288	Cable, ID871, CDR Stellantis ACM	24.2
1699505428	Cable, ID872, JLR ACM 1	24.2
1699505429	Cable, ID873, JLR ACM 2	24.2
1699505430	Cable, ID874, Suzuki ACM 4	24.2

SDM50

Low Content

Jeep

High Content

Links to same data lists

Citroen/Vauxhall Opel Europe

2024 Charger

China only Jaguar

China only Land Rover

Japan/Europe Only


Don't buy China/Euro only cables!

Approx 13 more expected for 2025!

New Bosch CDR Version Numbering

- First two digits used to be how many manufacturers were covered
- Industry consolidation kept changing the count
- New numbering system uses calendar year as first two digits
- Second digit is major release within calendar year
- Third digit is patch number
- We are at **24.3.634** Third release of 2024, no 2025 yet

New Bosch “CDR2” Program 23.3

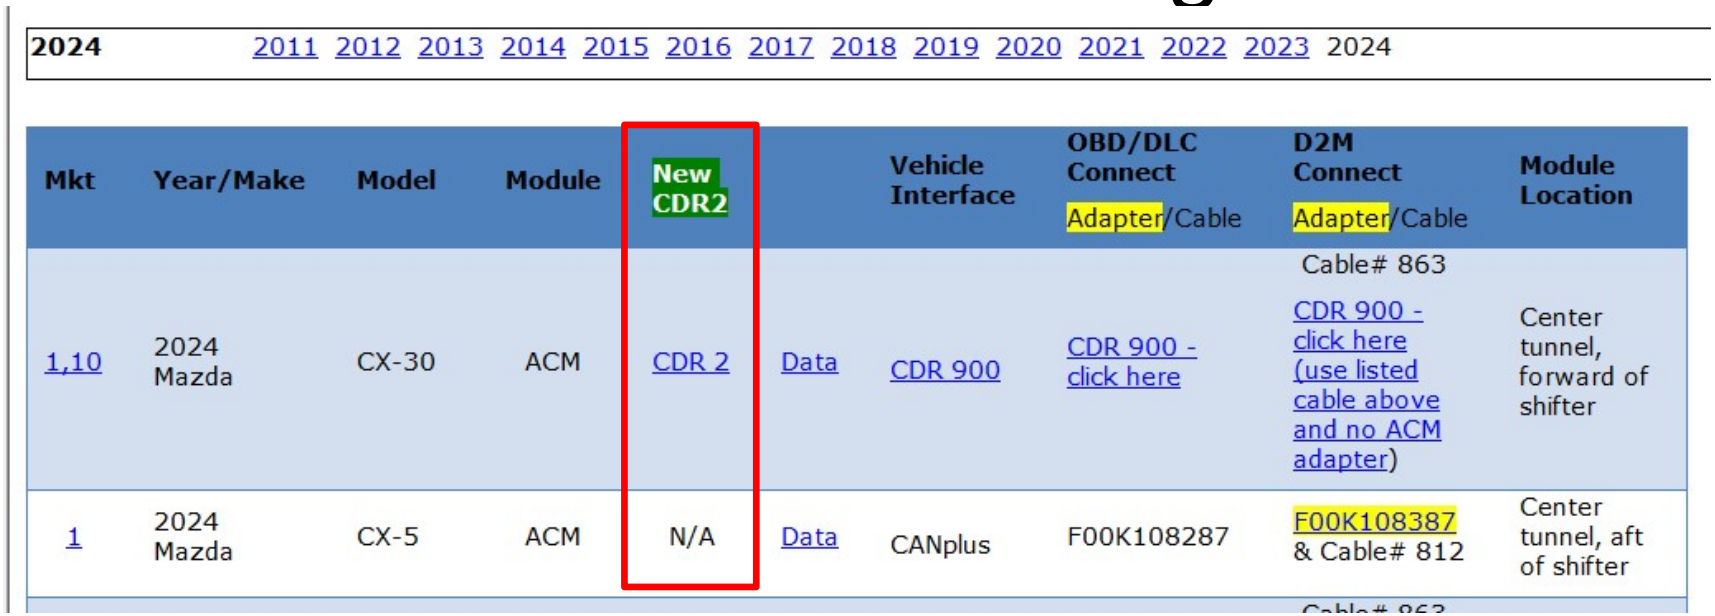


2024 2011 2012 2013 2014 2015 2016 2017 2018 2019 2020 2021 2022 2023 2024

Mkt	Year/Make	Model	Module	New CDR2		Vehicle Interface	OBD/DLC Connect Adapter/Cable	D2M Connect Adapter/Cable	Module Location
1,10	2024 Mazda	CX-30	ACM	CDR 2	Data	CDR 900	CDR 900 - click here	Cable# 863 CDR 900 - click here (use listed cable above and no ACM adapter)	Center tunnel, forward of shifter
1	2024 Mazda	CX-5	ACM	N/A	Data	CANplus	F00K108287	F00K108387 & Cable# 812	Center tunnel, aft of shifter

- Next Generation of CDR software
- Phasing in to new models starting 2023
- Integrated as of CDR 25.0 – will open with legacy software

CDR2 slightly different look/feel, but otherwise similar

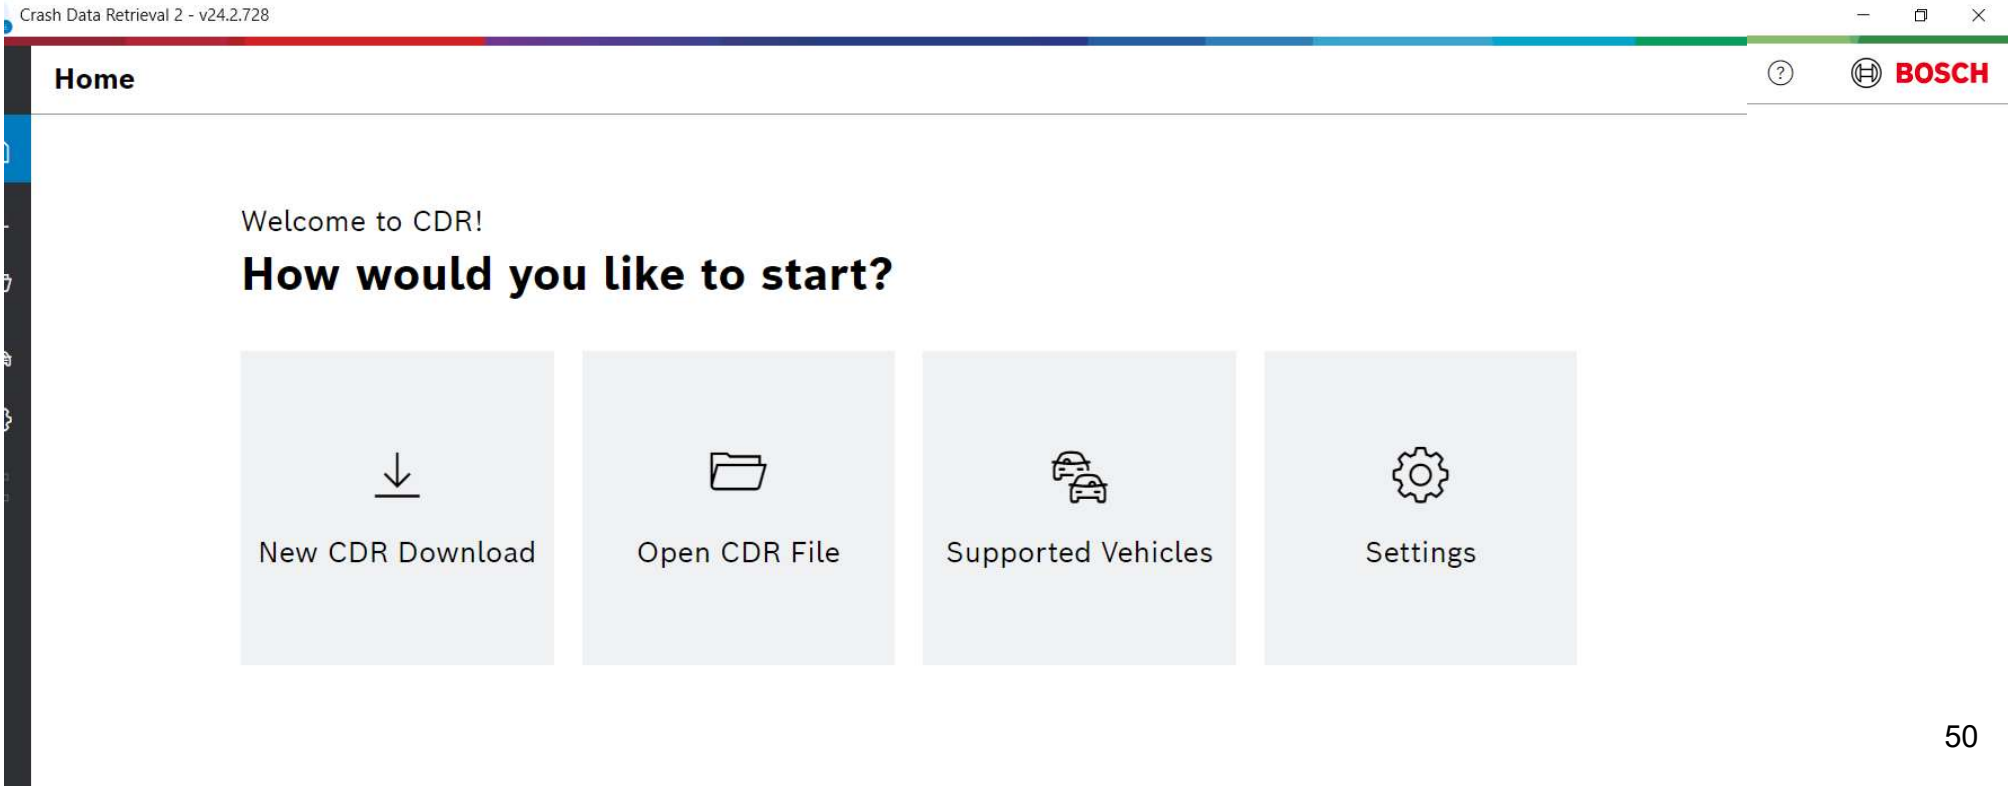

New Mercedes EQS ADS module

2 California and Nevada	2023 Mercedes-Benz	EQS (sedan)	ADS *(vehicles equipped with DrivePilot)*	CDR 2	Data	CDR 900	OBD Only CDR 900 - click here	does not support direct to module downloads	N/A

- Self driving car only offered in California and Nevada so far
- New separate module from ACM
- Click on “data” tab in help file to see contents
- GPS position, Nearby object locations, turn signal switch status,

New Jeep Drive Camera module

2025	2006	2007	2008	2009	2010	2011	2012	2013	2014	2015	2016	2017	2018	2019	2020	2021

Mkt	Year/Make	Model	Module	New CDR2		Vehicle Interface	OBD/DLC Connect Adapter/Cable	D2M Connect Adapter/Cable	Module Location
1, 10	2025 Jeep	Grand Cherokee (includes L & PHEV)	ACM	N/A	Data	CDR 900	CDR 900 - click here (no DLC adapters needed)	Cable #871 CDR 900 - click here (use listed cable above and no ACM adapter)	Center console
			DCM	N/A	Data How to image	CDR 900	OBD/DLC Downloads are not supported	Cable ID 851 CDR 900 - click here (use listed cable above and no ACM adapter)	behind the center of the dash and mounted to the HVAC housing

- New separate module from ACM
- Monitors if driver eyes are on road and hands on wheel to allow semi-autonomous driving

NHTSA CISS DATABASE UPDATE

1. https://crashviewer.nhtsa.dot.gov/CISS/SearchIndex
2. 21,615 cases available from 2016-2023 calendar years – last update 12/24 for 23 CY
3. Searchable by manufacturer, model year, model, EDR data available, driver assist technology, etc
4. Find similar cases, check polarity, see typical EDR report in 11,513 of those cases
5. Link to VIN decoder, Canadian Specs, Vin check digit calc'tr Welcome to VIN Decoding ::
6. Send special requests (Kia/H caselist, ASCM, FCM, etc) NHTSACrashDataSupport@dot.gov

SAE WCX EDR related papers 4-08-25

Paper No.	Title
2025-01-8712	Examination of the Data Structures of the Bendix Data Recorder
	Matthew DiSogra, Delta |v| Forensic Engineering; Jeffrey Hirsch, Drive Forensics; Adam Yeakley, Delta |v| Forensic Engineering
2025-01-8713	The Effects of Collision-Related Power Loss on Toyota Safety Sense 2.5+ Event Data
	Charles Getz, Matthew DiSogra, Heath Spivey, Taylor Johnson, Amit Patel, Delta |v| Forensic Engineering
2025-01-8714	Analysis of the Event Data Recorder vehicle system data of a GM Vehicle Intelligence Platform Airbag Control Module (SDM50)
	Brian Smyth, Charles L Crosby, Ryan Bickhaus, James Smith, Exponent Inc; Dustin Edmunds, Donald Floyd, Vipul Modi, RaShawndra D. Outlaw, Jeff Wright, General Motors LLC
2025-01-8703	Decelerations for vehicles with anti-lock brake systems (ABS) during wet-to-dry transitions on asphalt and concrete road surfaces.
	Ian Miller, David King, Gunter Siegmund, MEA Forensic Engineers & Scientists

SAE INTRO ENDS HERE

Materials beyond this point are ”what’s new” and will be covered in other portions of the SAE class


Analysis Update: Speed Data

1. Accuracy: Historically +/-4% ’99 GM paper
2. Part 563 speed data **+/-1 kph** (0.6 mph) of speedo display, does not include speedo error or tire wear which can add 2% to speed.
3. SAE 2016-01-1497 “**Compendium** of Pass Vehicle EDR Literature and Analysis of Validation Studies” by Bortles et al, Kineticorp recaps accuracy as -1.5 mph to +0.5 mph (most testing @ 30 to 70 mph).
4. SAE 2024-01-2890 reports speed in IIHS crash tests as +/-2kph at 64 kph. Tire wear +2% not included.
5. For low speed use fixed error not percent

SAE 2024-01-2890
Accuracy of 2016-2022 EDR's in IIHS Crash Tests


- Obtained ACM's from 43 IIHS 64 kph crash tests
- Compared EDR to IIHS reference measurements
- Published April 7, 2024
- Speed data +/-2kph. Delta Vx reaffirmed as +/-10%.
- New model IIHS test vehicles have little to no tire wear. Since tire wear can affect speed accuracy, those +2% effects must be superimposed on the IIHS data

SAE 2024-01-2890 Accuracy of EDR in 2016-2022 IIHS Crash Tests

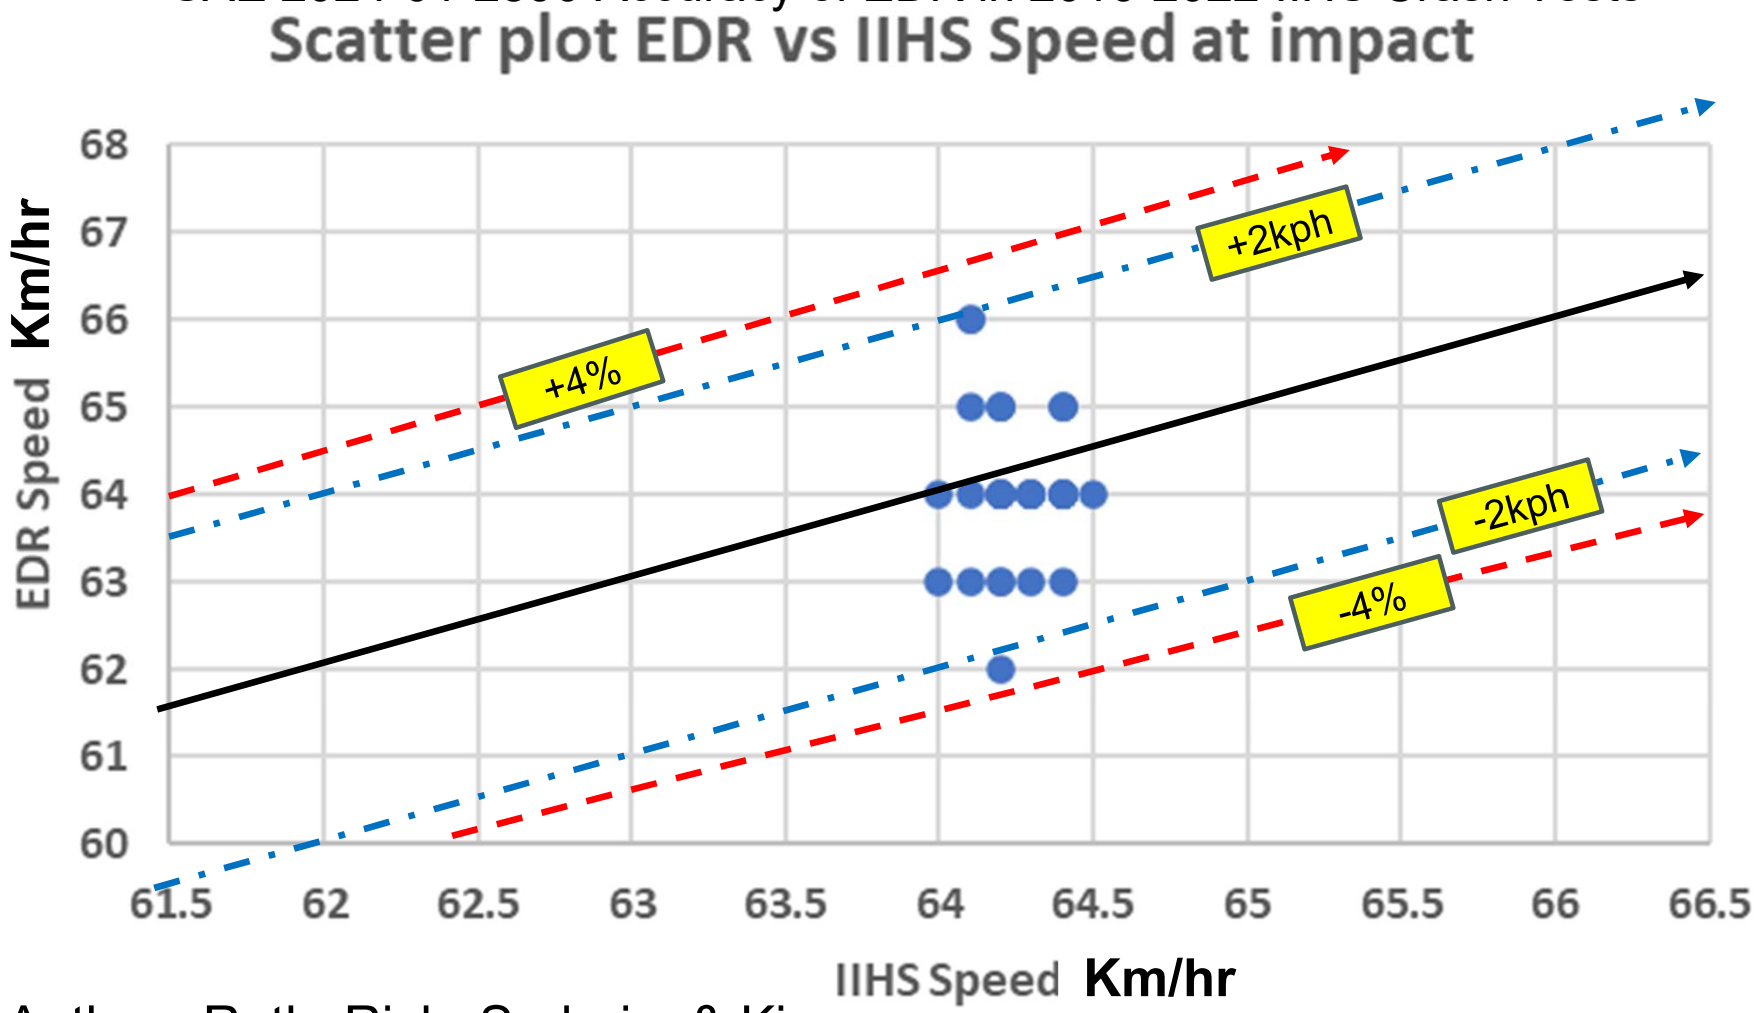

Authors Ruth, Rich, Sadrnia, & King

New Suggestion based on SAE 2024-01-2890 – correct +/-2kph –tire wear up to 2%

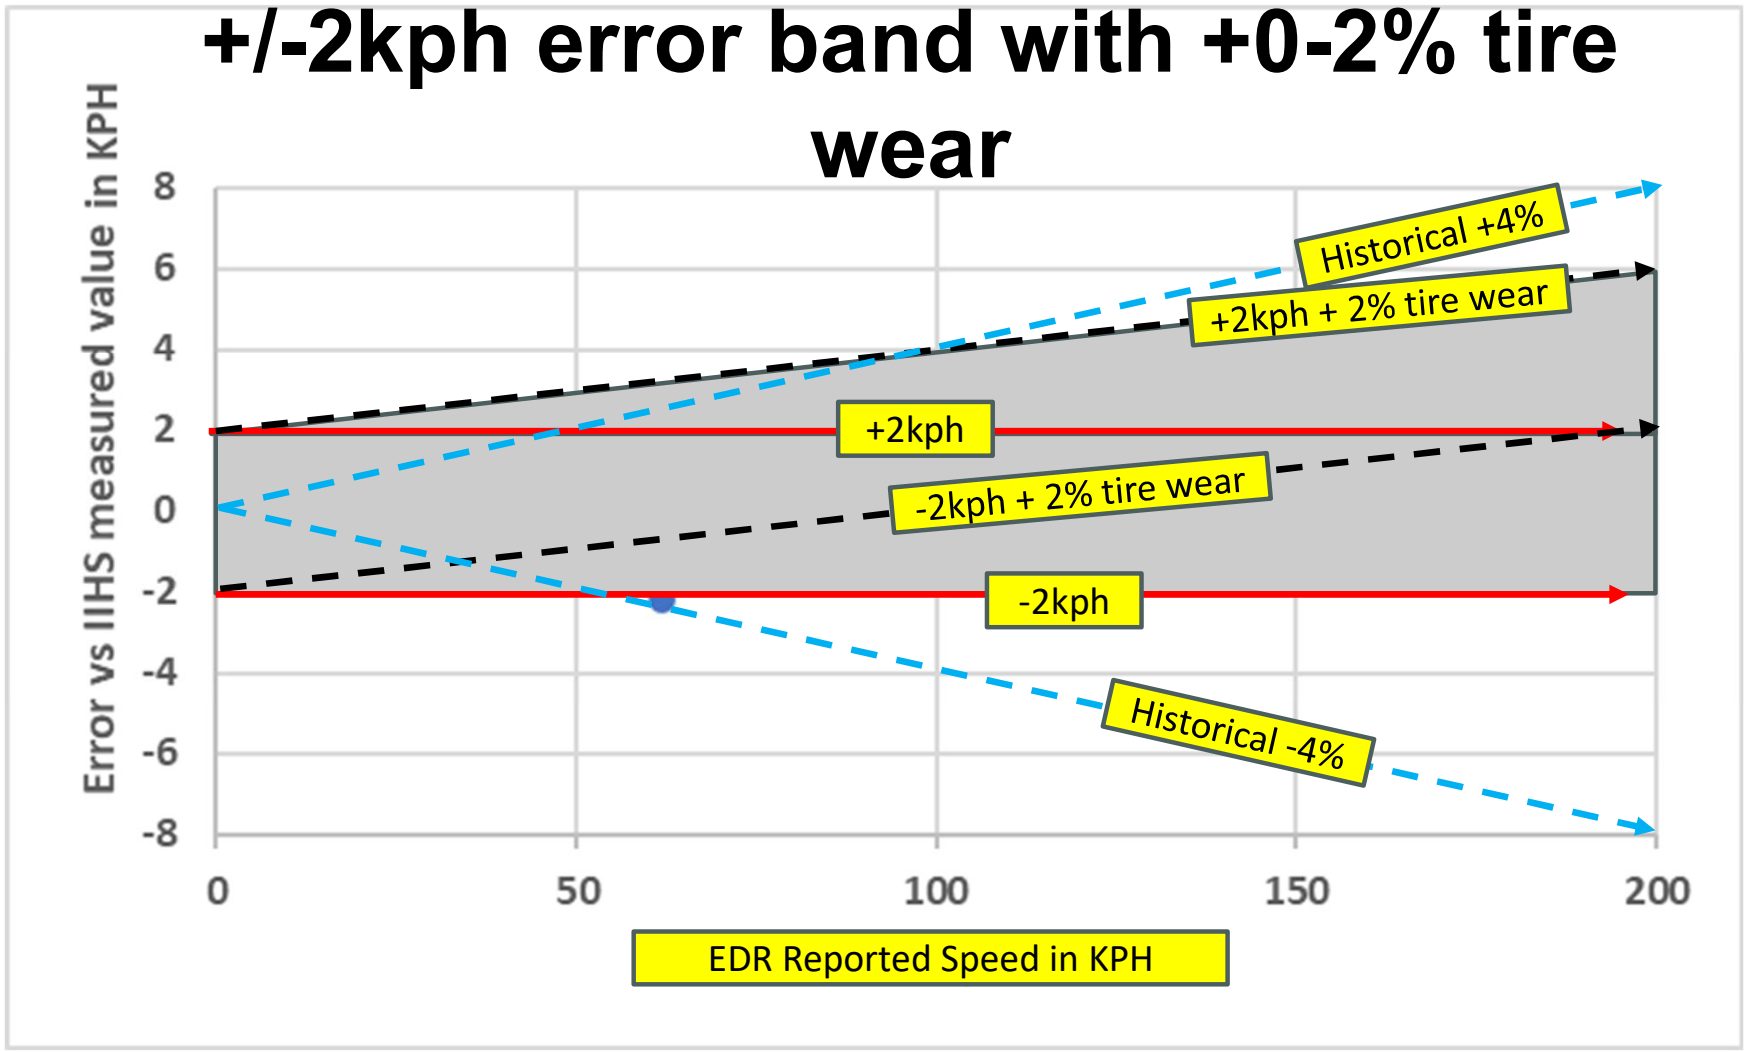

Speed at Impact during braking - Timing of Last Speed Data Point

Red= Bad Green=Good

Time from last data point to impact		
(Time available for possible braking between last data point and impact)		
MANUFACTURER	**Model year**	
GM Gen 1	92-02	No precrash data
GM Gen 2	99-12	**0 to 1 interval between data points, 1 second**
GM Gen 3	2005-2012	0 to 1 interval between data points, some 0.5 **some 1.0 second**
GM Gen 4	2012-presen	0 to 1 interval between data points, 0.5 second **New SDM50 samples last data at AE**
Ford ACM Gen 1	97-07	No precrash data
Ford PCM	2003-2011	0 to 1 interval between data points, 0.2 seconds
Ford ACM Gen 2	2005-2012	0 to 1 interval between data points, **1 second**
Ford Gen 3 RC6	2009-2010	**more than 1 interval between data points, use 1 second**
Ford Gen 3 RC6_2011 & Bosch AB10	2011+	0 to 1 interval between data points, 0.5 seconds
Ford Gen 3 RC7	2013+	0 to 1 interval between data points, 0.5 seconds
Ford Gen 3 AB12 & RC8	2017+	? Data point interval only 0.2 sec though, use that
Fiat.Chryslers	2006+	0 to 1 interval between data points, 0.1 sec (0.2 some minivan 2010-2012)
Toyota Gen 1 and 2	2001-2012	Last data point taken at impact **but 0 to 0.5 sec old**
Toyotoa Gen 3 & 4	2013+	**Last data point taken at imapct, within 24ms (use zero)**
Honda	2011+	Last data point taken at impact, within 0.1 sec of impact,but 0.3 sec delay for analog speedometer **0.9 sec for Digital speedo**
Nissan	2013+	Last data point taken at impact, within 0.1 sec?
Mazda	2011+	Last data point taken at impact, within 0.1 sec ?
Volvo	2011+	0 to 1 interval between data points, 0.5 second
BMW	2013+	0 to 1 interval between data points, 0.5 second
Mercedes	2014+	0 to 1 interval between data points, 0.5 second **New models time of last data to AE**
Volkswagen	2015+	File gives time since last data point 0.0 to 0.4 sec - use that
Kia/Hyundai	2010+	Last data point taken at imapct, within 0.1 sec?
Subaru	2012+	Last data point taken at imapct, within 0.1 sec?
Mitsubishi (Chrysler clone)	2009+	? Assume 0 to 1 interval between data points, 0.1 sec
Mitsubishi (Part 563)	2013+	? Assume 0 to 1 interval between data points, 0.5 sec

INSPECTION PROCEDURE CHANGES

- Measure tread depth of tires if speed is important
- Look up ACM location. If **NOT** on CG, ***and*** there was significant rotation during crash, then
  - Document exact location of ACM vs CG at inspection
  - Document exact location of damage centroid vs CG

    (may be done later if vehicle was scanned)

Draw vehicles at max engagement, draw PDOF line thru damage centroid, understand which side of CG PDOF line passes by and approximate distance from CG

Chevrolet ACM Recent Changes


1 1 1 animation

24.3 Dec 2024


Note SDM50 Propagation only 65% so far

	Part 563 Intent								SDM50	GM					
Model	**2012**	**2013**	**2014**	**2015**	**2016**	**2017**	**2018**	**2019**	**2020**	**2021**	**2022**	**2023**	**2024**	**2025**	**2026**
Astro															
Avalanche	454	454	*												
Aveo		454	*				454								
Beat (India)			454	454											
Blazer								454	454	454	454	454	454	454, EV 852	
Bolt EV							454	454	454	454	454	454	454		852
Bright Drop														852	852
Camaro	454	454	454	454	454	454	454	454	454	454	454	454	454		
Caprice	**454**	police	police	police	police	police	police								
Captiva	454	454	*	**Sport**	**Sport**										
City Express				**780**	**780**	**780**	**780**	**780**							
Colorado	3003			**454**	**454**	**454**	**454**	**454**	454	454	454	**852**	**852**	**852**	**852**
Corvette	3003	3003	454	454	454	454	454	454	**845**	**845**	**845**	**845**	**845**	**845**	**845**
Cruze	454	454	454	454	454	454	454	454	454						
Equinox	454	454	454	454	454	454	454	454	454	454	454	454	454	**852**	**852**
Express	3320 ROS	3320 ROS	3320 ROS	3320 ROS	454	454	454	454	454	454	454	454	454	454	454
Impala	**454**	454	454	454	454	454	454	454	454						
Kodiak	**2012**	**2013**	**2014**	**2015**	**2016**	2017	2018	2019	2020	2021	2022	2023	2024	2025	2026
Low Cab Fwd								454							
Malibu	3321	3321 (2012	454	454	454	454	454	454	454	454	454	454	454		
Matiz	454														
Orlando	454	454	454												
Silverado	454	454	454	454	454	454	454	454	454	454	454	**852**	**852**	**852**	**852**
Silverado Med Duty												**454**	454	454	454
Sonic	454	454	454	454	454	454	454	454	454						
Spark		454	454	454	454	454	454	454	454	454	454				
SSR				**SS**	**454**	**454**	**454**								
Suburban	454	454	454	454	454	454	454	454	454	**852**	**852**	**852**	**852**	**852**	**852**
Tahoe	454	454	454	454	454	454	454	454	454	**852**	**852**	**852**	**852**	**852**	**852**
Tracker							454	454	454	454	454				
TrailBlazer										454	454	454	454	454	454
Traverse	454	454	454	**454**	**454**	**454**	**454**	454	454	454	454	454	454	**852**	**852**
Trax		454	454	454	454	454	454	454	454	454	454		454	454	454
Volt	454	454	454	454	454	454	454	454							

GM EDR Evolution

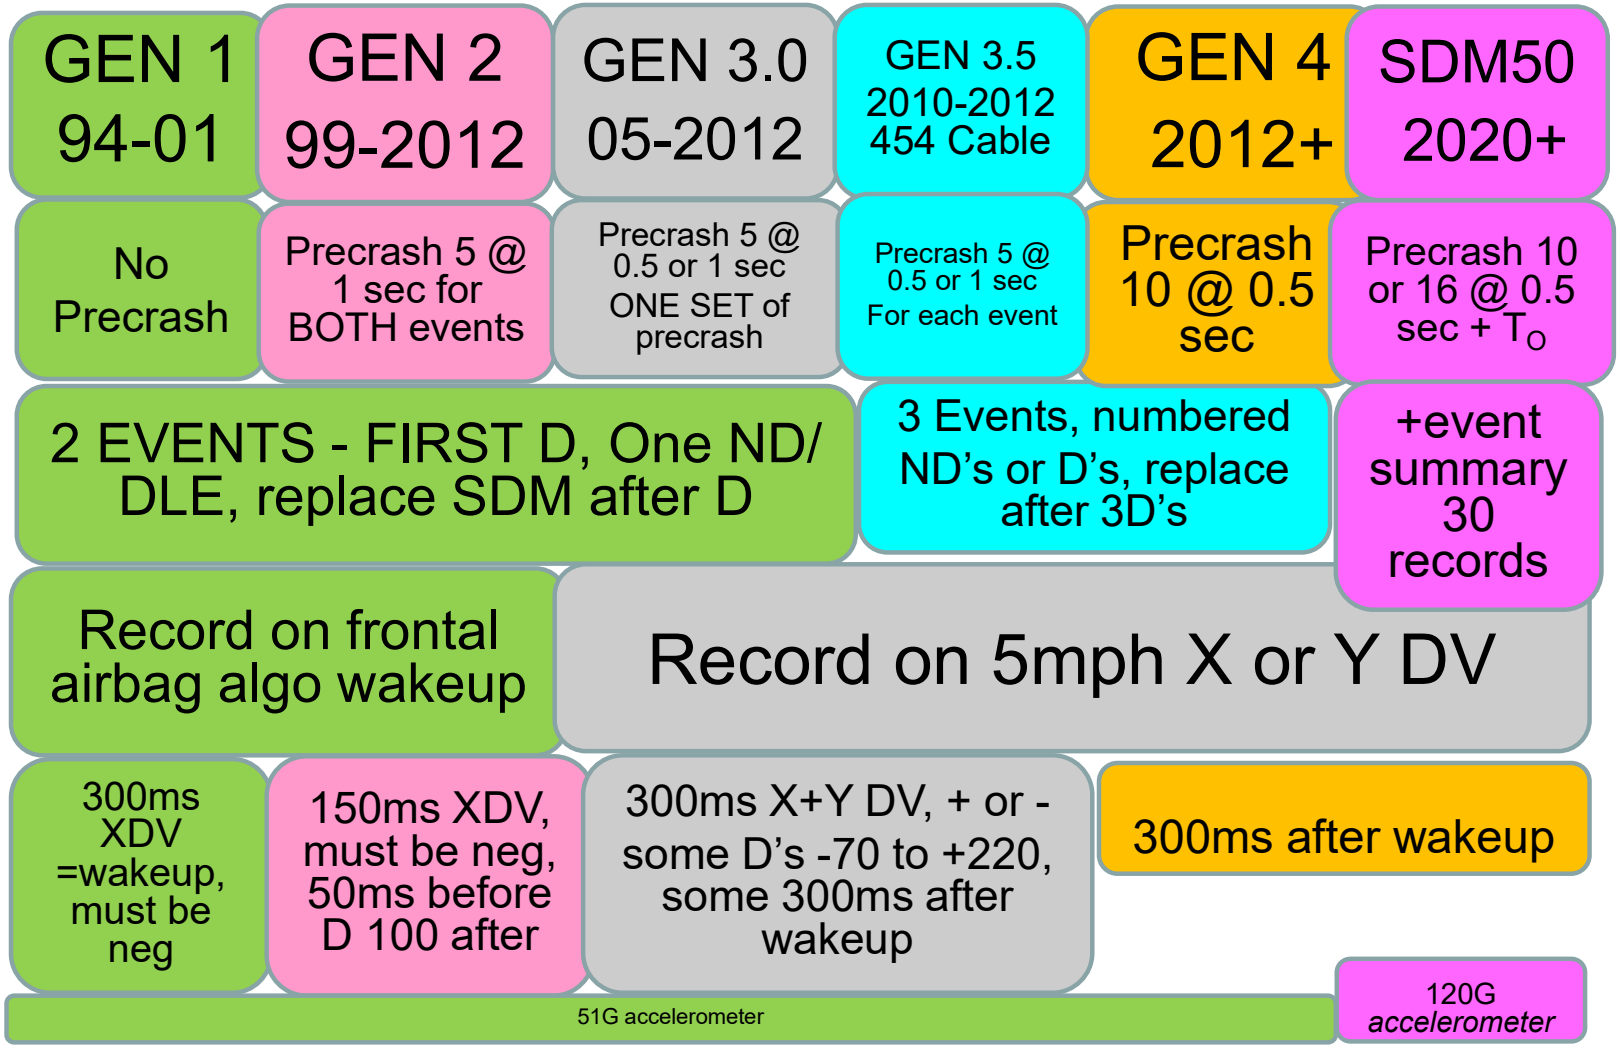

GM EDR Evolution #2

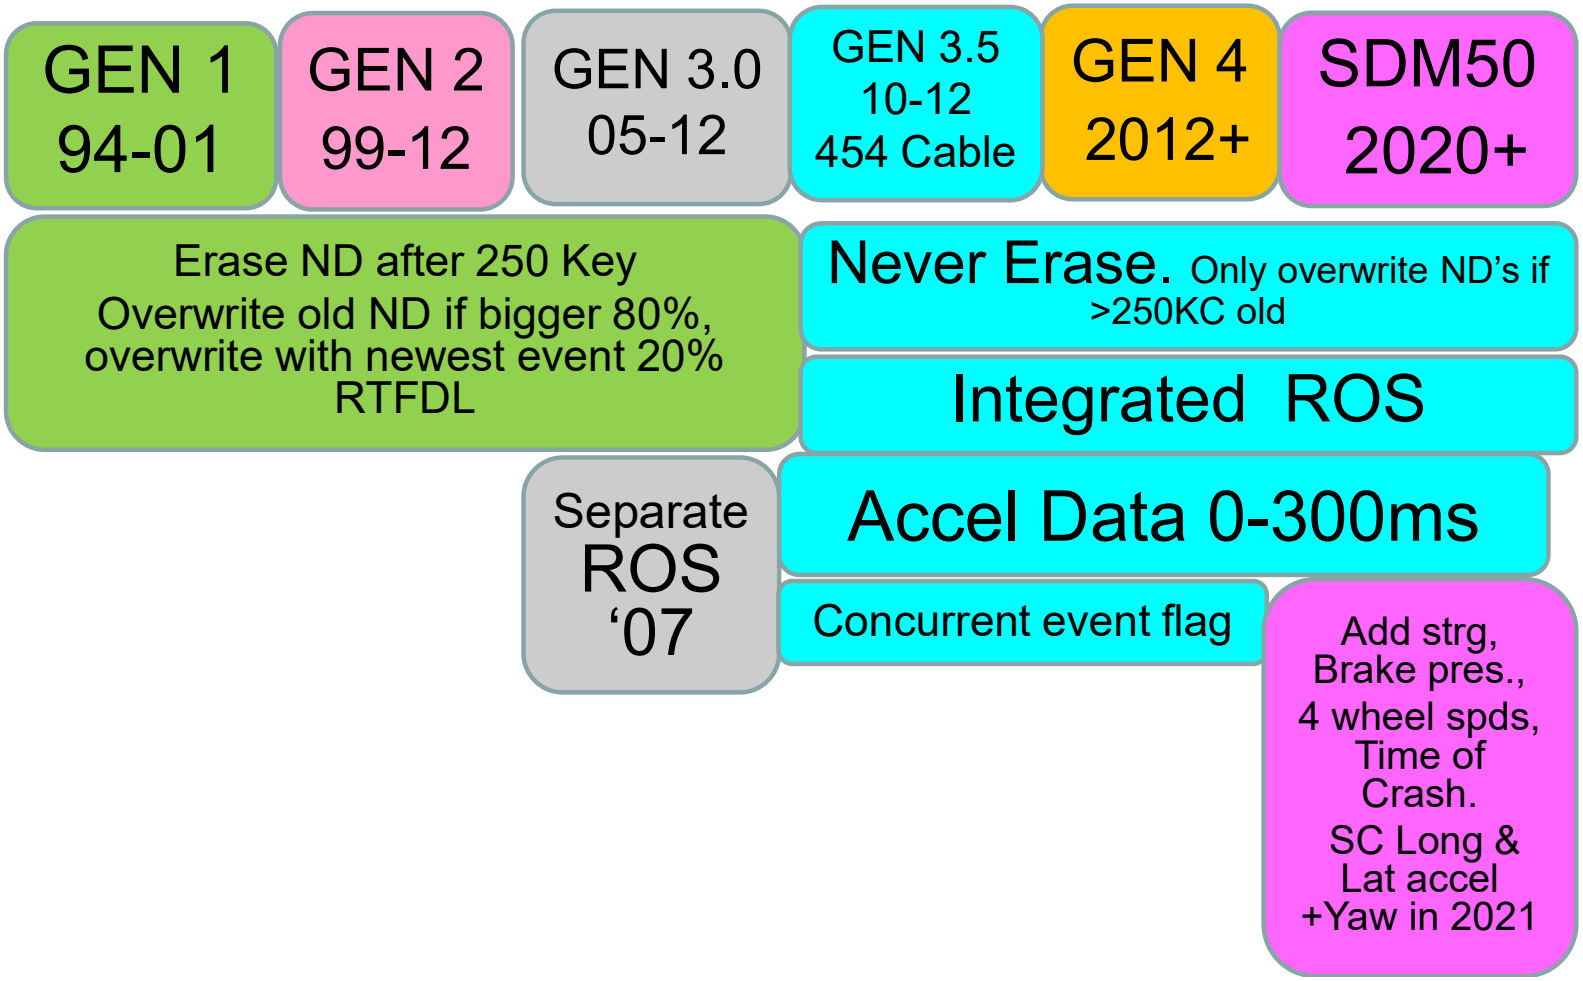

2020+ SDM50 – More Data!

Pre-Crash Data -8.0 to 0.0 sec (Record 1) - Table 1 of 7

Time (sec)	Accelerator Pedal, % Full (%)	ABS Activity	Brake Pedal Position (%)	Driver Applied Brake Pedal Pressure (kPa)	Driver Applied Brake Pedal Pressure Detected	On/Off (Brake Pedal Initial Travel Achieved)	Cruise and Speed Limiter Switch Status
-8.0	0	Off	5	81	False	On (True)	No Activation

Pre-Crash Data -8.0 to 0.0 sec (Record 1) - Table 2 of 7

Time (sec)	Cruise Secondary Switch Status	Conventional Cruise Control	Adaptive Cruise Control Selected Mode	Adaptive Cruise Control	Transmission Estimated Gear	Transmission Shift Lever Position	Reduced Engine Power Mode Indicator On
-8.0	No Activation	Inactive	Cruise Control Mode Switching Not Supported	Inactive	Ninth	Forward Range A	Off

Pre-Crash Data -8.0 to 0.0 sec (Record 1) - Table 3 of 7

Time (sec)	Engine RPM (Engine Speed)	Engine Torque (Nm [Ft Lbs])	Engine Throttle, % Full (%)	Speed, Vehicle Indicated (MPH [km/h])	IMU Yaw Rate (deg/sec)	Right Front Wheel Angular Speed (RPM)	Left Front Wheel Angular Speed (RPM)
-8.0	1,184	-20.0 [-14.8]	0	51 [82]	-6.288	525	537

2020+ SDM50….

Pre-Crash Data -8.0 to 0.0 sec (Record 1) - Table 4 of 7

Time (sec)	Right Rear Wheel Angular Speed (RPM)	Left Rear Wheel Angular Speed (RPM)	Steering Wheel Angle (deg)	Propulsion System Active	System Power Mode	Backup System Power Mode	SDM Power Mode
-8.0	537	535	951	True	Propulsion	Propulsion	Propulsion

Pre-Crash Data -8.0 to 0.0 sec (Record 1) - Table 5 of 7

Time (sec)	Ignition Status	Ignition Prolongation Timer (sec)	Secondary Collision Prolongation Timer (sec)	Antilock Brake System Failed	Brake Pedal Override Flag	Automatic Brake Status	Electronic Stability Control Status
-8.0	On	5.0	0.0	False	False	Not Active	Normal Operation

Pre-Crash Data -8.0 to 0.0 sec (Record 1) - Table 6 of 7

Time (sec)	Traction Control System Present	Traction Control System Failed	Traction Control System Enabled	Traction Control System Active	Traction Control System Switch Status	Left Turn Signal Switch Active	Right Turn Signal Switch Active
-8.0	True	False	True	Traction Control Off	Enabled	False	False

Pre-Crash Data -8.0 to 0.0 sec (Record 1) - Table 7 of 7

Time (sec)	IMU Lateral Acceleration (g)	IMU Longitudinal Acceleration (g)	Red Brake Telltale On	Brake Boost Status - Eboost
-8.0	-0.337574	-0.089182	False	Normal Boost

More 2020+ SDM50

- GPS Lat/Long at crash
- Second and third row (if equipped) seat belt status
- Up to 30 Event Summary records give clear order of events
- Outside Air Temp, Brake Overrides
- Auxilliary Crash Sensor Data (recon does not use)
- UTC Time at Event

UTC Time at Event	03:13:43
UTC Date at Event	2022/11/13

EVERYTHING GM COULD IMAGINE!!!!!

SDM50 Data use similar to Ford & Stellantis


- Use individual wheel rpm's as additional independent measurements of speed to verify speed
- Use Brake Pedal Position and Brake Pressure to determine how hard driver is pushing on the brake pedal (classify panic braking vs normal braking)
- Use Longitudinal Accel from stability to more precisely get speed at impact if braking from a stable speed
- Use Lat Accel and Yaw to get change in heading and approach angle from original, for momentum & triangle calcs – plus lateral movement

GM Active Safety Control Module

1. Additional module must be downloaded separtely from ACM
2. First installed in 2013 Cadillac ATS
3. Only with GM option UGN or UKL
4. REQUIRES CDR 900 interface!
5. Some vehicles have TWO ASCM modules.
6. Typically located in luggage compartment on the side, behind trim
7. Gen 1 and 2 only record if AEB activates?

GM ASCM Evolution

ASCM = Advanced Safety Control Module]
EOCM = External Object Calculation Module (SAME)

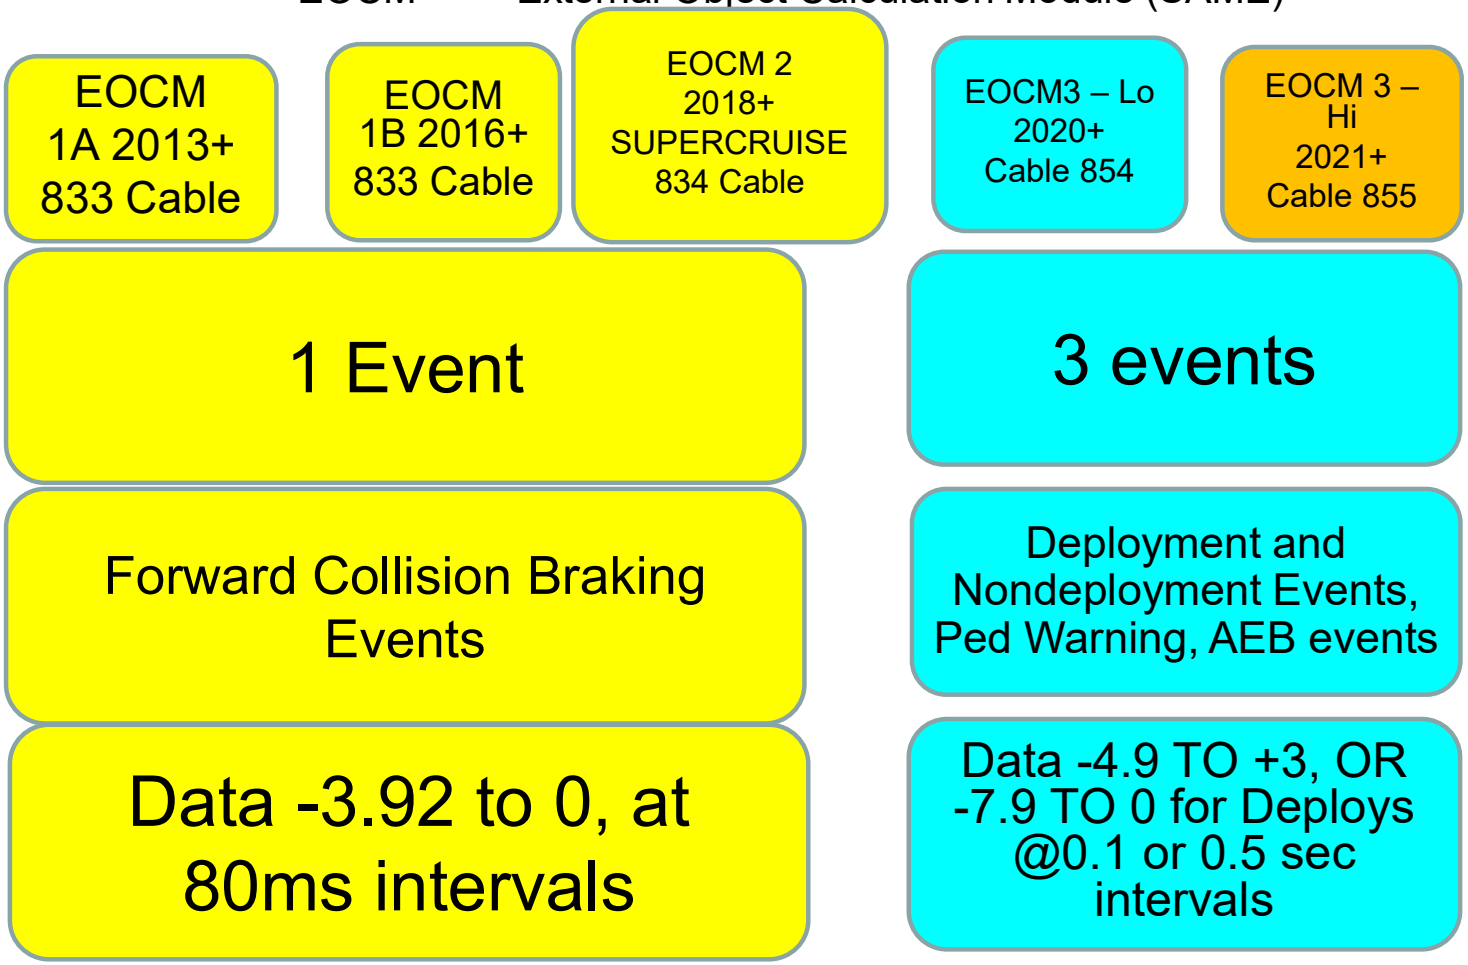

GM ASCM CDR 24.1 Coverage

Model	Location	Model Year												
3 digits Bosch CDR cable ID shown in help file														
BUICK	ASCM Location	2013	2014	2015	2016	2017	2018	2019	2020	2021	2022	2023	2024	2025
ENCLAVE	cargo left front of wheel well						833 1B							not
ENVISION	rear seat left trim by wheel wl				833 1A	833 1B				854 3-LC				released
LACROSSE	trunk left					833 1B								yet
REGAL	trunk left						833 1B							
CADILLAC		2013	2014	2015	2016	2017	2018	2019	2020	2021	2022	2023	2024	2025
ATS	trunk left	833 1A					833 1B							
CT4	Trunk upper shelf								854 3-LC	855 3-HC				
CT5	Trunk upper shelf								854 3-LC	855 3-HC				
CT6	Primary right, secondary left				833 1A		833 1B, 834 2							
CTS SEDAN	trunk left		833 1A				833 1B							
CTS	trunk left				833 1A		833 1B							
ESCALADE	under left qtr window trim			833 1A			833 1B			854/855 LC/HC				
LYRIC	cargo left front of wheel well											833 1B		
SRX	under left rear seat	833 1A												
XT4	cargo left front of wheel well							833 1B						
XT5	cargo left front of wheel well					833 1B								
XT6	trunk left								833 1B		833 1B/834 2			
XTS	trunk left	833 1A					833 1B							
CHEVROLET		2013	2014	2015	2016	2017	2018	2019	2020	2021	2022	2023	2024	2025
BOLT	trunk left										834 2			
BLAZER	trunk left							833 1B						
MALIBU	trunk left				833 1A	833 1B								
SILVERADO	rear wall behind middle seat											855 3-HC	854/5	
SUBURBAN	under left qtr window trim										854 3-LC			
TAHOE	under left qtr window trim										854 3-LC			
TRAVERSE	trunk right						833 1B							
VOLT	trunk left					833 1B								
GMC		2013	2014	2015	2016	2017	2018	2019	2020	2021	2022	2023	2024	2025
ACADIA	cargo left front of wheel well					833 1B								
HUMMER EV											855 3-HC			
SIERRA	rear wall behind middle seat											854 3-LC		
YUKON	under left qtr window trim									854 3-LC		854/855		

ASCM 3 Data Validation

2024-01-2888 **Analysis of the Event Data Recorder (EDR) Function of a GM Active Safety Control Module (EOCM3 LC)**

Cleve Bare, Red Hawk Reconstruction LLC; Jason Skiera, Brian Smyth, Exponent Inc.; Tommy Beetham, Donald Floyd, Winston Koo, Devin Newell, General Motors LLC

- Instrumented a Vehicle and performed a series of manuevers that generated ASCM events.
- Compared the reference instruments to the ASCM data
- All tested parameters matched
- Sample size one vehicle
- The Lane Keep Assist feature was not tested

GM Active Safety Control Module

Mkt	Year/Make	Model	Module		Vehicle Interface	OBD/DLC Connect Adapter/Cable	D2M Connect Adapter/Cable	Module Location
4	2018 Cadillac	ATS (note 6)	ACM	Data	CANplus	CANplus - F00K108287	CANplus - F00K108454	Center tunnel
			ASCM (Note1)	Data	CDR 900	CDR 900 - click here	CDR 900 - Cable# 833	In the luggage compartment, left side, near rear, on outboard side of brace, behind trim
6	2018 Cadillac	ATS-L (note 6)	ACM	Data	CANplus	CANplus - F00K108287	CANplus - F00K108454	Center tunnel
4,6	2018 Cadillac	CT6 (note 6)	ACM	Data	CANplus or CDR 900	CANplus - F00K108287 CDR 900 - click here	CANplus - F00K108454 CDR 900 - click here (use listed cable above)	Center tunnel
			ASCM (Note2) how to image	Data	CDR 900	CDR 900 - click here	CDR 900 - Cable# 834	In the luggage compartment, right center, mounted to the right side in the battery well. The secondary ASCM is on the left.
			ASCM (Note1)	Data	CDR 900	CDR 900 - click here	CDR 900 - Cable# 833	In the luggage compartment, right center, mounted to the right side in the battery well

GM Active Safety Module




1. Must be downloaded separately from ACM
2. Icon will appear after VIN input for any vehicle that MIGHT have Super Cruise
3. Module /data will only be present if option “UKL” (Super Cruise) or “UGN” (Adv Driver Assist) has been purchased for the subject vehicle (most DO NOT have it).

GM Active Safety Module

1. Data can be captured every 80 milliseconds and can record up to 50 records for a total of 4 seconds of data. The data recording window can be either 4 seconds before the end of an auto braking event or 4 seconds before an airbag deployment. ONE EVENT ONLY
2. Data is recorded in non-volatile memory at the next **proper power-down** of the module. Data may **not** be stored if the battery power is lost before the power-down.


collision

Vehicle going 6mph auto brakes to

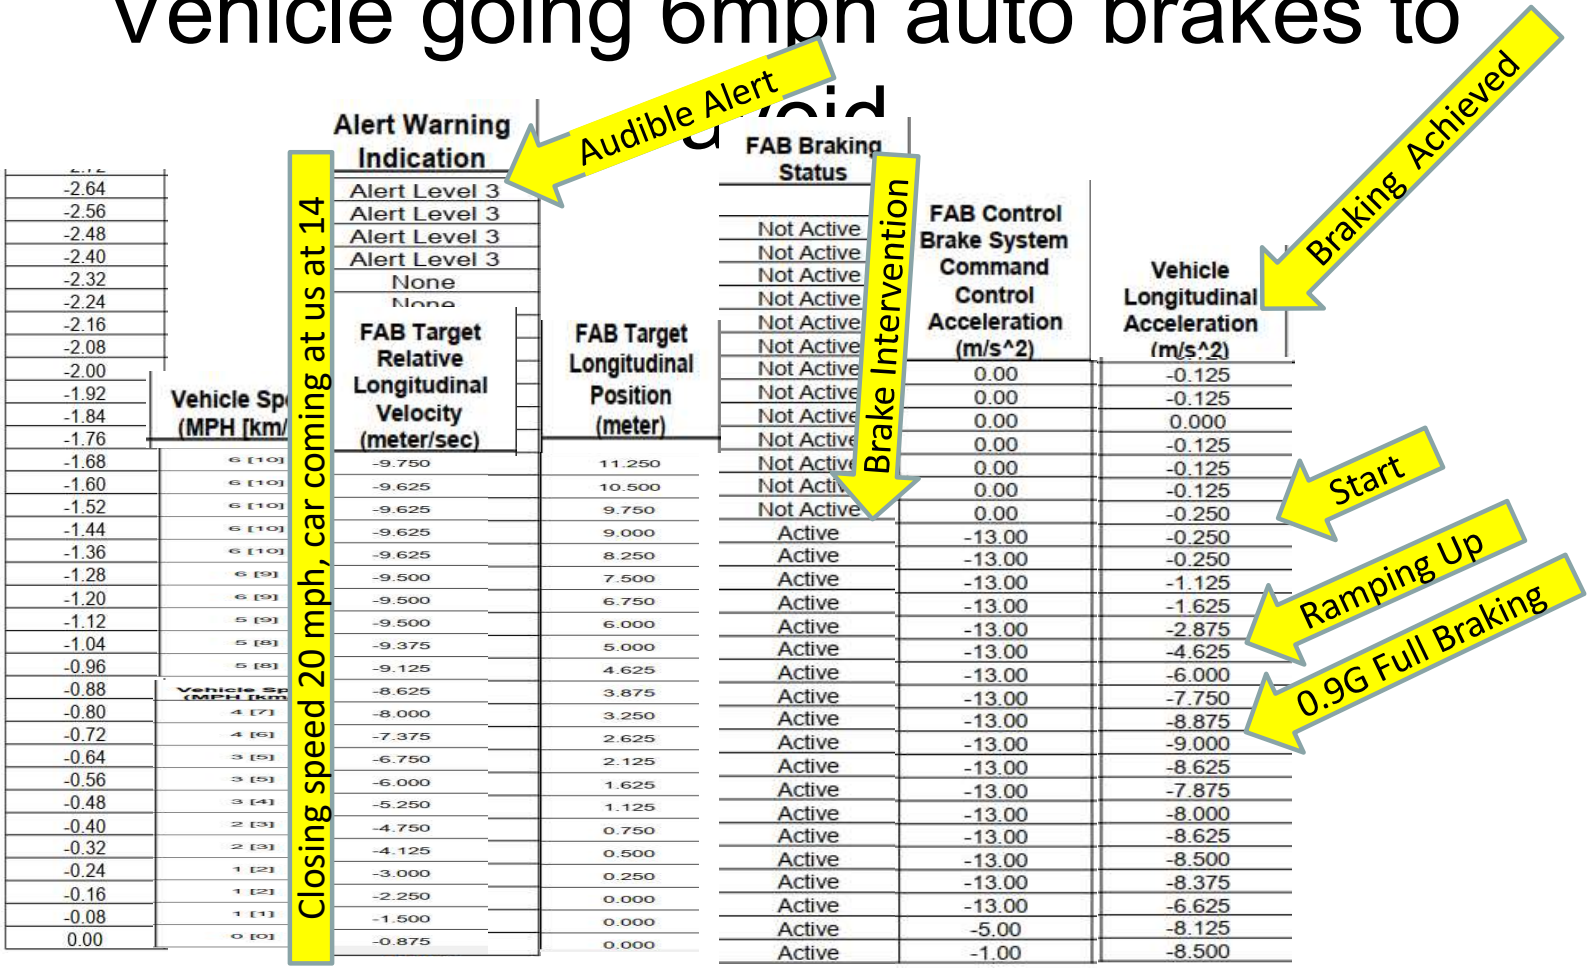

Vehicle Sp (MPH [km/	Alert Warning Indication	FAB Target Relative Longitudinal Velocity (meter/sec)	FAB Target Longitudinal Position (meter)	FAB Braking Status	FAB Control Brake System Command Control Acceleration (m/s^2)	Vehicle Longitudinal Acceleration (m/s^2)
-2.64	Alert Level 3					
-2.56	Alert Level 3					
-2.48	Alert Level 3					
-2.40	Alert Level 3					
-2.32	None					
-2.24	None					
-2.16						
-2.08						
-2.00						
-1.92				Not Active	0.00	-0.125
-1.84				Not Active	0.00	-0.125
-1.76				Not Active	0.00	0.000
-1.68	6 [10]	-9.750	11.250	Not Active	0.00	-0.125
-1.60	6 [10]	-9.625	10.500	Not Active	0.00	-0.125
-1.52	6 [10]	-9.625	9.750	Not Active	0.00	-0.250
-1.44	6 [10]	-9.625	9.000	Active	-13.00	-0.250
-1.36	6 [10]	-9.625	8.250	Active	-13.00	-0.250
-1.28	6 [9]	-9.500	7.500	Active	-13.00	-1.125
-1.20	6 [9]	-9.500	6.750	Active	-13.00	-1.625
-1.12	5 [9]	-9.500	6.000	Active	-13.00	-2.875
-1.04	5 [8]	-9.375	5.000	Active	-13.00	-4.625
-0.96	5 [8]	-9.125	4.625	Active	-13.00	-6.000
-0.88	Vehicle Sp (MPH [km	-8.625	3.875	Active	-13.00	-7.750
-0.80	4 [7]	-8.000	3.250	Active	-13.00	-8.875
-0.72	4 [6]	-7.375	2.625	Active	-13.00	-9.000
-0.64	3 [5]	-6.750	2.125	Active	-13.00	-8.625
-0.56	3 [5]	-6.000	1.625	Active	-13.00	-7.875
-0.48	3 [4]	-5.250	1.125	Active	-13.00	-8.000
-0.40	2 [3]	-4.750	0.750	Active	-13.00	-8.625
-0.32	2 [3]	-4.125	0.500	Active	-13.00	-8.500
-0.24	1 [2]	-3.000	0.250	Active	-13.00	-8.375
-0.16	1 [2]	-2.250	0.000	Active	-13.00	-6.625
-0.08	1 [1]	-1.500	0.000	Active	-5.00	-8.125
0.00	0 [0]	-0.875	0.000	Active	-1.00	-8.500

GM Front Camera Module (FCM)

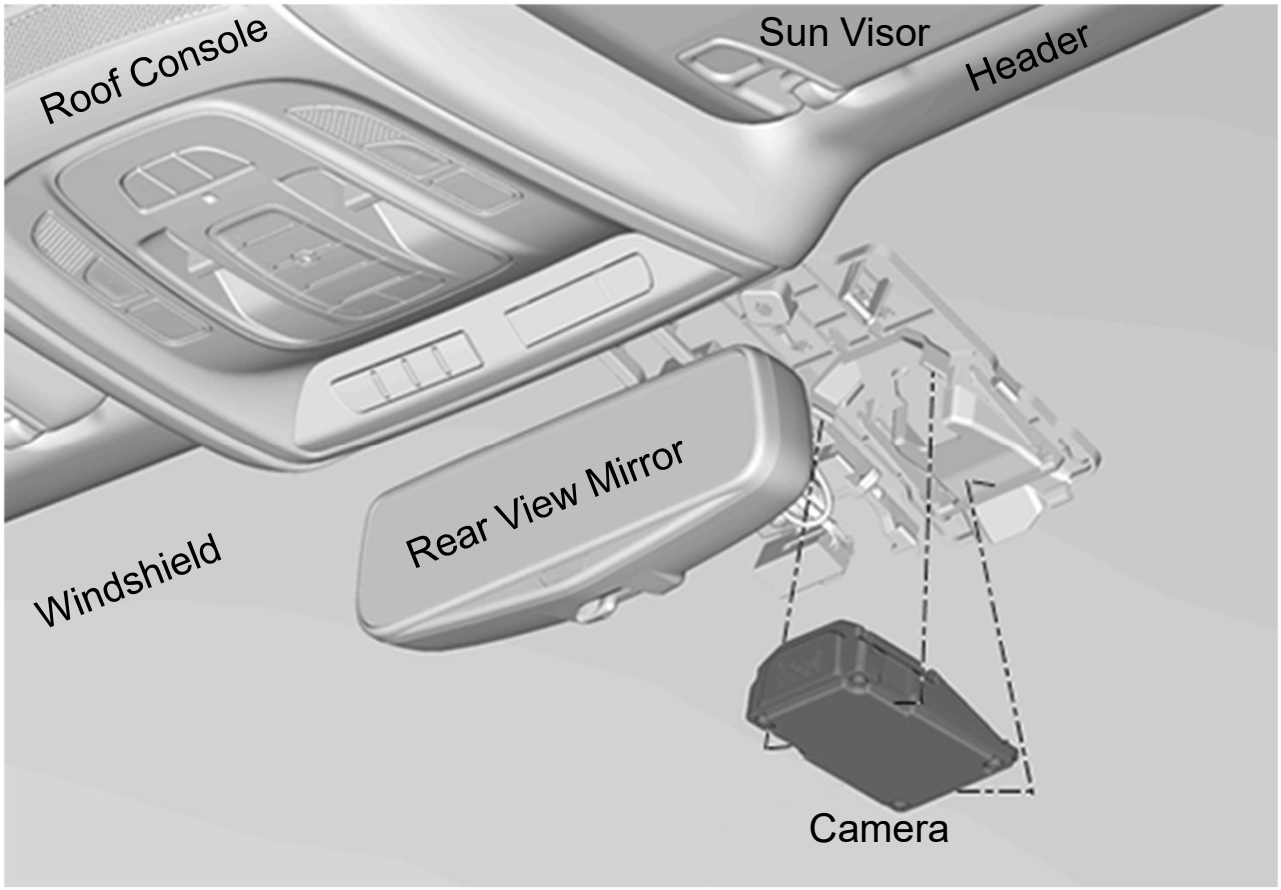


FCMs are mounted on the windshield near the rear view mirror.

GM Auto Emergency Braking

1. AEB will prevent many crashes and reduce the severity of crashes still happening
2. If there is still a crash, the AEB system may store up to 3 camera images in FCM*:
   a) 4 sec before event (*Forward Camera Module)
   b) At event (asynchronous, may be slightly after trigger)
   c) 4 sec after event
3. First accessible with CDR 21.2, more with 24.1 – many still not covered must be requested with proper legal authority from GM

GM FCM EDR

- GM released the ability to read data from Front Camera Modules(FCM) with V 21.2 of the CDR Software (Date: 8/2021)
- The data consists of photos taken before, during, and after the crash.
- Not all GM cars are equipped with FCMs
- Some cars have FCMs but are not supported at this time
- We can identify which cars have an FCM by
  - Looking for presence of the camera module near the rear view mirror
  - Verifying the (RPO) UEU and UGN in older vehicles Service Parts Identification sticker. New QR code on the FMVSS Sticker does NOT have enough detail – get list of options by giving dealer a VIN. (see photos) or use repairlinkshop (next slide)

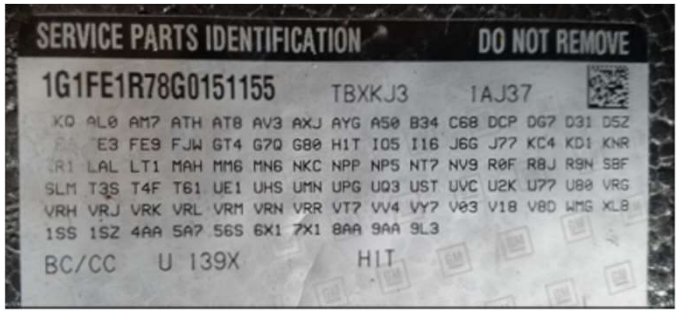




HOW TO GET GM OPTION CODES BEFORE YOUR INSPECTION Steps:

Create a user account at **repairlinkshop.com**

From the home screen, type or paste the VIN into the search bar in the upper right corner (where it says “VIN Most Accurate”) and click search.

It will take you to a screen like this then click the VIN Attributes button and you’ll get a pop up window with build info and RPO codes:

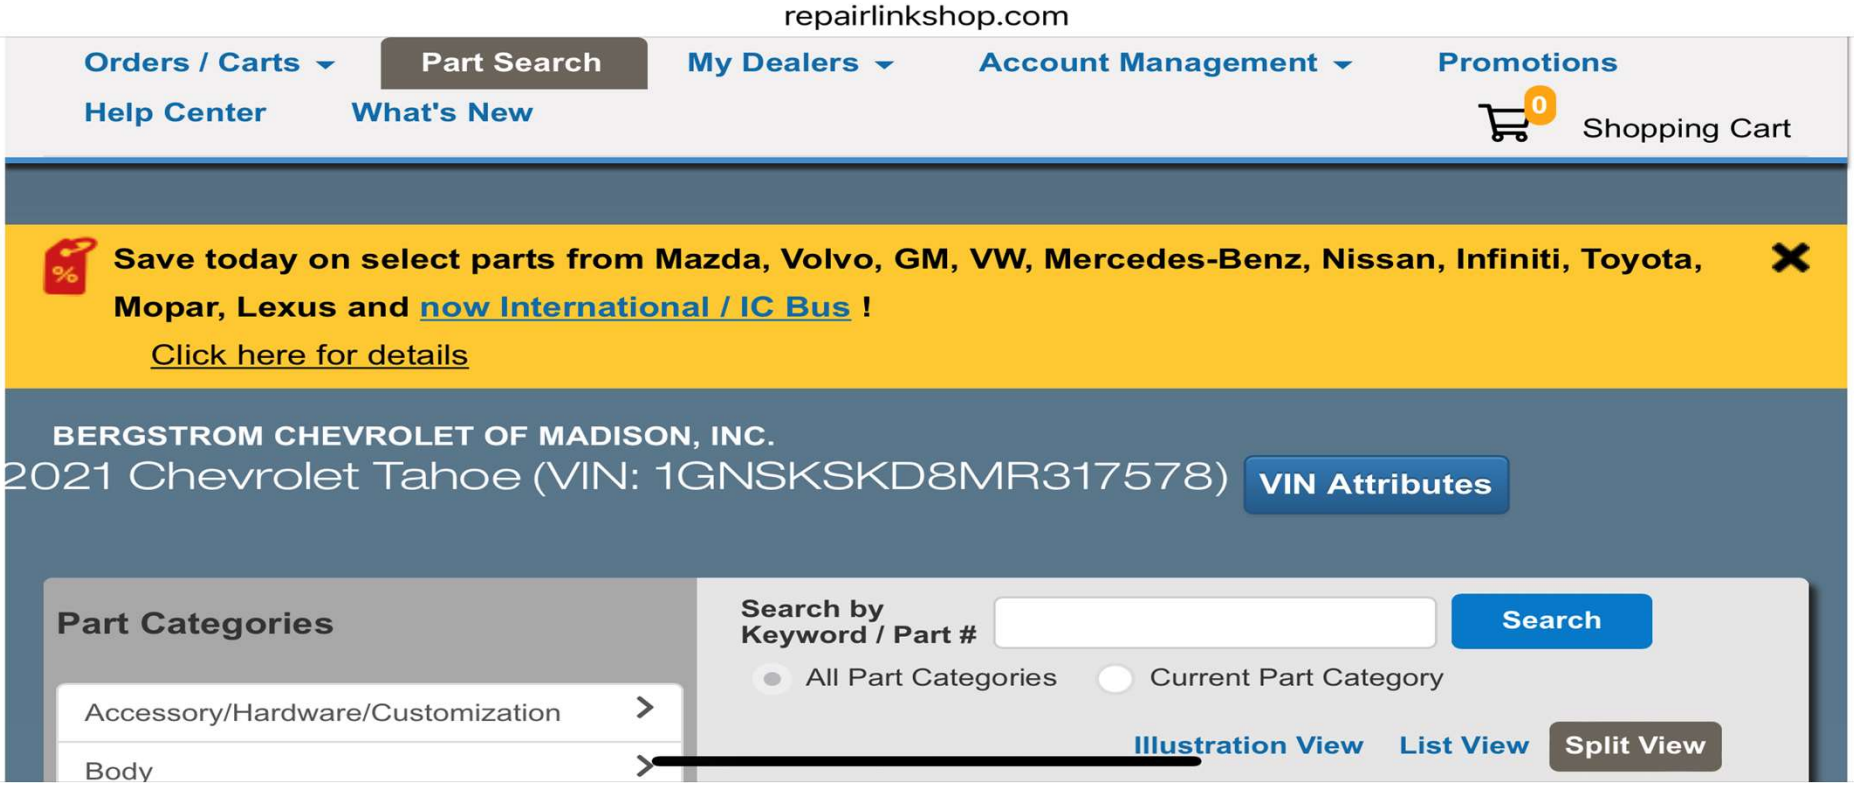

Combined ASCM and FCM Access 24.3



GM FCM EDR

- The Lookup file will identify which GM vehicles may have an

Mkt	Year/Make	Model	Module		Vehicle Interface	OBD/DLC Connect Adapter/Cable	D2M Connect Adapter/Cable	Module Location
4,6	2019 Cadillac	XTS (note 6)	ACM	Data	CANplus	CANplus - F00K108287	CANplus - F00K108454	Center tunnel, forward
			ASCM (Note1)	Data	CDR 900	CDR 900 - click here	CDR 900 - Cable# 833	In the luggage compartment, under the left side trim panel
			FCM (Note1) how to image	Data	CDR 900	CDR 900 - click here	CDR 900 - Cable# 856	Center - top interior of windshield

ACM Data may be present

ASCM Data may be present

FCM Data may be present

89

GM FCM EDR


- The Lookup file will identify which GM vehicles may have an

Mkt	Year/Make	Model	Module		Vehicle Interface	OBD/DLC Connect Adapter/Cable	D2M Connect Adapter/Cable	Module Location
4,6	2019 Cadillac	XTS (note 6)	ACM	Data	CANplus	CANplus - F00K108287	CANplus - F00K108454	Center tunnel, forward
			ASCM (Note1)	Data	CDR 900	CDR 900 - click here	CDR 900 - Cable# 833	In the luggage compartment, under the left side trim panel
			FCM (Note1) how to image	Data	CDR 900	CDR 900 - click here	CDR 900 - Cable# 856	Center - top interior of windshield

Note we get hints on how to DL the FCM – How to image

90

GM ASCM EDR – Bosch CDR 900

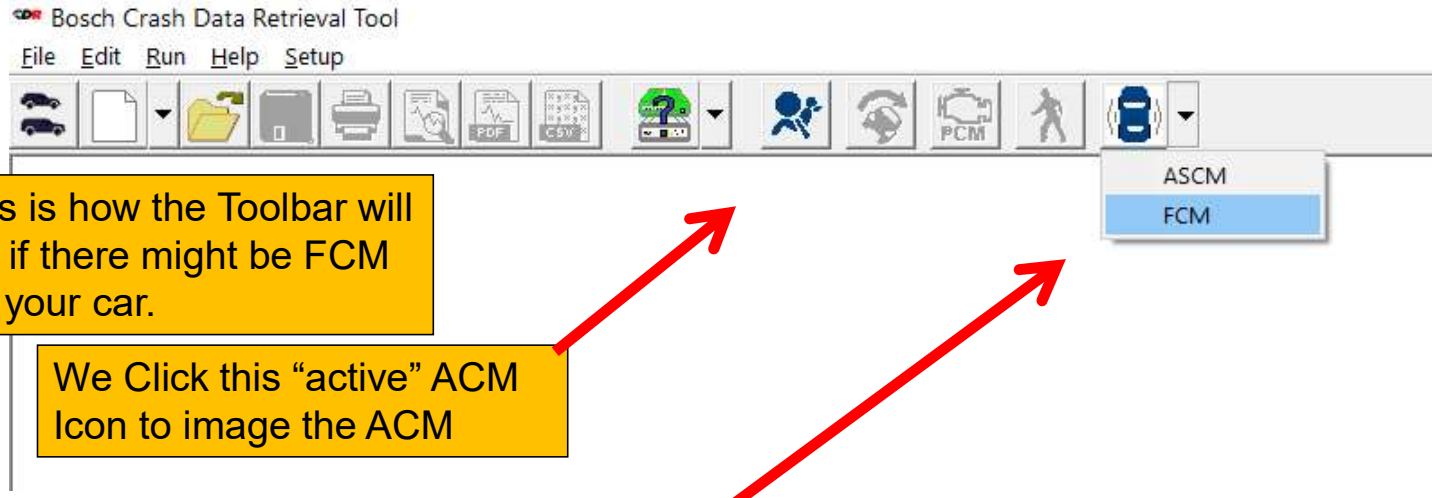

And this is how the Toolbar will appear if there might be FCM data in your car.

We Click this “active” ACM Icon to image the ACM

Then once the ACM Download is complete and saved, we click this “active” Dropdown Icon to image the FCM and then save that file as well. Now we have 3 things to image!!

GM ASCM EDR – Bosch CDR 900



We repeat the idea that we discussed in the DLC training: If you fail to download and save the data from all available modules you are driving away and leaving unread data in the car.


And, just because you can read the ACM via the DLC does not guarantee that you have communication with the FCM, ASCM, FCM, ROS, etc .

GM FCM EDR

- There are several network pathways in modern vehicles
- Damage may allow DLC communication to one module and prevent comm to another module.
- Do the research to see if your car is equipped with all indicated modules (ACM, ASCM, FCM) and read as necessary (DLC or DTM or maybe one of each)
- At this time FCMs are only readable on 2019MY and later GM's
- If you previously read the SDM and ASCM on an FCM now-supported vehicle, you may have to return to read the data from this new module type
- The FCM raw data was NOT saved in any ASCM files you may have read.

GM FCM EDR

- When a CDR file contains image data, the user can export the data using options from the CDR software:

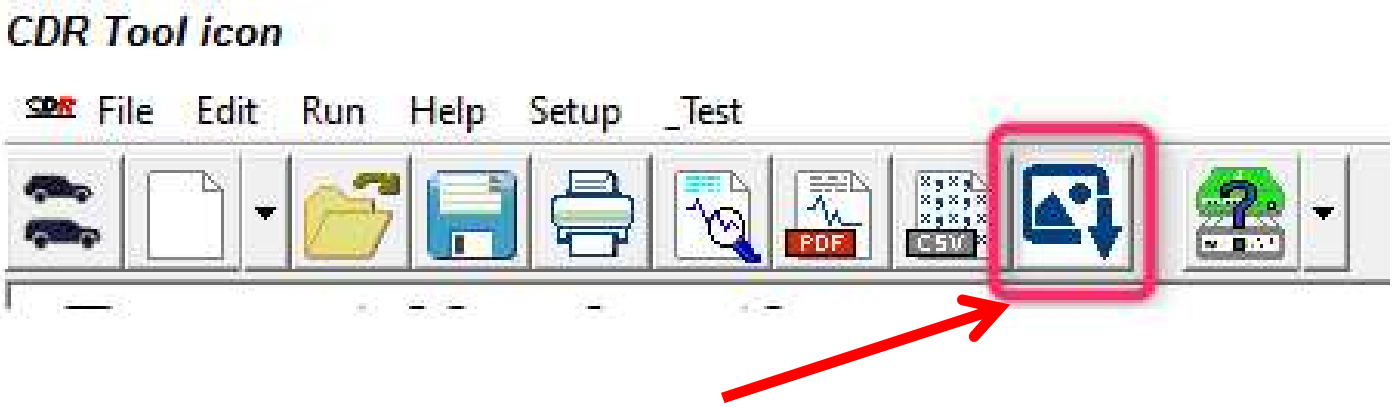

GM FCM EDR

- The Front Camera Module (FCM) can record two events. Recording is triggered by “events of interest”. The following are possible “events of interest” that trigger data recording listed in the priority order:
- Airbag Deployment Event,
- Pretensioner Deployment Event,
- Non-Deployment Event,
- Pedestrian Braking,
- Collision Imminent Breaking (CIB)
- Pedestrian Warning,
- Front Collision Alert,
- Lane Departure Warning.

95

GM FCM EDR

- The new event is stored only if it is equal or higher priority than the priority of one of the currently stored events. The new event overwrites the lowest priority event that is already stored.
- If all previously stored events are of equal priority (and are lower priority than the new event), the oldest stored event is the one being overwritten.
- The image data is not rendered directly in the CDR program .

- It must be exported to a file in the images' native format.

96

GM FCM EDR

- Photos are black and white *.pgm files (**P**ortable **G**ray **M**ap)
- You will need a *.pgm file viewer – many free *.pgm apps are available.

  IRFANVIEW now suggested in help file

  IrfanView - Official Homepage - One of the Most Popular Viewers Worldwide
- Users can regenerate the images collected by the FCM as many times as they wish recreating the file as it existed when the data was collected from the vehicle.
- Yet again we see that having the Raw file IS the evidence – As an analyst, *if sharing with another,* you want the raw FCM cdrx file, not someone else's downloaded *.pgm images.
- The data in the FCM CDRx file remains untouched and cannot be changed.
- The images can be downloaded and generated from the Raw file as many times as necessary.

GM FCM EDR

- If the exported image file appears to be changed by another user, you can re-export the image directly from the CDR file it was created; therefore, removing any doubt that the data source was changed after the file was generated.
- One more issue… The FCM image will be upside down.



98

GM FCM EDR

- The solution is to “Invert” or Flip the photo. DO NOT “rotate” it.



- Original FCM “upside down” photo



- A successfully “inverted” or “flipped” photo

(if you convert pgm to jpg, grab the photo at the top and drag the top thru the bottom of the photo to invert it)

- A confusing, inaccurate “rotated” photo.

(Note car appears to be driving on *wrong side of road*)




4 different modules to read in GM Occupant Classification Sensor


Mkt	Year/Make	Model	Module	New CDR2		Vehicle Interface	OBD/DLC Connect Adapter/Cable	D2M Connect Adapter/Cable	Module Location
4	2024 Chevrolet	Silverado EV	ACM	N/A	Data	CDR 900	CDR 900 - click here	Cable ID # 852 CDR 900 - click here (use listed cable above)	Center tunnel
			ASCM (Note2)	N/A		CDR 900	CDR 900 - click here	CDR 900 - Cable# 870	Below rear driver's side seat.
			FCM how to image	N/A	Data	CDR 900	CDR 900 - click here	CDR 900 - Cable# 856	Center - top interior of windshield
ar Buttons			OCS	CDR 2		CDR 900	CDR 900 - click here	D2M downloads are not supported	Under Passenger Seat

Toyota CDR 23.3 Coverage US Models


Reviewed in 24.1 July 2024 – no major changes – note Gen 4 propagation

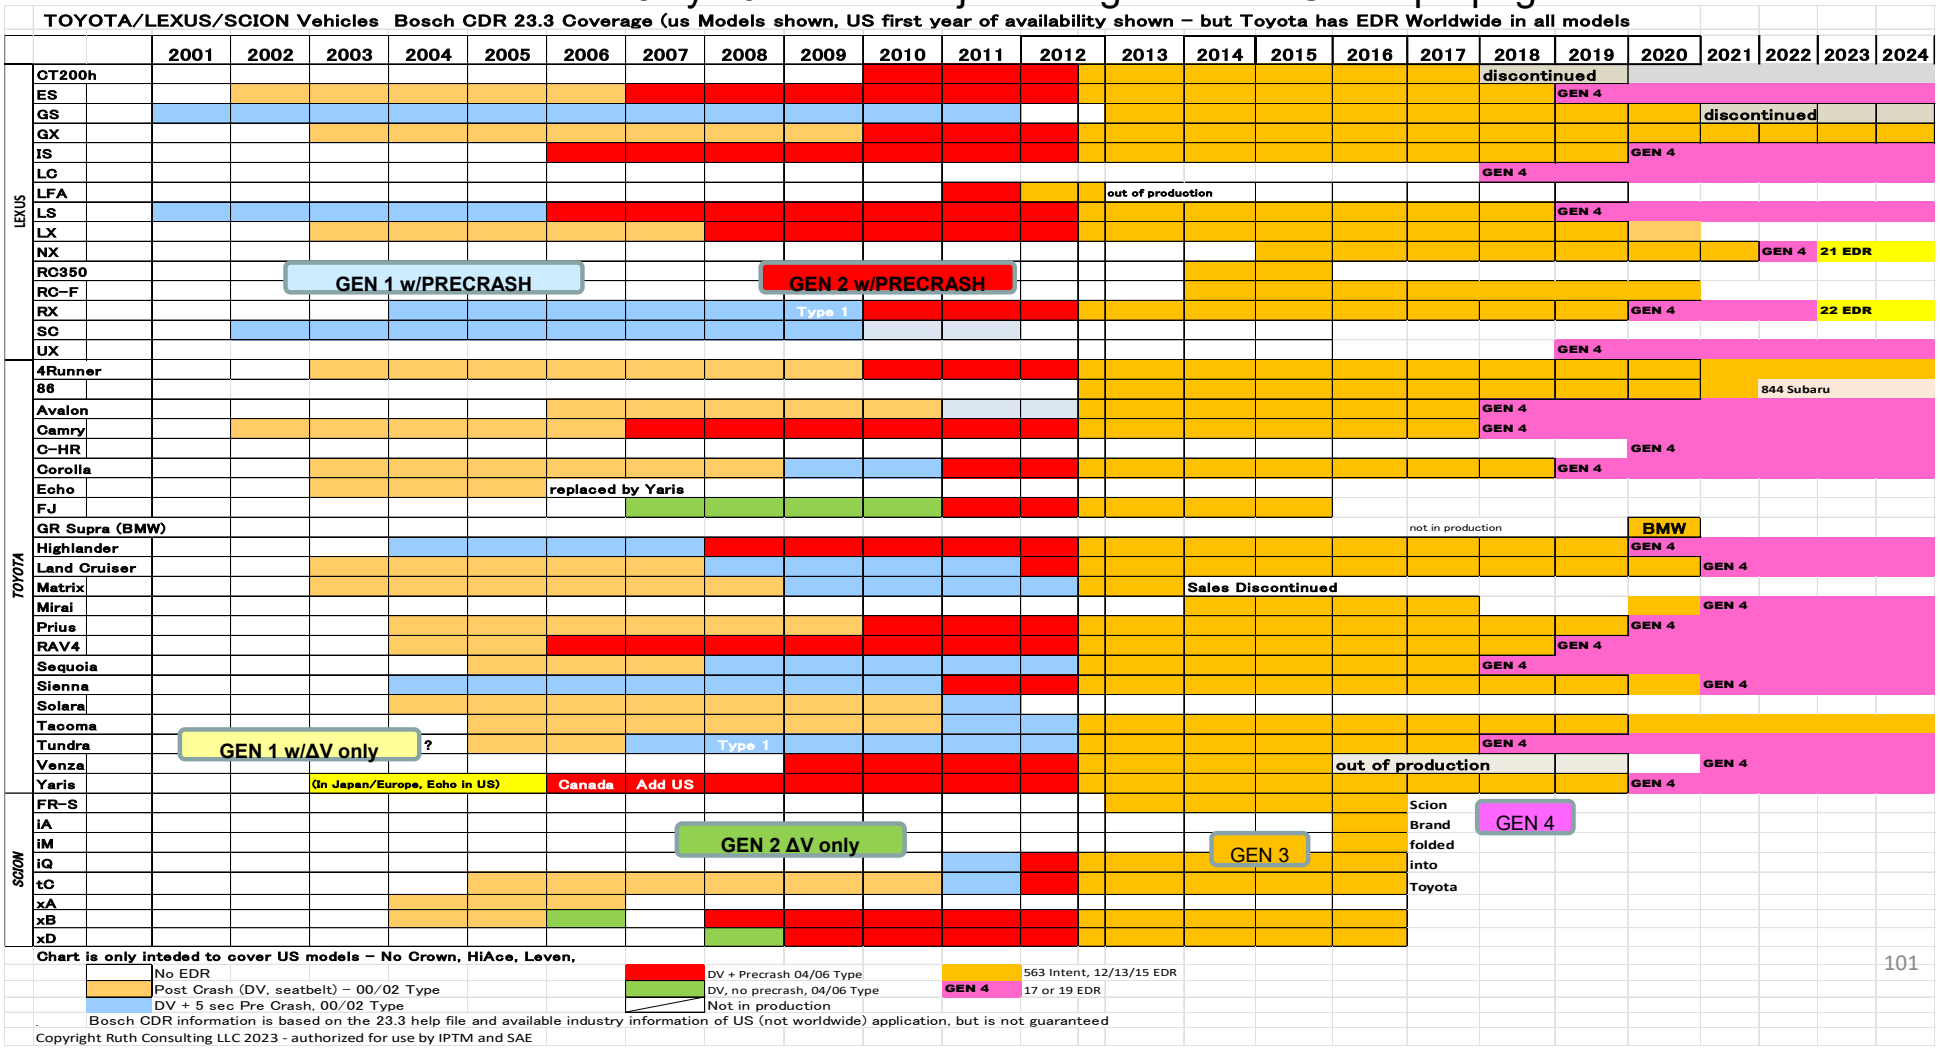


Toyota EDR Evolution

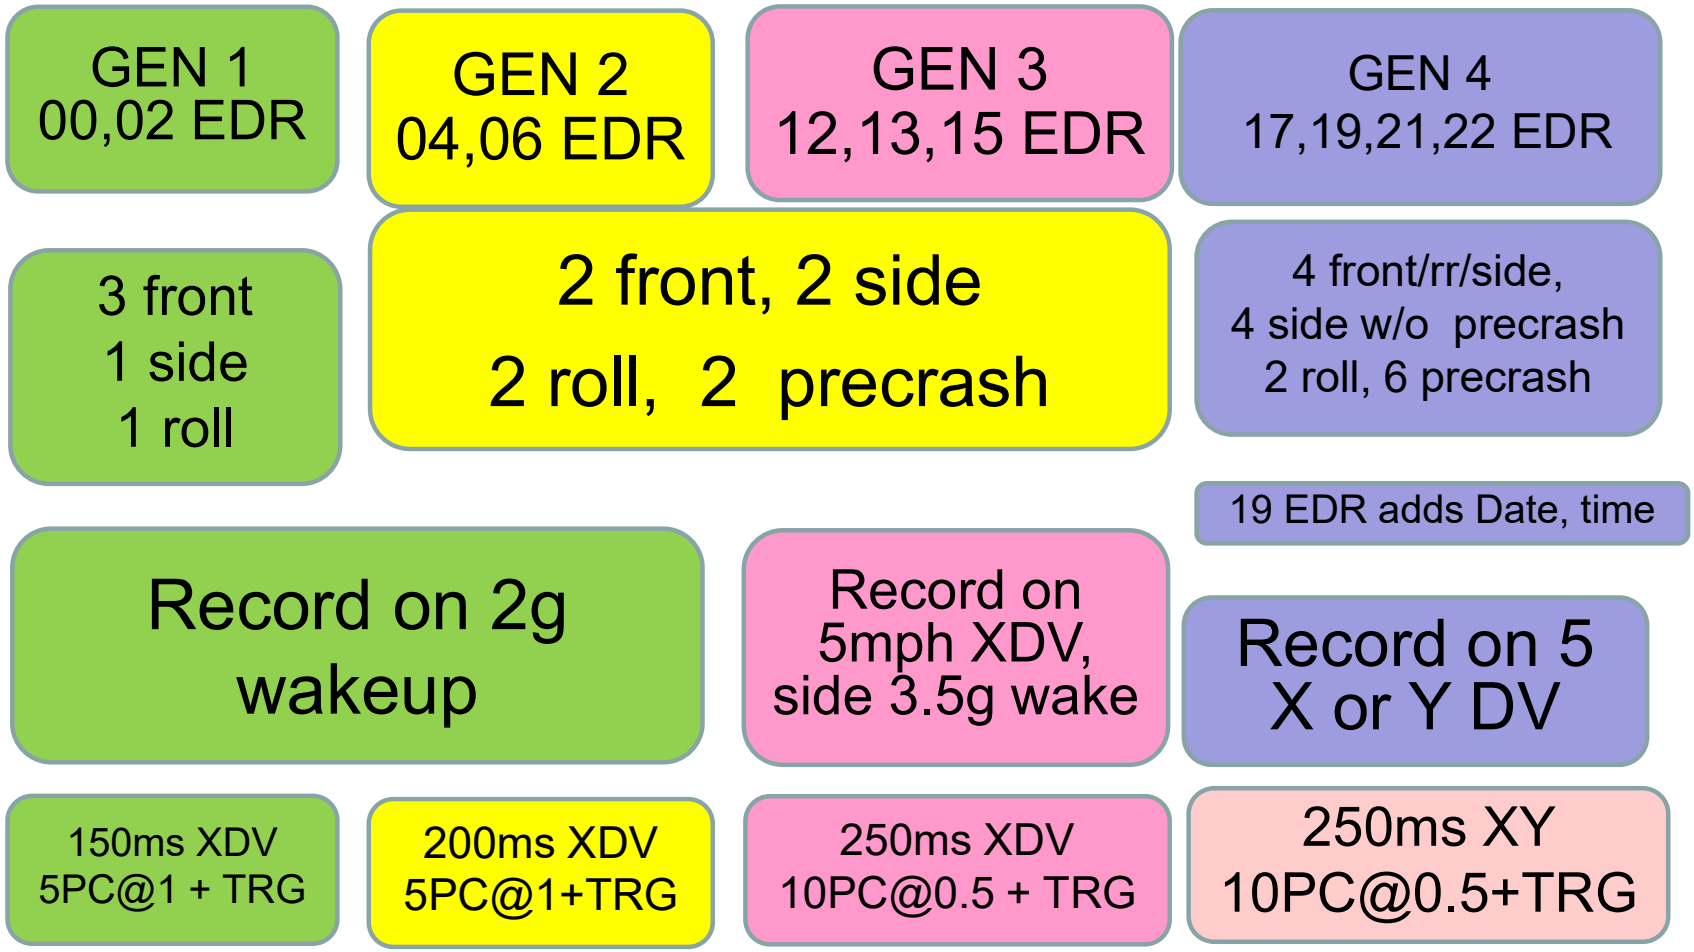

Toyota EDR Evolution cont'd

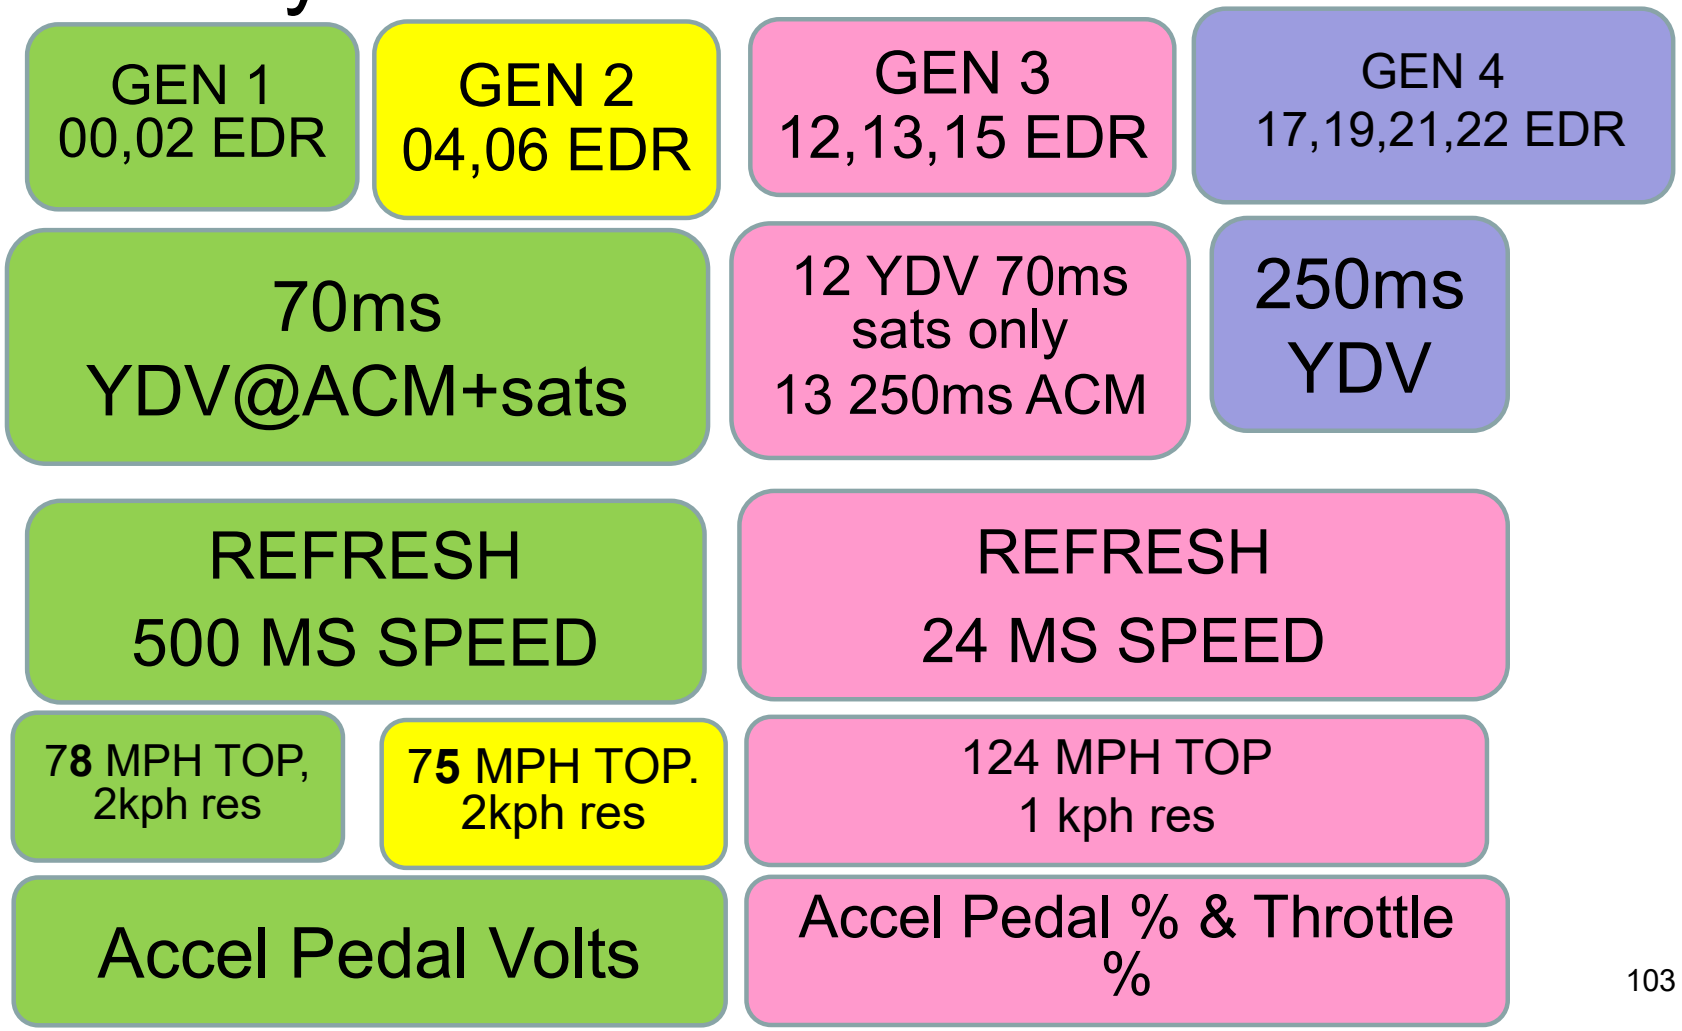

Toyota EDR Evolution cont'd

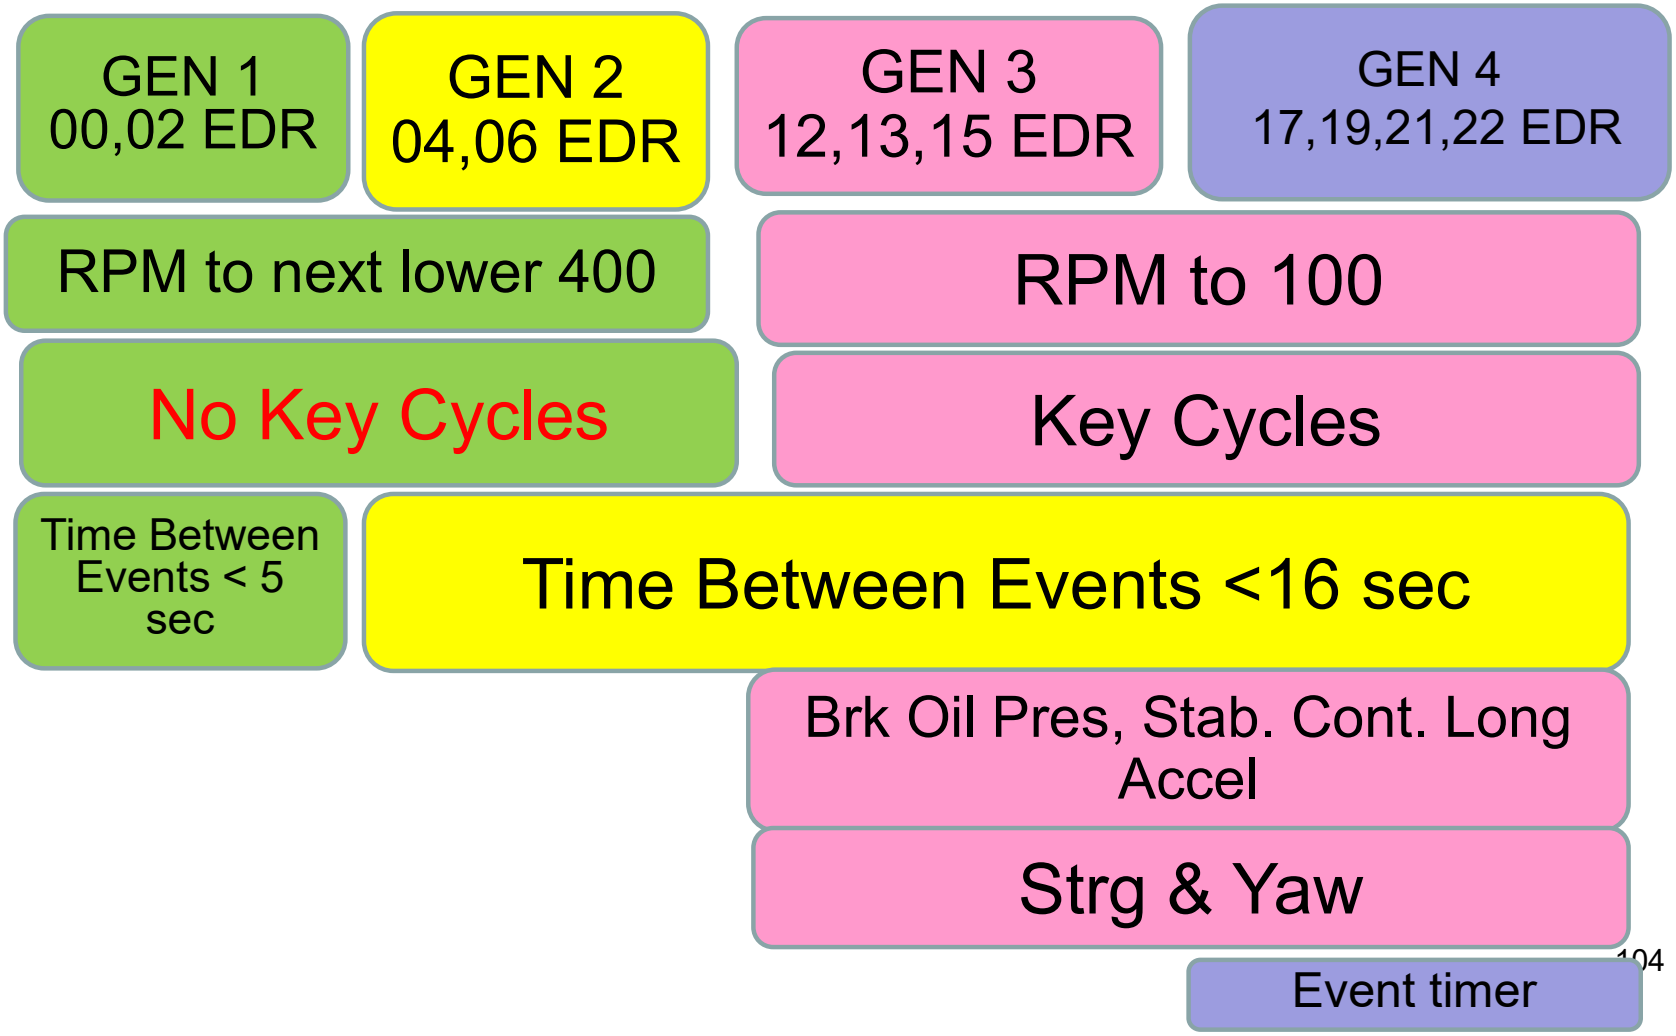

“17 EDR”, “19 EDR”, “21EDR” & “22EDR”

- “Front/Rear” events also triggered by 5mph Y DV or side deployment
- Y Delta V from ACM added to frontal events for recon
- More precrash registers (6 vs 2 prior)
- More front/rear & side registers (4 vs 2)
- Separate side events still reported, but do NOT have precrash associated with them. Side events have detail of side satellite sensors (generally ***not used*** by Recons).
- Odometer data element added
- 19-21-22 EDR adds date/time of crash

17 EDR Event Record Summary
Print ERS and note key cycles at each event
Analyze 1st event associated with crash 1st

Event Record Summary at Retrieval

Events Recorded	TRG Count	Crash Type	Time (msec)	Pre-Crash Recording Status	Diagnostic Data Recording Status	Occupant Data Recording Status	Crash Info Recording Status	Time Series Recording Status
Most Recent Event	10	Side Crash	0	N/A	Complete	N/A		plete
1st Prior Event	9	Frontal/Rear/Si	-898	Complete		Complete	Complete	Complete
2nd Prior Event	8	ide Crash	-925	N/A			N/A	Complete
3rd Prior Event	6	Side Crash	N/A			N/A	N/A	Complete
4th Prior Event	5	Rollover	N/A	omplete	Complete	Complete	Incomplete	Incomplete
5th Prior Event	4	Frontal/Rear/Side Crash	N/A	Complete	Complete	Complete	Complete	Complete
6th Prior Event	3	Side Crash	N/A	N/A		N/A	N/A	Complete
7th Prior Event	2	Rollover	N/A	Complete			Complete	Complete

Pages NOT numbered like Gen3

#7 missing

Lost count due to 7 missing

The big event – start here

No precrash for sides

17 EDR Same Data, New Look to Precrash

Pre-Crash Data -5 to 0 Seconds (1st Prior Event, TRG 2) - Table 1 of 4

Time (sec)	Vehicle Speed (MPH [km/h])	Accelerator Pedal, % Full (%)	Percentage of Engine Throttle (%)	Fuel Injection Quantity (mm^3/st)	Engine RPM (RPM)	Motor RPM (RPM)	Service Brake, ON/OFF
-5.00	29.8 [48]	49.5	24.5	Invalid	2,400	Invalid	OFF
-4.50	32.3 [52]	47.0	24.5	Invalid	2,500	Invalid	OFF
-4.00	34.2 [55]	38.0	20.0	Invalid	2,700	Invalid	OFF
-3.50	35.4 [57]	32.5	16.0	Invalid	2,800	Invalid	OFF
-3.00	36.7 [59]	26.5	13.5	Invalid	2,400	Invalid	OFF
-2.50	37.3 [60]	22.5	11.0	Invalid	2,400	Invalid	OFF
-2.00	37.3 [60]	19.0	8.5	Invalid	2,200	Invalid	OFF
-1.50	38.5 [62]	19.0	6.0	Invalid	1,900	Invalid	OFF
-1.00	37.9 [61]	18.0	5.5	Invalid	1,900	Invalid	OFF
-0.50	37.9 [61]	18.0	5.0	Invalid	1,800	Invalid	OFF
TRG(0)	36.0 [58]	100.0	26.0	Invalid	1,700	Invalid	OFF

Pre-Crash Data -5 to 0 Seconds (1st Prior Event, TRG 2) - Table 2 of 4

Time (sec)	ABS Control Status	BOS Control Status	Brake Oil Pressure (Mpa)	Longitudinal Acceleration , VSC Sensor (m/s^2)	Yaw Rate (deg/s)	Steering Input (degrees)	Shift Position
-5.00	OFF	OFF	0.00	1.579	-0.98	-4.5	D
-4.50	OFF	OFF	0.00	1.795	0.00	-1.5	D
-4.00	OFF	OFF	0.00	1.292	0.49	0.0	D
-3.50	OFF	OFF	0.00	0.861	0.00	-1.5	D
-3.00	OFF	OFF	0.00	0.718	0.00	-1.5	D
-2.50	OFF	OFF	0.00	-0.072	0.00	-1.5	D
-2.00	OFF	OFF	0.00	0.000	0.00	-1.5	D
-1.50	OFF	OFF	0.00	0.000	-0.49	-1.5	D
-1.00	OFF	OFF	0.00	0.287	0.00	-1.5	D
-0.50	OFF	OFF	0.00	-0.144	0.00	-1.5	D
TRG(0)	OFF	OFF	0.48	-1.507	61.00	-19.5	D

Pre-Crash Data -5 to 0 Seconds (1st Prior Event, TRG 2) - Table 3 of 4

Time (sec)	Sequential Shift Range	Cruise Control Status	VSC Control Status	READY Signal	Drive Mode, Power Train	Drive Mode, Snow	Drive Mode, EV
-5.00	Undetermined	OFF	ON (enable)	Invalid	Normal	OFF	Invalid
-4.50	Undetermined	OFF	ON (enable)	Invalid	Normal	OFF	Invalid

2022 Mirai,19+ Lexus LS PPM (Pedestrian)

- PPM memory is integral to ACM but requires downloading a separate file to get the data. Two event spaces.
- Future PPM may be a separate module.
- Help file will identify this, look to see if ACM/PPM use same cable

2021 LS HV (all markets)	ACM	N/A	Data - 19EDR	CDR 900	CDR 900 - click here	Cable# 827 CDR 900 - click here (use listed cable above and no ACM adapter)	Under Center Console
2019 - 2021 (non-HV)	PPM (pop-up hood) *if equipped*	N/A	Data - 17EDR	CANplus or CDR 900	CANplus - F00K108287 *- for CANplus interface only, you must use the DLC 4 OBD Adapter when connecting to vehicles sold outside the*	CANplus - F00K108387 & Cable#827 CDR 900 - click here (use listed cable above and no ACM adapter)	*Note: if equipped with PPM, its EDR data is stored in the ACM but requires separate downloads for each system*

Pedestrian Protection Events VIN_PPM

EDR Device Type	Pedestrian Protection Module
Event(s) recovered	Pedestrian Events (2)

Read separate from ACM

System Status at Pedestrian Event (1st Prior Event, TRG 1)

TRG Count (times)	1
TRG Count not for Pedestrian (times)	SNA
Ignition Cycle, Crash (times)	353
Odometer signal (miles [km])	1,195 [1,923]
Trip count (times)	392
Time count (msec)	1,283,900
Time count input system	Normal
Airbag Warning Lamp, On/Off	OFF
Pedestrian Warning Lamp, On/Off	OFF
Time from Previous TRG (msec)	32767 or greater
Time from Pre-Crash to TRG (msec)	300
Time between TRG not for Pedestrian and TRG for Pedestrian (msec)	SNA
TRG Establishment not for Pedestrian, within 5 sec.	ON
Freeze Signal	ON
Recording Status, Pre-Crash	Complete
Recording Status, Crash Info.	Complete
Recording Status, EDR Correlation Info.	Complete

Synch to ACM

Deployment Command Data (1st Prior Event, TRG 1)

Front Pop-Up Hood, Time to Deploy (msec)	3.0
Rear Pop-Up Hood, Time to Deploy (msec)	3.0
Airbag for Pedestrian Deployment, Time to Deploy (msec)	SNA

DTCs Present at Time of Event (1st Prior Event, TRG 1)

Recording Status, Diagnostic	Complete
Ignition Cycle Since DTC was Set (times)	0
Warning ON Time Since DTC was Set, for Pedestrian (min)	0
Diagnostic Trouble Codes	None

Pedestrian Event Crash Pulse (1st Prior Event, TRG 1)

Recording Status, Time Series Data	Complete
Time from TRG to Next Sample (msec)	1

Link to Updated GTS how-to by Brad Muir



GTS+ User Guide for Distribution - 10-2024 Brad Muir.pdf

TOYOTA/LEXUS Vehicles with Vehicle Control History Data and LSS/TSS with Techstream Data

		2013	2014	2015	2016	2017	2018	2019	2020	2021	2022	2023	2024
LEXUS	ES				LSS	LSS	LSS	LSS 2.0	LSS 2.0	LSS 2.0	LSS+ 2.5	LSS+ 2.5	LSS+ 2.5
	GS				LSS	LSS	LSS	LSS	LSS	discontinued			
	GX								LSS	LSS	LSS	LSS 2.0	LSS 3.0
	IS		250 and 350			LSS	LSS	LSS	LSS	LSS 2.0	LSS+ 2.5	LSS+ 2.5	LSS+ 2.5
	LC						LSS	LSS	LSS	LSS	LSS	LSS	LSS+ 2.5
	LS						LSS	LSS 2.0	LSS 2.0	LSS 2.0	LSS+ 2.5	LSS+ 2.5	LSS 3.0
	LX						LSS	LSS 2.0	LSS 2.0	LSS 2.0	LSS+ 2.5	LSS+ 2.5	LSS+ 2.5
	NX						LSS		LSS 2.0	LSS 2.0	LSS 3.0	LSS 3.0	LSS 3.0
	RC						LSS	LSS	LSS	LSS	LSS	LSS+ 2.5	LSS+ 2.5
	RX				LSS	LSS	LSS		LSS 2.0	LSS 2.0	LSS 2.0	LSS 3.0	LSS 3.0
	UX							LSS 2.0	LSS 2.0	LSS 2.0	LSS 2.0	LSS+ 2.5	LSS+ 2.5
TOYOTA	4Runner								TSS-P	TSS-P	TSS-P	TSS-P	TSS-P
	Avalon				TSS-P	TSS-P	TSS-P	TSS-P	TSS-P	TSS-P	TSS+ 2.5		
	C-HR						TSS-P	TSS-P	TSS-P	TSS+ 2.5	TSS+ 2.5		
	Camry						TSS-P	TSS-P	TSS-P	TSS+ 2.5	TSS+ 2.5	TSS+ 2.5	TSS+ 2.5
	Corolla						TSS-P	TSS 2.0	TSS 2.0	TSS 2.0	TSS 2.0	TSS 3.0	TSS 3.0
	Highlander							TSS-P	TSS 2.0	TSS+ 2.5	TSS+ 2.5	TSS+ 2.5	TSS+ 2.5
	Land Cruiser				TSS-P	TSS-P	TSS-P	TSS-P	TSS-P	TSS-P			
	Mirai							TSS 2.0	TSS 2.0	TSS+ 2.5	TSS+ 2.5	TSS+ 2.5	TSS 3.0
	Prius			C and P	and Prius	and Prime			TSS-P	TSS 2.0	TSS 2.0	TSS 3.0	TSS 3.0
	RAV4						TSS-P	TSS 2.0	TSS 2.0	TSS 2.0	TSS 2.0	TSS+ 2.5	TSS+ 2.5
	Sequoia						TSS-P	TSS-P	TSS-P	TSS-P	TSS-P		
	Sienna								TSS-P				
	Tacoma						TSS-P	TSS-P	TSS-P	TSS-P	TSS-P	TSS-P	TSS 3.0
	Tundra						TSS-P	TSS-P	TSS-P	TSS-P	TSS+ 2.5	TSS+ 2.5	TSS+ 2.5
	Venza												
	Yaris												
SCION	iM												

Accessing VCH data

- Buy short term Subscription from Toyota
- Software changed from “techstream” to Global GTS+
- Techstream discontinued Sept 2024
- CDR 900 still works as VIM but you must select it and input the serial number of your 900
- Users are reporting problems finding everything techstream had in GTS+ - one report required a screen shot for each time stamp instead of one file with it all in it
- Be sure to save PDF’s of “VDAS” file before subscription expires – VDAS will not open without subscription

TSS 1.0 (TSS-P, TSS-C, LSS) Photo Storage

- For Images to be recorded and linked the

  VEHICLE must brake
- A PCS warning buzzer is not sufficient for images to be linked with VCH and recorded
- If vehicle begins to brake and driver responds, then related images should be stored
- CHECK: perform CDR download FIRST. Look for deceleration with no driver input: i.e. no brake switch = on, no brake oil pressure, but speed drops more than idling down

TSS 2.0 Photo Storage

- Adds new Image capture categories:
  - Vehicle behavior related image data: 1 Set of images
  - PCS related image data: 3 Sets of images (Pre-Crash, AEB)
  - LKA related image data: 1 Set of images (Lane Keep)
  - ICS related image data : 3 Sets of images
    (Intelligent Clearance Sonar – short range)
  - Collision related image data : 2 Sets of images

TSS 2.5 / 2.5+

- 2021 Camry and Highlander and Lexus IS to start
- Camera / Millimetre Wave Radar optimized improve response range and enhanced low light pedestrian and daytime bicycle recognition.
- Pre-Collision System adds new Features

TSS-C	TSS-P	TSS 2.0	TSS 2.5+
TSS-C features Pre-Collision System, Lane Departure Alert, and Automatic High Beam.	TSS-P enhances TSS-C, and adds Dynamic Radar Cruise Control to its suite of systems.	Builds on TSS-P, and consists of up to six active safety and driver assistance systems.	TSS 2.5+ adds new capabilities to the Pre-Collision and Dynamic Radar Cruise Control Systems, and enhances Lane Tracing Assist.

TSS 3.0

- Adds cross vehicle traffic detection

20 Images from the Toyota FCM @ 0.6 sec



Sample VCH Summary

Vehicle Diagnostic Report

2020 Rav4 [redacted]
004320 mile

[redacted]

[redacted]

Printed By: Default User(1)

[redacted]

Vehicle Control History Report
(1 of 2)

Current Key Cycle : 00372
Current Key Cycle Elapsed Time : 00000:17:23
Maximum Number of Overwrite of the Recording Area : 30000

Key Cycle : All

Key Cycle	Elapsed Time	Clock Type	Time and Date	Trigger	Image	ODO (mile)	Number of Overwrite of the Recording Area
00030	00000:53:56.4	-	2/1/2020 4:24:56 PM	Steering angle speed over certain number was detected (related to LDA/LKA/LTA)	Icon	51	1
00044	00000:19:06.4	-	2/4/2020 11:00:03 AM	PCS operation history		264	1
00051	00000:01:15.3	-	2/6/2020 9:30:21 AM	Steering angle speed over certain number was detected (related to LDA/LKA/LTA)	Icon	315	1
00055	00000:24:15.8	-	2/7/2020 8:50:59 AM	Steering angle speed over certain number was detected (related to LDA/LKA/LTA)	Icon	340	1

VCH may capture ped hits EDR won't (<5)

Vehicle Control History

Key Cycle	All

Current Key Cycl
00372


Key Cycle	Elapsed Time	Clock Type	Time and Date	Trigger
00143	00000:47:31.8	-	2/24/2020 11:24:28 AM	Steering angle speed over certain number was dete
00144	00000:19:09.1	-	2/24/2020 7:22:43 PM	PCS operation history
00145	00000:07:55.7	-	2/24/2020 7:53:02 PM	Sudden braking history
00162	00000:43:37.7	-	2/28/2020 6:26:13 PM	PCS operation history
00178	00000:03:40.9	-	3/4/2020 5:09:47 PM	Steering angle speed over certain number was dete
00182	00000:24:30.4	-	3/6/2020 5:50:27 PM	Sudden braking history
00182	00000:24:30.4	-	3/6/2020 5:50:27 PM	PCS operation history
00182	00000:24:30.5	-	3/6/2020 5:50:27 PM	Steering angle speed over certain number was dete
00182	00000:24:30.8	-	3/6/2020 5:50:27 PM	Accelerator signal and brake signal input simultane
00226	00000:00:04.3	-	3/27/2020 6:58:48 AM	Accelerator signal and brake signal input simultane

VCH data every 0.15 sec!

Tips Using VCH Data for Ped Hits

- Use date/time feature and key cycles to find your event. Beware if user sets clock wrong the time will be wrong.
- Typically look for **last** recorded events but often there are postcrash recovery events after the event of interest
- Look for sudden accel release, **sudden braking**, sudden steering avoidance to identify reaction to ped – brake to stop?
- Be sure to download CSV file and NOT just PDF's- PDF's do not contain all timing info and all data that CSV does
- Look at event type – sudden braking, PCS operation
- Look for ignition on timer in ms to help synchronize events


Ford 09+ CDR 23.2 Coverage

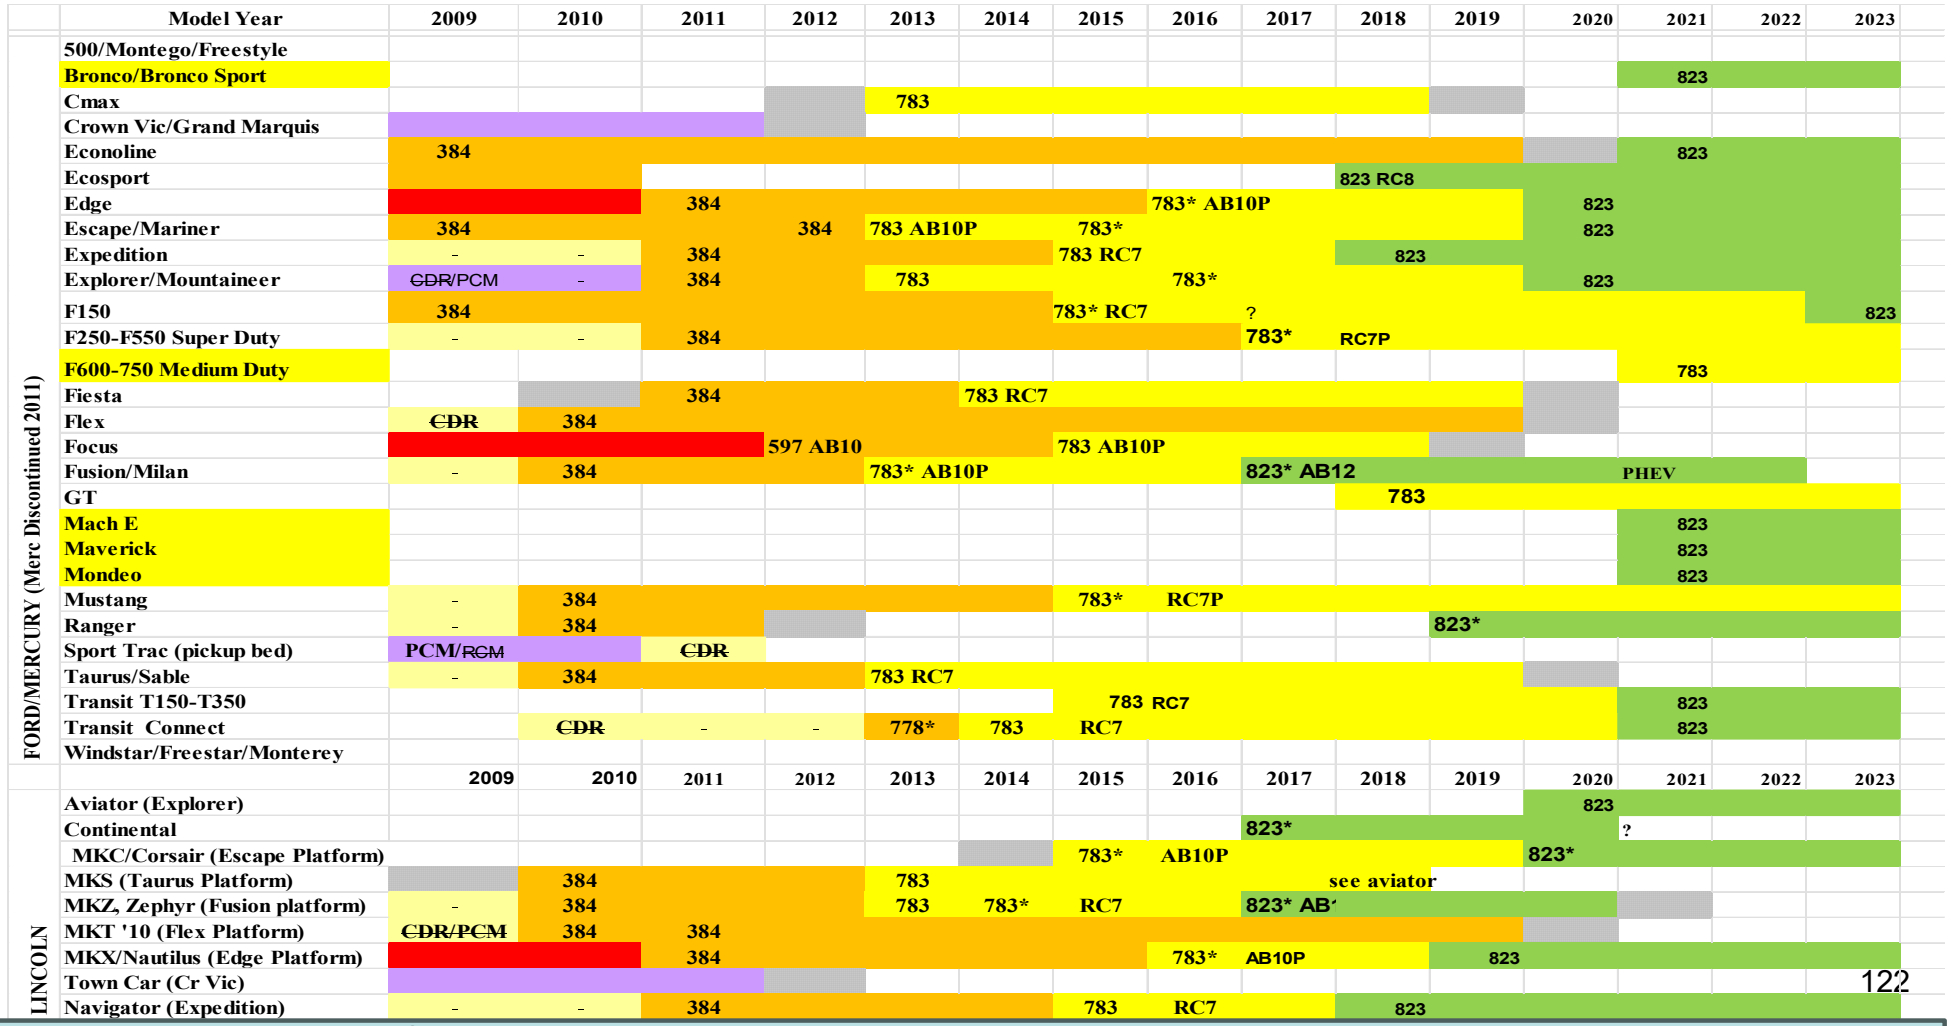

	Model Year	2009	2010	2011	2012	2013	2014	2015	2016	2017	2018	2019	2020	2021	2022	2023
FORD/MERCURY (Merc Discontinued 2011)	500/Montego/Freestyle															
	Bronco/Bronco Sport													823		
	Cmax					783										
	Crown Vic/Grand Marquis															
	Econoline	384												823		
	Ecosport										823 RC8					
	Edge			384					783* AB10P				823			
	Escape/Mariner	384			384	783 AB10P		783*					823			
	Expedition	-	-	384				783 RC7			823					
	Explorer/Mountaineer	~~CDR~~/PCM	-	384		783			783*				823			
	F150	384						783* RC7		?						823
	F250-F550 Super Duty	-	-	384						783*	RC7P					
	F600-750 Medium Duty													783		
	Fiesta			384			783 RC7									
	Flex	~~CDR~~	384													
	Focus				597 AB10			783 AB10P								
	Fusion/Milan	-	384			783* AB10P				823* AB12				PHEV		
	GT										783					
	Mach E													823		
	Maverick													823		
	Mondeo													823		
	Mustang	-	384					783*	RC7P							
	Ranger	-	384									823*				
	Sport Trac (pickup bed)	PCM/~~RCM~~		~~CDR~~												
	Taurus/Sable	-	384			783 RC7										
	Transit T150-T350							783 RC7						823		
	Transit Connect		~~CDR~~	-	-	778*	783	RC7						823		
	Windstar/Freestar/Monterey															
		2009	2010	2011	2012	2013	2014	2015	2016	2017	2018	2019	2020	2021	2022	2023
LINCOLN	Aviator (Explorer)												823			
	Continental									823*				?		
	MKC/Corsair (Escape Platform)							783*	AB10P				823*			
	MKS (Taurus Platform)		384			783					see aviator					
	MKZ, Zephyr (Fusion platform)	-	384			783	783*	RC7		823* AB						
	MKT '10 (Flex Platform)	~~CDR/PCM~~	384	384												
	MKX/Nautilus (Edge Platform)			384					783*	AB10P		823				
	Town Car (Cr Vic)															
	Navigator (Expedition)	-	-	384				783	RC7		823					

No New families since 2018 but some additional data elements are being added

Ford Part 563 EDR Subfamilies

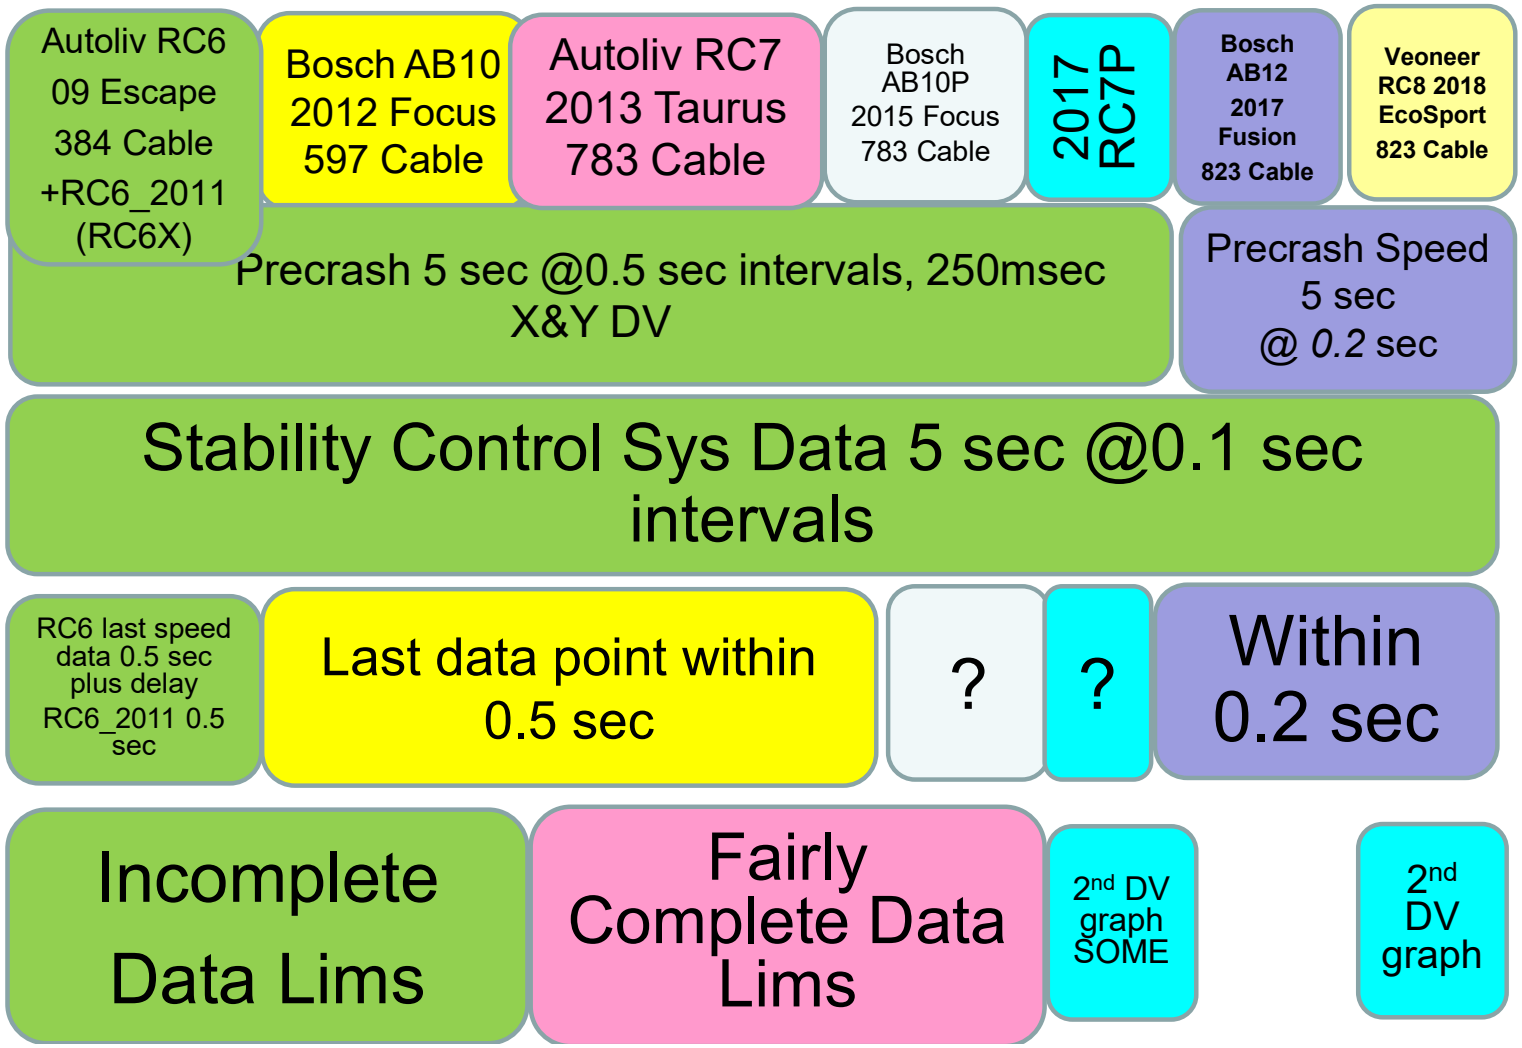

2024 F150 not supported YET


- 2024 gives error that the part number is not supported (24.1 and 24.2)
- Bosch CDR help line is aware of the issue since May 2024
- Ford has been asked to resolve, no information available as to when
- Reverting to older software will not fix this, Ford must give info to Bosch to fix it.

Stellantis (formerly FCA)

Includes Chrysler, Jeep, Dodge, Ram, Fiat, Lancia, Renault, Citroen and Peugot Data Analysis





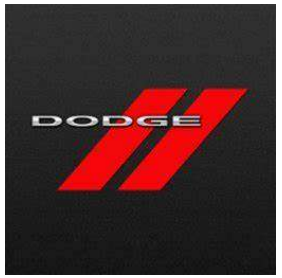















New Jeep Driver Camera Module

- Monitors driver during hands free active driving assist
- Records if there is airbag deployment or other triggers
- First known instance of a manufacturer making rear (inward) facing camera taking pictures of driver available.
- So new we don’t have many details (yet).

Cable ID# 851 Driver Camera Module
The Driver Monitoring System Module (DMSM) which is part of the Hands-Free Active Driving Assist records driver camera images within the ECU (upon certain triggers such as airbag deployment). The DMSM module records 3 events and can store 5 images for each event. The CDR tool retrieves the recorded image data and stores the data in the CDR file. To export the image data from the CDR file for viewing, select "File>Save Image Data" from the file menu of the CDR application. The Image files are exported and saved in the Crash Data Retrieval folder located in My Documents folder.

Recorded Data
The data recorded includes only retrieved images

Image Data

The data includes recorded images from each event which can be exported by the CDR tool directly into the default data file folder named *Crash Data Retrieval* along with the CDR file. The Images are exported by the CDR tool to their native file format Y = luminance(brightness), U and V means = chrominance (color) with a YUV file extension. During the exporting of the images, the images are named with the user entered VIN, ECU suffix, the record number and the date and time stamp the image was recorded in the ECU.
•<User Entered VIN>_DCM_RecordXImageY_DD-MM-YYY_HH-MM-SS.YUV
The YUV images can be viewed by any off-the-shelf software program that supports the YUV file format such as IrfranView (https://www.irfanview.com/).

See Exporting Images section of the help file for exporting and viewing images

New Chrysler/Jeep Issues

- Some newer Chrysler/Dodge/Jeep vehicles will not read through the DLC due to gateway issues. You must read them DTM. The help file will advise you of this.

1, 10	2023 Jeep	Grand Cherokee (includes L & PHEV)	ACM	Data	CDR 900	OBD/DLC Downloads are not supported	Cable F00K108785 CDR 900 - click here (use listed cable above and no ACM adapter)	Forward of center console
			DCM	Data How to image	CDR 900	OBD/DLC Downloads are not supported	Cable ID 851 CDR 900 - click here (use listed cable above and no ACM adapter)	behind the center of the dash and mounted to the HVAC housing

Kia/Hyundai/Genesis

- Tool provider GIT is now selling new “2.0” ADL interface that is faster, works on either brand. Includes the CFCI adapter function. “Advanced Data Logger”
- Separate Kia and Hyundai/Genesis Software subscriptions
- New single black ADL icon replaces old Red and Blue E’s.
- Software currently for EDR only, ADAS data to come soon



GIT: Hyundai EDR 2.0 Tool Hardware K

$6,450.00

Sold Out

Shop Now

New Mercedes EQS ADS module (Automated Driver System)

2024	2014	2015	2016	2017	2018	2019	2020	2021	2022	2023	2024

Mkt	Year/Make	Model	Module	New CDR2		Vehicle Interface	OBD/DLC Connect Adapter/Cable	D2M Connect Adapter/Cable	Module Location
2 California and Nevada	2023 Mercedes-Benz	EQS (sedan)	ADS *(vehicles equipped with DrivePilot)*	CDR 2	Data	CDR 900	OBD Only CDR 900 - click here	does not support direct to module downloads	N/A


- Self driving car only offered in California and Nevada so far
- New separate module from ACM
- Click on “data” tab in help file to see contents
- GPS position, Nearby object locations, turn signal switch status,

Rivian EDR

On the Rivian Website (thanks to Bob Anderson for posting)

- In the event of a collision, data may be recorded on the vehicle's Event Data Recorder, which is a sort of "black box" that is physically located on the vehicle. Rivian does not access this data without explicit customer consent. To access your own EDR data following a collision, please reach out to Rivian Service and request a mobile service visit for this purpose.
- Due to our vehicles' weight classification (>8500 GVW Rivian is exempt from the Part 563 EDR regulation requirements) and we do not provide a commercially available tool for retrieving or interpreting EDR data.
- Members of law enforcement should see our guidance on Law Enforcement Data Requests.
- Legal representatives should see our guidance on Civil Service of Process and Third-Party Data Requests.
- Furthermore, according to an Autoevolution article: (Rivian EVs Come With a 'Black Box,' Here's How You Can Access Its Data - autoevolution) there can be video from Rivian's cameras.

Beware side impacts to front & rear of vehicle when ACM is Not at CG -Example

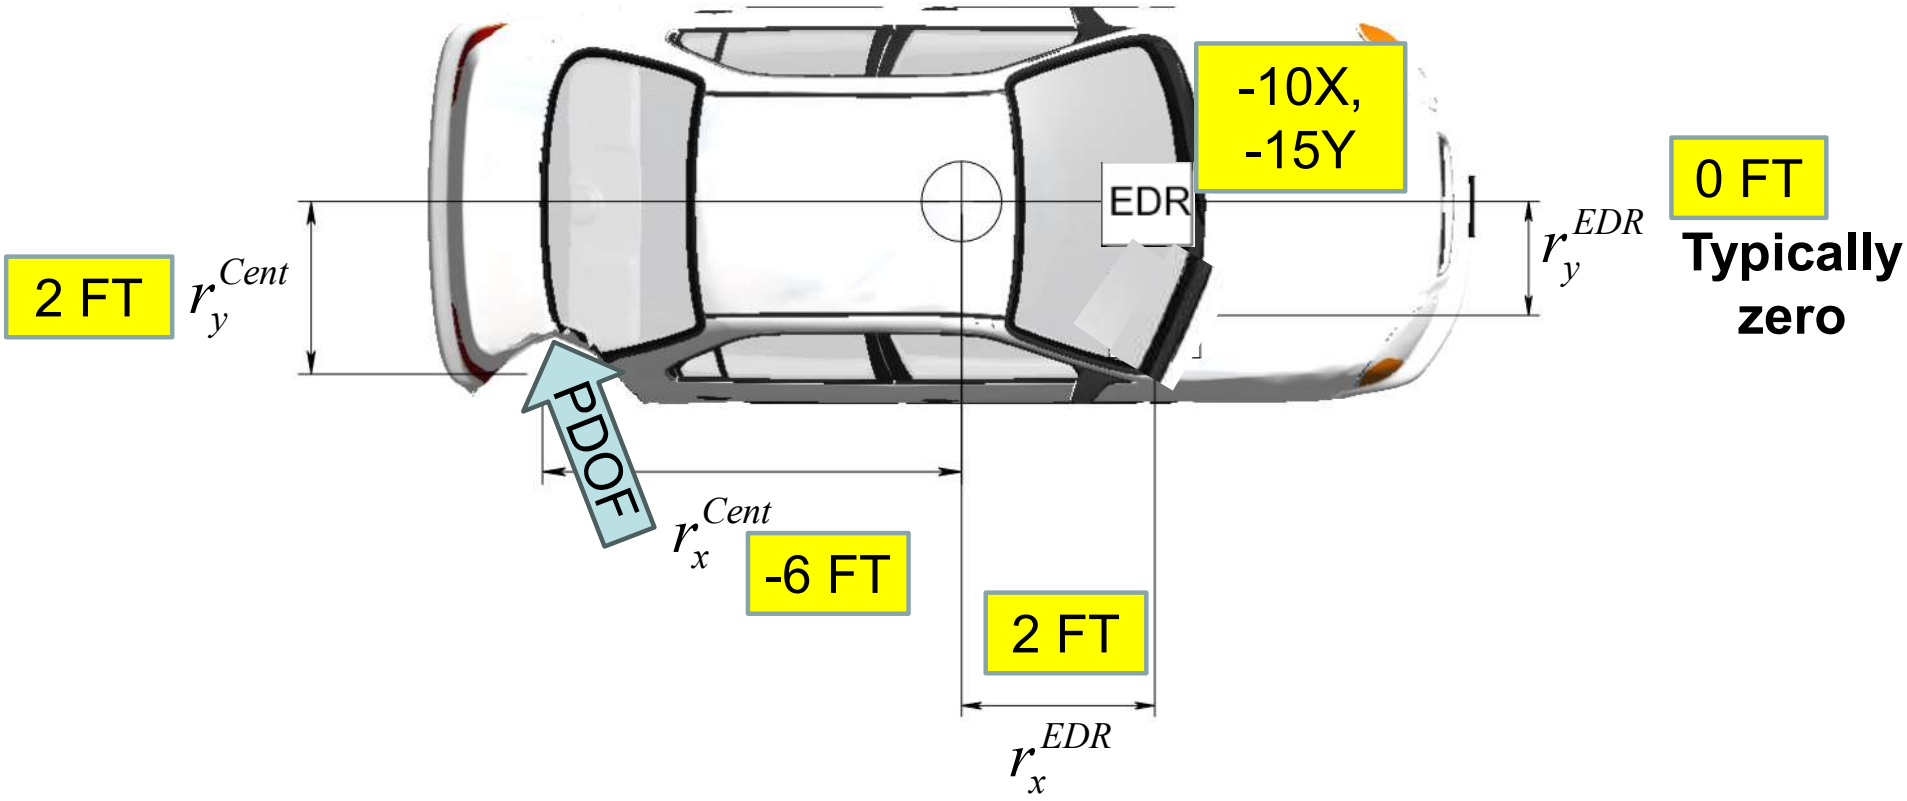

Correction for EDR Delta V to CG

Pass rear side impact example

-15 mph | 21.4 | -10 mph | 2 FT | +2 FT

$$\Delta v_y^{CG} = \frac{\Delta v_y^{EDR} \cdot k^2 + \Delta v_x^{EDR} \cdot r_y^{cent} \cdot r_x^{EDR}}{k^2 + r_x^{cent} \cdot r_x^{EDR}}$$

21.4 | -6 FT | +2 FT

-321-40 = **-38.4 mph**
21.4-12 (-61.8kph)

- unknown • Δv_y^{CG} is the lateral delta-V at the CG
- -15 mph • Δv_y^{EDR} is the lateral delta-V reported by the EDR
- 21.4 • k^2 is the radius of gyration squared
- -10 mph • Δv_x^{EDR} is the longitudinal delta-V reported by the EDR
- 2 FT • r_y^{cent} is the lateral displacement of the damage centroid from the CG (Polarity positive if pass side)
- 2 FT • r_x^{EDR} is the longitudinal displacement of the EDR from the CG (RHR) (typically 0 to +2 feet)
- -6 FT • r_x^{cent} is the longitudinal displacement of the damage centroid from the CG (Negative if centroid rear of CG, positive if fwd)

Wow! – Delta Vy was reported as -15 mph when it was -38 mph at CG!!!!
This was an extreme case – it is normally a much smaller correction

Appeal for Files

- Manufacturers keep coming out with new generations of EDR's
- The way I keep up is asking my network of former students and conference attendees to send me files from new vehicles
- PLEASE SEND Rick Ruth FILES FROM 2023/4/5 MY VEHICLES rick@ruthconsulting.com
- If you don't de-identify them, Rick will
- Helpful if I know which way they turned to check polarity of steering, yaw, lat accel


End March 2025 Update for Maryland QUESTIONS?????


Rick Ruth rick@ruthconsulting.com
313-910-5809

Info from 2023 & Earlier worth repeating follows but will not be presented live – only for reference

New Back Powering Gear Needed

1. Manufacturers (GM+) are replacing mini and micro fuses with Micro 2 and Micro 3 fuses to pack more fuses into smaller spaces. The complete back power kit must now have several different yellow clips to fit all the different vehicles on the road. GM started it, Ford followed, more to come. Mini fits into sub mini, don't need sub mini.

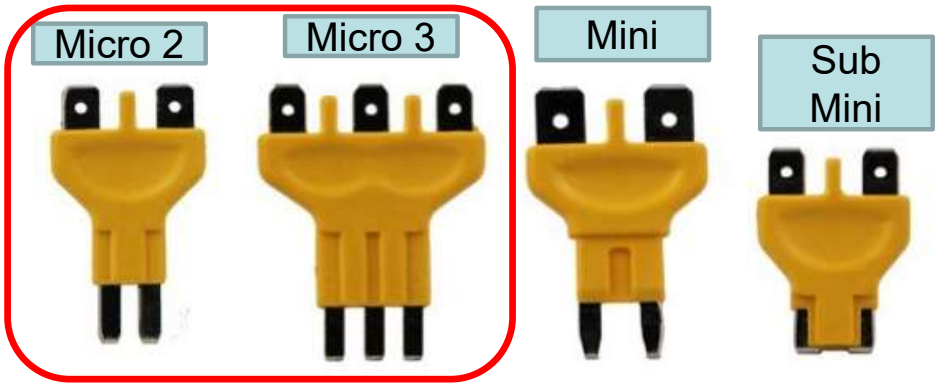

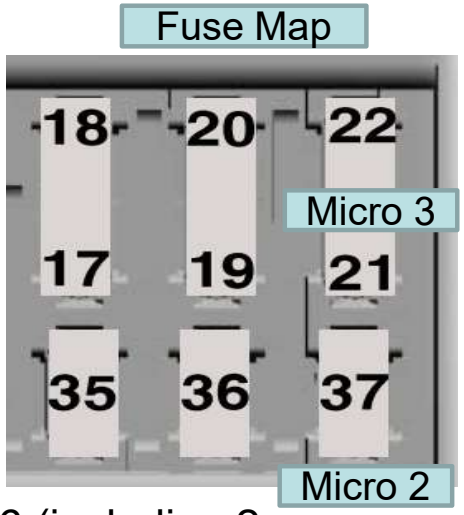

2. Buy General Technologies Corp GTC063 set of 6 (including 2 bigger ones you don't really need) at the site below for $19.95

https://www.amazon.com/General-Technologies-Corp-GTC063-Connector/dp/B0787JKMTH?ref_=bl_dp_s_web_9003703011

EMERGING TRENDS

1. Worry re: cyber security, (hackers trying to take over vehicle control systems).
2. Many are installing “gate-way” modules or features to protect ECU’s from hacking.
3. Back power ACM fuse AND cyber security (gateway) module fuse. DTM still an alt.
4. Recently needed on 2017 RAM 3500, 2018 Toyota, all VW, 2020 Ford Explorer, GM SDM-50
5. Ford “extended power” fuse or “Battery Electronic Control Module” for ACM & “smart data link” gateway– no RCM or SRS

CDR/EDR Training

1. Bosch Training Provider Page lists IPTM (Rick Ruth+), Crash Data Specialists (Brad Muir+), CSI (Rusty Haight), Crash Data Group, Northwestern (was CSI, now + Muir/Russel) + Kent Boots

   SAE (Rick/Lisa) not listed, teaches analysis only.

2. There is no "certification" – your qualifications depend on your training and experience

3. IPTM ONLINE technician training $595 has just been updated May 1 with Kent Boots as instructor

4. IPTM Analyst Level 1 Live training $895

5. IPTM ONLINE Analyst Level 1 training $995.

Additional EDR training available

6. IPTM has a "Level 2" analyst class which goes into greater depth on how to use the law of sines and cosines to solve Velocity Vector triangles, offset collisions w/EMR, ground forces & new data elements.
7. Advanced EDR Technician class by Kent Boots
8. SAE 24hr Analyst EDR live 2x/yr
9. Online DLC tech basic from Crash Data Group $200

Drag factor if Post-crash Rotation

- In intersection crashes, if the crash is an offset collision (vs a central collision) there is often rotation post impact. To get the appropriate drag factor you need a “spin” analysis that considers the non-ABS roadway drag factor, whether any tires are locked and what percent of the weight is on the locked tires, and the degrees of rotation.
- A template has been developed to assist in calculating the appropriate drag factor. Please see the “Drag Factor with Vehicle Rotation post impact” template.

Drag factor vs spin angle template

Drag Factor with vehicle rotation post impact Calculation Template								
Assumptions made by this template:								
1. The vehicle is on level ground (ADD OR SUBSTRACT SLOPE IF NOT)								
2. The vehicle is rotating at a constrant rate (i.e., no roll out and the end)								
3. The change in vehicle heading to the departure angle happens instantly and is not part of the spin								
4. The rotation angle at rest is measured from the departure angle, not the approach angle.								
Yellow= User Entries								
Blue=Calculations								
0.7	Non-ABS Roadway Drag Factor (locked tires)							
0.05	rolling resistance no locked tires, 05 2WD, .06 AWD							
0	number of front tires locked 0 to 2							
0	number of rear tires locked 0 to 2							
55	percent of weight on front tires typically 50-60 (use 55 if not sure)							
0.050	Equivalent drag factor with locked tires straight ahead							
0.650	difference between roadway drag factor and straight ahead affected by sine							
Degrees Rotated	**sin of angle**	**drag factor this interval**		**avg drag factor**				
0	**0.000**	**0.050**		**0.050**				
1	0.017	0.061		**0.056**				
2	0.035	0.073		**0.061**				
3	0.052	0.084		**0.067**				
4	0.070	0.095		**0.073**				
5	0.087	0.107		**0.078**				

ACM Not at CG

Thanks to Andy Rich for developing most of this section, and Bob Scurlock, Ph.D. for researching it





ACM Not at CG
Two possible conditions

Force applied closer to CG




EDR under-reports delta-V

Force applied closer to EDR



EDR over-reports delta-V

ACM Not at CG – Theory
Over/Under reporting is caused by rotation

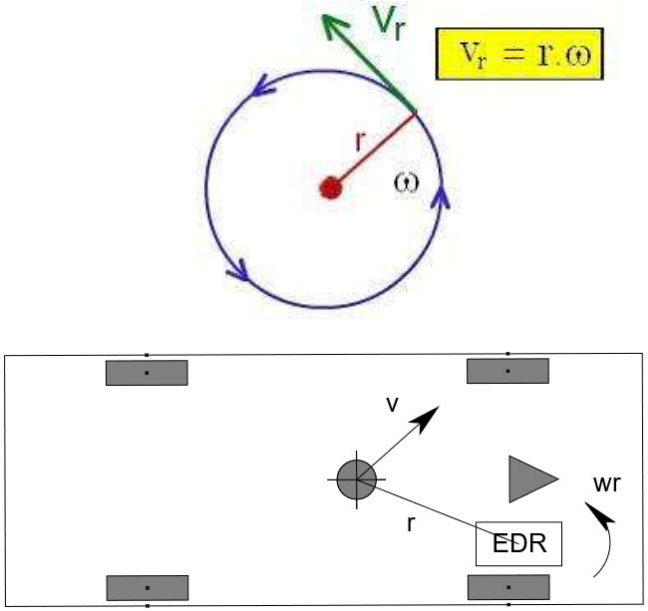

$$\Delta v^{EDR} = \Delta v^{CG} + \omega r$$

ACM Not at CG
Early Research

Nathan Rose et al. offering the following solution in Collision Magazine V13, I2

$$\Delta v_x^{CG} = \Delta v_x^{EDR} + r_y \Delta \omega_{yaw}$$
$$\Delta v_y^{CG} = \Delta v_y^{EDR} - r_x \Delta \omega_{yaw}$$

- r_x is the longitudinal distance from the EDR to CG
- r_y is the lateral distance from the EDR to the CG
- When EDR is on the centerline (CL) then $r_y = 0$ and $\Delta v_x^{CG} = \Delta v_x^{EDR}$
- But how to get $\Delta\omega$?
- Rose suggests simulation – not typically available to police
- Scurlock, Rich & Poe combine the above equations with conservation of angular momentum to give a mathematical approach.

$$I\Delta\omega = mh\Delta v$$

ACM Not at CG

- The following equation assumes that the EDR is mounted at the centerline (CL) of the car and that the CG is also at the CL.
- If the EDR is not at the CL see

Corrections to Off-Axis Δv Measurements from Event Data Recorders

Bob Scurlock, Ph.D., ACTAR, Andrew Rich, BSME, ACTAR, and Kyle Poe

- June 2021 Collision Magazine
- Available at https://arxiv.org/abs/2001.03165
- Heavy math needed to handle all EDR locations and CG's– will strain most brains – but in most typical cases it simplifies to.


$$\Delta v_y^{CG} = \frac{\Delta v_y^{EDR} \cdot k^2 + \Delta v_y^{EDR} \cdot r_y^{cent} \cdot r_x^{EDR}}{k^2 + r_x^{cent} \cdot r_x^{EDR}}$$

Correct ACM ΔVy to CG Formula & Definitions

$$\Delta v_y^{CG} = \frac{\Delta v_y^{EDR} \cdot k^2 + \Delta v_x^{EDR} \cdot r_y^{cent} \cdot r_x^{EDR}}{k^2 + r_x^{cent} \cdot r_x^{EDR}}$$


- Δv_y^{CG} is the lateral delta-V at the CG
- Δv_y^{EDR} is the lateral delta-V reported by the EDR
- k is the radius of gyration
- Δv_x^{EDR} is the longitudinal delta-V reported by the EDR
- r_y^{cent} is the lateral displacement of the damage centroid from the CG (positive pass side, neg driver side)
- r_x^{EDR} is the longitudinal displacement of the EDR from the CG (RHR) (typically 0 to +3 feet)
- r_x^{cent} is the longitudinal displacement of the damage centroid from the CG (negative if centroid rear of CG, positive if fwd)

ACM Not at CG
Definitions

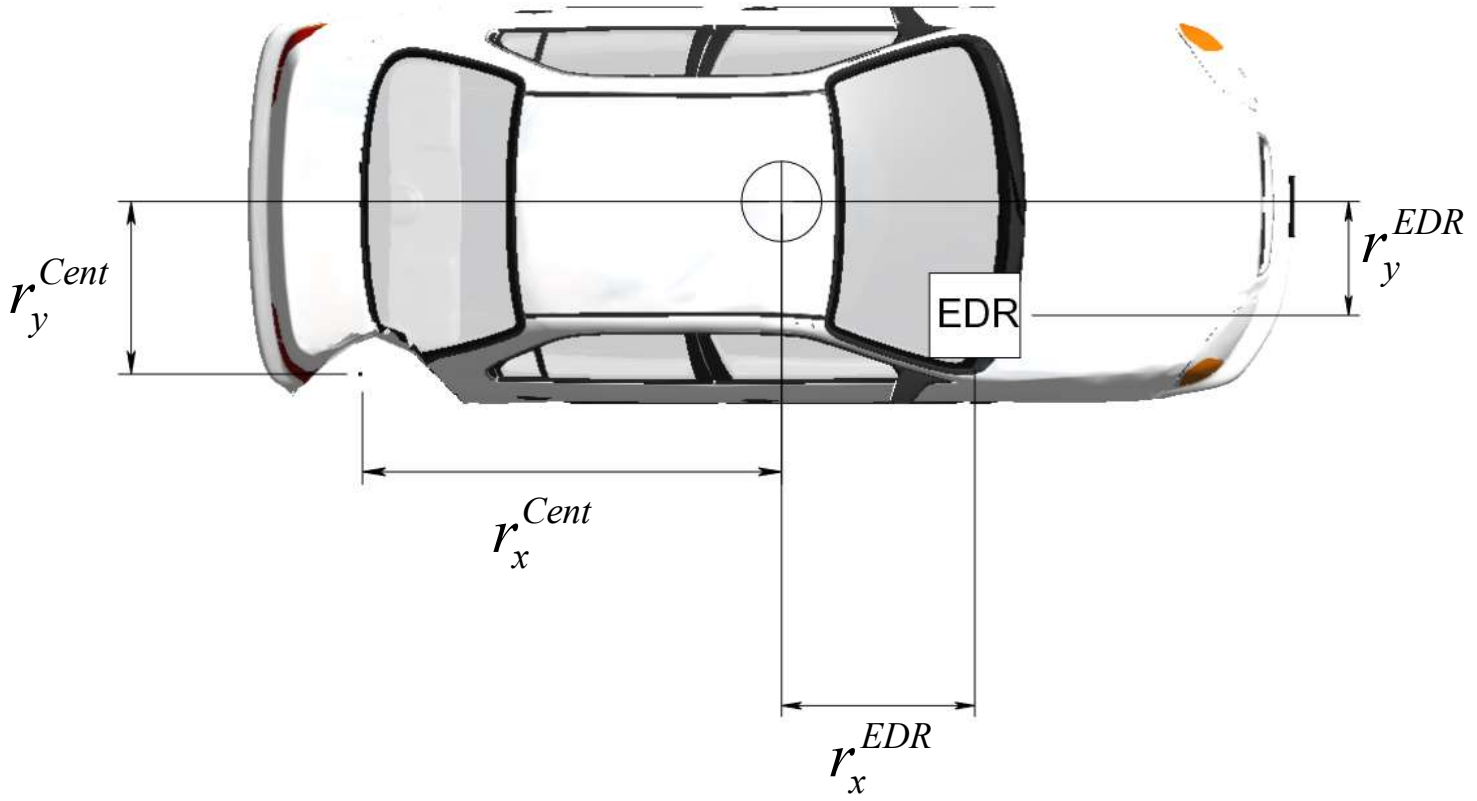

Typically zero

ACM Not at CG Sample Inputs

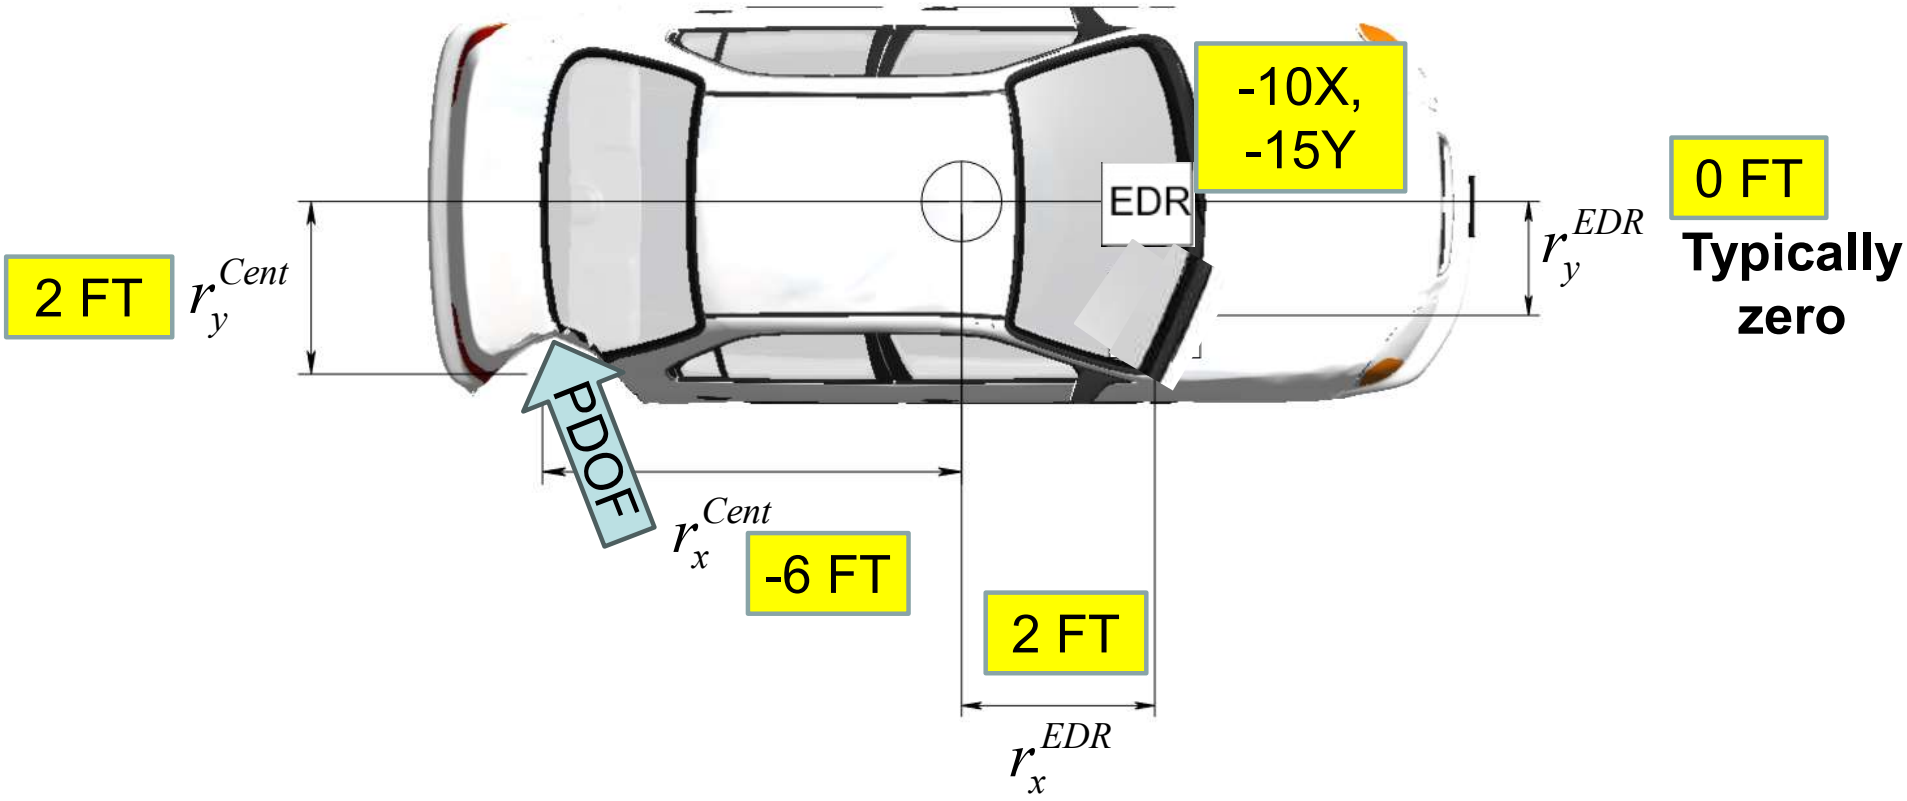

Correction for EDR Delta V to CG

Pass rear side impact example

-15 mph | 21.4 | -10 mph | 2 FT | +2 FT


$$\Delta v_y^{CG} = \frac{\Delta v_y^{EDR} \cdot k^2 + \Delta v_x^{EDR} \cdot r_y^{cent} \cdot r_x^{EDR}}{k^2 + r_x^{cent} \cdot r_x^{EDR}}$$

21.4 | -6 FT | +2 FT

-321-40 = -38.4 mph
21.4-12 (-61.8kph)

- unknown • Δv_y^{CG} is the lateral delta-V at the CG
- -15 mph • Δv_y^{EDR} is the lateral delta-V reported by the EDR
- 21.4 • k^2 is the radius of gyration squared
- -10 mph • Δv_x^{EDR} is the longitudinal delta-V reported by the EDR
- 2 FT • r_y^{cent} is the lateral displacement of the damage centroid from the CG (Polarity positive if pass side)
- 2 FT • r_x^{EDR} is the longitudinal displacement of the EDR from the CG (RHR) (typically 0 to +2 feet)
- -6 FT • r_x^{cent} is the longitudinal displacement of the damage centroid from the CG (Negative if centroid rear of CG, positive if fwd)

Beware the R_0 Line & the R_0 Point!

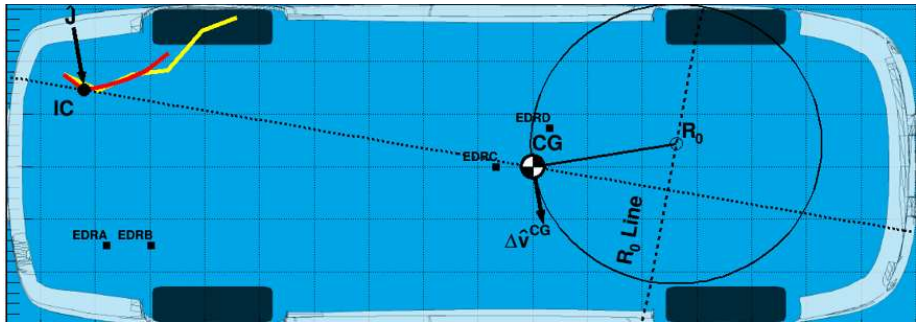

The R_0 line is a function of r_x^{EDR}

$$r_y^{EDR} = -\frac{k^2}{r_y^{cent}} - \left(\frac{r_x^{cent}}{r_y^{cent}}\right) r_x^{EDR}$$

- There is an imaginary line (the R_0 line, or pivot point) where $\Delta v_y^{EDR} = 0mph$ so we cannot solve for a unique Δv^{cg}.
- When an accelerometer (EDR) is close to the R_0 line, your analysis may be very sensitive to uncertainties in accelerometer location.
- You should do a sensitivity analysis considering actual accelerometer position in EDR may be +/-3" of the module center you measured. If results diverge excessively, use caution.

Analysis Update: Delta V Data

1. **Ground Forces were typically ignored in reconstruction**
2. **In small ΔV's (ped/mc) ground forces become significant**
3. **If car locks up brakes before hitting ped, Long. ΔV of ped hit is overstated**
4. **If MC t-bones car, Lat ΔV understated**
5. **ΔV is multiplied by big weight ratio, Closing speed error gets bigger**


Pre SDM50: GM Gen 3.5 & 4 Features

1. 2010 454 cable SDM's do not require replacement after a D (until 3 D's).
2. Events & deployments all numbered vs. labeled D/ND.
3. Events may **not** be in order algorithms started, they are in order they **qualified** for recording (see graphic next page)
4. **Align precrash data for all events to see relationship**
5. Black plastic SDM housings
6. Accelerometer max values listed in DL's

168

SDM 10-40 Concurrent Event Flag


-A Concurrent Event is when two events are happening nearly simultaneously. The "Concurrent Event Flag Set" parameter will indicate "Yes" if one event begins, but before that event is qualified, another event begins and is qualified.
A Non-Deployment event typically becomes qualified if that event exceeds the 5 MPH (8 km/h) delta V recording threshold and the event has concluded. A deployment event (FSR or Rollover) becomes qualified when a deployment has been commanded for that event.
Example of a Concurrent Event:
A Rollover event begins. Before the Rollover event is qualified, a Non-Deployment event begins and is qualified. Sometime after the Non-Deployment event is qualified, the Rollover event is qualified. The Non-Deployment event will be recorded in the first open record even though the Rollover event enabled before the Non-Deployment event. The Rollover event will be recorded in the next open record. The "Concurrent Event Flag Set" parameter will indicate "Yes" for the Rollover event. The "Time Between Events" parameter will indicate the time from the start of the Rollover event to the start of the Non-Deployment event.

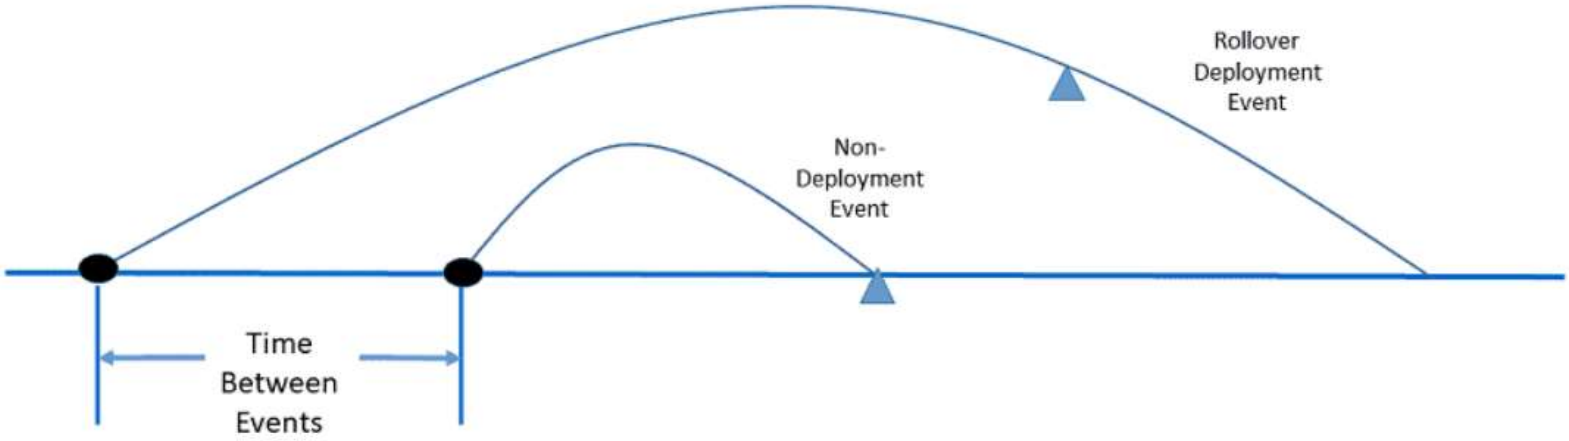

Event Recor #1	Event Record #2
Event Record Type = Non – Deployment	Event Record Type = Rollover
Concurrent Event Flag = No	Concurrent Event Flag = Yes
Time Between Events = NA	Time Between Events = XX seconds

When Concurrent Event Flag is Yes, Overlay Precrash Data from all events

- The event number gives when the event QUALIFIED for recording, not when I started
- Time between events is time between consecutive wake-ups, NOT always time between qualifying events
- Recap Delta V or, if rollover, event type over precrash data to assist understanding

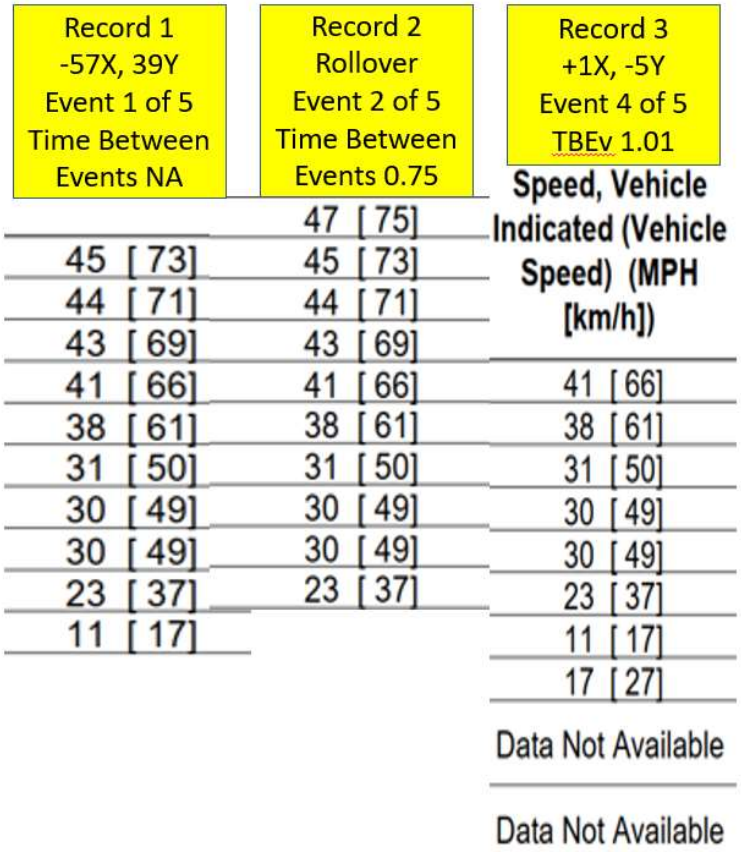


Noteworthy GM news

1. Conti SDM-30 data incomplete file not accurately interpreted by CDR – not fixable. Must send to Conti for readout and interp. (data lims detail how)
2. GM note 6 (no key needed) vehicles initially had 2 fuses, SDM bat and SDM ignition. Newer GM vehicles may have only ONE SDM fuse, normally bat, but police packages may only power it with ignition. SDM 50 ***requires key to be on*** to read SDM.
3. Foreign coverage – China since 99 (but only Gov't/NPS can use CDR), Australia/Korea/Thailand since 07
4. South America not covered or spoofable

Data from L/R bumper pressure sensors on 15 & 17 PPM EDR

NOT USED FOR ANLYSIS

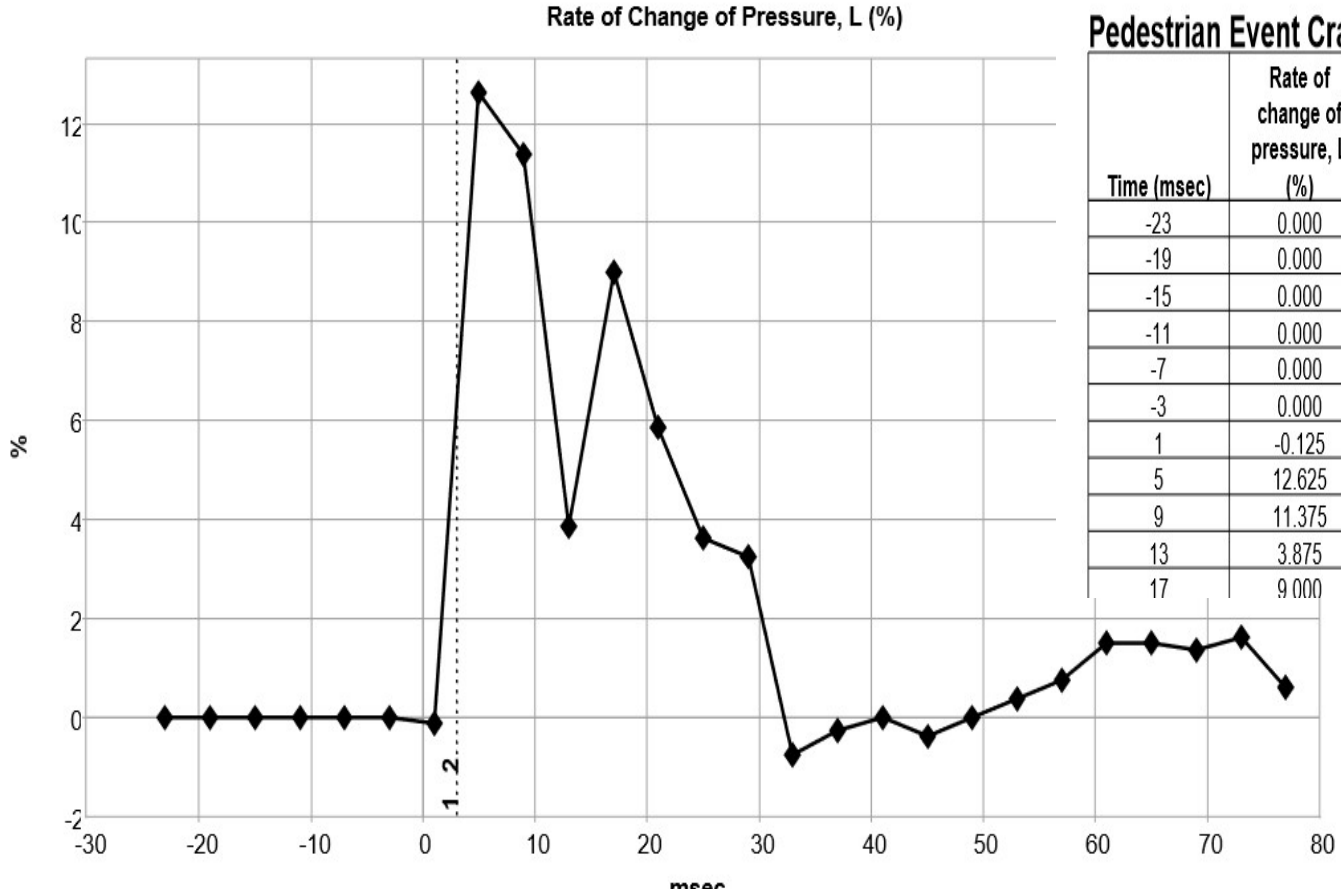

Pedestrian Event Crash Pulse (1st Prior Event, TRG 1)

Time (msec)	Rate of change of pressure, L (%)	Rate of change of pressure, R (%)	Calculated Value of Vehicle Speed (MPH [km/h])
-23	0.000	0.000	27.3 [44]
-19	0.000	0.000	27.3 [44]
-15	0.000	0.000	27.3 [44]
-11	0.000	0.000	27.3 [44]
-7	0.000	0.000	27.3 [44]
-3	0.000	0.000	27.3 [44]
1	-0.125	9.750	27.3 [44]
5	12.625	23.000	27.3 [44]
9	11.375	21.375	27.3 [44]
13	3.875	12.250	27.3 [44]
17	9.000	-1.500	27.3 [44]

Toyota “13 EDR” & “15 EDR”

1. **13 EDR** Adds Lateral ***Accel*** data from ACM in frontal events for 200ms (Fixes biggest drawback of **12 EDR**)


Longitudinal/Lateral Crash Pulse (Most Recent Event,

Time (msec)	Longitudinal Delta-V (MPH [km/h])	Lateral Acceleration for Frontal/Rear Crash, Floor Sensor (m/sec^2)	F
0	0.0 [0.0]	0.0	
10	0.3 [0.6]	-1.9	
20	0.5 [0.8]	0.0	

2. ***Calculate*** Lat **Delta V** for each 10ms interval
3. DV_{10ms} = ***Accel***/9.81*(32.2/1.466)*0.01s
4. Add up intervals to get ***total*** **Delta V**
5. **Template available to calculate it**

Identifying Ford EDR families

1. At the end of the data limitations section, just below the last paragraph, on the left, Bosch puts what version of data limitations is being printed. For Ford, most data limitations are by family.
2. No difference between DL
   a) 2009 RC6 and
   b) 2011 RC6X.
3. Open cdrx **copy** in notepad, see RC6_2011

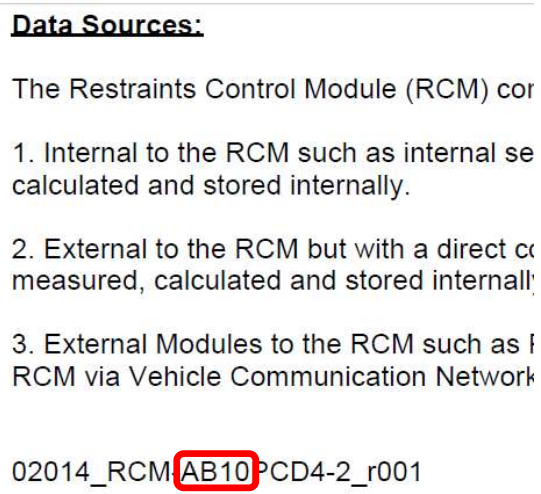
Data Sources:

The Restraints Control Module (RCM) cor

1. Internal to the RCM such as internal se
calculated and stored internally.

2. External to the RCM but with a direct c
measured, calculated and stored internall

3. External Modules to the RCM such as
RCM via Vehicle Communication Networ

02014_RCM_AB10_PCD4-2_r001

RC8 Precrash Data Look

Pre-Crash Data -5 to 0 sec [5 samples/sec] (First Record)

Time (sec)	Speed, Vehicle Indicated (MPH [km/h])	Speed, Vehicle Indicated, Quality Factor	Accelerator Pedal, % Full	Accelerator Pedal, % Full, Quality Factor	Service Brake, On/Off	Service brake, on/off Quality Factor	Engine RPM
- 5.0	59.8 [96]	OK	18	OK	OFF(Driver_Not_Braking)	OK	2,174

Pre-Crash Data -5 to 0 sec [10 samples/sec] (First Record) - Table 1 of 2

Time (sec)	ABS Activity (Engaged, Non-Engaged)	Stability Control Active	Traction Control via Engine	Traction Control via Brakes	Stability Control Lateral Acceleration (g)	Stability Control Longitudinal Acceleration (g)
- 5.0	Off/non-engaged	Off/non-engaged (No)	Off/non-engaged (Inactive)	Off/non-engaged (Inactive)	-0.01	0.02

Pre-Crash Data -5 to 0 sec [10 samples/sec] (First Record) - Table 2 of 2

Time (sec)	Stability Control Yaw Rate (deg/sec)	Stability Control Roll Rate (deg/sec)	Steering Wheel Angle (Pinion) (deg)	Steering Wheel Angle (Pinion) Quality Factor
- 5.0	0.06	-1.53	0.0	OK
- 4.9	-0.13	-1.18	0.0	OK

Other RC8 features

- Acceleration data added
- Second Delta V graph centered around deployment +/- 125ms (also in SOME RC7P)
- Unique decoder for occupant size (see next slide)

Pre-Crash Data -5 to 0 sec [1 sample/sec] (First Record)

Time (sec)	Occupant Size Classification, Front Passenger (Child size Yes/No [Hex value])	Extended Power Status
- 5.0	No [$03]	No Fault
- 4.0	No [$03]	No Fault

Ford Occupant Size Classification

Pre-Crash Data -1 sec (First Record)

Ignition cycle, crash	359
Frontal air bag warning lamp, on/off	OFF
Occupant size classification, front passenger (Child size Yes/No [Hex value])	No [$08]
Safety belt status, driver	Driver Buckled

- The Hex Value provides additional information than just child yes/no
- The Decoder is different for each supplier and major module type
- Look at end of data limitations for module type – Autoliv=RC5, RC6, RC7; Bosch=AB9, AB10

RC6/7	AB10	AB12	RC8	Classification
$01	$00	$00	$00	Empty
$02	$01	$05	$02	Child or Occupied Disable
$04	$05	$04	$01	Indeterminate (gray zone between child and adult)
$08	$02	$01	$03	Occupied Enable Small Adult (typical 110 lb 5th female)
$10	$03	$02	$04	Occupied Enable Medium (typical 172 lb 50th male)
$20	$04	$03	$05	Occupied Enable Large Adult (typical 223 lb 95th male)

RC8 Lower Recording Threshold?

- Data Limitations State 5mph DV over 150ms threshold for recording
- But events with less than 5mph are seen

If no devices are listed before ΔV then it is a non deployment

Deployment Data (First Record)

Maximum Delta-V, Longitudinal (MPH [km/h])	-2.02 [-3.25]
Time, Maximum Delta-V Longitudinal (msec)	300.0

- Remember, nothing deployed unless a device is listed with a deploy time
- This is a non-deployment

Unusual Ford Event Names

- Fuel Cutoff Level 1 or 2 (RC7P, RC8, AB12) **(may not store precrash)**
- Unlocked Frontal, Side, or Rollover Event (RC7, RC8)
- Locked Frontal, Side, or Rollover Event (RC7, RC8)
- Frontal Accel, Side Accel or Rollover Threshold Exceeded (AB12) **(may not store precrash)**
- Shutdown Request Threshold Exceeded Level 1,2 (AB12)
- Event Record 1 or 2 (AB10P)

Multiple “events” (front, side, rollover) are really algorithms enabled – could be only one combined event in memory. Events recovered may say frontal but if algorithm activated twice there may be two events.

Some events like Fuel Cutoff 1 may NOT store data.

2017 MKZ AB12

Pre-Crash Data -5 to 0 sec [5 samples/sec] (First Record) - Table 1 of 2

Time (sec)	Speed, Vehicle Indicated (MPH [km/h])	Speed, Vehicle Indicated, Quality Factor	Accelerator Pedal, % Full	Accelerator Pedal, % Full, Quality Factor	Service Brake, On/Off	Service brake, on/off Quality Factor	Engine RPM	Cruise Control Driver Accelerator Pedal Override
- 5.0	99.2 [160]	OK	0	OK	Off	OK	2,816	Cruise_Reg_Not_Overridden
- 4.8	98.7 [159]	OK	0	OK	Off	OK	2,800	Cruise_Reg_Not_Overridden
- 4.6	98.3 [158]	OK	0	OK	Off	OK	2,786	Cruise_Reg_Not_Overridden
- 4.4	98.2 [158]		0	OK	On	OK	2,770	Cruise_Reg_Not_Overridden
- 4.2	.8 [157]	OK	0	OK	On	OK	2,758	Cruise_Reg_Not_Overridden

Every 0.2 Sec!

Pre-Crash Data -5 to 0 sec [5 samples/sec] (First Record) - Table 2 of 2

Time (sec)	Brake Pre-Charge Request	Brake Assist Sensitivity Level	Brake Deceleration Request (m/s^2)	Large Driver Steering or Accel Pedal Input	Collision Mitigation System Fault	Collision Mitigation System Enabled
- 5.0	N/A	N/A	236	N/A	N/A	N/A
- 4.8	N/A	N/A	236	N/A	N/A	N/A

Collision Avoidance

2017 MKZ AB12 add'l data

Pre-Crash Data -5 to 0 sec [2 samples/sec] (First Record)

Time (sec)	Driver Gear Selection (Auto Trans)	Wheel Torque Requested (Nm)	Total Arbitrated Brake Torque (Nm)	Ignition Status	Speed Control Status
- 5.0	Drive	532	0	Run	Off
- 4.5	Drive	120	0	Run	Off
- 4.0	Drive	-20	0	Run	Off

Pre-Crash Data -5 to 0 sec [10 samples/sec] (First Record) - Table 1 of 2

Time (sec)	ABS Activity (Engaged, Non-Engaged)	Brake Powertrain Torque Request 1	Brake Powertrain Torque Request 2	Traction Control via Brakes	Stability Control Lateral Acceleration (g)	Stability Control Longitudinal Acceleration (g)
- 5.0	Non-engaged	No	Inactive	No	-0.02	0.09

Pre-Crash Data -5 to 0 sec [10 samples/sec] (First Record) - Table 2 of 2

Had this before

Time (sec)	Stability Control Yaw Rate (deg/sec)	Stability Control Roll Rate (deg/sec)	Steering Wheel Angle (deg)	Steering Wheel Angle Quality Factor
- 5.0	0.06	0.24	-0.9	OK
- 4.9	-0.08	0.00	-0.6	OK
- 4.8	0.45	0.86	0.0	OK

Ford AB12 Anomaly

- File found with “Event Record 2” with no “Event Record 1”. Reported to Bosch.
- Polarity in AB12 is correct. Ford Steering, Yaw, and Lat Accel 2009+ should all be the same sign – and opposite the right hand rule - negative CW right turn, Positive for CCW left turn.

- Steering Wheel Angle if Applicable: positive value indicates left turn, and negative value would indicate right turn.


- Stability Control Lateral Acceleration if Applicable: Lateral Acceleration (Y-direction) is the acceleration along the lateral axis of the vehicle, reported as positive when accelerating to the left.

- Stability Control Longitudinal Acceleration if Applicable: Longitudinal Acceleration (X-direction) is the acceleration along the longitudinal axis of the vehicle, reported as positive when accelerating in a forward direction.

- Stability Control YawRate if Applicable: The YawAxis is the vertical axis of the vehicle, generally perpendicular to the plane of the road. A positive YawRate is counter-clockwise when observing the vehicle from above.

New RC7P Feature- 2017 F250

- Ford has added a second graph to capture the deployment decision +/-125ms. This is important in hit-curb-then-hit-tree cases where the deployment was previously off the end of the mandated 250ms after wakeup graph

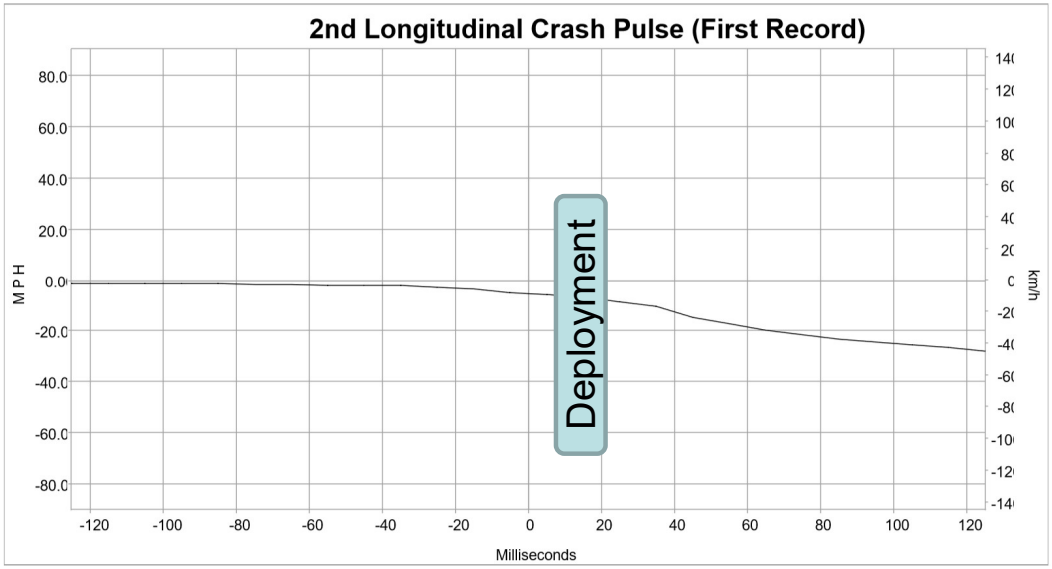

Ford Global Real Timer

Added for AB12/ RC7P/RC8

Timer starts when car is built, is hooked to battery, runs continuously

Month of build is on door jamb sticker (exact day/time is not)

Can be used to tie your recording to your crash

Great for knowing a more precise time between events when not within 5 seconds

Pre-Crash Data -1 sec (First Record)

Ignition cycle, Crash	1,782
Frontal Air Bag Warning Lamp, On/Off	Off
Safety Belt Status, Driver	Belted
Seat Track Position Switch, Foremost, Status, Driver	Rearward
Seat Track Position Switch, Foremost, Status, Front Passenger	Rearward
Safety Belt Status, Front Passenger	Unbelted
Brake Telltale	Off
ABS Telltale	Off
ESC/TC Telltale	Off
ESC/TC Off Telltale	Default Mode
Powertrain Wrench Telltale	Off
Powertrain Malfunction Indicator Lamp (MIL) Telltale	Unchanged Off
Global Real Time (seconds)	47,951,087

Bosch AB10P Unique Info

1. Longitudinal Accel Stability Control Info is positive for slowing down, negative for speeding up – *opposite of what data limitations say*.
2. Lateral Accel data is positive right, negative left – different than the other Ford modules.
3. Steering and Yaw remain positive left and are identified as such in data limitations.

RC6+ Steering Angle Glitch

1. Ford stores one value for steering relative to original zero position set at factory
2. If vehicle steering is serviced, original zero may be lost and system learns a new one from average of all new driving.
3. EDR may write down ORIGINAL position relative to zero – so a FEW models serviced may appear to have WRONG value for zero.
4. No warning in DL's about this yet

2020/21 F250+ no EDR events

- Ford accidentally turned off the EDR in 20/21 F Super Duty (F250, 350, 450, and 550) ACM's built from 2/18/2019 thru 7/10/2021
- 12/3/2021 Ford issued a Customer Satisfaction Program 21P19 advising of this. Vehicle brought to dealers for other service will reflash the ACM to turn the EDR back on.
- You can ask dealer to run VIN and tell you if 21P19 has been performed before you go to download it so ask not to waste your time.

Reading Police Explorers

- Some upfitters rewire the DLC and steal the low/medium speed CAN bus pins that connect to ACM for other police circuitry.
- “Original” DLC plug may be shoved up under dash
- If ACM will not communicate via upfitted DLC plug, look for the original DLC plug under dash and use that with 784 adapter.

Back powering New Fords

1. Airbag system will stays on until car slows to a near stop. Switched battery feed replaces ignition switch feed.
2. Airbag fuse (interior fuse box) Micro 3

19	7.5A [7]	Extended power module.

3. 2020 Explorer moves to engine compt

146	15A	Battery electronic control module. ACM Power

4. ALSO REQUIRES GATEWAY (INTERIOR FUSE BOX)

13	7.5A	Steering column control module. Smart datalink connector. GATEWAY Instrument cluster.
7	10A	Smart data link connector power. DLC

For Ford EDR **not supported** by Bosch CDR
See “Unsupported Fords” on ruthconsulting.com

Most requests can go directly to Ford’s suppliers. A few must go through Ford legal:

Email to EDRFORD@FORD.COM

(this is an address for a Bowman and Brooke outside counsel that handles these requests for Ford)

Contact Rick Ruth for additional information prior to making request

As of this writing, Veoneer (former Autoliv) charges $2000 to all, Bosch and Conti are no charge to law enforcement but $1500 to private parties.

Veoneer and Conti now say they cannot download modules >15 years old


Available on ruthconsulting.com

Getting EDR Data from unsupported Fords

Richard R. Ruth, P.E.

(this copy has been updated 12 22 2022, after the original presentation at the Jan 2016 CDR Summit)


Stellantis 21.5 CDR Coverage 64%

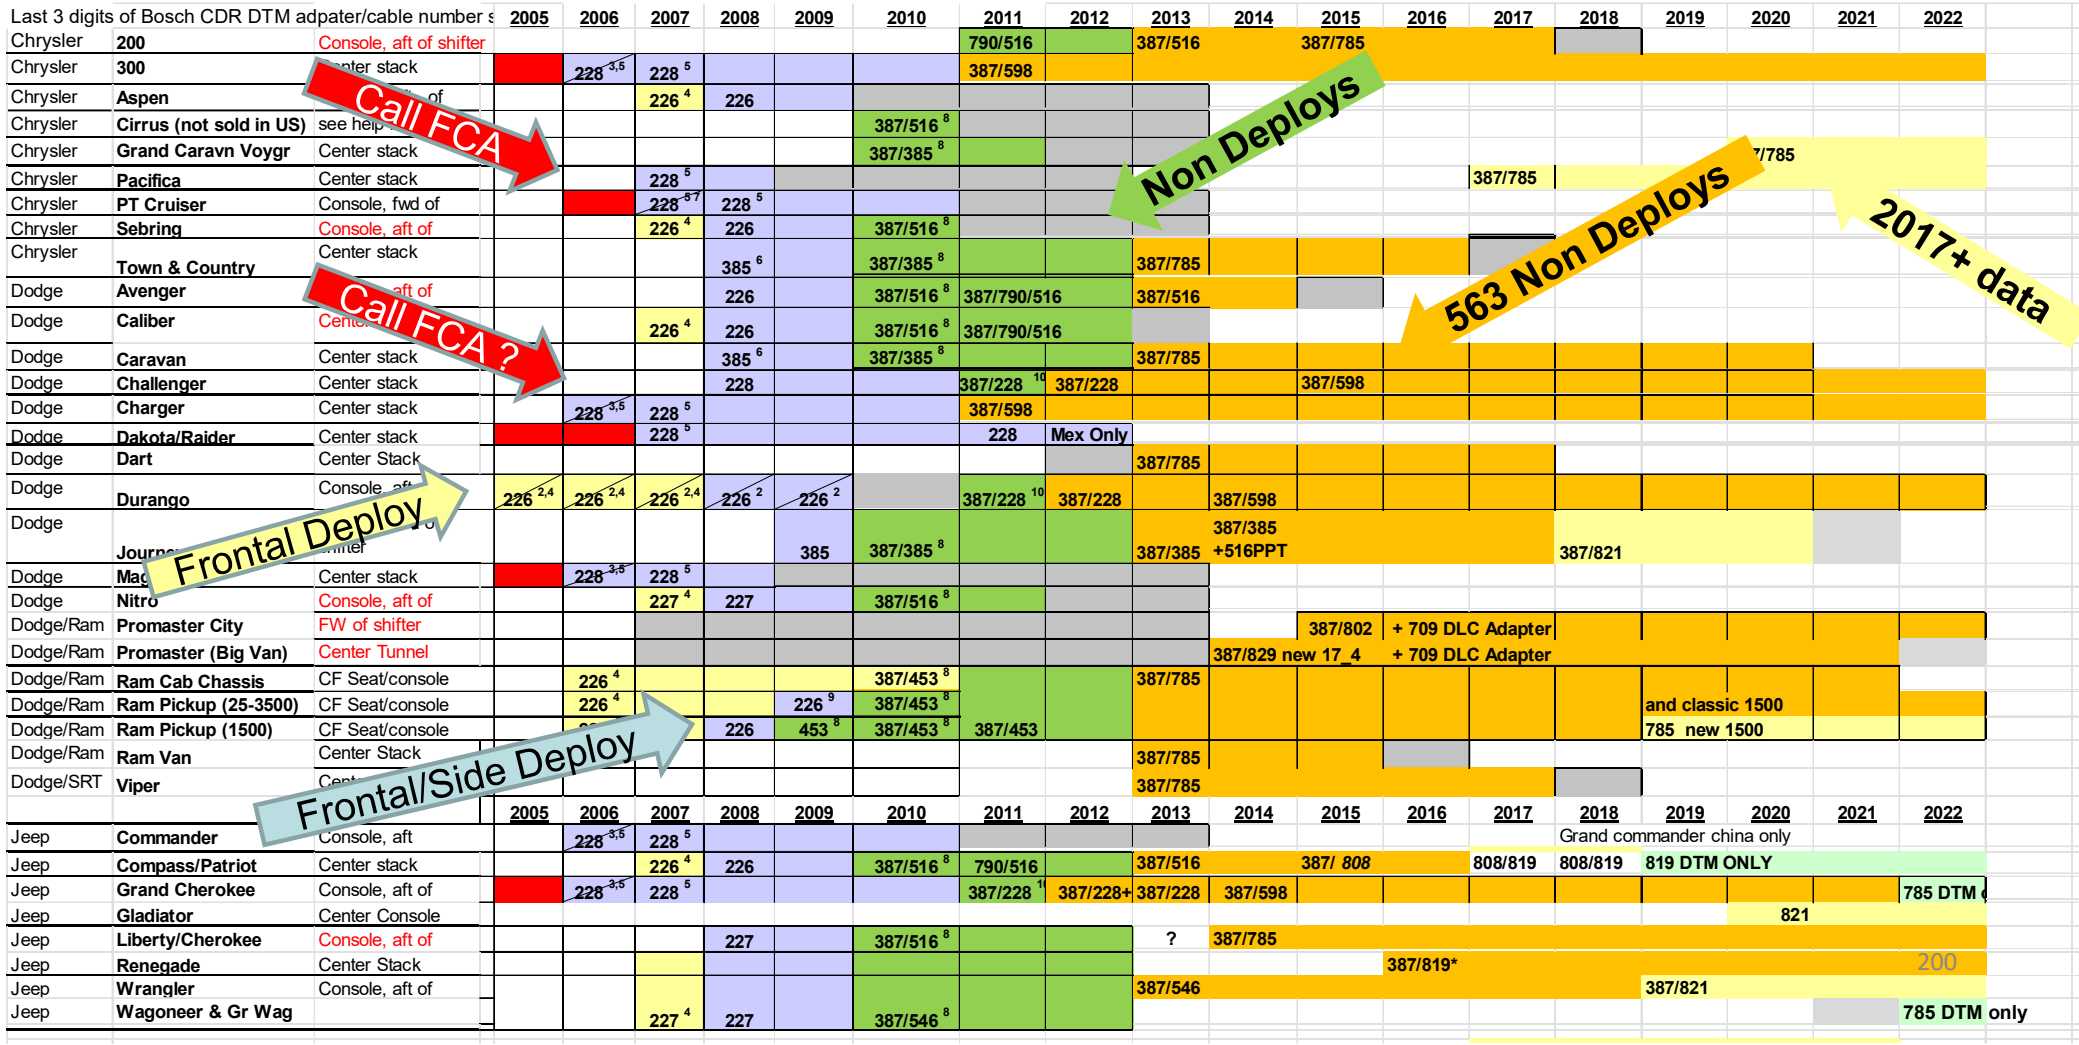

Last 3 digits of Bosch CDR DTM adpater/cable number s			2005	2006	2007	2008	2009	2010	2011	2012	2013	2014	2015	2016	2017	2018	2019	2020	2021	2022
Chrysler	200	Console, aft of shifter							790/516		387/516		387/785							
Chrysler	300	nter stack		228 3,5	228 5				387/598											
Chrysler	Aspen	of			226 4	226														
Chrysler	Cirrus (not sold in US)	see help						387/516 8												
Chrysler	Grand Caravn Voygr	Center stack						387/385 8												
Chrysler	Pacifica	Center stack			228 5										387/785					
Chrysler	PT Cruiser	Console, fwd of			228 5,7	228 5														
Chrysler	Sebring	Console, aft of			226 4	226		387/516 8												
Chrysler	Town & Country	Center stack				385 6		387/385 8			387/785									
Dodge	Avenger	aft of				226		387/516 8	387/790/516		387/516									
Dodge	Caliber	Cent			226 4	226		387/516 8	387/790/516											
Dodge	Caravan	Center stack				385 6		387/385 8			387/785									
Dodge	Challenger	Center stack				228			387/228 10	387/228			387/598							
Dodge	Charger	Center stack		228 3,5	228 5				387/598											
Dodge	Dakota/Raider	Center stack			228 5				228	Mex Only										
Dodge	Dart	Center Stack									387/785									
Dodge	Durango	Console, aft	226 2,4	226 2,4	226 2,4	226 2	226 2		387/228 10	387/228		387/598								
Dodge	Journ	hifter					385	387/385 8			387/385	387/385 +516PPT				387/821				
Dodge	Mag	Center stack		228 3,5	228 5															
Dodge	Nitro	Console, aft of			227 4	227		387/516 8												
Dodge/Ram	Promaster City	FW of shifter											387/802	+ 709 DLC Adapter						
Dodge/Ram	Promaster (Big Van)	Center Tunnel										387/829 new 17_4		+ 709 DLC Adapter						
Dodge/Ram	Ram Cab Chassis	CF Seat/console		226 4				387/453 8			387/785									
Dodge/Ram	Ram Pickup (25-3500)	CF Seat/console		226 4			226 9	387/453 8									and classic 1500			
Dodge/Ram	Ram Pickup (1500)	CF Seat/console				226	453 8	387/453 8	387/453								785 new 1500			
Dodge/Ram	Ram Van	Center Stack									387/785									
Dodge/SRT	Viper	Cent									387/785									

			2005	2006	2007	2008	2009	2010	2011	2012	2013	2014	2015	2016	2017	2018	2019	2020	2021	2022
Jeep	Commander	Console, aft		228 3,5	228 5											Grand commander china only				
Jeep	Compass/Patriot	Center stack			226 4	226		387/516 8	790/516		387/516		387/ *808*		808/819	808/819	819 DTM ONLY			
Jeep	Grand Cherokee	Console, aft of		228 3,5	228 5				387/228 1	387/228+	387/228	387/598								785 DTM
Jeep	Gladiator	Center Console																821		
Jeep	Liberty/Cherokee	Console, aft of				227		387/516 8			?	387/785								
Jeep	Renegade	Center Stack												387/819*						200
Jeep	Wrangler	Console, aft of									387/546						387/821			
Jeep	Wagoneer & Gr Wag				227 4	227		387/546 8												785 DTM only

FCA EDR Evolution (under dev't)

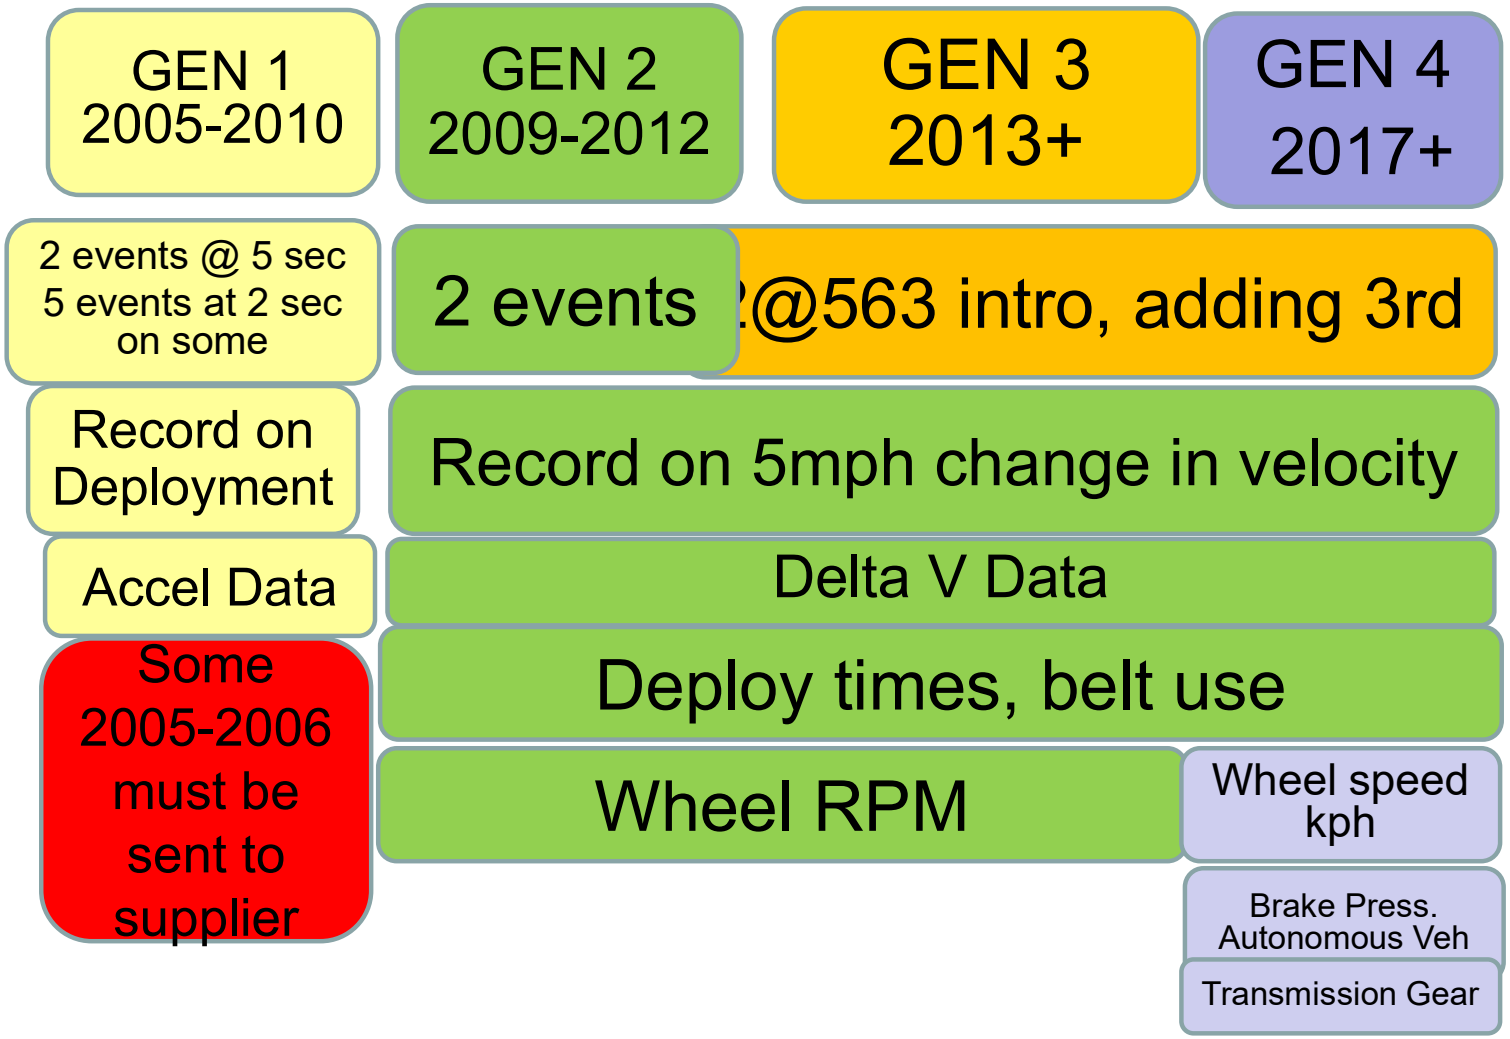

2018+ Output New Look –

Removed multiple brake elements, added ABS/SC, moved strg to P1, hi res
Two tables at 0.1 sec interval, others tables @ 0.25 sec intervals

Pre-Crash Data [10 samples/sec] (Most Recent Event - table 1 of 2)
(the most recent sampled values are recorded prior to the event)

Time Stamp (sec)	Pre-Crash Recorder Status	Speed, Vehicle Indicated (MPH [km/h])	Accelerator Pedal, % Full	Service Brake	Engine RPM	ABS Activity	Stability Control	Steering Input (deg)
-5.0	Complete	96 [155]	0.00	Off	3,878	No	On	1
-4.9	Complete	96 [154]	0.00	Off	3,835	No	On	-1
-4.8	Complete	96 [154]	0.00	Off	3,726	No	On	-5
-4.7	Complete	96 [154]	0.00	Off	3,621	No	On	-10
-4.6	Complete	96 [154]	0.00	Off	3,489	No	On	-18
-4.5	Complete	95 [154]	0.00	Off	3,344	No	On	-21
-4.4	Complete	95 [153]	0.00	Off	3,210	No	On	-20
-4.3	Complete	95 [153]	0.00	Off	3,109	No	On	-19
-4.2	Complete	95 [153]	0.00	Off	3,068	No	On	-19
-4.1	Complete	95 [152]	0.00	Off	3,108	No	On	-18
-4.0	Complete	95 [152]	0.00	Off	3,079	No	On	-18

Wheel RPM replaced by speed

See driven vs non driven, left vs right, ABS working…

Pre-Crash Data [10 samples/sec] (Most Recent Event - table 2 of 2)

(the most recent sampled values are recorded prior to the event)

Time Stamp (sec)	ABS MIL	Yaw Rate (deg/sec)	Wheel Speed LF (km/h)	Wheel Speed RF (km/h)	Wheel Speed LR (km/h)	Wheel Speed RR (km/h)
-5.0	Off	0.40	154.37	154.52	154.55	154.52
-4.9	Off	-0.48	154.28	154.16	154.25	154.25
-4.8	Off	-1.76	154.40	154.09	153.88	153.77
-4.7	Off	-2.80	154.28	153.95	153.88	153.67
-4.6	Off	-4.24	154.01	153.64	153.85	153.55
-4.5	Off	-6.80	153.98	153.16	153.80	153.19
-4.4	Off	-7.12	153.80	152.88	153.70	152.80
-4.3	Off	-5.84	153.49	152.67	153.37	152.62
-4.2	Off	-5.12	153.13	152.19	153.25	152.38
-4.1	Off	-4.64	152.80	152.04	152.91	151.91
-4.0	Off	-4.64	152.49	151.73	152.46	151.65
-3.9	Off	-4.00	152.13	151.55	152.13	151.31
-3.8	Off	-3.68	151.83	151.25	151.95	151.13

Current Gear & More @ 0.25 sec

Pre-Crash Data [4 samples/sec] (Most Recent Event - table 1 of 2)

(the most recent sampled values are recorded prior to the event)

NEW

Changes at END of shift

Time Stamp (sec)	Pre-Crash Recorder Status	Raw Manifold Pressure (kPa)	PCM MIL	ETC Lamp	Current Gear	Reverse Gear Status
-5.00	Complete	20.00	Off	Off	D5	Not_Reverse
-4.75	Complete	20.00	Off	Off	D5	Not_Reverse
-4.50	Complete	21.60	Off	Off	D5	Not_Reverse
-4.25	Complete	23.20	Off	Off	D5	Not_Reverse
-4.00	Complete	23.20	Off	Off	D6	Not_Reverse
-3.75	Complete	23.20	Off	Off	D6	Not_Reverse
-3.50	Complete	23.20	Off	Off	D6	Not_Reverse
-3.25	Complete	23.20	Off	Off	D6	Not_Reverse
-3.00	Complete	22.40	Off	Off	D6	Not_Reverse
-2.75	Complete	21.60	Off	Off	D6	Not_Reverse
-2.50	Complete	21.60	Off	Off	D7	Not_Reverse
-2.25	Complete	21.60	Off	Off	D7	Not_Reverse
-2.00	Complete	21.60	Off	Off	D7	Not_Reverse
-1.75	Complete	21.60	Off	Off	D7	Not_Reverse

‹ 10.63 in ‹

Tire pressure @ 0.25 sec intervals

Pre-Crash Data [4 samples/sec] (Most Recent Event - table 2 of 2)

(the most recent sampled values are recorded prior to the event)

NEW

Time Stamp (sec)	Tire Pressure Position	Tire Pressure Status	Tire Pressure Value (PSI)	Cruise Control Lamp Status	Cruise Control Engaged Status	ACC On/Off	ACC Set Speed (MPH [km/h])
-5.00	LHF	Normal	34	Off	Not_Engaged	Off	0 [0.0]
-4.75	RHR	Normal	32	Off	Not_Engaged	Off	0 [0.0]
-4.50	RHR	Normal	32	Off	Not_Engaged	Off	0 [0.0]
-4.25	RHR	Normal	32	Off	Not_Engaged	Off	0 [0.0]
-4.00	RHR	Normal	32	Off	Not_Engaged	Off	0 [0.0]
-3.75	LHR	Normal	33	Off	Not_Engaged	Off	0 [0.0]
-3.50	LHR	Normal	33	Off	Not_Engaged	Off	0 [0.0]
-3.25	LHR	Normal	33	Off	Not_Engaged	Off	0 [0.0]
-3.00	LHR	Normal	33	Off	Not_Engaged	Off	0 [0.0]
-2.75	RHF	Normal	33	Off	Not_Engaged	Off	0 [0.0]
-2.50	RHF	Normal	33	Off	Not_Engaged	Off	0 [0.0]

Other Chrysler Info

1. High G Frontal sensors not likely to clip.
2. “Sensor Design Range Exceeded” line on graph means clipping above that level
3. Buckle switch NOT normally used to determine if pre-tensioner fires (Exceptions on some non US built vehicles)
4. Fiat Spider = Mazda Miata, threshold <5mph
5. Master Cylinder Pressure on 2018 Charger!
6. 2019+ Compass and some later must be read DTM – security gateway issue – check help file?
7. Odometer in EDR may vary from display by <10km

Hyundai/Kia EDR Tools

- You may now purchase U.S. DLC only kits from Crash Data Group **$5150 per brand** including software 1st yr.
- 1ea of DTM cables 1-24 + CFCI adapter in a case $8500 from CDG
- Full Hyundai kit from GIT comes with 13 DTM cables thru #24, Kia with 15 DTM cables thru #23. 10 Cables are in both. New cables cost $300 each. Cables #25-30 not included in full kits as of last check.
- Hyundai full kit: Part G0Z**H**DMN001 last known price ***$6450,*** Kia full kit: Part GIT0Z**K**DMN001 ***$6950 + tax+ship***
- CAN-FD (Flexible Data Rate) DTM adapter needed for 2020 HV80 & other new models last known cost $1,400. Contacts: ~~Patrick Dadson~~ ~~pdadson@gitamerica.com~~ (888)549-4977
- Scott Baker **crash@crashdatagroup.com** (800) 280-7940

Additional Info

1. K/H Interface modules are identical, but you must buy both kits to get software for both. Software updates won't download unless the **correct brand interface module** is attached to your laptop and the ID & password keyed to that interface are used. US Kit update request must come from within US borders (VPN not honored).
2. More people are buying Kia/Hyundai kits now that we have 10+ model years on the road and you can buy DLC only kits.

Software updates

- Software updates **$825/yr/** brand from GIT Tool Company or Crash Data Group.
- GIT is making all update cycles to March 2026.
- Renew in Dec 2024 you may pay for 16 mos to get to March 2026.

New Hardware coming

- A new interface is being produced in 2025 which can use either brand of software. .
- But with the new hardware you only have to buy one interface to use both softwares
- You will still have to get BOTH software subscriptions to be able to update either software on your new hardware.

Officially Supported US 2013+ Models V65H/61K

Model	Model Years														
KIA	2010	2011	2012	2013*	2014	2015	2016	2017	2018	2019	2020	2021	2022	2023	2024
CADENZA (Azera sister)					19(VG)	19	19	13(YG)	13	13	13	13			
EV6													29+CFCI (CV)		
FORTE	10	10	10	10 (TD)	6 (YD)	6	6	12(YD,YDM)	12	21 or 28 (BDm)				21	
K5												26(D3LA)			
K900						11 (KH)	11	11	11	21 or 28 (RJ)					
NIRO (DE EV, DE HEV, DE PHEV)								21(DE)	21	21	21	21	21	30+CFCI (SG)	
OPTIMA	No	4	4	4 (TF/QF)	4	4	14 (JF,JFA)*	14	14	14	14				
OPTIMA HYBRID	No	4	4	4 (TF HEV)	4	4	4	23(JF HEV)	23	23	23				
RIO	No	No	8	8(UB)	8	8	8	8	21 (SC)	21	21	21	21	21	
RONDO (Canada only 2011 MY+)	No	No	9	(not officially supported since non-US, read as a Kia Rio)											
SEDONA	No	No	No	No	10(VQ)	12(YP)	12	12	12	12	12	12	29+CFCI (KA4)		
SELTOS												28(SP2)	28	28	
SORENTO	No	3	3	3(XM)	3,7(XM)	3,7	13 (UMA)	13	13	13	13	29+CFCI (MQ4)		29	
SOUL	1 see note 1	1 see note 1	1	1(AM)	12(PS)	12(PSEV)	12	12	12	12,26(SK3 EV	26 (SK3)	26	26	26	
SPORTAGE (SL)	No	Yes	2	2(SL)	2	2	2	13(QL)	13	13	13	13	30+CFCI (SG)		
STINGER (CK)									21 (CK)	21	21	21	21	21	
TELLURIDE (ON)											25(ON)	25	25	25	
HYUNDAI	2010	2011	2012	2013*	2014	2015	2016	2017	2018	2019	2020	2021	2022	2023	2024
ACCENT (RB)	No 10	No?	5 see note 2	5(RB)	5	5	5	5	21(HC)	21	21	21	21	21	
AZERA (HG)		likely	Yes	7(HG)	7	7	7	7							
ELANTRA Coupe(JK), Sedan(UD/MD	No	Yes	8	8(JK/UD/MD)	8	8	8	21(AD, ADA)	21	21	21	28 (CN7)			
ELANTRA GT (GD) (aka "i30")	old model		new model	6/12(GD)	6,12	6,12	6,12	6,12	21(PD)	21	21	21			
EQUUS (VI)(stretch genesis)	?	yes?	yes?	9,11(VI)	9,11(VI)	9,11(VI)	9,11(VI)								
GENESIS (Coupe BK, Sedan BH/DH)	9 shave keyway	9 shave keyway	?	9(BK, BH)	9	13(DH)	13		2018	2019	2020	2021	2022	2023	
GENESIS GV60													29+CFCI (JW1)		
GENESIS G70	YELLOW = COULD BE EITHER OF 2 CABLES, SEE WHICH FITS									21,25(IK)	21,25	21,25	21,25	21,25	
GENESIS GV70													29+CFCI (JK1)		
GENESIS G80								13(DH)	13	13	13	29+CFCI (RG3)			
GENESIS GV80											29+CFCI (JX1)				
GENESIS G90								13(HI)	13	13	13	13	13	30+CFCI (RS4)	
IONIQ EV and HEV								21(AE)	21	21	21	21	21		
IONIQ 5													29+CFCI (NE EV)		
KONA (i20, Rio sister)small SUV)									24 (OS)	24	24	24	24	24	
KONA EV										27 (OS EV)	27	27	27	27	
NEXO										26 (FE)	26	26	26	26	
PALISADE											25(LX2)	25	25	25	
SANTA CRUZ				2013*	2014	2015	2016	2017	2018	2019	2020		30+CFCI (NX4A OB)		
SANTE FE	9 shave keyway note 3	9 shave keyway	9 shave keyway	7(NC,DMA)	7	7	7	7	7	25 (TMA)	25	25	25	25	
SONATA		4	?	(YFA, YF HEV	4	14 (LF) 4 (HEV)	14 (LF HEV)	14	14	14	25(DN8A)	25	25	25	
TUCSON	Yes	Yes	2	2(LM)	2	2	13(TL)	13	13	13	13	13	30+CFCI		
VELOSTER coupe	out of productio		?	5(FS)	5	5	5	5	5	14 (JS)	14				
VELOSTER N										28(JSN)	25	25	25	25	
VENUE											30(QX)	30			
Gold = 2013 Part 563 Compliant		K/H Common Cables		2013*	2014	2015	2016	2017	2018	2019	2020	2021	2022	2023	2024

New Data -Smart Cruise Control info 21 Palisades

Pre-Crash Information 2 (-5 ~ 0 sec)

Time (sec)	Gear shift selector display	SCC information (Main switch status)	SCC information (Set Speed)	SCC information (SPEED UNIT)	SCC information (Mode status)	SCC information (Fail info)
-5.0	D	ON	85	MPH	Engaged	System without Error
-4.5	D	ON	85	MPH	Engaged	System without Error

Auto Braking info 21 Palisades

Pre-Crash Information 3 (-5 ~ 0 sec)

Forward Collision Alert

Time (sec)	FCA (Function status)	FCA (Warning Level)	FCA (Fail info)
-1.0	ON	No Warning / Invalid or Not supported	Normal
-0.9	ON	No Warning / Invalid or Not supported	Normal
-0.8	ON	Level 1	Normal
-0.7	ON	Level 2	Normal
-0.6	ON	Level 2	Normal

Audible

0.2g Autobrake

Level 3 =Max autobrake

Backpowering Kia/Hyundai Vehicles

- The K-H Interface normally gets its power thru the DLC plug. It does not have a separate power plug.
- Back powering required using a second fuse block adapter to power the DLC plug.
- Kent Boots has procured the mating connector to a diagnostic port on the interface that has power input pins.
- He sells a cable for $75 plus $10 shipping that mates the interface to Kia/Hyundai and Bosch 2.5mm round pin power supplies
- Email Kent kent@getedrdata.com

Pre-2013 Kia Hyundai may have data

Model	Vehicle Size, Descrip	Model Years 2010	2011	2012	2013*
KIA		Cable #	Cable #	Cable #	Cable #
CADENZA (VG, 2014) (Azera sister)	112.0" WB	YG requires cable 13 per software			
FORTE (TD 2013, YD 2014))	104.3"WB, compact	10	10	10	10 (TD)
K900 (KH 2015)	119.9"WB				
NIRO					
OPTIMA (2013 TF QF, 2016 JF, JFA)	110.0" WB sedan	No	4	4	4 (TF/QF)
OPTIMA HYBRID	110.0" WB sedan	No	4	4	(TF HEV)
RIO (UB)	94.5"WB, compact	No	No	8	8(UB)
RONDO (Canada only 2011 MY+)		No	out of production		
SEDONA (VQ '14, YP '15)	113.8/118.9" WB miniv	No	No	No	No
SORENTO (XM to 2015)(UMA 2016)	106.3" WB, crossover	No	3	3	3(XM)
SOUL (AM 2013, PS 2014+)	100.4" WB	1 see note 1	1 see note 1	1	1(AM)
SPORTAGE (SL)	103.9" WB, crossover	No	Yes	2	2(SL)
HYUNDAI					
ACCENT (RB)	94.5"WB, compact	No 10	No?	5 see note 2	5(RB)
AZERA (HG)	109.4"WB, sedan		likely	Yes	7(HG)
ELANTRA Coupe(JK), Sedan(UD/MD)	104.3"WB, compact	No	Yes	8	8(JK/UD/MD)
ELANTRA GT (GD) (aka "i30")	former Elantra Touring	old model		new model	6(GD)
EQUUS (VI)(stretch genesis)	119.9" WB, luxury seda	?	yes?	yes?	9(VI)
GENESIS (Coupe BK, Sedan BH/DH))	115.6" WB, luxury seda	9 shave keyway	9 shave keyway	?	9(BK, BH)
GENESIS G90					
SANTE FE (Sport DMA, NC)	106.3" WB, crossover	9 shave keyway note 3	9 shave keyway	9 shave keyway	7(NC,DMA)
SONATA (YF sedan, YF HEV)	110.0" WB sedan		4	?	4(YF)
TUCSON (LM to 2015)(TL in 2016)	103.9" WB, crossover	Yes	Yes	2	2(LM)
VELOSTER coupe (FS)	104.3"WB, compact	out of productior		?	5(FS)

2010-2012 EDR Access

1. The tool requires VIN input and only allows read of 2013+ VINS.
2. Input surrogate 2013 VIN to communicate with 2010-2012 models. Report will list surrogate VIN used.
3. Decoder changed slightly for 2013. Not all data decodes properly.
4. 2010-12 file admissibility must be presented skillfully (get help).
5. **Data successfully admitted in Virginia, Florida, and California.**

K/H 2010-2012 data reliability?


1. In 50+ NHTSA crashes, speed, delta V and belt use appear OK (one exception)
2. Steering angle, and accel data appear implausible on some
3. Key cycles at download not in all models
4. SAE 2014-01-0502 has details.
5. Additional testing on 2012 Soul reported in SAE 2015-01-1445.
6. 2021-01-0905 **2 crash tests of 2012 Hyundai Genesis Coupe EDR.**
7. Admitted to court in VA, CA, one other

Brake Pres. added to 2019 Forte

< Event 1 >

Master cylinder pressure

Units in Bars. 1 Mpa=10 bars
Toyota max scale is 12 Mpa=120 bar

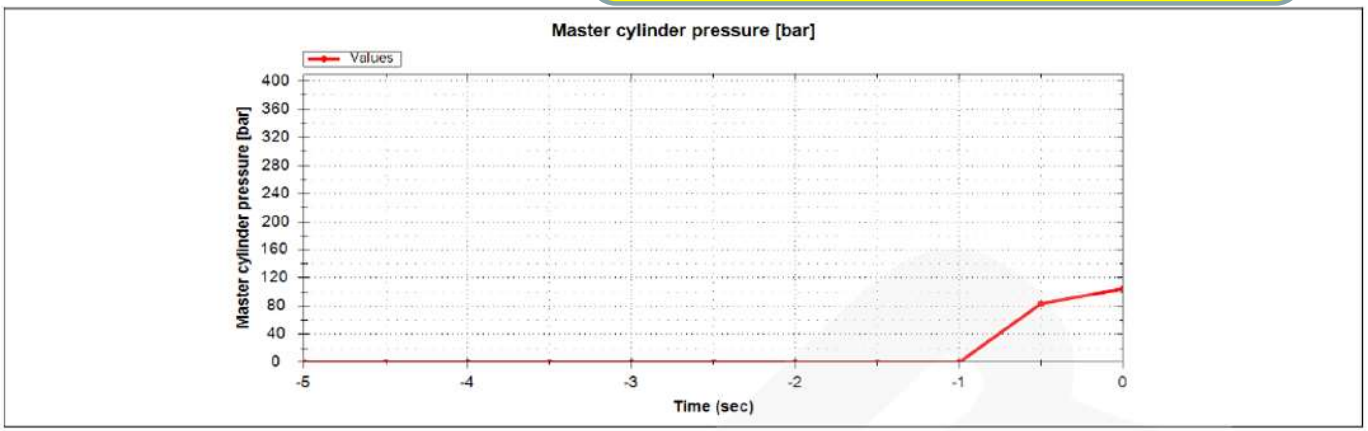

Num	Time (sec)	Master cylinder pressure [bar]
1	-5.0	0.2
2	-4.5	0.2
3	-4.0	0.2
4	-3.5	0.2
5	-3.0	0.2
6	-2.5	0.2
7	-2.0	0.2
8	-1.5	0.2
9	-1.0	0.2
10	-0.5	83.7
11	0.0	104.6

Some 2012 Honda not supported

- For 2012 Pilot and Odyessy help file Note 1 indicates due to production variations some vehicles may not be supported by CDR, and will repond “no communication with module”.
- Contact ahmmediation@ahm.honda.com for assistance in reading those ACM’s. (ahm stands for American Honda Motor). (reported on CDR Tool group Oct 2023)

Honda 24.2 CDR Coverage

Mostly US, no Euro until 2023

Model	Location	2011	2012*	2013	2014	2015	2016	2017	2018	2019	2020	2021	2022	2023	2024	2025
ACURA		Last 3 digits of Bosch CDR cable number					Gen 2		Gen 3			Gen 4				
RL			547													
TL			547													
TSX			547													
ZDX			547													
MDX			547		387/789			387/810				?	846			
NSX								387/789								
RDX				547			387/789		387/825							
ILX				547			387/789									
RLX					387/789											
TLX						387/789				387/810		846				
INTEGRA														846		
HONDA			2012	2013	2014	2015	2016	2017	2018	2019	2020	2021	2022	2023	2024	2025
ACCORD				387/789			387/810		387/825						846	
CIVIC 2 DR			547				387/810						846			
CIVIC 4 DR			547	387/789			387/810						846			
CLARITY												387/810				
CROSSTOUR			547													
CR-V			547				387/789	387/810					846		846	
CR-Z			547													
FCX Clarity								387/810								
FIT		EV	547			387/789		387/810					846			
HR-V							387/789		387/810				846			
INSIGHT			547							387/810						
ODYSSEY			547		387/789			387/810							846	846
PASSPORT										387/810						
PILOT			547				387/789	387/810						846		
RIDGELINE			547					387/810								

2011-
NO time series EDR
But may have Delta V single value

Honda only assists law enforcement voluntarily

The source data for thi… …ersion 24.2
Always consult the latest help file for the most accurate coverage
* Some 2012 models ot covered

Copyright Ruth Consulting LLC 2024 - Authorized for distribution by IPTM & SAE

Honda EDR Evolution

- 2012-2015 Gen 1 – One set DL's
  - Roll rate polarity varies by supplier
    (polarity added under graph)
  - Accel data instantaneous (not useful)
- 2016-17 Gen 2 adds AEB, Lane Departure data
- 2018 – Gen 3 adds "IG SW status" (ignition switch)
  - Airbag deploys even if ign off until car stops
  - Markets outside US/Japan do not get precrash data
- 2022 – Gen 4 – time -0.5 to TRG, Rear Belt Status, Lifetime event counter

Gen 2 New Data Elements

Pre-Crash Data -5 to 0 sec [2 samples/sec] (Event Record 1) - Table 2 of 3

Time Stamp (sec)	PCM Derived Accelerator Pedal Position, % full	Forward Collision Warning (Not Warning/ Warning)	Collision Mitigation Braking System (Not Engaged/ Engaged)	Collision Mitigation Braking System, Forward Collision Warning (On/Off)	Lane Departure Warning (Not Warning/ Warning)	Road Departure Mitigation (Not Engaged/ Engaged)	Road Departure Mitigation, Lane Departure Warning (On/Off)
-5.0	13	Not warning	Not engaged	On	Not warning	Not engaged	Off
-4.5	13	Not warning	Not engaged	On	Not warning	Not engaged	Off

Pre-Crash Data -5 to 0 sec [2 samples/sec] (Event Record 1) - Table 3 of 3

Time Stamp (sec)	Adaptive Cruise Control (Not Engaged/ Engaged)	Adaptive Cruise Control (On/Off)	Lane Keeping Assist (Not Engaged/ Engaged)	Lane Keeping Assist (On/Off)	Cruise Control (Not Engaged/ Engaged)	Cruise Control (On/Off)
-5.0	Not engaged	Off	Not engaged	Off	Not Engaged	Off
-4.5	Not engaged	Off	Not engaged	Off	Not Engaged	Off

GEN 4 New Data Elements


System Status at Event (Impact Event Record 1)

Seat track position switch, foremost, status, driver	No
Safety belt status, left second row passenger	Off
Safety belt status, middle second row passenger	Off
Safety belt status, right second row passenger	Off
Ignition cycle, crash	1,011
ECU life timer, crash	225h:58m:50s
Time from Time zero to End of Event (msec)	150
Time between T-0.5 and Time zero (msec)	215
Lifetime event number	1
Multi-Event Number (Event 1/2)	1

Reminders: UNIQUE TO HONDA

1. Most manufactures record the speed calculated in the powertrain control module as it is being sent **TO** the speedometer on the CAN bus.
2. Honda records the speed being displayed **ON** the speedometer, after the PCM calculated speed has been dampened or “smoothed”.
3. The last data point labeled 0.0 is sampled at AE. -0.5 is -0.01 to -0.50. While sampled at AE, speedometer processing delays what is being reported, so it lags the true speed at impact during hard braking.

2012 Civic Speed Reporting Delay

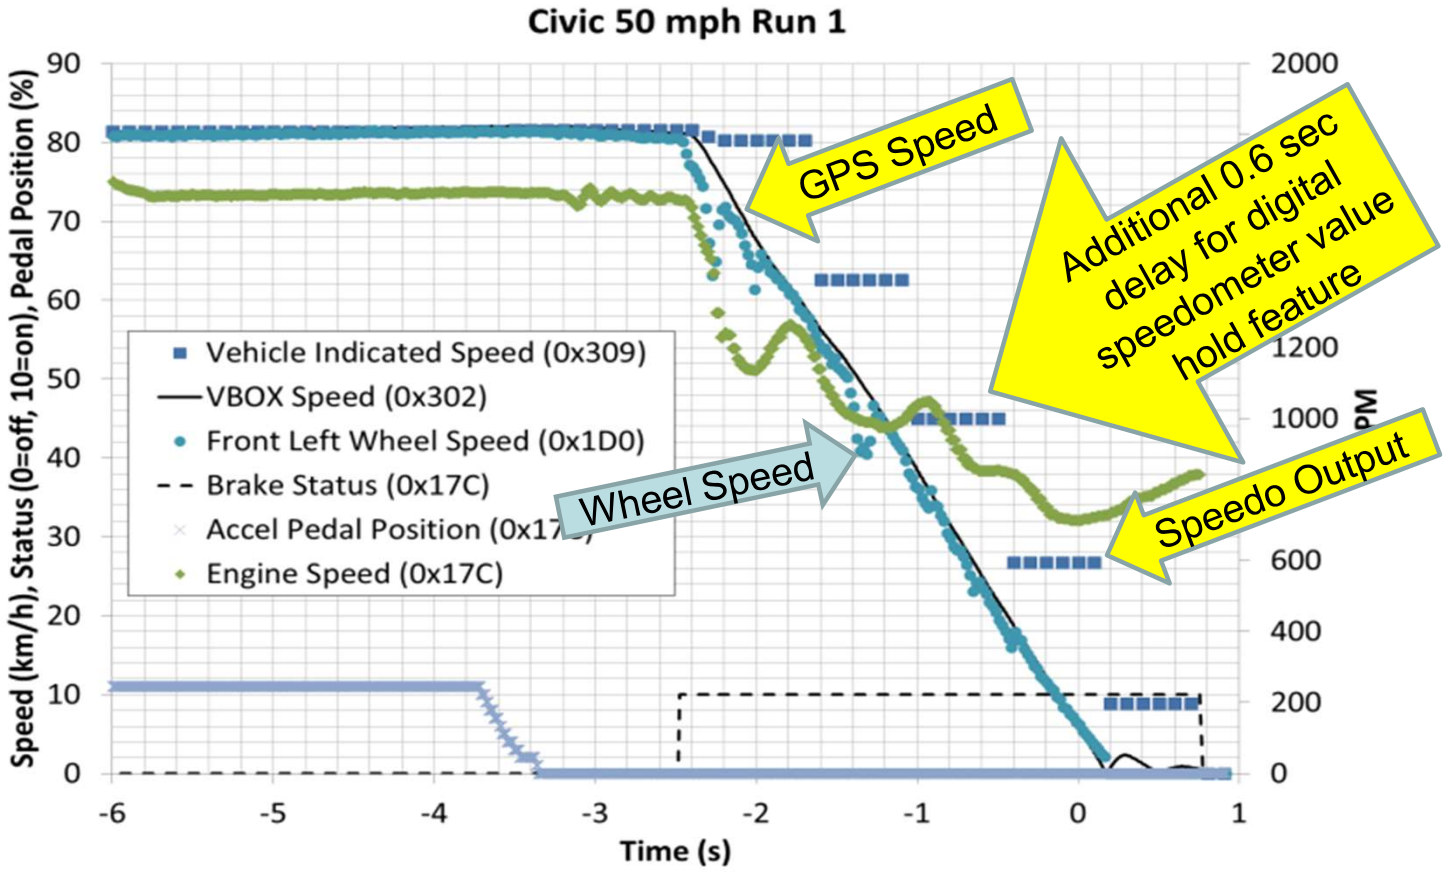

NISSAN EDR's CDR 23.3

US models only listed - CDR coverage is for US and Canada markets only

Model	Location	2006	2007	2008	2009	2010	2011	2012	2013	2014	2015	2016	2017	2018	2019	2020	2021	2022	2023	2024
Last 3 digits of Bosch CDR cable number																				
INFINITI																	No info			
G CONVERTIBLE	TUNNEL BETWEEN SEATS			*			Jul-12		780											
G COUPE	TUNNEL BETWEEN SEATS		*	Yellow = Proprietary Consult Tool Only					780											
G SEDAN	TUNNEL BETWEEN SEATS		*	No direct to module cables			Jul-12		780											
M	TUNNEL BETWEEN SEATS								780											
Q30													780							
Q40	TUNNEL BETWEEN SEATS										780									
Q50	TUNNEL BETWEEN SEATS								780											
Q60	TUNNEL BETWEEN SEATS								780				780							
Q70	TUNNEL BETWEEN SEATS								780											
EX	TUNNEL BETWEEN SEATS						pecial software		780											
FX	TUNNEL BETWEEN SEATS			required to read EDR					780											
JX35	TUNNEL BETWEEN SEATS								780											
QX50, 55													780		828					
QX60													780						828	
QX80	TUNNEL BETWEEN SEATS								780							828			828	
QX50-80	TUNNEL BETWEEN SEATS												QX80 only							
QX50-80	TUNNEL BETWEEN SEATS												QX80 only							
QX30	TUNNEL BETWEEN SEATS												598							
NISSAN		2006	2007	2008	2009	2010	2011	2012	2013	2014	2015	2016	2017	2018	2019	2020	2021	2022	2023	
370Z	TUNNEL BETWEEN SEATS		*				Aug-12		780											
ALTIMA COUPE	TUNNEL BETWEEN SEATS			*					[illegible]	INCLUDED IN SEDAN BELOW										
ALTIMA SEDAN	TUNNEL BETWEEN SEATS		*	Yellow = Proprietary Consult Tool Only					780						828					
ARIYA																	780			
ARMADA	TUNNEL BETWEEN SEATS	*		No direct to module cables					780			?	780							
CUBE	TUNNEL BETWEEN SEATS				*				780											
FRONTIER	TUNNEL BETWEEN SEATS	*					Oct-12		780								780			
GT-R	TUNNEL BETWEEN SEATS				*					780										
JUKE	TUNNEL BETWEEN SEATS								780											
KICKS														780	828					
LEAF	TUNNEL BETWEEN SEATS								780						828					
MAXIMA SEDAN	TUNNEL BETWEEN SEATS		*						780						828					
MICRA	Check Manual										780									
MURANO	TUNNEL BETWEEN SEATS		*		*				780						828					
MURANO CROSS C	TUNNEL BETWEEN SEATS								included in above											
NV200	TUNNEL BETWEEN SEATS								780											
PATHFINDER	TUNNEL BETWEEN SEATS	*							780									?		
QUEST	CTR CONSOLE NEAR FRONT		*						780											
ROGUE	Check Manual			*					780								828			
ROGUE SPORT/QUASHAI														780		828				
ROOX (Japan)																828				
SENTRA	TUNNEL BETWEEN SEATS		*						780							828				
TITAN	TUNNEL BETWEEN SEATS	*							780											
VERSA SEDAN	TUNNEL BETWEEN SEATS		*						780							828				
VERSA NOTE HB	TUNNEL BETWEEN SEATS						Sep-12		780											
XTERRA	TUNNEL BETWEEN SEATS	*					Oct-12		780											
Z																		780		

Yellow area not covered by CDR

Cable 828 Adds Roll Angle data

The source data for this chart is the Bosch CDR help file for Version 23.3 as of Nov 2023 and unofficial sources for non-cdr coverage
Always consult the latest help file for the most accurate coverage

Copyright Ruth Consulting LLC 2023 - Authorized for distribution by IPTM & SAE

Nissan Pre-Crash Data

Pre-Crash Data -5 to 0 sec [2 samples/sec] (Event Record 1)

(the most recent sampled values are recorded prior to the event)

Time Stamp (sec)	Speed, Vehicle Indicated (MPH [km/h])	Accelerator Pedal, % full	Engine RPM	Motor RPM	Service Brake (On, Off)	Steering Input (deg)
-5.0	24 [39]	16	2650	0	Off (Brake Not Activated)	-32
-4.5	23 [37]	11.5	1750	0	Off (Brake Not Activated)	-2
-4.0	21 [34]	9	1200	0	On (Brake Activated)	28
-3.5	15 [24]	9	1150	0	On (Brake Activated)	14
-3.0	13 [21]	4	950	0	On (Brake Activated)	4
-2.5	11 [17]	4	950	0	On (Brake Activated)	4
-2.0	5 [8]	4	900	0	On (Brake Activated)	-48
-1.5	3 [5]	4	850	0	On (Brake Activated)	-98
-1.0	1 [2]	4	850	0	On (Brake Activated)	-160
-0.5	3 [5]	10.5	1100	0	Off (Brake Not Activated)	-194
0.0	6 [9]	16	1150	0	Off (Brake Not Activated)	-218

Hybrid/Electric or Trans Input

Trans input tells you convertere slip

Table 2 – not rq'd

At AE

Nissan Long ΔV Polarity Error in SOME


Altima fixed - Front hit *was* positive – but ***Some exceptions still noted!***

2013 Altima in CDR 12.2

System Status at Event (Event Record 1)

Frontal Air Bag Suppression Switch Status	S airbag inhibit)
Maximum Delta-V, Longitudinal (MPH [km/h])	29 [47]
Time, Maximum Delta-V, Longitudinal (msec)	300
Maximum Delta-V, Lateral (MPH [km/h])	5 [8]
Time, Maximum Delta-V, Lateral (msec)	210
Maximum Acceleration, Longitudinal (g)	32.5
Time, Maximum Acceleration, Longitudinal (msec)	102.5
Maximum Acceleration, Lateral (g)	36
Time, Maximum Acceleration, Lateral (msec)	112.5


+29 at 300ms

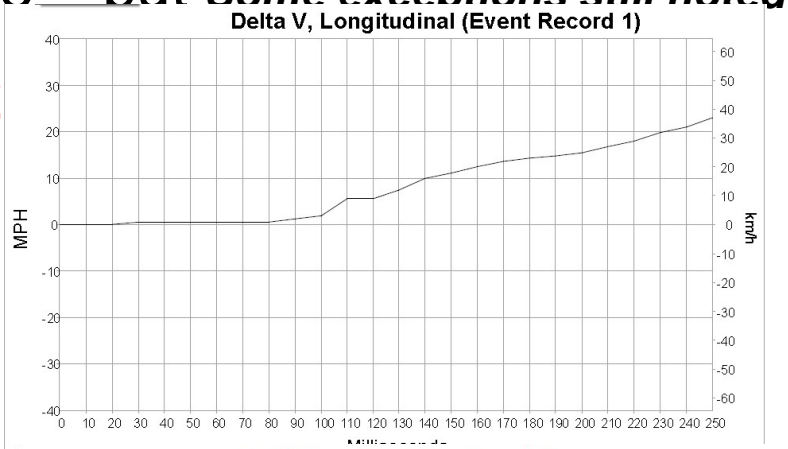

2013 Altima in CDR 16.5

S airbag inhibit)	
Maximum Delta-V, Longitudinal (MPH [km/h])	-29 [-47]
Time, Maximum Delta-V, Longitudinal (msec)	300
Maximum Delta-V, Lateral (MPH [km/h])	5 [8]
Time, Maximum Delta-V, Lateral (msec)	210
Maximum Acceleration, Longitudinal (g)	-32.5
Time, Maximum Acceleration, Longitudinal (msec)	102.5
Maximum Acceleration, Lateral (g)	36
Time, Maximum Acceleration, Lateral (msec)	112.5

-29 at 300ms

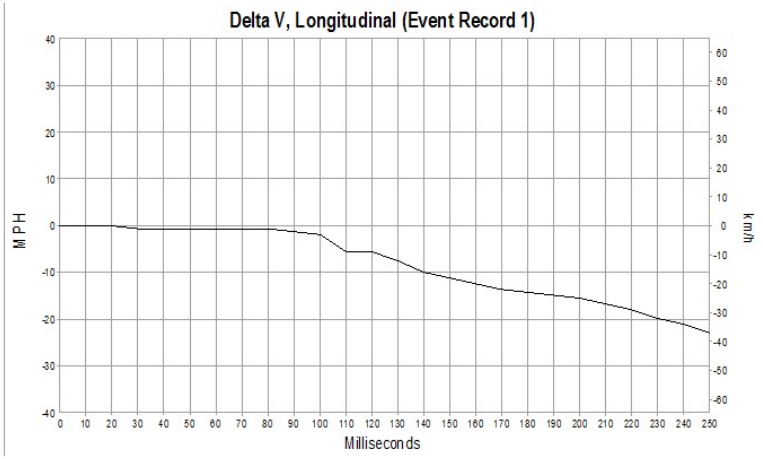

Nissan Recording Threshold

1. Several files have been read with events under 5mph Delta V over 150ms.
2. From 2013-2019 we believed all Nissans had a wakeup threshold of AE
3. At 2020 EDR User Summit, it was reported that tests were done on a 2014 Pathfinder at low speeds. No events were created below 5mph Delta V, events were created over 5mph.
4. Threshold could be model dependent!

VW/Audi 23.0

See help file for Rolls Royce

Model	Location	2009-13	2014	2015	2016	2017	2018	2019	2020	2021	2022
Last 3 digits of Bosch CDR adapter/cable number											
All VW/Audi Require the 387 Adapter to read DTM			Gold = US only (Canada not covered)				Yellow=Worldwide				
VW											
Arteon	UNDER CENTER STACK						805				
Atlas	UNDER CENTER STACK						805				
Beetle	UNDER CENTER STACK			804			Canada added				
CC	UNDER CENTER STACK			804							
Crafter	UNDER CENTER STACK						805				
EOS	UNDER CENTER STACK		806								
Golf, eGolf	UNDER CENTER STACK			805			Worldwide				
Jetta	UNDER CENTER STACK			804			805				
Neo											
Passat	UNDER CENTER STACK			804			805				
Polo	UNDER CENTER STACK						805				
Routan	UNDER CENTER STACK										
Sportwagen + Alltrack				Golf platform, not called out separtely in help file							
T-Roc	UNDER CENTER STACK						805	805			
T-Cross	UNDER CENTER STACK										
Tiguan	UNDER CENTER STACK			804		805					
Touareg	UNDER GEAR SELECTOR			804				500/826			
Touran	UNDER CENTER STACK						805				
AUDI				2015	2016	2017	2018	2019	2020	2021	2022
A1	Under Center Stack							805			
A3,S3, RS3	Under Center Stack			805					842		
A4, S4, A4 allroa	Tunnel between 1st/2nd row seats			804		500/813					
A5, R5, S5, RS5	Tunnel between 1st/2nd row seats			804			500/813				
A6, A6L, S6, Ava	Tunnel between 1st/2nd row seats			804			500/826				
A7, S7, RS7	Tunnel between 1st/2nd row seats			804			500/826				
A8, A8L, S8	Tunnel between 1st/2nd row seats			804			500/826				
Q2	Under Center Stack						805				
Q3	Under Center Stack			804				805			
Q4											842
Q5, SQ5	Tunnel between 1st/2nd row seats			804			500/813				
Q7	Under Center Stack					500/813			500/826		
Q8	Under Center Stack						500/826				
R8	Under Center Stack					804					
TT, TTS				not covered at this time							
eTron	Under Center Stack							500/826			

The source data for this chart is the Bosch CDR help file for Version 19.6. Always consult the latest help file for the most accurate coverage

Copyright Ruth Consulting LLC 2021- Authorized for distribution by UNF-IPTM & SAE

Chrysler Minivan Sister

No “back model” coverage

2023 and 2024 now covered in 23.1

VW/Audi Events

- Recorder holds up to 6 events in Chron order.
- Event types are Front, Rear, Side, Rollover, Pedestrian (if equipped), External Trigger, and HV (High Voltage disconnect). External triggers are Automatic Driver Assistance System (ADAS) events and are not crashes. If the driver is not braking hard enough, ADAS will override and brake harder.
- DL's say crash event threshold is 8 kph (5mph) lat or long Delta V over 150ms for ND's, D's will record at any magnitude. External Triggers may record with 0 ΔV.
- A small # of ND events have <5mph, this is the exception not the rule.

VW/Audi Details

1. Same data set for all event types
2. Time from last precrash to AE noted
3. Some 2017+ modules use Flex Ray/500
4. Date/Time of Crash from clock (GPS if clock not set) in 2015+ Audi models, phased into VW models
5. Newer models require hood to be open to read through DLC, have gateway
6. EDR Speed is as reported on the speedometer

VW/Audi Speed Data +5%?

- A 2021 Audi A6 was tested in Europe by setting "External Trigger" (Auto Emergency Braking) events and measure reported speed vs GPS speed. Authors found the reported values to be 5% higher than actual speed.[1]
- Two 2021 VW ID4 IIHS tests run at 64.4 kph reported 64 kph in EDR.[2] Further testing needed?

1 "Event data recordings triggered by automated emergency braking", European Association For Accident Research (EVU 30th annual conf July 2023) by Spec and Van Essen (PDF) Event data recordings triggered by automated emergency braking (researchgate.net)

2 "Late Model EDR Accuracy" WREX 2023 by Ruth


VW/Audi Auto Emergency Braking

- IPTM is not aware of any pictures stored or any way to access pictures taken by the AEB system.
- Sources within VW advise if you put a good scan tool on a vehicle after a crash, there is a speed stored in the camera module calculated from images and not from the vehicle speed sensor.
- If tires are locked or otherwise not rolling at vehicle speed, the camera source may be a more accurate speed.

Threshold & Time between events (Five Overlaid)

System Status at Event (Record 5)

Event Counter at Event	1	2	3	4	5
Event Type	Frontal	Frontal	Frontal	ta Not Available	Data Not Available
Multi-Event, Number of Events	1, Event	2, Event	3, Event	4, Event	5, Event
Time from Initial Event to Current Event (msec)	0.0	306.0	608.0	1,275.0	1,327.0
Vehicle Clock, Date and Time at Event (YYYY-MM-DD, HH:M	2019-11-01, 19:50:40	9-11-01, 19:50:41	-11-01, 19:50:41	11-01, 19:50:41	2019-11-01, 19:50:43
Vehicle Mileage (km)	55,370	55,370	55,370	55,370	55,37
Operating Time (min)	80,639	80,639	80,639	80,639	
Ignition Cycle at Event (Cycles)	5,265	5,265	5,265	5,265	5,265
Ignition Cycle at Download (Cycles)	5,271	5,271	5,271	5,271	5,271
Maximum Delta-V, Longitudinal (MPH [km/h])	-24.9 [-40]	-2.5 [-4]	0.0 [0]	1.9 [3]	1.9 [3]
Time, Maximum Delta-V, Longitudinal (msec)	300.0	290.0	75.0	300.0	300.0
Clipping Time, Longitudinal Acceleration Sensor (msec)	Clipping Not Reached	ping Not Reached	ing Not Reached	ng Not Reached	Clipping Not Reached
Maximum Delta-V, Lateral (MPH [km/h])	-7.5 [-12]	0.0 [0]	-0.6 [-1]	2.5 [4]	1.9 [3]
Time, Maximum Delta-V, Lateral (msec)	300.0	252.5	230.0	285.0	300.0
Clipping Time, Lateral Acceleration Sensor (msec)	Clipping Not Reached	ping Not Reached	ing Not Reached	ng Not Reached	Clipping Not Reached
Time, Maximum Delta-V, Resultant (msec)	300.0	300.0	230.0	297.5	300.0
Time from Last Speed Data Sample (Precrash) to Time Zero	110	304	2	335	283
Time from Time Zero to Algorithm Start (Front) (msec)	ithm Started at Time Zero	orithm	ithm	thm	Algorithm
Time from Time Zero to Algorithm Reset (Front) (msec)	285	orit	orithm	rit	Algori
Time from Time Zero to Algorithm Start (Side) (msec)	7	196	it	Not Started	Alg
Time from Time Zero to Algorithm Reset (Side) (msec)	Algorithm Not Reset	206	m Not Re	ithm Not Reset	
Time from Time Zero to Algorithm Start (Rear) (msec)		orithm Not Sta	hm Not S	ed at Time Zero	
Time from Time Zero to Algorithm Reset (Rear) (msec)		orithm Not	orithm	20	20
Time from Time Zero to Deployment (Rollover) (msec)	Algorithm N	orithm N	ith	thm Not Sta	Algorithm Not Started
Time from Time Zero to Algorithm Reset (Rollover) (msec)	Algorith	orit	n Not Reset	rithm No	Algorithm Not Reset
Vehicle Identification Number (VIN)	WVWZZ	ZAUZJW16280	UZJW162808	AUZJ	VWZZZAUZJW162808
Part Number, ACM	5Q0959655BH	5Q0959655BH	5Q0959655BH	5Q0959655BH	5Q0959655BH
Supplier ID, ACM	TSR	TSR	TSR	TSR	TSR
Production Date, ACM	171117	171117	171117	171117	171117
Supply Voltage (Before Event) (V)	14.7	12.6	12.6	12.6	12.6
Complete File Recorded	Completed Successfully	eted Successfully	ted Successfully	ed Successfully	Completed Successfully

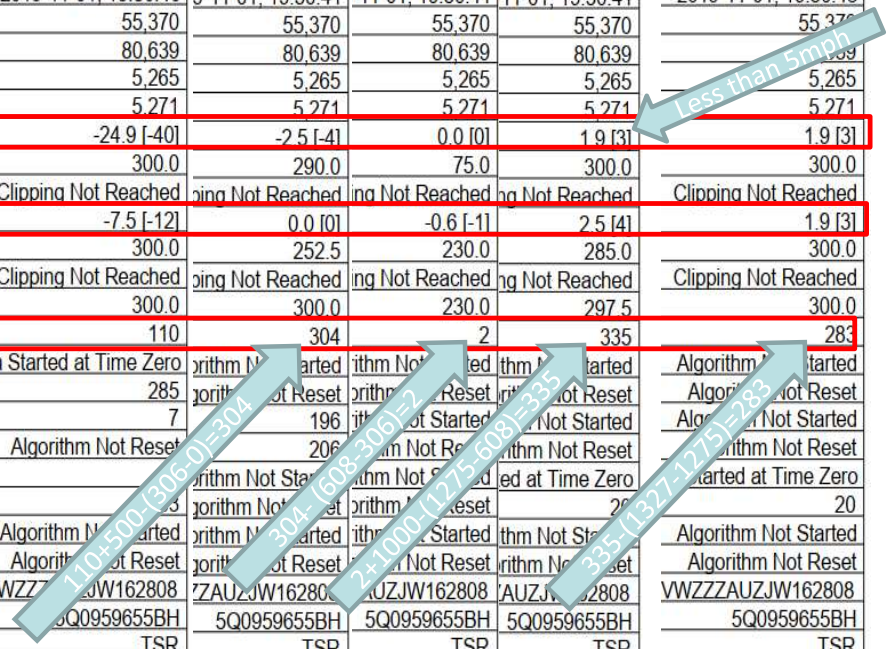

Subaru CDR Coverage 24.2 Dec 2024

Bosch CDR900 Interface Required for true Subaru models | Gold = US Only | Yellow = US/Europe | Blue = Europe Only | Japan Only | Green = Bosch

Cables 614 and 616 were originally released for Toyota models but also service some Subaru's

	2011	2012	2013	2014	2015	2016	2017	2018	2019	2020	2021	2022	2023	2024	2025
SUBARU US Models															
Ascent	Not in production								835 Bosch						
BRZ	n/a	n/a	Read as Toyota brand 86 model with Cable 614 (CAN+ or CDR900 interface)									844 Denso			
Crosstrek	n/a	n/a	616 Denso												
Forester	No	No	616* Denso	*					835 Bosch						
Impreza	No	614* Denso	614*/616 Denso								Japan	Japan	844 Denso		
Legacy	No	No	614 Denso		836 Bosch					844 Denso					
Outback	No	No	614 Denso		836 Bosch					844 Denso					
WRX (inlcudes STI)	No	No	No	No	614 Denso		616	614/616				844 Denso			
Tribeca	No	No	No	No	Discontinued										
NON-US Models															
ıpan only)			614												
pe)		614					614/616			616					
Japan, Europe)					614		614/616				844				

* if equipped with Gen 3 ACM there may not be an EDR

The source of this information is the Bosch CDR help file 24.2. Always consult the help file for the latest information. More detailed market coverage info is in the help file.

Copyright Ruth Consulting LLC 2024 - Authorized for distribution by UNF-IPTM & SAE

Subaru EDR Tools

1. Bosch CDR 900 interface and 21.3+ software reads all model and model years except for 2013-2020 BRZ, which you read as a Toyota brand Model 86. The 21.4+ software is rejecting the BRZ, reload 19.6 software to read it until Bosch fixes that?
2. Subaru records both a front and side event in angular crashes. Use the first in time for Delta V.
3. Recent attempts to read a 2023 Crosstrek listed as not covered were successful using a 2021 VIN ?

TESLA 3.5% of new sales!



1. Remember the definition of an EDR is something that records a time series of data **as a result of a crash**.
2. Tesla may record information as a result of turning the key on, but that is not an event data recorder. More on this later.
3. Tesla did not have any EDR in the ACM of its original 2008 Roadster models.
4. Tesla has installed EDR in The 2012+ Model S, the 2015+ Model X, and the 2017 Model 3.
5. Effective March 2018, Tesla announced they will sell a publicly available tool to download the Tesla EDR

Tesla EDR

- Kit includes:
  - TIV-144: In vehicle cable for Tesla Model S and X
  - TIV-145: In vehicle cable for Tesla legacy Model S
  - TIV-996: In vehicle cable for Tesla Model 3
  - TD2M-601: Direct to Module cable for Tesla Model X and 3
  - TD2M-602: Direct to Module cable for Tesla Model S
  - TD2M-139: Direct to Module cable for Tesla Model S (NEW CABLE)
  - AC Power Adapter
  - PCAN-USB adapter
  - Hard Shell Case



COST: $1400.00 as of 4/15/2023

Getting the Data


Coverage



Model	2008-11	2012	2013	2014	2015	2016	2017	2018	2019	2020	2021	2022	2023
ROADSTER	NO EDR												
Model S	Not in Prod								2/26/2019 GEN 2			6/10/2021 GEN 3	
Model X	Not in Production										2021+ GEN 2		
Model 3	Not in Production										10/5/2020 GEN 2		
Model Y	Not in Production												


TESLA

- More information is available on their website https://edr.tesla.com
- See “Other sources” later

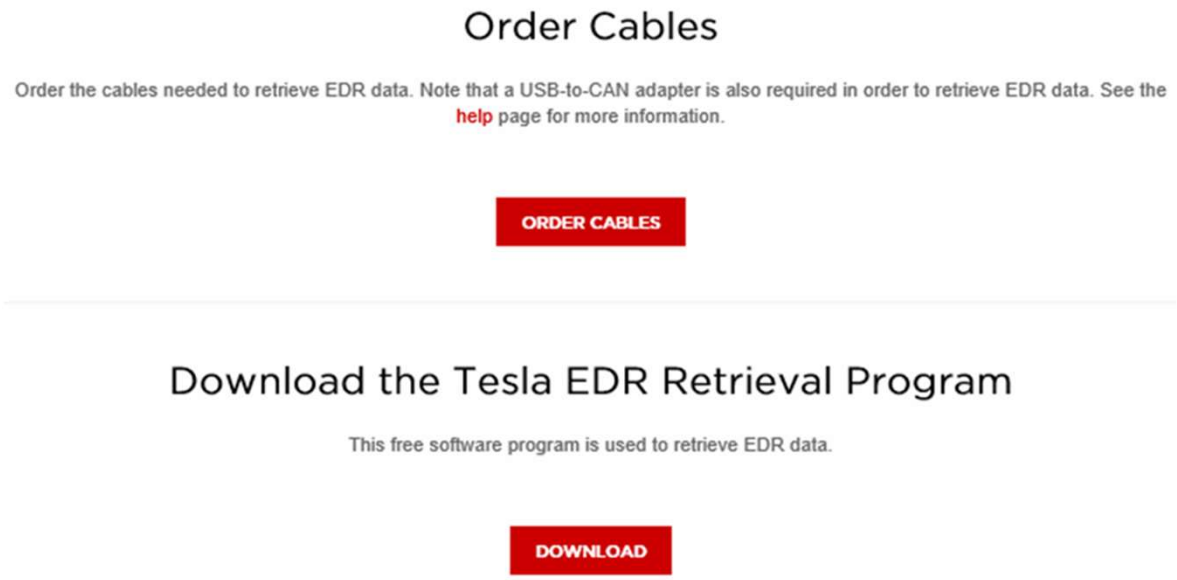

The Tesla EDR Tool

1. Tesla provides the software free of charge on their website that installs on your laptop. No special computer is needed.
2. The hardware kit sells for a list price of $1200.00.
3. The equivalent of the Bosch CDR interface manual is the “PCAN-USB” adapter. It is very small, and reminds you more of a USB to serial adapter, just a slight bit larger.

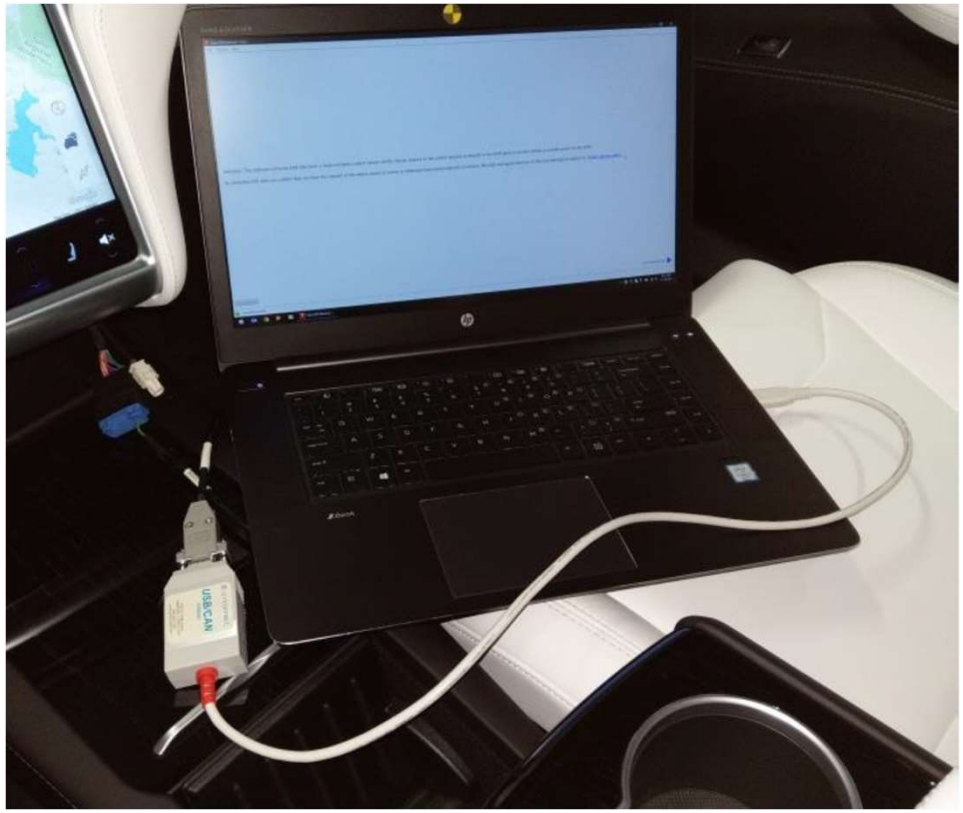


Plug in the PCAN adapter to the Body Harness. Model X and Model 3 are in other places & use a different connector described in Tesla's EDR guides by model at **edr.tesla.com/help**.



TESLA also has 3 direct to module connectors

If the In-Vehicle Connection procedure is unsuccessful, you might be able to connect to the RCM directly, and establish a direct-to-module connection. The RCM is located forward of the center console, below the instrument panel and center screen.

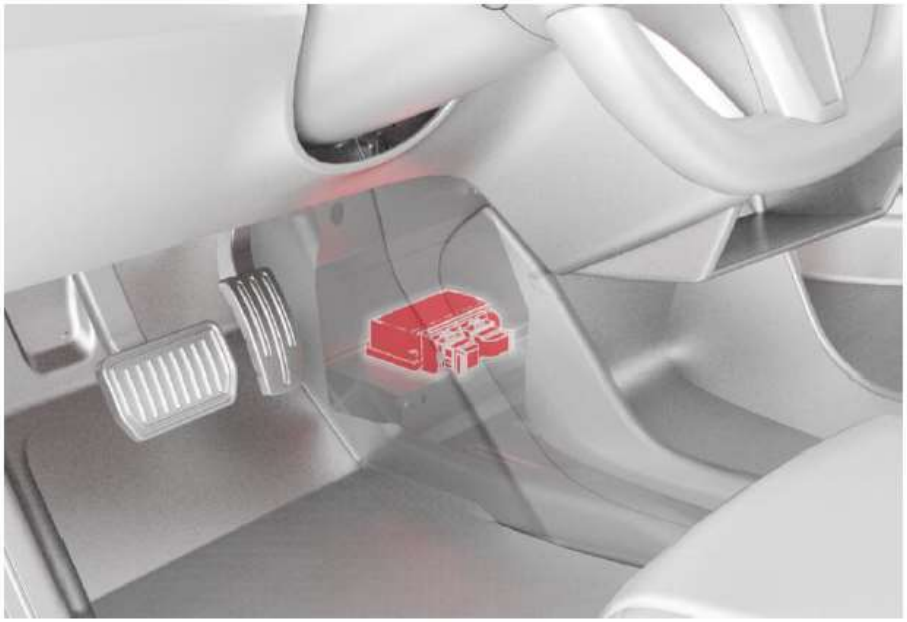

Some 2018 Model 3 Cables must be replaced

External Power must be used for DTM readouts

·. Connect 12V power to the Tesla Model S Direct-To-Module EDR Retrieval Harness.


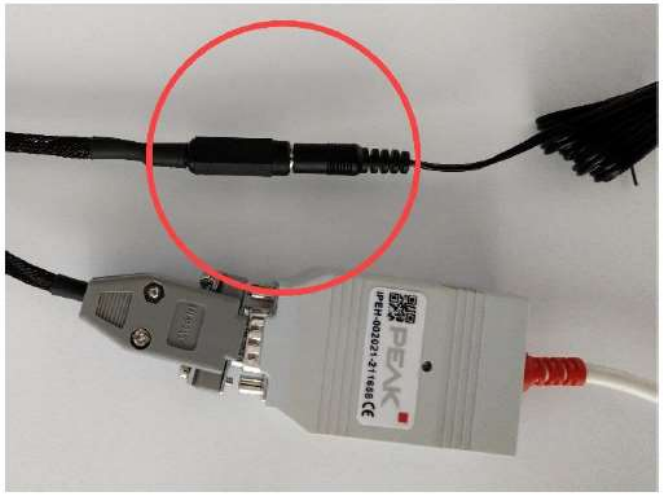


Figure 20. Connecting 12V power to the EDR retrieval harness

·. Proceed to “Retrieve Data” on page 26 to complete the data retrieval procedure.

The Tesla Guide (one per model)

- The Guide is VERY thorough and helpful 20+ pages
- It gives step by step instructions for the hardware assembly and to navigate the EDR program
- There are photographs of connector and module locations
- There are instructions for disassembly to get to the connectors and modules

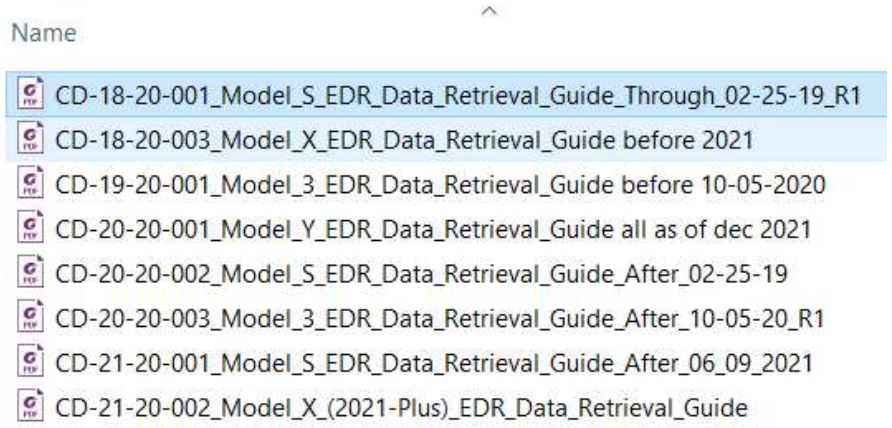

Tesla EDR

- Data varies by model

	Model S	Model 3	Model X
PreCrash Data			
Vehicle Speed	2Hz	5Hz	2Hz
Accelerator Pedal	2Hz	5Hz	2Hz
Rear Motor Speed	2Hz	5Hz	2Hz
Service Brake	2Hz	2Hz	2Hz
Stavility Control	2Hz	2Hz	2Hz
ABS	2Hz	2Hz	2Hz
Steering Wheel Angle	2Hz	10 Hz	10 Hz
Lateral Acceleration	Not Reported	10 Hz	10 Hz
Longitudinal Acceleration	Not Reported	10 Hz	10 Hz
Roll Rate	Not Reported	10 Hz	10 Hz
Yaw Rate	Not Reported	10 Hz	10 Hz

Tesla EDR

- Data varies by model

	Model S	Model 3	Model X
Crash Data			
Longitudinal Δv	300ms	300ms	250ms
Lateral Δv	300ms	300ms	250ms
Longitudinal Acceleration	500Hz (300ms)	2000Hz (60ms)	2000Hz (60ms)
Lateral Acceleration	500Hz (300ms)	2000Hz (60ms)	2000Hz (60ms)
Normal Acceleration	Not Reported	Not Reported	50Hz (1.4s)
Roll Angle	100Hz (6s)	Not Reported	Not Reported


Tesla EDR Sample File

- Model 3 Data

Time (sec)	Service Brake	Stability Control	ABS Activity
-5.0	Off	Off	Off
-4.5	Off	Off	Off
-4.0	Off	Off	Off
-3.5	Off	Off	Off
-3.0	Off	Off	Off
-2.5	Off	Off	Off
-2.0	Off	Off	Off
-1.5	Off	Off	Off
-1.0	Off	Off	Off
-0.5	Off	Off	Off
0.0	On	Off	Off
-2.6	6.0	10.8	714
-2.4	6.0	13.2	746
-2.2	6.0	14.8	784
-2.0	7.0	12.4	807
-1.8	7.0	12.4	845
-1.6	7.0	12.4	883
-1.4	7.0	11.2	905
-1.2	8.0	12.0	922
-1.0	8.0	10.4	941
-0.8	8.0	4.8	932
-0.6	8.0	0.0	916
-0.4	8.0	0.0	888
-0.2	8.0	0.0	843
0.0	7.0	0.0	749

Tesla EDR Sample File

- Model 3 Data

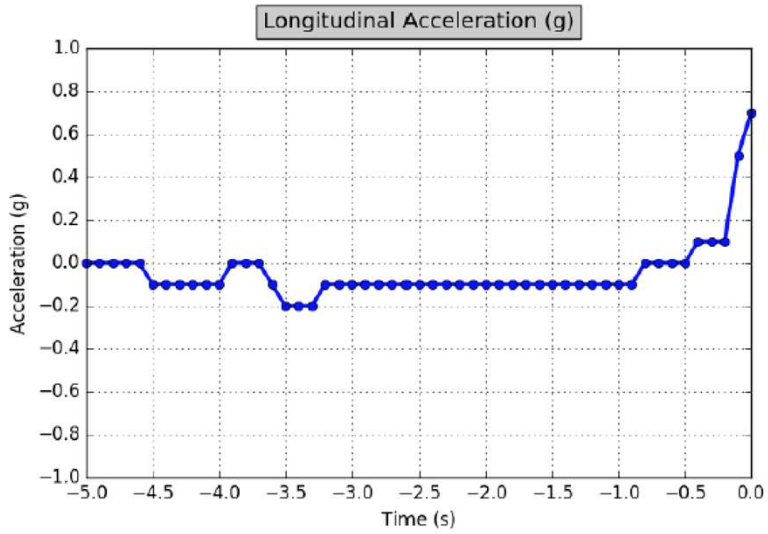

Time (s)	Acceleration (g)	Time (s)	Acceleration (g)	Time (s)	Acceleration (g)
-5.0	0.0	-3.2	-0.1	-1.4	-0.1
-4.9	0.0	-3.1	-0.1	-1.3	-0.1
-4.8	0.0	-3.0	-0.1	-1.2	-0.1
-4.7	0.0	-2.9	-0.1	-1.1	-0.1
-4.6	0.0	-2.8	-0.1	-1.0	-0.1
-4.5	-0.1	-2.7	-0.1	-0.9	-0.1
-4.4	-0.1	-2.6	-0.1	-0.8	0.0
-4.3	-0.1	-2.5	-0.1	-0.7	0.0
-4.2	-0.1	-2.4	-0.1	-0.6	0.0
-4.1	-0.1	-2.3	-0.1	-0.5	0.0
-4.0	-0.1	-2.2	-0.1	-0.4	0.1
-3.9	0.0	-2.1	-0.1	-0.3	0.1
-3.8	0.0	-2.0	-0.1	-0.2	0.1
-3.7	0.0	-1.9	-0.1	-0.1	0.5
-3.6	-0.1	-1.8	-0.1	0.0	0.7
-3.5	-0.2	-1.7	-0.1		
-3.4	-0.2	-1.6	-0.1		
-3.3	-0.2	-1.5	-0.1		

Troubleshooting


1. Some users report a “time out” error when trying to read data. The vehicle is going back to sleep. **Putting your foot on the brake pedal** and keeping it there for the whole readout keeps the vehicle alive.
2. Low battery power accentuates the time out problem. Tesla NEMA 5-15 adapter?



3. Or see the Help Guide for information how to backpower through the First-Responder loop.

Converting Raw Data to a Report

The Tesla software extracts a raw data file. To convert the raw data to a report, you must upload the raw data to the Tesla Server. A report is immediately returned in the latest version of software.

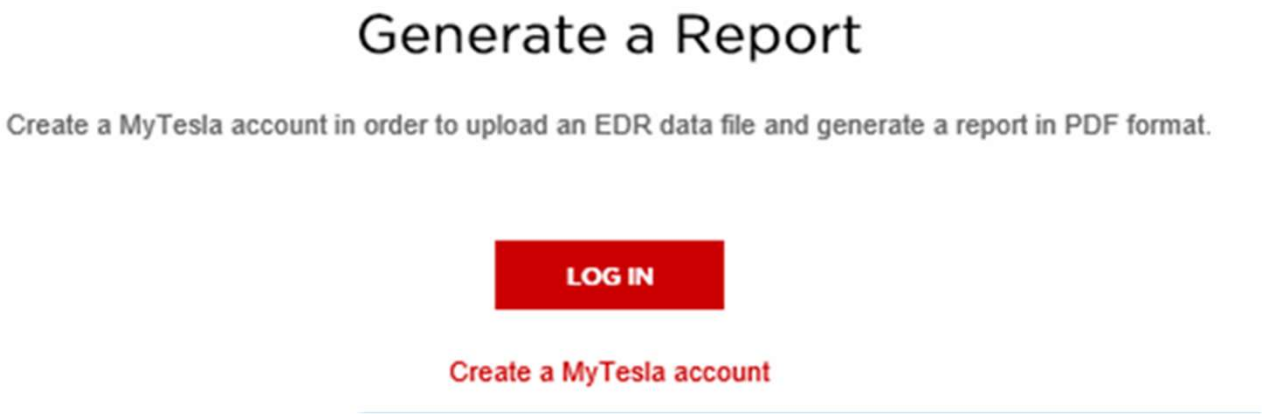

Worried about report conversion being biased by Tesla?

1. Data is Encrypted.
2. The report is returned IMMEDIATELY. There is no time for Tesla to alter any data to Tesla's benefit.
3. However, some clients insist that no one has a copy of the data except them.
4. There is a "Save without VIN sequence" option to de-identify data
5. There is no alternative.

What about OTHER data Tesla Data Records?

1. Most of the time you will NOT NEED to access the other data Tesla records, the EDR should be sufficient. But if you need a longer time history, Tesla records MANY data parameters every one second plus, when anything electronically monitored happens. It gets uploaded to the cloud.
2. It is NOT an "event" data recorder, it is a continuous recorder (does **NOT** meet Part 563 definition of a data recorder) (so **NO** PUBLICLY AVAILABLE tool to read it)
3. Law Enforcement contact Tesla and demonstrate proper legal authority
4. Tell them what you are interested in (they have so much you have to narrow it down)

What about OTHER data Tesla Data Records?

1. Modern Tesla have recorded video that can be uploaded to Tesla
2. This data can be retrieved from Tesla
3. Contact legal@tesla.com



BMW CDR US 23.0 Coverage

See help file for Rolls Royce

Model	Location	2012	2013	2014	2015	2016	2017	2018	2019	2020	2021	2022
Last 3 digits of Bosch CDR adapter/cable number shown												
BMW	**All BMW require 387 Adapter for DTM**											
1 Series			Not sold in US						500/822			
2 Series	Driver side, behind IP, rt of strg			796								796 OR 5(
2 Series xdrive	Center console between seats										500/822	
3 Series	Passenger side, behind the glove box		796								500/822	
Active Hybrid 3	Driver side, behind IP, rt of strg			796								
4 Series	Passenger side, behind the glove box		796					500/822				
5 Series	Passenger side, behind the glove box		796								500/822	
6 Series	See Service Manual								500/822			
6 Series GT	Passenger side, behind the glove box		796			500/796	500/822					
7 Series	Passenger side, behind the glove box								500/822			
8 Series	Passenger side, behind the glove box		796								500/822	
X3 xDrive	Center Tunnel, Between Seats			796					500/822			
X5	Center Tunnel, Between Seats				798	500/798	500/807		also X2			
X1, X2	See Help File - Various				796			500/822			500/807	
X3, X4	Center Tunnel, Between Seats				796						500/822	
X6	See Service Manual								500/822			
X7	Center Tunnel, Under Dash				798				500/822			
Z4	See Service Manual				798				500/822			
iX												500/822
i3, i8				500/807								

No “back model” coverage

500=flex ray

2023 now covered in 23.1

The source data for this chart is the Bosch CDR help file for Version 21.5

Always consult the latest help file for the most accurate coverage


Copyright Ruth Consulting LLC 2022 - Authorized for distribution by UNF-IPTM & SAE

SOME BMW have 2 “Airbag Modules”. Data in ACSM in the instrument panel



<- Sensor only module on center tunnel
No ACSM nomenclature on it

ACSM EDR brain box

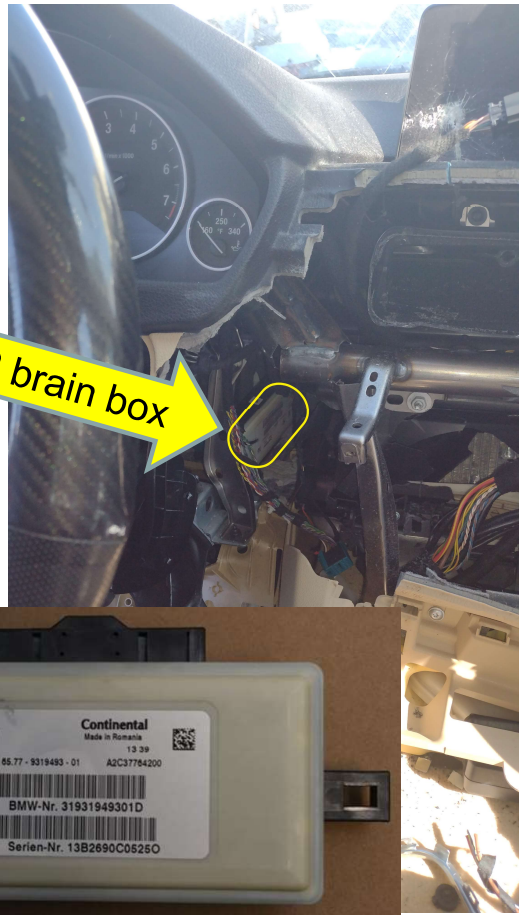

Advanced Crash Safety Module (ACSM) (brain box) has the data. Other module with the arrow contains sensors, is hard mounted to body.

ACSM EDR brain box



More data in 2020 X5 “ACSM5”

Coverage for ACSM6 added in 23.0

- Recent files show day/date/time of crash and second/third row seat belt use, more

Multi-Event, Number of Events	1. Event
Time From Previous Event to Current Event (msec)	Data Not Available
Time From Last Speed Data Sample (Precrash) to Time Zero (msec)	57
Time From Initial Event to Current Event (msec)	Data Not Available
Complete File Recorded, Public, Prio 1 Data	Completed Successfully
Ignition Cycle, Crash (Cycle)	1,315
Ignition Cycle, Download (Cycle)	1,316
Vehicle Clock, Date and Time at Event (YYYY-MM-DD, HH:MM:SS)	2020-12-18, 09:03:54
Vehicle Mileage (km)	13,285
Operating Time (min)	20,794
Safety Belt Status, 2nd Row, Left Side	Not Belted
Safety Belt Status, 2nd Row, Center	Not Belted
Safety Belt Status, 2nd Row, Right Side	Not Belted
Safety Belt Status, 3rd Row, Left Side	Data Not Available
Safety Belt Status, 3rd Row, Center	Data Not Available
Safety Belt Status, 3rd Row, Right Side	Data Not Available

Mercedes CDR Coverage 21.2 36%

Model	Start of Sales	2013	2014	2015	2016	2017	2018	2019	2020	2021	2022
Last 3 digits of Bosch CDR DTM cable number											
Mercedes	EDR Start	All Mercedes use 387 adapter for direct to module downloads									
A-Class Limo								832			
AMG-GT					800						
B-Class EV	after 4/1/2014		598								
B-Class	after 6/2/2014			598					832 Limo		
C Class Sedan	after 9/1/2014			801							
C Class Coupe	tart of 2015 M.Y.			800	801						
CLA Class	after 6/2/2014			598					832		
CLS-Class				800					801		
E Class (includes coupe)	after 4/1/2013		800			801 w steering data					
EQA/B/C									801 w strg		
G Class	after 11/1/2014			598				801			
GL Class	after 7/11/2014			598	?	?					
GLA Class	after 6/2/2014			598						832	
GLC Class					598		801			832	
GLE Class					598				832		
GLK	after 12/2013		800		?	?					
GLS Class					598				832		
GT								801			
G wagon									801		
Maybach S600					801						
ML-Class	after 7/11/2014			598	?						
S-class Sedan	after 9/2013		801							500/841	
S-Class Coupe	after 9/1/2014			801							
SL	after 12/2013		800								
SLC							800				
SLK	after12/2013		800								
Sprinter								832			
Vito					598					832	
Smart & 2016 with "E"	after 9/1/2014			809							
Smart with VIN 4th "F"					820						
Smart for two, coupe, cabrio							820				
Metris							598				

No "back model" coverage

2023-4 now released

Mercedes Details

1. Mercedes phased in EDR in anticipation of the NPRM requiring EDR's for Sept. 2014
2. Precrash speed, brake, throttle (563 Table 1) & lat/longitudinal ΔV.
3. Can hold 5 events, D's lock, ND's FIFO
4. Recording threshold is 5 mph over 150ms
5. Speed is avg. of 4 wheel speed sensors
6. The 2017 E Class has Steering, ABS, Stab Cont'l. This marks a departure from their philosophy to record only the minimum required by law.

Mercedes Key Cycles

- Some Mercedes have unusually high key cycle counts for their age, and since event.
- Other brands have 2500 key cycles per yr or 20,000km.
- Working theory is that counter increments whenever key fob leaves range and comes back into range.

Ignition Cycle, Crash (cycle)	11,639
Ignition Cycle, Download (cycle)	12,113
Vehicle Mileage (km)	20,950
Operating Time (min)	29,712
Vehicle Identification Number	4JGDA5JB2HA******
Event Counter (counts)	1

Mercedes Operating Timer

- In one model, the mileage divided by the operating timer implied the vehicle traveled an average speed of 500 mph
- Obviously this can’t be true, issue is under investigation

Mazda CDR 23.3 Coverage

	Location	US Only Coverage												Add Europe	
Last 3 digits of Bosch CDR cable number showr		2010	2011	2012	2013	2014	2015	2016	2017	2018	2019	2020	2021	2022	2023	2024
MAZDA			All Mazda use 387 adapter for direct to module													
CX-3	TUNNEL BELOW IP							812								
Tribute/CX-5	TUNNEL AFT SHIFTER		Read as Escape		779			811	812							
CX-9	See help file		778					811								
CX-30 US	Forward of Shifter											843				
CX-30 Europe	Forward of Shifter														CDR2 863	
CX-50	Forward of Shifter														863	
CX-90	Forward of Shifter															863
Mazda 2	TUNNEL AFT SHIFTER		792				not listed	812	not listed						863	
Mazda 3	Forward of Shifter			779				811			843					
Maxda 3 Europe															CDR2 863	
Mazda 5	TUNNEL BELOW IP			778					not listed							
Mazda 6	TUNNEL BELOW IP		792			779		811		831						
MX-5 Miatta	TUNNEL BELOW IP				no coverage			812								
MX-30	Forward of Shifter													843		

Law Enforcement Contact Your Instructors - Data available from pre-CDR ACM's from Mazda or Mazda

Memo: The Mazda Tribute was sister to the Ford Escape thru 2011. A 2011 Tribute was read using a 2011 Escape VIN.

The source data for this chart is the Bosch CDR help file for Version 23.3

Always consult the latest help file for the most accurate coverage

Copyright Ruth Consulting LLC 2023- Authorized for distribution by IPTM & SAE

2023+ Additional Precrash Data

The CDR Help file indicates some 2023+ Mazda may add the following data


- Engine RPM
- ABS Activity (engaged, non-engag
- Stability Control (on, off, engaged)
- Steering Input
- Adaptive Cruise Control Status
- AEBS Status
- AP Crash Status
- Automatically Commanded Steering Function
- Corrective Steering Function

- Lane Departure Warning System Status
- Lateral Acceleration Pre Crash
- Longitudinal Acceleration Pre Crash
- Normal Acceleration
- Stability Control
- Traction Control Status
- Tyre Pressure Monitoring System Warning Lamp
- Yaw Rate

Volvo CDR 23.0.2 Coverage

Model	Location	2010	2011	2012	2013	2014	2015	2016	2017	2018	2019	2020	2021	2022	2023
Last 3 digits of Bosch CDR cable number sh															
VOLVO		All Volvo use 387 Adapter for DTM images													
C40	CTR TUNNEL UNDER CONSOLE													500/830	
S60	CTR TUNNEL UNDER CONSOLE		799							500/830					
S80, S80L	CTR TUNNEL UNDER CONSOLE														
S90	CTR TUNNEL UNDER CONSOLE								816						
V40	CTR TUNNEL UNDER CONSOLE								816 Euro						
V60	CTR TUNNEL UNDER CONSOLE		799							500/830					
V70	CTR TUNNEL UNDER CONSOLE				799										
V90	CTR TUNNEL UNDER CONSOLE	Old Volvo DV Law Enf only call Volvo							816						
XC40	CTR TUNNEL UNDER CONSOLE									500/830					
XC60	CTR TUNNEL UNDER CONSOLE				799					816					
XC70	CTR TUNNEL UNDER CONSOLE				799										
XC90	CTR TUNNEL UNDER CONSOLE							816							

Volvo EDR Evolution

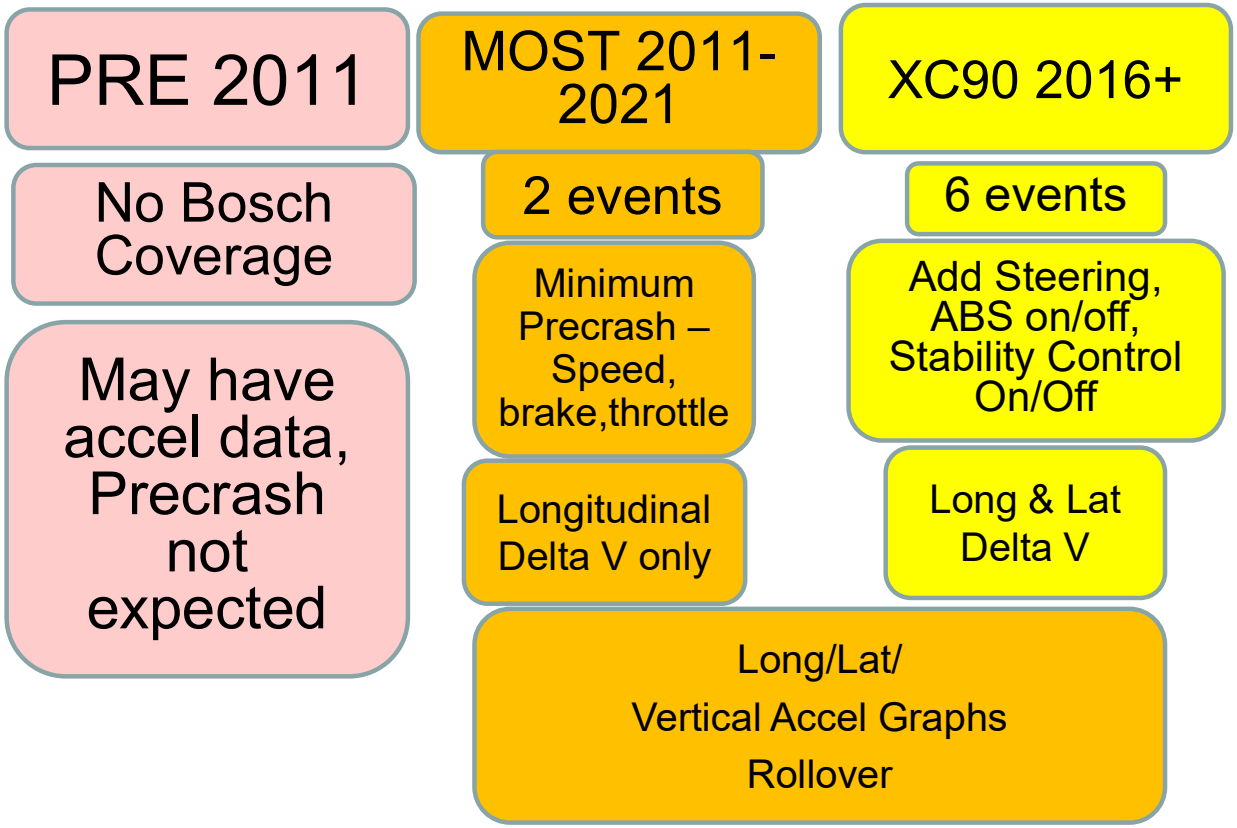

Volvo will only read in run mode, not accessory mode

Volvo anomalies observed

- Side curtain airbags deploy when frontal airbags deploy
- In 2-event crashes, time between events is always 0, data element appears to be not functioning
- Many times precrash is the same for both events, so we assume crashes are <0.5 sec apart
- (May be in all models, but the above was noticed in 2013-2016 60 series files)

2016+ XC90 Sample Volvo File

(vs. 2013 Volvo with minimum data)

Pre-Crash Data -1 Sec (Event Record 1)

Ignition Cycle, Crash	2,764
Safety Belt Status, Driver	On, Belted
Safety Belt Status, Passenger	On, Belted
Frontal Airbag Warning Lamp	Off
Frontal Airbag Suppression Switch Status, Front Passenger	On
Seat Track Position Switch, Foremost, Status, Driver	Not Equipped
Seat Track Position Switch, Foremost, Status, Front Passenger	Not Equipped
Occupant Size Right Front Passenger Child	Not Equipped

2020 still not added to other models

Added Data for XC90

Pre-Crash -5 to 0 sec (Event Record 1)

Time (sec)	Speed, Vehicle Indicated (MPH [km/h])	Accelerator Pedal, % Full (%)	Service Brake (On, Off)	Steering input (%)	ABS Activity	Stability control status
-5.0	43.5 [70.0]	100.0	Off	0.0	Off	On
-4.5	47.8 [77.0]	100.0	Off	0.0	Off	On
-4.0	52.2 [84.0]	100.0	Off	2.0	Off	On
-3.5	55.9 [90.0]	100.0	Off	3.0	Off	On
-3.0	58.4 [94.0]	100.0	Off	3.0	Off	On
-2.5	61.5 [99.0]	100.0	Off	11.0	Off	Engaged
-2.0	62.8 [101.0]	100.0	Off	6.0	Off	Engaged
-1.5	65.2 [105.0]	100.0	Off	-9.0	Off	Engaged
-1.0	67.1 [108.0]	100.0	Off	-8.0	Off	Engaged
-0.5	69.6 [112.0]	100.0	Off	-9.0	Off	Engaged
0.0	70.2 [113.0]	100.0	Off	-13.0	Off	Engaged

2016+ XC90 Sample Volvo File

2021 still not added to other models

System Status at Retrieval

Vehicle Identification Number	YV1LF
Application Diagnostic Database Part Number	31387255 AL
Ignition Cycle, Download	2,765
Lifetime Operating Timer (sec)	2,154,311

System Status at Event (Event Record 1)

Data Area Status, Event Record 1	Locked, Data Stored
Data Area Read Status, Event Record 1	Data Not Read
Complete File Recorded (Yes/No)	Yes
Multi-Event, Number of Events (1,2)	Event Number 1
Time from Preceding Event (sec)	Written but No Data Available
Maximum Delta-V, Longitudinal (MPH [km/h])	< -62 [-100]
Time, Maximum Delta-V, Longitudinal (msec)	100
Maximum Delta-V, Lateral (MPH [km/h])	-19.9 [-32.0]
Time, Maximum Delta-V, Lateral (msec)	>300

Clipped Value (at Max)

Not present in 2013, Added for XC90


[redacted]



1. Bosch CDR software 21.1 includes significantly expanded Mitsubishi coverage. Mi
2. The only models not officially covered are 2021+ Outlander Sport and pre-2013 that may be spoofable as Dodge Calibers .
3. The original Mitsubishi proprietary tool ($7,000) is not needed for any vehicles. Software has not been updated for years.
4. Early Mitsubishi readouts had some incomplete files retrieved (no useful data retrieved). CDR coverage is not

Mitsubishi EDR Coverage – Most Worldwide

Most now supported by CDR, some not

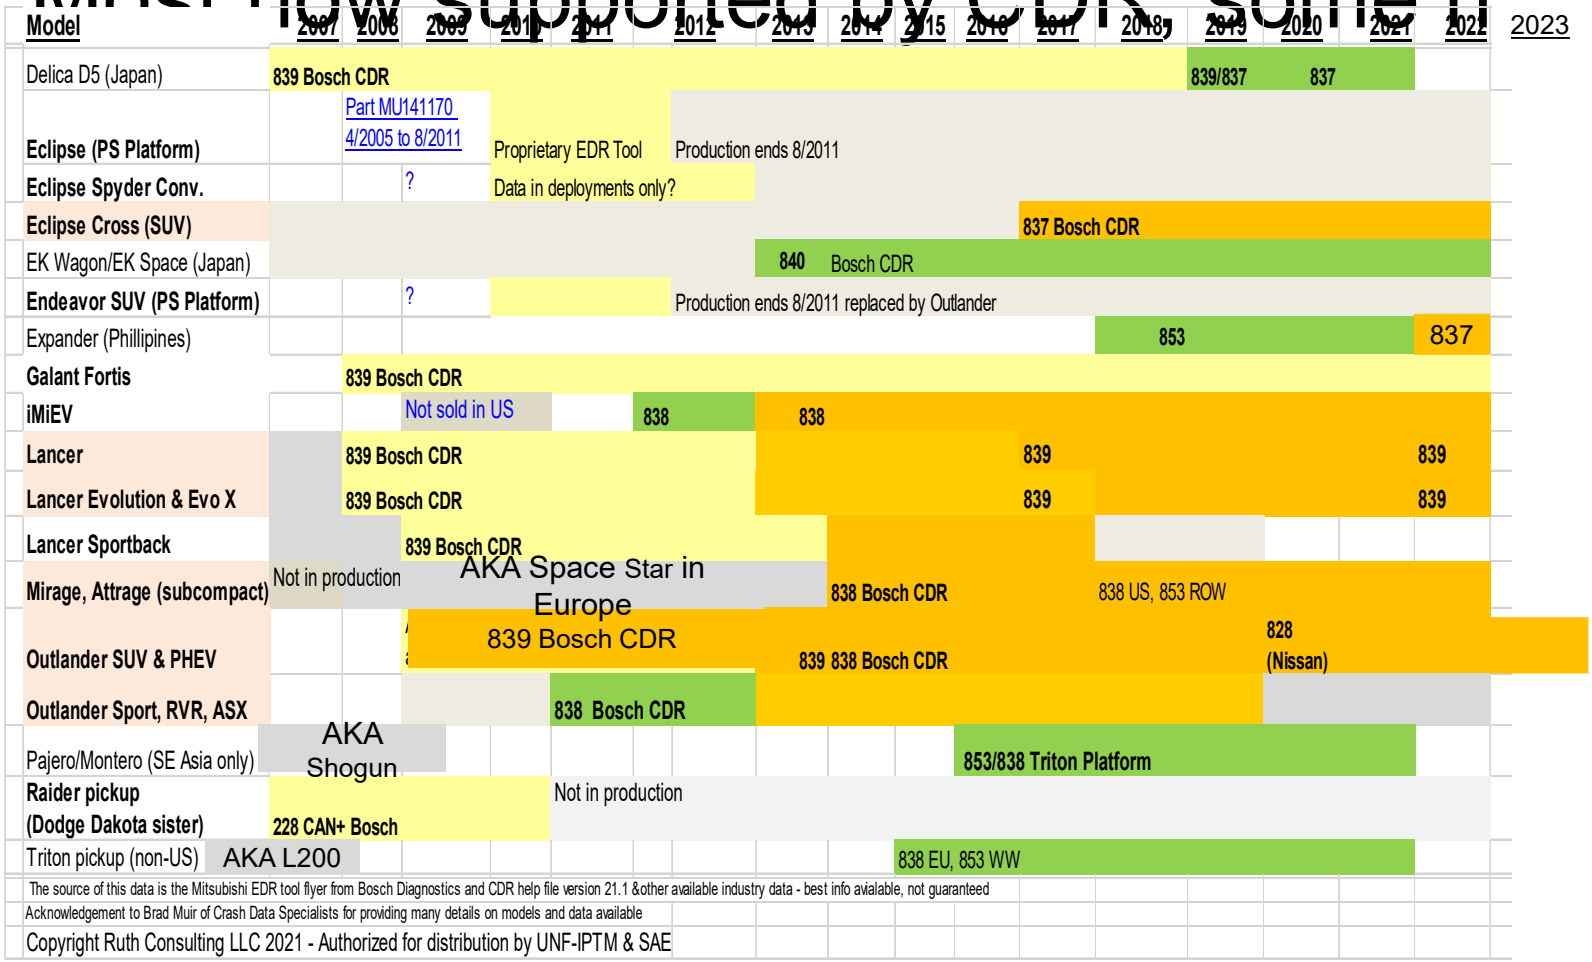

Jaguar/Land Rover

- ACM's must be sent to the supplier Veoneer in France or Bosch in Budapest, Hungary.
- If ACM is not in hand yet, contact Jag/LR to learn who the supplier is. They will give you contact info for supplier.
- Euro suppliers charge higher prices – Bosch as high as $4500
- Some Bosch ACM's have little useful data – ask what you will get before committing to pay!

Newly published research

1. Every year at the SAE World Congress in April new research is presented.
2. A very brief summary follows, I encourage you to read these papers.
3. Other good sources of EDR info include Collision Magazine

https://www.collisionmagazine.com/article-index/

& Accident Reconstruction Journal.

SAE WCX 2023 EDR Session

- **2023-01-0628 Data Collection for Incident Response for Vehicles with Autonomous Systems**

HVEDR Papers

- 2023-01-0009 **Examination of Detroit Assurance® 4.0 Video Radar Decision Unit (VRDU) Records for Use in Crash Analysis**
- **2023-01-0010 Testing of Heavy Truck Advanced Driver Assistance Systems and Crash Mitigation Systems**
- **2023-01-0011 An Evaluation of the Performance of the WABCO OnGuard ACTIVE Collision Mitigation System in a 2019 Freightliner M2 106**
- **2023-01-0012 Examination of Bendix® Data Recording (BDR) Records for Use in Crash Analysis**

SAE 2024 EDR papers release 4/7/24

Time	Paper No.	Title
1:30 P.M.	2024-01-2889	**Simulation of Vehicle Speed Sensor Data for use in Heavy Vehicle Event Data Recorder Testing** *Matthew C. DiSogra, Charles Getz, Amit Patel, DELTA |v| Forensic Engineering; Wesley Grimes, Mecanica Scientific Svcs Corporation; David Plant, D P Plant & Associates; Greg Wilcoxson, Wilcoxson Consulting LLC*
2:00 P.M.	2024-01-2893	**An Evaluation of the Performance of the Bendix® Wingman® Fusion™ Collision Mitigation System in a 2017 Kenworth T680** *Shawn Harrington, Nicholas Martin, Forensic Rock; Peter Leiss, Robson Forensic Inc*
2:30 P.M.	2024-01-2890	**Accuracy of Late Model EDR's in IIHS crash tests** *Richard Ruth, Ruth Consulting LLC; Charles King, J.S. Held LLC; Andrew Rich, Rich Consulting LLC; Hamed Sadrnia, Timothy D. Brown & Associates*
3:00 P.M.		**BREAK**
3:30 P.M.	2024-01-2888	**Analysis of the Event Data Recorder (EDR) Function of a GM Active Safety Control Module (EOCM3 LC)** *Cleve Bare, Red Hawk Reconstruction LLC; Jason Skiera, Brian Smyth, Exponent Inc.; Tommy Beetham, Donald Floyd, Winston Koo, Devin Newell, General Motors LLC*
4:00 P.M.	2024-01-2892	**Comparing Event Recorder Data (EDR) in Front/Rear Collisions from the Crash Investigation Sampling System (CISS) Database** *Ryan Fix, Craig Wilkinson, Gunter P. Siegmund, MEA Forensic Engineers & Scientists*
4:30 P.M.	2024-01-2891	**Study on a method for reconstructing pre-crash situations using data of an event data recorder and a dashboard camera** *Hideki Matsumura, Institute for Traffic Accident Research (ITARDA)/NTSEL; Motoki Sugiyama, Takekazu IWATA, Institute for Traffic Accident Research (ITARDA)*

Appeal for Files

- Manufacturers keep coming out with new generations of EDR's
- The way I keep up is asking my network of former students and conference attendees to send me files from new vehicles
- PLEASE SEND Rick Ruth FILES FROM 2023/2024 MY VEHICLES rick@ruthconsulting.com
- If you don't de-identify them, Rick will
- Helpful if I know which way they turned to check polarity of steering, yaw, lat accel

SAE WCX EDR related papers 4-08-25

Paper No.	Title
2025-01-8712	Examination of the Data Structures of the Bendix Data Recorder
	Matthew DiSogra, Delta |v| Forensic Engineering; Jeffrey Hirsch, Drive Forensics; Adam Yeakley, Delta |v| Forensic Engineering
2025-01-8713	The Effects of Collision-Related Power Loss on Toyota Safety Sense 2.5+ Event Data
	Charles Getz, Matthew DiSogra, Heath Spivey, Taylor Johnson, Amit Patel, Delta |v| Forensic Engineering
2025-01-8714	Analysis of the Event Data Recorder vehicle system data of a GM Vehicle Intelligence Platform Airbag Control Module (SDM50)
	Brian Smyth, Charles L Crosby, Ryan Bickhaus, James Smith, Exponent Inc; Dustin Edmunds, Donald Floyd, Vipul Modi, RaShawndra D. Outlaw, Jeff Wright, General Motors LLC
2025-01-8703	Decelerations for vehicles with anti-lock brake systems (ABS) during wet-to-dry transitions on asphalt and concrete road surfaces.
	Ian Miller, David King, Gunter Siegmund, MEA Forensic Engineers & Scientists