
The house on its site · the site and services plan

Site option Z4 | shift (0.91, 6.073) m, rotation 0° | the first floor stands on the same outline | 250 mm outer / 200 mm inner walls | V9.1: the final site position, B1 6.00 m from M1 (the owner's car test); the site plan `studies/site_plan.typ` and the whole farm `studies/whole_farm.typ` (the existing buildings approximate, to be measured)

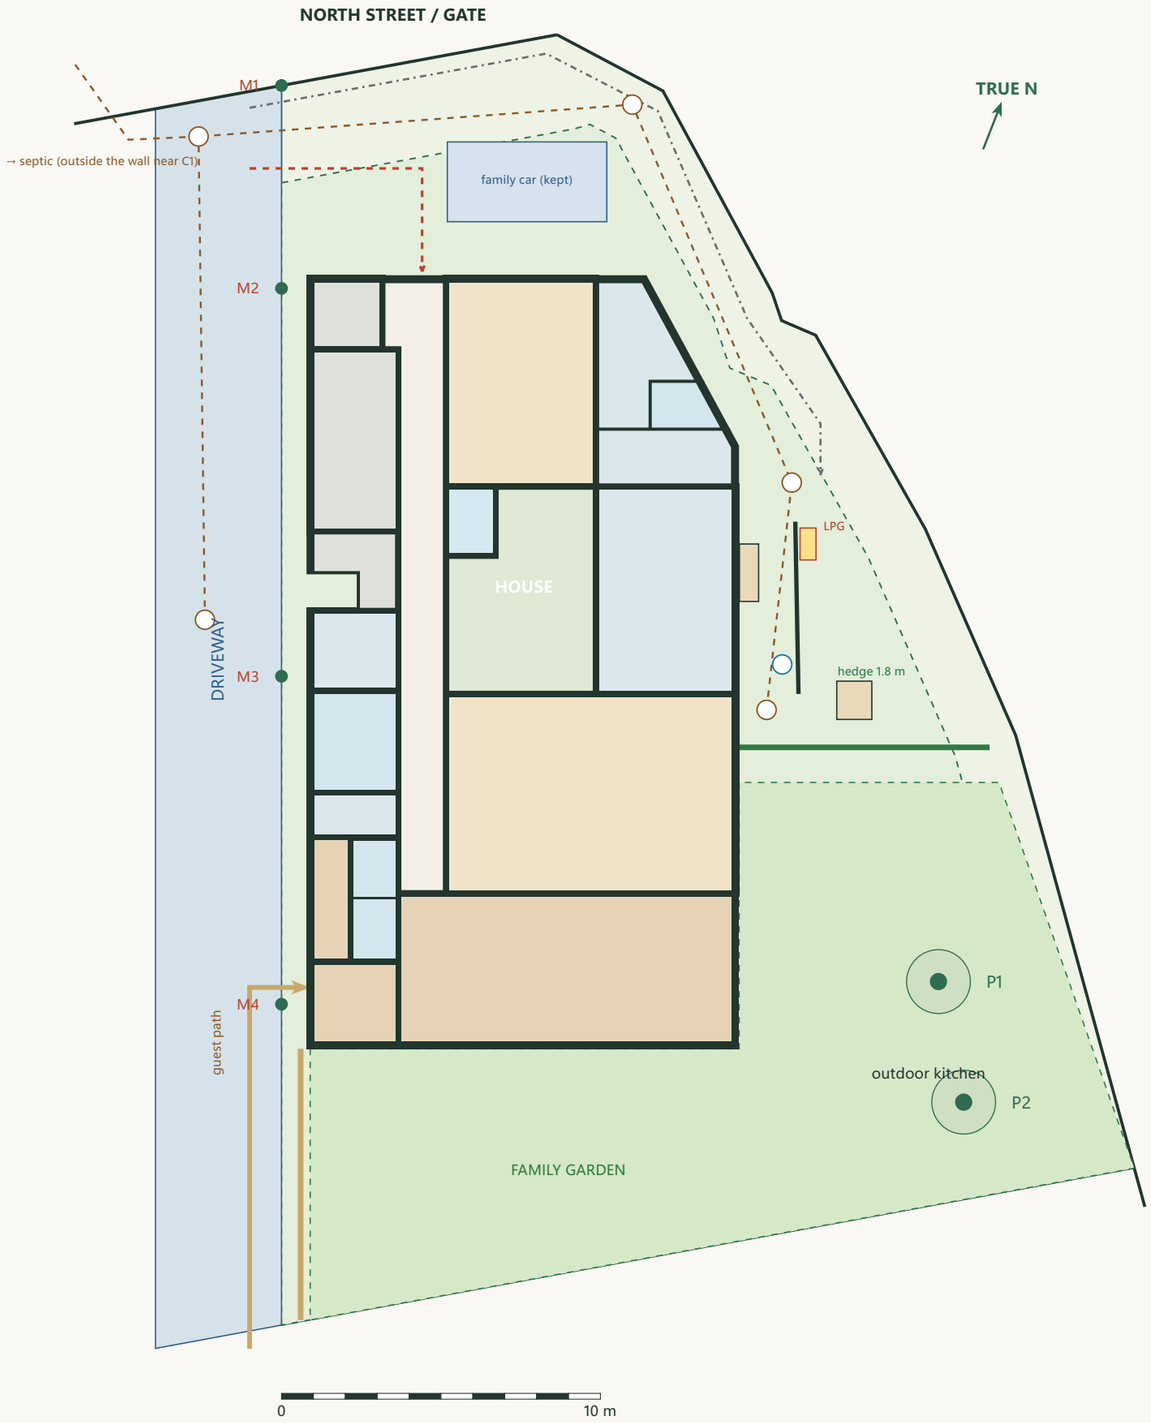

321.11 m² outside footprint (incl. courtyard)	**279.64 m²** ground floor rooms (axes)	**222.7 m²** first floor rooms (axes)
4.5 × 6.3 m courtyard, clear · sky 3.15 m axes above	**55.6 m²** master suite (indoors)	**0.785 m** west face to the M line (both floors)
0.91 / 0.42 m nearest wall face to the setback: deed line / wall as built (field 2.30 m)	**5.99 / 7 m** palms P1 / P2 to the outer walls	**3.6 m** floor to floor (to confirm)

The house. A compact courtyard house on site option Z4: a pentagon 13.311 × 24 m on wall centre lines, its north-east corner cut parallel to the lane, square to the M line and pushed as far north as the setbacks allow. The courtyard is the cool heart; the rooms look in, not out. A west service band and an east service block frame the middle band (women's majlis, courtyard, double-height living); the men's majlis takes the full width on the south.

First floor. The family part on the north and west around the courtyard; the south wing (V8.0): the gym on the west, a large suite court open to the sky, the owner's office on the east (reached from the court only), and the master suite. The gallery runs on a 1.55 m projection over the courtyard and the double-height void, on an edge beam and 3 columns.

Roof access (V8.1): a maintenance ladder in a recess of the gym's east wall in the suite court, behind a locked walnut panel; the internal stair stops at the first floor; office visitors are met in the men's majlis. One entry to the site: the farm's 4 m main gate.

Site position (V9.1, final): set out on site (day 1, the diagonals exact); then, after the owner's car test (a full forward turn from the gate into the north strip), B1 exactly 6.00 m from M1; the cut wall shortened again (6.08 m): 0.91 m from the deed setback, 0.42 m from the wall as built (field 2.30 m; the official survey confirms). The levels (the floor, the plinth, the entrance steps or ramps, the garden, the sewer falls) are set from the survey. **The farm (owner; approximate, to be measured):** the old house with its majlis west of the driveway, its covered parking and the ground tank south of it near peg R, the septic outside the north wall near C1 serving both houses.

Site plan (a study): one 4 m gate; one family car in the north strip (one forward turn from the gate, drawn on the site plan); the guest path (porcelain, V10.0) along the driveway; the service yard reached along the farm's wall; the family garden on the south only; rain separate; PV without a generator.

المنزل

منزل فناء مدمج على خيار الموقع Z4: مخمس 13.311 × 24 م على محاور الجدران، ركنه الشمالي الشرقي مقطوع موازيا للزقاق، متعامد مع خط M ومدفوع شمالا قدر ما تسمح الارتدادات. الفناء هو القلب البارد، والغرف تطل إلى الداخل لا إلى الخارج.

الدور الأول

جزء العائلة شمالا وغربا حول الفناء، والجناح الجنوبي (V8.0): النادي غربا وفناء الجناح الكبير المفتوح للسماء ومكتب المالك شرقا، ثم جناح النوم الرئيسي. الممر العلوي على بروز 1.55 م فوق الفناء والصالة، على جسر حافة و3 أعمدة.

الوصول إلى السطح (V8.1)


سلم صيانة في تجويف بجدار النادي داخل فناء الجناح خلف لوح خشبي مقفل؛ الدرج الداخلي يتوقف عند الدور الأول؛ زوار المكتب يُستقبلون في مجلس الرجال. مدخل واحد للموقع: البوابة الرئيسية للمزرعة بعرض 4 م.

موضع البيت والمزرعة (V9.1)

وُقّع البيت في الموقع ثم أُزيح جنوبا حتى صار الركن B1 على 6.00 م من M1 (تجربة سيارة المالك: دوران كامل إلى الشريط الشمالي دون مناورة) وقُصّر جدار القطع مرة أخرى: الهامش 0.91 م من خط الصك و0.42 م من الجدار القائم. المناسيب تُحدَّد من الرفع المساحي الرسمي. البيت القديم غرب الممر، ومظلته والخزان جنوبه، وخزان الصرف قرب C1 للبيتين (تقريبي، يقاس). بوابة واحدة؛ ممر الضيوف؛ حديقة العائلة جنوبا.

Ground floor

Room numbers G.. | dark squares = the 3 columns, orange dashed = the first-floor edge beam above (a colonnade along the courtyard) | doors and windows outside the two studied blocks are indicative

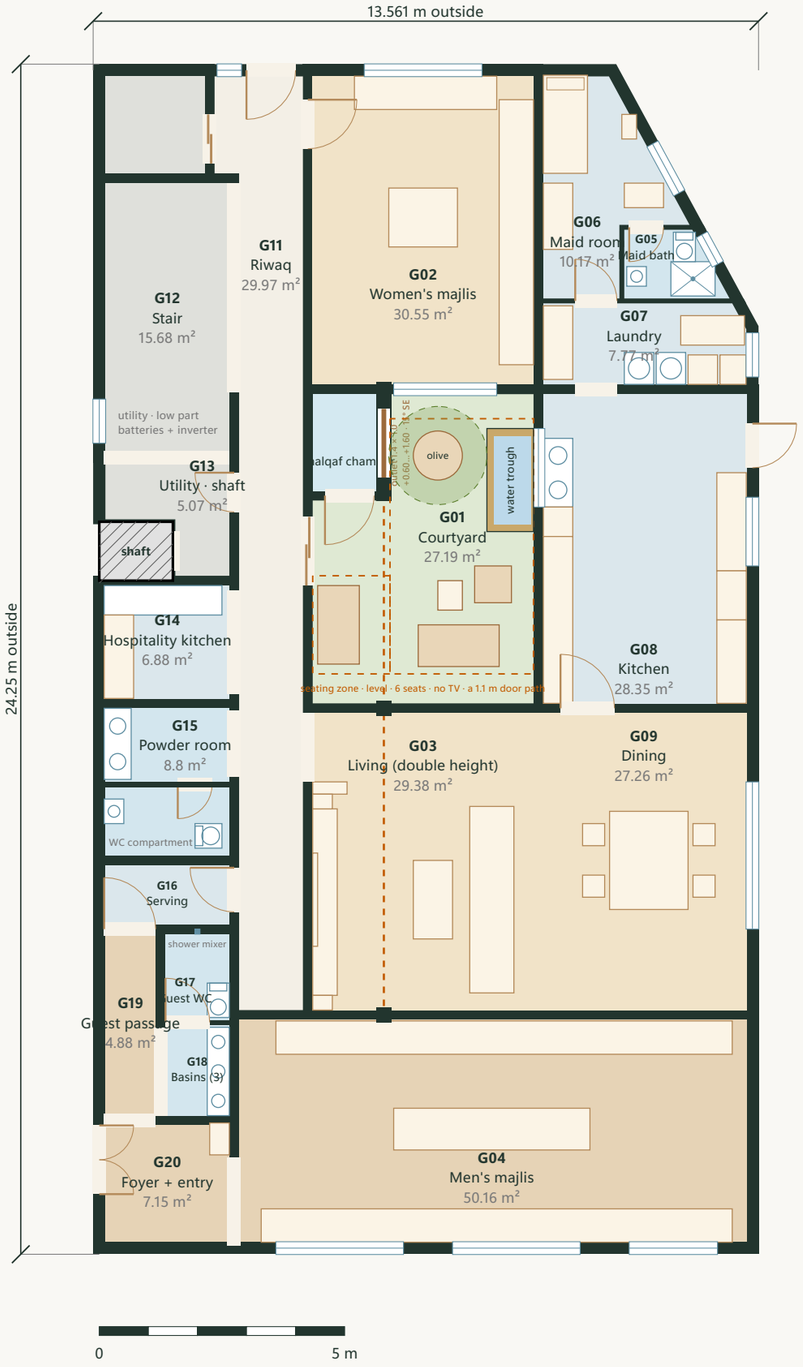

TRUE N

Middle band: the women's majlis 4.7 × 6.5 m, the courtyard (an L-shape round the malqaf chamber, 27.19 m² on axes, its wide part 4.5 × 6.3 m clear, open to the sky) and the living room in two heights: double height on the courtyard, normal height with the dining to the east. The living is entered from the riwaq through a 1.4 m arched opening; its west wall is solid and full height with the arched TV niche (V6.3).

Straight walls (owner, 11 Nov 2026): no jogs between rooms unless structural; the riwaq's line and the laundry / kitchen wall straightened. **West band (the owner's review, 10 Nov 2026):** the lift (installed at construction), the open stair (flipped, V8.2, the coat cupboard in its start strip); **one utility room with one door from the riwaq**: the west service **shaft** (x 0–1.5, y 9.2–10.4, unchanged; its maintenance door with 0.9 m clear in front), the panel, the heater and the manifold on the walls, and the **low part under the stair's half landing** (1.65 m) for the future batteries and inverter (the wall between them opened: a note for the engineer; the store's door removed); then the west wash block (sheet 06): the **family powder room** redrawn, **open to the riwaq (a 1.35 m opening, no door)**: **two basins under a large mirror** straight ahead, the **WC compartment across the full width** at the far end (only the WC and one basin, the only door, seen from the riwaq only obliquely); the guest side two rectangles side by side onto the guest passage: the **guest WC** (1.5 × 1.9, its door from the basins room as before; only the WC and a shower mixer on the wall) and next to it the **three guest basins in one straight row** with a mirror (1.5 × 2.0, a 1.8 m opening); all drains into the west run. The riwaq 2 × 19.25 m runs along the courtyard.

East block (sheet 06; **the maid's wing re-planned, layout D, owner 10 Nov 2026, `studies/maid_wing.typ` adopted**): from the kitchen the **laundry** across the whole width (1.8 m deep: **its kitchen wall on the structural line y 6.5, in line with the majlis wall**; the machines on the kitchen wall, the table on the majlis wall), then the **maid bath** on the south part of the cut wall, 1.5 m deep, a simple wet room (a wall-mounted shower over a floor drain, no tray, no cubicle; the WC under its own window; a basin; the drains straight out; door only from her room), then the **maid room** north of it (the bed in the north corner with its head on the north wall, the wardrobe on the majlis wall, the shelf wedge in the north tip, a small desk under the escape casement on the cut's north part; one door from the laundry); no store. **The malqaf (V10.0, L5):** its chamber ("malqaf chamber" on the plan) at the courtyard's north-west corner inside the covered strip, with the **courtyard outlet** (raised, H2) in the first arcade arch and a carved door onto the strip; the shaft and the head above it. **Men's majlis** 10.56 × 4.75 m, entered only from the guest foyer. No east duct. **Colonnade:** 3 columns on x 5.8 under the first-floor edge beam, in the women's majlis south wall, the courtyard / living glass and the living's south wall, with a three-arch arcade in the courtyard bay (V7.1).

Courtyard (H2, owner 11 Nov 2026): level, **no TV**; **outlet → olive → water:** the malqaf outlet raised (+0.60…+1.60, louvres fixed 15° SE), the **olive in a fixed pot in the jet's path**, the **trough** under the sink window; **6 seats with backs** facing the olive and the water, the zone extended under the projection with a 1.1 m path from the riwaq door. **Winter sun-seat: the suite court (sheet 03). Outside (V8.3):** the outdoor counter and sink next to the kitchen service door (canopy optional), the grill and tannour a little apart in the yard's south part (≥ 3 m from every opening, downwind); the yard screen, the gas cabinet at its north end, the bins north of the door.

الوسط: مجلس النساء والفناء والصالة

الفناء على شكل L حول غرفة الملقف (27.19 م² على المحاور، وجزؤه الواسع 4.5 × 6.3 م صافيا) مفتوح للسماء. الصالة بسقفين: ارتفاع مزدوج على الفناء وارتفاع عادي مع الطعام شرقا، وتُدخل من الرواق عبر فتحة مقوسة 1.4 م؛ جدارها الغربي مصمت كامل الارتفاع مع كوة التلفاز المقوسة (V6.3).

الشريط الغربي والرواق

المصعد والدرج المفتوح (معكوس الاتجاه في V8.2: الجزء السفلي يصعد جنوبا من الردهة خلف درابزين أسود، ودولاب المعاطف في النصف الغربي من شريط البداية)، ثم (مراجعة المالك 10 نوفمبر 2026) غرفة خدمات واحدة بباب واحد من الرواق: الشفت الغربي بحجمه ومكانه (بابه وأمامه 0.9 م)، واللوحة والسخان والمجمّع على الجدران، والجزء المنخفض تحت بسطة الدرج للبطاريات والعاكس مستقبلا (يُفتح الجدار بينهما، ملاحظة للمهندس، ويُلغى باب المخزن). وفي كتلة المغاسل (أعيد رسمها): مغاسل العائلة مفتوحة على الرواق بفتحة 1.35 م بلا باب، وحجرة المرحاض بكامل العرض (مرحاض ومغسلة واحدة، بابها الوحيد لا يُرى من الرواق إلا بزاوية) ومغسلتان بمرآة أمام المدخل؛ وللضيوف مستطيلان متجاوران على الممر: دورة مياه (مرحاض وخلاط دش على الجدار، بابها من المغاسل) وبجوارها ثلاث مغاسل في صف مستقيم خلف فتحة واسعة. الرواق 2 × 19.25 م على طول الفناء.

الكتلة الشرقية ومجلس الرجال

المطبخ ثم الغسيل بكامل العرض (بعمق 1.8 م على خط جدار المجلس)، ثم حمام الخادمة على الجزء الجنوبي من الجدار المائل بعمق 1.5 م، بسيط (دش معلق على الجدار فوق مصرف أرضي، بلا حوض ولا كابينة؛ المرحاض تحت نافذته؛ مغسلة؛ الصرف مباشر؛ الباب من غرفتها فقط)، ثم غرفتها شمالا (السرير في الزاوية الشمالية ورأسه على الجدار الشمالي، الدولاب على جدار المجلس، الرفوف في الزاوية الضيقة، ومكتب تحت نافذة الهروب)، بلا مخزن (التخطيط D، قرار المالك 10 نوفمبر 2026، اللوحة 06)؛ وغرفة الملقف (V10.0) في الركن الشمالي الغربي للفناء وفتحتها على الفناء في أول قوس. مجلس الرجال 10.56 × 4.75 م لا يدخل إلا من بهو الضيوف. لا شفت شرقي.

الأعمدة والرواق


3 أعمدة على 5.8 x (في جدار مجلس النساء الجنوبي، وبين زجاج الفناء والصالة، وفي جدار الصالة الجنوبي) تحمل جسر حافة البروز في الدور الأول (الخط البرتقالي المتقطع)، فيصبح على حافة الفناء رواق بأعمدة وثلاثة أقواس.

الفناء (معدل V8.3)

أرضية مستوية بلا تلفاز؛ **H2 (قرار المالك 11 نوفمبر 2026): الملقف ← الزيتونة ← الماء:** المخرج مرفوع (+0.60…+1.60، شيش ثابت 15° نحو الجنوب الشرقي)، والزيتونة في أصيص ثابت في مسار النسيم، والحوض تحت نافذة المغسلة؛ ستة مقاعد بظهر تواجه الزيتونة والماء، والجلسة ممتدة تحت البروز مع ممر 1.1 م من باب الرواق؛ زجاج الصالة ثابت؛ مقعد شمس الشتاء في فناء الجناح (اللوحة 03).

First floor

Room numbers F.. | west projection 1.55 m over the courtyard and the void, edge beam (orange dashed) on 3 columns | hatched = open below / to the sky | furniture from the two first-floor studies

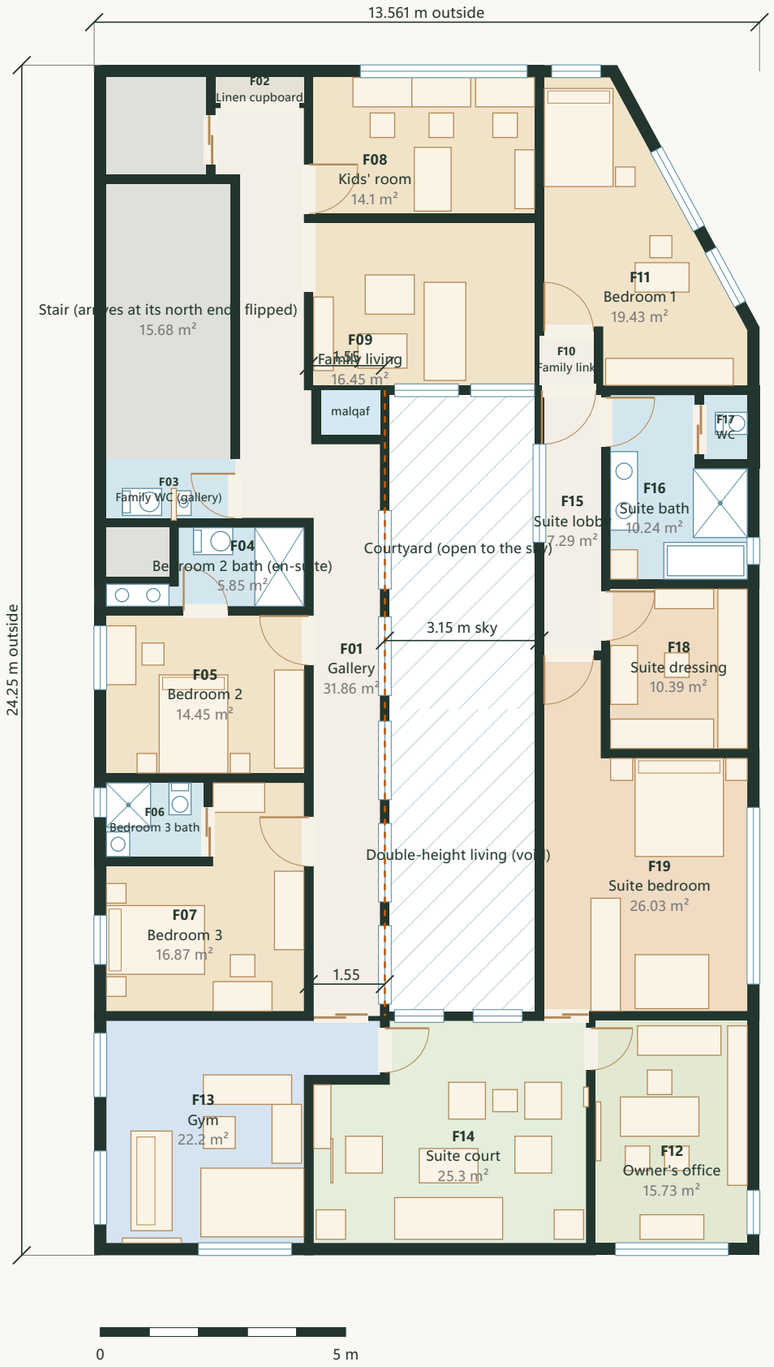

TRUE N

West projection: 1.55 m over the courtyard and the double-height void, on an edge beam on x 5.8 and 3 columns; the first-floor west wall stands on the GF west wall. Gallery 1.55 m (≈ 1.42 m clear), west rooms 4.25 m (≈ 4.025 m clear), courtyard sky 3.15 m (≈ 2.95 m clear).

North band: kids' room 14.1 m² and family living 16.45 m² on the courtyard edge; bedroom 1 19.43 m², the young children's room next to the master suite (no en-suite: they are bathed in the suite's bathroom; owner, V9.0).

West band: the family WC (WC + basin) off the gallery, bedroom 2 with its en-suite, bedroom 3 with its own bath; every door from the gallery.

South wing v2 (V8.0): the gym on the west band 22.2 m² (the treadmill with its manufacturer zone), the suite court 25.3 m² open to the sky from the gym to the office — **the family's winter sun room (owner, 10 Nov 2026, the courtyard haven study): two armchairs with backs and a small table in the court's middle band north part (x 7.0–9.5, y 20.6–21.4, out of the doors' strip: ≈ 2 h of direct January sun on the north strip and ≈ 3 h through the mashrabiya), a socket pair and a wall light by the office door; the mashrabiya's middle panels made to open in winter (hinged or sliding, closing tight in dust; non-structural)** — the owner's office 15.73 m² on the east (no door to the bedroom; reached from the court only); master suite 55.6 m².

البروز الغربي والممر العلوي

بروز 1.55 م فوق الفناء وفراغ الصالة على جسر حافة على 5.8 x و3 أعمدة، والجدار الغربي للدور الأول فوق الجدار الغربي للأرضي. الممر 1.55 م (نحو 1.42 م صافي)، والغرف 4.25 م (نحو 4.025 م صافي)، والسماء فوق الفناء 3.15 م.

الشريط الشمالي

غرفة الأطفال 14.1 م² وجلسة العائلة 16.45 م² على حافة الفناء، وغرفة النوم 1 19.43 م² للأطفال الصغار بجوار الجناح (بلا حمام خاص: يستحمون في حمام الجناح).

الشريط الغربي

دورة مياه العائلة (مرحاض ومغسلة) من الممر، وغرفة النوم 2 مع حمامها، وغرفة النوم 3 مع حمامها؛ كل الأبواب من الممر ولا باب على بسطة الدرج.

الجنوب والشرق

النادي غربا 22.2 م²، وفناء الجناح 25.3 م² المفتوح للسماء من النادي إلى المكتب (غرفة شمس الشتاء للعائلة، قرار المالك 10 نوفمبر 2026: كرسيان بظهر وطاولة صغيرة في وسطه الشمالي خارج شريط الأبواب، مقبس وإضاءة جدارية عند باب المكتب، وألواح المشربية الوسطى تُفتح شتاءً وتُغلق بإحكام في الغبار)، ومكتب المالك شرقا 15.73 م² بلا باب إلى غرفة النوم (يُدخل إليه من فناء الجناح فقط)، وجناح النوم الرئيسي 55.6 م² بمدخل من وصلة العائلة.

First floor / the family part

Kids' room, family living, bedrooms 1–3, family bath, gallery on the west projection | furnished test from studies/ff_family.typ



Kids' room 4.7 × 3 m: two study desks and a PC desk under the north window, a gaming corner; solid door from the gallery. **Family living** 4.7 × 3.5 m on the courtyard edge: a view, not a path.

Bedroom 2 4.25 × 3.4 m with its own bath beside the shaft (3 Nov 2026; the family WC next to it, from the gallery); **bedroom 3** 16.87 m² with its own bath 2.2 × 1.7 m over the GF family WC; **bedroom 1** 19.43 m², one room without a bath.

Bedroom 2's bath 4.25 × 1.8 m and the **family WC** 2.75 × 1.3 m by the west shaft (3 Nov 2026: the F-b bath split; every fixture on one service wall into the shaft), the family WC's door from the gallery, for bedroom 1, the family living and the kids' room.

غرفة الأطفال: دراسة وألعاب

4.7 × 3 م: مكتبا دراسة ومكتب كمبيوتر تحت النافذة الشمالية وركن ألعاب، وباب مصمت من الممر. يمكن أن تصبح غرفة نوم رابعة لاحقا.

جلسة العائلة

4.7 × 3.5 م = 16.45 م² على حافة الفناء: إطلالة لا ممر، والطريق إلى جناح الوالدين خلف الكنبة.

غرف النوم

النوم 2: 4.25 × 3.4 م بتجويف دولاب بجانب الشفت. النوم 3: 16.87 م² مع حمام خاص 2.2 × 1.7 م فوق دورة العائلة. النوم 1: 19.43 م² غرفة واحدة بلا حمام.

حمام العائلة

حمام غرفة النوم 2 4.25 × 1.8 م ودورة المياه العائلية 2.75 × 1.3 م بجوار الشفت الغربي (3 نوفمبر 2026)، وباب دورة المياه من الممر.

التخزين

دولاب البياضات في نهاية الممر الشمالية (2 × 0.7 م). الدواليب المدمجة صناديق نجارة مثبتة بين الجدارين.

First floor / the south wing and the master suite

South wing v2 (owner, V8.0): the gym on the west band, the suite court from the gym to the office, the office on the east | furnished test from studies/ff_suite.typ | orange = the treadmill's clear zones, red = the double wall to bedroom 3 | the three court doors on a 1.2 m strip



Master suite 55.6 m² (unchanged): a lobby from the family link opens to the bath, the dressing and the bedroom (the bed is not seen from the suite door). Luxury bath 11.89 m²; walk-in dressing 3.01 × 3.45 m; bedroom 26.03 m². **No door to the office.** Its court door (sliding glass) opens onto an entry zone formed by a full-height wardrobe: the sight-line test (doors open, from the gym and office doors and from the court seating) keeps the bed out of view.

Suite court 25.3 m² on axes (≈ 23.1 m² clear), open to the sky, from the gym to the office: the three court doors (bedroom, gym, office) on a 1.2 m strip along its north edge, the seating (a sofa, two armchairs, a table, plants) in the south part; the floor falls south to a box gutter with an overflow, linear drains at the near-flush doors. Its south side is the facade frame: a 1.10 m base under R8, the cornice and the parapet; the infill is the owner's choice (a mashrabiya screen recommended). The clerestory windows of the living get the winter noon sun on 100 % of their height.

Gym 22.2 m² on the west band (inside the column frame), with an entrance nib at the gallery end: the treadmill along the length on the stiff 2.75 m bay (0.5 m clear each side, 2 m behind), a power rack, kettlebells, a bike, the pilates mat, a fixed TV; windows west and south; a double wall to bedroom 3 (Rw ≈ 55 dB).

Owner's office 3.31 × 4.75 m (east): for the owner only, reached from the suite court (bedroom → court → office; the family gym → court → office); visitors are met in the men's majlis; a simple door, an east window, a fixed TV.

Roof ladder (V8.1): a manufactured vertical ladder in a 0.90 × 0.30 recess of a rendered pilaster on the gym's east wall (north end, off the door strip and the seating), behind a locked walnut-finish panel; 3.70 m to the gym roof, the stiles 1.10 m above it, a self-closing gate in the court guard (`studies/roof.typ` page 2).

جناح النوم الرئيسي · 55.6 م²

كما هو: ردهة من وصلة العائلة إلى الحمام والملابس والنوم. لا باب بين غرفة النوم والمكتب. باب الفناء الزجاجي المنزلق يفتح على منطقة دخول يكوّنها دولاب كامل الارتفاع، فلا يُرى السرير من باب النادي أو المكتب أو من جلسة الفناء والأبواب مفتوحة.

فناء الجناح

25.3 م² مفتوح للسماء من النادي إلى المكتب: الأبواب الثلاثة على ممر بعرض 1.2 م في طرفه الشمالي والجلسة في الجنوب، والأرضية تميل جنوبا إلى مزراب مع فائض، ومصارف خطية أمام الأبواب شبه المستوية. جهته الجنوبية إطار الواجهة بجدار سفلي 1.10 م، والحشوة اختيار المالك (المشربية مقترحة).

النادي


22.2 م² في الشريط الغربي ضمن إطار الأعمدة، بمدخل من نهاية الممر: جهاز المشي بطول الغرفة على البلاطة الصلبة، ورف الأثقال والكيتل بل والدراجة وبساط البيلاتس وتلفاز ثابت؛ جدار مزدوج مع غرفة النوم 3.

مكتب المالك

شرقا للمالك فقط، يُدخل إليه من فناء الجناح؛ الزوار في مجلس الرجال؛ باب بسيط ونافذة شرقية وتلفاز ثابت. سلم الصيانة إلى السطح في تجويف بجدار النادي خلف لوح خشبي مقفل.

Ground floor / the west wash block and the east service block

Room studies studies/guest_wing.typ and studies/east_wing.typ | doors, fixtures and walls as studied

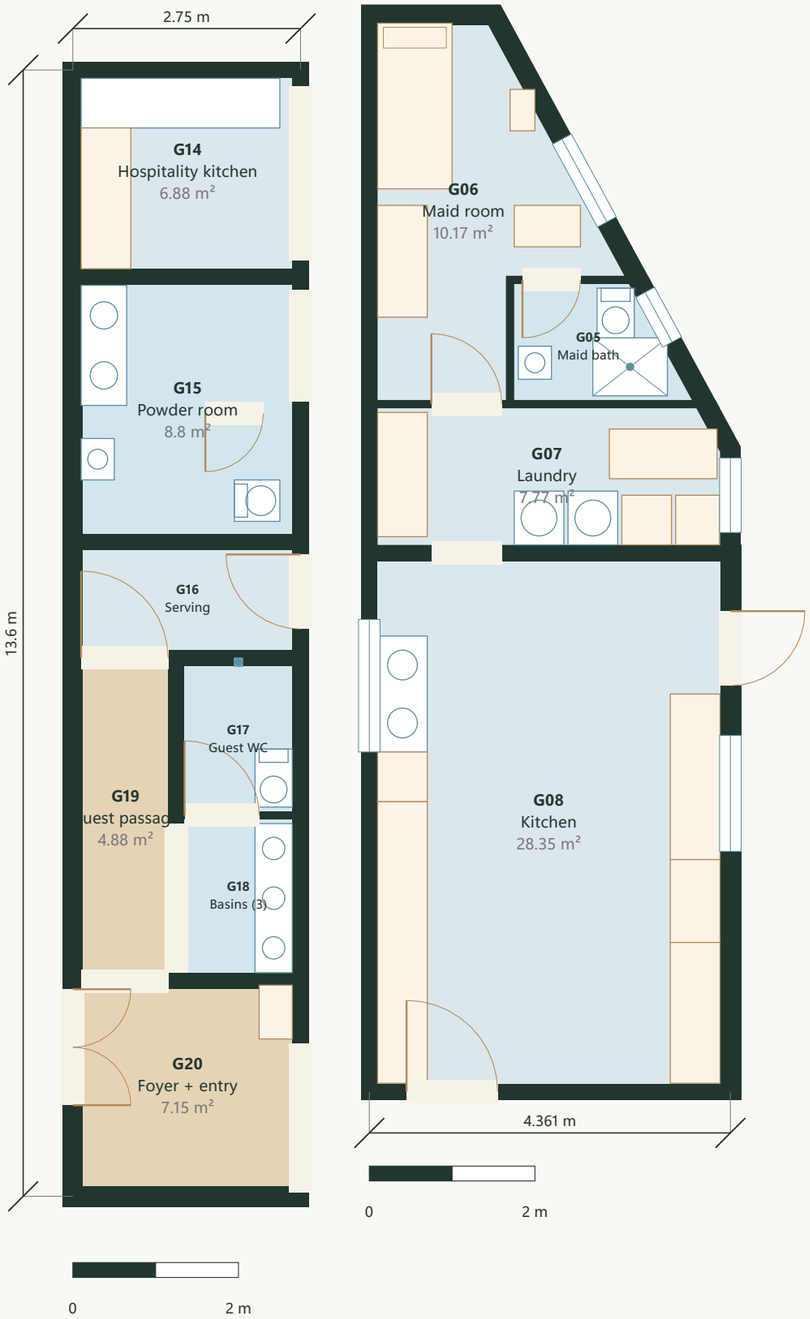

West wash block (2.75 × 13.6 m): one strip of wet rooms on one drain run. Family side, open to the riwaq: hospitality kitchen 2.75 × 2.5 m (a light kitchen for coffee, tea, dates and desserts); the family powder room 2.75 × 3.2 m (3 Nov 2026: the basins and the WC as one luxurious room with a door from the riwaq; no shower on the ground floor).

The **serving passage** 2.75 × 1.4 m (2.53 × 1.2 m clear) is the only family / guest link: door 1 (0.9 m) from the riwaq and door 2 (1.05 m) from the guest side are never open together and both lock from the family side.

Guest side (owner, 11 Nov 2026): the guest WC with its 0.90 door from the basins room, back on its south wall as before the redraw (inside only the WC and a shower mixer on the wall: no shower zone, no floor marking), and next to it the three basins in one row, open to the guest passage through a 1.8 m opening; the guest passage and the foyer with a 1.4 m double door and a 1.8 m opening into the men's majlis (a bent entry, partial).

East service block: kitchen 4.36 × 6.5 m on the courtyard lines (two parallel runs, no island, door to the dining only); the sink under its courtyard window (y 7.3–8.9, V8.0) with the dishwasher south of it, the outdoor TV on the other face of the wall further south; the maid's wing re-planned (layout D, owner 10 Nov 2026, `studies/maid_wing.typ` adopted): the laundry 7.77 m² across the whole width, then the maid bath 2.94 m² on the south part of the cut wall (its own window, door only from her room), then the maid room 10.17 m² in the north (an escape casement on the cut's north part, sill +1.10), reached only through the kitchen and the laundry; no store. **The malqaf (V10.0, L5)** is no longer in this block: its core stands at the courtyard's north-west corner (the breeze outlet in the first arch, the filtered supply fan in the foot chamber, the head 1.6 × 2.4 on the roof).

كتلة المغاسل الغربية

خط واحد من الغرف الرطبة على خط صرف واحد. جهة العائلة مفتوحة على الرواق: مطبخ الضيافة 2.75 × 2.5 م للقهوة والشاي والتمر والحلى، ومغاسل العائلة، ودورة العائلة.

ممر التقديم

2.75 × 1.4 م (2.53 × 1.2 م صافي) هو الصلة الوحيدة بين العائلة والضيوف: الباب 1 (0.9 م) من الرواق والباب 2 (1.05 م) من جهة الضيوف لا يفتحان معا ويقفلان من جهة العائلة.

جهة الضيوف

دورة الضيوف بابها من غرفة المغاسل كما كان (قرار المالك 11 نوفمبر 2026؛ داخلها المرحاض وخلاط دش على الجدار فقط، بلا منطقة دش)، وبجوارها ثلاث مغاسل في صف مفتوحة على الممر بفتحة 1.8 م، وممر الضيوف، والبهو بباب مزدوج 1.4 م وفتحة 1.8 م إلى المجلس (مدخل منكسر جزئي).


الكتلة الشرقية

المطبخ 4.36 × 6.5 م على خطوط الفناء بخطي خزائن وبلا جزيرة وبابه إلى الطعام فقط، والحوض تحت نافذته على الفناء (7.3–8.9 y) وغسالة الصحون جنوبه؛ والغسيل 4.36 × 1.8 م على جدار مجلس النساء المصمت، وغرفة الخادمة 10.17 م² بنافذة هروب وحمامها 2.94 م² في الركن المائل؛ والملقف (V10.0) انتقل إلى الركن الشمالي الغربي للفناء: غرفة قاعدته داخل الممر المسقوف، وفتحة النسيم في أول قوس من الرواق مقابل الجلسة، ورأسه 1.6 × 2.4 م فوق السطح.


Sections / the west projection and the light

Schematic sections, levels to confirm: GF ±0.00 · FF +3.60 · roof +7.20 | the column on x 5.8 is beyond the cut | the light figures are geometry only

A · east–west through the courtyard (y 12.0), looking north

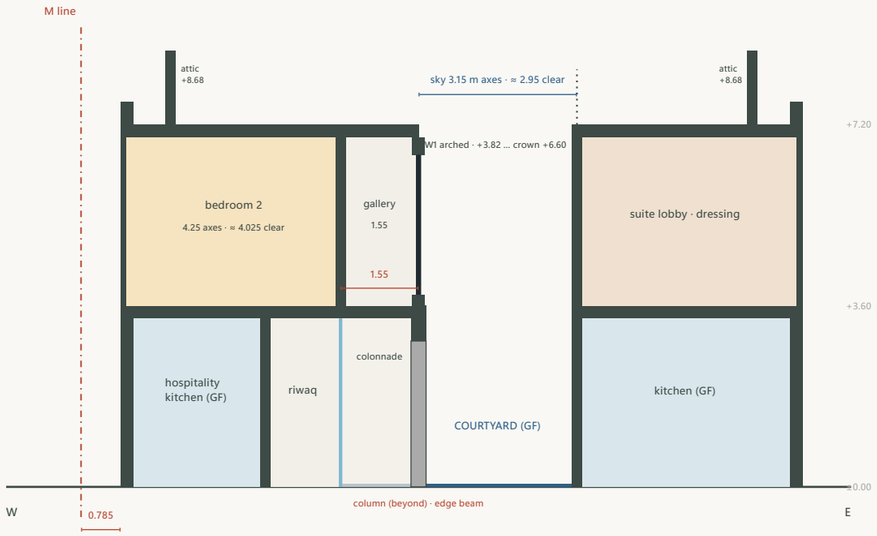

B · north–south through the middle band (x ≈ 7.3), looking west · the light check

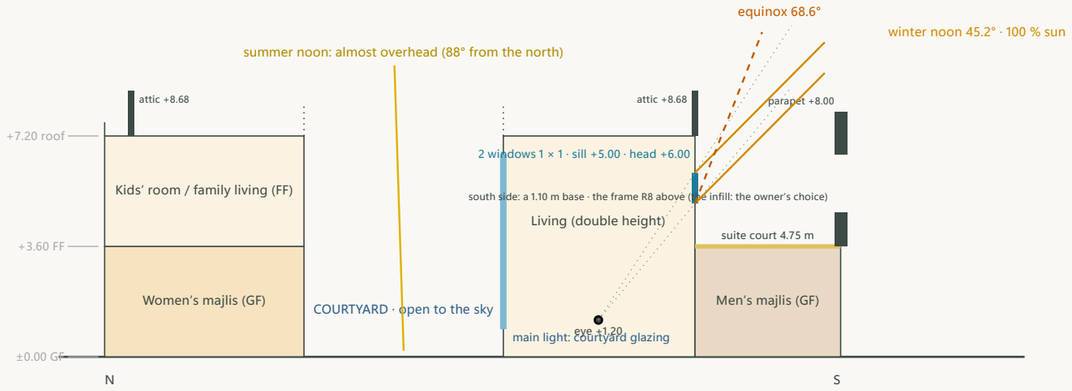

Behind the 4.75 m suite court	Winter noon sun on the windows	Equinox noon sun	Sky seen from the eye
the south facade frame with its parapet (top +8.00) · **V8.0, south wing v2**	100 %	100 %	100 %
the same frame without a parapet (solid top +7.20)	100 %	100 %	100 %

A · west projection: the gallery stands on a 1.55 m slab over the courtyard, carried by an edge beam on x 5.8 (spans 6.5 and 6.25 m) on 3 columns: on the ground floor a colonnade along the courtyard, with a normal-height ceiling under the projection. The first-floor west wall stands on the ground-floor west wall, 0.785 m from the M line. Courtyard sky 3.15 m on axes (≈ 2.95 m clear).

B · light: the main light of the double-height living comes from the courtyard; its 2 clerestory windows face the suite court, which since V8.0 (south wing v2) runs 4.75 m to the south facade. Over the facade's parapet the winter noon sun reaches 100 % of the window height and the sky shows on 100 % (V7.1, behind the 2.0 m court: 81 %).

المقطع A · البروز الغربي

يقوم الممر على بلاطة 1.55 م فوق الفناء يحملها جسر حافة على 5.8 x فوق 3 أعمدة، فيصبح في الأرضي رواق بأعمدة على حافة الفناء بسقف عادي تحت البروز. الجدار الغربي للدور الأول فوق الجدار الغربي للأرضي على بعد 0.785 م من خط M. السماء فوق الفناء 3.15 م على المحاور.

المقطع B · الضوء

الضوء الرئيسي للصالة من زجاج الفناء. النوافذ العلوية (2) تطل على فناء الجناح الممتد 4.75 م حتى الواجهة الجنوبية (V8.0)، فتصل شمس ظهر الشتاء إلى 100 % من ارتفاع النافذة.

الخصوصية

جلسة النوافذ فوق مستوى النظر من أرضية فناء الجناح أو زجاج معتم.

Areas / room schedules

Axes = wall centre lines | clear = inside the walls as drawn (250 mm outer, 200 mm inner, 100 mm partitions, the steel windows on the courtyard edges), furniture and thresholds not deducted

Ground floor

No.	Space	Axis size	Axis area	≈ Clear
G01	Courtyard	polygon	27.19 m²	–
G02	Women's majlis	4.7 × 6.5 m	30.55 m²	28.24 m²
G03	Living (double height)	4.7 × 6.25 m	29.38 m²	27.83 m²
G04	Men's majlis	10.56 × 4.75 m	50.16 m²	46.77 m²
G05	Maid bath	polygon	2.94 m²	2.47 m²
G06	Maid room	polygon	10.17 m²	8.85 m²
G07	Laundry	polygon	7.77 m²	6.75 m²
G08	Kitchen	4.36 × 6.5 m	28.35 m²	26.06 m²
G09	Living (normal height) · dining	4.36 × 6.25 m	27.26 m²	25.63 m²
G10	Lift (shaft placeholder)	2.25 × 2.2 m	4.95 m²	4 m²
G11	Family lobby + riwaq	polygon	29.97 m²	25.72 m²
G12	Stair	2.75 × 5.7 m	15.68 m²	13.89 m²
G13	Utility room (shaft inside)	polygon	5.07 m²	4.17 m²
G14	Hospitality kitchen	2.75 × 2.5 m	6.88 m²	5.81 m²
G15	Family powder room (WC · 2 basins)	2.75 × 3.2 m	8.8 m²	7.58 m²
G16	Serving passage (2 doors)	2.75 × 1.4 m	3.85 m²	3.03 m²
G17	Guest WC	1.5 × 1.9 m	2.85 m²	2.27 m²
G18	Guest basins (trough · 3 taps)	1.5 × 2 m	3 m²	2.4 m²
G19	Guest passage	1.25 × 3.9 m	4.88 m²	3.79 m²
G20	Foyer + entry	2.75 × 2.6 m	7.15 m²	6 m²

The owner's review, 10 Nov 2026: G13 is one room with the low part under the stair's half landing (≈ 3.7 m² at 1.65 m headroom, counted in the stair's footprint G12) and one door; its polygon wraps round the west shaft (1.5 × 1.2 m, not counted). G15 redrawn (10 Nov 2026): the WC compartment across the full width (2.75 × 1.55) with only the WC and one basin; two basins outside. G17 1.5 × 1.9 with only the WC and a shower mixer on the wall, its door from the basins room (11 Nov 2026); G18 1.5 × 2.0 next to it, the three basins in one straight row behind a 1.8 m opening. **The maid's wing, layout D (`studies/maid_wing.typ`, adopted):** G07 the laundry across the whole width (y 4.7–6.5, 1.8 m deep since 11 Nov 2026: its kitchen wall on the structural line y 6.5, no jog with the majlis wall; the machines on the kitchen wall, the table on the majlis wall), G05 the maid bath on the cut wall's south part, 1.5 m deep, a simple wet room (refined 10 Nov 2026), G06 the maid room north of it (the bed in the north corner, the wardrobe on the majlis wall, the shelf wedge in the tip, the desk under the escape casement); G21 the store removed. The malqaf chamber (3.36 m² on axes) is not a room.

First floor

No.	Space	Axis size	Axis area	≈ Clear
F01	Upper gallery (on the west projection)	polygon	31.86 m²	27.84 m²
F02	Linen cupboard	2 × 0.7 m	1.4 m²	0.95 m²
F03	Family WC (gallery)	2.75 × 1.3 m	3.57 m²	3.15 m²
F04	Bedroom 2 bath (en-suite)	polygon	5.85 m²	4.67 m²
F05	Bedroom 2	4.25 × 3.4 m	14.45 m²	12.88 m²
F06	Bedroom 3 bath	2.2 × 1.7 m	3.74 m²	2.96 m²
F07	Bedroom 3	polygon	16.87 m²	15.02 m²
F08	Kids' room (study + gaming)	4.7 × 3 m	14.1 m²	12.49 m²
F09	Family living	4.7 × 3.5 m	16.45 m²	14.85 m²
F10	Family link	1.2 × 1.2 m	1.44 m²	1.1 m²
F11	Bedroom 1	polygon	19.43 m²	17.3 m²
F12	Owner's office	3.31 × 4.75 m	15.73 m²	13.96 m²
F13	Gym	polygon	22.2 m²	19.92 m²
F14	Suite court (open to the sky)	polygon	25.3 m²	–
F15	Suite lobby	1.35 × 5.4 m	7.29 m²	5.98 m²
F16	Suite bath	polygon	10.24 m²	8.84 m²
F17	Suite WC (closet)	1.1 × 1.5 m	1.65 m²	1.14 m²
F18	Suite dressing	3.01 × 3.45 m	10.39 m²	9.05 m²
F19	Suite bedroom	polygon	26.03 m²	23.6 m²

321.11 m²
outside footprint, incl. courtyard

27.19 m²
courtyard on axes (4.5 × 6.3 clear)

279.64 m²
ground floor rooms (axes)

222.7 m²
first floor rooms (axes), + suite court 25.3 m²


Decisions log

One line per key decision with its reason | from data/decisions.csv | the version is the one in which the decision was made

Ver.	Topic	Decision	Reason	القرار	السبب
V3.0	**Courtyard**	A small courtyard at the centre, enclosed on four sides, open to the sky	The rooms the family uses most look into it; shaded by its walls it stays cool, gives privacy and light from inside	فناء صغير في المنتصف، مغلق من الجهات الأربع ومفتوح للسماء؛ تظل عليه الغرف الأكثر استعمالاً، ويبقى بارداً مظللاً ويعطي الخصوصية والضوء من الداخل.
V3.0	**Living room**	One living room with two ceiling heights: double height on the courtyard, normal height (dining) to the east	The double-height hall continues the courtyard and works as a chimney; the low hall is warmer, easier to cool, and carries the first floor	صالة واحدة بسقفين: تصف بارتفاع مزدوج على الفناء وتعمل كمدخنة للتهوية، وتصف بارتفاع عادي للطعام يسهل تكييفه ويحمل الدور الأول.
V3.0	**West service band**	Family entrance, entry cupboard, future lift, stair, utility room with the shaft and the west wash block in one band	Services rise in one place, the structure gains one stiff core, every service is reachable	شريط خدمات غربي واحد: المدخل والصندوق المخصص للغاسق والدرج والمصعد المستقبلي والمرافق والحمام الشرقي في مكان واحد ونواة الإنشاء والخدمة.
V3.1	**West wash block**	Hospitality kitchen, family basins, family WC, guest WC and guest trough in one strip of wet rooms on one drain run	Short drains, one cleanout, the guest side separated from the family side	كتلة مغاسل واحدة بخط صرف واحد: مطبخ الضيافة ومغاسل العائلة وغرفة الضيوف والمصلحة الجوضية.
V3.1	**Serving passage**	The only family / guest link is a passage with two doors that are never open together, both locked from the family side	The family serves the men's majlis without being seen; an open guest door receives only a blank wall (majaz)	الصلة الوحيدة بين العائلة والضيوف ممر تقديم يفتحان لا يفتحان معاً ويقفلان من جهة العائلة؛ يُقدَّم للمجلس دون أن تُرى العائلة.
V3.3	**Hospitality kitchen**	A light kitchen open to the riwaq for coffee, tea, dates and desserts; the east kitchen is the heavy one	The serving base for the men's majlis sits next to the serving passage, away from the cooking smells	مطبخ ضيافة خفيف مفتوح على الرواق للقهوة والشاي والتمر والحلو؛ يجاور ممر التقديم والمطبخ الثقيل في الشرق، فلا تصل الروائح للقاعة.
V3.3	**Guest foyer**	A double door at one end of the foyer and the opening into the men's majlis at the other (a bent entry)	Guests do not look straight into the majlis; the majaz is partial in a short foyer (open item)	بهو الضيوف بباب مزدوج في طرف، وفتحة المجلس في الطرف الآخر (مدخل منكسر)؛ المجاز جزئي لقصر البهو.
V3.3	**Guest basins**	One trough basin with three taps on the east wall of the guest side	Several guests wash at once before and after the meal	مغسلة جوضية واحدة بثلاثة صنابير في جهة الضيوف لغسل عدة ضيوف معاً.
V3.1	**Men's majlis**	A full-width men's majlis on the south, entered via the foyer; high south windows, seating at the east end	Privacy for the family and the guests; light without being seen	مجلس رجال بعرض المبنى جنوباً لا يدخل إلا من البهو؛ نوافذ عالية جنوبية وجلسة وشبه رئيسية في الطرف الشرقي.
V3.1	**East service block**	Kitchen on the courtyard lines; laundry on the solid wall of the women's majlis; maid room and maid bath in the sloped corner	The kitchen stays isolated; the maid wing is reached only through the kitchen and the laundry	الكتلة الشرقية: المطبخ على خطوط الفناء، والغسيل على جدار مجلس النساء المصمت، وغرفة الخادمة وحمامها في الركن المائل، والوصول للخادمة من المطبخ فقط.
V4.0	**Maid room**	The maid room stays at about 8.85 m², clear; the 6.5 m² target is dropped	The sloped cut wall makes the north part too narrow; the freed space went to the maid bath	غرفة الخادمة نحو 8.85 م²، صافي وسقف هدف 6.5 م² لأن الجدار المائل يضيق الحيز الشمالي.
V3.4	**Air tower and tunnel**	An air tower on the tip of the cut corner catches the north-west wind above the roofs and feeds a tunnel to the courtyard	Cool, clean air without fans; it takes no usable room space; every opening can be closed	برج هواء في أبرز الركن المقطوع يلتقط الرياح الشمالية الغربية ويمرر هواءها فوق الأسطح إلى الفناء دون أن يأخذ من مساحة الغرف.
V3.3	**Future lift**	A lift shaft built now as a store, fitted later with a two-stop lift (ground and first floor)	The house is ready for old age without paying for a lift now; the roof is reached by stair	بئر مصعد يبنى الآن ويستعمل مخزناً، ويركّب لاحقاً مصعد بوقفتين (أرضي وأول).
V3.0	**Utility room and shaft**	The west service shaft sits inside a utility room with the electrical panel, the water manifold and the water heater	Every service is behind one door and can be maintained without breaking a wall	الشعب الغربي داخل غرفة خدمات مع اللوحة الكهربائية ومجمع المياه وسخان الماء؛ كل الخدمات خلف باب واحد.
V5.0	**Plumbing**	West: the shaft and one drain under the wash block; east: kitchen, laundry and maid bath straight out east; the suite bath to a stack outside the east wall; no east duct	Short runs, wet rooms stacked over wet rooms, nothing in a kitchen ceiling or over the master bedroom	الصرف: غرب، خلف كتلة الغسيل، وشرقاً للمطبخ والغسيل وحمام الخادمة إلى الخارج؛ وحمام الجناح الخاص فوق مثيله في الدور الرئيسية.
V5.0	**First-floor zoning**	Family part on the north and west around the courtyard; the L (office, gym, suite court, master suite) to the south and east	Children near the shared bath and the family living; the master suite private behind a lobby	توزيع الدور الأول: جناح العائلة شمالاً وغرباً حول الفناء، وجزء L جنوباً وشرقاً (المكتب والنادي وفناء الجناح وجناح الدور).
V6.1	**West projection on columns**	The first-floor west body on columns (area 1.55 m² each, 4 of 5 used); the ground and the double-height void, on an edge beam and three columns at x 5.8 (each in an existing wall or glass line, a colonnade on the ground floor); the split projection of V5.1 is reverted	A wall on cantilever beams along about 14.95 m costs more and is less direct structurally than walls stacked over walls, and the outward projection 0.11 m from the M line needed municipal approval; rooms and gallery keep their width, the courtyard sky is 3.15 m	كتلة غربية على أعمدة (مساحة كل عمود 1.55 م² وتستعمل 4 من 5)؛ الأرضي والفراغ المزدوج على عمود حافة و3 أعمدة عند x 5.8 (كل عمود في جدار قائم أو خط زجاج، وممر مظلل في الأرضي)؛ التقسيم المنفصل في V5.1 أُلغي.
V5.0	**Kids' room**	A kids' room for study and gaming on the north side	Homework and play in one room, away from the bedrooms; it can become a fourth bedroom	غرفة أطفال للدراسة واللعب في الشمال، يمكن أن تصبح غرفة نوم رابعة.
V5.0	**Family living**	The family living on the courtyard edge is a view, not a path	Nobody walks between the seats and the courtyard	جلسة العائلة على حافة الفناء، مُطلّة لا ممر.
V5.0	**Bedrooms**	Bedroom 1 one room without a bath; bedroom 2 with a wardrobe niche; bedroom 3 with its own bath over the ground-floor family WC; one family bath by the west shaft	Wet rooms stay on the shafts; every bedroom door opens from the gallery	غرف النوم: النوم 1 بلا حمام، والنوم 2 بخزينة ثوب، والنوم 3 بحمام خاص فوق دورة العائلة، وحمام عائلي بجوار الشفت.
V5.0	**Master suite**	Lobby, luxury bath with tub, walk-in shower, two basins and a WC closet, walk-in dressing and bedroom, entered from the family link	Privacy (the bed is not seen from the suite door) and the owner's programme	جناح النوم الرئيسي: ردهة، حمام فخم وغرفة ملابس وغرفة نوم، يدخل منكسر من وصلة العائلة.
V5.0	**Owner's office**	The owner's office in the south-west corner, door from the gym route	A quiet room away from the bedrooms, near the stair	مكتب المالك في الركن الجنوبي الغربي، بباب من ممر النادي.
V6.2	**L-shaped gym**	L-shaped gym: the long arm along the south facade (kettlebells, barbell, pilates mat, pull-up bar, one cardio machine) and a short arm at the east end turning north along the suite bedroom wall, holding only the treadmill (0.5 m clear each side, 2 m free behind in the long arm); the suite court becomes about 25.3 m²	The owner's choice: the treadmill gets its own arm. Acoustic separation is mandatory: a double wall to the suite bedroom (about 55 dB), a floating floor or dense rubber under the arm, anti-vibration pads, the treadmill 0.1 m off the wall	دار على شكل L (اختيار المالك): الذراع الطويلة على الواجهة الجنوبية للأثقال وبساط اليوغا، وعقلة الجر، وجهاز كارديو، وذراع قصيرة في الطرف الشرقي بمحاذاة جدار غرفة النوم الرئيسية لجهاز المشي فقط؛ مع عزل صوتي: جدار مزدوج نحو 55 ديسيبل) وأرضية عائمة أو مطاط كثيف، ووسائد ضد الاهتزاز، ومسرح المشي 0.1 م عن الجدار.
V6.2	**L-shaped gym**	With a ceiling about 100 % of the winter noon sun reaches the windows (a parapet would block it)	With a ceiling about 100 % of the winter noon sun reaches the windows (a parapet would block it)	مساحة الجناح الخاص المقوم للنصف أمام الواجهة الجنوبية الصالة، وتراوين لا تزيد على سطح الذي ليصل نحو 100 % من شمس الشتاء.
V6.2	**L-shaped gym**	Cleaner structure than a cantilevered roof strip; the colonnade reads through both storeys	The upper floor is 3.15 m above the finished floor; the ground floor is 4.65 m	الأعمدة الثلاثة على x 5.6 تستمر إلى السقف بدل خط الترابزين؛ سقف شريط الممر يرتكز عليها بكمرة ظرفية بدل كابولي 1.35 م؛ أعمدة دائرية نحيلة نحو 0.30 م (اقتراض). السبب: إنشاء أنظف.
V5.0	**Suite court and clerestory light**	A private court open to the sky in front of the double-height living's clerestory windows; a railing, not a parapet, on the gym roof edge	The court is the only place for a window in the suite bedroom wall; the gym roof is reached by stair	الكمرة 81 مغلقة ويخفيها سقف جبس عند نحو +3.05؛ القاعدة الكمرات المغلقة في الغرف المتصلة تخفي بأسقف جبس تحمل التكييف والإضاءة. السبب: سقف مسطح في كل غرفة.
V6.2	**Projection edge beam**	Option (b): the edge beam on x 5.6 upturned above the first-floor slab as the base of the gallery railing; (a) a drop beam is acceptable if the engineer decides	The upturned beam is the railing's base and hides the drop beam	الخيار (ب): الكمرة الطرفية على x 5.6 مرفوعة فوق بلاطة الدور الأول قاعدةً للدرابزين؛ الخيار (أ) المقاطعة مقبول إن قرره المهندس. السبب: سقف رئوي منظم.
V6.2	**Kitchen service door**	A lockable 0.90 m service door in the kitchen's east wall at its north end near the laundry (y 6.7–7.6) to the east service yard; the cooking counter starts 0.1 m south of it, the east-wall stack means the door and the kitchen window	Rubbish, deliveries and gas reach the yard without crossing the house	باب خدمة مقفل بعرض 0.90 م في الجدار الشرقي للمطبخ عند طرفه الشمالي قرب الغسيل (y 6.7–7.6) إلى فناء الخدمة الشرقي؛ سطح الطبخ يبدأ بعده بـ 0.1 م وتلتقي المأمورية سوداء مطبخ الباب والنافذة. السبب: الخدمة دون عبور البيت.
V6.2	**Air system simplified**	Dry malqaf for night ventilation (screen, filter slot, damper); a small dry sealed duct south under the maid wing to a low outlet grille in the courtyard's east wall (the kitchen's west wall) over the sunken seating's bench; the main ventilation by a calculated system (ERV, exhaust, AC) by the MEP engineer	No water in a dark underground duct; the closed rooms need filtered ducted supply; the outlet moved from the north wall to the east wall (3d-char2): the cool air settles where people sit, the women's majlis keeps its full glass	تبسيط نظام الهواء: ملقف جاف للتهوية الليل (شبكة، فلتر، بوابة إغلاق)، قناة صغيرة جافة محكمة جنوبا تحت جناح الخادمة إلى مخرج شبكي في جدار الفناء الشرقي (جدار المطبخ الغربي) فوق مقعد الجلسة المغارة؛ التهوية الرئيسية بنظام محسوب بمعدله مهندس الكهروميكانيك. السبب: لا ماء في قناة مظلمة؛ ينتظر الهواء الباردة سوداء مقفلة، وانتقل المخرج من الأرض إلى الجدار الشرقي لكي تظل هادئة.
V6.3	**TV wall**	The living's solid wall (x 4.25) is solid and full height; a 1.40 m arched entrance from the riwaq at its north end, then an arched built-in TV niche 4.40 × 0.70 m (TV 85" centred, low cabinet, side shelves, hidden LED); the sofa faces west, eye-to-screen = 3.45 m, the dining behind; no arches between the colonnade columns	The TV and the sound system need a solid wall; the riwaq no longer looks into the living, so the serving door 1 faces a blank wall	الجدار الشرقي للمعيشة (x 4.25) مصمت وبكامل الارتفاع؛ فتحة مقوسة 1.40 م للمدخل من الرواق في طرفه الشمالي، تليها تجويفة مقوسة للتلفاز 4.40 × 0.70 م (لقاز 85 بوصة في الوسط، خزانة منخفضة، رفوف جانبية)؛ الكنبة تواجه الغرب بمسافة نحو 3.45 م إلى الشاشة والطعام خلفها؛ لا أقواس بين أعمدة الرواق. السبب: التلفاز ونظام الصوت يحتاجان جداراً مصمتاً ولم يعد الرواق يطل على الصالة.
V6.3	**Lift at construction**	The lift (two stops, ground and first floor) is installed before the family moves in, no longer a future store; sliding landing doors from the family lobby and the gallery; the entry cupboard (every 0–0.9 and the strip in front of the lift door is lobby; the shaft 2.25 × 2.2 stays a placeholder unfill a supplier's civil drawing is chosen	Ageing in place is very important and every bedroom and shower is on the first floor	المصعد (وقت) الإنشاء (مصعد، مصعدان) قبل السكن وليس مخزناً مستقبلياً؛ أبواب منزلقة من البهو العائلي ومن ممر العرض؛ تعتبر خزانة المدخل 0–0.9 م وبصمة الشريط أمام باب المصعد جزءا من البهو؛ فتحة المصعد 2.25 × 2.2 تبقى حاجزا مؤقتا إلى أن يختار المورد رسم الإنشاء.
V6.3	**Door widths**	Every bedroom and bathroom door on both floors is a 1.00 m opening with a 0.90 m leaf (≥ 0.85 m clear); two cannot: the guest WC takes a 0.90 m opening (the room is 1.3 m wide) and the maid bath keeps 0.70 m (column C31 and the cut wall) until the maid wing is redesigned; the suite WC closet door opens out into the bath; bedroom 3's door moves to y 15.2–16.2 and its bath door is sliding	Wheelchairs, walkers and furniture pass; a stated requirement of ageing in place	كل أبواب غرف النوم والحمامات في الدورين فتحات 1.00 م بضفة 0.90 م (صافي 0.85 م على الأقل)؛ استثناءان: دورة مياه الضيوف 0.90 م (عرض الغرفة 1.3 م) وحمام الخادمة يبقى 0.70 م حتى إعادة تصميم جناح الخادمة؛ باب مضمورة مرحاض الجناح يفتح إلى الحمام. السبب: مرور الكراسي المتحركة والمشايات والأثاث.
V6.3	**Suite bath window (X3)**	The suite bath's east window is 0.55 m wide at y 9.50–10.05, so its frame clears column C33 (assumed 0.25 × 0.60 along the wall, y 10.15–10.75) by 0.05 m; the window stays over the tub	No clash with the column whatever size the engineer chooses up to 0.60 m along the wall	نافذة حمام الجناح الشرقي بعرض 0.55 م عند 9.50–10.05 ص y، يحميها بنحو لطيف عن العمود C33 (0.60 × 0.25 م بطول الجدار) بمقدار 0.05 م. السبب: لا تعارض مع العمود مهما كان مقاسه حتى 0.60 م.
V6.3	**House 0.30 m south (provisional)**	The whole house moves 0.30 m south on the site (shift 3.525 → 3.825): the nearest outer wall face is now 0.20 m from the lane setback line (it governs; the north street line is 0.80 m away) instead of 0.05 m; provisional until the official survey; the south garden is 0.30 m shallower (7.2 m at the middle of the south facade), the palms 5.99 / 7.84 m from the walls	A survey error of a few centimetres would have put the wall in the setback; to reach 0.35 m on the lane the house needs 0.63 m south, or 0.30 m south and 0.17 m west	يُزاح البيت كله 0.30 م جنوبا في الموقع (القرب رجعة جدار يبعد الآن 0.20 م عن خط ارتداد الزقاق (وهو الحاكم؛ خط الشارع الشمالي على 0.80 م) بدل 0.05 م؛ مؤقت حتى الرفع المساحي الرسمي؛ الحديقة الجنوبية أقل عمقا بـ 0.30 م والنخلتان على 5.99 / 7.84 م. السبب: خطأ مساحي بسنتيمترات كان سيضع الجدار في الارتداد.
V6.4	**Courtyard enclosure (option A)**	The municipal rule for a domestic worker's room (≥ 6.5 m² clear, x 2.1 m wide; design review G-04); the structural grid and the first-floor walls are untouched	The municipal rule for a domestic worker's room (≥ 6.5 m² clear, x 2.1 m wide; design review G-04); the structural grid and the first-floor walls are untouched	يتراجع جدار الفناء الشرقي 0.50 م جنوبا إلى 7.0 م، كما تتقلص غرفة الخادمة إلى 7.28 م²، مساحي بعرض 2.49 م، عند السرير والمغسلة إلى نحو 6.2 م²؛ يبقى المطبخ بصفين متوازيين (نحو 24 م²، مساعي) ويُنقل باب الخدمة وسطح الطبخ والشفاط مع الجدار. السبب: الشرائط البلدية لغرفة العاملة المنزلية (6.5 م²، و2.1 م على الأقل).
V6.4	**Roof access**	The conditioned house is closed around the courtyard, which stays open to the sky: the west projection widens 0.20 m to 1.55 m (B3, R11 and C21–C23 at x 5.80, spans and X8 unchanged); black steel divided-lite windows W1 on the gallery edge (on the B3 upstand, guarding transom +4.70, laminated glass below, four inward casements), W2 on the family living's edge (two casements) and W3 on the living's upper courtyard side at y 13.0 (two motorised tilt lites), heads at +6.75	A closed, filtered house (R-25; design review Y-01, critical) with the gallery's edge ≥ 1.20 m clear (1.225 m at the columns, 1.405 m elsewhere) and the sky opening 3.15 m wide; one line for the beam, the columns and the window (studies/courtyard_enclosure.typ)	يُغلق البيت المكيف حول الفناء الذي يبقى مفتوحا للسماء: يتسع البروز الغربي 0.20 م إلى 1.55 م (الجسر والأعمدة على x 5.80 وبقية الأبعاد كما هي)؛ نوافذ السجر الطويلة على رفع المجلس، ونوافذ الغرفة العائلية، وفناء البوار العلوي عند 13.0 ص بعرض 3.15 م. السبب: بيت مغلق ومفلتر مع حد أدنى للممر 1.20 م وصافي وفتحة سماء 3.15 م.
V6.4	**Roof access**	The main stair continues from the first floor to the roof in the same well with the same geometry (two more flights, 11 risers each, trimmers R16–R18 as B16–R18) into a stair room on the well (2.525 × 5.50 inside, 2.20 m clear, roof +9.62) with a door to the roof; the lift stops at the first floor (its headroom 3.40 m to the roof slab underside); the roof is for maintenance and equipment only	Review F-07: no roof access existed; the roof carries the plant, the malqaf hatch, the tank and the PV, and must be reached safely without a ladder; nothing on the first floor is lost	يستمر الدرج الرئيسي من الدور الأول إلى السطح في البئر نفسه وبالهندسة نفسها (شوطان إضافيان في غرفة درج فوق البئر (2.525 × 5.50 داخليا؛ ارتفاع صاف 2.20 م) يؤدي إلى السطح؛ المصعد يقف في الدور الأول؛ السطح للصيانة والمعدات فقط. السبب: لم يكن للسطح مدخل، وعليه المعدات والمدار، والطاقة الشمسية.
V6.4	**Roofline (attic and cornice)**	Flat roof, no tiles. A main honey-stone cornice 0.45 m high projecting 0.30 m on the facade edge at roof level all round; on the north block a cream-plastered attic screen 1.8 m high (coping +9.10) set back 1.0 m behind the cornice (its 0.30 m coped upstand at +7.65), hiding the stair room and the roof equipment from the street and the lane at the boundary (the stair room shows 0.6 m above the attic only from more than = 15 m); the south wing keeps the cornice and a plain parapet to +8.40, a 0.70 m step in the roofline; a thin stone band between the floors; no slab level changes	The classical roofline of the design language kept simple; the roof equipment and the stair room hidden from the public eye; the courtyard loses no sky or sun (the attic lies below the sky hole's own edges from every point of the courtyard floor)	سطح منظر بلا قرميد؛ كورنيش رئيسي من الحجر العسلي على حافة الواجهة عند السطح حول البيت كله؛ على الكتلة الشمالية حاجز سطح (عليّة) بارتفاع 1.8 م مرتد 1.0 م خلف الكورنيش يخفي غرفة الدرج والمعدات؛ الجناح الجنوبي يبقى بالكورنيش ودرابزين معتمد 1.1 م؛ فيتدرج عند السطح شريط حجري رفيع بين الدورين. السبب: لغة التصميم الكلاسيكية المبدلة وإخفاء المعدات.
V7.1	**Arched enclosure windows**	The design language (Roman arches, black steel divided lites); the courtyard reads as a two-tier classical arcade with the arcade below	The design language (Roman arches, black steel divided lites); the courtyard reads as a two-tier classical arcade with the arcade below	تُلبد نوافذ إغلاق الفناء وتزود بسقف زنك (رومانية) من القوائل الأسود المثبتة ست نوافذ مقوسة عرض 1.60 م على حافة الممر العلوي فوق أقواس الرواق، ونافذتان 1.30 م على حافة المعيشة العليا، ونافذة كبيرة واحدة 2.80 م فوق زجاج الصالة على أن 0.15 م تحت صور حافة السطح.
V7.1	**Courtyard arcade**	In the courtyard bay only (between C21 and C22) two slender honey-stone columns Ø0.25 on x 5.80 at y 8.667 and 10.833 give three equal bays of 2.167 m with three semicircular arches under the projection (spans 1.84 / 1.92 / 1.84 m, springing +2.31 … +2.35, crown at the soffit +3.27); decorative unless the engineer uses the columns; the W1 arched windows above align with the three bays; the living bay keeps no arches	A two-tier classical arcade round the courtyard (the design language); the columns tame a direct tunnel vault (a pergola)	في جهة الفناء فقط عمودان رشيقان من الحجر العسلي قطر 0.25 م على خط بلاطة الرواق 5.80 م يقسمانه إلى ثلاث فتحات متساوية بثلاثة أقواس نصف دائرية تحت البروز (زخرفية ما لم يستعملها المهندس)؛ النوافذ المقوسة فوقها على محور الأقواس؛ جهة الصالة بلا أقواس.	
V8.0	**Fire safety: early warning and safe exit (home level)**	Home level: interconnected mains smoke alarms with battery back-up in every bedroom and on the routes, a heat alarm in the kitchen, CO and gas detectors, extinguishers and a fire blanket; escape casements without screens in every sleeping room (the maid room's at sill +1.10); exit doors with thumb-turns. Not adopted: sprinklers, fire doors, a panel, a safe room	Owner; studies/fire_escape.typ	على مستوى المنزل: إنذار مبكر مترابط ونوافذ هروب بلا شبك وأبواب خروج بلا مفاتيح؛ بلا رشاشات أو أبواب حريق.	
V8.0	**Courtyard layout**	The seating one step down (−0.15) from the colonnade edge to the kitchen wall with three benches and a low table; the outdoor TV in a semicircular stone surround on the kitchen wall; the malqaf grille below it; the north enclosure with a water basin and one tree; no pergola; the drainage section	Owner; studies/courtyard_layout.typ		
V8.0	**Kitchen sink window moved north**	Moved north to y 7.3–8.9 (1.6 m, sill +1.10) over the sink, the dishwasher south of it; the outdoor TV, its surround and the malqaf grille stay (0.65 m of wall to the frame)	It looks at the fountain and the tree; the TV wall stays solid	تنتقل نافذة الحوض شمالاً إلى 7.3–8.9 م (فاصل على الناقورة والشجرة) بعيني التلفاز وقتحة الملقف في مكانهما.	
V8.0	**Air system v3 (owner goals; proposals assumed, MEP to design)**	One tower, two separate paths: a gentle courtyard breeze in pleasant weather (not cooling) and the fresh-air intake of the ventilation unit; no water, pads, earth pipes or human entry (v1 / v2 withdrawn). Proposals: a four-sided head with flaps, a split shaft, a spring-return damper, a 0.9 × 0.20 channel in the gallery under the grille and a 0.9 × 0.20 channel in the gallery under the grille	Review E-01: a sealed house needs a real ventilation unit; the malqaf stays the symbol and the breeze	برج واحد بمسارين منفصلين: نسيم للجلسة ومدخل الهواء النقي لوحدة التهوية؛ لا ماء ولا دخول بشري. المقترحات افتراضية.	
V8.0	**Air system v3.1: open items decided**	TV, a 750 m³/h HRV in a roof plant room; an assist fan proposed, not added Assist fan YES (a quiet EC extract-type fan in the plenum behind the grille, own switch by the seating, slid out through the grille for service); bird mesh only on the breeze path; the HRV in a base under the malqaf tower, one mass, top +9.10 (nothing but the tower above the attic), serviced from the roof through doors; the AC condensers south of the tower (2.2 m clear of the base); the kitchen make-up inlet discreet under the stone band, interlocked with the hood SUPERSEDED by south wing v2: the gym an L on the west and the south with a 2.5 m court and the office east	Owner's decisions on the study's open items (studies/air_system.typ v3.1)	تجهيز مساعدة هادئة خلف القتحة بمفتاحها؛ شبك طيور فقط وحدة التهوية في قاعدة تحت برج الملقف كتلة واحدة؛ المكيفات جنوب البرج؛ مدخل هواء المطبخ مخفي تحت الحزام الحجري.	
V8.0	**South wing swapped (applied)**		Owner; replaced the same day	استبدل بالنسخة الثانية من الجناح الجنوبي.	
V8.0	**External stair tower east; roof stair dropped; outdoor kitchen**	An enclosed arched stair tower outside the east wall at the south-east (2.6 × 5.78, top +9.60) to the office landing and the roof, a locked gate above the landing, an out-opening gate at the foot, no door into the house, a service gate in the lane wall; the internal stair stops at the first floor; the outdoor counter at the tower's east face, the grill 3.4 m south of the gate	Feasible with conditions (suite window shortened to y 15.0–17.9); counted as the first floor's second way out	المصلة غربية، فناء الجناح الكبير من المصلة إلى المكتب؛ المكتب شرقاً بلا باب إلى غرفة النوم.	
V8.0	**South wing v2**	Gym on the west band (≈ 18 m² clear, treadmill on the 2.75 m solid bay, an entrance nib at the gallery end); the suite court from the gym to the office (≈ 25 m², the three doors on a 1.2 m strip, seating south); the office east, no door to the bedroom; fixed TVs; R6 removed	Owner; X5 improved, not verified		
V8.1	**Stair tower removed; roof by a maintenance ladder; roofline lowered**	The external stair tower, its gates, landings and the visitors' door to the office are removed; office visitors are met in the men's majlis, the office is reached from the suite court only (simple door to visitor locks); the roof by a manufactured vertical ladder in a 0.90 × 0.30 recess in a honey-stone pilaster on the gym's east wall in the suite court (3.7 m climb, behind a locked walnut-finish panel, a self-closing gate in the court guard at the top, a central fall-arrest rail, the stiles 1.10 above the roof); the attic lowered to 1.40 m above the roof finish (coping +8.70), the south wing parapet 0.70 m (+8.00) with a continuous 1.10 m black steel guardrail set back 1.0 m (the strip outside it a no-go zone); the outdoor counter at the east wall, the grill apart; the service gate on the lane proposed to keep for the yard	Owner, 1 Nov 2026 after V8.0 (cost and appearance); the sight lines re-run: 1.40 hides 1.2 m condensers on 0.10 pads and the tank (studies/roof.typ § 3); the HRV base (+9.10) stays 0.40 above the attic as part of the malqaf mass, or is lowered (option)	إلغاء برج الدرج الخارجي وباب الزوار؛ المكتب من فناء الجناح فقط؛ الوصول إلى السطح بسلم صيانة ثابت في فناء الجناح خلف لوح مظلّ؛ خفض العلية إلى 1.40 م والدروة الجنوبية إلى 0.70 م مع درابزين مرتد 1.10 م.	
V8.2	**Main stair flipped (option B) and the family bath enlarged (F-b)**	The main stair turned round in the same well: the lower flight on the east half rises south straight off the family lobby (the start at the north end, 1.45 m in front of the first riser), the half landing at the south end, the upper flight on the west half arrives at the north end beside the lift's first-floor door; the risers 16–B18 remain; bedrooms 2.22 m at tread 6, 0.30 trimmers an option for 2.32); a 0.90 black-bar balustrade along the lower flight on the riwaq; the store under the half landing with a low door onto the riwaq; a small obscured west window at the half landing; a glazed obscured side light at the family entrance; the small entry cupboard removed, a full-height coat cupboard in the west half of the start strip. The freed south landing becomes the family bath's north part (an L) with a separate WC compartment by the shaft stack and a double basin	Owner, 2 Nov 2026; from studies/stair_flip.typ: the study room, the living, the suite and the entrance come 5–7 m nearer the stair, bedrooms 2 and 3 lose 3.8 m; a proper foot; the same headroom and structure	قلب الدرج الرئيسي (stair_flip ب): البداية والوصول في الطرف الشمالي بجوار المصعد، وبسطة الوصول القديمة تصبح جزءا من حمام العائلة مع مرحاض منفصل ومغسلتين؛ درابزين على الرواق ونافذة صغيرة وزجاج مظلل بالمدخل.	
V8.2	**Food route to the men's majlis accepted (review X-01)**	The food route from the kitchen through the dining and the riwaq to the serving passage is accepted as drawn: no outside service path, no serving door in the majlis	Owner, 2 Nov 2026: normal guest numbers; very large events use the old majlis on the farm; the owner serves	قبول مسار الطعام من المطبخ إلى مجلس الرجال كما هو مرسوم: لا أحداث عابرة، والمناسبات الكبيرة في المجلس القديم بالمزرعة، والمالك يقدم بنفسه.	
V8.2	**Bedroom 1: no private bathroom (option A; review F-05)**	Bedroom 1 keeps its size and uses the family bath (two compartments since the stair flip); the wet areas stay grouped in the two existing clusters (west and the stair shaft, east along the east wall); low-level motion-sensor night lights along the route bedroom 1 → family link → family living → gallery → family bath (design_ff.typ marks; a note for the electrical design)	Owner, 2 Nov 2026, from studies/bedroom1_bath.typ: the 17.3 m route accepted; no third wet cluster	غرفة النوم 1 بلا حمام خاص (اختيار أ): تبقى بحجمها وتستخدم حمام العائلة، مع إضاءة ليلية منخفضة بحساس حركة على المسار.	
V8.2	**Ground-floor shower deferred to the plumbing study (review G-07)**	Deferred: decided with the plumbing study (open item 10); P1 (the family WC and the family basins merged into one accessible wet room with a level shower and a 1.5 m turning circle) stays the preferred option, P1-lite (the family WC room only) the fallback	Owner, 2 Nov 2026, from studies/gf_shower.typ	دش الدور الأرضي مؤجل إلى دراسة السباكة؛ الخيار المفضل دمج دورة العائلة والمغاسل في حمام مبتل، والبديل دورة العائلة وحدها.	
V8.2	**Suite court south side: a mashrabiya screen**	The court's south side is a mashrabiya screen on the 1.10 m base up to the facade frame's soffit (the full height of the opening under the parapet), timber or black steel lattice in the design language: the palms seen out, no view in	Owner, 2 Nov 2026 (studies/south_wing.typ § 12 option b)	الجهة الجنوبية لفناء الجناح: مشربية بكامل ارتفاع الفتحة فوق القاعدة 1.10 م وتحت السقف؛ ترى النخيل ولا يُرى الداخل.	
V8.2	**Clerestory windows stay openable (open item 14 closed)**	The double-height living's clerestory windows stay openable vents (ventilation, the living's smoke outlets); the suite court is no longer an escape route since the stair tower went, so fixed fire-rated glazing is not needed; privacy by the 1.40 m sill and the court's mashrabiya	Owner, 2 Nov 2026	النوافذ العلوية للصالة تبقى قابلة للفتح؛ لا حاجة لزجاج مقاوم للحريق لأن فناء الجناح لم يعد مخرج هروب.	
V8.2	**Site plan: the north-strip parking kept; the inverter and batteries in the utility room**	The uncovered family parking space north of the house (5 × 2.5 in the setback strip, 0.4 m off the wall, clear of the family entrance) is KEPT; a 3-point manoeuvre from the driveway (studies/site_plan.typ). The future inverter and batteries go in the utility room (west), away from the water: the heater and the manifold on the room's south side, the batteries on the north wall under the family bath's dry linen zone (the bath's slab sunken and tanked); the electrical engineer confirms the space, the ventilation and the fire safety	Owner, 2 Nov 2026 (the municipality allows parking inside the plot)	موقف السيارة شمال البيت يبقى (مناورة بثلاث حركات)؛ العاكس والبطاريات في غرفة الخدمات غربا بعيدا عن الماء، ويؤكد مهندس الكهرباء المساحة والتهوية والسلامة.	
V8.3	**Bedroom 1: en-suite shower room, hotel layout, B4 - studied, NOT applied**	B4 (an entry zone by the link, two doors side by side on one line, a 1.6 × 2.4 shower room over the laundry / maid bath, a ≥ 10 m² clean bedroom) fails its acceptance criteria 2 and 3 in every variant: bedroom 1 is a 13.9 m² wedge and the programme needs ≥ 15.7 m²; the best variant B4-b leaves a 7.3 m² L-shaped bedroom with the two doors at a corner (studies/bedroom1_bath.typ page 3). Option A (2 Nov) stands for now; since the family bath is a WC only, bedroom 1 has no shower on its floor until the owner decides (B4-b with its two failed criteria, or another answer)	Owner's brief 3 Nov 2026; the sizes are targets, nothing squeezed	حمام غرفة النوم 1 بالمخطط قدمي (B4) دُرس ولم يُطبق لأن معايرين من معايير القبول لا يتحققان (الغرفة مثلثة الشكل)؛ يقرر المالك بين b-B4 مع نفسه أو حل آخر.	
V8.3	**Bedroom 2: en-suite bathroom; the first-floor family bath becomes a family WC**	The F-b bath by the west shaft is split: bedroom 2's en-suite (y 9.2–11.0 with the former wardrobe niche as its vanity niche, ≈ 4.7 m² clear; a level shower 1.0 × 1.6 with a channel along the service wall, a wall-hung WC, the vanity; its door from inside bedroom 2) and a family WC (y 7.9–9.2, ≈ 2.8 m² clear, a wall-hung WC behind a screen wall, a basin; its door from the gallery). Every fixture on one 0.20 service wall on y 9.2 into the shaft (no pipe in the floor); the gallery and the guard round the stair opening untouched; bedroom 3's bath unchanged. Result: the suite, bedrooms 2 and 3 have their own bathrooms plus a family WC upstairs; bedroom 1 waits (B4)	Owner 3 Nov 2026; all five acceptance criteria pass (the bed in view from bedroom 2's door, noted)	حمام خاص لغرفة النوم 2 من تقسيم حمام العائلة؛ ودورة مياه عائلية بينهما من الممر؛ لا تمديدات في جدار خدمة واحد إلى الشفت.	
V8.3	**Plumbing decisions (round 2)**	The east stack EXTERNAL on the east wall behind removable cladding (not the internal duct); automatic trap primers on the rarely used drains; rain and sewage fully separate and the condensate by tundishes / trapped air-breaks: adopted; the suite bathroom's approach (option b, the service wall): NOT decided, open for discussion	Owner 3 Nov 2026	المأسورة الشرقية خارجية خلف كسوة قابلة للفك؛ مخارج سيفونات آلية للمصارف قليلة الاستعمال؛ فصل الأمطار عن الصرف واعتماد التكثيف عبر قمعيات هوائية؛ أسلوب حمام الجناح لم يُحسم.	
V8.3	**Courtyard layout revised: level floor, movable furniture, the enclosure on the kitchen wall**	The sunken step and the built-in benches removed: the whole courtyard floor LEVEL with gentle falls to linear drains (rain system, trap primers); modern movable sofas and armchairs for 4–6 with a low table facing the TV; the fountain + tree enclosure moved to the north end of the east (kitchen) wall in front of the sink window (the tree north, a raised water bed with a rim +0.95 under the sill +1.10); the TV and its stone surround south of it with the grille below (+0.10 … +0.45); the north side solid, the rest a slightly glass freed; the seating zone 12.1 m² (+1.6 m²

Open items / for the owner and the engineers


From data/open_items.csv (the same list as docs/OPEN_ITEMS.md) | orange = the edge beam and the 3 columns, red = the acoustic wall gym ↔ bedroom 3 | the roof ladder in the suite court

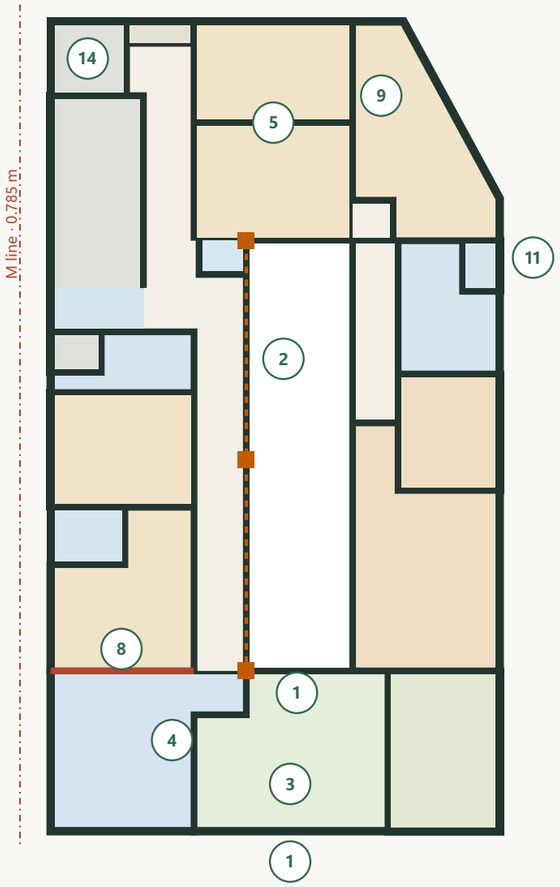

No.	For	Item	Action	البند
1	Survey	Setback margin 0.91 m from the deed setback line, 0.42 m from a setback counted from the wall as built (the lane notch on the cut wall; 8 Nov 2026: B1 6.00 m from M1 after the owner's car test, the cut wall a further 0.24 m shorter; V9.0: the house set out on site and moved 1.24 + 0.50 m south, B1 5.49 m from M1; the cut wall 0.12 m shorter after the field reading of 2.30 m)	The official survey; the engineering office says whether the setback is counted from the deed line or from the wall as built (docs/SITE_SETOUT.md, studies/setout.typ)	الهامش 0.91 م من خط الصك و0.42 م من الجدار القائم: يؤكده الرفع المساحي ويحدد المكتب الهندسي خط القياس.
2	Structural	Edge beam on x 5.8 (spans 6.5 and 6.25 m) and three columns at x 5.8 under the first-floor west projection	Engineer: beam depth, column sizes and foundations; the columns stand in the women's majlis south wall, the courtyard / living glass and the living's south wall	جسر الحافة على x 5.8 (بحور 6.5 and 6.25 م) والأعمدة الثلاثة تحت البروز الغربي: يحدد المهندس الإنشائي المقاسات والأساسات.
3	Structural	South wing v2 over the men's majlis and the guest block (X5 revised, improved, not verified): the gym inside the column frame (B19 between C19 and C20, a new B22 under the double wall), the suite court terrace on the majlis roof, the office wall x 10.0 on rib B21 (non-load-bearing), R8 across the court's south side	Engineer: B19, B22, R8, the terrace load (depressed zone, falls, planters), the treadmill bay's vibration	الجناح الجنوبي فوق مجلس الرجال وكتلة الضيوف: الجسور B19 وB22 وR8 وحمل فناء الجناح واهتزاز جهاز المشي، للتأكيد من المهندس.
4	Structural	The maintenance ladder in the suite court (V8.1): the rendered pilaster (V10.0: no stone) on the gym's east wall (the 0.20 wall not cut, X20), the ladder's fixings, the gate posts on R3; the 1.10 m guardrail set back 1.0 m on the south wing (anchors through the waterproofing)	Engineer and the ladder supplier; the fall protection confirmed by the specialist under the Saudi requirements	سلم الصيانة في فناء الجناح: العمود الحجري على جدار النادي وتثبيت السلم والبوابة، والدرابزين المرتد على الجناح الجنوبي؛ يؤكد المهندس والمختص.
5	Structural	First-floor walls off ground-floor lines (y 3.0 over the women's majlis, the suite walls over the kitchen and, if the plumbing proposal (b) is adopted, the suite bath's 0.20 service wall on the depressed slab, the gym nib and the office wall over the men's majlis; the family bath's wall on y 7.9 is on B12)	Engineer: light partitions on the slab or beams	جدران الدور الأول خارج خطوط الأرضي: قواطع خفيفة أو جسور.
6	Structural	Floor-to-floor height 3.60 m (assumed); the flipped stair (V8.2): headroom 2.22 m at tread 6 under the mirrored trimmers B16′–B18′ (0.30 trimmers give 2.32), the first-floor opening turned round; handrails	Engineer to confirm the levels	ارتفاع الدور 3.60 م (مفترض)؛ الدرج المعكوس: ارتفاع حر 2.22 م تحت الجسور الحاملة للفتحة؛ يؤكد المهندس.
7	Structural	No soil report: the footing type and depth, the lift pit, the malqaf core's pad (V10.0) and sump	Owner: commission the soil investigation	لا يوجد تقرير تربة: نوع القواعد وعمقها وحفرة المصعد وقناة النسيم وقواعد برج الدرج.
8	Acoustics	Acoustic wall between the gym and bedroom 3 (south wing v2): a double wall (target Rw about 55 dB airborne), a floating floor or dense rubber under the treadmill, anti-vibration pads, nothing fixed to the wall	Acoustic / structural engineer: the build-ups, then a test on site	جدار مزدوج بين النادي وغرفة النوم 3 (نحو 55 ديسيبل) وأرضية عائمة تحت جهاز المشي.
9	MEP	Air system v4 (AIR_SYSTEM.md, V10.0: the malqaf at L5): the breeze path (the head's mesh and flaps, D1, the dust trap, the outlet louvres and D2), the filtered supply fan 750 m^3/h (a washable pre-filter + an ISO ePM1 ≥ 50 % filter, a silencer) with high grilles into the family living, the gallery, the riwaq and the women's majlis, the hood's interlocked make-up inlet (mandatory), the west vent re-routed south-east, the chamber's gully and electrics, the two switches and the dust relay; every figure assumed	MEP engineer: size the fan, the filters, the dampers and the dust relay, the louvres and grilles, the make-up inlet; confirm the breeze (≈ 1.8 m^3/s at 21 km/h) and the separations	نظام الهواء v4 (الملقف في L5): مسار النسيم ومسار الهواء المرشح، المروحة والمرشحات وكاتم الصوت، الخانقان وحساس الغبار، مدخل الهواء التعويضي للشقاط، تحويل تهوية الصرف الغربية؛ للمهندس الميكانيكي
10	MEP	Plumbing study rounds 1–2 (plumbing.typ, PROPOSALS) with the owner's decisions of 3 Nov 2026 (the east stack external behind cladding, automatic trap primers, rain / sewage separate, condensate by tundishes); still open: the suite bath's drainage approach (a: all in the sunken slab / b: the east service wall + the tub's plinth), the heaters (two cylinders or a roof heat pump), the utility room's door moved south, the water system (the next study: the tankers, the ground tanks, a roof tank, the pumps, the greywater lines to the south garden), the septic's inlet level (−1.24 computed; a pump if it is higher); every size assumed	Owner: the suite bath approach, the heaters, the utility door; then the plumbing engineer designs the falls, the pipe sizes, the stacks and the pump station if needed	دراسة السباكة: قرارات 3 نوفمبر مسجلة (الماسورة الشرقية خارجية، مغذيات السيفونات، فصل الأمطار)؛ ما زال مفتوحا: أسلوب صرف حمام الجناح والسخانات وباب غرفة الخدمات ونظام الماء؛ ثم يصمم المهندس.
11	MEP	The stack outside the east wall (suite bath + vent) at y 7.05 behind a removable cladding panel (plumbing round 2, A3: recommended over an internal duct), its four branch fittings at +3.4 … +3.9 and a rodding eye; the kitchen extract through the east wall; the hood clear of the stack	Owner: confirm the external stack; MEP engineer to size and detail it	الماسورة خارج الجدار الشرقي خلف كسوة قابلة للفك (موصى بها على القناة الداخلية)؛ يؤكد المالك ويصمم المهندس.
12	Owner	Service door to the east service yard: DECIDED, a lockable 0.90 m door in the kitchen's east wall at its north end (y 6.7–7.6), near the laundry; drawn	Lock and hardware with the joinery; MEP moves the stack south of it	باب الخدمة: تقرر. باب مقفل 0.90 م في الجدار الشرقي للمطبخ عند طرفه الشمالي قرب الغسيل إلى الفناء الشرقي (نفايات، توصيل، غاز)؛ مرسوم. القفل مع النجارة.
13	Owner	Foyer majaz only partial: the entrance door and the majlis opening overlap	Owner: accept, or add a curtain or a short screen	المجاز في بهو الضيوف جزئي: قبول أو ستارة أو حاجز قصير.
14	Owner	Lift installed at construction: the shaft 2.25 × 2.2 is a placeholder until a supplier's civil drawing is chosen (two stops); the roof slab is closed over the stair well and the lift does not serve the roof	Owner: ask 2 or 3 suppliers, use the largest shaft; the headroom above the first-floor stop ≤ 3.40 m (≤ 3.70 with a 0.30 raised head hidden behind the coping)	المصعد عند الإنشاء: المقاس مؤقت حتى اختيار المورد، وارتفاع الرأس ≥ 3.40 م.
15	Design	Daylight check of the courtyard and the double-height living	A daylight simulation with the final levels	فحص الإضاءة الطبيعية للفناء والصالة بمحاكاة.
16	Survey	The existing farm placed from the owner's answers (V9.0), approximate: the old house and its annex (W1–W4, A1–A4), the covered parking (P1–P4), the ground tank (K0–K2, the lid and the fill point), the reserved tank's place, the septic's position and inlet level; where guests park; the south gate, the workers' house, the service gate	Owner: measure them on the next site visit (docs/SITE_SETOUT.md § 8, the tapes from M1, D and R); then data/deed_sketch.csv and the studies are corrected	المزرعة القائمة (تقريبي): البيت القديم وملحقه والمظلة والخزان وخزان الصرف ومكان مواقف الضيوف: تقاس في الزيارة القادمة.
17	Design	The facade principle R-37 (no privacy from outside: the house inside a fully walled farm) to be applied at the facade design stage: the walls now blank or with small / high windows for privacy (the women's majlis north window, the kids' room, a north-light clerestory for the family living, the dining and suite east windows, the office, the men's majlis sills) are candidates to open; the west guest side keeps its privacy	Designer at the facade stage, with the climate rules (shading, dust) and the escape windows	مبدأ الواجهات (لا خصوصية من الخارج): يطبق في مرحلة تصميم الواجهات بفتح الجدران المغلقة والنوافذ الصغيرة إلا في الجهة الغربية (طريق الضيوف).
18	Survey	The existing septic OUTSIDE the north wall near corner C1 serves the old house and takes the new house's drains (owner, V9.0): its inlet level, capacity for both houses and condition; the street level at the gate, the farm's levels: all approximate in studies/site_plan.typ. Levels (8 Nov 2026): the ground falls slightly to the south; the owner accepts raising the house on a plinth if needed; the finished floor, the plinth, the entrance steps or ramps, the courtyard and garden levels and the sewer falls are set from the official survey's levels.	Owner: the survey; then the drainage falls are re-checked (a pump at the gate's collector chamber if the inlet is higher than −1.24)	خزان التحليل خارج السور الشمالي قرب C1 يخدم البيتين: منسوب مدخله وسعته وحالته والمناسيب بالرفع المساحي؛ ثم تُراجع ميول الصرف.
19	Owner	The municipality: the septic's reuse and its legal position outside the wall (the drain crossing under it), the rain soakaways and their overflows, the gas cabinet and the Civil Defense's villa requirements (access, water, alarms); parking in the setback strip is allowed (owner, 2 Nov 2026)	Owner: ask the municipality and the Civil Defense with the site plan	البلدية: إعادة استعمال خزان التحليل خارج السور، وآبار تصريف الأمطار، وخزانة الغاز ومتطلبات الدفاع المدني.
20	Design	The facade study, after the plan freeze and once the windows are set (owner, 9 Nov 2026): (1) the windows (sizes, positions, the GF and FF windows on one vertical axis, the 20 cm module); (2) the shaping with the structure (the recesses, the projections, the arches and the cornices built in block and concrete); (3) the finishes: render and paint only (a light sand render, an optional calm honey tone on the projections; no stone)	Designer and owner after the plan freeze; the builder's rules from the start: plaster mesh over every block / concrete junction, drips and falls on every projection	دراسة الواجهات بعد تجميد المخطط: النوافذ، ثم التشكيل مع الهيكل، ثم التشطيبات (لياسة ودهان فقط، بلا حجر)
21	Design	D11 (owner, 9 Nov 2026): walls in 20 cm block; around the windows 30 cm block bands projecting 10 cm outwards (the inner face flush), full height from the base to the cornice like pilasters, the windows inside them; the GF and FF windows on one vertical axis; every window and band size on a 20 cm module (a constraint for every study from now on)	Check at the facade study: the availability and price of 30 cm block in Taif, the continuity of the wall insulation round the bands, the render and its mesh at the band edges (the stone-cladding check dropped: no stone, 9 Nov 2026)	D11: جدران بلك 20 سم، وحول النوافذ أشرطة بلك 30 سم بارزة 10 سم من القاعدة إلى الكورنيش، ونوافذ الدورين على محور رأسي واحد، وكل المقاسات على موديول 20 سم
22	Structural	The malqaf core (V10.0, L5): an independent RC core at the courtyard's north-west corner on its own pad (≈ 2.4 × 3.0 × 0.6, ≈ 100 kPa assumed), absorbing C17, C21 and the first arcade column: the fourth support of the west projection (B3 / B4 first spans 6.50 → 4.33 m); R3 widened to 0.40 over y 6.5–8.8; the new beam R-L5 (1.55 m) under the head's south wall; the head frame for wind and EARTHQUAKE; the slabs' ties; the north-east slab openings closed	Structural engineer with the soil report; the fall-back F2 (the head on the core alone) if the beam additions are refused	نواة الملقف ورأسه (L5): القاعدة والجدران، الدعامة الرابعة للبروز وتقصير B3 وB4، توسيع R3، الجسر الجديد، إطار الرأس للزلازل؛ للمهندس الإنشائي مع تقرير التربة

Roof plan / the roof ladder, the set-back attic, the set-back guardrail and the reserved zones

studies/roof.typ (V8.1: the roof by a maintenance ladder in the suite court; the internal stair stops at the first floor; V10.0: the malqaf head at the courtyard's north-west corner, L5; no HRV, no plant room) | flat roof, no tiles | the attic 1.38 m above the finish, set back 1.0 m | the south parapet 0.70 m with a 1.10 m guardrail set back 1.0 m | zones reserved, not designed | all sizes assumed

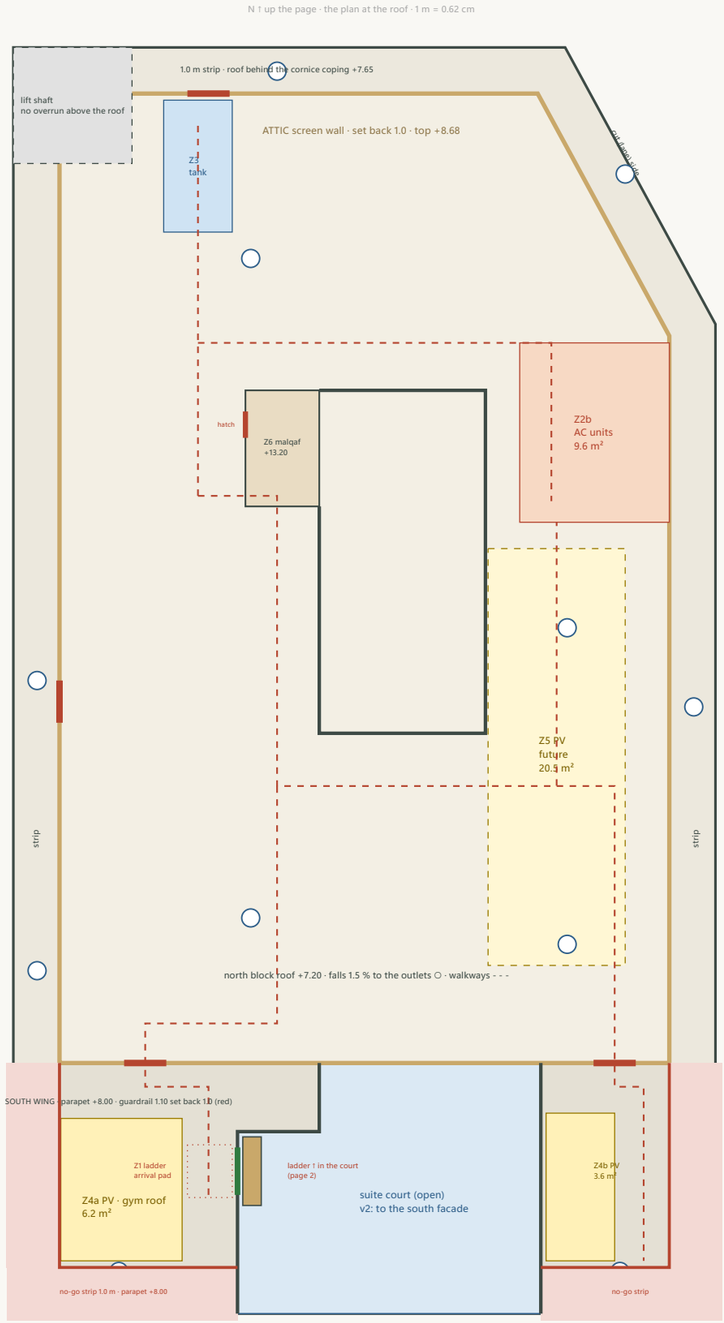

Access (V8.1): by a **maintenance ladder in the suite court**: a manufactured vertical ladder in a 0.90 × 0.30 recess of a rendered pilaster on the gym's east wall, behind a locked walnut-finish panel (not climbable when closed); 3.7 m from the court floor to the gym roof, the stiles 1.10 m above the roof as the transfer handholds (+8.40), a self-closing gate in the court's west guard, a landing pad inside the guarded zone; a fall-arrest rail, to be confirmed by the specialist. The internal stair stops at the first floor; the roof slab over the well is closed; no door from the roof into the house. The lift stops at the first floor: headroom to the roof slab underside 3.4 m (a lift with ≤ 3.40 m, or ≤ 3.70 m with a 0.30 m raised head hidden behind the cornice; open item 15).

Roofline (V8.1, lower and balanced; V10.0 render, no stone): a rendered **main cornice** 0.45 × 0.3 m at +6.90 … +7.35 all round; on the north block a coped upstand to +7.65 and the **attic screen** 1.38 m above the roof finish (coping +8.68) set back 1 m on all four sides; the **south wing** a low parapet 0.7 m above the finish (+8.00) and a **continuous 1.10 m black steel guardrail set back 1 m** (not seen from the street; the strip outside it a no-go zone): the roofline steps 0.68 m. Above the attic only the **malqaf head** (V10.0, L5: 1.6 × 2.4, +13.20) at the courtyard's north-west corner, on the shaft and the gallery roof; no plant room (the filtered fan is in the malqaf's foot chamber). The attic hides 1.2 m condensers on pads and the tank from every distance (§ 3 of the study). The attic never cuts the courtyard's sky or sun.

Zones (reserved): no plant room (V10.0: the filtered fan sits in the malqaf's foot chamber); the AC units behind the cut / east attic wall; water tank(s) between the roof beams R10 and R3; PV on the gym roof and the office roof inside the guardrail and, later, on the north block's east roof; the 1.0 m strip in front of the attic (a no-go zone) with its own outlets; 11 roof outlets to internal downpipes, falls 1.5 %; 0.9 m walkways from the ladder's landing pad through the attic opening at x 2.1–2.9 to every zone, with a branch to the office roof; the guarding continuous from the ladder to every piece of equipment (checked).


Zone	m²	Note
Z1 the maintenance ladder (suite court → gym roof)	0.5	V8.1 (owner): the roof is reached by a fixed vertical ladder in a recess in a pilaster on the gym's east wall (page 2): 3.7 m climb from the court floor +3.60 to the gym roof +7.30, behind a locked walnut-finish panel; the internal stair stops at the first floor, the roof slab over the well closed
Z2b plant: AC outdoor units	9.6	behind the cut / east attic wall, in the north-east part of the roof (owner): 3.7 m east of the malqaf head and 2.6 m below its openings (their hot plume rises leeward in a W wind); over the suite bath (anti-vibration mounts); 0.6 m service space round each unit; V10.0: no HRV plant room
Z3 water tank(s)	3.3	≈ 2 × 1.5 m³ between the roof beams R10 and R3, inside the attic (needed only if the owner wants a gravity reserve)
Z4 PV, south wing (gym roof Z4a + office roof Z4b)	9.8	west and east of the court, never in front of the clerestory windows; V8.1 only inside the set-back guardrail and off the walkways (was 24.6 m²: the no-go strips and the ladder's walkway take the rest); fixing points cast in before waterproofing
Z5 PV, future (north block east)	20.5	inside the attic; morning shade from the east attic wall
Z6 the malqaf head (V10.0, L5)	3.1	1.6 × 2.4 m at the courtyard's north-west corner on the shaft and the gallery roof, rising to +13.20: an RC frame with rendered block ribs, render and paint (light sand; the band, the crown and the slot surrounds in the honey tone); 3 / 5 slender arched slots per face (+11.2 … +12.6), a bird mesh, the + divider and the flaps inside; the hatch on its west face; the sky hole's guard starts at its south-east corner (`studies/air_system.typ`, `studies/malqaf_L5.typ`)
Z7 the 1.0 m strip in front of the attic	42.1	roof behind the main cornice and its coping; falls to its own outlets; a NO-GO zone (the coping is 0.35 above the finish): its two openings in the attic wall get locked gates; entered only on a harness clipped to anchor eyes on the attic wall
Z8 the no-go strips of the south wing	13.6	the 1.0 m between the guardrail and the parapet (+8.00, 0.70 above the finish): no equipment, no walkway; the outlets there reached on a harness

السطح


الوصول إلى السطح بسلم صيانة ثابت في فناء الجناح خلف لوح مقفل (V8.1)، والدرج الداخلي يتوقف عند الدور الأول وبلاطة السطح فوق البئر مغلقة؛ المصعد يقف في الدور الأول. كورنيش رئيسي من الحجر العسلي حول البيت، وعلى الكتلة الشمالية حاجز سطح بارتفاع 1.38 م مرتدّ 1 م خلف الكورنيش يخفي المعدات؛ رأس الملقف (L5) في الركن الشمالي الغربي للفناء فوق المجرى وسقف الممر، ولا غرفة معدات على السطح؛ الجناح الجنوبي بدروة منخفضة 0.70 م ودرابزين مرتد 1.10 م فيتدرّج خط السطح 0.68 م. مناطق محجوزة: وحدات التكييف خلف العلية، الخزان، الألواح الشمسية، الممرات والمصارف والحواجز.

Elevations / the lowered roofline and the sight lines


studies/roof.typ (V8.1; V10.0 render and paint, no stone) | light sand render; the plinth, the corners, the band between the floors and the main cornice formed in the structure, in a calm honey tone | black steel divided-lite windows | the attic set back 1.0 m | openings indicative

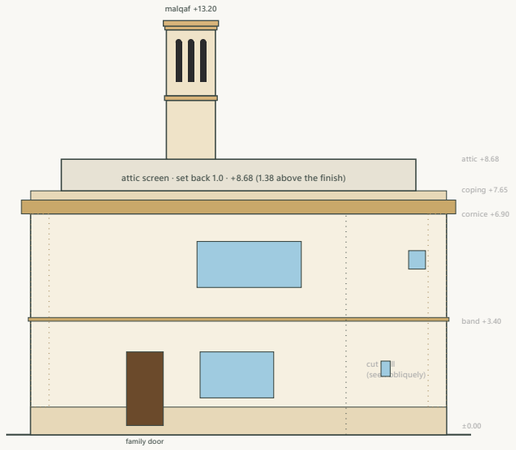


NORTH ELEVATION (from the street) · W ← → E · 1 m = 0.5 cm

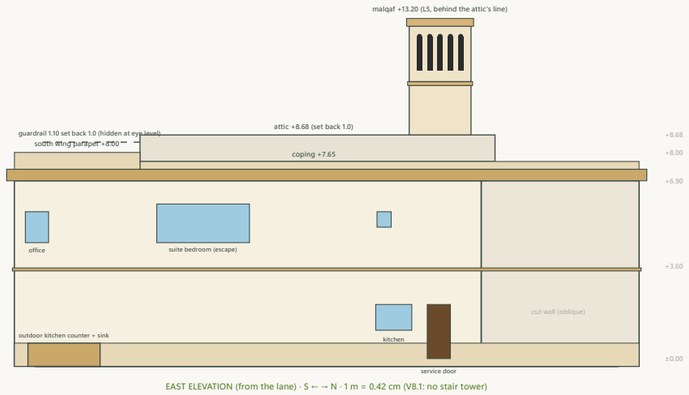

EAST ELEVATION (from the lane) · S ← → N · 1 m = 0.42 cm (V8.1: no stair tower)

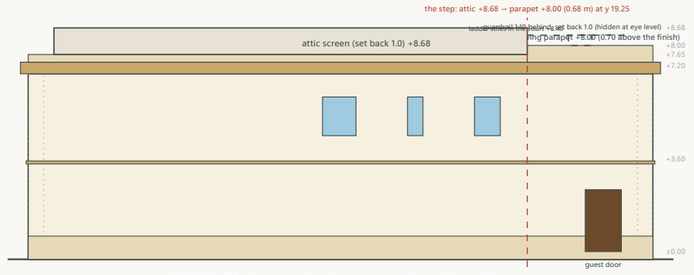

WEST ELEVATION (from the M line / the neighbour) · N ← → S · 1 m = 0.5 cm

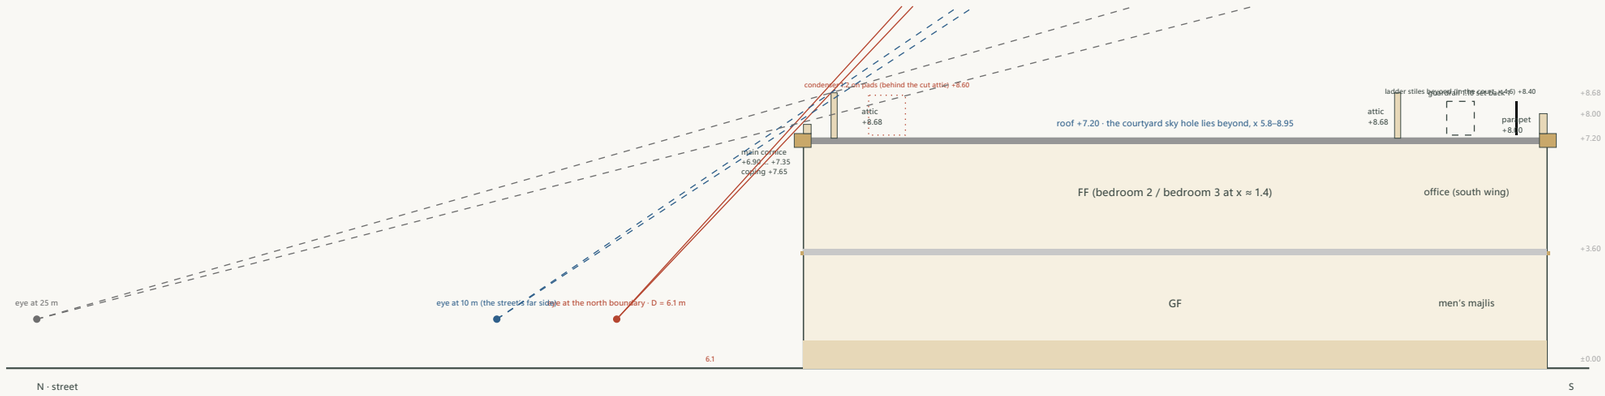

Sight lines (eye 1.6 m above the ground, +1.30 against the house): from the north boundary (D = 6.09 m) the cornice coping (+7.65) is seen at 46.2° and the attic coping at 46.1°: the attic hidden behind the cornice (its coping 13 mm below the line; V9.2: the attic 2 cm lower). Nothing stands above the attic but the malqaf head (V10.0, L5: at the courtyard's north-west corner, hidden from the gate by the north facade, seen whole from the courtyard). The attic (V9.2: 1.38 m above the finish; V8.1 1.40) hides 1.2 m condensers on 0.10 pads (+8.60) and the tank from the street and the lane at every distance: the minimum height is 1.3 m; the units are specified ≤ 1.2 m high.

Elevations: the main cornice (0.45 m, projecting 0.3) at +6.90 the thin band at +3.40 the plinth to +0.60 and the quoins formed in the structure, rendered in the honey tone (V10.0: no stone anywhere); the north block's coping +7.65 with the attic (+8.68) 1.0 m behind it; the south wing's low parapet +8.00 with the guardrail set back behind it; the malqaf head +13.20 at the courtyard's north-west corner (V10.0, L5: 3 / 5 slender arched slots per face, the Hijazi cornice, render and paint); on the east the office's window and the outdoor kitchen's counter at the south end (V8.1). No element above the attic on the west.

الواجهات وخطوط النظر

من حدّ الأرض الشمالي تختفي العِلّية خلف الكورنيش (خُفّضت 2 سم)، ولا شيء فوقها إلا رأس الملقف في ركن الفناء الشمالي الغربي؛ العلية بارتفاع 1.38 م تخفي المعدات، والدروة الجنوبية 0.70 م مع درابزين مرتد لا يُرى من الشارع. الواجهات: لياسة كريمية، حجر عسلي في القاعدة والزوايا والشريط بين الدورين والكورنيش الرئيسي، نوافذ فولاذية سوداء مقسّمة.