


Laundry room — zone by zone


Current condition matched to the proposed enhancement, area by area

Seven zones identified from the walkthrough video and the site photographs. Each is paired with the concept render that shows its target condition, the specific interventions that apply to it, and where it sits in the four-tier budget.

THE SEVEN ZONES

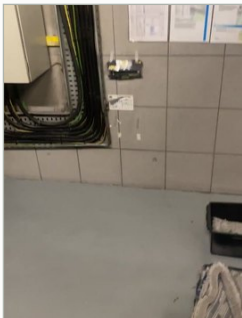

ZONE 01

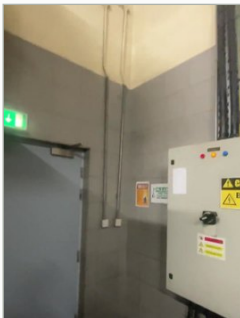

ZONE 02



ZONE 03



ZONE 04



ZONE 05



ZONE 06



ZONE 07

ZONES

7

MACHINES

4 wash · 3 dry

TIER 0 — FREE

AED 0

FULL BUILD

AED 10,090

Zone map


#	Z O N E	M A T C H E D R E N D E R	P R I O R I T Y	T I E R	A E D
01	Electrical board and the document wall	Signage and standards kit	SAFETY	Tier 0 + signage	— / 700
02	Fire door, exit route and second board	Hero — the whole room upgraded	SAFETY	Tier 0	0
03	The dark store alcove — the free room	The lit store alcove	BEST VALUE	Tier 1	60
04	Main machine line	Machine line detail	standard	Tier 1 + Tier 2	1,200+
05	Staging side — clutter where the linen zone should be	Trolley bays and linen staging	standard	Tier 0 + Tier 3	0 + liners
06	Far end and the overhead bulk tank	Hero — the whole room upgraded	VERIFY FIRST	before Tier 3	TBC
07	Stacked machines and rear corner	— none —	OUT OF SCOPE	Not priced	—

How to read a zone page

Left is the room as it is now, straight from the walkthrough or the site photographs — no retouching. Right is what changes in that specific area, and which concept render shows the target condition. The render panel carries the file reference; the images themselves are supplied alongside this report.

Dryers left, washers right · 2.11 m walkway · nothing moves

8.96 × 4.28 m. Washers 1.05 × 1.02, dryers 1.05 wide. Everything in colour is paint, signage or a bin — no machine, pipe or duct is relocated.

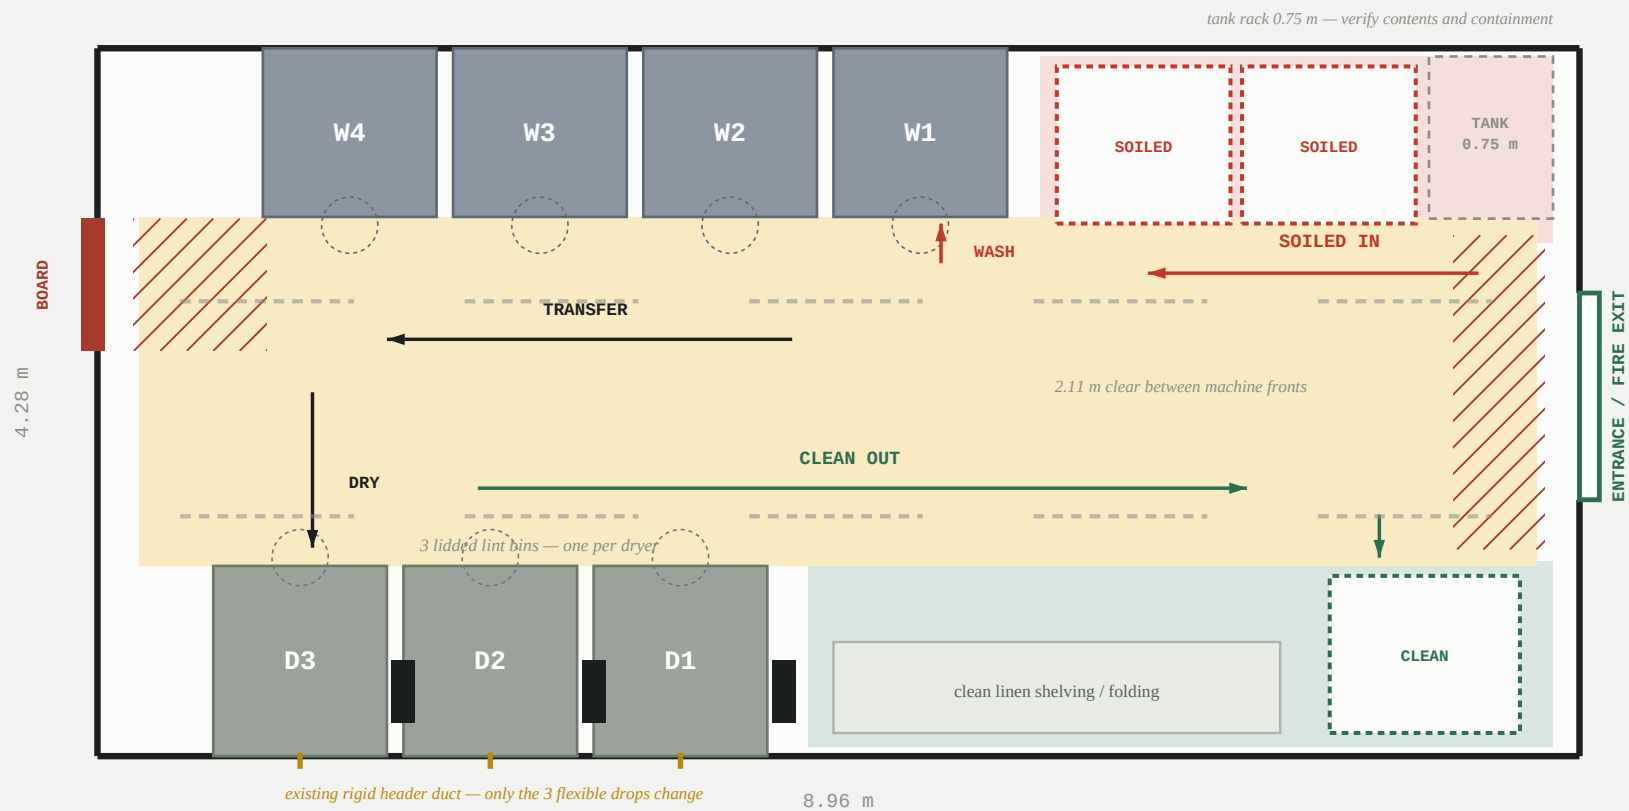

LEGEND — EVERYTHING BELOW IS PAINT, SIGNAGE OR A BIN

- | | | |
|--|--|---|
| <div></div> Soiled side
receiving north-east, feeds the washers | <div></div> Walkway
2.11 m clear, also the escape route | <div></div> Washer W1–W4
north wall — RIGHT as you enter |
| <div></div> Clean side
staging + folding south-east, off the dryers | <div></div> Keep clear
board and inside the door | <div></div> Dryer D1–D3
south wall — LEFT as you enter |
| | | <div></div> LED batten |

One door, and it works

Washers right, dryers left puts soiled and clean on opposite sides with no crossing except the wash-to-dry transfer at the far end.
The doorway must never be blocked.

Sides corrected: dryers on the left as you enter, washers on the right — which removes a crossing.

With the washers on the right and the dryers on the left, soiled feeds straight into the washers and clean comes straight off the dryers — the two never cross except once, at the far end, and that crossing is washed linen. Machines occupy 2.17 m of the 4.28 m width, leaving 2.11 m clear against the 1.20 m an escape route needs. Machine sizes are measured; positions along each wall are scaled from the top view, so mark the floor from the machines. One tape photo was duplicated, so one dryer dimension is still outstanding.

The target condition

Concept renders, not photographs of this room. Each zone page carries the one that applies to it.



Render 1 · Hero — the whole room upgraded

ZONES 02 · 06



Render 3 · Trolley bays and linen staging

ZONE 05




Render 2 · Machine line detail

ZONE 04



Render 4 · The lit store alcove

ZONE 03

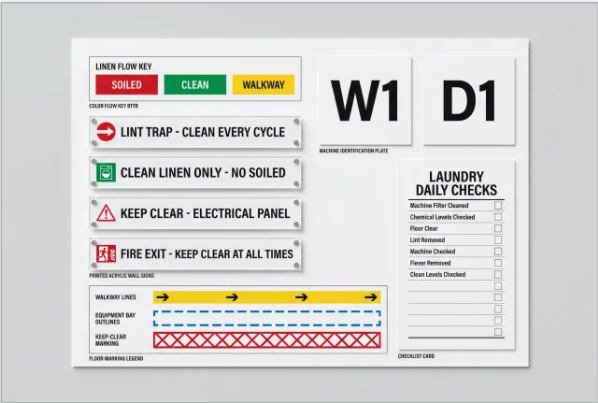

Render 5 · Signage and standards kit

ZONE 01




Supporting · Wall station — close detail


ZONE 03 — DETAIL

Entry wall, 0:00–0:02 in the walkthrough

CURRENT

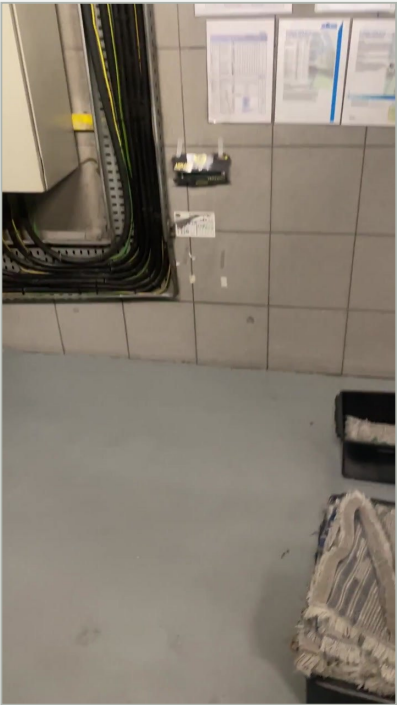

PROPOSED

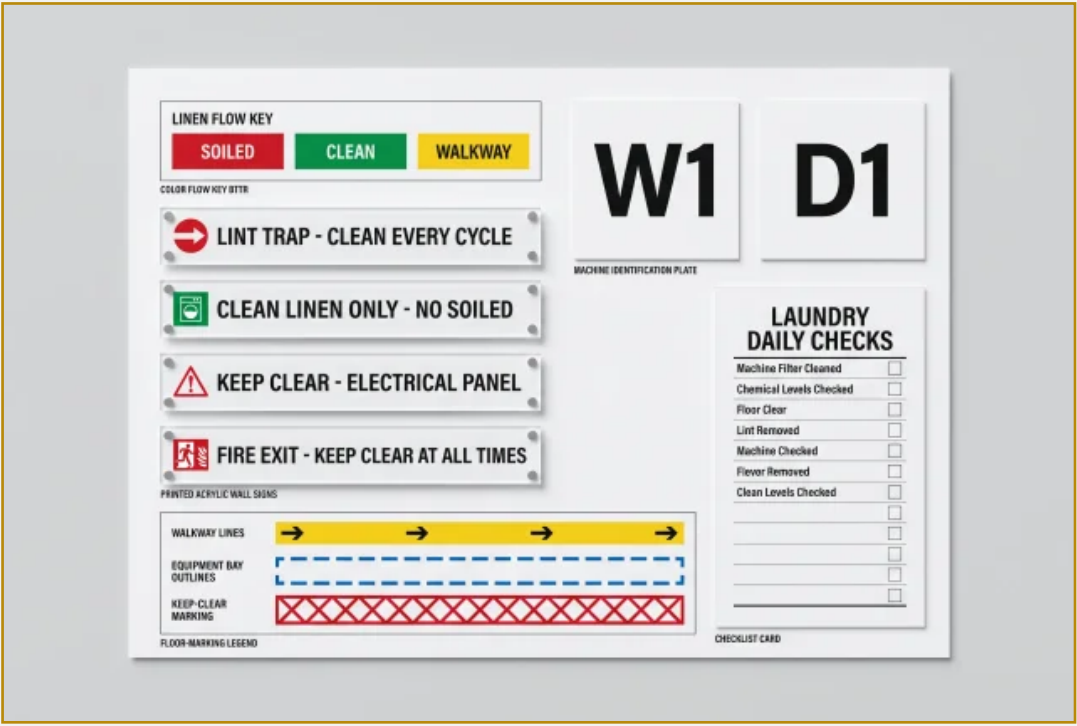

BUDGET

Tier 0 + signage

AED — / 700

WHY IT MATTERS

Paper against a live board is the cheapest fire risk in the room to remove — and the first thing an auditor photographs.

Render 5 • Signage and standards kit

WHAT IS THERE NOW

- A distribution board with heavy cabling entering, and roughly fifteen A4 sheets taped to the tile directly beside it.
- Open lint trays, a woven sack and a plastic storage box on the floor beneath the board.
- No keep-clear zone marked or maintained in front of the board.

WHAT CHANGES HERE

- Strip the paper wall entirely. Combustible material does not belong against a live board.
- Clear the floor beneath and in front of it, then paint a keep-clear zone on the resin.
- Replace the paper with the printed kit: one KEEP CLEAR — ELECTRICAL PANEL sign at a fixed height.
- Documents move to the framed DAILY CHECKS board in the alcove (Zone 03).

Corner by the fire-rated door, 0:03

CURRENT

PROPOSED



Render 1 · Hero — the whole room upgraded

BUDGET

Tier 0

AED 0

WHY IT MATTERS

Nothing on this page costs money, and it is the highest-consequence zone in the report.

WHAT IS THERE NOW

- A green running-man exit sign over a fire-rated door — this room is on an escape route.
- A second distribution board, Caution — Electrical Hazard, with cabling entering below.
- Small safety notices taped at inconsistent heights beside the board.

WHAT CHANGES HERE

- Treat the whole floor as an escape route: nothing stored on it that is not on wheels.
- Mark a keep-clear zone at this board as well as the first.
- Replace taped notices with the same printed signs at one consistent height throughout.
- This zone costs nothing and is the most likely single inspection failure in the room.

Side alcove, 0:05–0:07. Shown unedited: this is how dark it is.

CURRENT



PROPOSED



Render 4 • The lit store alcove

BUDGET

Tier 1

AED 60

WHY IT MATTERS

One fitting. It is the only line in this brief that makes another entire zone usable.

WHAT IS THERE NOW

- Mop, squeegee, bucket and a floor gully already live here — the space is in use.
- No light fitting at all, so nothing else can be stored or found in it.
- Because it is unusable, the cleaning kit and paperwork spill into the main room.

WHAT CHANGES HERE

- Fit one LED batten. That single fitting is what unlocks the whole zone.
- Then mount, in one aligned run: shadow board, PPE station, bundled chemical shelf, framed DAILY CHECKS board.
- Everything currently cluttering the main room and the board wall has a home here.
- One fitting at about AED 60 — the best value line in the entire brief.

Main run, 0:10–0:12

CURRENT



PROPOSED



Render 2 • Machine line detail

BUDGET

Tier 1 + Tier 2

AED 1,200+

WHY IT MATTERS

Light is what makes a clean room read as clean. Two battens in a four-metre room cannot do it.

WHAT IS THERE NOW

- Two fluorescent battens for the full length of a room roughly four metres tall; the far end is genuinely dark.
- High-level cable trays and mesh carrying a heavy layer of settled lint and dust.
- No floor zoning, no walkway, no machine identification. A blue drum parked loose against the wall.

WHAT CHANGES HERE

- Twelve IP65 LED battens at 4000K, evenly spaced — no dark corners, no dark far end.
- Deep clean the high-level steelwork, then paint every service one uniform matt light grey.
- Paint a yellow walkway line one metre out from the machine faces; add W1/W2 ID plates.
- Aluminium coved trim at the machine bases so lint has nowhere to lodge.

Staging side — clutter where the linen zone should be

Opposite the machine line, from the site photographs

CURRENT

PROPOSED



Render 3 · Trolley bays and linen staging

BUDGET

Tier 0 + Tier 3

AED 0 + liners

WHY IT MATTERS

There is no staging zone here today. Render 3 is not an upgrade of this wall — it is the zone this wall does not yet have.

WHAT IS THERE NOW

- A large grey panel and a wire frame stored upright against the wall, with open lint trays along the base.
- No marked bays, no staging zone, and no visible clean/soiled separation anywhere on this side.
- The wall carries services and a tiled dado but no signage system at all.

WHAT CHANGES HERE

- Remove the stored panel and frame from the room — they are the largest single obstruction in it.
- This wall is where the linen staging zone goes: painted bays on the resin floor, one trolley per bay.
- SOILED / CLEAN / RETURN signage colour-coded above each bay, so segregation is visible rather than assumed.
- Replace trolley liners rather than frames, and retire anything torn.

Far end of the run, 0:23

CURRENT



PROPOSED



Render 1 · Hero — the whole room upgraded

BUDGET

Establish before Tier 3

AED TBC

WHY IT MATTERS

Everything else in Tier 3 waits on this. Do not order the chemical shelf until the tank is identified.

WHAT IS THERE NOW

- A large white bulk tank on a raised steel frame, above head height, over the working area.
- A second green exit sign sits directly below and beside it — tank over an escape route.
- Contents, secondary containment, fixing and fill method all unverified from the footage.

WHAT CHANGES HERE

- Establish what the tank holds before committing to anything in Tier 3.
- If chemical: it needs secondary containment and a check on what sits beneath it.
- If water: it needs a check on frame loading and fixing.
- Either outcome, keep the route beneath it clear and lit — the hero render shows the target condition.

Rear area, 0:15–0:20

CURRENT



NOT IN SCOPE

This area was not surveyed or priced.
Ask and it gets its own brief.

BUDGET

Not priced

AED —

WHY IT MATTERS

Different space, different standard. Pricing it inside the main-room budget would understate both.

WHAT IS THERE NOW

- Stacked washer/dryer columns against large-format grey tile — a different space at a different finish standard.
- A staff locker unit, a cardboard box on the floor, and a blue drum in the corner.
- Loose black cable draped down the wall and lying across the floor beneath an isolator.

WHAT CHANGES HERE

- Not covered by this brief, which prices the main machine room only.
- Two items apply regardless: lift the draped cable onto P-clips, and get the box off the floor.
- Say the word and this area gets surveyed and priced separately.

Budget and order of work

T I E R	S P E N D	C U M U L A T I V E	W H A T Y O U G E T
0 — Housekeeping	0	0	About 60% of the visual gain
1 — High leverage	2,840	2,840	Reads as a well-run room
2 — Ceiling	2,250	5,090	Duct fire risk removed
3 — Finishing	5,000	10,090	Audit-ready back-of-house

D O T H E S E T H R E E F I R S T – T H E Y C O S T N O T H I N G

- Zone 02 — clear the escape route. Green exit signage means the floor is not storage.
- Zone 01 — strip the paper wall off the distribution board and mark keep-clear zones at both boards.
- Zone 06 — establish what the overhead bulk tank contains before committing to Tier 3.

About the renders

The renders on each zone page are idealised concepts, not photographs of this room — use them to show intent, and read them against the current photograph beside them. They were supplied at 640px, which is fine on screen but soft if this report is printed large. For evidence of what one shift of cleaning actually buys before any money is committed, render the upright site photographs through the image-to-image prompts supplied with this brief: that produces a before and after of this room, not a concept.

F O U R - W E E K S E Q U E N C E

Week 1	ZONES 01, 02, 06	Escape route cleared, board zones marked, paper wall stripped, tank identified. Then the rest of Tier 0, including the high-level lint strip. Order Tier 1.
Week 2	ZONES 03, 04	Alcove batten in first — it gives the cleaning kit somewhere to live. Then the twelve battens, upper-wall paint, dado clean, floor deep clean.
Week 3	ZONES 01, 04, 05	Floor line painting, after wall painting and never before. Signage installed at one common height. Lidded bins and trolley bays sited and marked.
Week 4	ZONE 04	Access equipment on site: high-level clean, then ceiling services painted grey. Ducting contractor.
Ongoing	ALL	Daily check sheet on the alcove board, signed. Without it the room reverts within six weeks.