


Laundry room — zone by zone


Current condition matched to the proposed enhancement, area by area

Seven zones identified from the walkthrough video and the site photographs. Each is paired with the concept render that shows its target condition, the specific interventions that apply to it, and where it sits in the four-tier budget.

THE SEVEN ZONES

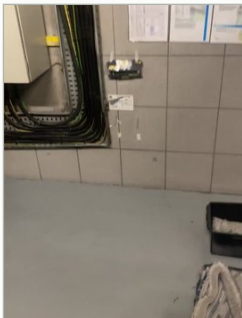

ZONE 01

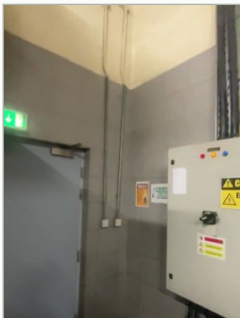

ZONE 02



ZONE 03



ZONE 04



ZONE 05



ZONE 06



ZONE 07

ZONES

7

RENDERS MATCHED

5

TIER 0 — FREE

AED 0

FULL BUILD

AED 11,660

Zone map


#	Z O N E	M A T C H E D R E N D E R	P R I O R I T Y	T I E R	A E D
01	Electrical board and the document wall	Signage and standards kit	SAFETY	Tier 0 + signage	— / 700
02	Fire door, exit route and second board	Hero — the whole room upgraded	SAFETY	Tier 0	0
03	The dark store alcove — the free room	The lit store alcove	BEST VALUE	Tier 1	60
04	Main machine line	Machine line detail	standard	Tier 1 + Tier 2	1,200+
05	Staging side — clutter where the linen zone should be	Trolley bays and linen staging	standard	Tier 0 + Tier 3	0 + liners
06	Far end and the overhead bulk tank	Hero — the whole room upgraded	VERIFY FIRST	before Tier 3	TBC
07	Stacked machines and rear corner	— none —	OUT OF SCOPE	Not priced	—

How to read a zone page

Left is the room as it is now, straight from the walkthrough or the site photographs — no retouching. Right is what changes in that specific area, and which concept render shows the target condition. The render panel carries the file reference; the images themselves are supplied alongside this report.

Entry wall, 0:00–0:02 in the walkthrough

CURRENT

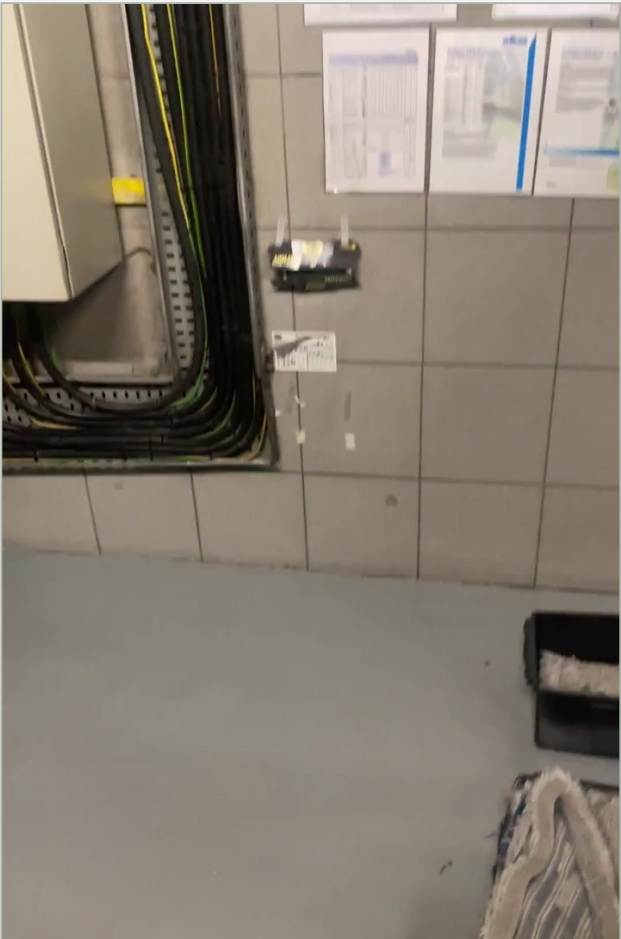

BUDGET

Tier 0 + signage

AED — / 700

WHAT IS THERE NOW

- A distribution board with heavy cabling entering, and roughly fifteen A4 sheets taped to the tile directly beside it.
- Open lint trays, a woven sack and a plastic storage box on the floor beneath the board.
- No keep-clear zone marked or maintained in front of the board.

WHAT CHANGES HERE

- Strip the paper wall entirely. Combustible material does not belong against a live board.
- Clear the floor beneath and in front of it, then paint a keep-clear zone on the resin.
- Replace the paper with the printed kit: one KEEP CLEAR — ELECTRICAL PANEL sign at a fixed height.
- Documents move to the framed DAILY CHECKS board in the alcove (Zone 03).

WHY IT MATTERS

Paper against a live board is the cheapest fire risk in the room to remove — and the first thing an auditor photographs.

MATCHED RENDER — PLACE IMAGE HERE

Render 5 • Signage and standards kit

The printed kit: KEEP CLEAR — ELECTRICAL PANEL, FIRE EXIT — KEEP CLEAR, lint-trap and segregation signs, machine ID plates, floor-marking legend.

hf_20260808_160100_5e948227-7d15-4316-a300-7c1b59b06905.png

Corner by the fire-rated door, 0:03

CURRENT



BUDGET

Tier 0

AED 0

WHAT IS THERE NOW

- A green running-man exit sign over a fire-rated door — this room is on an escape route.
- A second distribution board, Caution — Electrical Hazard, with cabling entering below.
- Small safety notices taped at inconsistent heights beside the board.

WHAT CHANGES HERE

- Treat the whole floor as an escape route: nothing stored on it that is not on wheels.
- Mark a keep-clear zone at this board as well as the first.
- Replace taped notices with the same printed signs at one consistent height throughout.
- This zone costs nothing and is the most likely single inspection failure in the room.

WHY IT MATTERS

Nothing on this page costs money, and it is the highest-consequence zone in the report.

MATCHED RENDER — PLACE IMAGE HERE

Render 1 · Hero — the whole room upgraded

Twelve LED battens down the full length, high-level trays cleaned and painted one grey, rigid straight ducting, painted floor zones, lidded bins, clear fire exit.

hf_20260808_160100_1543a39e-4b78-460a-9cc0-f8fab6f64674.png

Side alcove, 0:05–0:07. Shown unedited: this is how dark it is.

CURRENT



BUDGET

Tier 1

AED 60

WHAT IS THERE NOW

- Mop, squeegee, bucket and a floor gully already live here — the space is in use.
- No light fitting at all, so nothing else can be stored or found in it.
- Because it is unusable, the cleaning kit and paperwork spill into the main room.

WHAT CHANGES HERE

- Fit one LED batten. That single fitting is what unlocks the whole zone.
- Then mount, in one aligned run: shadow board, PPE station, banded chemical shelf, framed DAILY CHECKS board.
- Everything currently cluttering the main room and the board wall has a home here.
- One fitting at about AED 60 — the best value line in the entire brief.

WHY IT MATTERS

One fitting. It is the only line in this brief that makes another entire zone usable.

MATCHED RENDER — PLACE IMAGE HERE

Render 4 • The lit store alcove

One LED batten, then a shadow board, PPE station, banded chemical shelf and a framed DAILY CHECKS board — all in the alcove you already own.

hf_20260808_160100_354a8998-70b7-4b24-b76c-12d1ea341dc1.png

Main run, 0:10–0:12

CURRENT



BUDGET

Tier 1 + Tier 2

AED 1,200+

WHAT IS THERE NOW

- Two fluorescent battens for the full length of a room roughly four metres tall; the far end is genuinely dark.
- High-level cable trays and mesh carrying a heavy layer of settled lint and dust.
- No floor zoning, no walkway, no machine identification. A blue drum parked loose against the wall.

WHAT CHANGES HERE

- Twelve IP65 LED battens at 4000K, evenly spaced — no dark corners, no dark far end.
- Deep clean the high-level steelwork, then paint every service one uniform matt light grey.
- Paint a yellow walkway line one metre out from the machine faces; add W1/W2 ID plates.
- Aluminium coved trim at the machine bases so lint has nowhere to lodge.

WHY IT MATTERS

Light is what makes a clean room read as clean. Two battens in a four-metre room cannot do it.

MATCHED RENDER — PLACE IMAGE HERE

Render 2 · Machine line detail

Aluminium coved trim at the machine bases, wall-mounted lidded lint bin with its sign, W1/W2 machine ID plates, painted yellow walkway line one metre out.

hf_20260808_160100_a9f95453-1fc6-4897-88ee-55b5fdfa4892.png

Staging side — clutter where the linen zone should be

Opposite the machine line, from the site photographs

CURRENT



WHAT IS THERE NOW

- A large grey panel and a wire frame stored upright against the wall, with open lint trays along the base.
- No marked bays, no staging zone, and no visible clean/soiled separation anywhere on this side.
- The wall carries services and a tiled dado but no signage system at all.

WHAT CHANGES HERE

- Remove the stored panel and frame from the room — they are the largest single obstruction in it.
- This wall is where the linen staging zone goes: painted bays on the resin floor, one trolley per bay.
- SOILED / CLEAN / RETURN signage colour-coded above each bay, so segregation is visible rather than assumed.
- Replace trolley liners rather than frames, and retire anything torn.

WHY IT MATTERS

There is no staging zone here today. Render 3 is not an upgrade of this wall — it is the zone this wall does not yet have.

BUDGET

Tier 0 + Tier 3

AED 0 + liners

MATCHED RENDER — PLACE IMAGE HERE

Render 3 · Trolley bays and linen staging

Matching trolleys parked inside painted bays, SOILED / CLEAN / RETURN signage colour-coded red and green, folded stock on stainless shelving.

hf_20260808_160100_b831b395-bb37-4260-861c-f3609fc75236.png

Far end of the run, 0:23

CURRENT



BUDGET

Establish before Tier 3

AED TBC

WHAT IS THERE NOW

- A large white bulk tank on a raised steel frame, above head height, over the working area.
- A second green exit sign sits directly below and beside it — tank over an escape route.
- Contents, secondary containment, fixing and fill method all unverified from the footage.

WHAT CHANGES HERE

- Establish what the tank holds before committing to anything in Tier 3.
- If chemical: it needs secondary containment and a check on what sits beneath it.
- If water: it needs a check on frame loading and fixing.
- Either outcome, keep the route beneath it clear and lit — the hero render shows the target condition.

WHY IT MATTERS

Everything else in Tier 3 waits on this. Do not order the chemical shelf until the tank is identified.

MATCHED RENDER — PLACE IMAGE HERE

Render 1 • Hero — the whole room upgraded

Twelve LED battens down the full length, high-level trays cleaned and painted one grey, rigid straight ducting, painted floor zones, lidded bins, clear fire exit.

hf_20260808_160100_1543a39e-4b78-460a-9cc0-f8fab6f64674.png

Rear area, 0:15–0:20

CURRENT



BUDGET

Not priced

AED —

WHAT IS THERE NOW

- Stacked washer/dryer columns against large-format grey tile — a different space at a different finish standard.
- A staff locker unit, a cardboard box on the floor, and a blue drum in the corner.
- Loose black cable draped down the wall and lying across the floor beneath an isolator.

WHAT CHANGES HERE

- Not covered by this brief, which prices the main machine room only.
- Two items apply regardless: lift the draped cable onto P-clips, and get the box off the floor.
- Say the word and this area gets surveyed and priced separately.

WHY IT MATTERS

Different space, different standard. Pricing it inside the main-room budget would understate both.

NO RENDER — AREA NOT IN SCOPE

This area was not surveyed or priced. Ask and it gets its own brief.

Budget and order of work

T I E R	S P E N D	C U M U L A T I V E	W H A T Y O U G E T
0 — Housekeeping	0	0	About 60% of the visual gain
1 — High leverage	3,160	3,160	Reads as a well-run room
2 — Ceiling	3,500	6,660	Duct fire risk removed
3 — Finishing	5,000	11,660	Audit-ready back-of-house



D O T H E S E T H R E E F I R S T – T H E Y C O S T N O T H I N G

- Zone 02 — clear the escape route. Green exit signage means the floor is not storage.
- Zone 01 — strip the paper wall off the distribution board and mark keep-clear zones at both boards.
- Zone 06 — establish what the overhead bulk tank contains before committing to Tier 3.

About the five renders

The concept renders referenced on each zone page are supplied separately — this session could not embed them, because the image host is blocked by the network policy the report was produced under. Each render panel carries the exact filename so the images drop straight into place. They are idealised concepts, not photographs of this room: use them to show intent. For evidence of what one shift of cleaning actually buys, render the upright site photographs through the prompts supplied with this brief.

F O U R - W E E K S E Q U E N C E

Week 1	ZONES 01, 02, 06	Escape route cleared, board zones marked, paper wall stripped, tank identified. Then the rest of Tier 0, including the high-level lint strip. Order Tier 1.
Week 2	ZONES 03, 04	Alcove batten in first — it gives the cleaning kit somewhere to live. Then the twelve battens, upper-wall paint, dado clean, floor deep clean.
Week 3	ZONES 01, 04, 05	Floor line painting, after wall painting and never before. Signage installed at one common height. Lidded bins and trolley bays sited and marked.
Week 4	ZONE 04	Access equipment on site: high-level clean, then ceiling services painted grey. Ducting contractor.
Ongoing	ALL	Daily check sheet on the alcove board, signed. Without it the room reverts within six weeks.