
PART No.
TGM-31-627A-xx

9 REV.

Formula:
D = OD. Shaft Part Maximum
d = OD. Small Part Maximum + 0.1
A = OD. Flank Part Maximum + 0.07
T = Lg. OD. Flank Part Maximum + 0.01
L = Lg. Under Flank Part Maximum + 0.01
B = Lg. Under Cut Part T/N. Min
C = OD. Under Cut Part T/N. Maximum + 0.01
E = OD. Under Cut R/L Part Maximum + 0.01
F = Under Cut R/L Part Min -0.05

Rt=6 (▽ = Rt=0.8)

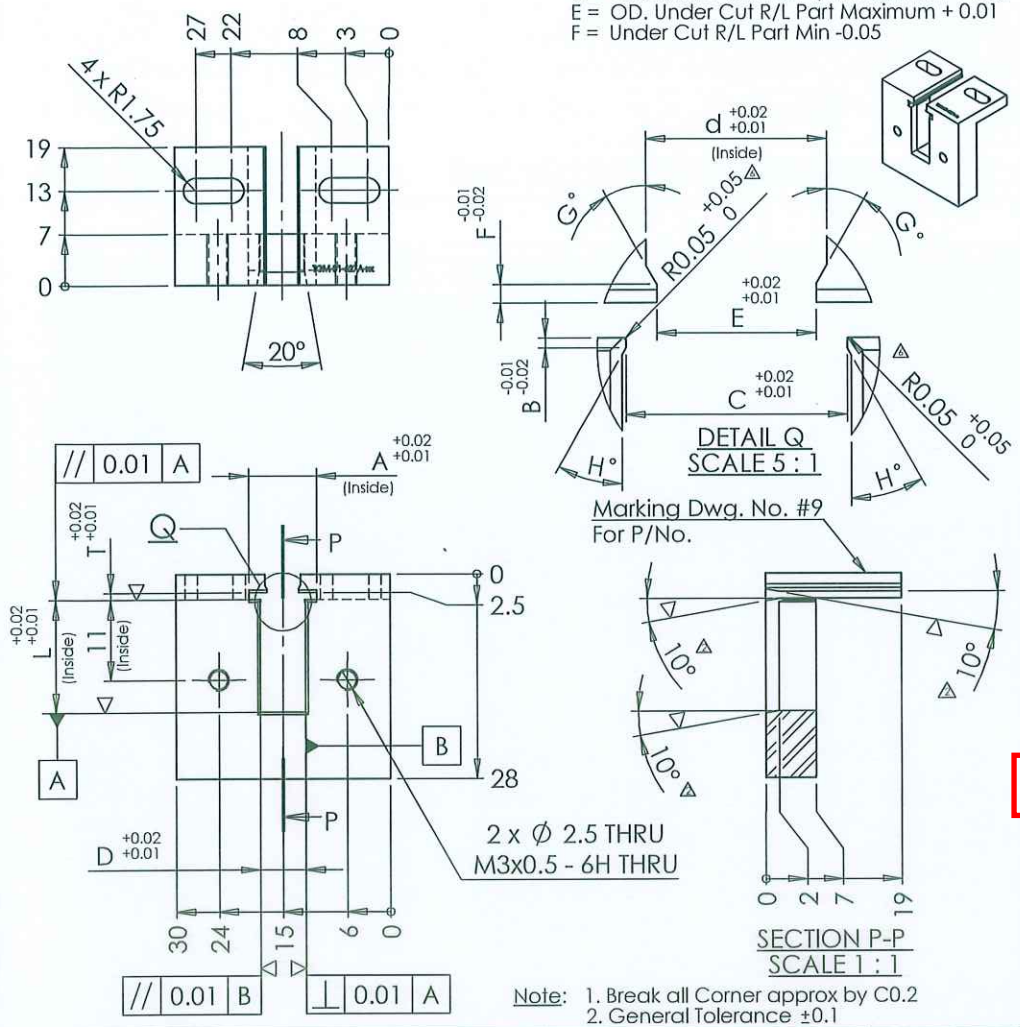

Note: 1. Break all Corner approx by C0.2
2. General Tolerance ±0.1

Item	D	d	A	T	L	B	C	E	F	G°	H°	For P/No.	Check
-91	6.38	4.37	9.54	0.934	17.99	0.35	6.17	-	-	-	45°	F30212BABP1 RQ : 424/20 F30212CAAP1 RQ:95/21 F30212BAAP1 RQ:234/20 FF3026-2-P1 RQ:164/21 FF3021-2BS2 RQ:274/22	Preecha
-92	6.38	3.7	7.59	0.916	9.267	0.56	5.98	-	-	-	45°	J30112-AAP1 RQ : 30/20	Preecha
-93	6.4	4.44	9.58	0.934	13.83	0.28	6.17	-	-	-	30°	FD3025-2AP1 RQ : 433/20 D30252AAAP1 RQ:507/21	Preecha
-94	5.05	3.77	7.99	0.58	7.75	0.28	4.82	-	-	-	30°	FD4002-2U RQ : 147/21	Preecha
-95	6.4	4.44	9.56	1.29	9.337 ⑨	0.28	6.17	-	-	-	30°	FK3003-2C RQ : 473/21 K30032CBAP1 RQ : 493/21	Preecha
-96	6.4	7.65	9.59	1.765	19.51	0.2	6.12	-	-	-	45°	FJ3012-2A RQ : 508/21 J30122AAAP1 RQ:593/21 FJ3012-2A08 RQ : 312/24	Preecha
-97	6.4	5.64	9.58	1.514	8.94	0.28	6.17	-	-	-	30°	FD5A11-2-01 RQ : 539/21	Preecha
-98	6.4	4.984	9.58	1.336	8.198	0.28	6.17	-	-	-	30°	FD5A12-2-01 RQ : 540/21	Preecha
-99	6.38	4.37	9.54	0.934	18.67	0.35	6.17	-	-	-	45°	F30232AAAP1 RQ:273/22 FF3023-2-67 RQ:597/21	Preecha
-100	6.4	4.44	9.54	1.24	14.52	0.28	6.17	-	-	-	30°	FD3002-2EP1 RQ:35/22	Preecha
-101	6.4	4.1	9.59	1.17	15.86	0.28	6.17	-	-	-	30°	FJ3013-2-P1 J30132-AAP1 RQ:168/23	Preecha
-102	5.05	3.568	8.02	0.67	12.52	0.28	4.82	-	-	-	30°	F20152AAAP1 RQ : 353/23	Preecha
-103	6.4	5.33	9.54	0.934	18.967	0.28	6.17	-	-	-	30°	FF3030-2-07 RQ : 110/24 F30302AAAP1 RQ : 277/24	Preecha
-104	6.4	5.7	9.58	2.255	18.288	0.28	6.17	-	-	-	30°	FD3030-2A-NA RQ : 193/24 FD3030-2B01-NB RQ : 256/24 FD3030-2D-NA RQ : 376/24	Preecha
-105													

Minebea Copy
18 APR 2025
Issued by GM and MIA Div.
Uncontrolled

REV.	ECN No.	DATE	NAME	DESCRIPTION
8	----	2 Jul'18	Preecha	Up Date Dwg. Rq : 355/18
9	----	8 NOV'21	Preecha	CH : Spec Item -95 9.321 => 9.337 Rq:493/21
3	----	16 Jul'13	Preecha	Change: Spec Item -02, -18 Rq. 3048
4	----	13 Sep'13	Preecha	Change: Spec Item -10 Rq. 3205
5	----	14 Jan'14	Preecha	Change: Spec Item -28 Rq. 11/15
6	----	22 Jan'15	Preecha	Add: R0.05 +0.05 0 Rq. 33/15
7	----	17 Apr'17	Preecha	Add: F20142CAAP1S1 Item 47 etc;. Rq. 191/17

UNLESS SPECIFIED ±0.1 OR R0.1
GENERAL TOLERANCE
JIS B0405 MAC ING WORKING

LESS THAN 0.5	±0.05
0.5 ~ 6	±0.1
6 ~ 30	±0.2
30 ~ 120	±0.3
120 ~ 400	±0.4
400 ~ 1000	±0.6
ANG. F	±1°

M/C. KCL-50 | Q'ty 1
MATERIAL SKD-11
FINISH Buff All Area
HEAT TREATMENT HRC 50 to 60

List Request No. 2792
3RD ANGLE
SCALE : | SHEET 6/6 | UNIT (mm.)

DETAILED	DESIGNED	CHECKED	APPROVED
Apihsek	Chonknok	Preecha	Preecha

DATE 1 Feb' 13

NMB MinebeaMitsumi Inc.
General Machining Parts Div. 1

TITLE: Jig Protect Chip (A)

PART No. TGM-31-627A-xx

9 REV.