
PART No.
TGM-31-627D-xx

1 REV.


Rt=12 (Lap Rt=0.8)

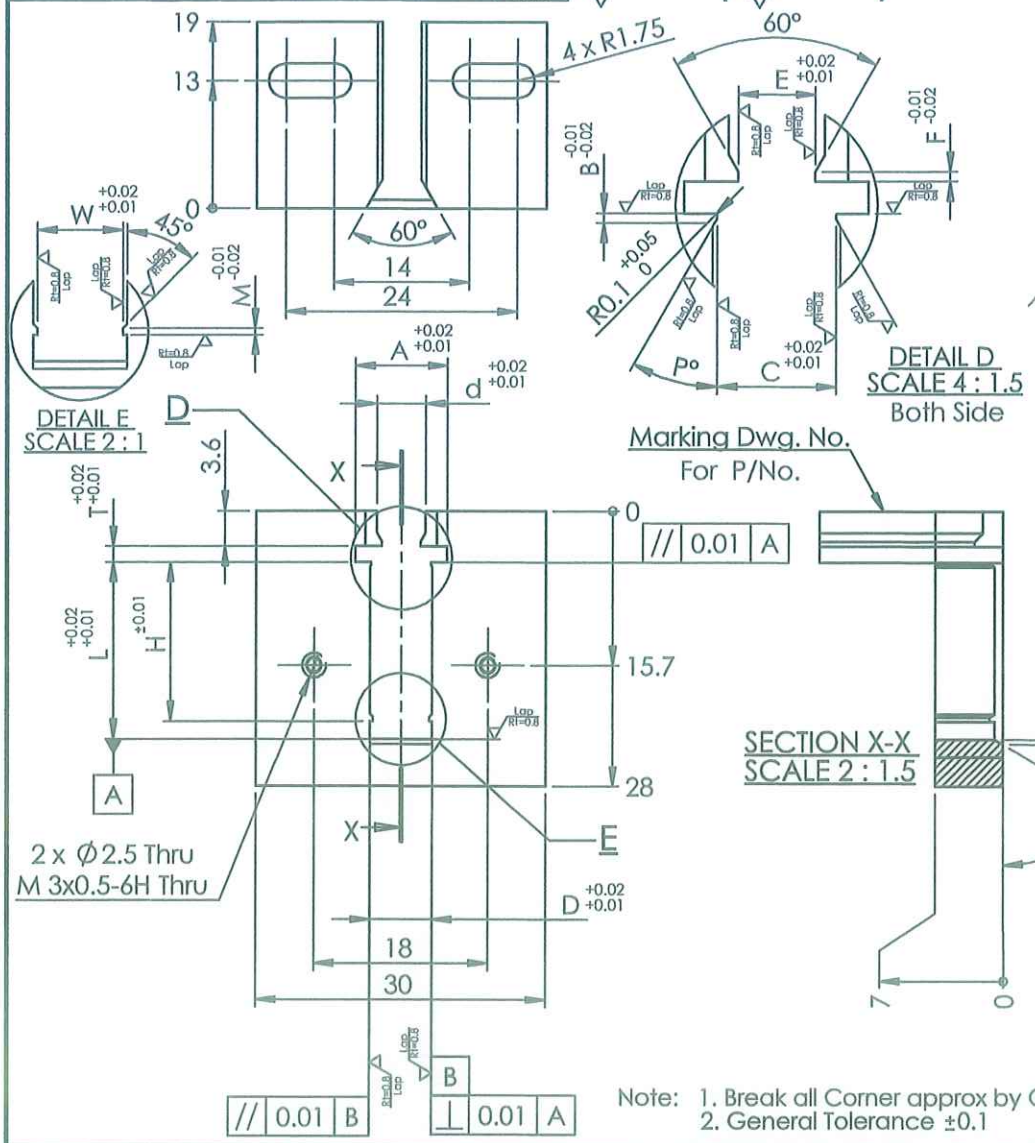

Item	D	d	A	T	L	B	C	E	F	H	W	M	P°	For P/No.	Check
-01	6.4	6.2	9.54	3	10.3	0.29	6.18	-	-	9.702	5.92	0.625	30°	F30052FCAP1 F30102ADAP1 F30182AAAP1 F30182A04AAP1 RQ:180/24	PREECHA
-02	6.4	4.5	9.54	1.62	16.6	0.28	6.16	-	-	16.2	5.82	0.44	30°	F30082GAAP1T1 RQ:434/18	PREECHA
-03	6.4	5.9	9.54	1.88	11.48	0.27	6.16	-	-	11.03	5.82	0.67	30°	F30132CAAP1 F30072EAAP2 RQ:434/18	PREECHA
-04	6.4	5.9	9.54	2.03	12.72	0.28	6.17	-	-	12.27	5.81	0.67	30°	F30172-02AAP1 RQ:434/18 F30172-34AAP1 RQ:179/24	PREECHA
-05	6.4	5.9	9.54	2.98	10.24	0.29	6.17	-	-	9.712	5.905	0.625	30°	F30182AACP4T1 F30102CAFP1T2 Rq : 273/25	Preecha
-06															
-07															
-08															
-09															
-10															

MinebeaMitsumi Inc.
Copy Issued Uncontrolled
22/9/2568
Engineering Design center
G/M.1 & M/A. Div.

Note: 1. Break all Corner approx by C0.2
2. General Tolerance ±0.1

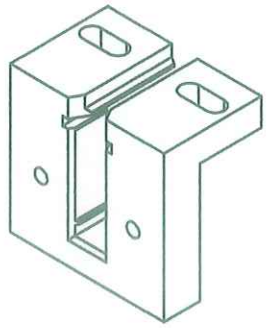

Formula: D = OD. Shaft Part Maximum
d = OD. Small Part Maximum + 0.1
A = OD. Flank Part Maximum + 0.07
T = Lg. OD. Flank Part Maximum + 0.01
L = Lg. Under Flank Part Maximum + 0.01
B = Lg. Under Cut Part T/N. Min
C = OD. Under Cut Part T/N. Maximum + 0.01
E = OD. Under Cut R/L Part Maximum + 0.01
F = Under Cut R/L Part Min -0.05
H = Under Cut Flank - Lg. OD. Guide -0.03
W = OD. Groove Maximum + 0.02
M = Lg. OD. Groove Min

REV.	ECN No.	DATE	NAME	DESCRIPTION
1	---	---	---	ENGINEERING RELEASE

UNLESS SPECIFIED C0.1 OR R0.1 GENERAL TOLERANCE JISB0405 MACHING WORKING	
LESS THAN 0.5	±0.05
0.5 ~ 6	±0.1
6 ~ 30	±0.2
30 ~ 120	±0.3
120 ~ 400	±0.4
400 ~ 1000	±0.8
ANGLE	±1°

0.8S 6.3S 25S 100S ~ UNCUT

M/C. KCL-50 Q'ty 1
MATERIAL SKD-11
FINISH Buff All Area
HEAT TREATMENT HRC 50-60

List Request No. 399/18
3 RD ANGLE
SCALE : SHEET / UNIT (mm.)

DETAILED	DESIGNED	CHECKED	APPROVED
Phalachai	Aphisek	Preecha	Preecha

DATE 16 Jul' 18

NMB MinebeaMitsumi Inc.
General Machining Parts Div. 1

TITLE: Jig Protect Chip (D)

PART No. TGM-31-627D-~~xx~~ 05

1 REV.