

Fluke Digital Multimeters Solutions for every need



How to choose the best DMM for your job


Choosing the right digital multimeter (DMM) requires thinking about what you'll be using it for. Evaluate your basic measurement needs and job requirements and then take a look at special features/functions built into many multimeters. Think about whether you need to do basic measurements, or if you need the more advanced troubleshooting options offered by special features.

Factors to consider:

- Your work environment (voltage level, types of equipment, types of measurements, applications)
- Specialty features/functions (capacitance, frequency, temperature, non-contact voltage, low impedance mode, min-max record, data logging, trending)
- Resolution and accuracy (6,000, 20,000, or 50,000 count resolution)

Safety

The increased occurrence and levels of transient overvoltages in today's power systems have given rise to more stringent safety standards for electrical measurement equipment. Transients that ride on top of power sources (mains, feeder or branch circuits) can trigger a sequence of events that may lead to serious injury. Test equipment must be designed to protect people working in this high-voltage, high-current environment.

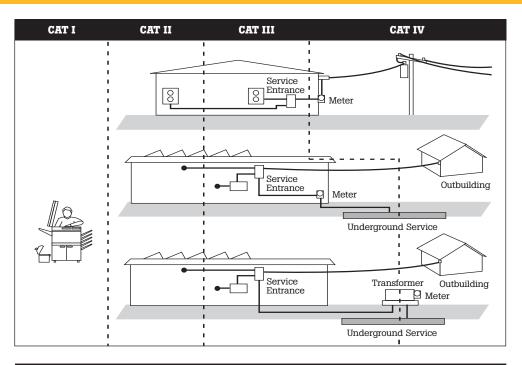

Measurement category	In brief	Examples
CAT I	Electronic	Protected electronic equipment Equipment connected to (source) circuits in which measures are taken to limit transient overvoltages to an appropriately low level Any high-voltage, low-energy source derived from a high-winding resistance transformer, such as the high-voltage section of a copier
CAT II	Appliances, PCs, and TVs	Appliance, portable tools, and other household and similar loads Outlet and long branch circuits Outlets at more than 10 meters (30 feet) from CAT III source Outlets at more that 20 meters (60 feet) from CAT IV source
CAT III	MC panels, etc.	Equipment in fixed installations, such as switchgear and polyphase motors Bus and feeder in industrial plants Feeders and short branch circuits, distribution panel devices Lighting systems in larger buildings Heavy appliance outlets with short connections to service entrance
CAT IV	Three-phase at utility connection, any outdoor conductors	Refers to the "origin of installation," i.e., where low-voltage connection is made to utility power Electricity meters, primary overcurrent protection equipment Outside and service entrance, service drop from pole to building, run between meter and panel Overhead line to detached building, underground line to well pump

Digital Multimeter selection chart

	Best for	Applications	Recommended DMM		
	Advanced industrial troubleshooting, including	Logging: For unattended monitoring of signals over time, to detect intermittent problems.	289		
	datalogging and graphing intermittent problems	Graphing: View logged values graphically in the field right on the meter, without a PC.			
		Working on VSD's: Take accurate voltage, current and frequency measurements on the output side of the drive at either the drive itself or the motor terminals.			
SIC		Testing motor windings or contact resistance: Allows testing of resistance up to 50 ohms with one milliohm (0.001 ohm) resolution.			
meters	Advanced electronic applications, including	Logging: For unattended monitoring of signals over time, characterize device performance.	287		
	datalogging and graphing intermittent problems	Graphing: View logged values graphically in the field right on the meter, without a PC.	0.05 mg		
Advanced		Monitoring two parameters at the same time: Dual display allows for monitoring of two selectable parameters.			
lva		Performance testing: Testing the frequency response of amplifiers and audio transmission line.			
Ac	Industrial troubleshooting	Working on VSD's: Take accurate voltage, current and frequency measurements on the output side of the drive at either the drive itself or at the motor terminals.	87V		
		Industrial troubleshooting: All of the resolution and accuracy you need to solve more problems on motor drives, in-plant automation, power distribution, and electromechanical equipment.			
		Checking power quality: Capture glitches and spikes as short as 250 μs. Identify irregular signals.			
	Industrial troubleshooting in explosive environments	Safety and compliance: Unlike most other ATEX-certified tools, can be used both inside and outside the hazardous zone (ATEX Zones 1 & 2) without compromising performance or compliance.	87V Ex		
		Industrial troubleshooting: All the functionality necessary for most industrial troubleshooting jobs.			
ers	Automotive troubleshooting	Troubleshoot variety of problems on conventional and hybrid vehicles: Millisecond pulse width measurements for fuel injectors, RPM readings for both DIS and conventional ignitions with optional inductive pickup.	88V		
y mete		Automotive testing: alternator diodes, duty cycle, solenoids, breaker points, wiring, switches, and more.			
pecialty	Harsh environments requiring dustproof and waterproof test equipment	28 II/ 27 II			
Sp		Working on VSD's: Take accurate voltage, current and frequency measurements on the output side of the drive at either the drive itself or at the motor terminals. (28 II only)	New		
	Applications where display positioning is problematic	Remote monitoring: View meter display up to 30 feet away from the measurement point. Observe meter real-time readings remotely.	233		
		Inconvenient measurements: Remote magnetic display solves three handed problem.			
		Electrical Maintenance: All the features and functions of a conventional multimeter.	New		



	Best for	Applications	Recommended DMM		
ters	Every day use requiring true-rms, accurate, rugged meter	Industrial troubleshooting: Applications requiring exceptional ease-of-use, ruggedness and reliability.	179		
pose met		Electrical maintenance and troubleshooting: Variety of commercial electrical troubleshooting, installation and maintenance.			
sod		Temperature measurements: Built-in thermometer conveniently allows you to take temperature readings without having to carry a separate instrument.			
ral pur	Every day use requiring average responding, accurate, rugged meter	Industrial troubleshooting: Applications requiring exceptional ease-of-use, ruggedness and reliability.	77 IV		
General		Electrical maintenance and troubleshooting: Variety of commercial electrical troubleshooting, installation and maintenance.			
	Wide variety of electrical work	Electrical maintenance troubleshooting: When you need to eliminate false or "ghost" voltages or perform continuity, connection or basic wiring checks.	117		
		Non-contact voltage detection: Integrated non-contact voltage detection simplifies many tasks.			
ırs	HVAC troubleshooting	Residential HVAC maintenance: Lower voltage HVAC residential maintenance, installation and troubleshooting.	116		
ompact meters		Temperature and microamp measurements: Troubleshooting problems with HVAC equipment and flame sensors.			
Compac	Electronic and field service applications	Electronic troubleshooting: Troubleshoot a wide variety of measurement parameters, including frequency and capacitance.	115		
	Utility applications involving basic electrical tests	Revenue meter tests: Involving meter sets and reconnects, capacitor checks, detection of absence or presence of voltage, and for continuity, connections or basic wiring checks.	113		
		Simultaneous voltage and continuity checks: Vcheck LoZ low impedance function allows users to check voltage and continuity simultaneously.			

Meters designed for the way you work.

		dvanced mete	ers		S	pecialty mete	
Models	289	287	87 V	87V EX	88V	28 II	27
Basic features							
Counts	50000	50000	20000	20000	20000	20000	60
True-rms readings	ac+dc	ac+dc	ac	ac	ac	ac	
Basic dc accuracy	0.025 %	0.025 %	0.05 %	0.05 %	0.1 %	0.05 %	0.1
Wide bandwidth	100 kHz	100 kHz	20 kHz	20 kHz	5 kHz	20 kHz	30 1
Auto/manual ranging	•/•	•/•	•/•	•/•	•/•	•/•	•/
Digits	41/2	41/2	41/2	41/2	41/2	41/2	31
ATEX II 2G Eex ia IICT4 safety rating Zone 1 and Zone 2				•			
Measurements							
Voltage ac/dc	1000 V	100					
Current ac/dc	10 A	10					
Resistance	500 ΜΩ	500 ΜΩ	50 MΩ	50 MΩ	50 MΩ	50 MΩ	50 1
Frequency	1 MHz	1 MHz	200 kHz	200 kHz	200 kHz	200 kHz	200
Capacitance	50,000 μF	50,000 μF	10,000 μF	10,000 μF	10,000 μF	10,000 μF	10,00
Temperature	(+) 1350 °C	(+) 1350 °C	(+) 1090 °C	(+) 1090 °C	(+) 1090 °C	(+) 1090 °C	
dB	60 dB	60 dB					
Conductance	50 nS	50 nS	60				
Duty cycle/pulse width	•/•	•/•	•/-	•/-	•/-	•/-	•/
Continuity/diode test	•	•	•	•	•	•	•
Motor Drive (ASD) measurements	•		•	•		•	
RPM					•		
VoltAlert™, non-contact voltage detection							
VCHEK [™]							
LoZ: low input impedance	•						
Lo Ohms	•					•	
Microamps	•	•	•	•	•	•	
Display							1
Removable wireless remote display	•						
Dot matrix display	•	•					
Dual display Analog bargraph	•	•		•	•	•	
Backlight	Two level	Two					
Graphical trend display	1 WO level	1 WO level	1 WO level	1 WO TEVEL	I WO level	I WO level	1 000
Diagnostics and data	-						
Min Max recording/with time stamp	•/•	•/•	•/-	•/-	•/-	•/-	•/
Fast Min Max	250 μs	250 µs	,				
Display Hold/Auto (Touch) Hold	•/•	•/•	•/•	•/•	•/•	•/•	•/
Relative reference	•	•	•	•	•	•	,
Stand alone logging	•	•					
Trend Capture	•	•					
Readings memories	10,000	10,000					
USB interface	•	•					
Other features							1
Automatic selection, ac/dc volts							
Real time clock	•	•					
Overmolded case, integrated holster	•	•					
Removable holster			•	•	•	•	
Closed case calibration	•	•	•	•	•	•	
Separate battery/fuse access	•/•	•/•	•/-	•/-	•/-	•/-	•/
Completely sealed/watertight						•	
Automatic power off	•	•	•	•	•	•	
Low battery indication	•	•	•	•	•	•	
Operating temperature range	-20 °C ,+55 °C	-20 °C, +55 °C	-40 °C ,+55 °C	-40 °C ,			
Warranty and electrical safety							
Warranty (years)	Lifetime	Lifetime	Lifetime	Lifetime	Lifetime	Lifetime	Lifet
Input alert	•	•	•	•	•	•	
Dangerous voltage indication	•	•	•	•	•	•	
IP Rating	IP 42	IP 42	IP 30	IP 44	IP 30	IP 67	IP
EN61010-1 CAT III	1000 V	100					
EN61010-1 CAT IV	600 V	600					



		General purpose meters			Compact meters			
II	233	179	77 IV	117	116	115	114	113
	20000	2000	0000	2000	0000	0000	0000	0000
)	20000	6000	6000	6000	6000	6000	6000	6000
o o	ac 0.25 %	ac 0.09 %	0.3 %	ac 0.5 %	ac 0.5 %	ac 0.5 %	0.5 %	ac 0.5 %
łz	0.20 //	0.00 70	0.5 70	0.5 70	0.5 70	0.0 %	0.0 %	0.5 70
.12	•/•	•/•	•/•	•/•	•/•	•/•	•/•	•/•
	31/2	31/2	31/2	31/2	31/2	31/2	31/2	31/2
	0 /2	0.12	0.12	<i>C72</i>	0.12	0.12	0.12	0.12
V	1000 V	1000 V	1000 V	600 V	600 V	600 V	600 V	600 V
A A	10 A	10 A	10 A	10 A	600 μA	10 A	000 V	000 1
ÍΩ	40 ΜΩ	50 MΩ	50 MΩ	40 ΜΩ	40 ΜΩ	40 ΜΩ	40 MΩ	60 kΩ
кНz	50 kHz	100 kHz	100 kHz	50 kHz	50 kHz	50 kHz		
) μF	10,000 μF	10,000 μF	10,000 μF	10,000 μF	10,000 μF	10,000 μF		10,000 μF
	(+) 400 °C	(+) 400 °C			(+) 400 °C			
ıS								
-								
	•	•	•	•	•	•	•	•
				•				
				•	•		•	•
				-				
					•			
	•							
orrol	•	•	•	•	•	•	•	•
evel	•			•			•	
-	•/-	•/-	•/-	•/-	•/-	•/-	•/-	•/-
•	•/•	•/•	•/•	•/-	•/-	•/-	•/-	•/-
			I	•	•	•	•	•
	•	•	•					
			_	•	•	•	•	•
	•/-	•/-	•/-	•	•	•	•	•
-	•/-	•/-	•/-	•	•	•	•	•
	•	•	•	•	•	•	•	•
-55 °C	-10 °C, +50 °C	-10 °C, +50 °C	-10 °C, +50 °C	• -10 °C, +50 °C	-10 °C, +50 °C			
-55 0	-10 0, +50 0	-10 0, +50 0	-10 0, +50 0	-10 0, +30 0	-10 0, +50 0	-10 0, +50 0	-10 6, +50 6	-10 0, +50 0
me	Three	Lifetime	Lifetime	Three	Three	Three	Three	Three
	•	•	•	•	•	•	•	•
7				IP 42	IP 42	IP 42	IP 42	IP 42
V	1000 V	1000 V	1000 V	600 V	600 V	600 V	600 V	600 V
I	600 V	600 V	600 V					300 V