
HQ and branch failover validation

Production network / 3 branches and headquarters

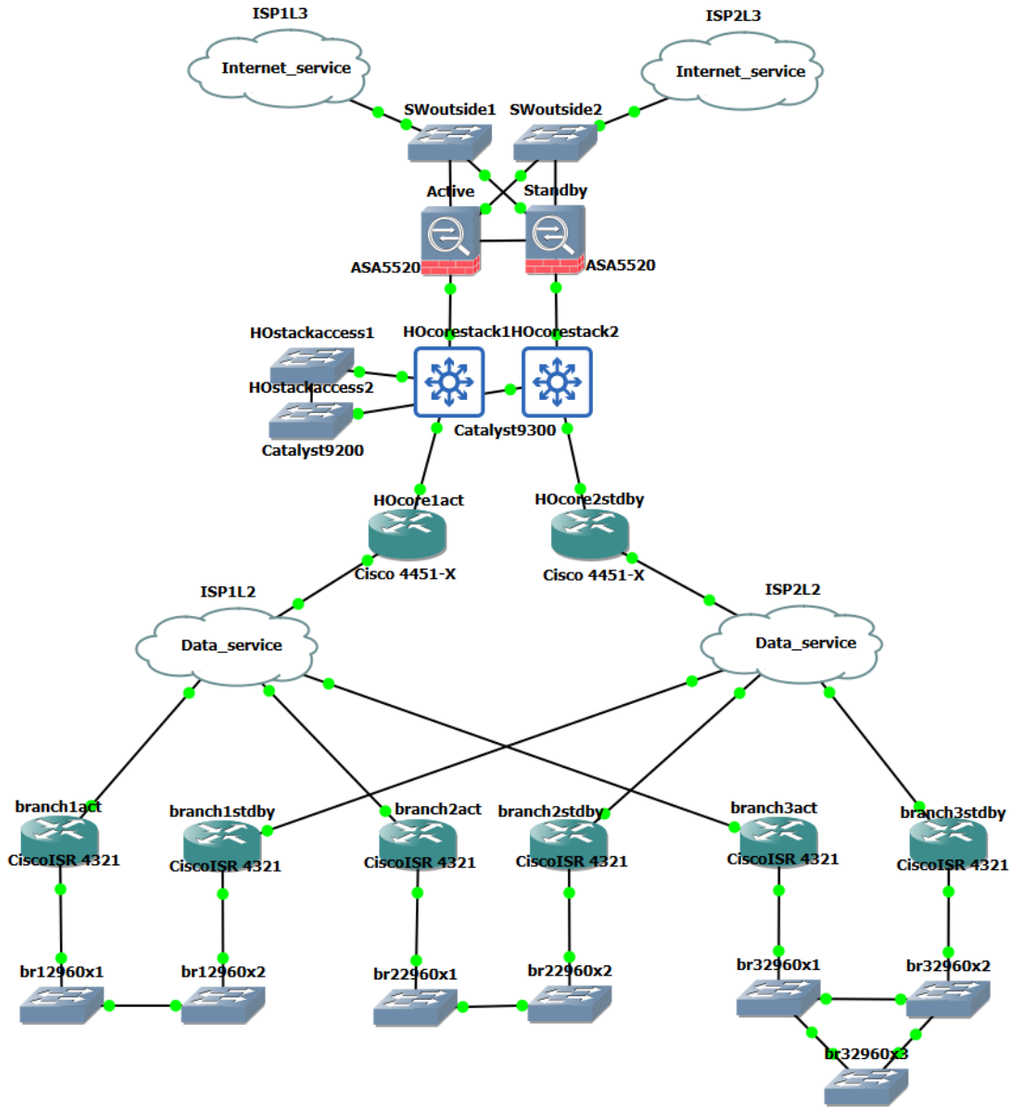

Reported test results / 6 of 6 passed

Branch primary data circuit

PASS

The primary branch path failed. IP SLA tracking triggered HSRP failover, and EIGRP selected the backup IPsec tunnel for return traffic from HQ.

Active branch router

PASS

The active ISR 4321 failed. Its peer took over the HSRP virtual gateway and restored branch-to-HQ connectivity.

Active HQ router

PASS

The active ISR 4451-X failed. Its peer took over the HSRP gateways for HQ users and the ASA pair, restoring reachability to the branches.

HQ core stack member

PASS

One Catalyst 9300 stack member failed. The surviving member forwarded HQ traffic over the remaining links.

Active HQ firewall

PASS

The active ASA 5520 failed. The standby firewall became active and restored Internet access.

Primary Internet provider

PASS

The primary HQ Internet service (ISP1L3) failed. Internet traffic switched to the secondary provider (ISP2L3).