
Fintech enterprise failover validation

Palo Alto perimeter / Catalyst core and access / FortiGate firewall tiers / IPsec-OSPF

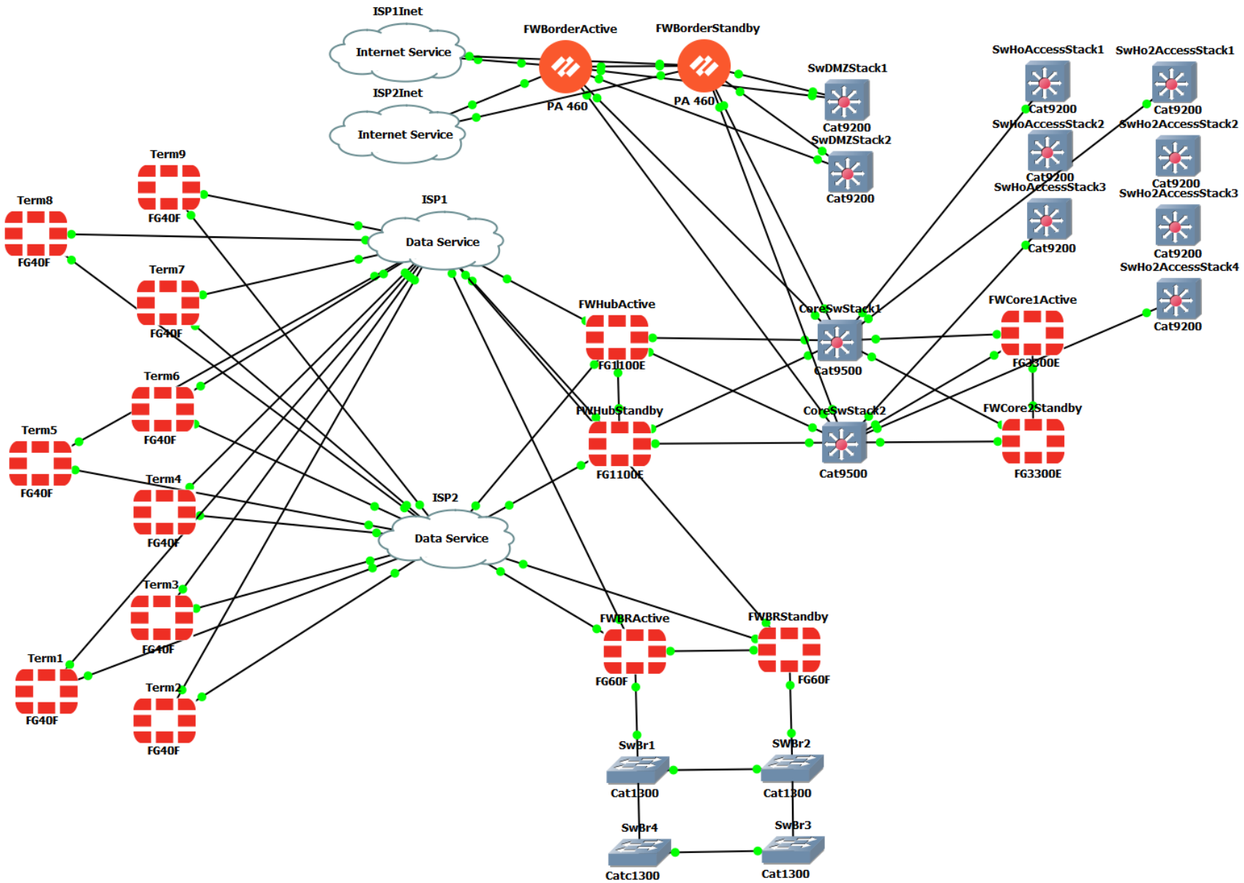

Reported test results / All passed

Perimeter ISP1 failure — PASS
External BGP path switched to ISP2; service reachability recovered.

Perimeter PA-460 shutdown — PASS
Standby Palo Alto assumed active forwarding after primary hardware failure.

Perimeter monitored-link loss — PASS
HA interface monitoring triggered takeover to the standby firewall.

Catalyst 9500 stack-member failure — PASS
Switching and firewall connectivity recovered through the remaining core member.

Catalyst 9200 DMZ member failure — PASS
DMZ connectivity recovered through the remaining member of the switch stack.

HA aggregate member-link failure — PASS
On all HA clusters using monitored LACP aggregates, simulated single-member link failure preserved traffic flow without HA failover.

FortiGate 3300E hardware failure — PASS
Secondary firewall assumed the gateway and security enforcement role.

FortiGate 3300E monitored-port loss — PASS
Internal HA role changed following loss of a monitored LAN connection.

FortiGate 1100E hardware failure — PASS
VPN hub standby took over; connectivity and routing recovered.

FortiGate 1100E monitored-port loss — PASS
VPN hub HA takeover recovered connectivity after link failure.

Branch FortiGate 60F hardware failure — PASS
Standby branch firewall assumed forwarding and VPN connectivity recovered.

Branch switch and Rapid PVST recovery — PASS
Switch 2 assumed root role when Switch 1 failed; branch connectivity recovered.

Branch firewall LAN link loss — PASS
Port monitoring triggered branch FortiGate HA failover.

Branch primary ISP/tunnel failure — PASS
OSPF removed the failed preferred path and selected the surviving tunnel.

Remote terminal ISP1/tunnel failure — PASS
OSPF selected the higher-cost backup IPsec tunnel after the primary failed.

Results supplied by project owner; no independent measurement or convergence-time claim is implied.