
HQ and branch failover validation

Production network / 3 branches and headquarters

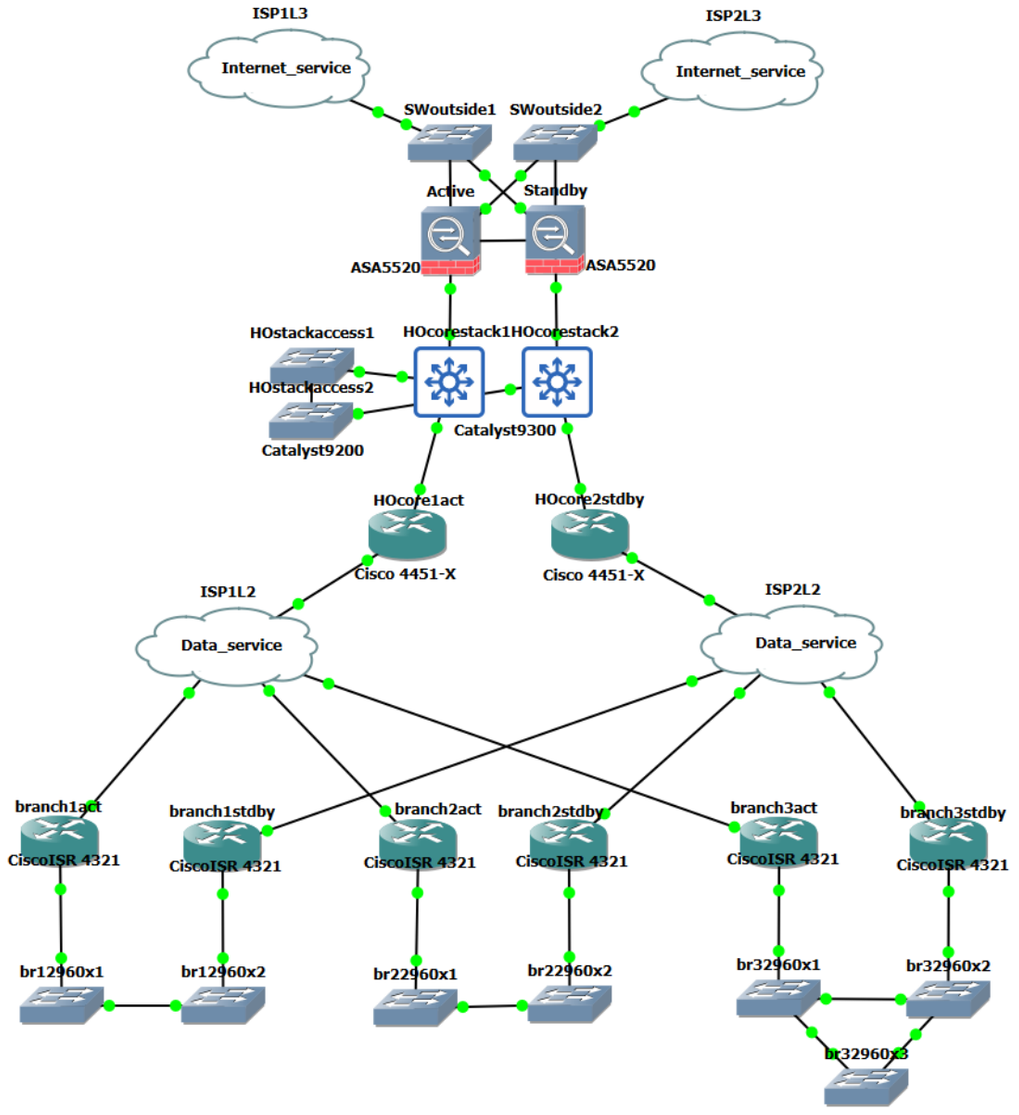

Reported test results / 6 of 6 passed

Branch primary data circuit — PASS

When the primary branch data circuit failed, IP SLA tracking triggered HSRP failover. The standby branch router became the active gateway and forwarded traffic to and from HQ through the backup IPsec tunnel.

Active branch router — PASS

The active ISR 4321 failed. Its peer took over the HSRP virtual gateway and restored branch-to-HQ connectivity.

Active HQ router — PASS

The active ISR 4451-X failed. Its peer took over the HSRP gateways for HQ users and the ASA pair, restoring reachability to the branches.

HQ core stack member — PASS

A simulated failure of Catalyst 9300 stack member 1 brought down the active ASA's inside link. ASA interface monitoring detected the link loss and triggered automatic failover. The standby ASA connected to stack member 2 became active and resumed forwarding HQ Internet traffic.

Active HQ firewall — PASS

The active ASA 5520 failed. The standby firewall became active and restored Internet access.

Primary Internet provider — PASS

The primary HQ Internet service (ISP1L3) failed. Internet traffic switched to the secondary provider (ISP2L3).