
2 3 4

## **Bill Of Materials**

Line #	Designator	Qua ntity	Manufacturer Part Number			
1	C1	1	EEE-FT1V101AP			
2	C2, C3	2	GRT31CR61H106ME01L			
3	C4, C6, C9, C10, C14, C15, C16, C18, C23	9	C0805C104K5RACTU			
4	C5, C13, C20	3	C0805C225K4RACTU			
5	C7	1	C0805C103K5RACTU			
6	C8	1	C0805C510K5GACTU			
7	C11, C12, C17, C19	4	GRM32ER61A107ME20L			
8	C21, C22	2	SCCT20E106SRB			
9	DZ1	1	BZT52C10-E3-08			
10	EXT1	1	SSQ-120-03-T-D			
11	FID1, FID2, FID3	3	33 (23 33 . 2			
12	J1	1	691322110002			
13	J2	1	5-146256-3			
14	J3	1	HLE-120-02-F-DV-BE			
15	J4	1	SSQ-102-01-T-S			
16	JP1	1	22-28-4023			
17	L1	1	XAL6060-103MEB			
18	L2	1				
19		1	XAL5030-222MEB			
	LD1		LTST-S220KGKT			
20	LD2	1	LTST-S220KSKT			
21	LNK1	1	2-881545-2			
22	PB1	1	1-1825027-4			
23	PL1	1	691361100002			
24	Q1, Q2	2	DMP6023LFG			
25	Q3	1	SISA88DN-T1-GE3			
26	Q4, Q5, Q6	3	BSS138K-13			
27	R1, R3, R7, R24, R27	5	RC0805FR-07100KL			
28	R2, R5, R11, R12, R20, R23, R26	7	RC0805FR-07200KL			
29	R4, R16	2	RC0805FR-0739KL			
30	R6	1	RC0805FR-0710KL			
31	R8, R13, R14, R19	4	RC0805FR-074K7L			
32	R9	1	RC0805FR-0788K7L			
33	R10	1	RC0805FR-0722KL			
34	R15	1	RC0805FR-07120KL			
35	R17	1	RC0805FR-071KL			
36	R18	1	KRL2012E-M-R010-F-T5			
37	R21, R22	2	RC0805FR-071M05L			
38	R25	1	RC0805FR-0722K1L			
39	TVS1	1	SMAJ26CA			
40	U1	1	MBT3946DW1T1G			
41	U2	1	LMR23630AFDDAR			
42	U3	1	LTC4041IUFD#PBF			
43	U4	1	ATTINY25-20SUR			
.0			71.111.120 200011			

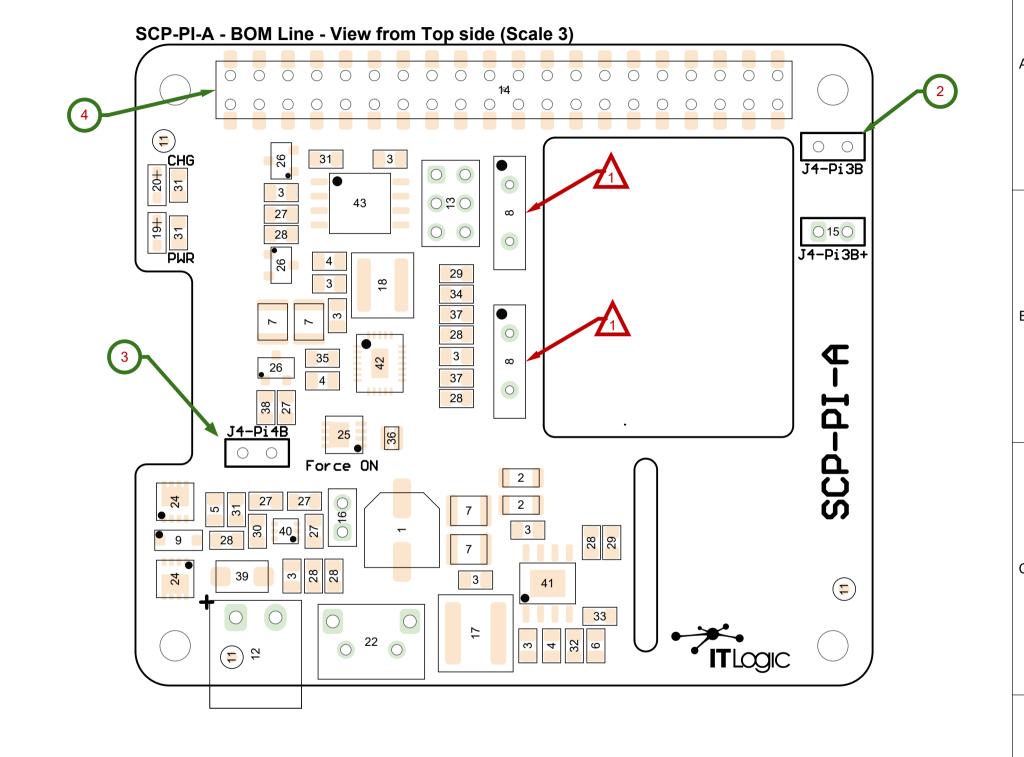

## **Assembly Notes**

Place C21, C22 (#9) Orizontally and on the TOP Side - Apply glue around the PCB

(2) Place J4 (#17) if the raspberry is a PI 3 Model B

3 Place J4 (#17) if the raspberry is a Pl 4 Model B

(4) Place EXT1 (#12) under the board and press firmily untill the pins will come out completely form connector J3 (#16)

Project: SuperCa	p UPS Rasp Pi	Revision: A
Title: Board Assem	bly	
Sheet: 1 of 1	Author: acortellini	ITI COUC O A A A
Date: Nov-02-2019 L	License: CC BY-NC-SA 4.0	

2 3