

NAO flasher

Table of Contents

Description

Software installation

Use instructions

Release Notes

Description

NAO flasher is a tool that can be used to create a bootable key with a NAOqi image to change the NAOqi version of a robot or make a Factory Reset.

Software installation

Download the NAOFlasher version corresponding to the Operating System of your computer:

OS	64 bits
Linux	Linux 64
Mac	Mac 64
Windows	Windows 64

Use instructions

Use Diskpart to clean your USB stick

1. Go to the windows tab and type **diskpart**.
2. Press **Enter** or click on the icon to start the program.
3. Use the following commands (numbers refer to the picture):
 - 1) **list volume** : this list all the volumes on your computer.
Find the line that corresponds to your USB stick and remember the corresponding letter (Ltr column).
 - 2) **select volume X** : this enable you to do actions on the USB drive.
Replace X with your USB drive letter.
 - 3) **clean**: this erase all data and partitions on the volume.
- 4) **exit**: it closes DISKPART.

```

Microsoft DiskPart version 6.1.7600
Copyright (C) 1997-2006 Microsoft Corporation.
On computer: EM-WIN7-P0

DISKPART> list volume 1

Volume ### Ltr Label          Fs      Type          Size      Status       Info
-----
Volume 0    D:             FAT16    Partition     100 MB     Healthy
Volume 1    F:             FAT32    Partition     100 MB     Healthy
Volume 2    E:             NTFS     Partition     100 MB     Healthy
Volume 3    C:             NTFS     Partition     100 MB     Healthy
Volume 4    G:             NTFS     Partition     100 MB     Healthy

DISKPART> select volume G 2

Volume 4 is the selected volume.

DISKPART> clean 3

DiskPart succeeded in cleaning the disk.


DISKPART> exit 1
  
```

Write the NAOqi image system on your USB stick

Download the NAOqi system image you need on [Aldebaran GitHub](https://github.com/aldebaran).

⚠ Your USB stick must have a capacity superior or equal to **8Gb**.

1. Plug your cleaned USB stick to your computer.
- ⚠ If a window opens to inform you that there is a problem with your USB stick and that you should format your USB stick, ignore this warning and close the window.
2. Start **flasher.bat**.
3. click **File > Open image** or **Browse** button, and select the NAO qi image you want to flash. 4. If your USB stick is not already selected, select it in the list next to **Choose your usb stick**.
- 💡 If you plug your USB stick after starting **flasher.bat**, click the **Refresh** button to make your USB stick appear in the list.

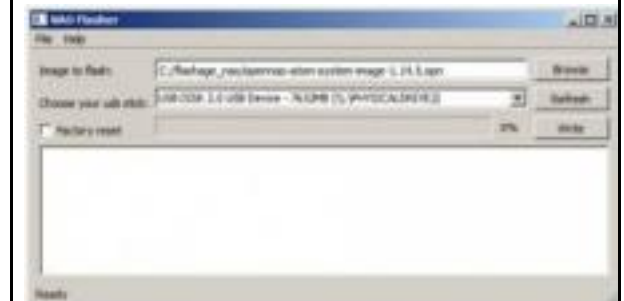

5. If you want to use this USB stick to perform a Factory reset, check the **Factory reset** option.




A Factory reset deletes all data from your robot.

6. Click the **Write** button to start writing the NAO qi image system on your USB stick. 7. If you get the following error message: “the USB drive contains a file system”, clean your USB stick and start over.

8. When the process is complete, you get the following message: “Done! You can now remove your usb drive from your computer”.

9. Close NAO flasher.

10. Unplug your USB stick from your computer.

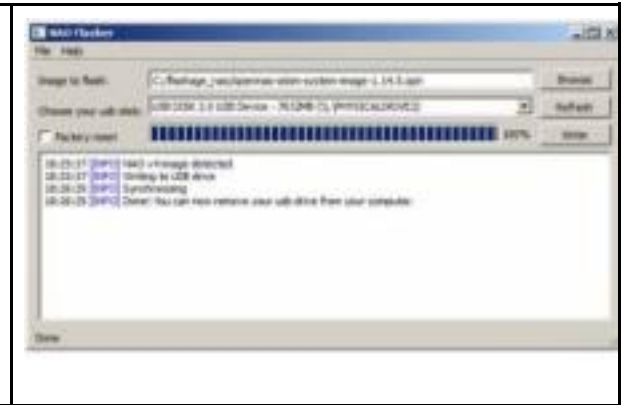

Release Notes

Version	Description
Version	This version of NAO flasher is the only version at the moment. Nevertheless, make sure you have the correct NAOqi images.

Last update: **2026/01/14**