
# INY5 M07J


## 2041L2 NOK . CAMBAIR PIN

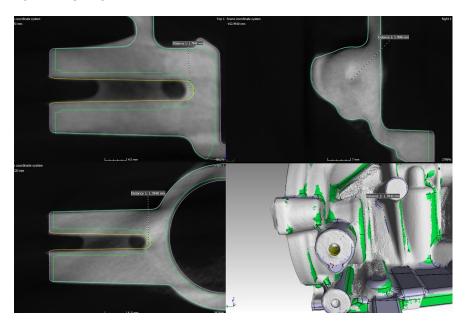


## REMEDIDA OK


F10	1.0774			
	3.0774	0.0000	2.0000	3.0774
X	-172.1291	-172.0888		-0.0403
Y	162.5405	162.0805		0.4600
Z	-94.4966	-93.0288		-1.4678
fo	rma paso sup acoplami	iento		

## EXCESO DE MATERIAL ES NECESARIO APORTAR MATERIAL AL MOLDE

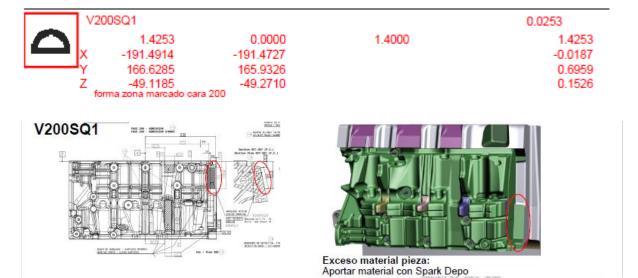



FALTA DE MATERIAL LIMPIAR MOLDE



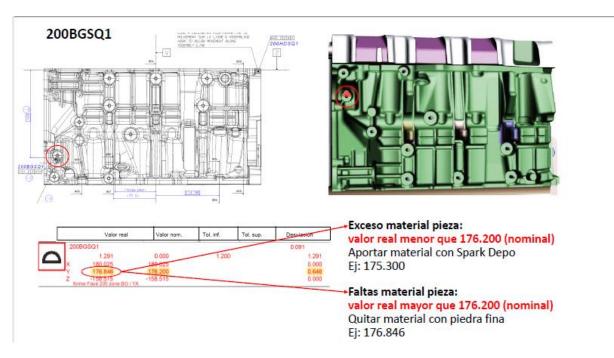


### **CAMBIAR PIN**







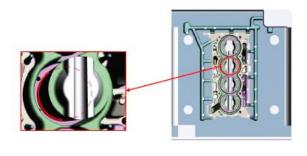

Exceso material pieza: Aportar material con Spark Depo

## LIMPIAR ZONA EN EL MOLDE

600L1				0.0171
207.9171	207.3000	207.9000	206.7000	0.6171
loc cara 600 en Z				

FP2	P2L2			0.2088
<b>(1)</b>	1.4088	0.0000	1.2000	1.4088
Y	-57.9956 c paso cara paliers (58,7	-58.7000 ) Z=205		0.7044

