

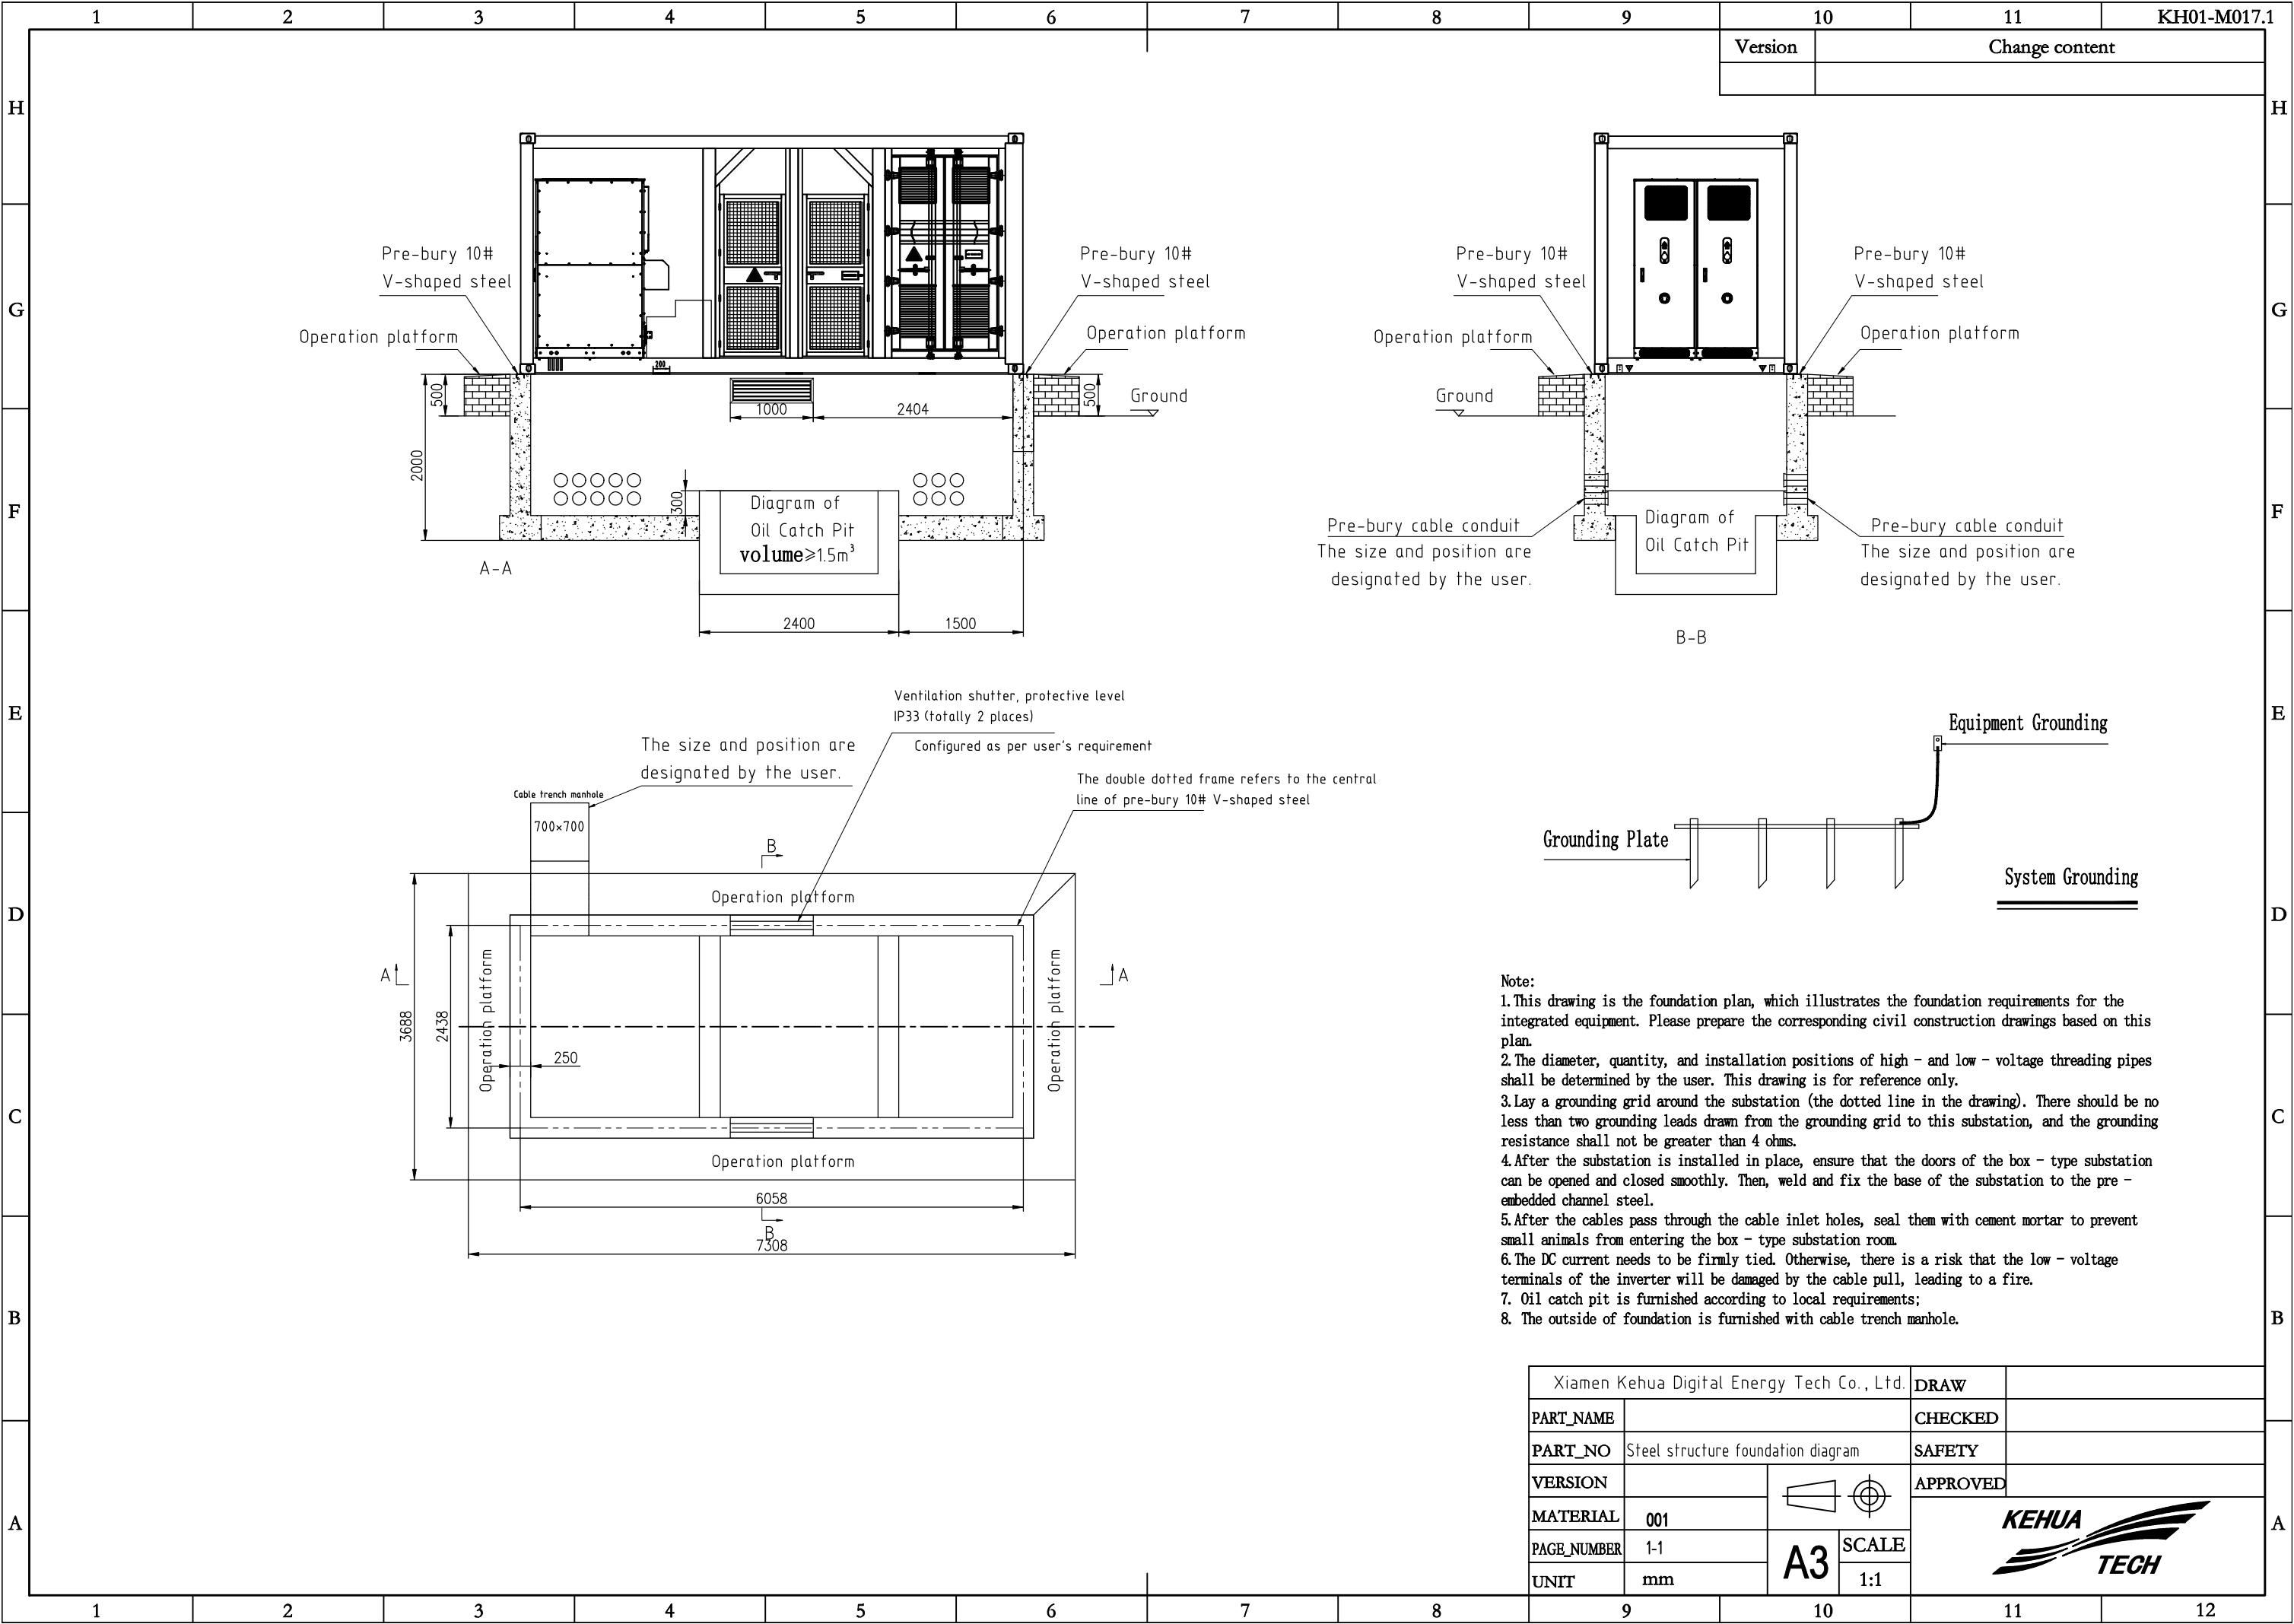
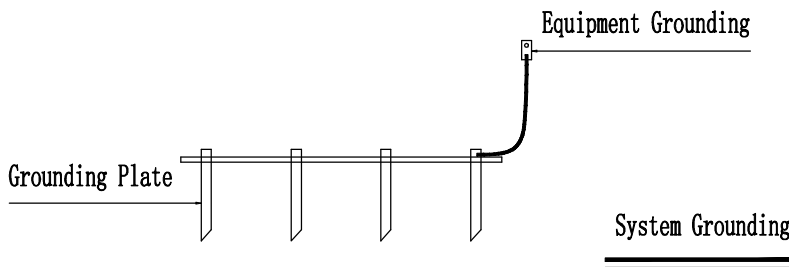
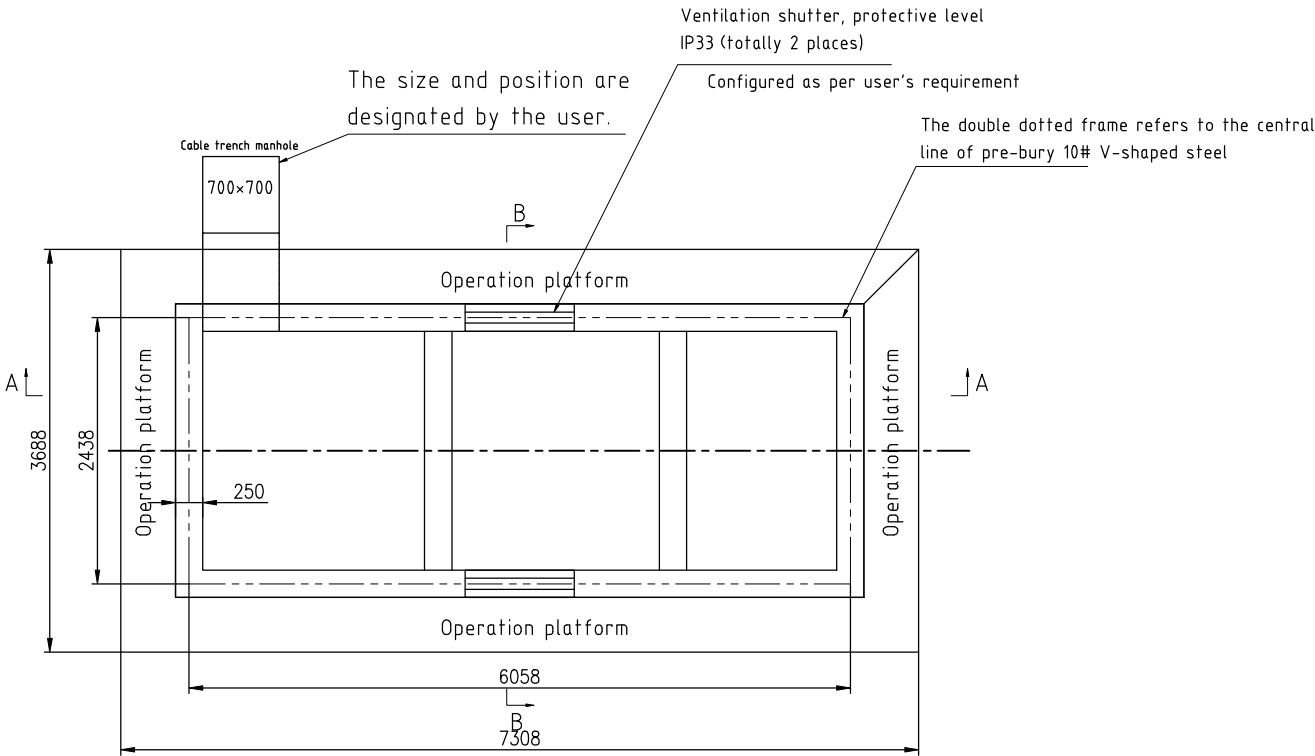
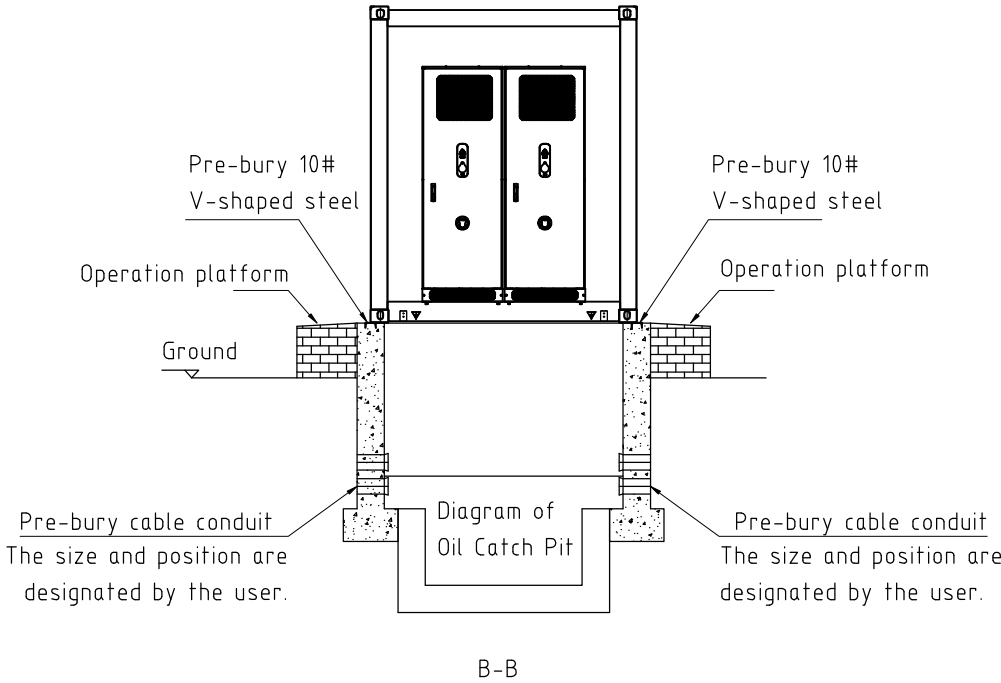


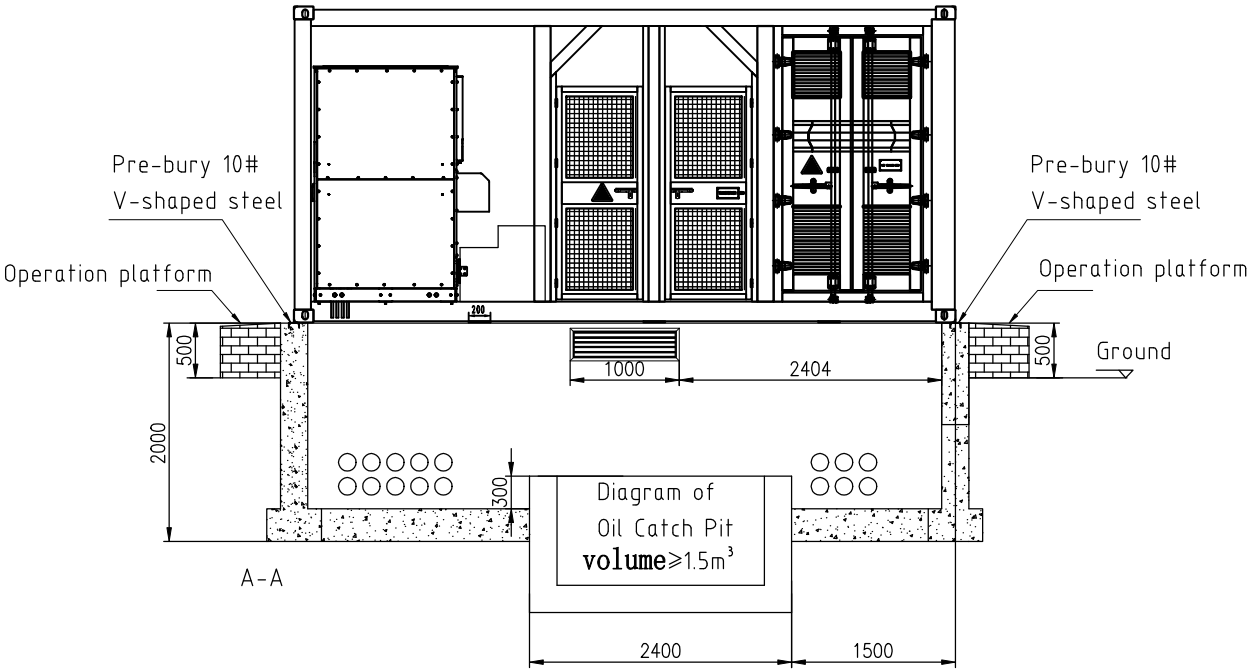

Version		Change content	



- Note:
- 1.This drawing is the foundation plan, which illustrates the foundation requirements for the integrated equipment. Please prepare the corresponding civil construction drawings based on this plan.
 - 2.The diameter, quantity, and installation positions of high - and low - voltage threading pipes shall be determined by the user. This drawing is for reference only.
 - 3.Lay a grounding grid around the substation (the dotted line in the drawing). There should be no less than two grounding leads drawn from the grounding grid to this substation, and the grounding resistance shall not be greater than 4 ohms.
 - 4.After the substation is installed in place, ensure that the doors of the box - type substation can be opened and closed smoothly. Then, weld and fix the base of the substation to the pre - embedded channel steel.
 - 5.After the cables pass through the cable inlet holes, seal them with cement mortar to prevent small animals from entering the box - type substation room.
 - 6.The DC current needs to be firmly tied. Otherwise, there is a risk that the low - voltage terminals of the inverter will be damaged by the cable pull, leading to a fire.
 7. Oil catch pit is furnished according to local requirements;
 8. The outside of foundation is furnished with cable trench manhole.

Xiamen Kehua Digital Energy Tech Co., Ltd.		DRAW	
PART_NAME		CHECKED	
PART_NO	Steel structure foundation diagram	SAFETY	
VERSION		APPROVED	
MATERIAL	001	 KEHUA TECH	
PAGE_NUMBER	1-1		
UNIT	mm		
		A3	SCALE 1:1