

Manual Analysis:

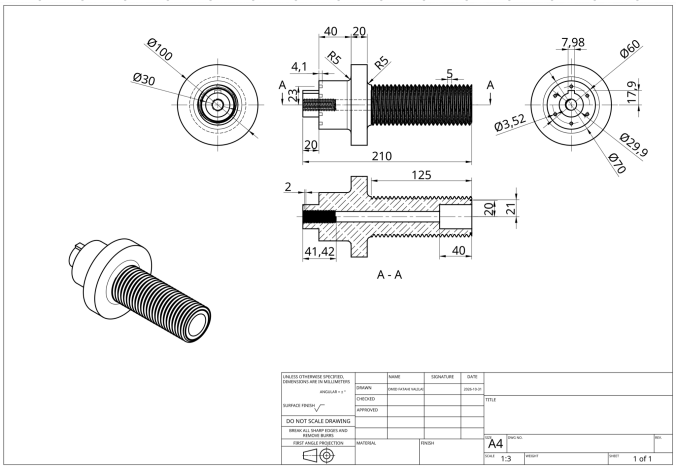

Digit 1:

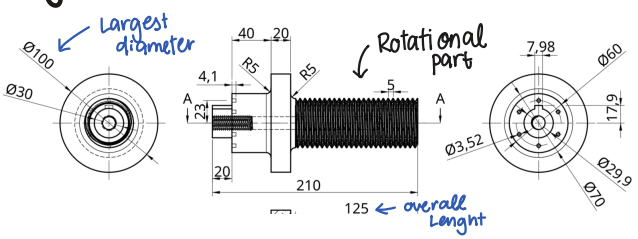


L = overall lenght of the part = 210 mm
D = largest relevant diameter = 100 mm

$\frac{L}{D} = \frac{210\,mm}{100\,mm} = 2{,}10$, Rotational part, $0.5 < L/D < 3$

DIGIT 1

		PART CLASS
0	Rotational Parts	L/D <=0.5
1		0.5<L/D<3 ← digit 1 = 1
2		L/D > 3
3		
4		
5	Non rotational Parts	
6		
7		
8		
9		

Digit 2

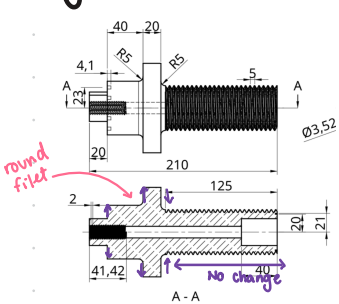


- Object is stepped on the left side with 3 changes in height before the "half"
- The right side of the shape has a thread And also stepped.

digit 2 = 5

DIGIT 2

External shape Elements		
0	Smoothing Shape Elements	
1	Stepped one end or Smooth	No Shape Elements
2		Thread
3		Groove
4	Stepped Both Ends	No Shape Elements
5		Thread
6		Groove
7	Functional Cone	
8	Operating Speed	
9	All Others	

Digit 3:

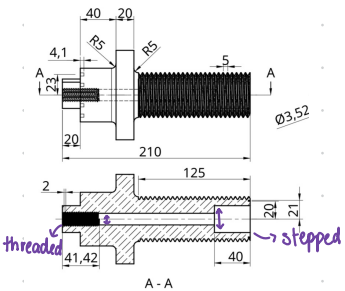

- Stepped on 1 end (Right Side)
- Has a thread done by tapping on the left side

DIGIT 3		
Internal Shape Internal Shape Elements		
0	No Hole, No Break Through	
1	Smooth or Stepped on One End	No Shape Elements
2		Thread
3		Groove
4	Stepped Both Ends	No Shape Elements
5		Thread
6		Groove
7	Functional Cone	
8	Operating Speed	
9	All Others	

→ digit 3 = 2


Digit 4:

»» the part has no special plane-surface machining features in the drawing

DIGIT 4	
Plane Surface Machining	
0	No Surface Machining

→ digit 4 = 0

Digit 5:

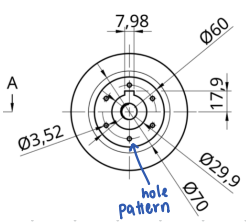

- there are 6 holes uniformly distributed around that piece
- They are parallel to the axis of the figure

DIGIT 5	
Auxiliary Holes and Gear Teeth	
0	No Auxiliary Holes
1	Axial, Not on Pitch Circle Dia
2	Axial on Pitch Circle Diameter

digit 5 = 2 ←

OPITZ CODE: 15202