
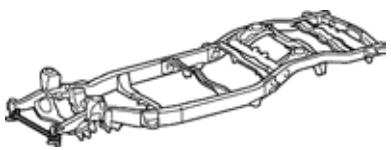


FRAME AUXILIARY CROSSMEMBER (ASSY): w/ Winch

|                                                                                                  |                                                                                                                                                       |
|--------------------------------------------------------------------------------------------------|-------------------------------------------------------------------------------------------------------------------------------------------------------|
| <br><br>F29262A | With the frame side rail plate removed.                                                                                                               |
|                                                                                                  | <div>Symbol meaning</div><br><div> : Cut with Disc Sander etc.</div> |

F29262B

REMOVAL

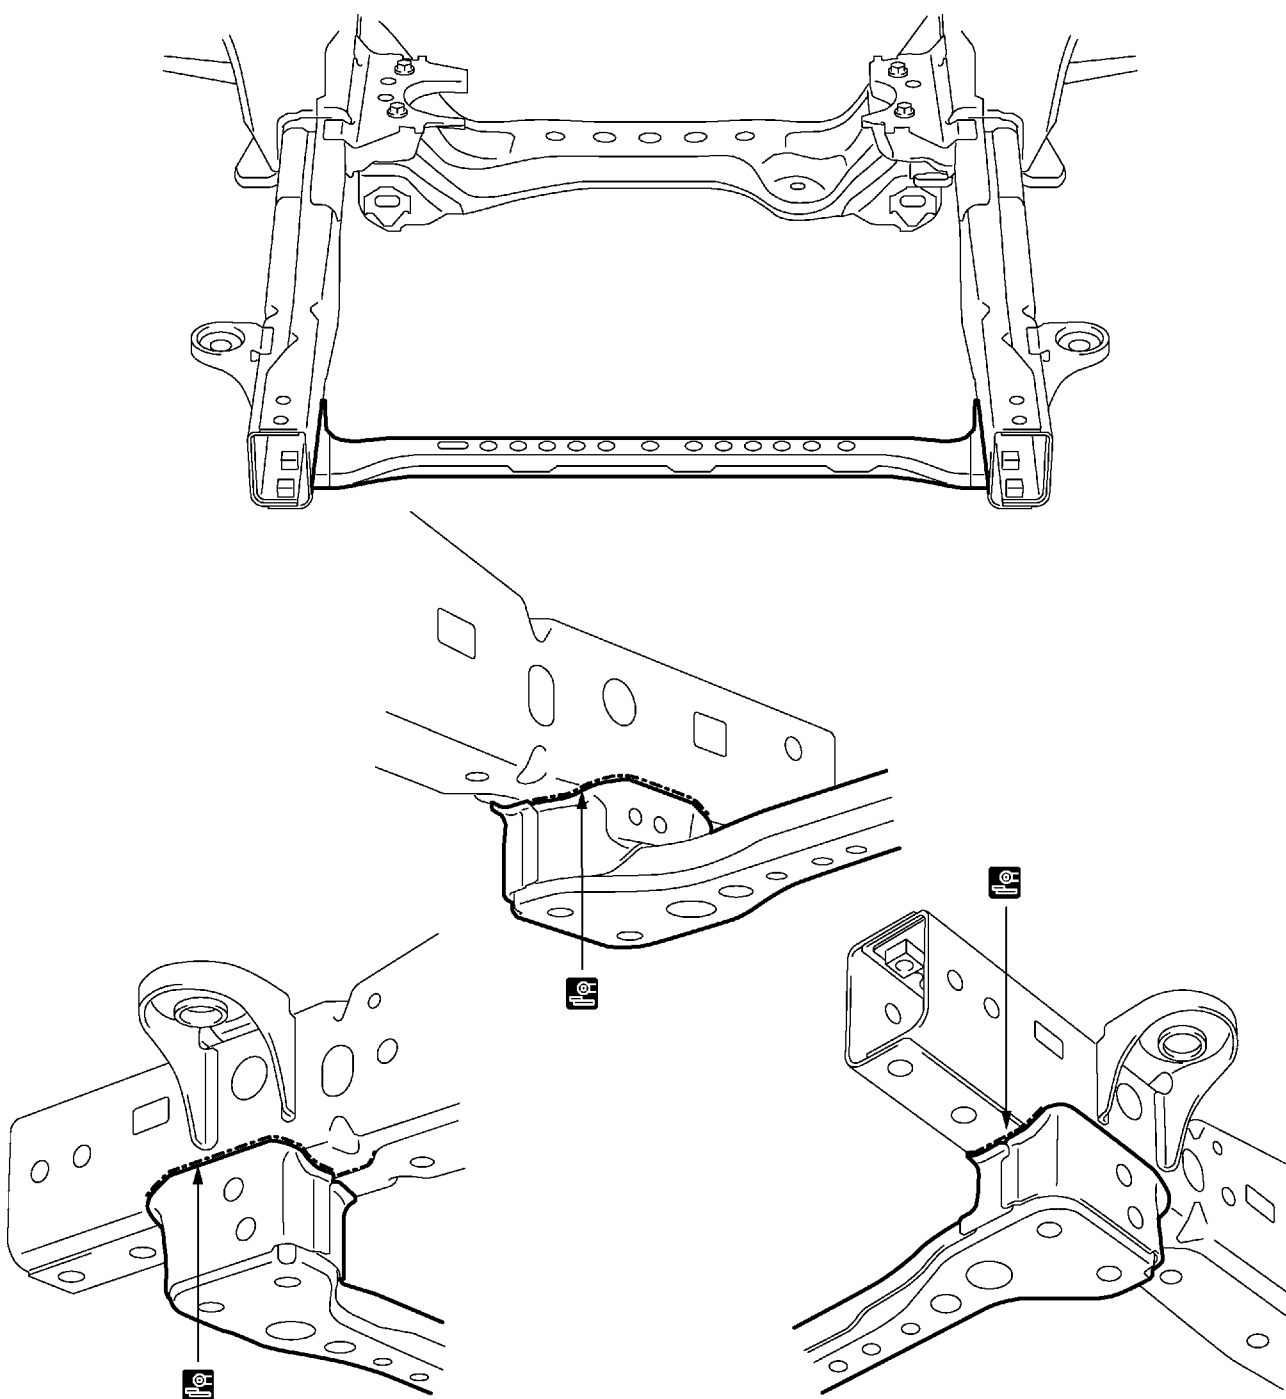




F29262

## Symbol meaning

 : Fillet Weld

F29263B


## INSTALLATION

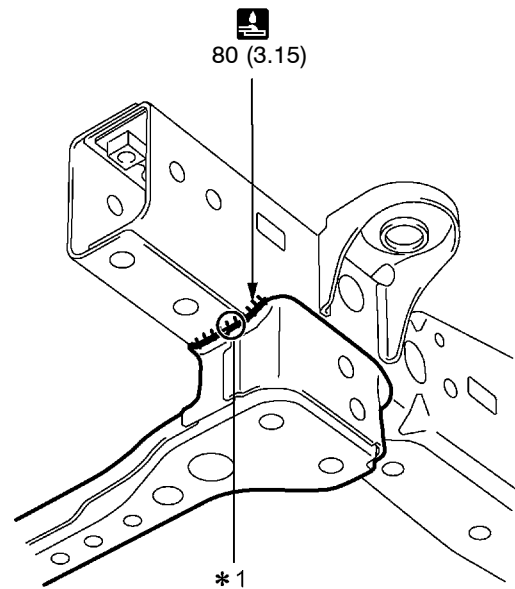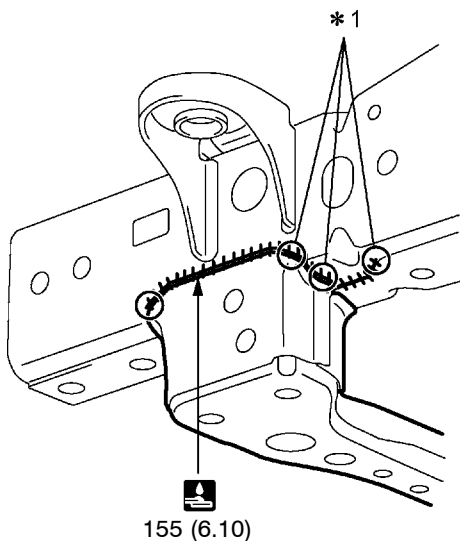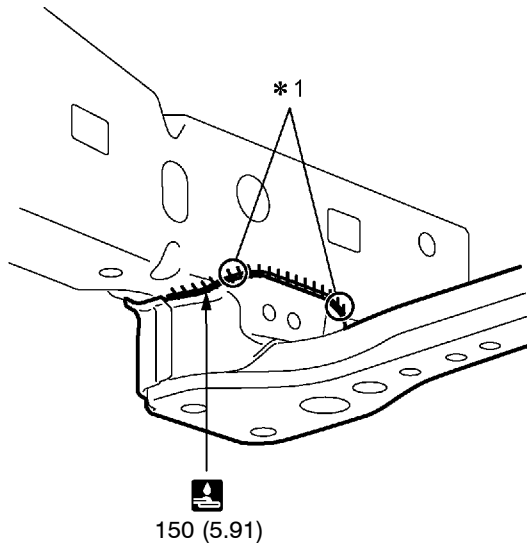

F29263

## INSTALLATION POINT

- 1 Make sure that proper welding can be performed by setting up the welding conditions as necessary before performing work.
- 2 Make sure that the welding bead at \*1 is overlapped.
- 3 To prevent heat deformation, weld the right and left side of each part before continuing to the next part.
- 4 After applying the top coat, apply anti-rust agent to the internal panel portion of the closed section structural weld points.

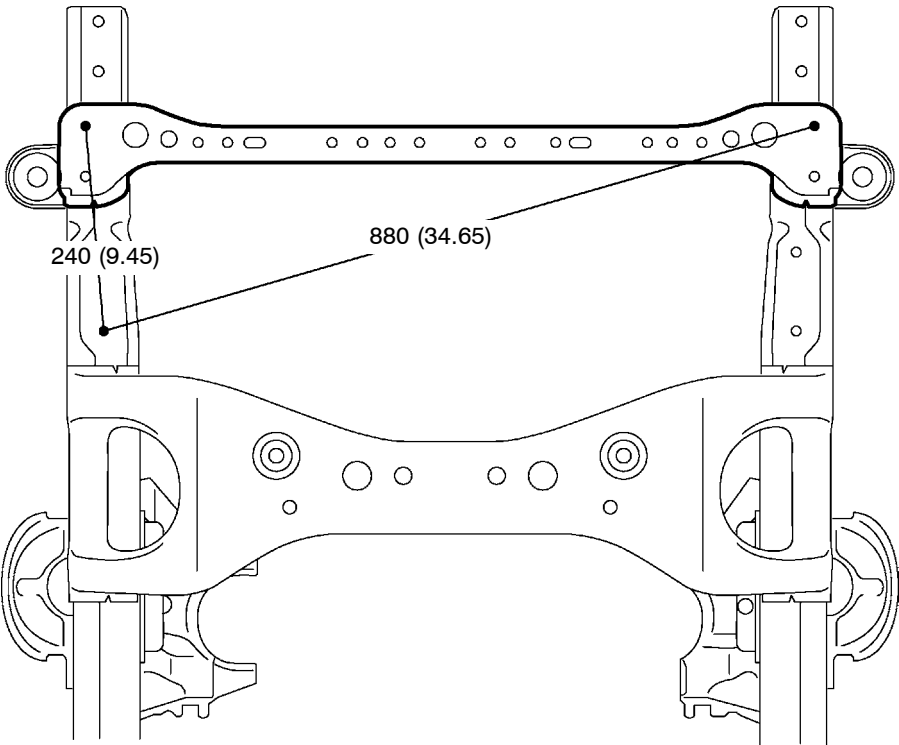

F29264

**INSTALLATION POINT**

1 These values are reference values.