


FRAME AUXILIARY CROSSMEMBER (ASSY): w/o Winch

F29259A




With the frame side rail plate removed.

Symbol meaning

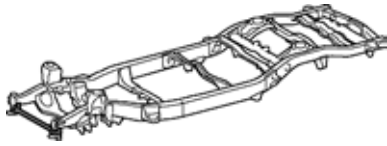

: Cut with Disc Sander etc.

F29259B

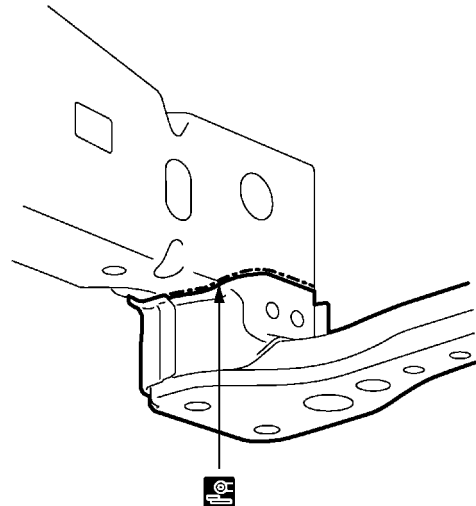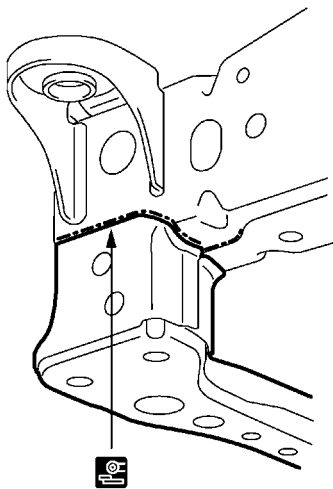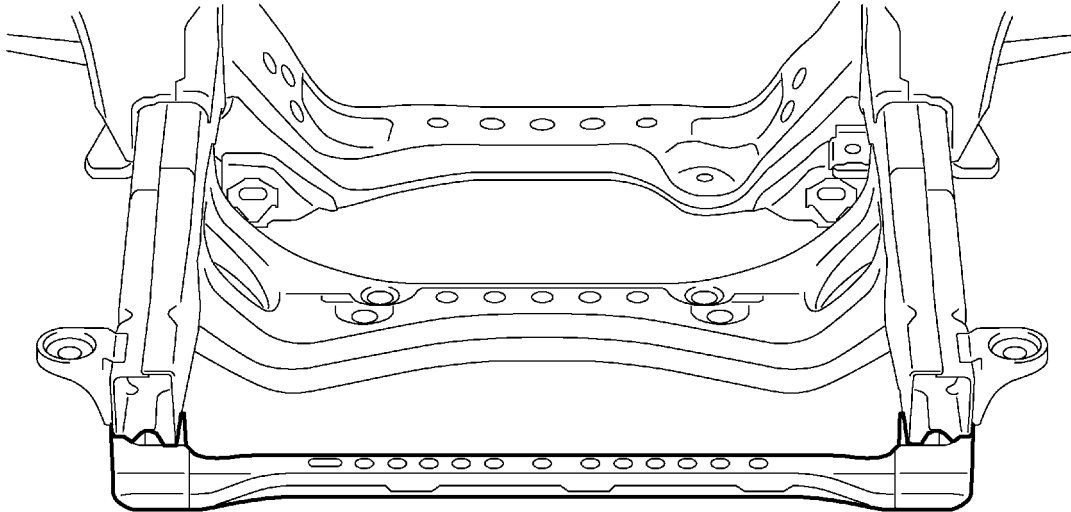REMOVAL



F29259

Symbol meaning

 : Fillet Weld

F29260B

INSTALLATION

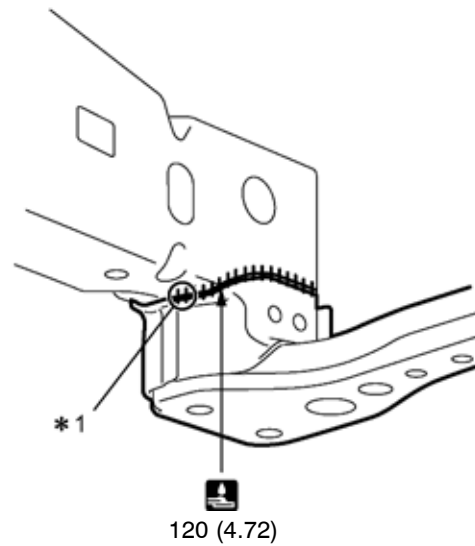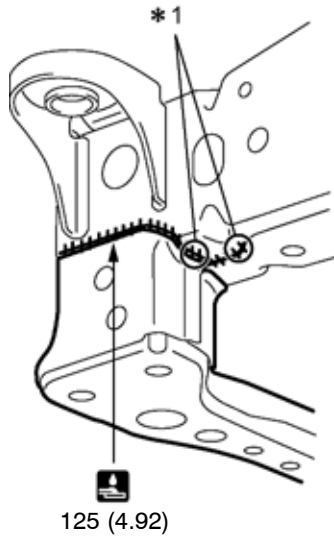


mm (in.)

F29260

INSTALLATION POINT

- 1 Make sure that proper welding can be performed by setting up the welding conditions as necessary before performing work.
- 2 Make sure that the welding bead at *1 is overlapped.
- 3 To prevent heat deformation, weld the right and left side of each part before continuing to the next part.
- 4 After applying the top coat, apply anti-rust agent to the internal panel portion of the closed section structural weld points.

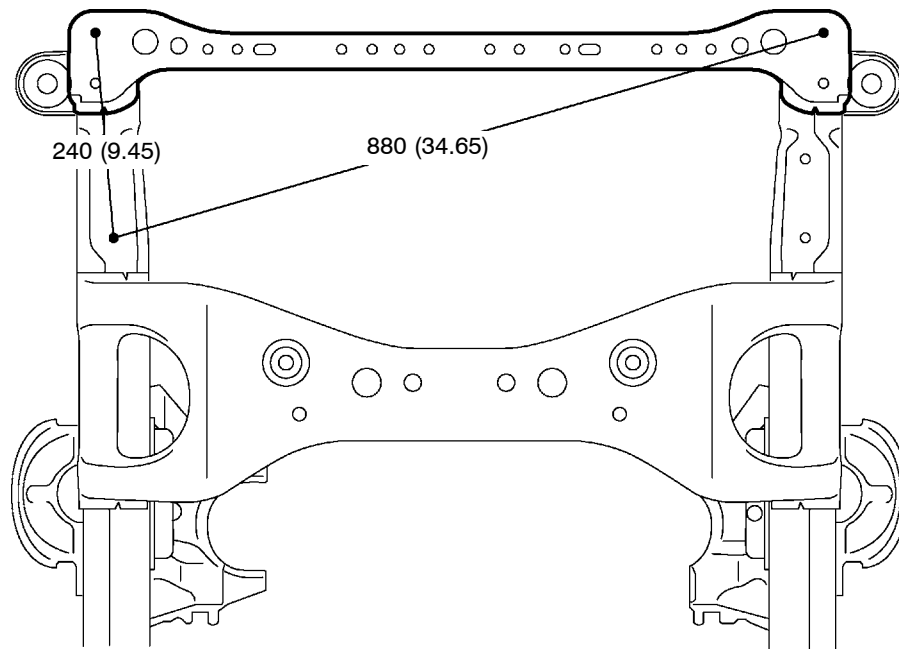

F29261

INSTALLATION POINT

1 These values are reference values.