

AUDI CUPRA SEAT SKODA VOLKSWAGEN

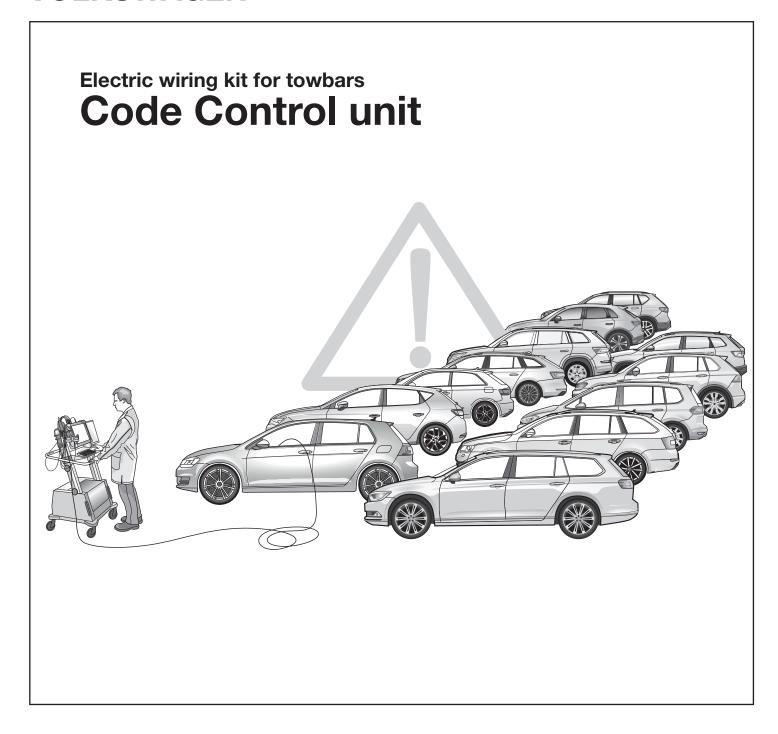

87501909/28.02.2020

AUDI

A3 3-door 06/14 →
A3 Sportback 06/14 →
A3 Saloon 06/14 →
A3 Cabriolet 06/14 →

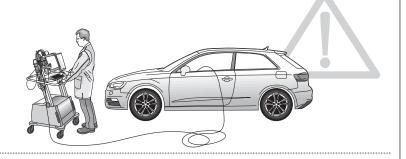

Please effect coding as follows:

Option A

→ Manufacturer diagnosis:

ODIS online encoding / re-documentation

- Audi A3 SVM code:
 - 050204 for vehicles with reduced fan power
 - 050203 For vehicles with full fan power

Follow the ODIS encoding instructions and close the configuration!



Alternative action code / SVM-code / AM-code possible!

The necessary code can be found in the "Coding sheet" in the Audi dealer portals.

Option B

- → Diagnosis Services or diagnostic methods (local / offline):
- VCDS (→ page 6)
- Hella Gutmann (→page 7)
- VCDS
- Autologic
- SP Diagnostic
- SUN
- etc. pp.

Set up trailer operation

SEAT

 Leon 5-door
 06/14→

 Leon 3-door
 06/14→

 Leon ST
 06/14→

 Leon X-Perience
 10/14→



Please effect coding as follows:

Option A

Manufacturer diagnosis:

ODIS online encoding / re-documentation

- SEAT Leon SVM code:
 - DA69AHV
 - or DA69AHV123

Follow the ODIS encoding instructions and close the configuration!



Alternative action code / SVM-code / AM-code possible!

The necessary code can be found in the "Coding sheet" in the SEAT dealer portals.


Option B

- → Diagnosis Services or diagnostic methods (local / offline):
- VCDS (→page 6)
- Hella Gutmann (→page 7)
- VCDS
- Autologic
- SP Diagnostic
- SUN
- · etc. pp.

87501909/28.02.2020 2/7

SKODA

Octavia III Saloon06/14 →Octavia III Estate06/14 →Octavia III Scout08/14 →Octavia IV Estate03/20 →

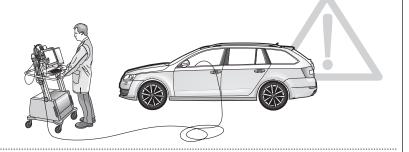

Please effect coding as follows:

Option A

→ Manufacturer diagnosis:
ODIS online encoding / re-documentation

Skoda SVM code:

for vehicles with trailer preparation (1D7) = 30F05

for vehicles without trailer preparation (1D0) = 30E3E

Follow the ODIS encoding instructions and close the configuration!



Alternative action code / SVM-code / AM-code possible!

The necessary code can be found in the "Coding sheet" in the Skoda dealer portals.

Option B

- → Diagnosis Services or diagnostic methods (local / offline):
- VCDS (→ page 6)
- Hella Gutmann (→page 7)
- VCDS
- Autologic
- SP Diagnostic
- SUN
- etc. pp.

Set up trailer operation

VW

Golf VII 06/14 → 06/14 → 06/14 → Golf VII Alltrack 02/15 →



Please effect coding as follows:

Option A

→ Manufacturer diagnosis:
ODIS online encoding / re-documentation

- Golf VII action code:
 - 37A58 for fixed towing equipment
 - 37A6C for removable towing equipment
 - 37A70 for vehicles with trailer preparation

Follow the ODIS encoding instructions and close the configuration!



Alternative action code / SVM-code / AM-code possible!

The necessary code can be found in the "Coding sheet" in the VW dealer portals.


Option B

- → Diagnosis Services or diagnostic methods (local / offline):
- VCDS (→ page 6)
- Hella Gutmann (→page 7)
- VCDS
- Autologic
- SP Diagnostic
- SUN
- etc. pp.

87501909/28.02.2020 3/7

VW

Golf VII Sportsvan 06/14→

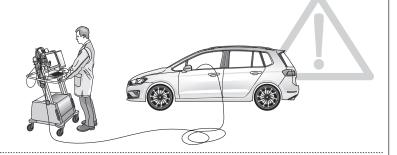

Please effect coding as follows:

Option A

- → Manufacturer diagnosis:
 ODIS online encoding / re-documentation
- Golf VII action code:
 - 39C8E for fixed towing equipment
 - 39C92 for removable towing equipment

Follow the ODIS encoding instructions and close the configuration!



Alternative action code / SVM-code / AM-code possible!

06/17→

The necessary code can be found in the "Coding sheet" in the VW dealer portals.

Option B

- → Diagnosis Services or diagnostic methods (local / offline):
- VCDS (→ page 6)
- Hella Gutmann (→page 7)
- VCDS
- Autologic
- SP Diagnostic
- SUN
- etc. pp.

Set up trailer operation

VW **AUDI SEAT Passat Saloon** 11/14 → Ateca 06/16 → **Q2** 10/16→ Passat Variant 11/14 → 01/19→ Q3 (F3) 12/18→ Tarraco Passat Alltrack 09/15→ Q3 (F3) Sportback 10/19→ **Touran II** 09/15→ **SKODA CUPRA** Tiguan II 04/16→ Tiguan II Allspace 09/17→ Kodiaq 03/17 → **Ateca** 11/18→ Karoq 09/17→ T-Roc 08/17→

- → Diagnosis Services or diagnostic methods (local / offline):
- VCDS (→ page 6)
- Hella Gutmann (→page 7)
- VCDS
- Autologic

Arteon

- SP Diagnostic
- SUN
- etc. pp.



87501909/28.02.2020 4/7

SKODA

Superb III Hatch06/15→Superb III Estate09/15→Rapid06/15→Rapid Spaceback06/15→





SEAT

 Ibiza 5-door
 08/15→05/17

 Ibiza ST
 08/15→05/17

 Ibiza SC 3-door
 08/15→05/17

 Toledo
 06/15→

Please effect coding as follows:

Option A

→ Manufacturer diagnosis:
ODIS online encoding / re-documentation

→The necessary code can be found in the "Codingsheet" in the SEAT / SKODA /VW dealer portals.

Follow the ODIS encoding instructions and close the configuration!


Option B

- → Diagnosis Services or diagnostic methods (local / offline):
- VCDS (→ page 6)
- Hella Gutmann (→page 7)
- VCDS
- Autologic
- SP Diagnostic
- SUN
- etc. pp.

Set up trailer operation

SKODA

Fabia III Hatch 11/14→ 11/14→ 01/15→

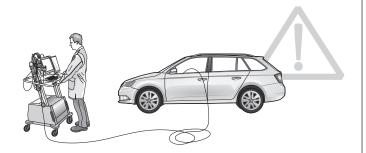

Please effect coding as follows:

Option A

→ manufacturer diagnosis:

ODIS online encoding / re-documentation

Skoda SVM code:

for vehicles with trailer preparation (1D7) = 32136

for vehicles without trailer preparation (1D0) = 32122

Follow the ODIS encoding instructions and close the configuration!



Alternative action code / SVM-code / AM-code possible!

The necessary code can be found in the "Coding sheet" in the Skoda dealer portals.

Option B

- → Possible alternative Diagnosis Services or diagnostic methods (local / offline):
- Hella Gutmann (Page 16)
- VCDS (Page 17)
- Autologic
- SP Diagnostic
- SUN
- etc. pp.

87501909/28.02.2020 5/7

all vehicles



Encoding VW/Audi/Seat/Skoda with VCDS

Please note:

The procedure described below for encoding and enabling the trailer mode only serves for a general orientation and can vary greatly depending on the model (motorisation / equipment). If necessary, fewer or further control units will have to be adapted.

→ Encoding Gateway_19

Installations List ->

69 Trailer hitch control module -> installed

→ Encoding EZE_09 (electronic central electric controller):

Access authorisation: 31347

Adaptation -10

Adaptation channel:

networking trailer connection device -> installed

Trailer hitch control module -> installed

→ Encoding DIS_13 (distance control)

Access authorisation 20103

Encoding

Control module for trailer -> installed

→ Encoding ZKS_46 (central module comfort system)

Trailer control unit -> installed

→ Encoding SWA_3C (lane change assistant)

Trailer control unit -> installed

→ Encoding SCH_17 (control panel insert)

Trailer control unit -> installed

→ Encoding RFK_6C (reversing camera system)

Trailer detection -> installed

→Encoding STF_74 (chassis control)

Trailer -> installed

→ Encoding EPH_10 (PDC controller)

Trailer ->Trailer device

can be removed manually

→ Encoding FFF_A5 (front sensor system controller)

Trailer electronics -> installed

→ Encoding HDE-6D (boot lid electronics controller)

Controller for trailer -> installed


Important note on encoding and activating in trailer mode.

The aforementioned settings are carried out in the vehicle's electrical system and saved locally. During general updates for the vehicle software (for example, within the scope of service or repair work), the settings may be overwritten and deleted under certain circumstances. In this case, the trailer mode activation has to be updated again locally after the update.

87501909/28.02.2020 6/7





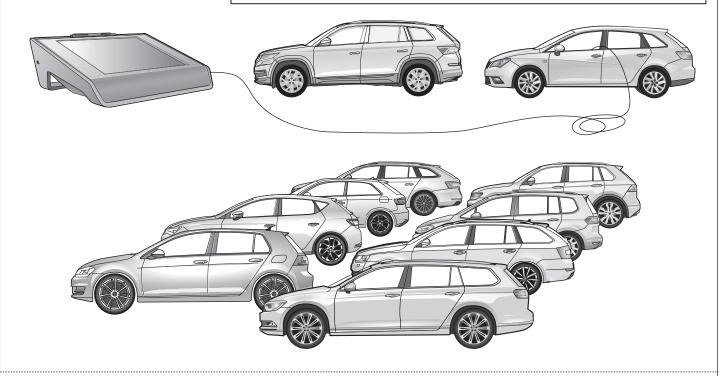

The activation of the trailer functions must be performed as follows:

- 1. Vehicle selection
- 2. switch to diagnostics coding
- 3. Deactivate/activate trailer coupling
- 4. Select diagnotstic Interface Bus
- 5. Follow instructions

Vehicles with assistance systems

- 6. Perform adaptation of trailer coupling on assistance systems
- 7. Follow instructions
- 8. Diagnostics
- 9. Read out error memory, delete if necessary
- 10. Done

87501909/28.02.2020 7/7