


- NOTES:
1. CONFIRM CUT CABLE TO WORK ORDER.
2. LABEL TO BE MADE AND PRINTED, QR CODE NO LONGER REQUIRD NOR TRACKING, LABEL INCLUDES:

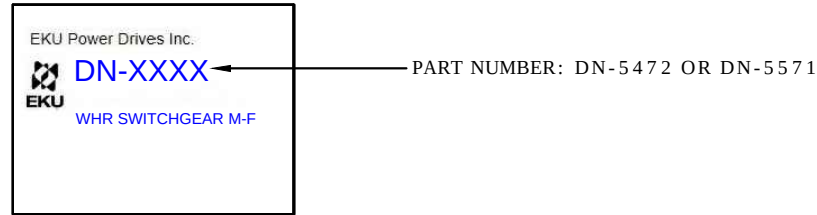

3. EKU LABEL NOT REQUIRED FOR FIRST ARTICLE BUILD.
4. PINS 1-4 SIZE 10AWG, PINS 5-10 SIZE 12AWG.

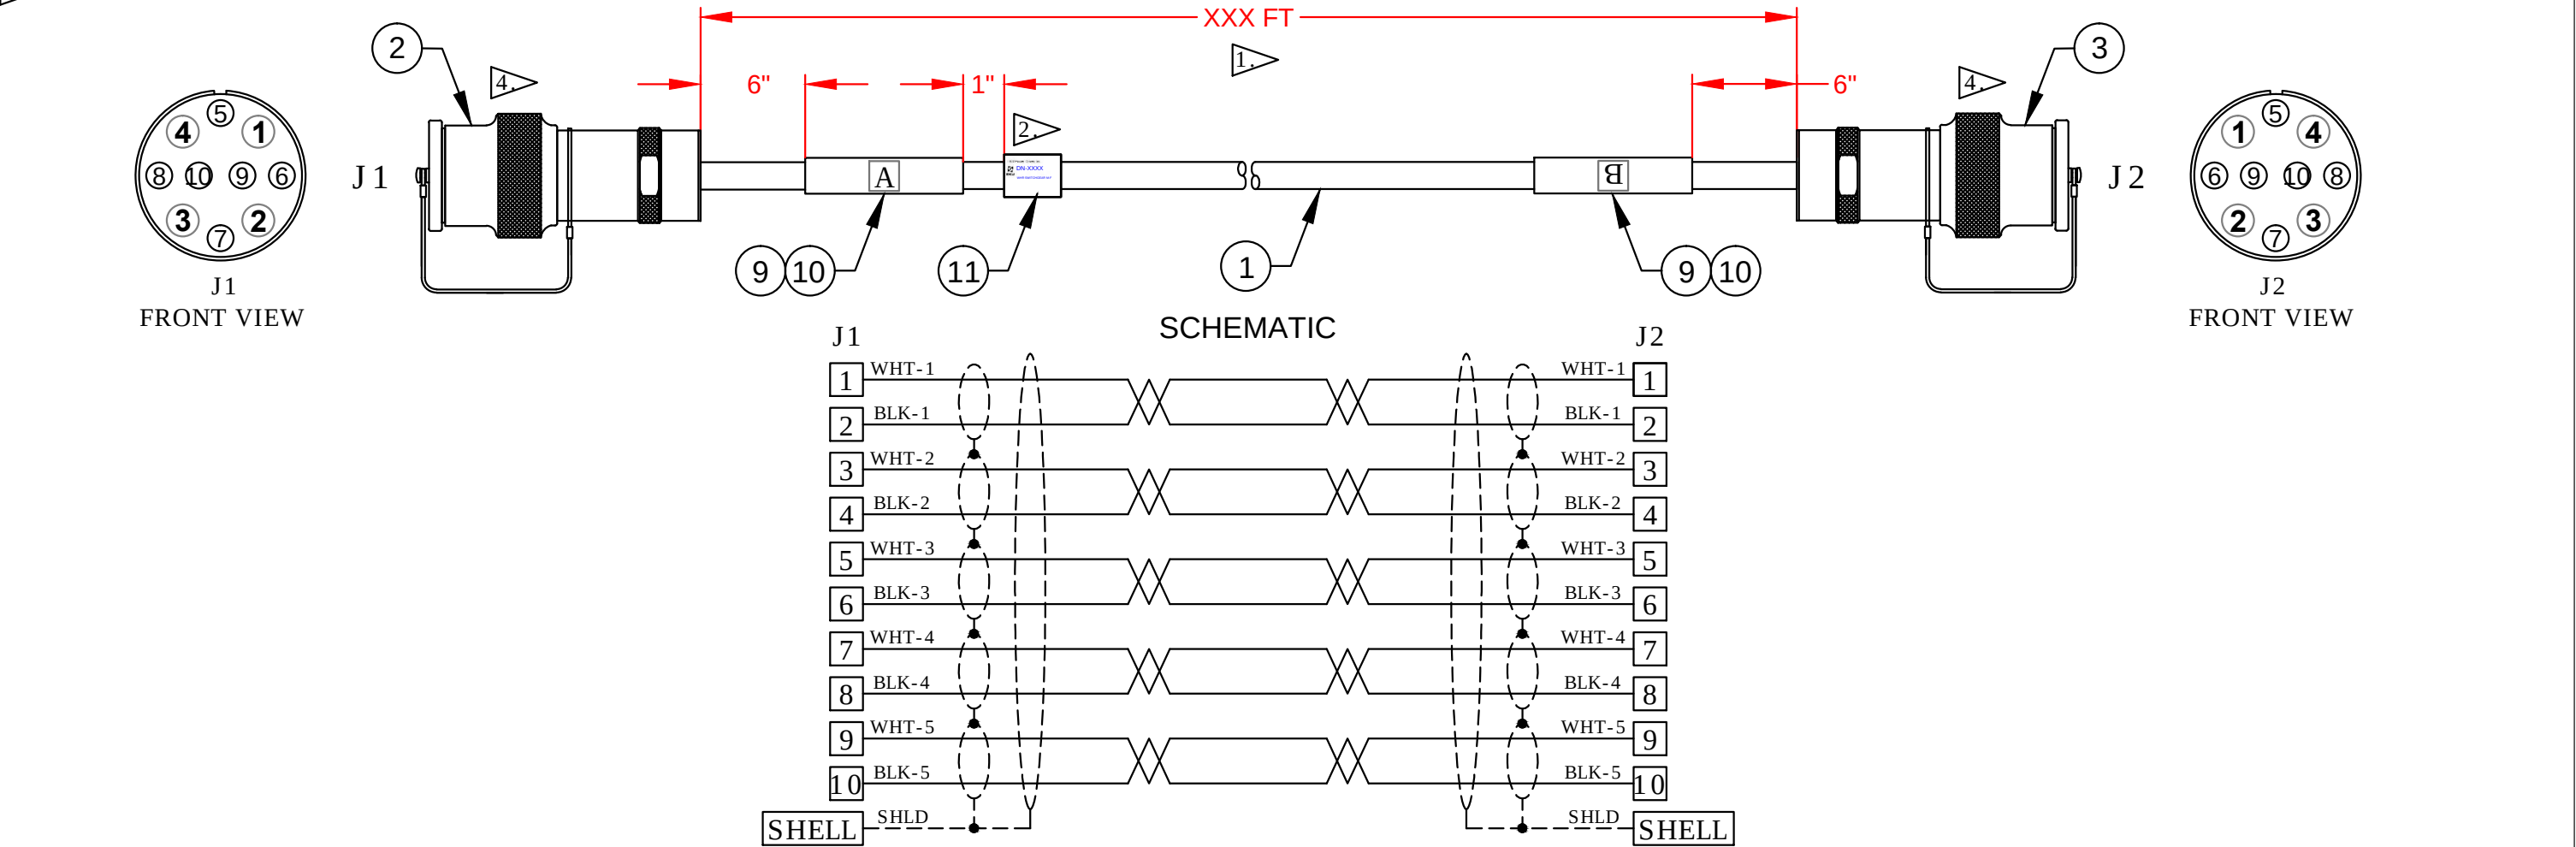


TABLE 1 - ASSEMBLY AND LABEL INFO TABLE					
ASSEMBLY P / N	LENGTH (XXX FT)	REF.	INFORMATION	POSITION	
				< 18 IN	≥ 18 IN
DN-5472	100 FT	A	DN-5472 SWITCHGEAR WO#	1 QTY, MIDDLE	SEE VISUAL
		B	DN-5472 E-FRAC WO#		
DN-5571	150 FT	A	DN-5571 SWITCHGEAR WO#		
		B	DN-5571 E-FRAC WO#		

11	1			EKU LABEL
10	2	HS105-3/8X3IN		HEATSHRINK CLR 3/8IN X 3IN
9	2	THT-67-427-1.5		LABEL, BRADY, 2.00 X 2.25
8	-	-		-
7	A/R	5224-005-121X		CRIMP, 12 AWG (M) PIN
6	A/R	5224-005-10AX		CRIMP, 10 AWG (M) PIN CONTACT
5	A/R	5024-006-10AX		CRIMP, 10 AWG (F) SOCKET
4	A/R	5024-006-121X		CRIMP, 12 AWG (F) SOCKET
3	1	A16-SP-10CPF-12B		CONN, 10P (F), PLG (10-12AWG)
2	1	A16-SP-10CPM-12B		CONN, 10P (M), PLG (10-12AWG)
1	XXX FT	358240	P-5P16ISOSBS-BW	CBL, 16A 51STP TYPE P ARMORED
ITEM	QTY	MATERIAL P/N	ALT. P/N	DESCRIPTION

0.0	REMOVED ITEM 8 AS PER PAUL'S EMAIL ON 03/01/22.	PA	03/02/22
0.0	INITIAL DESIGN, FIRST ARTICLE	PA	02/24/22
REV	DESCRIPTION	APR DRN	DATE

REMOVE ALL BURRS AND BREAK SHARP EDGES OIL ANG GAS, BUILD TO IPC/WHMA-A-620 CLASS 2 STANDARDS, OR MOST CURRENT REVISION MILITARY, BUILD TO IPC/WHMA-A-620 CLASS 3 STANDARDS, MOST CURRENT REVISION, UNLESS OTHERWISE STATED.	
DIMENSIONS ARE IN INCHES/IMPERIAL, UNLESS OTHERWISE STATED	
DRAWING IS THE SOLE PROPERTY OF X-ACT ENGINEERED MANUFACTURING SOLUTIONS. ANY REPRODUCTION IN PART OR WHOLE WITHOUT THE WRITTEN PERMISSION OF X-ACT EMS IS PROHIBITED. ANY MODIFICATION, REVISION OR ANY ADDITION TO THIS DRAWING MUST BE UNDER APPROVAL OF TECHNICAL STAFF AND MUST BE NOTED IN THE DRAWING ALONG WITH A VALID ECN NUMBER. THIS DRAWING IS PROVIDED TO THE CLIENT AS VERIFICATION OF MATERIALS AND BUILD TYPE FOR USE ON X-ACT CUSTOM CABLE ASSEMBLIES ONLY.	LENGTH TOLERANCE LENGTH TOLERANCE (FEET) (INCHES) ≤ 1 +1/-0 > 1-5FT +2/-0 > 5-10FT +4/-0 > 10 +6/-0 ANGULAR: PART & MOLD = ± 3.0° XX = ± 0.03 XXX = ± 0.010