



# Asset Performance Management

## Troubleshooting Guide

Release 540.1

August 2023

# DISCLAIMER

This document contains Honeywell proprietary information. Information contained herein is to be used solely for the purpose submitted, and no part of this document or its contents shall be reproduced, published, or disclosed to a third party without the express permission of Honeywell International Sàrl.

While this information is presented in good faith and believed to be accurate, Honeywell disclaims the implied warranties of merchantability and fitness for a purpose and makes no express warranties except as may be stated in its written agreement with and for its customer.

In no event is Honeywell liable to anyone for any direct, special, or consequential damages. The information and specifications in this document are subject to change without notice.

Copyright 2023 - Honeywell International Sàrl

# CONTENTS

|                                                                                                                      |    |
|----------------------------------------------------------------------------------------------------------------------|----|
| Chapter 1 - About this Guide .....                                                                                   | 7  |
| Chapter 2 - Overview .....                                                                                           | 8  |
| Chapter 3 - Installation, Upgrade, Localization, or Rename Errors .....                                              | 9  |
| 3.1 Pre-requisite .....                                                                                              | 9  |
| 3.2 Internet Explorer Pre-requisite Installation Fails .....                                                         | 9  |
| 3.3 After Upgrade Some APM Pages are Empty or Partially Loaded .....                                                 | 9  |
| 3.4 Restarting Installation from the Beginning After Failed Install .....                                            | 10 |
| 3.5 Error When Setting Honeywell.MES.Core.UI.Localization.IsLocalized to True .....                                  | 10 |
| 3.6 Windows script host error when installing Asset Synchronizer on a Flex node .....                                | 10 |
| 3.7 Some elements on client are not displaying localized language .....                                              | 11 |
| 3.8 The APM DAS instances are not installed in a co-existence installation .....                                     | 11 |
| 3.9 AMApplicationServer Service not running after installation .....                                                 | 12 |
| 3.10 RabbitMQ does not start after server rename or service account change .....                                     | 13 |
| 3.11 RabbitMQ RDQ files keep accumulating and consuming entire disk space .....                                      | 13 |
| 3.12 When installing on a system with Honeywell software already installed errors appear on some install steps ..... | 14 |
| 3.13 Certificate configuration step fails during installation .....                                                  | 14 |
| 3.14 Asset Performance Management installation stalls .....                                                          | 14 |
| 3.15 Upgrading on a Windows 2012 R2 Server .....                                                                     | 15 |
| 3.16 APM Service Cannot Be Restarted .....                                                                           | 15 |
| 3.17 The Trusted certificate (depth level greater than 1) issue while configuring RabbitMQ .....                     | 16 |
| 3.18 APM application is not installing in AM and DAS logs .....                                                      | 17 |
| 3.19 MES Landing page not opening in co-existence server after APM R531.1 installation .....                         | 19 |
| 3.20 Install Microsoft SQL Server 2012 Native Client .....                                                           | 20 |
| 3.21 Maintenance Tool Stopped Working .....                                                                          | 21 |

|                                                                                                                                           |           |
|-------------------------------------------------------------------------------------------------------------------------------------------|-----------|
| <b>Chapter 4 - User Interface and Viewer Errors .....</b>                                                                                 | <b>22</b> |
| 4.1 Error “HTTP error 503. The service is unavailable” OR “Access is denied. You do not have permission to access this application” ..... | 22        |
| 4.2 Error - “An Add on for this website failed to run” .....                                                                              | 23        |
| 4.3 Asset Performance Management home page is not displayed .....                                                                         | 23        |
| 4.4 Displaying wrong tooltips on trends .....                                                                                             | 25        |
| 4.5 Repeatedly asked to provide login credentials .....                                                                                   | 26        |
| 4.6 Asset Performance Management application does not allow you to change your user roles .....                                           | 27        |
| 4.7 Fault details not refreshed even after enabling the auto refresh option problem .....                                                 | 28        |
| 4.8 Error - “SQL CMD not found” .....                                                                                                     | 28        |
| 4.9 “AMReports” folder not created .....                                                                                                  | 29        |
| 4.10 Error - “Unable to establish communication with Server. General Exception” .....                                                     | 29        |
| 4.11 Halt in execution of models .....                                                                                                    | 29        |
| 4.12 Error Message - Images Uploading Failed .....                                                                                        | 30        |
| 4.13 Not able to view log files .....                                                                                                     | 30        |
| 4.14 Honeywell Intuition landing page does not load .....                                                                                 | 30        |
| 4.15 Could Not Connect to net.tcp error after upgrade .....                                                                               | 31        |
| 4.16 Using APM tags in Insight Graphics Causes Error .....                                                                                | 32        |
| 4.17 Error “Internal Server Error Undefined” appears when opening tabs .....                                                              | 32        |
| 4.18 Time Control does not appear on the trend in 4-Server installation .....                                                             | 33        |
| 4.19 Error when attempting to view Calculation Status if file extensions are not allowed .....                                            | 33        |
| 4.20 The Error “The application is experiencing network issues” appears when using the Event Viewer .....                                 | 33        |
| 4.21 Faults do not occur as expected after updating in the Legacy Configuration .....                                                     | 34        |
| 4.22 Coexistence - Error .....                                                                                                            | 34        |
| 4.23 Fault Model Expression Length Error .....                                                                                            | 35        |
| <b>Chapter 5 - External Data Source and EPHD Errors .....</b>                                                                             | <b>37</b> |
| 5.1 Data Source Page Not Loading .....                                                                                                    | 37        |
| 5.2 Connection of the server lost to the external interfaces .....                                                                        | 38        |
| 5.2.1 Problem .....                                                                                                                       | 38        |
| 5.2.2 Solution .....                                                                                                                      | 38        |
| 5.3 Excel Data Source Data not Appearing .....                                                                                            | 39        |
| 5.4 PHD Data Source not starting .....                                                                                                    | 39        |

|                   |                                                                                                                        |           |
|-------------------|------------------------------------------------------------------------------------------------------------------------|-----------|
| 5.5               | PHD Configuration Tool Fails to Connect to Database Node .....                                                         | 40        |
| 5.6               | Error - “Not able to create Historian tag.PHD is not running” OR “Not able to create Historian tag.save failure” ..... | 40        |
| 5.7               | EPHD connection is lost .....                                                                                          | 40        |
| 5.8               | Tags in EPHD disappear after services restart .....                                                                    | 40        |
| 5.9               | Trends not functioning after migration with EPHD database .....                                                        | 41        |
| 5.10              | Datasources not running in 4-server deployment .....                                                                   | 41        |
| 5.11              | PHD communication does not function as expected if two versions of PHD are installed on the Application Server .....   | 42        |
| <b>Chapter 6</b>  | <b>- Calculation Errors .....</b>                                                                                      | <b>43</b> |
| 6.1               | Calculation timeout errors .....                                                                                       | 43        |
| 6.2               | Calculations set to run on status change run unexpectedly .....                                                        | 43        |
| 6.3               | Large python Calculation not loading in Calculation Status page & Logs indicate timeout. ....                          | 44        |
| 6.4               | Thermo calculations do not execute and calculation status shows a time out error .....                                 | 44        |
| 6.5               | Honeywell Unisim EO X64 .....                                                                                          | 45        |
| 6.6               | Honeywell Unisim Thermo x32 bit .....                                                                                  | 45        |
| <b>Chapter 7</b>  | <b>- Database Server Space Consumption .....</b>                                                                       | <b>47</b> |
| <b>Chapter 8</b>  | <b>- APM Configuration Excel Plugin Errors .....</b>                                                                   | <b>51</b> |
| 8.1               | Out-of-date Excel plugin visible after upgrade .....                                                                   | 51        |
| 8.2               | Excel Plugin manually disabled .....                                                                                   | 51        |
| 8.3               | Excel Plugin options disabled with multiple Excel workbooks open .....                                                 | 52        |
| 8.4               | Excel Plugin not available if Excel is installed after Asset Performance Management .....                              | 52        |
| 8.5               | An error occurs when attempting to get data .....                                                                      | 52        |
| 8.6               | After upgrade from R520.1 to R520.2 some Excel sheets do not get data .....                                            | 53        |
| 8.7               | R540.1 APM DAS Instance Data Access Page Save Option Not Getting Enabled After Doing Changes .....                     | 53        |
| <b>Chapter 9</b>  | <b>- Application Server Errors .....</b>                                                                               | <b>54</b> |
| 9.1               | AM Service is not running on licensed server .....                                                                     | 54        |
| 9.2               | Trouble in hosting the WCF service: endpoint port number error .....                                                   | 54        |
| 9.3               | Application Service throws Winsock error .....                                                                         | 55        |
| 9.4               | Unable to Start AMService in Multi-Server .....                                                                        | 55        |
| 9.5               | RabbitMQ Service Not Initialized After 20 Retries .....                                                                | 56        |
| <b>Chapter 10</b> | <b>- Report Errors .....</b>                                                                                           | <b>59</b> |

|                                                                                          |           |
|------------------------------------------------------------------------------------------|-----------|
| 10.1 SQL Reporting Services Windows service stopped .....                                | 59        |
| 10.2 Encrypted content error when attempting to view reports .....                       | 59        |
| 10.3 Reports do not load on multi-server system .....                                    | 60        |
| <b>Chapter 11 - External Application Errors .....</b>                                    | <b>61</b> |
| 11.1 Asset Performance Management and UniSim Design communication failure .....          | 61        |
| 11.2 UNISIM database cannot be created, if the case file is in the shared location ..... | 61        |
| 11.3 UNISIM calculations will not execute on secondary calculation server .....          | 61        |
| 11.4 "SSPI can not be generated" error with Flex .....                                   | 62        |
| <b>Chapter 12 - Notification Errors .....</b>                                            | <b>63</b> |
| 12.1 Error Appears When Attempting to Send Notification Email .....                      | 63        |
| <b>Chapter 13 - Certificate Errors .....</b>                                             | <b>65</b> |
| 13.1 Required Certificate Deleted from Windows Repository .....                          | 65        |
| 13.2 Intuition Certificate Renewal .....                                                 | 66        |
| <b>Chapter 14 - UI220 Coexistence issues with APM 531.X .....</b>                        | <b>67</b> |
| 14.1 APM R531.x Co-existence with UI R220.1 .....                                        | 67        |
| 14.2 Event management pages will not open with UI220 .....                               | 68        |

## ABOUT THIS GUIDE

This document covers troubleshooting steps for issues that may be encountered when using Asset Performance Management.

### Revision history

| Revision | Date        | Description                                                           |
|----------|-------------|-----------------------------------------------------------------------|
| 1        | August 2023 | Asset Performance Management R540.1 General Availability (GA) release |

### Intended audience

Operations

### Related documents

The following list identifies publications that may contain information relevant to the information in this document.

| Document name                                              | Document number       |
|------------------------------------------------------------|-----------------------|
| Asset Performance Management User's Guide                  | APMDOC-X392-en-R540.1 |
| Asset Performance Management Configuration Guide           | APMDOC-X391-en-R540.1 |
| Asset Performance Management Installation Guide            | APMDOC-X390-en-R540.1 |
| Asset Performance Management Upgrade Guide                 | APMDOC-X390-en-R540.1 |
| Asset Performance Management R530.1 Software Change Notice | APMDOC-X166-en-R540.1 |

The following chapters detail currently known troubleshooting steps for issues that might be encountered when operating Asset Performance Management.

For the most up-to-date version of this guide, see <https://www.honeywellprocess.com> (click the **Support** tab). User registration and login are required to access the Honeywell Process site.

Following topics are covered in this section

- [Installation, Upgrade, Localization, or Rename Errors](#)
- [User Interface and Viewer Errors](#)
- [External Data Source and EPHD Errors](#)
- [Calculation Errors](#)
- [APM Configuration Excel Plugin Errors](#)
- [Application Server Errors](#)
- [Report Errors](#)
- [External Application Errors](#)
- [Notification Errors](#)
- [Certificate Errors](#)
- [UI220 Coexistence issues with APM 531.X](#)



## INSTALLATION, UPGRADE, LOCALIZATION, OR RENAME ERRORS

### 3.1 Pre-requisite

Ensure the following pre-requisite conditions are met during the installation of Asset Performance Management:

1. Ensure all windows updates are completed and the system is restarted before starting the installation.
2. Disable automatic windows updates in the system during the installation of Asset Performance Management.

#### ATTENTION

1. If the system restarts during Asset Performance Management installation, ensure the ISO is mounted on the same drive before proceeding further with the installation.
2. Dont click **Next** twice in the installation dialog manager window as this will lead to skip of successive inputs screens.

### 3.2 Internet Explorer Pre-requisite Installation Fails

#### Problem

Asset Performance Management requires Internet Explorer version 11. The Internet Explorer upgrade can fail if Windows Update cannot read the update manifest, resulting in the following error:

0x8024000B

#### Solution

Do all of the following to rename the `Spupdsvc.exe` file:

1. Choose **Start > Run**.
2. Enter the following command in the **Run** dialog box, and then click **OK**:  
`Cmd /c ren %WinDir%\System32\Spupdsvc.exe Spupdsvc.old`
3. Attempt the upgrade again.

### 3.3 After Upgrade Some APM Pages are Empty or Partially Loaded

#### Problem

After upgrading a Asset Performance Management server, when opening APM pages some appear partially loaded or empty.

#### Solution

To resolve this issue, clear the browser cache.

## 3.4 Restarting Installation from the Beginning After Failed Install

### Problem

If the Asset Performance Management installation fails, attempting to re-run the installation begins partway through the process.

### Solution

Before re-running the installation wizard, do all of the following:

- Delete the following folder:  
`C:\Program Files (x86)\Honeywell\Uniformance Sentinel Installer`
- Open the Registry Editor (regedit) and delete the following key:  
`HKEY_LOCAL_MACHINE\SOFTWARE\Wow6432Node\Honeywell\USMaster`

## 3.5 Error When Setting Honeywell.MES.Core.UI.Localization.IsLocalized to True

### Problem

During the localization procedure, Honeywell.MES.Core.UI.Localization.IsLocalized must be set to true, however, attempting to do so can result in an error.

### Solution

The problem occurs when the user does not have permissions to the SystemCatalogs Configuration task. To continue, assign the task to the role to which the user performing the localization belongs.

1. Open the Asset Performance Management application from the server or client computers and open the Security page (**System > System Configuration > Security**).
2. Select the **Roles** tab, and then click the role to which the user performing the localization belong.
3. Select **View Tasks**.  
The tasks are displayed in the Tasks box.
4. In the Tasks list, under **MES Foundation**, select the **SystemCatalogs Configuration** task.
5. Click **Save**.

## 3.6 Windows script host error when installing Asset Synchronizer on a Flex node

### Problem

When installing the Asset Synchronizer on a Flex node, a Windows Script Host error appears if the Flex Node is part of a work group.

### Solution

To install the Asset Synchronizer, the Flex Node must be part of the domain. Join the Flex Node to the domain and then restart the Asset Synchronizer installation.

## 3.7 Some elements on client are not displaying localized language

### Problem

After localizing Asset Performance Management, on client computers that viewed the system prior to the localization some other elements (for example, column names) are still being displayed in the non-localized language.


### Solution

This is caused by cached items in Internet Explorer. To correct the display, clear the browser cache, including clearing favorites data.

1. Choose **Internet Explorer > Tools > Delete Browsing History**.

The Delete Browsing History dialog box appears.

2. Clear the **Preserve Favorites website data** check box.
3. Select the following checkboxes:
  - a. Temporary Internet files
  - b. Cookies

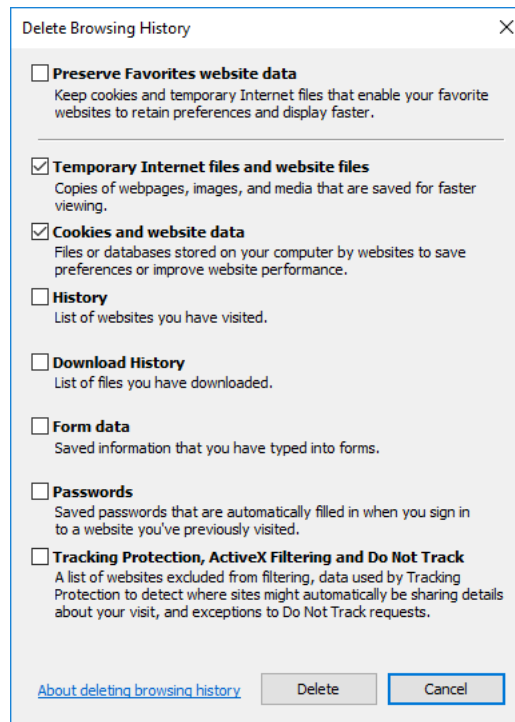

4. Click **Delete**.

## 3.8 The APM DAS instances are not installed in a co-existence installation

### Problem

After installing Asset Performance Management in a multi-server deployment alongside Uniformance Insight and Uniformance KPI, the default DAS instances are not installed.

***Solution***

This problem can occur when Uniformance Insight or Uniformance KPI is installed before Asset Performance Management, but the installation does not include the client tools and plugin utility required to create the DAS instance on the Web Server as expected.

To resolve the issue, manually add the data source by running the following command on the Application Server after replacing the URI variables to match your server details:

```
"C:\Program Files (x86)\Honeywell\MES\ConnectionTemplate.exe" LoadTemplate
Service:SentinelDASInstance Template:SentinelTagSource
URI:
Protocol://WebServerName.Domain:Port/MESImpl200/Core/DataModel/SystemCatalogs1.0/
```

## 3.9 AMApplicationServer Service not running after installation

***Problem*****Condition 1**

After the installation is complete, the AMApplicationServer service does not start up.

**Condition 2**

In a co-existence installation, the AMApplicationServer service does not start up and the following error appears in the log file:

```
"AmHostingService Write - Exception in Starting Asset Manager Application Service --
MassTransit.RabbitMqTransport.RabbitMqConnectionException: Unable to connect to
RabbitMQ after 5 attempts.
                                     at Honeywell.AM.Service.AmHostingService.OnStart(String[]
args): ''
```

***Solution*****ATTENTION**

Ensure the Windows Services window is closed before performing the following procedure.

This problem can occur if the RabbitMQ service cannot start up after installation. To repair the error, do all of the following to repair the RabbitMQ installation:

1. Delete the following folders if they exist:

- a. %ProgramData%\RabbitMQ
- b. %AppData%\RabbitMQ

2. Navigate to the following folder on the installation media and open a command prompt from that location:

```
[installationmedia]:\Installer\Components\US\MSIs\Configuration
```

3. Run the following command:

```
Honeywell.UAS.Configuration.exe -r -p Password
```

where Password is the password for the services user.

4. Restart the Asset Performance Management server.

## 3.10 RabbitMQ does not start after server rename or service account change

### *Problem*

After the rename or service account change RabbitMQ does not start as expected.

### *Solution*

#### **ATTENTION**

Ensure the Windows Services window is closed before performing the following procedure.

To repair the error, do all of the following to repair the RabbitMQ installation:

1. Delete the following folders if they exist:
  - a. %ProgramData%\RabbitMQ
  - b. %AppData%\RabbitMQ
2. Navigate to the following folder on the installation media and open a command prompt from that location:
 

```
[installationmedia]:\Installer\Components\US\MSIs\Configuration
```
3. Run the following command:
 

```
Honeywell.UAS.Configuration.exe -r -p Password
```

 where Password is the password for the services user.
4. Restart the Asset Performance Management server.

## 3.11 RabbitMQ RDQ files keep accumulating and consuming entire disk space

### *Problem*

RabbitMQ RDQ files keep accumulating and consuming entire disk space.

### *Solution*

1. Enable RabbitMQ management console with command "C:\Program Files (x86)\Honeywell\MES\AssetManager\Tools\InstallConfiguration>Honeywell.UAS.Configuration.exe -r -m -p Password1" Password1 should be service user password.
2. Go to admin - Policy - Add policy under RabbitMQ management console.
3. Select APM as virtual host, give any name, Apply to "Exchange and queues"
4. Select message-ttl From options, put 1800000 ( 30 \* 60 \*1000) i.e. 30 minutes, for example.
5. Click on Add or Update policy.
6. Go to Queue tab and see policy.
7. Restart **RabbitMQ** service.

## 3.12 When installing on a system with Honeywell software already installed errors appear on some install steps

### *Problem*

When installing on a system with other Honeywell products installed, the steps to install the OPC HDA DataSource Plugin and Intuition SharePoint Notification will fail if they are already installed with the most recent version.

### *Solution*

Skip the OPC HDA DataSource Plugin and Intuition SharePoint Notification and continue with the installation.

## 3.13 Certificate configuration step fails during installation

### *Problem*

During the installation, the certificate configuration step fails.

### *Solution*

The certificate configuration can fail if the services user does not have access to the MachineKeys folder. Do all of the following to add the required permissions and re-run the certificate configuration.

1. Ensure the services account is given the following permissions to the `[InstallDrive]:\ProgramData\Microsoft\Crypto\RSA\MachineKeys` folder on the Primary Server:
  - a. Read & Execute
  - b. List Folder contents
  - c. Read

2. Run the pre-installation checker (`Honeywell.Intuition.PreInstallChecker.exe`), located in the following folder on the installation media:

`[installationmedia]:\Installer\PreInstallChecker\`

3. Select the **Certificate Configuration** tab.
4. Click **Configure**.
5. Return to the Asset Performance Management installation wizard and click **Retry** to continue.

## 3.14 Asset Performance Management installation stalls

### *Problem*

During the installation, the installation stalls at the Asset Performance Management step before at completion and does not proceed to the next step.

### *Solution*

Perform an iisreset:

1. Choose **Start > Run**.
2. In the Run dialog box, type **IISRESET** and click **OK**.

## 3.15 Upgrading on a Windows 2012 R2 Server

### *Problem*

Windows 2012 R2 is no longer a supported operating system. However, some existing installations of Asset Performance Management may still be operating on Windows 2012 R2 and not in a position to transition to a supported operating system at this time.

### *Solution*

The following steps have been identified for as required before attempting an upgrade of Asset Performance Management on a Windows Server 2012 R2. For additional information, please contact Honeywell Product Support.

Please note, systems using other Honeywell products (for example, Uniformance Insight) might have additional system requirements or constraints.

1. Ensure the Asset Performance Management installation and services users are given the following permissions to the `[InstallDrive]:\ProgramData\Microsoft\Crypto\RSA\MachineKeys` folder:
  - a. Read & Execute
  - b. List Folder contents
  - c. Read
2. Ensure the following Windows updates are installed in the following order (files can be found in the `[installationmedia]\Installer\Prerequisites\Windows 2012 R2 Patches` folder):
  - a. Windows8.1-KB2993651-x64.msu
  - b. Windows8.1-KB2975719-x64.msu
  - c. Windows8.1-KB2993100-x64.msu
  - d. Windows8.1-KB2979582-x64.msu
  - e. Windows8.1-KB2990532-x64.msu
  - f. Windows8.1-KB2995004-x64.msu
3. On the database, ensure the Asset Performance Management user and the MESDB user have read and write permissions.
4. Once the upgrade as completed, ensure Internet Explorer is updated to the most recent.

## 3.16 APM Service Cannot Be Restarted

### *Problem*

The AMApplicationServer service cannot be restarted after it stops. If the workaround in “AMApplicationServer Service not running after installation” is performed, the error reoccurs within a few weeks.

### *Solution*

This problem can occur if the RabbitMQ service cannot start up because it cannot locate the security certificates. The problem can be resolved by updating the configuration to use Trusted Certificates.

**NOTE**

If you are using self-signed certificates, depending on your network security settings, the certificates might be deleted as a result of security policy. This problem will occur if the certificates are deleted. We recommend using Trusted Certificates.

If you require time to order Trusted Certificates, the workaround in “AMApplicationServer Service not running after installation” will create temporary certificates that can be used until the next certificate deletion.

Use the Configuration Utility provided with R520.3 (or R520.2 FF001) to update the certificate configuration.

1. Stop the following services:
  - a. AMApplicationServer
  - b. Honeywell UAS Calculation Host
  - c. Honeywell UAS Event Translator services
2. Close the Services window.
3. In a command prompt, run the following command after updating it to include the details for your system:

```
[Install
Dir]\AssetManager\Tools\InstallConfiguration\Honeywell.UAS.Configuration.exe -r
-p [UAS service account password] -s [ServerCertificateLocation] --
rabbitserverpassword [ServerCertificatePassword] -c
[ClientCertificateLocation] --rabbitclientpassword
[ClientCertificatePassword]
```

If this is an additional calculation server (rather than the main calculation server), use the following command:

```
[Install
Dir]\AssetManager\Tools\InstallConfiguration\Honeywell.UAS.Configuration.exe -r
-p [UAS service account password] -c [ClientCertificateLocation] --
rabbitclientpassword [ClientCertificatePassword]
```

4. Start the following services:
  - a. AMApplicationServer
  - b. Honeywell UAS Calculation Host
  - c. Honeywell UAS Event Translator services
5. Perform an iisreset.


## 3.17 The Trusted certificate (depth level greater than 1) issue while configuring RabbitMQ

### Problem:

If the trusted certificate depth level is greater than 1

Example



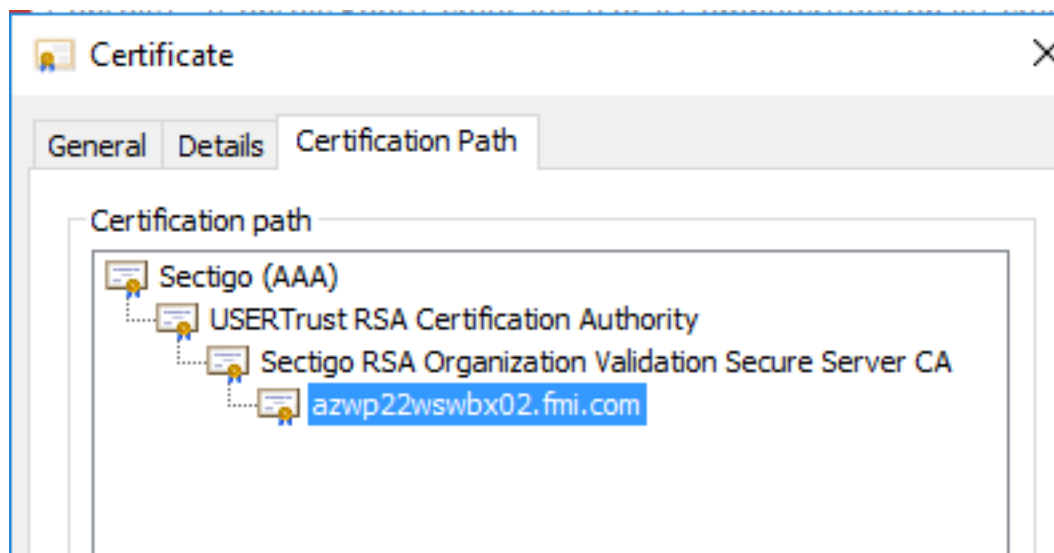

### Solution:

1. Navigate to the below folder:  
C:\ProgramData\RabbitMQ
2. Open rabbitmq.conf file and set the below key to ssl\_options.depth=3 (this is the example for above attached certificate)
3. Reconfigure the rabbit MQ with the trusted certificate as shown below

In a command prompt, run the following command after updating it to include the details for your system:

```
[Install
Dir]\AssetManager\Tools\InstallConfiguration\Honeywell.UAS.Configuration.exe -r
-p
[UAS service account password] -s
[ServerCertificateLocation] --rabbitserverpassword [ServerCertificatePassword] -
c
[ClientCertificateLocation] --rabbitclientpassword [ClientCertificatePassword]
```

If this is an additional calculation server (rather than the main calculation server), use the following command:

```
[Install
Dir]\AssetManager\Tools\InstallConfiguration\Honeywell.UAS.Configuration.exe -r
-p
[UAS service account password] -c
[ClientCertificateLocation] --rabbitclientpassword [ClientCertificatePassword]
```

## 3.18 APM application is not installing in AM and DAS logs

### Problem:

After installing APM application, in AM and DAS logs, below message is seen during service start.

```
System.ServiceModel.Security.SecurityNegotiationException: A call to SSPI failed, see inner exception. --->
System.Security.Authentication.AuthenticationException: A call to SSPI failed, see inner exception. --->
System.ComponentModel.Win32Exception.
```

## Solution:

The target principal name is incorrect. This is due to incorrect SPN configuration. If you are connecting to a DAS server, but did not select and provide the DAS connection settings during the install, you can update the service configuration after Asset Performance Management is installed to allow the connection.

### To update the service configuration file for DAS

1. Open the Honeywell.AM.Service.AMHostingService.exe.config file.

By default, this file is in the following location:

[Install Drive]: \Program Files (x86)\Honeywell\MES\AssetManager\AppServer\Bin

2. Locate the <configuration> section.
3. Add the following to the <configuration> section after replacing [DASServer] and [DASPort] with the fully qualified domain name and port number of your DAS server:

```
<system.serviceModel>
<behaviors>
<endpointBehaviors>
<behavior name="BigQuota">
<dataContractSerializer maxItemsInObjectGraph="2147483647" />
</behavior>
</endpointBehaviors>
</behaviors>
<bindings>
<basicHttpBinding>
<binding name="MES_Internal_System" closeTimeout="00:01:00"
openTimeout="00:01:00" receiveTimeout="00:01:00" sendTimeout="00:01:00"
allowCookies="false" bypassProxyOnLocal="false"
hostnameComparisonMode="StrongWildcard" maxBufferSize="2147483647"
maxBufferPoolSize="2147483647" maxReceivedMessageSize="2147483647"
messageEncoding="Text" textEncoding="utf-8" transferMode="Buffered"
useDefaultWebProxy="true">
<readerQuotas maxDepth="32" maxStringContentLength="8192"
maxArrayLength="16384" maxBytesPerRead="4096"
maxNameTableCharCount="16384" />
<security mode="TransportCredentialOnly">
<transport clientCredentialType="Windows"
proxyCredentialType="None" realm="" />
<message clientCredentialType="UserName"
algorithmSuite="Default" />
</security>
</binding>
</basicHttpBinding>
<netTcpBinding>
<binding name="MES_Internal_System" closeTimeout="00:10:00"
```

```

openTimeout="00:10:00" receiveTimeout="00:10:00" sendTimeout="00:10:00"
maxBufferPoolSize="2147483647" maxBufferSize="2147483647"
maxReceivedMessageSize="2147483647">
<security mode="Transport">
<transport clientCredentialType="Windows" />
</security>
</binding>
</netTcpBinding>
</bindings>
<client>
<endpoint address="http://[DASServer]:[DASPort]/MES/Core/DataAccess/
MasterDataAccess1.0/DataAccessServiceLocator.svc"
binding="basicHttpBinding" bindingConfiguration="MES_Internal_System"
behaviorConfiguration="BigQuota"
contract="DataAccessServiceClients.MasterDataAccessService.IDataAccessSer
viceLocator" name="DataAccessServiceLocatorEndPoint">
<identity>
<servicePrincipalName value="http/[DASServer]" />
</identity>
</endpoint>
<endpoint address="" binding="netTcpBinding"
bindingConfiguration="MES_Internal_System"
contract="DataAccessServiceClients.IntuitionDataSource.IIntuitionDataSou
rce" name="NetTcp_IIntuitionDataSource" />
<endpoint address="" binding="netTcpBinding"
bindingConfiguration="MES_Internal_System"
contract="DataAccessServiceClients.WCFTTimeSeries.IWCFTTimeSeries"
name="NetTcp_IWCFTTimeSeries" />
</client>
</system.serviceModel>

```

4. **Save and close the configuration file.**

## 3.19 MES Landing page not opening in co-existence server after APM R531.1 installation

### *Problem*


MES landing page not loading. Below error is displayed.

**HTTP Error 500.52 - URL Rewrite Module Error.**

### *Solution*

Perform the following steps in Web Server:

1. Open **Internet Information Service Manager** (IIS Manager).
2. From **Connections** pane, expand **Sites** and select **Default Web Site**.
3. The **Default Web Site Home** is displayed.
4. Double-click **URL Rewrite**.
5. Open **ForgeAppsOutboundrules**.
6. Click **Edit** option of **Precondition**.  
**Edit Preconditions** dialog box appears.
7. Click **Add**.  
**Add Condition** dialog box appears.
8. Enter the values as given below:
  - a. Enter **{RESPONSE\_CONTENT\_ENCODING}** as **Condition input** value.
  - b. Click **Check if input string** drop-down and select **Does Not Match the Pattern**.
  - c. Enter **^gzip** as **Pattern** value.
  - d. Select **Ignore case** checkbox.

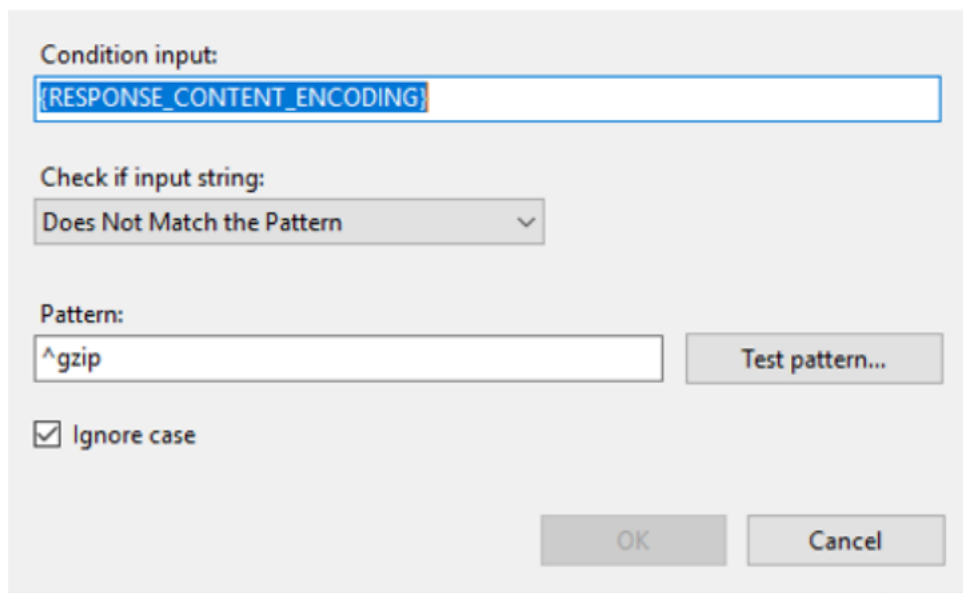

Condition input:

Check if input string:

Pattern:

☒ Ignore case

9. Click **OK**.

## 3.20 Install Microsoft SQL Server 2012 Native Client

### *Problem*

Install Microsoft SQL Server 2012 Native Client

### *Solution*

1. On the installation media, browse to `installer/prerequisites/sqlncli.msi`
2. Right click `sqlncli.msi` and click **install**.
3. Follow on screen instructions to complete the installation.

## 3.21 Maintenance Tool Stopped Working

If Maintenance Tool has stopped working error message dialog box appears by the end of installation, click **Close the program** to ignore the error.

## USER INTERFACE AND VIEWER ERRORS

### 4.1 Error “HTTP error 503. The service is unavailable” OR “Access is denied. You do not have permission to access this application”

#### *Problem*

When you change the Asset Performance Management application server to a different network/domain, the Asset Performance Management User Interface is not displayed. An error message “HTTP error 503”. Service is unavailable” is displayed when you try to login using the Asset Performance Management login credentials after you change the domain.



#### *Solution*

The above error can be resolved by performing the following steps:

1. Choose **Start > Run** and type **Inetmgr**.

The Internet Information Services (IIS) Manager window appears.

2. On the left pane, expand the server and select **Application Pools**.

The **Application Pools** pane is displayed in the right hand pane.

3. For MES related pools (except MESRouting4.0), change the user credentials in **Identity** column to a new domain user. For example, to change the Identity of MESCommon application pool, right-click and select **Advanced Settings**. In the **Advanced Settings** dialog box, change the user name in the Identity field to the new domain user.
4. Add the new domain user to the following user groups.
  - a. MESDBUser
  - b. MES System Admin

#### **ATTENTION**

You must perform this step on an AM server installed on a 64 Bit Operating System platform. Ensure that the user groups “MES System Admin” and “MESDBUser” have the domain user privileges.

5. **Run > IISRESET**.

6. Manually start SMTP Server in Internet Information Services 6.0 Manager.
7. For AM and MES Data Models, create the new domain user in the SQL users list with DB Admin Privileges.

You can now open the Asset Performance Management application with the new domain user login credentials.

## 4.2 Error - “An Add on for this website failed to run”

### *Problem*

The problem occurs when the Asset Performance Management URL is not configured in the local intranet zone and you try logging into the Asset Performance Management User interface.

### *Solution*

This problem can be resolved by adding the Asset Performance Management URL to the Local Intranet Zone in Internet Options.

To add the Asset Performance Management URL, perform the following steps.

1. Browse to **Internet Explorer > Tools > Internet Options > Security**.
2. **Click the Local Intranet icon and then click Sites.**  
The **Local Intranet dialog box** appears.
3. Type the Asset Performance Management URL (**http:// <AMServerHostName>**) in the **Add this website to the zone** box and then click **Add**.
4. Click **Close** to close the **Local Intranet** dialog box.
5. Click **OK** on the **Internet Options** dialog box.
6. **On the Internet Explorer, click the Refresh icon for the changes to reflect.**

## 4.3 Asset Performance Management home page is not displayed

### *Problem*

This problem can occur due to any or all of the following reasons:

- When Asset Performance Management is installed on a non-default web site, perform the steps provided in Solution 1.
- When a recent patch of MES is installed on the Asset Performance Management, perform the steps provided in Solution 2.
- When the Asset Performance Management is not added to Trusted sites, perform the steps provided in Solution 3.
- After the Asset Performance Management service (runtime) account has been changed, perform the steps provided in Solution 4.

### *Solution*

**Solution 1: When Asset Performance Management is installed on a non-default web site, perform the following steps:**

1. Provide the IP address of the Asset Performance Management.
  - a. On the Asset Performance Management, choose **Start > Run**.
  - b. In the **Run** dialog box, type **Inetmgr** and click **OK**.

The **Internet Information Services (IIS) Manager** window appears.

- c. On the left pane, expand **Sites** and then click **Non Default Websites**.
- d. From the **Actions** pane, click **Bindings**.

The **Site Bindings** window appears.

- e. Click **Edit**.
- f. In the **Edit** dialog box, ensure if the IP address box is configured with the IP address of the Asset Performance Management. If the IP address of the Asset Performance Management is not configured, then provide the Asset Performance Management IP.
- g. Click **Close**.

2. Delete the Temporary Internet files.
3. Reset IIS.

Try accessing the Asset Performance Management. The Asset Performance Management home page must be displayed.

**Solution 2: When a recent patch of MES is installed on the Asset Performance Management, perform the steps**

1. Delete the Temporary Internet files.

Deleting the temporary Internet files can speed up the loading of Web pages.

**To delete the temporary Internet files:**

- a. Choose **Internet Explorer > Tools > Internet Options > Connections > LAN Settings**.  
The **Local Area Network Settings** dialog box appears.
- b. Clear the **Use a Proxy server for your LAN** check box and then click **OK**.
- c. Click the **General** tab.
- d. From the **Browsing History** section, click **Delete**.

The **Delete Browsing History** dialog box appears.

- e. Select the **Temporary Internet Files** check box and then click **Delete**.
- f. Click **OK**.

2. Reset IIS.

Resetting the IIS restarts the Web server.

**To reset IIS**

- a. Choose **Start > Run**.
- b. In the Run dialog box, type **IISRESET** and click **OK**.



**NOTE**

Resetting the IIS stops the SMTP server due to which the outgoing mails are not delivered. Hence, you must manually start the SMTP server.

Try accessing the Asset Performance Management from the browser. If the Asset Performance Management home page is still not displayed, contact your Technical Support for more information.

**Solution 3: When the Asset Performance Management is not added to Trusted site**

Add the Asset Performance Management under trusted sites.

**To add the Asset Performance Management to trusted sites:**

1. Choose **Internet Explorer > Tools > Internet Options > Security > Trusted Sites**.
2. Click **Sites**.
3. The **Trusted Sites** dialog box appears.
4. From the Websites drop-down list and select the Asset Performance Management.
5. Click **Add**.
6. Click **OK**.

**Solution 4: After the services user has been changed**

After the services (runtime) user has been changed, ensure the new user has access to MachineKeys.

**To add access to MachineKeys:**

1. On the Web Server, navigate to the following folder:  
`C:\ProgramData\Microsoft\Crypto\RSA\`
2. Right-click **MachineKeys**, and from the menu, select **Properties**.
3. In the Properties dialog box, select the **Security** tab.
4. Click **Edit**.
5. Click **Add**.
6. Type the name of the new services user.
7. Click **OK**.
8. Ensure the services user account has Read permissions, and then click **OK**.
9. Perform an IIS reset.

## 4.4 Displaying wrong tooltips on trends

*Problem*

Tooltip displays wrong data in the trend control if the data is closely packed.

*Solution*

Increase the size of the trend control or zoom in the view.

## 4.5 Repeatedly asked to provide login credentials

### *Problem*

When you access the Asset Performance Management application, you might be repeatedly (at least four times) asked to provide the login credentials.

### *Solution*

#### **Part One**

Confirm the Asset Performance Management site has been added to the Local Intranet.

1. Choose **Internet Explorer > Tools > Internet Options**.

The Internet Options dialog box appears.

2. On the **Security** tab, click **Local intranet**.

The **Security Settings** dialog box appears.

3. Click **Sites**.
4. Click **Advanced**.
5. If the Asset Performance Managementsites (both fully-qualified and non-fully qualified domain names) do not appear on the list, for both the fully-qualified and non-fully qualified domain names, enter the address in the **Add this website to the zone list**, and then click **Add**.

#### **NOTE**

Ensure the servers are added using the correct protocol (https or http).

6. Click **OK**.
7. Click **OK** to save the settings and close the Internet Options dialog box.

#### **Part Two**

If the Asset Performance Management site is already added to the Local Intranet, configure Internet Explorer to always use the current user's logon credentials.

1. Choose **Internet Explorer > Tools > Internet Options**.

The Internet Options dialog box appears.

2. On the **Security** tab, click **Custom Level**.
3. The **Security Settings** dialog box appears.
4. From the **Settings** list, under the **User Authentication** section, select the **Automatic logon with current user name and password option**.
5. Click **OK**.
6. Click **OK** to save the settings and close the Internet Options dialog box.

## 4.6 Asset Performance Management application does not allow you to change your user roles

### Problem


Sometimes, when you login to the Asset Performance Management server using the Asset Performance Management URL, the application might not prompt you to provide the username and password. This is because your credentials are cached by the browser during your previous logins which might result in using the same user role every time you login to the application.

### Solution

You must perform the following steps if you want to login to the application using a different user role.

1. Delete the cookies and the saved passwords from the browser.
  - a. Choose **Internet Explorer > Tools > Delete Browsing History**.

The **Delete Browsing History** dialog box appears.

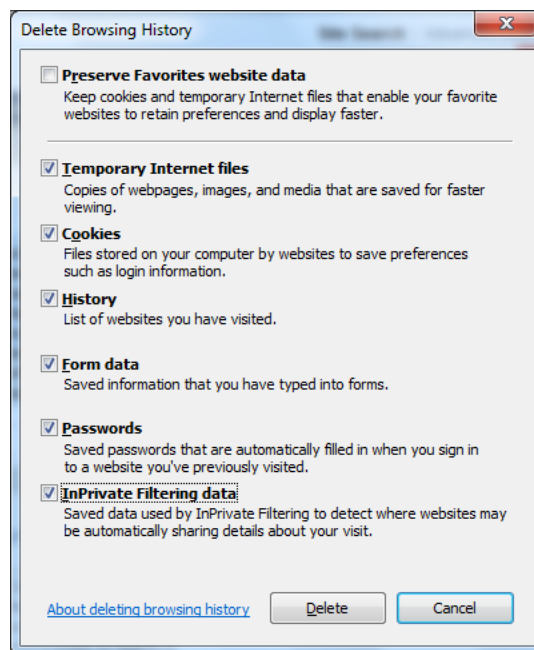


- b. Select the following checkboxes:
      - a. Temporary Internet files
      - b. Cookies
      - c. History
      - d. Form data
      - e. Passwords
      - f. InPrivate Filtering data
  - c. Click **Delete**.

2. Change the Security settings of the browser.
  - a. Choose **Internet Explorer > Tools > Internet Options**.

The **Internet Explorer** dialog box is displayed.

- b. Click the **Security** tab and then click **Custom Level**.

The Security Settings - Local Intranet Zone dialog box appears.

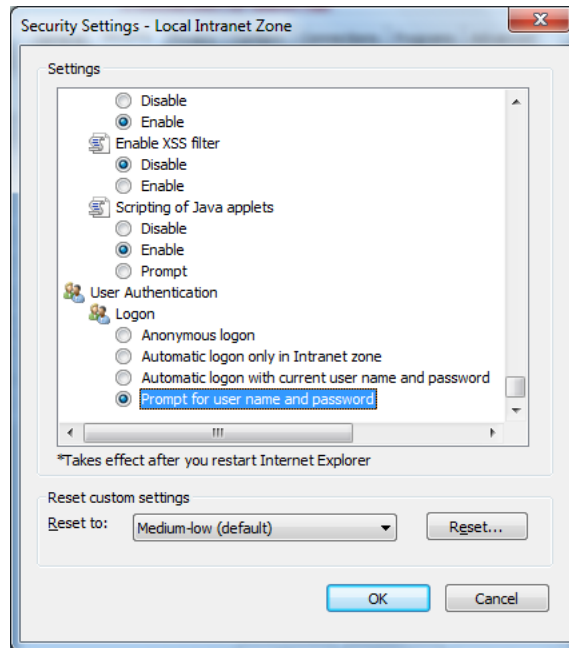

- c. From the Settings list, under the User Authentication section, select the **Prompt for username and password** option.
  - d. Click **OK**.
  - e. Click **OK** to save the settings and close the Internet Options dialog box.

## 4.7 Fault details not refreshed even after enabling the auto refresh option problem

### *Problem*

When ten or more clients are connected simultaneously to the Asset Performance Management server, on some client computers, the latest fault details are not updated on the dashboard even after the "Auto Refresh" check box is selected.

### *Solution*

Manually refresh the dashboard on the client computers clients to reload the fault details.

## 4.8 Error - "SQL CMD not found"

### *Problem*

When is installed on a non-default path (example: E drive), the installation fails displaying a "SQL CMD not found" error.

### *Solution*

Perform the following steps to resolve the problem.

- Check if the MES framework is installed properly.
- Verify if the following text files are available in the MES Foundation ([install drive]:\Program Files (x86)\Honeywell\MES Foundation) folder:
  - Install
  - Uninstall
  - Product Version

## 4.9 “AMReports” folder not created

### *Problem*

The “AMReports” folder is not created by default in the “Reports” view of the Asset Performance Management User Interface after installation. This problem occurs only when MES Foundation is installed on a non-default port.

### *Solution*

Perform the following steps where the report server is installed:

1. Browse to [InstallDrive]:\Program Files (x86)\Honeywell\MES\AssetManager\Tools\AMReports and edit the **RS Scriptor Load All Items** file.
2. Update the reportsrtserver name(Use FQDN for Https machines) and port in the following key  
SETREPORTSERVER=http://localhost <include port number>/ReportServer

Example, SET REPORTSERVER=https://APPS-TEAM-DB.dev.local:443/ReportServer

3. Close the **RS Scriptor Load All Items** file.
4. Run the **RS Scriptor Load All Items** file again and then restart the Asset Performance Management application.

## 4.10 Error - “Unable to establish communication with Server. General Exception”

### *Problem*

The error occurs when you access the ‘HARTConfiguration’ link available in the physical information folder under the ‘Asset Links’ view of Asset Performance Management.

### *Solution*

1. Verify if FDM Client is installed on the local machine from where you access the ‘HARTConfiguration’ link.
2. Verify if ‘FDM Remote Communication Interface’ service is running on FDM server and client machines with the same user credentials.

## 4.11 Halt in execution of models

### *Problem*

The problem occurs when you experience a halt while executing models.

### *Solution*

Check the status of server windows firewall. The status must be OFF. For more information on the Windows firewall settings refer to the *Asset Performance Management Installation Guide*.

## 4.12 Error Message - Images Uploading Failed

### *Problem*

An error message appears when you try to change the icon for the existing asset type /asset class.

### *Solution*

1. Ensure that the file is not “ReadOnly”.
2. Ensure that the file is not large to be set as an icon. If the file is too large, you must select a different icon.

## 4.13 Not able to view log files

### *Problem*

On the Asset Performance Management user interface, the log files are not displayed in the Maintain > Log Viewer for R410 and above releases.

### *Solution*

You must browse to the following path to view the log files:

```
%PROGRAMDATA%\Honeywell\Asset Performance Management\LogFiles
```

## 4.14 Honeywell Intuition landing page does not load

### *Problem*

After installing, the Honeywell Intuition Landing Page does not load as expected. Instead, the following message is displayed: “Unexpected system error occurred. Please contact the Administrator.”

### *Solution*

This error can occur if directory browsing is not enable on all required sites in IIS, or if the application pools are running as a local user while using a split server on a domain.

#### **Solution 1: Enable Directory Browsing in IIS**

1. Choose **Start > Administrative Tools > Internet Information Services (IIS) Manager**.
2. Expand the **Sites** list.
3. Do all of the following for the MES site, the **MES > Core** site, the **MESImpl200** site, and the **MESImpl200 > Core** site:
  - a. Select the site, and then double-click **Directory Browsing**.
  - b. In the right-hand sidebar, click **Enable**.

4. Do all of the following to test the basic settings for the **MES** site, the **MES > Core** site, the **MESImpl200** site, and the **MESImpl200 > Core** site:
  - a. Select the site, and then on the right-hand side bar, click **Basic Settings**.
  - b. In the **Edit Site** dialog box, click **Connect As**.
  - c. Select **Specific User**, and then click **Set**.
  - d. Enter the user credentials for the user with which you are attempting the access the Honeywell Intuition Landing Page.
  - e. Click **OK** to close the **Connect As** dialog box.
  - f. In the **Edit Site** dialog box, click **Test Settings**.
  - g. Check the test results. If there are any errors, resolve the issue and attempt the test again.
  - h. Click **OK** to close the **Test Connection** dialog box.
  - i. Click **OK** to close the **Edit Site** dialog box.
5. Perform an iisreset.

The Honeywell Intuition Landing Page should now load as expected.

### Solution 2: User Domain Accounts

Ensure domain accounts are used. For example, in all the following cases:

- Running IIS application pools
- MESDBUser group
- Running Windows services
- folder permissions

## 4.15 Could Not Connect to net.tcp error after upgrade

### *Problem*

After upgrading from Asset Manager R410.2 to Asset Performance Management R500.1, attempting to create and validate a calculation for an asset type results in an error:

```
Could not connect to net.tcp://[ConfigurationServiceURL]. The connection attempt lasted for a time span of [timespan]. TCP error code 10061: No connection could be made because the target machine actively refused it [IPAddress].
```

### *Solution*

Create the missing system profile desktop folder, and provide Systemprofile Full Control.

1. In Windows Explorer, navigate to one of the following folders, based on your operating system:
  - a. For 32-bit systems: %SYSTEMROOT%\system32\config\systemprofile\
  - b. For 64-bit systems: %SYSTEMROOT%\SysWOW64\config\systemprofile\
2. Create a new folder called Desktop.
3. Right-click the new Desktop folder, and select **Properties**.
4. Select the Security tab.
5. If the Systemprofile user is not already listed, add the user and grant Full Control permissions.

## 4.16 Using APM tags in Insight Graphics Causes Error

### *Problem*

When configuring graphics to use APM tags, the following error occurs:

An unhandled exception occurred and the process was terminated.

Application ID: /LM/W3SVC/1/ROOT/MESImpl200/Core/DataAccess/Insight1.0

Process ID: 6292

Exception: System.InvalidOperationException

Message: There are no assets found.

StackTrace: at

Honeywell.Intuition.DataAccess.DataSourcePlugins.AssetManager.Plugin.GetTimeSeriesValues(TimerSeriesFilter filter)

at

Honeywell.Intuition.DataAccess.DataSourcePlugins.AssetManager.Plugin.GetTimeSeriesValues(Dictionary`2 filters)

at

Honeywell.Intuition.DataAccess.CacheManagerPlugins.InMemory.Plugin.<>c\_\_DisplayClass45.<CacheGetTimeSeriesValuesFromSource>b\_\_34()

at System.Threading.ThreadHelper.ThreadStart\_Context(Object state)

at System.Threading.ExecutionContext.RunInternal(ExecutionContext executionContext, ContextCallback callback, Object state, Boolean preserveSyncCtx)

at System.Threading.ExecutionContext.Run(ExecutionContext executionContext, ContextCallback callback, Object state, Boolean preserveSyncCtx)

at System.Threading.ExecutionContext.Run(ExecutionContext executionContext, ContextCallback callback, Object state)

at System.Threading.ThreadHelper.ThreadStart()

### *Solution*

This error appears when the DAS plugin is not configured to use the correct URL for the Asset Performance Management tags. To correct the issue, confirm the URL is properly configured in the DAS plugin.

## 4.17 Error “Internal Server Error Undefined” appears when opening tabs

### *Problem*

If the browser window is left idle with a tab (such as a trend) opened for an extended period of time, the error “Internal Server Error Undefined” can appear when attempting to open tabs following the idle period.

### *Solution*

Refresh the browser or clear the browser cache and then reopen the tab.



## 4.18 Time Control does not appear on the trend in 4-Server installation

### *Problem*

When viewing a trend on a system with a 4-server install, the time control does not appear. This occurs when the server name for the time services is incorrect.

### *Solution*

Update the URLs for the time services in the database to ensure they point to the Web Server.

1. Open **SQL Server Management Studio**.
2. Expand **Databases > Honeywell.Intuition.Base > Tables > SystemCatalogs.Services**.
3. Edit the table rows and ensure the **URL** for all time-related services is configured to use the Web Server.

## 4.19 Error when attempting to view Calculation Status if file extensions are not allowed

### *Problem*

When viewing the Calculations Status page, attempting to view individual calculations results in an error.

### *Solution*

This error occurs when attempting to view a calculation with the calculation identifiers includes a period in the name, such as those constructed in the `[AssetName].[CalculationName]` format.

If unlisted file name extensions are not allowed on the system, the identifier is mistakenly read as a file extension, resulting in an error. For example, a calculation with the identifier `P12345A.Centrifugal-Process` is incorrectly interpreted as having a `.Centrifugal-Process` file extension.

To resolve the issue, update the IIS feature settings to allow unlisted file name extensions.

1. Open **Internet Information Services (IIS) Manager**.
2. Expand **Sites** and then select **Default Web Site**.

### **NOTE**

If Asset Performance Management is installed to a non-default site, select that node instead.

3. Double-click **Request Filtering**.
4. In the right-hand side bar, select **Edit Feature Settings**.
5. Under General, select the **Allow unlisted file name extension** checkbox, and then click OK.
6. Perform an `iisreset`.
7. Clear the browser cache.

## 4.20 The Error “The application is experiencing network issues” appears when using the Event Viewer

### *Problem*

Network connectivity issues result in an error when viewing the Event Viewer.

**Solution**

This can sometimes be resolved by enabling Web Sockets in IIS on the Web Server.

1. Open the windows **Server Manager**.
2. On the left-hand side, select **Local Server**.
3. In the toolbar on the top right, choose **Manage > Add Roles and Features**.
4. In the **Add Roles and Features Wizard**, click **Next** until you reach the **Server Roles** page.
5. On the Server Roles page, do all of the following:
  - a. In the **Roles** list, expand **Web Server (IIS) > Web Server > Application Development**.
  - b. Select **WebSocket Protocol**.
6. Click **Next** until you reach the end of the wizard, and then click **Install**.
7. Perform an iisreset.

## 4.21 Faults do not occur as expected after updating in the Legacy Configuration

**Problem**

After using the Legacy Configuration Fault Management to update a fault (Eliminated, Latch, Unlatch, CloseOut, Insert) the fault no longer occurs as expected.

**Solution**

The Fault Management features of the Legacy Configuration (Eliminated, Latch, Unlatch, CloseOut, Insert) were retired in R520 and no longer function as expected. The Event Management view should be used to Close or otherwise update fault events.

To resolve the issue after updating using the Legacy Configuration, restart the **AMApplicationServer** service.

## 4.22 Coexistence - Error


**Problem**

If user have UI220.1 for APM does not open event for any of the management pages.

**Solution**

You needs to add the following appSettings to web.config of Fault Viewer in web server:

**<Install Location>:\Program Files (x86)\Honeywell\MES\AssetManager\WebServer\FaultViewer**

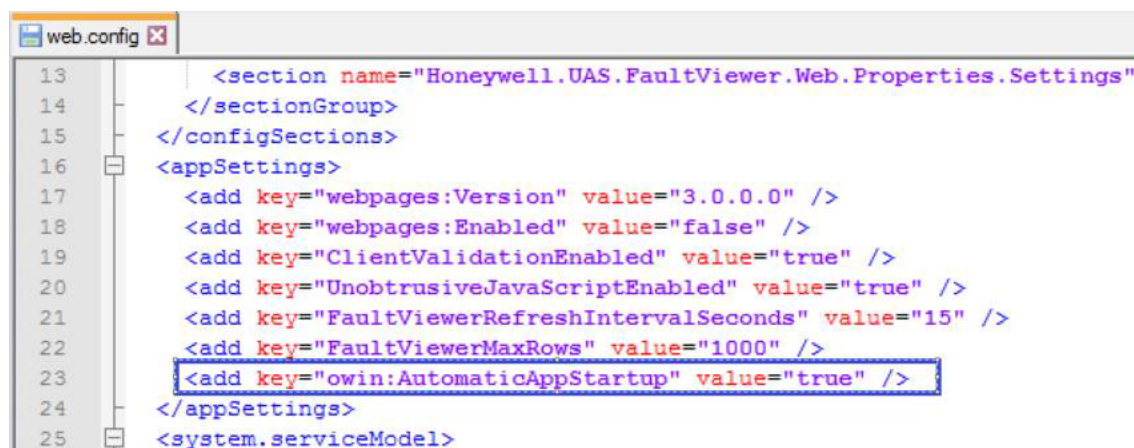

```

13      <section name="Honeywell.UAS.FaultViewer.Web.Properties.Settings"
14      </sectionGroup>
15      </configSections>
16      <appSettings>
17          <add key="webpages:Version" value="3.0.0.0" />
18          <add key="webpages:Enabled" value="false" />
19          <add key="ClientValidationEnabled" value="true" />
20          <add key="UnobtrusiveJavaScriptEnabled" value="true" />
21          <add key="FaultViewerRefreshIntervalSeconds" value="15" />
22          <add key="FaultViewerMaxRows" value="1000" />
23          <add key="owin:AutomaticAppStartup" value="true" />
24      </appSettings>
25      <system.serviceModel>
  
```

## 4.23 Fault Model Expression Length Error

For a fault model if the string characters in the expression are big the **Check Syntax** functionality will not work. Follow the below steps to resolve this issue.

1. Navigate to the following location in web server:  
[Install Location]:\Program Files (x86)\Honeywell\MES\AssetManager\WebServer\WUI\web.config
2. Open **web.config** file and search for **system.web** section.  
Enter the below two keys in **httpRuntime** as shown in the below image.
  - maxUrlLength="10999"
  - maxQueryStringLength="2097151"

```


C:\Program Files (x86)\Honeywell\MES\AssetManager\WebServer\WUI\web.config - Notepad++ [Administrator]
File Edit Search View Encoding Language Settings Tools Macro Run Plugins Window ?
web.config
41 </layout>
42 </appender>
43 <root>
44 <level value="WARN" />
45 <appender-ref ref="RollingLogFileAppender" />
46 </root>
47 </log4net>
48 <ILMSettings configSource="ILMSettings.config" />
49 <!--
50 For a description of web.config changes see http://go.microsoft.com/fwlink/?LinkId=235367.
51
52 The following attributes can be set on the <httpRuntime> tag.
53 <system.Web>
54 <httpRuntime targetFramework="4.5" />
55 </system.Web>
56
57 -->
58 <system.web>
59 <machineKey validationKey="AutoGenerate" decryptionKey="AutoGenerate" validation="SHA1" decryption="AES" />
60 <compilation targetFramework="4.7.1" />
61 <httpRuntime enableVersionHeader="false" maxRequestLength="104857600" maxUrlLength="10999" maxQueryStringLength="2097151"/>
62 <httpCookies httpOnlyCookies="true" />
63 <pages controlRenderingCompatibilityVersion="4.0">
64 <namespaces>
65 <add namespace="System.Web.Helpers" />
66 <add namespace="System.Web.Mvc" />
67 <add namespace="System.Web.Mvc.Ajax" />
68 <add namespace="System.Web.Mvc.Html" />
69 <add namespace="System.Web.Optimization" />
70 <add namespace="System.Web.Routing" />
71 <add namespace="System.Web.WebPages" />
72 </namespaces>
73 </pages>
<cacheing>

```

3. Save **web.config** file.
4. Open Internet Information Services (IIS) in web server.
5. Open Configuration Editor for the below section:

system.webServer/security/requestFiltering

6. Enter the value **2097151** for **maxQueryString**.

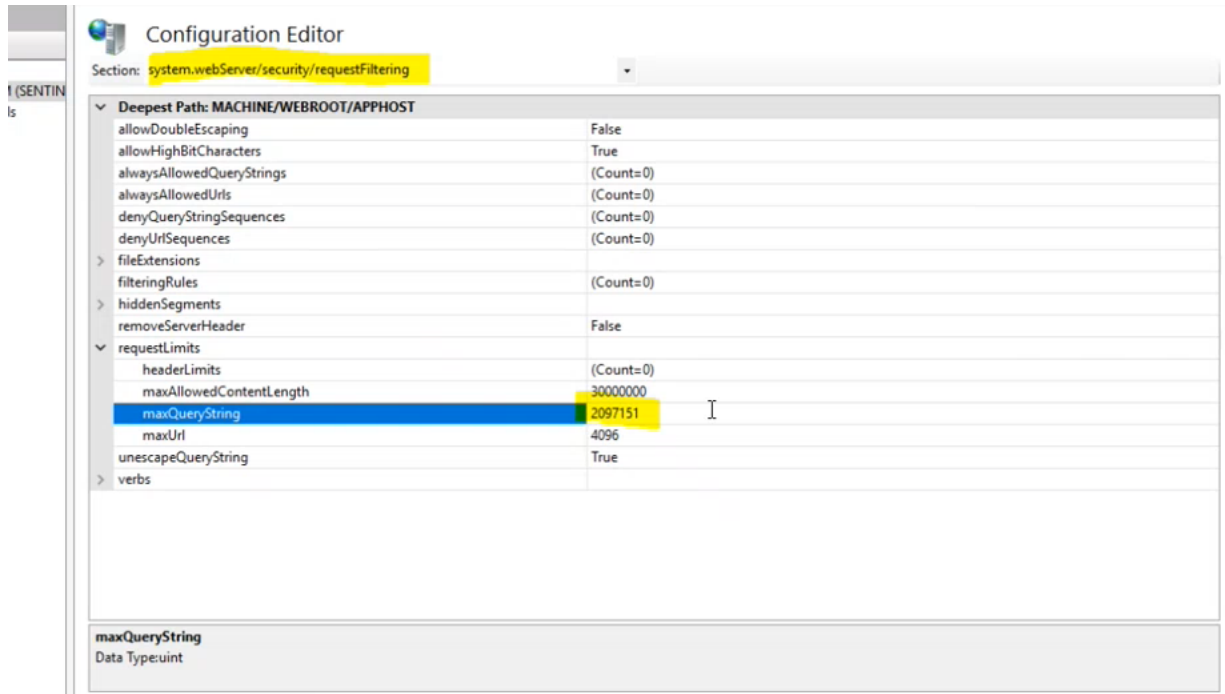

## EXTERNAL DATA SOURCE AND EPHD ERRORS

### 5.1 Data Source Page Not Loading

The reason for the data source page not loading can be of any of the below reasons:

- [Data Source Page Not Loading](#).
- The XML is not properly parsed in the database for ExternalDataSources table.
- [Error during migration of database from one testbed to another testbed](#).
- The **ClusterManagementService** deployment can be missing while migrating from R532.x. Run the below command in application server to resolve this issue:

**<Media  
Location>**

```
: \Installer\Components\US\MSIs\Configuration\Honeywell.UAS.Configuration.exe --
skipcert -u "DomainName\Service Account" -p "< ServiceUser Password>
```

### Double Slash for .dll Path in ISAPI Filter

Follow the below steps in the application and web server to ensure the .dll path in the ISAPI filter have only one slash:

1. Choose **Start > Run**, type **inetmgr**, and click **OK**.  
The **Internet Information Services (IIS) Manager** window appears.
2. Click **Default Web Site** to display the **Default Web Site Home** in the center pane.
3. Double-click **ISAPI Filters**.  
ISAPI Filters page appears.
4. Ensure the .dll path under the **Executable** column has only one slash. If there is a double slash, remove the extra slash.
5. Open command prompt as administrator.  
Enter **IISRESET** in the command prompt and press **Enter**.
6. Reload the Data Source configuration page.

### Database Migration

Follow the below steps to resolve the error during migration of database from one testbed to another testbed:

1. Navigate to the following folder in the server where influxdb is hosted:  
**<Install Location>\Program Files\influxData\influxdb**
2. Open command prompt as administrator and run the below command:  
**influxd backup -portable <path-to-backup-folder>**  
Where, **<path-to-backup-folder>** is the path in step 1.
3. To restore the influx database in the test server, you need to drop the database.

Run the below command to connect with the influx database:

Honeywell\_EED database influx -ssl -host <HostName> -database="<Database Name>" -username=<User Name> -password= <Password>

#### NOTE

If the influx database is using **http** communication mode, do not use **ssl** term as given in the above command.

4. Once the database is dropped, run the restore command in the test server to host the production server influx database.

Since the Asset task model database is moved from production to the test server, perform the below steps:

1. Navigate to <Install Location>:\Utilities\InfluxDBUtilityScript in Database Server and run the following SQL scripts :
  - a. **Key store Cleanup.sql**: This will drop Encryption Key table/Procedures/DbColumnEncryptionKeys.

#### NOTE

Take a backup of the configuration and delete the entries from the ExternalDatasources table since this SQL script does not update/delete the existing non-default influx typed datasources.

- b. **AddEncryptionTablesProceduresKeys.sql**: This will create Keys/Tables/Procedures for Encryption.
2. Run the below query in the SQL Server to check whether an encryption key is available:  
[Honeywell.MES.AssetTask.DataModel.AssetTaskDataModel].dbo.ExternalDataSourceEncryptionKey
3. If there are no rows available, navigate to the below path and execute the power shell script as an administrator in the application server and then in the web server:  
[installation media]\Utilities\EncryptData\EncryptData.ps1
4. Provide the following inputs during execution of powershell script:
  - a. **Service account password**
  - b. **Influxdb user**
  - c. **Password of influxdb user**
5. Open command prompt as administrator.  
Enter **IISRESET** in the command prompt and press **Enter**.

## 5.2 Connection of the server lost to the external interfaces

### 5.2.1 Problem

When the connection of the server is lost to any one of the external interfaces, the application will retry to connect to the external interface for 5 times in a time interval of 5 minutes (that is, it connects once in every one minute) and then stops if it fails to connect. When the application verifies the connection for the first 5 trials, the status of the external interface is "Marginal". However, if the external interface does not come alive after 5 trials, the interface will be switched to "Not Running" status.

### 5.2.2 Solution

You must restart the application service for data or event communication with the external data source.

## 5.3 Excel Data Source Data not Appearing

### Problem

Data from the Excel data source does not appear, and an error message appears in the logs. The Excel data source might appear as not running.

### Solution

Update the DCOM settings for Excel on the server with the calculation components (in a three-server installation, this is typically the Application Server, but in a four-server installation it is the standalone Calculation Server).

1. Open Component Services. (Run dcomcnfg, or **Start > All Programs > Accessories > Component Services**.)
2. On the tree, expand **Component Services > Computers > My Computer > DCOM Config**.
3. Right-click **Microsoft Excel Application** (or CLSID {00024500-0000-0000-C000-000000000046}), and then click **Properties**.

If it is not listed, the 32-bit version might be installed. Follow the steps in the procedure below (To view the 32-bit Component Services), and then complete this step and the remaining steps using the Console Root.

4. Click the **Security** tab, in the **Launch and Activation Permissions** area, select **Customize**, and then click **Edit**.
5. Add the Asset Performance Management users, and then click **OK**.
6. In the **Access Permissions** area, select **Customize**, and then click **Edit**.
7. Add the Asset Performance Management user, and then click **OK**.
8. Click the **Identity** tab, select **This user**, and then enter the Asset Performance Management user details in the **User**, **Password**, and Confirm password boxes.
9. Click **OK**.
10. Restart the **AMApplicationServer** service.

To view the 32-bit Component Services

1. Open the Console Root (run mmc -32).
2. On the **File** menu, click **Add/Remove Snap In**.
3. On the **Available snap-ins** list, select **Component Services**, and then click **Add**.
4. Click **OK**.

## 5.4 PHD Data Source not starting

### Problem

The PHD External data source does not start even after you perform the post configuration steps available in Asset Performance Management Installation guide.

### Solution

1. Refer PHD OPC Server User Guide (Ref: Pim 2901.pdf) and follow the steps described in the section "Configuring PHD OPC Server." to configure the OPC server. Note: Add the **Process Manager** account under Distributed COM user group.
2. Restart the PHD server.
3. Restart the AM Application service and check if the PHD data source is running.

## 5.5 PHD Configuration Tool Fails to Connect to Database Node

If the PHD configuration tool fails to connect to the Database node during tag save operation. Ensure **Service User** and **Installed User** are part of the **Product Administrator** group in database server and calculation server.

## 5.6 Error - “Not able to create Historian tag.PHD is not running” OR “Not able to create Historian tag.save failure”

### *Problem*

This problem occurs when the EPHD services is not running or the EPHD services is not started.

### *Solution*

Restart the EPHD.

To stop EPHD:

```
phdctl stop /y  
  
phdctl stop /y dbsecurity  
  
phdctl stop /y udbserver
```

To start EPHD:

```
phdctl start cold
```

## 5.7 EPHD connection is lost

### *Problem*

On occasion, for example on an idle system, the connection to the EPHD server is lost and Asset Performance Management can no longer access the data source.

### *Solution*

Restart the EPHD.

To stop EPHD:

```
phdctl stop /y  
  
phdctl stop /y dbsecurity  
  
phdctl stop /y udbserver
```

To start EPHD:

```
phdctl start cold
```

## 5.8 Tags in EPHD disappear after services restart

### *Problem*

After restarting the and PHD services, tags in the EPHD disappear (appear to have been deleted) along with their data history.



***Solution***

This issue can occur if the and PHD services start-up does not occur as expected. Do all of the following to resolve the missing data issue:

1. Stop the Asset Manager service.
2. Open a command prompt as an administrator.
3. Run the following commands, one at a time and in this order:
  - a. `Phdctl stop /y`
  - b. `Phdctl stop /y dbsecurity`
  - c. `Phdctl stop /y udbserver`
  - d. `Phdctl start cold`
4. Start the Asset Manager service.

## 5.9 Trends not functioning after migration with EPHD database

***Problem***

When using EPHD database, the trends fail to load and an error similar to the following appears in the log:

```
FATAL 2017-02-21 12:51:45,496 3074166ms OPCDACommon Write - OPCDACommon:
'AMHistorianDA'- Failed to Write-'E_FAIL IOPCItemIO.Read'

DACommon: 'AMHistorianDA' -Failed to Write Data Item -- 'AMTag4230'
```

***Solution***

This error occurs when the EPHD database does not contain the tags.

1. Browse to the following location on the Database Server, and double-click the AMPHDUtility.exe file:
 

```
C:\Program Files (x86)\Honeywell\MES\AssetManager\Tools\AMPHDUtility
```
2. Select the **Tag Synchronization** tab, and click **Do Tag Sync** to synchronize tags from the APM Database to the Native Historian.
3. (Optional) Review the tag synchronization log file (AMUtilitytoollogs.txt) at the following location:
 

```
C:\ProgramData\Honeywell\AssetManager\LogFiles
```
4. Restart the server.
5. Restart the **AM ApplicationServer** service.

**Solution 2: Restore from Pre-migration Back Up**

1. Restore the pre-migration database to the post-migration Database Server.
 

See the *Asset Performance Management Configuration Guide* for information on restoring and migrating a database.
2. Restart the services.

## 5.10 Datasources not running in 4-server deployment

***Problem***

After installing in a 4-server (Database, Application, Calculation, Web) deployment, the datasources are listed as not running in the Maintain > External Data sources view.

*Solution*

To resolve the issue and start the data sources, restart the servers in the following order:

1. Database Server
2. Application Server
3. Web Server
4. Calculation Server

## 5.11 PHD communication does not function as expected if two versions of PHD are installed on the Application Server

*Problem*

If two versions of PHD are installed on the Application Server, data communication with additional Honeywell products (such as DynAMo Ops Suite) does not function as expected.

*Solution*

1. On the Application Server, in Windows Programs and Features, select the latest version of **Uniformance PHD OPC DA/HDA Server**, and then select **Change**.
2. Click **Next** until you reach the **Select PHD Host Name page**.
3. In the **PHD Host Name field**, change localhost to the name of the external PHD server.
4. Click **Next** until the you reach the end of the wizard and finish to save the changes.

## CALCULATION ERRORS

### 6.1 Calculation timeout errors

#### Problem

A timeout error occurs when executing the variable monitoring calculations.

```
An exception occurred: Timeout waiting for response, RequestId: a8090000-5690-0050-df34-08d6620d1aa3
```

#### Solution

Restart the calculation service.

Do all of the following on the Calculation Server:

1. Open the Windows services list (**Start > All Apps > Services.**).
2. Right-click the **Honeywell UAS Calculation Host** service, and then click **Restart**.

### 6.2 Calculations set to run on status change run unexpectedly

#### Problem

Calculations are run unexpectedly when they are set to run on a Status change.

#### Solution

This occurs on systems with an early version of the Asset Metrics calculation imported. As the earlier version of the Asset Metrics calculation updated status, when this occurs, calculations watching for a status change are run as a result of the Asset Metrics calculation updating the variable.

Make the following changes to the existing Asset Metrics calculation to use an internal variable instead of Status.

1. On the any asset type, open the metrics calculation expression.
2. Locate the following line:

```
Integer tempInt, Status, Status, RunningStatus, MaintenanceStatus,
FaultedStatus, RunningCycles, ResetMetrics
```

Update it to the following:

```
Integer tempInt, tempStatus, Status, RunningStatus, MaintenanceStatus,
FaultedStatus, RunningCycles, ResetMetrics
```

3. Locate the following line:

```
If IsNan(Status) then Status=0 endif
```

Update it to the following:

```
tempStatus=Status
```

```
If IsNan(Status) then tempStatus=0 endif
```

4. Locate the following line:

```
if (Status==0) then OverallStatus=Bitset(OverallStatus,4,1) else  
OverallStatus=Bitset(OverallStatus,4,0) endif
```

Update it to the following:

```
if (tempStatus==0) then OverallStatus=Bitset(OverallStatus,4,1) else  
OverallStatus=Bitset(OverallStatus,4,0) endif
```

5. Locate the following line:

```
if (Status==0) then OverallStatus=Bitset(OverallStatus,4,1) else  
OverallStatus=Bitset(OverallStatus,4,0) endif
```

Update it to the following:

```
if (tempStatus==0) then OverallStatus=Bitset(OverallStatus,4,1) else  
OverallStatus=Bitset(OverallStatus,4,0) endif
```

6. Save the metrics calculation and publish the changes.

## 6.3 Large python Calculation not loading in Calculation Status page & Logs indicate timeout.

### Problem

Large python Calculation not loading in Calculation Status page & logs indicate timeout.

### Solution

Update Honeywell.AM.Service.AMHostingService.exe.config file as below

```
<add key="FrequentPythonCalculationIntervallnMin" value="10" /> <add  
key="ScheduleCalculationRequestTimeoutInMin" value="10" />
```

## 6.4 Thermo calculations do not execute and calculation status shows a time out error

### Problem

Thermo calculations do not execute and calculation status shows a time out error.

*Solution*

1. Navigate to the below path:  
    <Install Media>\Installer\Components\UniSim
2. Run setup.exe as administrator.
3. Click **Next** and Click **Repair**.
4. Click **Next** and Click **Install**.

## 6.5 Honeywell Unisim EO X64

After installation of R532.3 or R532.4 or R532.5, the newly created side stream compressor model displays an error '80040154 Class not registered' since X64 bit thermos did not install with the build.

Follow the below steps to install 64-bit UniSim thermos:

### ATTENTION

Perform this procedure only if an exception error is found while constructing server instance.

1. Choose **Start > Run**, type **Services.msc** and click **OK**.  
    The **Services** window appears.
2. In the Services panel, right-click on the below services and select **Stop**:
  - **Honeywell UAS Calculation Host**
  - **AMApplicationServer**
3. Open command prompt as administrator.  
    Enter **iisreset** in command prompt and press **Enter**.
4. Clear the Browser cache.
5. Navigate to the following folder:  
    <Installation Media>\Installer\Components\UnisimX64
6. Run **setup.exe**.
7. Repeat steps 3 and 4 in all servers.
8. Start **Honeywell UAS Calculation Host** and **AMApplicationServer** services.

## 6.6 Honeywell Unisim Thermo x32 bit

During Stream calculation execution an exception error may appear and abort the socket connection. This can be caused by an error processing your message or a receive timeout being exceeded by the remote host or a network recourse issue. The issue can be resolved by repairing 32-bit UniSim thermos.

Follow the below steps to repair 32-bit UniSim thermos:

### ATTENTION


Perform this procedure only if an exception error occurred and the socket connection was aborted.

1. Choose **Start > Run**, type **Services.msc** and click **OK**.  
The **Services** window appears.
2. In the Services panel, right-click on the below services and select **Stop**:
  - **Honeywell UAS Calculation Host**
  - **AMApplicationServer**
3. Open command prompt as administrator.  
Enter **iisreset** in command prompt and press **Enter**.
4. Clear the Browser cache.
5. Navigate to the following folder:  
<Installation Media>\Installer\Components\Unisim
6. Run **setup.exe**.
7. Repeat steps 3 and 4 in application, web and calculation servers.
8. Start **Honeywell UAS Calculation Host** and **AMApplicationServer** services.


## DATABASE SERVER SPACE CONSUMPTION

To resolve the over space consumption of database server, follow the below steps:


1. Open **Microsoft SQL Server Management Studio** as administrator.  
The **Microsoft SQL Server Management Studio** window appears.
2. Enter **Server name**.  
Click **Connect**.
3. From **Object Explorer** pane, expand **Databases** folder.

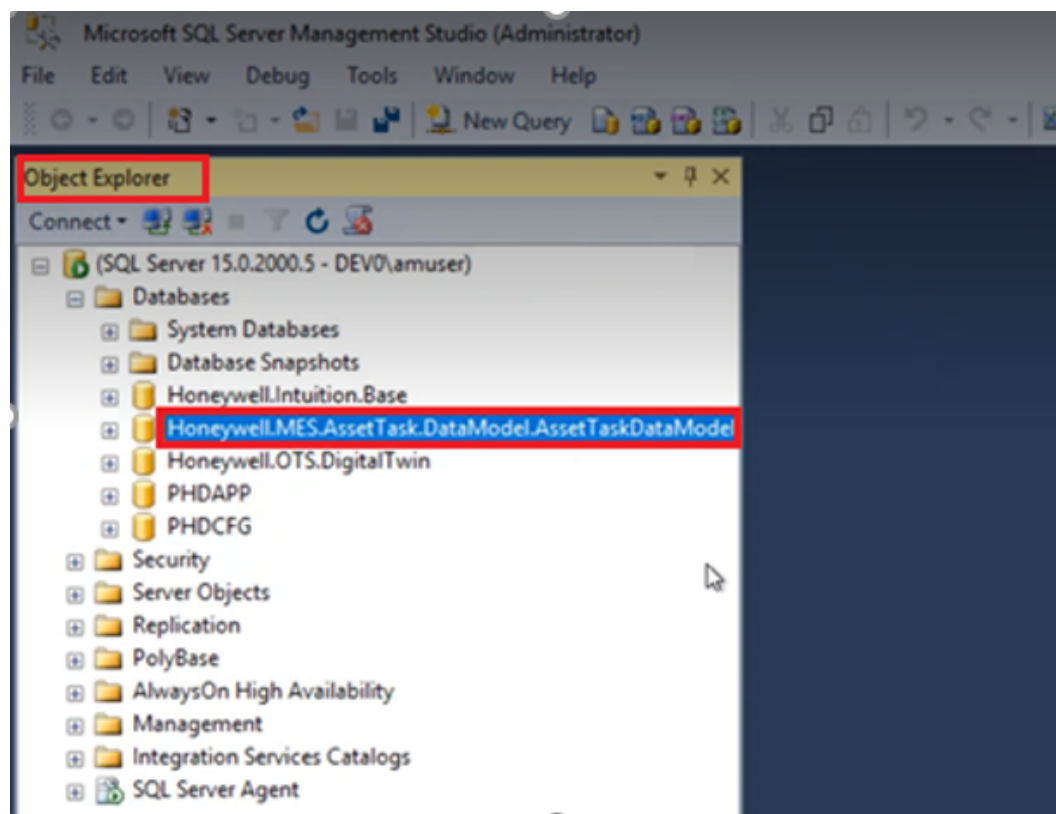

4. Right-click **Honeywell.MES.AssetTask.DataModel.AssetTaskDataModel** and select **Tasks > Back Up**.

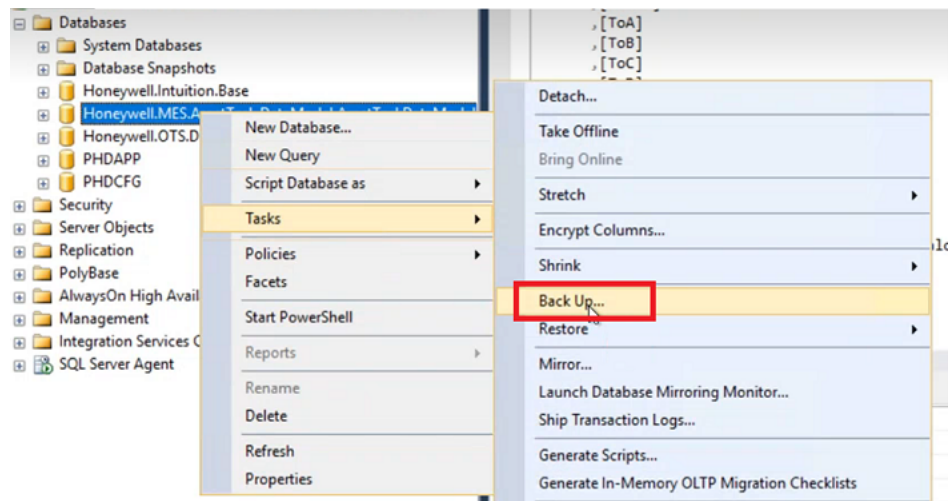


5. **Back Up Database** window appears.

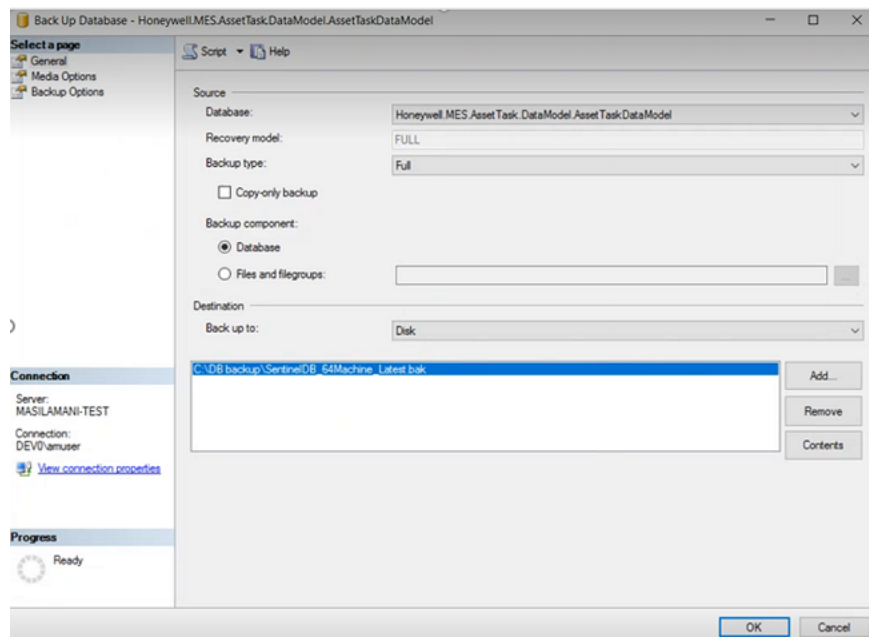

6. Click **Add** to select the backup destination.


7. Click **OK**.

8. Right-click **Honeywell.MES.AssetTask.DataModel.AssetTaskDataModel** and select **Properties**.

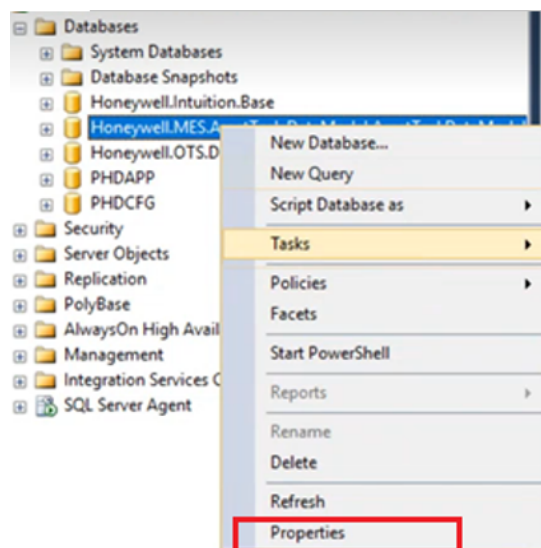





9. **Database Properties** window appears.
10. Select **Options** from **Select a page** pane.
11. Click **Recovery model** drop-down and select **Simple**.

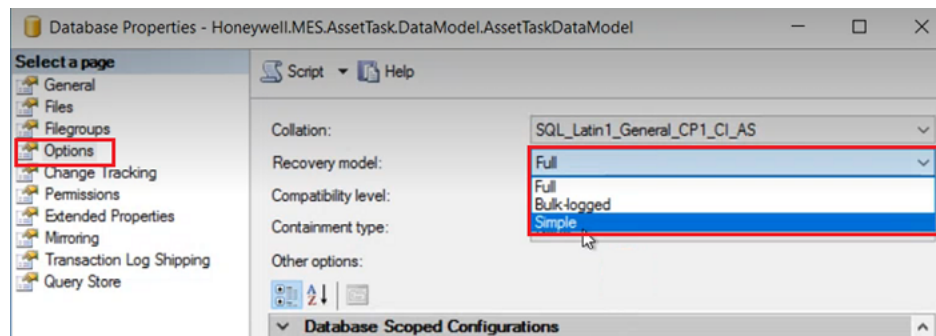


12. Click **OK**.
13. Right-click **Honeywell.MES.AssetTask.DataModel.AssetTaskDataModel** and select **Tasks > Shrink > Files**.

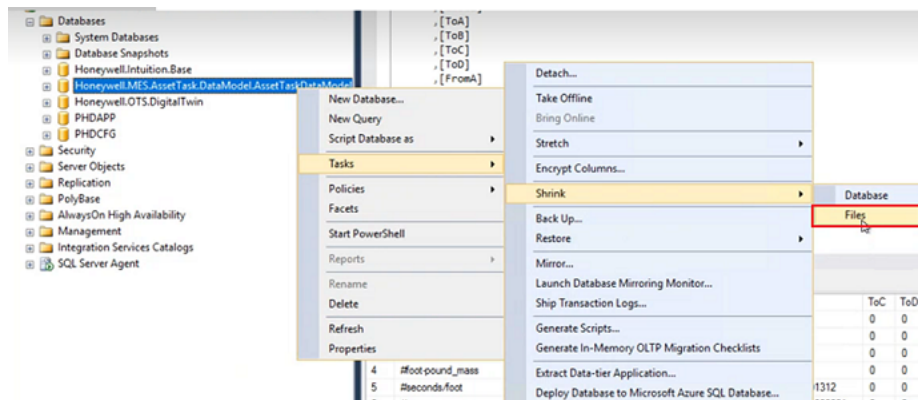

14. window appears.
15. Click on **File Type** drop-down and select **Log**.

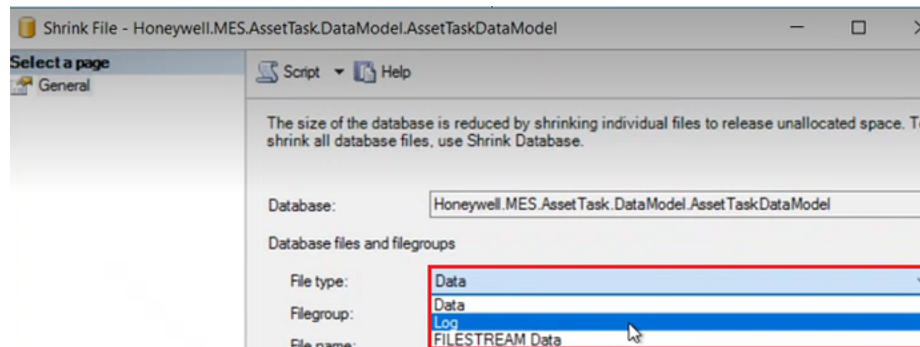


16. Click **OK**.
17. Right-click **Honeywell.MES.AssetTask.DataModel.AssetTaskDataModel** and select **Properties**.
18. Select **Options** from **Select a page** pane.
19. Click on **Recovery model** drop-down and select **Full**.

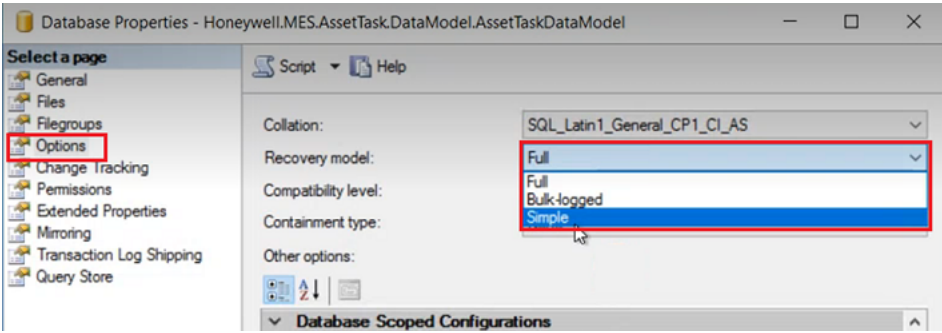

20. Click OK.

To view the data file location and size utilized, follow the below steps:

1. Right-click **Honeywell.MES.AssetTask.DataModel.AssetTaskDataModel** and select **Properties**.
2. Select **Files** from **Select a page** pane.

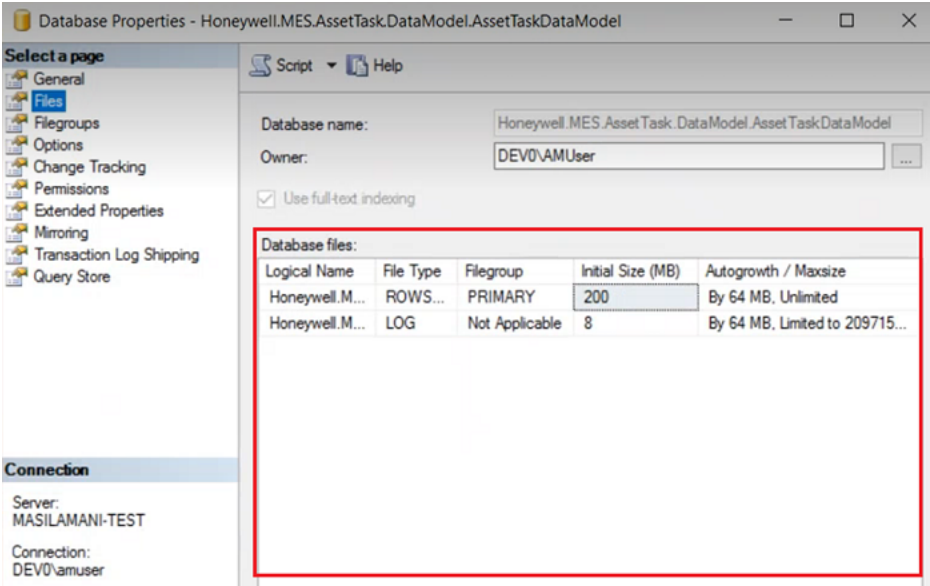

3. The data file location and space utilized is displayed.

## APM CONFIGURATION EXCEL PLUGIN ERRORS

### 8.1 Out-of-date Excel plugin visible after upgrade

#### *Problem*

After an upgrade from Asset Manager R410.2 to Asset Performance Management R500.1, the Excel Ribbon displays an out-of-date Add-Ins tab.

#### *Solution*

Perform the following steps to remove the old Excel Plugin from the ribbon.

1. In Excel, click the Microsoft Office button, and then click **Excel Options**.
2. Select **Add-ins**.
3. From the **Manage** list, select **COM Add-ins**, and then click **Go**.
4. Clear **Honeywell MES Excel App Add-in**, and then click **OK**.

The out-of-date Add-ins tab is removed from the ribbon.

### 8.2 Excel Plugin manually disabled

#### *Problem*

If the Excel APM Configuration Excel Plugin is closed during a Get Data or Publish task, or if a new sheet is opened, an error dialog box may appear. The dialog box asks the user if they want to disable the Excel Plugin. If the Excel Plugin is disabled, the APM Configuration Excel Plugin cannot be used.

#### *Solution*

Perform the following steps to re-enable the Excel Plugin.

1. In Excel, click the Microsoft Office button, and then click **Excel Options**.
2. Select **Add-ins**.
3. From the **Manage** list, select **Disabled Items**, and then click **OK**.
4. Select **Excel AddIn**, and then click **Enable**.
5. Click **OK** to close the **Disabled Items** dialog box.
6. From the **Manage** list, select **COM Add-ins**, and then click **Go**.
7. Ensure **Excel AddIn** is selected, and then click **OK**.

The tab appears on the ribbon.

## 8.3 Excel Plugin options disabled with multiple Excel workbooks open

### *Problem*

When Excel is opened, after using Load Template Sheets and Load Asset Sheets, the buttons become disabled. If a second Excel workbook is then opened, the buttons remain disabled and no Asset Performance Management data can be loaded into the new workbook.

### *Solution*

The Excel APM Configuration Excel Plugin is designed to work with one Excel workbook at a time. Do not use the APM Configuration Excel Plugin with multiple workbooks open.

## 8.4 Excel Plugin not available if Excel is installed after Asset Performance Management

### *Problem*

If the APM Configuration Excel Plugin is installed on a computer that does not have Excel installed, the Add-in is not available when Excel is later installed on the system. If the Add-in is manually selected, it does not remain active.

### *Solution*

1. Close Excel if it is open.
2. Run the file HoneywellExcelAddIn.vsto from the following location:  
`[InstallPath]\Honeywell\MES\AssetManager\Tools\BulkConfiguration`
3. Open Excel.  
The APM Configuration Excel Plugin is Add-in is now available.

## 8.5 An error occurs when attempting to get data

### *Problem*

When attempting to Get Data, the following error appears:

```
An exception occurred getting data: The communication object,  
System.ServiceModel.Channels.ServiceChannel, cannot be used for communication because  
it is in the Faulted state.
```

### *Solution*

On the Application Server, restart the AMApplicationServer service:

1. **Start > All Apps > Services.**
2. Right-click the **AMApplicationServer** service, and then click **Restart**.

When the service has restarted, attempt to Get Data again.

## 8.6 After upgrade from R520.1 to R520.2 some Excel sheets do not get data

### *Problem*

After upgrading from R520.1 to R520.2, the Enrichment and Asset Calculation Mapping sheets do not load data when the Get Data button is pressed.

### *Solution*

Uninstall and reinstall the APM Configuration Excel Plugin and Honeywell Excel Plugin.

1. Close Excel if it is open.
2. Using the Windows Add/Remove Programs, uninstall both the Asset Performance Management Configuration Excel Plugin and Honeywell Excel Plugin.
3. Run the following files in order:
  - a. [installdrive]:\Program Files  
(x86)\Honeywell\MES\AssetManager\Tools\BulkConfiguration\app.publish\SentinelExcelSetup.msi
  - b. [installdrive]:\Program Files  
(x86)\Honeywell\MES\AssetManager\Tools\BulkConfiguration\HoneywellExcelAddIn.vsto

## 8.7 R540.1 APM DAS Instance Data Access Page Save Option Not Getting Enabled After Doing Changes

### **Problem**

APM Data access page Save Option not getting enabled after doing changes in APMDAS instance for UASdataSource.

### **Solution**

Add below entries (Key, Value, Owner) in System Configuration -> Application page and recycling the SentinelDASInstance App pool in App server.

1. **Key:** DataAccess.SentinelDASInstance.UASDataSource.AMDataSource.AggregationsList.
2. **Value:** AVERAGE,COUNT,DELTA,DURATIONBAD,DURATIONGOOD,INTERPOLATIVE,RAW.
3. **Owner:** \_DataAccess.

## APPLICATION SERVER ERRORS

## 9.1 AM Service is not running on licensed server

*Problem*

The AM Service is not running (can be viewed in Maintain > External Datasource). The following error appears in the log:

```
FATAL 2015-03-17 17:26:15,557 30279ms IOConfigurationManager WriteLogger -
IOConfiguration:-Failed to Load configuration service
```

```
FATAL 2015-03-17 17:26:15,566 30288ms IOPlatform WriteLogger - IOPlatform-'IOService'
Exception encountered while starting -- 'Failed to connect to configuration service'
```

```
ERROR 2015-03-17 17:28:01,181 135902ms ConfigurationManager WriteLogger - Error in
applying configuration changes - Could not load file or assembly 'System.Core,
Version=2.0.5.0, Culture=neutral, PublicKeyToken=7cec85d7bea7798e, Retargetable=Yes'
or one of its dependencies. The given assembly name or codebase was invalid.
(Exception from HRESULT: 0x80131047)
```

*Solution*

This error can appear if Microsoft Windows Update KB2468871 is not installed.

To resolve the error, either run Windows Update to install KB2468871, or copy and run the installation file from the installation media:

```
[Installation Media]:\Prerequisites\ISSetupPrerequisites\KBs\ NDP40-KB2468871-v2-
x64.exe
```

## 9.2 Trouble in hosting the WCF service: endpoint port number error

*Problem*

The WCF services like I/O service, execution service and so on fails to host when the Application service is started. The following endpoint error occurs while hosting the WCF service.


“HostApplication: Error while starting the Service There is already a listener on IP endpoint 0.0.0.0:9023. Make sure that you are not trying to use this endpoint multiple times in your application and that there are no other applications listening on this endpoint.”

The above error indicates that the port number 9023 is already in use.

*Solution*

Perform the following steps to change the port number and restart the service:

1. In the **Command** prompt window, type **netstat -a**.

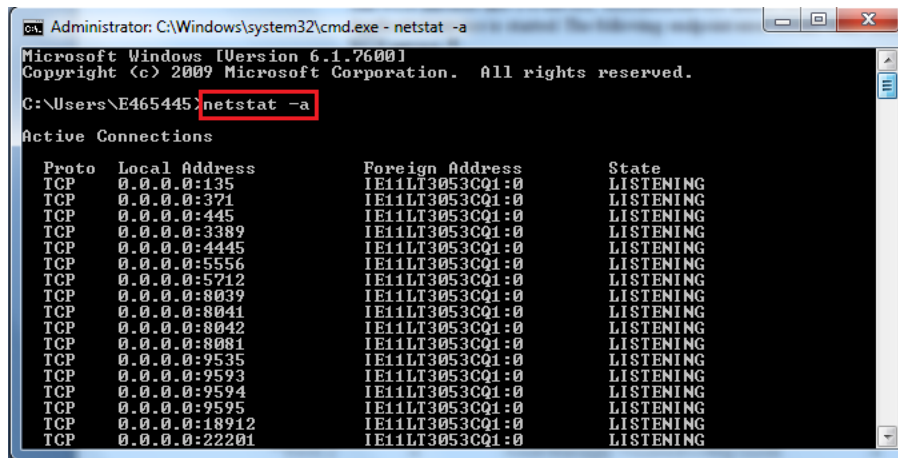

```

Administrator: C:\Windows\system32\cmd.exe - netstat -a
Microsoft Windows [Version 6.1.7600]
Copyright (c) 2009 Microsoft Corporation. All rights reserved.

C:\Users\E465445>netstat -a

Active Connections

Proto Local Address           Foreign Address         State
TCP    0.0.0.0:135               IE11LT3053CQ1:0        LISTENING
TCP    0.0.0.0:371               IE11LT3053CQ1:0        LISTENING
TCP    0.0.0.0:445               IE11LT3053CQ1:0        LISTENING
TCP    0.0.0.0:3389              IE11LT3053CQ1:0        LISTENING
TCP    0.0.0.0:4445              IE11LT3053CQ1:0        LISTENING
TCP    0.0.0.0:5556              IE11LT3053CQ1:0        LISTENING
TCP    0.0.0.0:5712              IE11LT3053CQ1:0        LISTENING
TCP    0.0.0.0:8039              IE11LT3053CQ1:0        LISTENING
TCP    0.0.0.0:8041              IE11LT3053CQ1:0        LISTENING
TCP    0.0.0.0:8042              IE11LT3053CQ1:0        LISTENING
TCP    0.0.0.0:8081              IE11LT3053CQ1:0        LISTENING
TCP    0.0.0.0:9535              IE11LT3053CQ1:0        LISTENING
TCP    0.0.0.0:9593              IE11LT3053CQ1:0        LISTENING
TCP    0.0.0.0:9594              IE11LT3053CQ1:0        LISTENING
TCP    0.0.0.0:9595              IE11LT3053CQ1:0        LISTENING
TCP    0.0.0.0:18912             IE11LT3053CQ1:0        LISTENING
TCP    0.0.0.0:22201             IE11LT3053CQ1:0        LISTENING

```

2. Open the DictionaryData.xml from “<AssetManagerInstallation path>\AppServer\Bin and search for the above port number.
3. Choose the port number (preferably above 8100) which is not present in the available listening port numbers in the **Local Address** column from the above command window.
4. Replace the port number (in this example 9023) with the chosen port number in the DictionaryData.xml.
5. Save the .xml document after changing the port number and restart the service.
6. Ensure that the error does not occur after restarting the Application service. The WCF service must be hosted.
7. If the above error occurs, check the port number and then repeat steps 1 to 5.

## 9.3 Application Service throws Winsock error

### Problem

While running the application service, the following error appears:

```
WSAENOBUFFS (10055)
```

An operation on a socket could not be performed because the system lacked sufficient buffer space or because a queue was full.

### Solution

Install the Microsoft hotfix provided in KB Article 2577795.

1. Download the hotfix from the Microsoft Knowledge Base: <https://support.microsoft.com/en-us/kb/2577795>
2. Install the hotfix on the Application Server.

## 9.4 Unable to Start AMService in Multi-Server

Follow the below steps to resolve ‘HTTP request is unauthorized with client authentication scheme Negotiate’ error in AMService logs.

1. The **Service Principal Name (SPN)** is not required for multi-server but in case it is configured, ensure SPN is configured across **Data Base** and **Application/Web/Calculation Servers**.  
For more information on configuring SPN on multi-server, refer to **Configuring SPNs on Multi-server** in the **Installation Guide**.

2. Choose **Start > Run**, type **inetmgr** and click **OK** in application server.  
The **Internet Information Services (IIS) Manager** window appears.
3. Double-click **Authentication** and ensure **Anonymous Authentication** is **Enabled** and all other authentications are **Disabled** for **APPServerName** and **DefaultWebSite** connections.
4. Select **MES** site and double-click **Authentication**:
  - a. Ensure **Windows Authentication** is **Enabled**, and other authentications are **Disabled**.
  - b. Select **Windows Authentication** from the list and click **Advanced Settings** under Actions pane.  
Ensure **Kernal-mode** authentication flag checkbox is **Enabled** and select **OFF** from **Extended Protection** drop-down.
  - c. Click **Provider** under Actions pane.  
In the **Enabled Providers** space, set **Negotiate** on Top and **NTLM** at the Bottom.
5. Select **MESImpl200** site and follow the below steps:
  - a. Select **Windows Authentication** from the list and click **Advanced Settings** under Actions pane.  
Ensure **Kernal-mode** authentication flag checkbox is **Enabled** and select **OFF** from **Extended Protection** drop-down.
  - b. Click **Provider** under Actions pane.  
In the **Enabled Providers** space, set **Negotiate** on Top and **NTLM** at the Bottom.
6. Navigate to the following location in Application and Web Server.  
C:\Windows\System32\inetsrv\config

**NOTE**

Take a backup of the below config file.

7. Open **applicationHost.config** file.
8. Search for the key **useAppPoolCredentials** and set the value as **True** in Application and Web server.

## 9.5 RabbitMQ Service Not Initialized After 20 Retries

The RabbitMQ is not getting initialized after 20 retries as displayed in the below image.



```

D:\UASInstallation\Honeywell\MES\AssetManager\Tools\InstallConfiguration>Honeywell.UAS.Configuration.exe -m -r -p NECVftn0cg71062
25 Jan 2023 11:21:55 - executablePath => D:\UASInstallation\Honeywell\MES\AssetManager\AppServer\bin\Honeywell.AM.Service.AMHostingService.exe
25 Jan 2023 11:21:59 - The RabbitMQ service is not started.
25 Jan 2023 11:21:59 - More help is available by typing NET HELPMMSG 3521.
25 Jan 2023 11:22:02 - C:\Program Files\Erlang OTP\erts-13.1\bin\erlsrv: Service RabbitMQ removed from system.
25 Jan 2023 11:22:05 - C:\Program Files\Erlang OTP\erts-13.1\bin\erlsrv: Service RabbitMQ added to system.
25 Jan 2023 11:22:05 - Adding permissions to the directory 'C:\ProgramData\RabbitMQ'
25 Jan 2023 11:22:09 - Enabling plugins on node rabbit@APMPOCAPPI:
25 Jan 2023 11:22:09 - rabbitmq_auth_mechanism_ssl
25 Jan 2023 11:22:09 - rabbitmq_management
25 Jan 2023 11:22:13 - The following plugins have been configured:
25 Jan 2023 11:22:13 - rabbitmq_auth_mechanism_ssl
25 Jan 2023 11:22:13 - rabbitmq_management
25 Jan 2023 11:22:13 - rabbitmq_management_agent
25 Jan 2023 11:22:13 - rabbitmq_web_dispatch
25 Jan 2023 11:22:13 - Applying plugin configuration to rabbit@APMPOCAPPI...
25 Jan 2023 11:22:13 - Plugin configuration unchanged.
25 Jan 2023 11:22:13 - Adding permissions to the directory 'C:\Users\uaservice'
25 Jan 2023 11:22:13 - Removing permissions to the directory 'C:\Users\uaservice'
25 Jan 2023 11:22:18 - The RabbitMQ service is starting.
25 Jan 2023 11:22:18 - The RabbitMQ service was started successfully.
25 Jan 2023 11:22:19 - Waiting 3 seconds for the RabbitMQ service to initialize.
25 Jan 2023 11:22:24 - Waiting 3 seconds for the RabbitMQ service to initialize.
25 Jan 2023 11:22:27 - Waiting 3 seconds for the RabbitMQ service to initialize.
25 Jan 2023 11:22:31 - Waiting 3 seconds for the RabbitMQ service to initialize.
25 Jan 2023 11:22:35 - Waiting 3 seconds for the RabbitMQ service to initialize.
25 Jan 2023 11:22:39 - Waiting 3 seconds for the RabbitMQ service to initialize.
25 Jan 2023 11:22:43 - Waiting 3 seconds for the RabbitMQ service to initialize.
25 Jan 2023 11:22:48 - Waiting 3 seconds for the RabbitMQ service to initialize.
25 Jan 2023 11:22:52 - Waiting 3 seconds for the RabbitMQ service to initialize.
25 Jan 2023 11:22:55 - Waiting 3 seconds for the RabbitMQ service to initialize.
25 Jan 2023 11:23:00 - Waiting 3 seconds for the RabbitMQ service to initialize.
25 Jan 2023 11:23:03 - Waiting 3 seconds for the RabbitMQ service to initialize.
25 Jan 2023 11:23:07 - Waiting 3 seconds for the RabbitMQ service to initialize.
25 Jan 2023 11:23:11 - Waiting 3 seconds for the RabbitMQ service to initialize.
25 Jan 2023 11:23:15 - Waiting 3 seconds for the RabbitMQ service to initialize.
25 Jan 2023 11:23:19 - Waiting 3 seconds for the RabbitMQ service to initialize.
25 Jan 2023 11:23:23 - Waiting 3 seconds for the RabbitMQ service to initialize.
25 Jan 2023 11:23:27 - Waiting 3 seconds for the RabbitMQ service to initialize.
25 Jan 2023 11:23:31 - Waiting 3 seconds for the RabbitMQ service to initialize.
25 Jan 2023 11:23:35 - Waiting 3 seconds for the RabbitMQ service to initialize.
25 Jan 2023 11:23:38 - Failed to receive an initialized status from RabbitMQ after 20 tries...
25 Jan 2023 11:23:38 - Unknown error occurred
25 Jan 2023 11:23:38 - Cannot start RabbitMQ after copying the erlang cookie.
D:\UASInstallation\Honeywell\MES\AssetManager\Tools\InstallConfiguration>

```

To resolve this issue, follow the below steps to download and install the **Erlang** and **RabbitMQ** in calculation server:

1. Choose **Start > Run**, type **taskmgr**, and click **OK**.  
The **Task Manager** Window appears.
2. Click the **Details** tab to display the list of running applications.  
Search for **epmd.exe**.
3. Right-click **epmd.exe** and click **End task**.
4. Uninstall Erlang OTP 22 (10.5) and RabbitMQ Server 3.8.1 which was installed from the media.
5. Download and install **Erlang** and **RabbitMQ** from the below link:
  - a. **Erlang**: [https://github.com/erlang/otp/releases/download/OTP-25.1/otp\\_win64\\_25.1.exe](https://github.com/erlang/otp/releases/download/OTP-25.1/otp_win64_25.1.exe)
  - b. **RabbitMQ**: <https://github.com/rabbitmq/rabbitmq-server/releases/download/v3.10.7/rabbitmq-server-3.10.7.exe>

#### NOTE

Ensure the same version of Erlang and RabbitMQ is used as the same versions were used for R532.5 Patch 1 validation.

6. Open the command prompt as administrator and run the below command to execute the RabbitMQ configuration:  
<Install Media>:\Installer\Components\US\MSIs\Configuration\Honeywell.UAS.Configuration.exe -r -p **Password**  
Where **Password** is runtime administrator account password.
7. Navigate to the following folder and check if the RabbitMQ certificates are created:  
<Install Location>:\ProgramData\RabbitMQ\certs

8. Restart the server.
9. Choose **Start > Run**, type **services.msc**, and click **OK**.  
The **Services** window appears.
10. In the services pane, search for the installed services and ensure the services are running.

## REPORT ERRORS

## 10.1 SQL Reporting Services Windows service stopped

### *Problem*

The Reports do not load, and the SQL Reporting Service is stopped. Attempting to restart the service results in a time out error.

### *Solution*

Increase the time out duration, and then attempt to start the service again.

1. Open the Windows Registry Editor.
2. Locate and select the following registry subkey:  
  
`HKEY_LOCAL_MACHINE\SYSTEM\CurrentControlSet\Control`
3. If the `ServicesPipeTimeout` entry does not exist, do all of the following:
  - a. On the **Edit** menu, point to **New**, and then click **DWORD Value**.
  - b. Type **ServicesPipeTimeout**, and then press Enter.
  - c. Right-click **ServicesPipeTimeout**, and from the menu click **Modify**
4. Select the `ServicesPipeTimeout` entry.
5. Do all of the following:
  - a. In the **Value** box, type **60000**.
  - b. In the **Base** area, select **Decimal**.
  - c. Click **OK**.
6. Restart the computer.

## 10.2 Encrypted content error when attempting to view reports

### *Problem*

Attempting to load the reports page results in an encrypted content error:

The report server cannot decrypt the symmetric key used to access sensitive or encrypted data in a report server database. You must either restore a backup key or delete all encrypted content.

### *Solution*

Restore the existing registry keys, if possible. (To complete this procedure, you must have an encryption key backup and know the password for the encryption key file.)

1. Open the SQL Reporting Services Configuration Manager.
2. Connect to the Asset Performance Management server.
3. Select **Encryption Keys**.
4. In the **Restore** area, click **Restore**.
5. Do all the following:
  - a. In the **File Location box**, enter the location of the registry key backup file.
  - b. In the **Password box**, type the password for the encryption key file. Do all of the following:
  - c. Click **OK**.

If you cannot restore the existing registry keys, delete the existing registry keys, and reset the connections strings and stored credentials for the reports.

1. Open the SQL Reporting Services Configuration Manager.
2. Connect to the Asset Performance Management server.
3. Select **Encryption Keys**.
4. In the **Delete Encrypted Content** area, click **Delete**.
5. In the confirmation dialog box, click **Yes**.
6. In the **Change** area, click **Change**.
7. In the confirmation dialog box, click **OK**.
8. Restart the SQL Reporting Server windows service.

## 10.3 Reports do not load on multi-server system

### *Problem*

When attempting to open the reports from the navigation bar, a “Page can’t be displayed” error appears and the reports do not load as expected.

### *Solution*

For the reports to load as expected in a multi-server system, the configuration UI settings file (app.xml) on the Web Server must be updated to use the Database Server in the Reports URL.

Do all of the following on the **Web Server**:

1. Open the SSRS report configuration file for editing. By default, this is found in the following location:  

```
[install drive]:\Program Files  
(x86)\Honeywell\MES\Core\WWWMESSCore\ClientBin5\app.xml
```
2. Locate the ReportsURL key and update the value to use the name of the Database Server, as shown:

```
<Add Key="ReportsURL" Value="http://[DBServerName:Port]/Reports" />
```

Replace

DBServerName with the name of the Database Server and Port with the Database Server Port Number.

3. Save and close the file.

## EXTERNAL APPLICATION ERRORS

**11.1 Asset Performance Management and UniSim Design communication failure***Problem*

After opening a case file with UniSim Design, communication between Asset Performance Management and UniSim Design stops functioning.

*Solution*

If a pop-up message from UniSim Design is active, UniSim Design will wait for the user response before establishing a connection to Asset Performance Management. By default, UniSim design is configured to provide a pop-up warning when the license is to expire. To prevent the communication interruption, change the pop-up notification settings in UniSim Design.

1. In UniSim Design, select **Tools > Preferences**.
2. Select **Licensing**.
3. In the **Startup Options** area, clear the following check boxes:
  - a. **Warn about application licensing expiring**
  - b. **Warn about commuted application license expiring**
  - c. **Notify when licensing update has been downloaded**

**11.2 UNISIM database cannot be created, if the case file is in the shared location***Problem*

UNISIM database cannot be created, if the case file is in the shared location.

*Solution*

Specify the IP Address of the machine instead of machine name.

**11.3 UNISIM calculations will not execute on secondary calculation server***Problem*

UNISIM calculations will not execute on secondary calculation server.

*Solution*

Ensure UNISIM license is installed in the secondary calculation server and all related assets including the UNISIM asset, belongs to the secondary calculation server group.

The following TCP ports are opened during the secondary calculation server installation.

| Ports |
|-------|
| 5712  |
| 19957 |
| 19958 |
| 1058  |
| 1059  |
| 1061  |

# 11.4 "SSPI can not be generated" error with Flex

*Problem*

The error “SSPI can not be generated” appears when attempting synchronization from Flex.

*Solution*

Update the server connection string in the file.

- 1. Locate the file and open for editing. By default, this file is installed at the following location:

```
[InstallDrive]:\Program Files
(x86)\Honeywell\AssetManager\Tools\AssetSynchronizer
```

- 2. Locate the server connection string:

```
<add key="ConnectionString"
value="Server=localhost;Database=Honeywell.MES.AssetTask.DataModel.AssetTaskData
Model;Trusted_Connection=True;" />
```

- 3. Update the server value in the connection string to use the IP address of the database server in place of “localhost”.
- 4. Save and close the file.
- 5. Attempt the synchronization again.

## 12.1 Error Appears When Attempting to Send Notification Email

### *Problem*

When a fault is configured to send an email, the following error appears and the email is not sent:

```
Failed to send email. Exception Info is: System.Net.Mail.SmtpException: Failure
sending mail. ---> System.Net.WebException: The remote name could not be resolved:
'smtp.honeywell.com'
```

```
at System.Net.ServicePoint.GetConnection(PooledStream PooledStream, Object owner,
Boolean async, IPAddress& address, Socket& abortSocket, Socket& abortSocket6)
```

```
at System.Net.PooledStream.Activate(Object owningObject, Boolean async,
GeneralAsyncDelegate asyncCallback)
```

```
at System.Net.PooledStream.Activate(Object owningObject, GeneralAsyncDelegate
asyncCallback)
```

```
at System.Net.ConnectionPool.GetConnection(Object owningObject, GeneralAsyncDelegate
asyncCallback, Int32 creationTimeout)
```

```
at System.Net.Mail.SmtpConnection.GetConnection(ServicePoint servicePoint)
```

```
at System.Net.Mail.SmtpTransport.GetConnection(ServicePoint servicePoint)
```

```
at System.Net.Mail.SmtpClient.GetConnection()
```

```
at System.Net.Mail.SmtpClient.Send(MailMessage message)
```

```
--- End of inner exception stack trace ---
```

```
at System.Net.Mail.SmtpClient.Send(MailMessage message)
```

```
at
Honeywell.MES.Core.Service.EmailNotification.ServiceImplementation.EmailNotification.S
endMail(MailMessage message)
```

```
at
Honeywell.MES.Core.Service.EmailNotification.ServiceImplementation.EmailNotification.S
endMailAsync(MailRequest request)
```

### *Solution*

This error occurs when the email server configuration is not correct, which can happen if administrator permissions are not provided during installation and the email server configuration can therefore not be saved or when the administrator permissions are required to access the e-mail pickup folder selected to store the emails. To resolve the issue, correct the e-mail server configuration.

1. Choose **Start > Administrative Tools**, right-click **Internet Information Services (IIS) Manager**, and select **Run as Administrator**.
2. Select the **APM** server, and then double-click **SMTP E-mail**.
3. In the **E-mail address** box, type the From address for e-mails sent from the server.
4. Do one of the following:
  - a. Select **Deliver e-mail to SMTP server** to send email to mail server.
  - b. Select **Store e-mail in pickup directory**.
5. If you selected the e-mail server, do all of the following:
  - a. In the **SMTP Server** box, type the name of the e-mail server or select the User localhost check box.
  - b. In the **Port** box, type the port used on the e-mail server.
  - c. In the **Authentication Settings** are, do one of the following:
    - a. Select **Not required** if no credentials are required on the server.
    - b. Select **Windows** to use the Windows credentials.
    - c. Select **Specify credentials** and then set the required user to specify a specific user account to access the server.
6. If you selected the e-mail pickup directory, select a location that does not require administrator access in which to store the e-mails.
7. Click **Apply** to save the email configuration.
8. Choose **Start > Windows System**, right-click **Command Prompt**, and select **Run as Administrator**.
9. Type **iisreset** and press Enter.



## 13.1 Required Certificate Deleted from Windows Repository

### *Problem*

A “cannot connect to broker” occurs. An error similar to the following appears on the Application Server:

```
WARN 2019-07-02 09:12:22,080 1068ms AmHostingService 4 - Unable to connect to
RabbitMQ after 1 attempt(s)| retrying... (Broker unreachable:
UASDemoCalc3.DOMAIN:5671/uas)
```

```
WARN 2019-07-02 09:12:27,301 6290ms AmHostingService 4 - Unable to connect to
RabbitMQ after 2 attempt(s)| retrying... (Broker unreachable:
UASDemoCalc3.DOMAIN:5671/uas)
```

```
WARN 2019-07-02 09:12:37,408 16396ms AmHostingService 4 - Unable to connect to
RabbitMQ after 3 attempt(s)| retrying... (Broker unreachable:
UASDemoCalc3.DOMAIN:5671/uas)
```

```
WARN 2019-07-02 09:12:52,470 31458ms AmHostingService 4 - Unable to connect to
RabbitMQ after 4 attempt(s)| retrying... (Broker unreachable:
UASDemoCalc3.DOMAIN:5671/uas)
```

```
WARN 2019-07-02 09:13:12,682 51670ms AmHostingService 4 - Unable to connect to
RabbitMQ after 5 attempt(s)| retrying... (Broker unreachable:
UASDemoCalc3.DOMAIN:5671/uas)
```

```
FATAL 2019-07-02 09:13:37,743 76732ms AmHostingService 4 - Failed to Start Asset
Manager Application Service
```

```
FATAL 2019-07-02 09:13:37,750 76739ms AmHostingService 4 - Exception in Starting
Asset Manager Application Service --
MassTransit.RabbitMqTransport.RabbitMqConnectionException: Unable to connect to
RabbitMQ after 5 attempts.
```

```
at Honeywell.AM.Service.AmHostingService.OnStart(String[] args): ''
```

### *Solution*

This error occurs when the certificate required by Asset Performance Management is deleted, which can occur as a result of domain policies. If this occurs, the default certificate should be replaced by a domain certificate.

1. **Request Domain Certificate**
  - a. Run the mmc command.
  - b. Add the Certificates snap-in: File > Add/Remove Snap-in > Certificates.
  - c. Select the Certificates snap-in, select Computer account, and then click Next.
2. **Convert the Domain Certificate for Use With RabbitMQ**
3. **Update the RabbitMQ Configuration to use the Domain Certificate**
  - a. Type iisreset and press Enter.

## 13.2 Intuition Certificate Renewal

Whenever the SSL certificate is renewed for https site binding of application/web/calculation servers in IIS, the intuition certificate also needs to be renewed as intuition certificate is created based on the SSL certificate associated to the https bindings.

1. Navigate to the following folder:  
    <Install Media>:\Installer\Components\CoreSystem\MES Utilities
2. Run **Honeywell.Intuition.PreInstallChecker.exe**.

**NOTE**  
For multi-server setup perform the above steps in **Application, Calculation and Web Server**.

3. An intuition certificate is generated under **IntuitionSign** folder in Certificate Management Console.
4. Choose **Start > Run**, type **certmgr.msc** and click **OK**.  
    The **Certificate Management Console** window appears.
5. Verify the renewed intuition certificate in **IntuitionSign** folder is available in **IntuitionVerify** folder.
6. For multi-server setup update the IntuitionVerify folder as given below:

| Server             | Procedure                                                                                                                           |
|--------------------|-------------------------------------------------------------------------------------------------------------------------------------|
| Application Server | Copy Web and Calculation Server certificate from <b>IntuitionSign</b> folder and paste it in <b>IntuitionVerify</b> folder.         |
| Web Server         | Copy Application and Calculation Server certificate from <b>IntuitionSign</b> folder and paste it in <b>IntuitionVerify</b> folder. |
| Calculation Server | Copy Application and Web Server certificate from <b>IntuitionSign</b> folder and paste it in <b>IntuitionVerify</b> folder.         |

7. Open command prompt as administrator and perform **IISRESET** in Web and Calculation Servers.

## UI220 COEXISTENCE ISSUES WITH APM 531.X


## 14.1 APM R531.x Co-existence with UI R220.1

*Problem*


PHD Incompatibility between APM 531.x and UI 220

*Solution*

1. Uninstall PHD 400 client files.
2. Restart the Machine.
3. Install PHD 320 client files.
  - a. Open APM R531.1. build location and navigate to below folder: \\Build Location\\Installer\\Components\\EPHD\\EPHD\\Install\\x86\\PHDClient
4. Right Click and click Install **PHDClient.msi**
5. For the license, go to reg edit as shown in below pic and copy PHDLicenseNumber and PHD authorization key from reg edit.

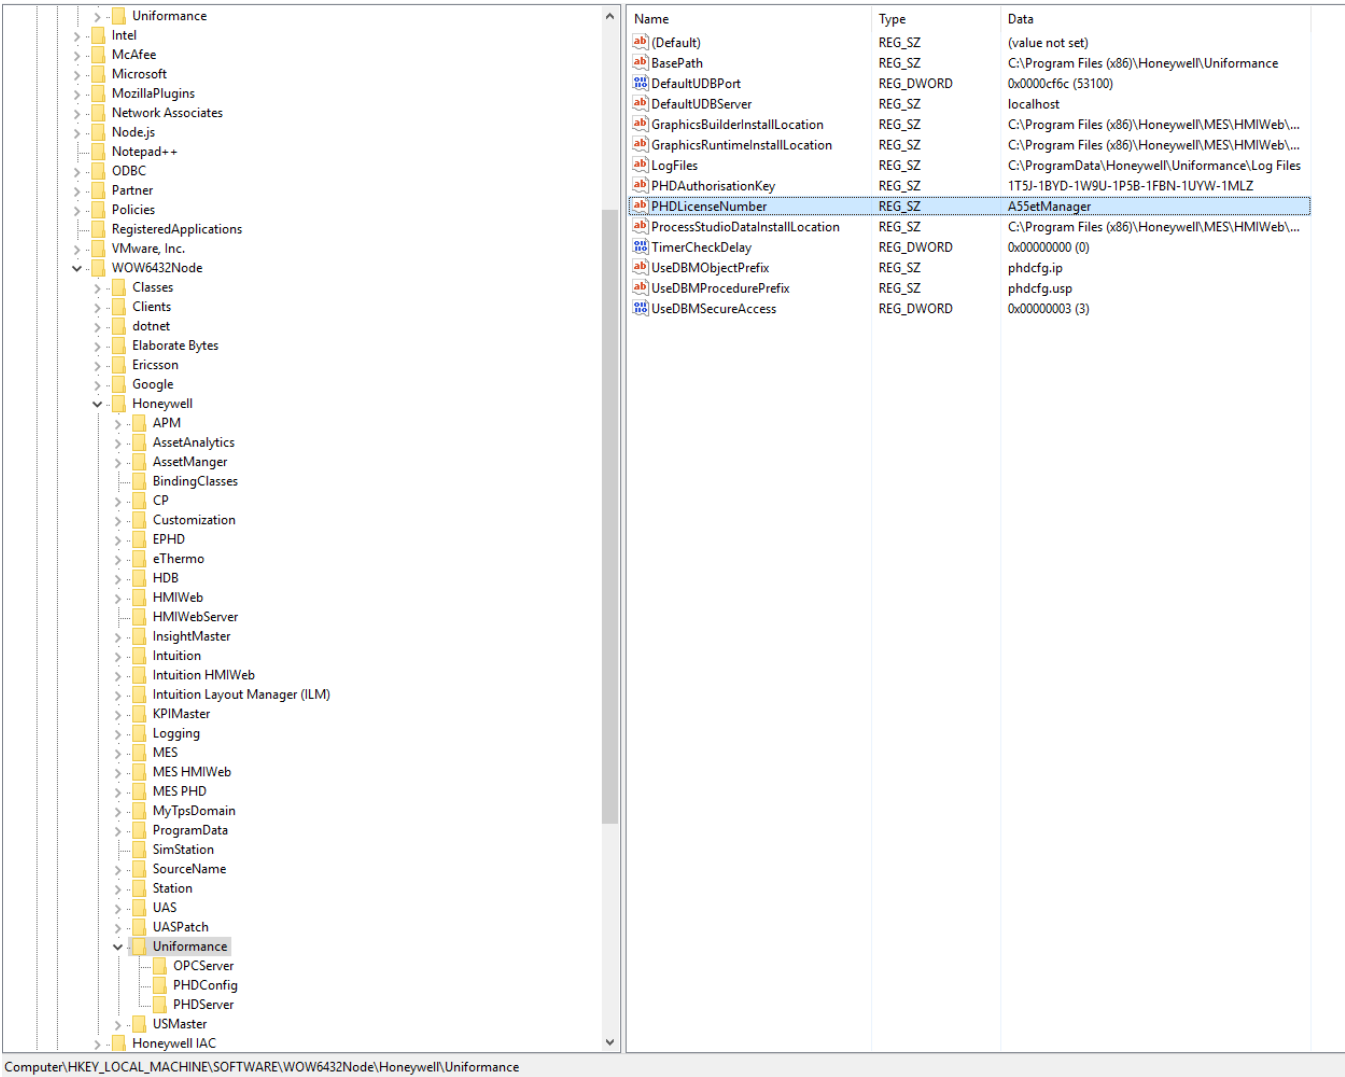

6. Enter the License number and Authorization key in the Uniformance PHD Client file setup.

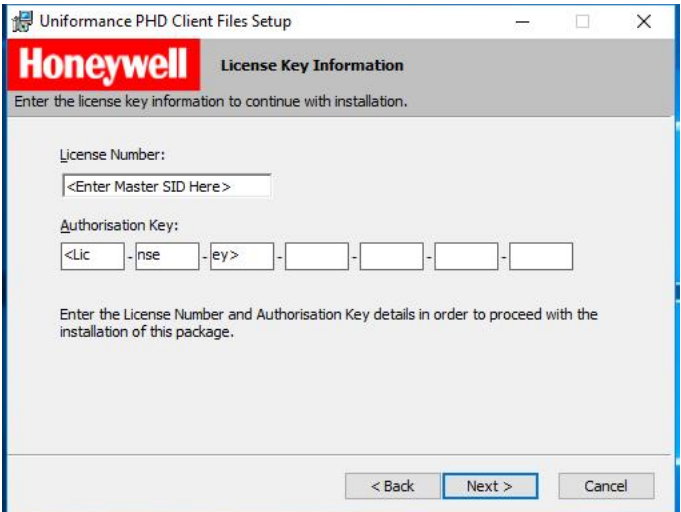

7. Once the installation is completed, start all the PHD services.


## 14.2 Event management pages will not open with UI220

### Problem

If user have UI220.1 for APM does not open event management pages.

### Solution

One needs to add the following appSettings to web.config of FaultViewer in web server "C:\Program Files (x86)\Honeywell\MES\AssetManager\WebServer\FaultViewer":

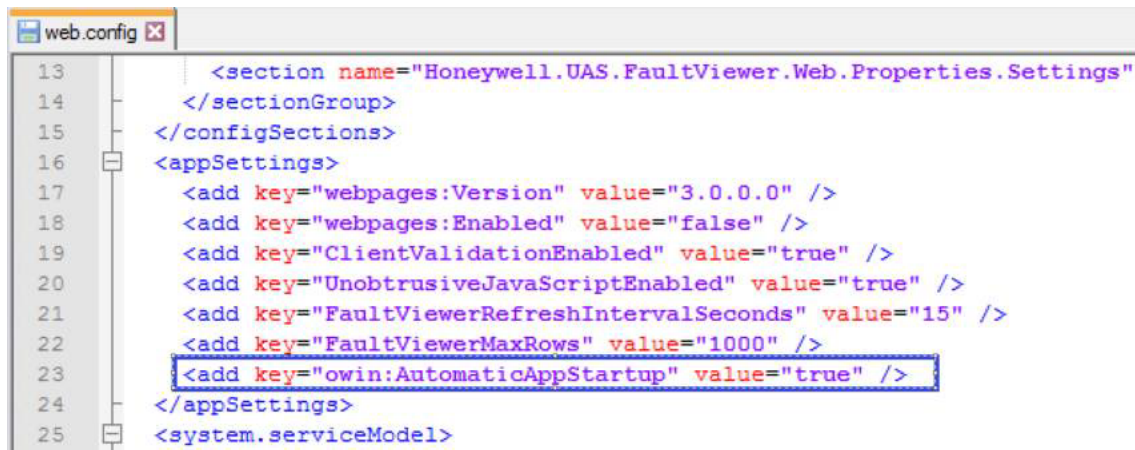

```
13      <section name="Honeywell.UAS.FaultViewer.Web.Properties.Settings"
14      </sectionGroup>
15  </configSections>
16  <appSettings>
17      <add key="webpages:Version" value="3.0.0.0" />
18      <add key="webpages:Enabled" value="false" />
19      <add key="ClientValidationEnabled" value="true" />
20      <add key="UnobtrusiveJavaScriptEnabled" value="true" />
21      <add key="FaultViewerRefreshIntervalSeconds" value="15" />
22      <add key="FaultViewerMaxRows" value="1000" />
23      <add key="owin:AutomaticAppStartup" value="true" />
24  </appSettings>
25  <system.serviceModel>
```

# NOTICES

## Terms and Conditions

Honeywell International Inc. authorizes you to copy documents published by Honeywell International Inc. on the World Wide Web for personal or non-commercial use only, provided any copy of these documents that you make shall retain all copyright and other proprietary notices contained herein. Except as expressly provided, nothing contained in this paragraph shall be construed as conferring any license or right under any Honeywell International Inc. copyright. No materials available on the Honeywell International Inc. Website may be stored, transmitted by any means (including but not limited to electronic, mechanical, scanning, photocopying or recording) without prior written permission of Honeywell International Inc. For more details, refer to <https://www.honeywell.com/us/en/terms-and-conditions>.

## Other trademarks

Microsoft and SQL Server are either registered trademarks or trademarks of Microsoft Corporation in the United States and/or other countries.

Trademarks that appear in this document are used only to the benefit of the trademark owner, with no intention of trademark infringement.

## Third-party licenses

This product may contain or be derived from materials, including software, of third parties. The third party materials may be subject to licenses, notices, restrictions and obligations imposed by the licensor. The licenses, notices, restrictions and obligations, if any, may be found in the materials accompanying the product, in the documents or files accompanying such third party materials, in a file named third\_party\_licenses on the media containing the product.

## Documentation feedback

You can find the most up-to-date documents on the Honeywell Process Solutions support website at:

<http://www.honeywellprocess.com/support>

If you have comments about Honeywell Connected Industrial documentation, send your feedback to: [hpsdocs@honeywell.com](mailto:hpsdocs@honeywell.com)

Use this email address to provide feedback, or to report errors and omissions in the documentation. For immediate help with a technical problem, contact your local Honeywell Process Solutions Customer Contact Center (CCC) or Honeywell Technical Assistance Center (TAC).

## How to report a security vulnerability

For the purpose of submission, a security vulnerability is defined as a software defect or weakness that can be exploited to reduce the operational or security capabilities of the software.

Honeywell investigates all reports of security vulnerabilities affecting Honeywell products and services.

To report a potential security vulnerability against any Honeywell product, please follow the instructions at:

<https://honeywell.com/pages/vulnerabilityreporting.aspx>

## Support

For support, contact your local Honeywell Process Solutions Customer Contact Center (CCC). To find your local CCC visit the website, <https://www.honeywellprocess.com/en-US/contact-us/customer-support-contacts/Pages/default.aspx>.

## Training classes

Honeywell holds technical training classes that are taught by process control systems experts. For more information about these classes, contact your Honeywell representative, or see <http://www.automationcollege.com>.