



TECHNICAL MEMORANDUM

DATE 03 February 2026

WSP Project No. CA0037087.2445

TO NAVFAC Atlantic

FROM Juliet Kennedy, B.Sc.
Veronica Reid, B.Sc., PMP

EMAIL juliet.kennedy@wsp.com
veronica.reid@wsp.com

PAINT SAMPLING FOR LEAD, MERCURY, AND PCBS AT MOLL POINT JOINT MARITIME FACILITY, ARGENTIA NAVAL AIR STATION, ARGENTIA, NEWFOUNDLAND AND LABRADOR (NAVFAC ATLANTIC PROJECT NO. FY26 MCON PROJECT P1360)

Naval Facilities Engineering Command Atlantic (NAVFAC Atlantic; the “Client”) retained WSP Canada Inc. (WSP) to perform paint sampling for lead, mercury, and polychlorinated biphenyls (PCBs) throughout the Guard Shack, Generator Building, and TE Building within Moll Point Joint Maritime Facility, located at the Argentia Naval Air Station, in Argentia, Newfoundland and Labrador (the “Site”). The assessment and sampling were completed between December 9 and December 19, 2025, by Brian Lane of WSP.

The paint sampling was completed in preparation for a demolition project of the buildings on Site (NAVFAC Project No. FY26 MCON PROJECT P1360).

FINDINGS

WSP collected 55 paint samples (in duplicate) to determine lead, mercury, and PCB content.

The Certificates of Analyses are included as Attachment 1. A summary table of bulk and leachability sample results for lead, mercury, and PCBs in paint is included as Attachment 2. Sample location figures are presented in Attachment 3.

Lead-Containing Paints

Based on the analytical results, various paints sampled throughout the Site buildings are above 90 ppm and, as a result, are considered to be lead-containing paints, based on the applied *Surface Coating Materials Regulations* (SOR/2016-193). Refer to the attached certificates of analysis and results spreadsheet for more details.

- In the TE Building, lead was identified above 90 ppm in paints at 38 locations in a variety of colours applied to a variety of substrates.
- In the Generator Building, lead was identified above 90 ppm in paints at 16 locations in a variety of colours applied to a variety of substrates.
- In the Guard Shack lead was identified above 90 ppm in off white paint on drywall and light brown paint on exterior piping.

Newfoundland and Labrador's *Guideline Document for Landfill Bans, Special Wastes and Diversion Programs* (2010) Lead Waste Screening Guideline, paint with a lead concentration greater than 5,000 ppm is required to undergo a leachate analysis for disposal purposes. The following paints contained greater than 5,000 ppm lead but did not exceed the 5 mg/L criteria specified by the Lead Waste Screening Guideline:

- Very light brown paint on plaster wall in Room 69 in the TE Building (sample TE-Rm69-M012A)
- Very light green paint on plaster wall in Room 74 in the TE Building (sample TE-Rm74-M016B)
- Dark grey paint on metal door and frame in Room 73 in the TE Building (sample TE-Rm73-M024A)
- Light grey paint on metal generator housing in Room 10 in the Generator Building (sample GB-Rm10-M008A)
- Light grey paint on metal generator housing in Room 10 in the Generator Building (sample GB-Rm10-M008B)

Under the Newfoundland and Labrador's *Guideline for Leachable Toxic Waste, Testing and Disposal* (2003) and *Schedule II Leachate Test, Canadian Environmental Protection Act (CEPA) Proposed Regulations* (2002) Leachate Waste Screening Guideline, leachable toxic waste is characterized as paint with a leachate concentration of 5 mg/L or higher. Based on the analytical results, the leachate extraction was equal to or greater than 5 mg/L in the following paints:

- Black paint on metal door and frame, Rooms 27 and 30 of the TE Building – 180 mg/L (samples TE-Rm27-M026A and TE-Rm30-M026B – samples were combined for leachate analysis due to limited available mass)
- Green paint on metal door and frame, Room 47 of the TE Building – 22 mg/L (sample TE-Rm47-M027A)
- Black paint on concrete and metal pad, Room 51 of the TE Building – 6.1 mg/L (samples TE-Rm51-M030A)
- Black paint on concrete and metal pad, Room 51 of the TE Building – 8.9 mg/L (samples TE-Rm51-M030B)

Mercury-Containing Paints

Based on the analytical results, various paints sampled throughout the Site buildings are above 10 ppm and, as a result, are considered to be mercury-containing paints, based on the applied *Surface Coating Materials Regulations* (SOR/2016-193). Refer to the attached certificates of analysis and results spreadsheet for more details.

- In the TE Building, mercury was identified above 10 ppm in paints at 14 locations in a variety of colours applied to a variety of substrates.
- In the Generator Building, mercury was identified above 10 ppm in white paint on drywall and concrete block, and blue paint applied to metal doors and frames.
- All paints tested in the Guardhouse contained less than 10 ppm mercury.

In Newfoundland and Labrador, under the *Canadian Council of Ministers of the Environment (CCME) Canadian Soil Quality Guidelines (CSQG)*, paint with a mercury concentration greater than 50 ppm is required to undergo leachate analysis. The Newfoundland and Labrador Department of Municipal Affairs and Environment (MAE) 2003 Guidance Document for *Leachable Toxic Waste, Testing and Disposal* (GD-PPD-26.1) characterizes leachable toxic waste as paint with a leachability of 0.10 mg/L or higher for mercury.

Based on the analytical results, no paint samples exceeded a mercury concentration of 50 ppm; therefore, no samples required leachate analysis.

PCB-Containing Paints

Based on the analytical results, the PCB concentrations in the following paints were above 50 ppm and, as a result, are considered to be PCB-containing paints, based on the *Canadian Environmental Protection Act (CEPA) PCB Regulations* (SOR/2008-273):

- Black paint on metal ceiling hangers in Room 4 of the Generator Building – 71 ppm (sample GB-Rm4-PCB012A)
- Black paint on metal ceiling hangers in Room 4 of the Generator Building – 68 ppm (sample GB-Rm4-PCB012B).

CONCLUSIONS AND RECOMMENDATIONS

Based on the findings of the assessment and analytical results, the following are recommended:

Lead-Containing Paints

- Disturbance of building materials coated with lead-containing paints during renovation/demolition operations should be conducted following the Environmental Abatement Council of Canada (EACC) *Lead Guideline for Construction, Renovation, Maintenance or Repair* (2025) Class 2A Operations, and must be conducted so as not to expose workers to airborne lead in excess of 50 ug/m³ as specified by *Canada Occupational Health and Safety Regulations* (SOR/86-304). Disturbance
- If leachate testing performed on a painted building material was below 5 mg/L lead, the painted building material can be disposed as regular C&D waste as outlined in the *Waste Management Regulations* (NLR 59/03), made under the Newfoundland and Labrador *Environmental Protection Act*. Painted metal should be recycled at a local scrap metal facility.
- If leachate extraction was above 5 mg/L, the painted building material is considered a hazardous waste and must be disposed of at an approved waste disposal site.
- Painted metal (regardless of leachability of paints applied) should be recycled at a local scrap metal facility.

Mercury-Containing Paints

- Disturbance of building materials coated with mercury-containing paints during renovation/demolition operations must be conducted so as not to expose workers to airborne mercury in excess of 25 ug/m³ as specified by *Canada Occupational Health and Safety Regulations* (SOR/86-304).
- Mercury concentrations in the paint did not exceed the disposal limit; therefore, paints can be disposed as regular C&D waste as outlined in the *Waste Management Regulations* (NLR 59/03), made under the Newfoundland and Labrador *Environmental Protection Act*. Painted metal should be recycled at a local scrap metal facility.

PCB-Containing Paints

- Paints and painted material below the threshold of 50 ppm for PCBs in paint are not considered hazardous waste and can be disposed as regular C&D waste as outlined in the *Waste Management Regulations* (NLR 59/03), made under the Newfoundland and Labrador *Environmental Protection Act*.
- Paints and painted material exceeding the 50 ppm threshold for PCBs in paint are considered hazardous waste and must be packaged and shipped to a provincially authorized facility for destruction.

LIMITATIONS

This report was prepared for the exclusive use of NAVFAC. This report is based on data and information collected during the Site visit conducted by WSP and is based solely on Site conditions encountered at the time of the survey.

The conclusions and recommendations contained in this report are based upon professional opinions with regard to the subject matter. These opinions are in accordance with applicable and currently accepted occupational health and safety or environmental assessment standards and practices applicable to these locations and are subject to the following inherent limitations:

- The data and findings presented in this report are valid as of the date of the investigation. The passage of time, manifestation of latent conditions or occurrence of future events may warrant further exploration at the properties, analysis of the data, and re-evaluation of the findings, observations, and conclusions expressed in this report.
- The findings, observations and conclusions expressed by WSP in this report are not, and should not be considered, an opinion concerning compliance of any past or present owner or operator of the Site with any federal, provincial or local laws or regulations.
- Additional hazardous building materials not identified in this report may become evident during renovation activities. Should additional information become available, WSP requests that this information be brought to our attention so that we may re-assess the conclusions presented herein.
- WSP will not be responsible for any real or perceived decrease in a property value, its saleability or ability to gain financing through the reporting of information in this report.
- WSP's report presents professional opinions and findings of a scientific and technical nature. While attempts were made to relate the data and findings to applicable environmental and occupational health and safety laws and regulations, the report shall not be construed to offer legal opinion or representations as to the requirements of, nor compliance with, environmental and occupational health and safety laws, rules, regulations, or policies of federal, provincial, or local governmental agencies. Any use of this assessment report constitutes acceptance of the limits of WSP's liability. WSP's liability extends only to its client and not to other parties who may obtain this assessment report. Issues raised by the report should be reviewed by appropriate legal counsel.
- The data reported and the findings and recommendations expressed in this report are limited by the Scope of Work. The Scope of Work is based on the request of the client, availability of access to the property, and time constraints.


- In evaluating the Site conditions, we have relied in good faith on information provided by others. We accept no responsibility for any deficiency, misstatements or inaccuracies contained in this report as a result of omissions, misinterpretations or fraudulent acts of the persons involved.
- This report is of a summary nature and is not intended to stand alone without reference to the instructions given to WSP by the Client, communications between WSP and the Client, and to any other reports prepared by WSP for the Client relative to the specific Site described in the report. In order to properly understand the suggestions, recommendations and opinions expressed in this report, reference must be made to the whole of the report. We cannot be responsible for use of portions of the report without reference to the entire report.
- Unless otherwise stated, the suggestions, recommendations and opinions given in this report are intended only for the guidance of the Client in the design of the specific project. The extent and detail of investigations, including the number of locations investigated, necessary to determine all of the relevant conditions which may affect construction costs would normally be greater than has been carried out for design purposes. Contractors bidding on, or undertaking the work, should rely on their own investigations, as well as their own interpretations of the factual data presented in the report, as to how concealed conditions may affect their work, including but not limited to proposed construction techniques, schedule, safety, and equipment capabilities.
- Special risks occur whenever engineering or related disciplines are applied to identify Site conditions and even a comprehensive investigation, sampling and testing program may fail to detect all or certain Site conditions. The conditions that WSP interprets to exist between and beyond investigation and sampling points may differ from those that actually exist.

CLOSURE

We trust that this technical memorandum meets your requirements. If you have any questions regarding the content of this technical memorandum, please do not hesitate to contact the undersigned.

Sincerely,

WSP Canada Inc.

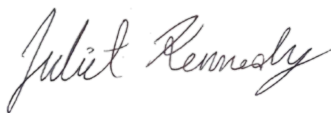

Juliet Kennedy, B.Sc.
Intermediate EHS Specialist



Mike Wilson, B.Sc.
Senior EHS Consultant

JK/VR/DS/ha

Attachment 1: Certificates of Analyses

Attachment 2: Summary Table of Bulk and Leachability Sample Results for Lead, Mercury, and PCBs in Paints

Attachment 3: Sample Location Figures

[https://wsponlinecan.sharepoint.com/sites/ca-us0048429.8539/shared documents/06. deliverables/technical memo - paint sampling/moll point joint maritime facility nl tech memo 07jan2026.docx](https://wsponlinecan.sharepoint.com/sites/ca-us0048429.8539/shared%20documents/06.%20deliverables/technical%20memo%20-%20paint%20sampling/moll%20point%20joint%20maritime%20facility%20nl%20tech%20memo%2007jan2026.docx)

ATTACHMENT 1

Certificates of Analyses

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
 Telephone: 856-858-4800 Fax: cs@emsl.com
 EMSL-CIN-01

EMSL Order ID: 012546401**LIMS Reference ID:** AD46401**EMSL Customer ID:** WSPN36

January 09, 2026

AP

WSP Canada, Inc. [WSPN36]

36 Pippy Place

Saint John's, NL A1B 4A5

The following analytical report covers the analysis performed on samples submitted to EMSL Analytical, Inc. on 12/29/2025. The results are tabulated on the attached pages for the following client designated project:

CA0037087.2445-NAVFAC Paint Sampling

The reference number for these samples is EMSL Order #: AD46401 . Please use this reference when calling about these samples. If you have any questions, please do not hesitate to contact the lab at 856-858-4800.

Report Date	Report Revision	Report Comments
01/09/2026	0	Initial Report

 Owen McKenna, Laboratory Manager or other approved signatory

Table of Contents

Cover Letter	1
Sample Condition on Receipt	3
Samples in Report	4
Positive Hits Summary	7
Case Narratives Work Order	22
Sample Results	23
Quality Assurance Results	133
Certified Analyses	140
Certifications	140
Qualifiers, Definitions and Disclaimer	141
Chain of Custody PDF	142

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax:cs@emsl.com
EMSL-CIN-01

EMSL Order ID: 012340401**LIMS Reference ID:** AD46401**EMSL Customer ID:** WSPN36**Attention:** AP

WSP Canada, Inc. [WSPN36]
36 Pippy Place
Saint John's, NL A1B 4A5
(709) 722-7023
capayablesinvoice@wsp.com

Project Name:

CA0037087.2445-NAVFAC Paint Sampling

Project ID:

_Master Project-WSPN36

Customer PO:**Sales Rep:**

Sarah Jamieson

Received:

12/29/2025 09:00

Reported:**Sample Condition on Receipt****Cooler ID: Default Cooler****Temperature: 22.0 °C**

Custody Seals	N
Containers Intact	Y
COC/Labels Agree	Y
Preservation Confirmed	N

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax:cs@emsl.com
EMSL-CIN-01

Table of Contents**EMSL Order ID:** 012340401**LIMS Reference ID:** AD46401**EMSL Customer ID:** WSPN36**Attention:** AP

WSP Canada, Inc. [WSPN36]
36 Pippy Place
Saint John's, NL A1B 4A5
(709) 722-7023
capayablesinvoice@wsp.com

Project Name:

CA0037087.2445-NAVFAC Paint Sampling

Project ID:

_Master Project-WSPN36

Customer PO:**Sales Rep:**

Sarah Jamieson

Received:

12/29/2025 09:00

Reported:**Samples in this Report**

Lab ID	Sample	Matrix	Date Sampled	Date Received
AD46401-01	TE-Rm52-PCB001A	Solid	12/16/25 12:00 am	12/29/2025
AD46401-02	TE-Rm52-PCB001B	Solid	12/16/25 12:00 am	12/29/2025
AD46401-03	TE-Rm51-PCB002A	Solid	12/16/25 12:00 am	12/29/2025
AD46401-04	TE-Rm42-PCB002B	Solid	12/16/25 12:00 am	12/29/2025
AD46401-05	TE-Rm46-PCB003A	Solid	12/16/25 12:00 am	12/29/2025
AD46401-06	TE-Rm46-PCB003B	Solid	12/16/25 12:00 am	12/29/2025
AD46401-07	TE-Rm43-PCB004A	Solid	12/17/25 12:00 am	12/29/2025
AD46401-08	TE-Rm43-PCB004B	Solid	12/17/25 12:00 am	12/29/2025
AD46401-09	TE-Rm7-PCB005A	Solid	12/16/25 12:00 am	12/29/2025
AD46401-10	TE-Rm4-PCB005B	Solid	12/16/25 12:00 am	12/29/2025
AD46401-11	TE-Rm10-PCB006A	Solid	12/16/25 12:00 am	12/29/2025
AD46401-12	TE-Rm10-PCB006B	Solid	12/16/25 12:00 am	12/29/2025
AD46401-13	TE-Rm65-PCB007A	Solid	12/17/25 12:00 am	12/29/2025
AD46401-14	TE-Rm65-PCB007B	Solid	12/17/25 12:00 am	12/29/2025
AD46401-15	TE-Rm67-PCB008A	Solid	12/16/25 12:00 am	12/29/2025
AD46401-16	TE-Rm50-PCB008B	Solid	12/17/25 12:00 am	12/29/2025
AD46401-17	TE-Rm66-PCB009A	Solid	12/16/25 12:00 am	12/29/2025
AD46401-18	TE-Rm66-PCB009B	Solid	12/16/25 12:00 am	12/29/2025
AD46401-19	TE-Rm64-PCB010A	Solid	12/16/25 12:00 am	12/29/2025
AD46401-20	TE-Rm64-PCB010B	Solid	12/17/25 12:00 am	12/29/2025
AD46401-21	TE-Rm68-PCB011A	Solid	12/16/25 12:00 am	12/29/2025
AD46401-22	TE-Rm68-PCB011B	Solid	12/17/25 12:00 am	12/29/2025
AD46401-23	TE-Rm69-PCB012A	Solid	12/16/25 12:00 am	12/29/2025
AD46401-24	TE-Rm53-PCB012B	Solid	12/16/25 12:00 am	12/29/2025
AD46401-25	TE-Rm69-PCB013A	Solid	12/16/25 12:00 am	12/29/2025
AD46401-26	TE-Rm69-PCB013B	Solid	12/17/25 12:00 am	12/29/2025
AD46401-27	TE-Rm73-PCB014A	Solid	12/16/25 12:00 am	12/29/2025
AD46401-28	TE-Rm73-PCB014B	Solid	12/17/25 12:00 am	12/29/2025
AD46401-29	TE-Rm53-PCB015A	Solid	12/16/25 12:00 am	12/29/2025
AD46401-30	TE-Rm72-PCB015B	Solid	12/16/25 12:00 am	12/29/2025
AD46401-31	TE-Rm74-PCB016A	Solid	12/16/25 12:00 am	12/29/2025
AD46401-32	TE-Rm74-PCB016B	Solid	12/17/25 12:00 am	12/29/2025
AD46401-33	TE-Rm57-PCB017A	Solid	12/16/25 12:00 am	12/29/2025
AD46401-34	TE-Rm21-PCB017B	Solid	12/16/25 12:00 am	12/29/2025
AD46401-35	TE-Rm40-PCB018A	Solid	12/17/25 12:00 am	12/29/2025
AD46401-36	TE-Rm40-PCB018B	Solid	12/17/25 12:00 am	12/29/2025
AD46401-37	TE-Rm25-PCB019A	Solid	12/17/25 12:00 am	12/29/2025
AD46401-38	TE-Rm23-PCB019B	Solid	12/17/25 12:00 am	12/29/2025
AD46401-39	TE-Ext-PCB020A	Solid	12/17/25 12:00 am	12/29/2025

EMSL maintains liability limited to cost of analysis. Interpretation and use of test results are the responsibility of the client. This report relates only to the samples reported above, and may not be reproduced, except in full, without written approval by EMSL. EMSL bears no responsibility for sample collection activities or analytical method limitations. The report reflects the samples as received. Results are generated from the field sampling data (sampling volumes and areas, locations, etc.) provided by the client on the Chain of Custody. Samples are within quality control criteria and met method specifications unless otherwise noted.

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax:cs@emsl.com
EMSL-CIN-01

Table of Contents**EMSL Order ID:** 012340401**LIMS Reference ID:** AD46401**EMSL Customer ID:** WSPN36**Attention:** AP

WSP Canada, Inc. [WSPN36]
36 Pippy Place
Saint John's, NL A1B 4A5
(709) 722-7023
capayablesinvoice@wsp.com

Project Name:

CA0037087.2445-NAVFAC Paint Sampling

Project ID:

_Master Project-WSPN36

Customer PO:**Sales Rep:**

Sarah Jamieson

Received:

12/29/2025 09:00

Reported:**Samples in this Report
(Continued)**

Lab ID	Sample	Matrix	Date Sampled	Date Received
AD46401-40	TE-Ext-PCB020B	Solid	12/17/25 12:00 am	12/29/2025
AD46401-41	TE-Ext-PCB021A	Solid	12/17/25 12:00 am	12/29/2025
AD46401-42	TE-Ext-PCB021B	Solid	12/17/25 12:00 am	12/29/2025
AD46401-43	TE-Ext-PCB022A	Solid	12/17/25 12:00 am	12/29/2025
AD46401-44	TE-Ext-PCB022B	Solid	12/17/25 12:00 am	12/29/2025
AD46401-45	TE-Ext-PCB023A	Solid	12/18/25 12:00 am	12/29/2025
AD46401-46	TE-Ext-PCB023B	Solid	12/18/25 12:00 am	12/29/2025
AD46401-47	TE-Rm73-PCB024A	Solid	12/18/25 12:00 am	12/29/2025
AD46401-48	TE-Rm63-PCB024B	Solid	12/18/25 12:00 am	12/29/2025
AD46401-49	TE-Rm63-PCB025A	Solid	12/18/25 12:00 am	12/29/2025
AD46401-50	TE-Rm15-PCB025B	Solid	12/18/25 12:00 am	12/29/2025
AD46401-51	TE-Rm27-PCB026A	Solid	12/18/25 12:00 am	12/29/2025
AD46401-52	TE-Rm30-PCB026B	Solid	12/18/25 12:00 am	12/29/2025
AD46401-53	TE-Rm47-PCB027A	Solid	12/18/25 12:00 am	12/29/2025
AD46401-54	TE-Rm47-PCB027B	Solid	12/18/25 12:00 am	12/29/2025
AD46401-55	TE-Rm52-PCB028A	Solid	12/18/25 12:00 am	12/29/2025
AD46401-56	TE-Rm52-PCB028B	Solid	12/18/25 12:00 am	12/29/2025
AD46401-57	TE-Rm52-PCB029A	Solid	12/18/25 12:00 am	12/29/2025
AD46401-58	TE-Rm52-PCB029B	Solid	12/18/25 12:00 am	12/29/2025
AD46401-59	TE-Rm51-PCB030A	Solid	12/18/25 12:00 am	12/29/2025
AD46401-60	TE-Rm51-PCB030B	Solid	12/18/25 12:00 am	12/29/2025
AD46401-61	TE-Rm45-PCB031A	Solid	12/19/25 12:00 am	12/29/2025
AD46401-62	TE-Rm63-PCB031B	Solid	12/19/25 12:00 am	12/29/2025
AD46401-63	TE-Rm51-PCB032A	Solid	12/19/25 12:00 am	12/29/2025
AD46401-64	TE-Rm71-PCB032B	Solid	12/19/25 12:00 am	12/29/2025
AD46401-65	TE-Rm51-PCB033A	Solid	12/19/25 12:00 am	12/29/2025
AD46401-66	TE-Rm27-PCB033B	Solid	12/19/25 12:00 am	12/29/2025
AD46401-67	GB-Rm1-PCB001A	Solid	12/9/25 12:00 am	12/29/2025
AD46401-68	GB-Rm10-PCB001B	Solid	12/9/25 12:00 am	12/29/2025
AD46401-69	GB-Rm6-PCB002A	Solid	12/9/25 12:00 am	12/29/2025
AD46401-70	GB-Rm9-PCB002B	Solid	12/9/25 12:00 am	12/29/2025
AD46401-71	GB-Rm5-PCB003A	Solid	12/9/25 12:00 am	12/29/2025
AD46401-72	GB-Rm5-PCB003B	Solid	12/9/25 12:00 am	12/29/2025
AD46401-73	GB-Rm1-PCB004A	Solid	12/9/25 12:00 am	12/29/2025
AD46401-74	GB-Rm1-PCB004B	Solid	12/9/25 12:00 am	12/29/2025
AD46401-75	GB-Rm1-PCB005A	Solid	12/9/25 12:00 am	12/29/2025
AD46401-76	GB-Rm1-PCB005B	Solid	12/9/25 12:00 am	12/29/2025
AD46401-77	GB-Rm4-PCB006A	Solid	12/12/25 12:00 am	12/29/2025
AD46401-78	GB-Rm4-PCB006B	Solid	12/12/25 12:00 am	12/29/2025
AD46401-79	GB-Rm4-PCB007A	Solid	12/12/25 12:00 am	12/29/2025

EMSL maintains liability limited to cost of analysis. Interpretation and use of test results are the responsibility of the client. This report relates only to the samples reported above, and may not be reproduced, except in full, without written approval by EMSL. EMSL bears no responsibility for sample collection activities or analytical method limitations. The report reflects the samples as received. Results are generated from the field sampling data (sampling volumes and areas, locations, etc.) provided by the client on the Chain of Custody. Samples are within quality control criteria and met method specifications unless otherwise noted.

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax:cs@emsl.com
EMSL-CIN-01

Table of Contents**EMSL Order ID:** 012340401**LIMS Reference ID:** AD46401**EMSL Customer ID:** WSPN36**Attention:** AP

WSP Canada, Inc. [WSPN36]
36 Pippy Place
Saint John's, NL A1B 4A5
(709) 722-7023
capayablesinvoice@wsp.com

Project Name:

CA0037087.2445-NAVFAC Paint Sampling

Project ID:

_Master Project-WSPN36

Customer PO:**Sales Rep:**

Sarah Jamieson

Received:

12/29/2025 09:00

Reported:**Samples in this Report
(Continued)**

Lab ID	Sample	Matrix	Date Sampled	Date Received
AD46401-80	GB-Rm12-PCB007B	Solid	12/12/25 12:00 am	12/29/2025
AD46401-81	GB-Rm10-PCB008A	Solid	12/12/25 12:00 am	12/29/2025
AD46401-82	GB-Rm10-PCB008B	Solid	12/12/25 12:00 am	12/29/2025
AD46401-83	GB-Rm10-PCB009A	Solid	12/12/25 12:00 am	12/29/2025
AD46401-84	GB-Rm10-PCB009B	Solid	12/12/25 12:00 am	12/29/2025
AD46401-85	GB-Rm10-PCB010A	Solid	12/12/25 12:00 am	12/29/2025
AD46401-86	GB-Rm10-PCB010B	Solid	12/12/25 12:00 am	12/29/2025
AD46401-87	GB-Rm2-PCB011A	Solid	12/12/25 12:00 am	12/29/2025
AD46401-88	GB-Rm2-PCB011B	Solid	12/12/25 12:00 am	12/29/2025
AD46401-89	GB-Rm4-PCB012A	Solid	12/15/25 12:00 am	12/29/2025
AD46401-90	GB-Rm4-PCB012B	Solid	12/15/25 12:00 am	12/29/2025
AD46401-91	GB-Rm14-PCB013A	Solid	12/15/25 12:00 am	12/29/2025
AD46401-92	GB-Rm14-PCB013B	Solid	12/15/25 12:00 am	12/29/2025
AD46401-93	GB-Ext-PCB014A	Solid	12/15/25 12:00 am	12/29/2025
AD46401-94	GB-Ext-PCB014B	Solid	12/15/25 12:00 am	12/29/2025
AD46401-95	GB-Ext-PCB015A	Solid	12/15/25 12:00 am	12/29/2025
AD46401-96	GB-Ext-PCB015B	Solid	12/15/25 12:00 am	12/29/2025
AD46401-97	GB-Ext-PCB016A	Solid	12/15/25 12:00 am	12/29/2025
AD46401-98	GB-Ext-PCB016B	Solid	12/15/25 12:00 am	12/29/2025
AD46401-99	GB-Ext-PCB017A	Solid	12/15/25 12:00 am	12/29/2025
AD46401-AA	GB-Ext-PCB017B	Solid	12/15/25 12:00 am	12/29/2025
AD46401-AB	GS-Rm1-PCB001A	Solid	12/9/25 12:00 am	12/29/2025
AD46401-AC	GS-Rm1-PCB001B	Solid	12/9/25 12:00 am	12/29/2025
AD46401-AD	GS-Rm1-PCB002A	Solid	12/9/25 12:00 am	12/29/2025
AD46401-AE	GS-Rm2-PCB002B	Solid	12/9/25 12:00 am	12/29/2025
AD46401-AF	GS-Rm2-PCB003A	Solid	12/9/25 12:00 am	12/29/2025
AD46401-AG	GS-Ext-PCB003B	Solid	12/9/25 12:00 am	12/29/2025
AD46401-AH	GS-Ext-PCB004A	Solid	12/9/25 12:00 am	12/29/2025
AD46401-AI	GS-Ext-PCB004B	Solid	12/9/25 12:00 am	12/29/2025
AD46401-AJ	GS-Ext-PCB005A	Solid	12/9/25 12:00 am	12/29/2025
AD46401-AK	GS-Ext-PCB005B	Solid	12/9/25 12:00 am	12/29/2025

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax:cs@emsl.com
EMSL-CIN-01

Table of Contents**EMSL Order ID:** 012340401**LIMS Reference ID:** AD46401**EMSL Customer ID:** WSPN36**Attention:** AP

WSP Canada, Inc. [WSPN36]
36 Pippy Place

Saint John's, NL A1B 4A5
(709) 722-7023

capayablesinvoice@wsp.com

Project Name:

CA0037087.2445-NAVFAC Paint Sampling

Project ID:

_Master Project-WSPN36

Customer PO:**Sales Rep:**

Sarah Jamieson

Received:

12/29/2025 09:00

Reported:**Positive Hits Summary**

Lab ID	Client ID					Sampled
AD46401-01	TE-Rm52-PCB001A					12/16/25 00:00
Method	Analyte	Result	Qualifier	Unit	Analyzed	
SW846-8082A	Aroclor-1242	3.2		mg/kg	12/31/2025	14:32
SW846-8082A	Aroclor-1254	4.0		mg/kg	12/31/2025	14:32
Lab ID	Client ID					Sampled
AD46401-02	TE-Rm52-PCB001B					12/16/25 00:00
Method	Analyte	Result	Qualifier	Unit	Analyzed	
SW846-8082A	Aroclor-1242	2.4		mg/kg	12/31/2025	15:12
SW846-8082A	Aroclor-1254	2.4		mg/kg	12/31/2025	15:12
Lab ID	Client ID					Sampled
AD46401-03	TE-Rm51-PCB002A					12/16/25 00:00
Method	Analyte	Result	Qualifier	Unit	Analyzed	
SW846-8082A	Aroclor-1242	2.4		mg/kg	12/31/2025	14:53
SW846-8082A	Aroclor-1254	4.2		mg/kg	12/31/2025	14:53
Lab ID	Client ID					Sampled
AD46401-04	TE-Rm42-PCB002B					12/16/25 00:00
Method	Analyte	Result	Qualifier	Unit	Analyzed	
SW846-8082A	Aroclor-1254	1.1		mg/kg	12/31/2025	15:34
SW846-8082A	Aroclor-1242	2.2		mg/kg	12/31/2025	15:34
Lab ID	Client ID					Sampled
AD46401-05	TE-Rm46-PCB003A					12/16/25 00:00
Method	Analyte	Result	Qualifier	Unit	Analyzed	
SW846-8082A	Aroclor-1254	2.7		mg/kg	12/31/2025	15:56
SW846-8082A	Aroclor-1242	3.8		mg/kg	12/31/2025	15:56
Lab ID	Client ID					Sampled
AD46401-06	TE-Rm46-PCB003B					12/16/25 00:00
Method	Analyte	Result	Qualifier	Unit	Analyzed	
SW846-8082A	Aroclor-1254	12	D	mg/kg	01/02/2026	12:58

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax:cs@emsl.com
EMSL-CIN-01

Table of Contents

EMSL Order ID: 012340401

LIMS Reference ID: AD46401

EMSL Customer ID: WSPN36

Attention: AP

WSP Canada, Inc. [WSPN36]
36 Pippy Place

Saint John's, NL A1B 4A5
(709) 722-7023

capayablesinvoice@wsp.com

Project Name:

CA0037087.2445-NAVFAC Paint Sampling

Project ID:

_Master Project-WSPN36

Customer PO:**Sales Rep:**

Sarah Jamieson

Received:

12/29/2025 09:00

Reported:**Positive Hits Summary**
(Continued)

Lab ID	Client ID					Sampled
AD46401-07	TE-Rm43-PCB004A					12/17/25 00:00
Method	Analyte	Result	Qualifier	Unit	Analyzed	
SW846-8082A	Aroclor-1254	1.7		mg/kg	12/31/2025 16:39	
SW846-8082A	Aroclor-1242	3.8		mg/kg	12/31/2025 16:39	
Lab ID	Client ID					Sampled
AD46401-08	TE-Rm43-PCB004B					12/17/25 00:00
Method	Analyte	Result	Qualifier	Unit	Analyzed	
SW846-8082A	Aroclor-1254	1.8		mg/kg	12/31/2025 17:01	
SW846-8082A	Aroclor-1242	3.7		mg/kg	12/31/2025 17:01	
Lab ID	Client ID					Sampled
AD46401-09	TE-Rm7-PCB005A					12/16/25 00:00
Method	Analyte	Result	Qualifier	Unit	Analyzed	
SW846-8082A	Aroclor-1242	1.6		mg/kg	12/31/2025 17:23	
SW846-8082A	Aroclor-1254	2.2		mg/kg	12/31/2025 17:23	
Lab ID	Client ID					Sampled
AD46401-10	TE-Rm4-PCB005B					12/16/25 00:00
Method	Analyte	Result	Qualifier	Unit	Analyzed	
SW846-8082A	Aroclor-1260	1.0		mg/kg	12/31/2025 17:45	
SW846-8082A	Aroclor-1242	4.0		mg/kg	12/31/2025 17:45	
SW846-8082A	Aroclor-1254	7.4		mg/kg	12/31/2025 17:45	
Lab ID	Client ID					Sampled
AD46401-11	TE-Rm10-PCB006A					12/16/25 00:00
Method	Analyte	Result	Qualifier	Unit	Analyzed	
SW846-8082A	Aroclor-1254	2.5		mg/kg	12/31/2025 18:07	
SW846-8082A	Aroclor-1242	2.7		mg/kg	12/31/2025 18:07	
Lab ID	Client ID					Sampled
AD46401-12	TE-Rm10-PCB006B					12/16/25 00:00
Method	Analyte	Result	Qualifier	Unit	Analyzed	
SW846-8082A	Aroclor-1254	2.4		mg/kg	12/31/2025 18:29	
SW846-8082A	Aroclor-1242	3.5		mg/kg	12/31/2025 18:29	

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax:cs@emsl.com
EMSL-CIN-01

Table of Contents

EMSL Order ID: 012340401

LIMS Reference ID: AD46401

EMSL Customer ID: WSPN36

Attention: AP

WSP Canada, Inc. [WSPN36]
36 Pippy Place

Saint John's, NL A1B 4A5
(709) 722-7023

capayablesinvoice@wsp.com

Project Name:

CA0037087.2445-NAVFAC Paint Sampling

Project ID:

_Master Project-WSPN36

Customer PO:**Sales Rep:**

Sarah Jamieson

Received:

12/29/2025 09:00

Reported:**Positive Hits Summary**

(Continued)

Lab ID	Client ID					Sampled
AD46401-13	TE-Rm65-PCB007A					12/17/25 00:00
Method	Analyte	Result	Qualifier	Unit	Analyzed	
SW846-8082A	Aroclor-1260	0.65		mg/kg	12/31/2025	19:13
SW846-8082A	Aroclor-1254	3.6		mg/kg	12/31/2025	19:13
SW846-8082A	Aroclor-1242	4.8		mg/kg	12/31/2025	19:13
Lab ID	Client ID					Sampled
AD46401-14	TE-Rm65-PCB007B					12/17/25 00:00
Method	Analyte	Result	Qualifier	Unit	Analyzed	
SW846-8082A	Aroclor-1254	0.90		mg/kg	12/31/2025	15:15
SW846-8082A	Aroclor-1242	2.2		mg/kg	12/31/2025	15:15
Lab ID	Client ID					Sampled
AD46401-15	TE-Rm67-PCB008A					12/16/25 00:00
Method	Analyte	Result	Qualifier	Unit	Analyzed	
SW846-8082A	Aroclor-1254	2.5		mg/kg	12/31/2025	19:34
SW846-8082A	Aroclor-1242	4.5		mg/kg	12/31/2025	19:34
Lab ID	Client ID					Sampled
AD46401-16	TE-Rm50-PCB008B					12/17/25 00:00
Method	Analyte	Result	Qualifier	Unit	Analyzed	
SW846-8082A	Aroclor-1254	0.49		mg/kg	12/31/2025	19:56
SW846-8082A	Aroclor-1242	1.4		mg/kg	12/31/2025	19:56
Lab ID	Client ID					Sampled
AD46401-17	TE-Rm66-PCB009A					12/16/25 00:00
Method	Analyte	Result	Qualifier	Unit	Analyzed	
SW846-8082A	Aroclor-1242	3.0		mg/kg	12/31/2025	20:18
SW846-8082A	Aroclor-1254	3.0		mg/kg	12/31/2025	20:18
Lab ID	Client ID					Sampled
AD46401-18	TE-Rm66-PCB009B					12/16/25 00:00
Method	Analyte	Result	Qualifier	Unit	Analyzed	
SW846-8082A	Aroclor-1254	2.3		mg/kg	12/31/2025	20:40
SW846-8082A	Aroclor-1242	2.5		mg/kg	12/31/2025	20:40

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax:cs@emsl.com
EMSL-CIN-01

Table of Contents

EMSL Order ID: 012340401

LIMS Reference ID: AD46401

EMSL Customer ID: WSPN36

Attention: AP

WSP Canada, Inc. [WSPN36]
36 Pippy Place
Saint John's, NL A1B 4A5
(709) 722-7023
capayablesinvoice@wsp.com

Project Name: CA0037087.2445-NAVFAC Paint Sampling**Project ID:** _Master Project-WSPN36**Customer PO:****Sales Rep:** Sarah Jamieson**Received:** 12/29/2025 09:00**Reported:****Positive Hits Summary
(Continued)**

Lab ID	Client ID					Sampled
AD46401-19	TE-Rm64-PCB010A					12/16/25 00:00
Method	Analyte	Result	Qualifier	Unit	Analyzed	
SW846-8082A	Aroclor-1254	0.77		mg/kg	12/31/2025	21:02
SW846-8082A	Aroclor-1242	1.1		mg/kg	12/31/2025	21:02
Lab ID	Client ID					Sampled
AD46401-20	TE-Rm64-PCB010B					12/17/25 00:00
Method	Analyte	Result	Qualifier	Unit	Analyzed	
SW846-8082A	Aroclor-1254	1.2		mg/kg	12/31/2025	21:24
SW846-8082A	Aroclor-1242	1.5		mg/kg	12/31/2025	21:24
Lab ID	Client ID					Sampled
AD46401-21	TE-Rm68-PCB011A					12/16/25 00:00
Method	Analyte	Result	Qualifier	Unit	Analyzed	
SW846-8082A	Aroclor-1242	2.6		mg/kg	12/31/2025	15:37
SW846-8082A	Aroclor-1254	3.8		mg/kg	12/31/2025	15:37
Lab ID	Client ID					Sampled
AD46401-22	TE-Rm68-PCB011B					12/17/25 00:00
Method	Analyte	Result	Qualifier	Unit	Analyzed	
SW846-8082A	Aroclor-1242	1.0		mg/kg	12/31/2025	15:59
SW846-8082A	Aroclor-1254	1.3		mg/kg	12/31/2025	15:59
Lab ID	Client ID					Sampled
AD46401-23	TE-Rm69-PCB012A					12/16/25 00:00
Method	Analyte	Result	Qualifier	Unit	Analyzed	
SW846-8082A	Aroclor-1254	17	D	mg/kg	01/02/2026	12:57
Lab ID	Client ID					Sampled
AD46401-24	TE-Rm53-PCB012B					12/16/25 00:00
Method	Analyte	Result	Qualifier	Unit	Analyzed	
SW846-8082A	Aroclor-1242	4.3		mg/kg	12/31/2025	16:43
SW846-8082A	Aroclor-1254	5.3		mg/kg	12/31/2025	16:43

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax:cs@emsl.com
EMSL-CIN-01

Table of Contents**EMSL Order ID:** 012340401**LIMS Reference ID:** AD46401**EMSL Customer ID:** WSPN36**Attention:** AP

WSP Canada, Inc. [WSPN36]
36 Pippy Place

Saint John's, NL A1B 4A5
(709) 722-7023

capayablesinvoice@wsp.com

Project Name:

CA0037087.2445-NAVFAC Paint Sampling

Project ID:

_Master Project-WSPN36

Customer PO:**Sales Rep:**

Sarah Jamieson

Received:

12/29/2025 09:00

Reported:**Positive Hits Summary****(Continued)**

Lab ID	Client ID					Sampled
AD46401-25	TE-Rm69-PCB013A					12/16/25 00:00
Method	Analyte	Result	Qualifier	Unit	Analyzed	
SW846-8082A	Aroclor-1242	0.52		mg/kg	12/31/2025	17:05
SW846-8082A	Aroclor-1254	1.3		mg/kg	12/31/2025	17:05
Lab ID	Client ID					Sampled
AD46401-26	TE-Rm69-PCB013B					12/17/25 00:00
Method	Analyte	Result	Qualifier	Unit	Analyzed	
SW846-8082A	Aroclor-1242	0.43		mg/kg	12/31/2025	17:26
SW846-8082A	Aroclor-1254	1.0		mg/kg	12/31/2025	17:26
Lab ID	Client ID					Sampled
AD46401-27	TE-Rm73-PCB014A					12/16/25 00:00
Method	Analyte	Result	Qualifier	Unit	Analyzed	
SW846-8082A	Aroclor-1242	3.1		mg/kg	12/31/2025	18:09
SW846-8082A	Aroclor-1254	4.2		mg/kg	12/31/2025	18:09
Lab ID	Client ID					Sampled
AD46401-28	TE-Rm73-PCB014B					12/17/25 00:00
Method	Analyte	Result	Qualifier	Unit	Analyzed	
SW846-8082A	Aroclor-1242	4.0		mg/kg	12/31/2025	18:31
SW846-8082A	Aroclor-1254	4.8		mg/kg	12/31/2025	18:31
Lab ID	Client ID					Sampled
AD46401-29	TE-Rm53-PCB015A					12/16/25 00:00
Method	Analyte	Result	Qualifier	Unit	Analyzed	
SW846-8082A	Aroclor-1254	2.8		mg/kg	12/31/2025	18:53
SW846-8082A	Aroclor-1242	4.7		mg/kg	12/31/2025	18:53
Lab ID	Client ID					Sampled
AD46401-30	TE-Rm72-PCB015B					12/16/25 00:00
Method	Analyte	Result	Qualifier	Unit	Analyzed	
SW846-8082A	Aroclor-1242	2.9		mg/kg	12/31/2025	21:46
SW846-8082A	Aroclor-1254	3.6		mg/kg	12/31/2025	21:46

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax:cs@emsl.com
EMSL-CIN-01

Table of Contents

EMSL Order ID: 012340401

LIMS Reference ID: AD46401

EMSL Customer ID: WSPN36

Attention: AP

WSP Canada, Inc. [WSPN36]
36 Pippy Place

Saint John's, NL A1B 4A5
(709) 722-7023

capayablesinvoice@wsp.com

Project Name:

CA0037087.2445-NAVFAC Paint Sampling

Project ID:

_Master Project-WSPN36

Customer PO:**Sales Rep:**

Sarah Jamieson

Received:

12/29/2025 09:00

Reported:**Positive Hits Summary**

(Continued)

Lab ID	Client ID					Sampled
AD46401-31	TE-Rm74-PCB016A					12/16/25 00:00
Method	Analyte	Result	Qualifier	Unit	Analyzed	
SW846-8082A	Aroclor-1254	11	D	mg/kg	01/02/2026	13:20
SW846-8082A	Aroclor-1242	3.8	D	mg/kg	01/02/2026	13:20
SW846-8082A	Aroclor-1260	5.7	D	mg/kg	01/02/2026	13:20
Lab ID	Client ID					Sampled
AD46401-32	TE-Rm74-PCB016B					12/17/25 00:00
Method	Analyte	Result	Qualifier	Unit	Analyzed	
SW846-8082A	Aroclor-1254	12	D	mg/kg	01/02/2026	13:41
SW846-8082A	Aroclor-1260	2.0	D	mg/kg	01/02/2026	13:41
SW846-8082A	Aroclor-1242	4.2	D	mg/kg	01/02/2026	13:41
Lab ID	Client ID					Sampled
AD46401-33	TE-Rm57-PCB017A					12/16/25 00:00
Method	Analyte	Result	Qualifier	Unit	Analyzed	
SW846-8082A	Aroclor-1242	1.4		mg/kg	12/31/2025	19:59
SW846-8082A	Aroclor-1254	2.6		mg/kg	12/31/2025	19:59
Lab ID	Client ID					Sampled
AD46401-34	TE-Rm21-PCB017B					12/16/25 00:00
Method	Analyte	Result	Qualifier	Unit	Analyzed	
SW846-8082A	Aroclor-1260	0.87		mg/kg	12/31/2025	20:20
SW846-8082A	Aroclor-1242	5.0		mg/kg	12/31/2025	20:20
SW846-8082A	Aroclor-1254	6.7		mg/kg	12/31/2025	20:20
Lab ID	Client ID					Sampled
AD46401-35	TE-Rm40-PCB018A					12/17/25 00:00
Method	Analyte	Result	Qualifier	Unit	Analyzed	
SW846-8082A	Aroclor-1260	1.2		mg/kg	12/31/2025	20:42
SW846-8082A	Aroclor-1232	2.3		mg/kg	12/31/2025	20:42
SW846-8082A	Aroclor-1254	6.7		mg/kg	12/31/2025	20:42
Lab ID	Client ID					Sampled
AD46401-36	TE-Rm40-PCB018B					12/17/25 00:00
Method	Analyte	Result	Qualifier	Unit	Analyzed	

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax:cs@emsl.com
EMSL-CIN-01

Table of Contents**EMSL Order ID:** 012340401**LIMS Reference ID:** AD46401**EMSL Customer ID:** WSPN36**Attention:** AP

WSP Canada, Inc. [WSPN36]
36 Pippy Place

Saint John's, NL A1B 4A5
(709) 722-7023

capayablesinvoice@wsp.com

Project Name:

CA0037087.2445-NAVFAC Paint Sampling

Project ID:

_Master Project-WSPN36

Customer PO:**Sales Rep:**

Sarah Jamieson

Received:

12/29/2025 09:00

Reported:**Positive Hits Summary****(Continued)**

Lab ID	Client ID					Sampled
AD46401-36	TE-Rm40-PCB018B					12/17/25 00:00
Method	Analyte	Result	Qualifier	Unit	Analyzed	
SW846-8082A	Aroclor-1260	1.0		mg/kg	12/31/2025	21:03
SW846-8082A	Aroclor-1232	2.1		mg/kg	12/31/2025	21:03
SW846-8082A	Aroclor-1254	5.2		mg/kg	12/31/2025	21:03
Lab ID	Client ID					Sampled
AD46401-37	TE-Rm25-PCB019A					12/17/25 00:00
Method	Analyte	Result	Qualifier	Unit	Analyzed	
SW846-8082A	Aroclor-1260	1.3	D	mg/kg	01/02/2026	14:04
SW846-8082A	Aroclor-1254	7.0	D	mg/kg	01/02/2026	14:04
Lab ID	Client ID					Sampled
AD46401-38	TE-Rm23-PCB019B					12/17/25 00:00
Method	Analyte	Result	Qualifier	Unit	Analyzed	
SW846-8082A	Aroclor-1254	11	D	mg/kg	01/02/2026	13:19
SW846-8082A	Aroclor-1260	3.2	D	mg/kg	01/02/2026	13:19
Lab ID	Client ID					Sampled
AD46401-42	TE-Ext-PCB021B					12/17/25 00:00
Method	Analyte	Result	Qualifier	Unit	Analyzed	
SW846-8082A	Aroclor-1254	0.32		mg/kg	12/31/2025	22:29
Lab ID	Client ID					Sampled
AD46401-46	TE-Ext-PCB023B					12/18/25 00:00
Method	Analyte	Result	Qualifier	Unit	Analyzed	
SW846-8082A	Aroclor-1260	1.7		mg/kg	01/05/2026	15:36
Lab ID	Client ID					Sampled
AD46401-47	TE-Rm73-PCB024A					12/18/25 00:00
Method	Analyte	Result	Qualifier	Unit	Analyzed	
SW846-8082A	Aroclor-1242	4.2	D	mg/kg	01/05/2026	22:22
SW846-8082A	Aroclor-1254	4.4	D	mg/kg	01/05/2026	22:22

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax:cs@emsl.com
EMSL-CIN-01

Table of Contents**EMSL Order ID:** 012340401**LIMS Reference ID:** AD46401**EMSL Customer ID:** WSPN36**Attention:** AP

WSP Canada, Inc. [WSPN36]
36 Pippy Place

Saint John's, NL A1B 4A5
(709) 722-7023

capayablesinvoice@wsp.com

Project Name:

CA0037087.2445-NAVFAC Paint Sampling

Project ID:

_Master Project-WSPN36

Customer PO:**Sales Rep:**

Sarah Jamieson

Received:

12/29/2025 09:00

Reported:**Positive Hits Summary**
(Continued)

Lab ID	Client ID					Sampled
AD46401-48	TE-Rm63-PCB024B					12/18/25 00:00
Method	Analyte	Result	Qualifier	Unit	Analyzed	
SW846-8082A	Aroclor-1242	5.1	D	mg/kg	01/06/2026	11:21
SW846-8082A	Aroclor-1254	8.1	D	mg/kg	01/06/2026	11:21
Lab ID	Client ID					Sampled
AD46401-49	TE-Rm63-PCB025A					12/18/25 00:00
Method	Analyte	Result	Qualifier	Unit	Analyzed	
SW846-8082A	Aroclor-1254	3.8		mg/kg	01/02/2026	19:30
SW846-8082A	Aroclor-1242	4.7		mg/kg	01/02/2026	19:30
Lab ID	Client ID					Sampled
AD46401-50	TE-Rm15-PCB025B					12/18/25 00:00
Method	Analyte	Result	Qualifier	Unit	Analyzed	
SW846-8082A	Aroclor-1254	10	D	mg/kg	01/06/2026	11:43
SW846-8082A	Aroclor-1242	8.5	D	mg/kg	01/06/2026	11:43
Lab ID	Client ID					Sampled
AD46401-51	TE-Rm27-PCB026A					12/18/25 00:00
Method	Analyte	Result	Qualifier	Unit	Analyzed	
SW846-8082A	Aroclor-1242	6.0		mg/kg	01/02/2026	19:52
SW846-8082A	Aroclor-1254	7.0		mg/kg	01/02/2026	19:52
Lab ID	Client ID					Sampled
AD46401-52	TE-Rm30-PCB026B					12/18/25 00:00
Method	Analyte	Result	Qualifier	Unit	Analyzed	
SW846-8082A	Aroclor-1254	8.5		mg/kg	01/02/2026	20:14
Lab ID	Client ID					Sampled
AD46401-53	TE-Rm47-PCB027A					12/18/25 00:00
Method	Analyte	Result	Qualifier	Unit	Analyzed	
SW846-8082A	Aroclor-1242	5.2	D	mg/kg	01/06/2026	12:04
SW846-8082A	Aroclor-1254	6.4	D	mg/kg	01/06/2026	12:04

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax:cs@emsl.com
EMSL-CIN-01

Table of Contents

EMSL Order ID: 012340401

LIMS Reference ID: AD46401

EMSL Customer ID: WSPN36

Attention: AP

WSP Canada, Inc. [WSPN36]
36 Pippy Place

Saint John's, NL A1B 4A5
(709) 722-7023

capayablesinvoice@wsp.com

Project Name:

CA0037087.2445-NAVFAC Paint Sampling

Project ID:

_Master Project-WSPN36

Customer PO:**Sales Rep:**

Sarah Jamieson

Received:

12/29/2025 09:00

Reported:**Positive Hits Summary**

(Continued)

Lab ID	Client ID					Sampled
AD46401-54	TE-Rm47-PCB027B					12/18/25 00:00
Method	Analyte	Result	Qualifier	Unit	Analyzed	
SW846-8082A	Aroclor-1242	4.3	D	mg/kg	01/06/2026	12:26
SW846-8082A	Aroclor-1254	6.3	D	mg/kg	01/06/2026	12:26
Lab ID	Client ID					Sampled
AD46401-55	TE-Rm52-PCB028A					12/18/25 00:00
Method	Analyte	Result	Qualifier	Unit	Analyzed	
SW846-8082A	Aroclor-1254	4.6		mg/kg	01/02/2026	20:36
Lab ID	Client ID					Sampled
AD46401-56	TE-Rm52-PCB028B					12/18/25 00:00
Method	Analyte	Result	Qualifier	Unit	Analyzed	
SW846-8082A	Aroclor-1260	1.8		mg/kg	01/02/2026	20:57
SW846-8082A	Aroclor-1242	2.3		mg/kg	01/02/2026	20:57
SW846-8082A	Aroclor-1254	3.7		mg/kg	01/02/2026	20:57
Lab ID	Client ID					Sampled
AD46401-57	TE-Rm52-PCB029A					12/18/25 00:00
Method	Analyte	Result	Qualifier	Unit	Analyzed	
SW846-8082A	Aroclor-1260	2.5	D	mg/kg	01/06/2026	13:10
SW846-8082A	Aroclor-1242	5.0	D	mg/kg	01/06/2026	13:10
SW846-8082A	Aroclor-1254	9.2	D	mg/kg	01/06/2026	13:10
Lab ID	Client ID					Sampled
AD46401-58	TE-Rm52-PCB029B					12/18/25 00:00
Method	Analyte	Result	Qualifier	Unit	Analyzed	
SW846-8082A	Aroclor-1242	4.2	D	mg/kg	01/06/2026	12:48
SW846-8082A	Aroclor-1260	5.0	D	mg/kg	01/06/2026	12:48
SW846-8082A	Aroclor-1254	6.7	D	mg/kg	01/06/2026	12:48
Lab ID	Client ID					Sampled
AD46401-59	TE-Rm51-PCB030A					12/18/25 00:00
Method	Analyte	Result	Qualifier	Unit	Analyzed	
SW846-8082A	Aroclor-1254	4.5		mg/kg	01/05/2026	19:05
SW846-8082A	Aroclor-1242	4.7		mg/kg	01/05/2026	19:05

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax:cs@emsl.com
EMSL-CIN-01

Table of Contents

EMSL Order ID: 012340401

LIMS Reference ID: AD46401

EMSL Customer ID: WSPN36

Attention: AP

WSP Canada, Inc. [WSPN36]
36 Pippy Place

Saint John's, NL A1B 4A5
(709) 722-7023

capayablesinvoice@wsp.com

Project Name:

CA0037087.2445-NAVFAC Paint Sampling

Project ID:

_Master Project-WSPN36

Customer PO:**Sales Rep:**

Sarah Jamieson

Received:

12/29/2025 09:00

Reported:**Positive Hits Summary**
(Continued)

Lab ID	Client ID					Sampled
AD46401-60	TE-Rm51-PCB030B					12/18/25 00:00
Method	Analyte	Result	Qualifier	Unit	Analyzed	
SW846-8082A	Aroclor-1254	4.8		mg/kg	01/05/2026	19:27
SW846-8082A	Aroclor-1242	7.9		mg/kg	01/05/2026	19:27
Lab ID	Client ID					Sampled
AD46401-61	TE-Rm45-PCB031A					12/19/25 00:00
Method	Analyte	Result	Qualifier	Unit	Analyzed	
SW846-8082A	Aroclor-1254	0.83		mg/kg	01/05/2026	20:11
SW846-8082A	Aroclor-1242	0.88		mg/kg	01/05/2026	20:11
Lab ID	Client ID					Sampled
AD46401-62	TE-Rm63-PCB031B					12/19/25 00:00
Method	Analyte	Result	Qualifier	Unit	Analyzed	
SW846-8082A	Aroclor-1254	2.6		mg/kg	01/05/2026	20:33
SW846-8082A	Aroclor-1242	2.9		mg/kg	01/05/2026	20:33
Lab ID	Client ID					Sampled
AD46401-63	TE-Rm51-PCB032A					12/19/25 00:00
Method	Analyte	Result	Qualifier	Unit	Analyzed	
SW846-8082A	Aroclor-1242	1.7		mg/kg	01/06/2026	12:57
SW846-8082A	Aroclor-1254	2.9		mg/kg	01/06/2026	12:57
Lab ID	Client ID					Sampled
AD46401-64	TE-Rm71-PCB032B					12/19/25 00:00
Method	Analyte	Result	Qualifier	Unit	Analyzed	
SW846-8082A	Aroclor-1242	2.6	D	mg/kg	01/06/2026	14:05
SW846-8082A	Aroclor-1254	6.3	D	mg/kg	01/06/2026	14:05
Lab ID	Client ID					Sampled
AD46401-65	TE-Rm51-PCB033A					12/19/25 00:00
Method	Analyte	Result	Qualifier	Unit	Analyzed	
SW846-8082A	Aroclor-1260	1.2		mg/kg	01/06/2026	13:42
SW846-8082A	Aroclor-1242	2.2		mg/kg	01/06/2026	13:42
SW846-8082A	Aroclor-1254	3.2		mg/kg	01/06/2026	13:42

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax:cs@emsl.com
EMSL-CIN-01

Table of Contents**EMSL Order ID:** 012340401**LIMS Reference ID:** AD46401**EMSL Customer ID:** WSPN36**Attention:** AP

WSP Canada, Inc. [WSPN36]
36 Pippy Place
Saint John's, NL A1B 4A5
(709) 722-7023
capayablesinvoice@wsp.com

Project Name: CA0037087.2445-NAVFAC Paint Sampling**Project ID:** _Master Project-WSPN36**Customer PO:****Sales Rep:** Sarah Jamieson**Received:** 12/29/2025 09:00**Reported:****Positive Hits Summary
(Continued)**

Lab ID	Client ID					Sampled
AD46401-66	TE-Rm27-PCB033B					12/19/25 00:00
Method	Analyte	Result	Qualifier	Unit	Analyzed	
SW846-8082A	Aroclor-1242	1.9		mg/kg	01/06/2026	14:34
SW846-8082A	Aroclor-1254	7.3		mg/kg	01/06/2026	14:34
Lab ID	Client ID					Sampled
AD46401-67	GB-Rm1-PCB001A					12/09/25 00:00
Method	Analyte	Result	Qualifier	Unit	Analyzed	
SW846-8082A	Aroclor-1254	17	D	mg/kg	01/07/2026	15:18
SW846-8082A	Aroclor-1260	3.8	D	mg/kg	01/07/2026	15:18
Lab ID	Client ID					Sampled
AD46401-68	GB-Rm10-PCB001B					12/09/25 00:00
Method	Analyte	Result	Qualifier	Unit	Analyzed	
SW846-8082A	Aroclor-1262	0.90		mg/kg	01/07/2026	15:39
SW846-8082A	Aroclor-1254	3.7		mg/kg	01/07/2026	15:39
Lab ID	Client ID					Sampled
AD46401-69	GB-Rm6-PCB002A					12/09/25 00:00
Method	Analyte	Result	Qualifier	Unit	Analyzed	
SW846-8082A	Aroclor-1254	2.3		mg/kg	01/02/2026	21:41
Lab ID	Client ID					Sampled
AD46401-70	GB-Rm9-PCB002B					12/09/25 00:00
Method	Analyte	Result	Qualifier	Unit	Analyzed	
SW846-8082A	Aroclor-1254	3.2		mg/kg	01/07/2026	16:01
Lab ID	Client ID					Sampled
AD46401-71	GB-Rm5-PCB003A					12/09/25 00:00
Method	Analyte	Result	Qualifier	Unit	Analyzed	
SW846-8082A	Aroclor-1254	1.3		mg/kg	01/07/2026	16:23
Lab ID	Client ID					Sampled
AD46401-72	GB-Rm5-PCB003B					12/09/25 00:00
Method	Analyte	Result	Qualifier	Unit	Analyzed	
SW846-8082A	Aroclor-1254	0.91		mg/kg	01/07/2026	16:45

EMSL maintains liability limited to cost of analysis. Interpretation and use of test results are the responsibility of the client. This report relates only to the samples reported above, and may not be reproduced, except in full, without written approval by EMSL. EMSL bears no responsibility for sample collection activities or analytical method limitations. The report reflects the samples as received. Results are generated from the field sampling data (sampling volumes and areas, locations, etc.) provided by the client on the Chain of Custody. Samples are within quality control criteria and met method specifications unless otherwise noted.

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax:cs@emsl.com
EMSL-CIN-01

EMSL Order ID: 012340401

LIMS Reference ID: AD46401

EMSL Customer ID: WSPN36

Attention: AP

WSP Canada, Inc. [WSPN36]
36 Pippy Place
Saint John's, NL A1B 4A5
(709) 722-7023
capayablesinvoice@wsp.com

Project Name: CA0037087.2445-NAVFAC Paint Sampling**Project ID:** _Master Project-WSPN36**Customer PO:****Sales Rep:** Sarah Jamieson**Received:** 12/29/2025 09:00**Reported:****Positive Hits Summary**
(Continued)

Lab ID	Client ID					Sampled
AD46401-73	GB-Rm1-PCB004A					12/09/25 00:00
Method	Analyte	Result	Qualifier	Unit	Analyzed	
SW846-8082A	Aroclor-1254	2.9		mg/kg	01/07/2026 17:07	
Lab ID	Client ID					Sampled
AD46401-74	GB-Rm1-PCB004B					12/09/25 00:00
Method	Analyte	Result	Qualifier	Unit	Analyzed	
SW846-8082A	Aroclor-1254	2.2		mg/kg	01/07/2026 17:29	
Lab ID	Client ID					Sampled
AD46401-75	GB-Rm1-PCB005A					12/09/25 00:00
Method	Analyte	Result	Qualifier	Unit	Analyzed	
SW846-8082A	Aroclor-1254	15		mg/kg	01/07/2026 17:51	
Lab ID	Client ID					Sampled
AD46401-76	GB-Rm1-PCB005B					12/09/25 00:00
Method	Analyte	Result	Qualifier	Unit	Analyzed	
SW846-8082A	Aroclor-1254	15		mg/kg	01/07/2026 18:13	
Lab ID	Client ID					Sampled
AD46401-77	GB-Rm4-PCB006A					12/12/25 00:00
Method	Analyte	Result	Qualifier	Unit	Analyzed	
SW846-8082A	Aroclor-1254	4.5		mg/kg	01/07/2026 18:34	
Lab ID	Client ID					Sampled
AD46401-78	GB-Rm4-PCB006B					12/12/25 00:00
Method	Analyte	Result	Qualifier	Unit	Analyzed	
SW846-8082A	Aroclor-1260	0.85		mg/kg	01/07/2026 18:56	
SW846-8082A	Aroclor-1254	5.0		mg/kg	01/07/2026 18:56	
Lab ID	Client ID					Sampled
AD46401-79	GB-Rm4-PCB007A					12/12/25 00:00
Method	Analyte	Result	Qualifier	Unit	Analyzed	
SW846-8082A	Aroclor-1254	4.8		mg/kg	01/07/2026 20:45	

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax:cs@emsl.com
EMSL-CIN-01

Table of Contents**EMSL Order ID:** 012340401**LIMS Reference ID:** AD46401**EMSL Customer ID:** WSPN36**Attention:** AP

WSP Canada, Inc. [WSPN36]
36 Pippy Place

Saint John's, NL A1B 4A5
(709) 722-7023

capayablesinvoice@wsp.com

Project Name:

CA0037087.2445-NAVFAC Paint Sampling

Project ID:

_Master Project-WSPN36

Customer PO:**Sales Rep:**

Sarah Jamieson

Received:

12/29/2025 09:00

Reported:**Positive Hits Summary****(Continued)**

Lab ID	Client ID					Sampled
AD46401-80	GB-Rm12-PCB007B					12/12/25 00:00
Method	Analyte	Result	Qualifier	Unit	Analyzed	
SW846-8082A	Aroclor-1254	6.2		mg/kg	01/07/2026 21:07	
Lab ID	Client ID					Sampled
AD46401-81	GB-Rm10-PCB008A					12/12/25 00:00
Method	Analyte	Result	Qualifier	Unit	Analyzed	
SW846-8082A	Aroclor-1262	0.51		mg/kg	01/07/2026 21:29	
SW846-8082A	Aroclor-1254	2.5		mg/kg	01/07/2026 21:29	
Lab ID	Client ID					Sampled
AD46401-82	GB-Rm10-PCB008B					12/12/25 00:00
Method	Analyte	Result	Qualifier	Unit	Analyzed	
SW846-8082A	Aroclor-1262	0.48		mg/kg	01/07/2026 21:51	
SW846-8082A	Aroclor-1254	2.1		mg/kg	01/07/2026 21:51	
Lab ID	Client ID					Sampled
AD46401-83	GB-Rm10-PCB009A					12/12/25 00:00
Method	Analyte	Result	Qualifier	Unit	Analyzed	
SW846-8082A	Aroclor-1254	0.95		mg/kg	01/08/2026 12:02	
Lab ID	Client ID					Sampled
AD46401-84	GB-Rm10-PCB009B					12/12/25 00:00
Method	Analyte	Result	Qualifier	Unit	Analyzed	
SW846-8082A	Aroclor-1254	1.1		mg/kg	01/08/2026 12:24	
Lab ID	Client ID					Sampled
AD46401-85	GB-Rm10-PCB010A					12/12/25 00:00
Method	Analyte	Result	Qualifier	Unit	Analyzed	
SW846-8082A	Aroclor-1268	0.43		mg/kg	01/07/2026 19:18	
SW846-8082A	Aroclor-1254	2.4		mg/kg	01/07/2026 19:18	
Lab ID	Client ID					Sampled
AD46401-86	GB-Rm10-PCB010B					12/12/25 00:00
Method	Analyte	Result	Qualifier	Unit	Analyzed	
SW846-8082A	Aroclor-1268	0.61		mg/kg	01/07/2026 19:40	

EMSL maintains liability limited to cost of analysis. Interpretation and use of test results are the responsibility of the client. This report relates only to the samples reported above, and may not be reproduced, except in full, without written approval by EMSL. EMSL bears no responsibility for sample collection activities or analytical method limitations. The report reflects the samples as received. Results are generated from the field sampling data (sampling volumes and areas, locations, etc.) provided by the client on the Chain of Custody. Samples are within quality control criteria and met method specifications unless otherwise noted.

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax:cs@emsl.com
EMSL-CIN-01

Table of Contents**EMSL Order ID:** 012340401**LIMS Reference ID:** AD46401**EMSL Customer ID:** WSPN36**Attention:** AP

WSP Canada, Inc. [WSPN36]
36 Pippy Place
Saint John's, NL A1B 4A5
(709) 722-7023
capayablesinvoice@wsp.com

Project Name:

CA0037087.2445-NAVFAC Paint Sampling

Project ID:

_Master Project-WSPN36

Customer PO:**Sales Rep:**

Sarah Jamieson

Received:

12/29/2025 09:00

Reported:**Positive Hits Summary**
(Continued)

Lab ID	Client ID					Sampled
AD46401-86	GB-Rm10-PCB010B					12/12/25 00:00
Method	Analyte	Result	Qualifier	Unit	Analyzed	
SW846-8082A	Aroclor-1254	6.1		mg/kg	01/07/2026 19:40	
Lab ID	Client ID					Sampled
AD46401-87	GB-Rm2-PCB011A					12/12/25 00:00
Method	Analyte	Result	Qualifier	Unit	Analyzed	
SW846-8082A	Aroclor-1254	0.67		mg/kg	01/07/2026 20:02	
Lab ID	Client ID					Sampled
AD46401-88	GB-Rm2-PCB011B					12/12/25 00:00
Method	Analyte	Result	Qualifier	Unit	Analyzed	
SW846-8082A	Aroclor-1260	0.32		mg/kg	01/06/2026 17:31	
SW846-8082A	Aroclor-1242	0.71		mg/kg	01/06/2026 17:31	
SW846-8082A	Aroclor-1254	0.92		mg/kg	01/06/2026 17:31	
Lab ID	Client ID					Sampled
AD46401-89	GB-Rm4-PCB012A					12/15/25 00:00
Method	Analyte	Result	Qualifier	Unit	Analyzed	
SW846-8082A	Aroclor-1260	11	D	mg/kg	01/07/2026 17:18	
SW846-8082A	Aroclor-1254	60	D	mg/kg	01/07/2026 17:18	
Lab ID	Client ID					Sampled
AD46401-90	GB-Rm4-PCB012B					12/15/25 00:00
Method	Analyte	Result	Qualifier	Unit	Analyzed	
SW846-8082A	Aroclor-1260	10	D	mg/kg	01/07/2026 17:40	
SW846-8082A	Aroclor-1254	58	D	mg/kg	01/07/2026 17:40	
Lab ID	Client ID					Sampled
AD46401-91	GB-Rm14-PCB013A					12/15/25 00:00
Method	Analyte	Result	Qualifier	Unit	Analyzed	
SW846-8082A	Aroclor-1254	1.0		mg/kg	01/06/2026 18:36	
Lab ID	Client ID					Sampled
AD46401-92	GB-Rm14-PCB013B					12/15/25 00:00
Method	Analyte	Result	Qualifier	Unit	Analyzed	

EMSL maintains liability limited to cost of analysis. Interpretation and use of test results are the responsibility of the client. This report relates only to the samples reported above, and may not be reproduced, except in full, without written approval by EMSL. EMSL bears no responsibility for sample collection activities or analytical method limitations. The report reflects the samples as received. Results are generated from the field sampling data (sampling volumes and areas, locations, etc.) provided by the client on the Chain of Custody. Samples are within quality control criteria and met method specifications unless otherwise noted.

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax:cs@emsl.com
EMSL-CIN-01

Table of Contents**EMSL Order ID:** 012340401**LIMS Reference ID:** AD46401**EMSL Customer ID:** WSPN36**Attention:** AP

WSP Canada, Inc. [WSPN36]
36 Pippy Place
Saint John's, NL A1B 4A5
(709) 722-7023
capayablesinvoice@wsp.com

Project Name: CA0037087.2445-NAVFAC Paint Sampling**Project ID:** _Master Project-WSPN36**Customer PO:****Sales Rep:** Sarah Jamieson**Received:** 12/29/2025 09:00**Reported:****Positive Hits Summary**
(Continued)

Lab ID	Client ID					Sampled
AD46401-92	GB-Rm14-PCB013B					12/15/25 00:00
Method	Analyte	Result	Qualifier	Unit	Analyzed	
SW846-8082A	Aroclor-1254	1.4		mg/kg	01/06/2026 18:57	
Lab ID	Client ID					Sampled
AD46401-95	GB-Ext-PCB015A					12/15/25 00:00
Method	Analyte	Result	Qualifier	Unit	Analyzed	
SW846-8082A	Aroclor-1254	1.0		mg/kg	01/02/2026 22:03	

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax:cs@emsl.com
EMSL-CIN-01

Table of Contents**EMSL Order ID:** 012340401**LIMS Reference ID:** AD46401**EMSL Customer ID:** WSPN36**Attention:** AP

WSP Canada, Inc. [WSPN36]
36 Pippy Place
Saint John's, NL A1B 4A5
(709) 722-7023
capayablesinvoice@wsp.com

Project Name:

CA0037087.2445-NAVFAC Paint Sampling

Project ID:

_Master Project-WSPN36

Customer PO:**Sales Rep:**

Sarah Jamieson

Received:

12/29/2025 09:00

Reported:**Work Order Case Narrative**

Samples received outside of the required temperature range. Testing proceeded per client request.

Sample submitted in a container not specified by the method.

Report Version: #01 Report amended: 01/09/26 Replaces report from 01/08/26 Reason: Sample ID's updated

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
 Telephone: 856-858-4800 Fax:cs@emsl.com
 EMSL-CIN-01

EMSL Order ID: 012340401

LIMS Reference ID: AD46401

EMSL Customer ID: WSPN36

Attention: AP

WSP Canada, Inc. [WSPN36]
 36 Pippy Place
 Saint John's, NL A1B 4A5
 (709) 722-7023
 capayablesinvoice@wsp.com

Project Name:

CA0037087.2445-NAVFAC Paint Sampling

Project ID:

_Master Project-WSPN36

Customer PO:**Sales Rep:**

Sarah Jamieson

Received:

12/29/2025 09:00

Reported:**Sample Results**

Sample: TE-Rm52-PCB001A/TE Bldg. Room 52/Red flaking on concrete floor
AD46401-01 (Solid)

Analyte	Result	Q	DF	RL	Units	Prepared Date/Time	Analyzed Date/Time	Prep/Analyst Initials	Prep Method	Analytical Method
GC-SVOA										
Aroclor-1016	ND		1	0.24	mg/kg	12/30/25 15:40	12/31/25 14:32	MxB/TL1	SW846 3540C	SW846-8082A
Aroclor-1221	ND		1	0.24	mg/kg	12/30/25 15:40	12/31/25 14:32	MxB/TL1	SW846 3540C	SW846-8082A
Aroclor-1232	ND		1	0.24	mg/kg	12/30/25 15:40	12/31/25 14:32	MxB/TL1	SW846 3540C	SW846-8082A
Aroclor-1242	3.2		1	0.24	mg/kg	12/30/25 15:40	12/31/25 14:32	MxB/TL1	SW846 3540C	SW846-8082A
Aroclor-1248	ND		1	0.24	mg/kg	12/30/25 15:40	12/31/25 14:32	MxB/TL1	SW846 3540C	SW846-8082A
Aroclor-1254	4.0		1	0.24	mg/kg	12/30/25 15:40	12/31/25 14:32	MxB/TL1	SW846 3540C	SW846-8082A
Aroclor-1260	ND		1	0.24	mg/kg	12/30/25 15:40	12/31/25 14:32	MxB/TL1	SW846 3540C	SW846-8082A
Aroclor-1262	ND		1	0.24	mg/kg	12/30/25 15:40	12/31/25 14:32	MxB/TL1	SW846 3540C	SW846-8082A
Aroclor-1268	ND		1	0.24	mg/kg	12/30/25 15:40	12/31/25 14:32	MxB/TL1	SW846 3540C	SW846-8082A
Surrogate(s)	Recovery	Q	Limits							
<i>Surrogate: Tetrachloro-m-xylene</i>	64%		10-112			12/30/25 15:40	12/31/25 14:32	MxB/TL1	SW846 3540C	SW846-8082A
<i>Surrogate: Decachlorobiphenyl</i>	61%		10-123			12/30/25 15:40	12/31/25 14:32	MxB/TL1	SW846 3540C	SW846-8082A

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax:cs@emsl.com
EMSL-CIN-01

Table of Contents**EMSL Order ID:** 012340401**LIMS Reference ID:** AD46401**EMSL Customer ID:** WSPN36**Attention:** AP

WSP Canada, Inc. [WSPN36]
36 Pippy Place
Saint John's, NL A1B 4A5
(709) 722-7023
capayablesinvoice@wsp.com

Project Name:

CA0037087.2445-NAVFAC Paint Sampling

Project ID:

_Master Project-WSPN36

Customer PO:**Sales Rep:**

Sarah Jamieson

Received:

12/29/2025 09:00

Reported:**Sample Results****(Continued)**

Sample: TE-Rm52-PCB001B/TE Bldg. Room 52/Red flaking on concrete floor
AD46401-02 (Solid)

Analyte	Result	Q	DF	RL	Units	Prepared Date/Time	Analyzed Date/Time	Prep/Analyst Initials	Prep Method	Analytical Method
GC-SVOA										
Aroclor-1016	ND		1	0.24	mg/kg	12/30/25 13:04	12/31/25 15:12	NP2/TL1	SW846 3546	SW846-8082A
Aroclor-1221	ND		1	0.24	mg/kg	12/30/25 13:04	12/31/25 15:12	NP2/TL1	SW846 3546	SW846-8082A
Aroclor-1232	ND		1	0.24	mg/kg	12/30/25 13:04	12/31/25 15:12	NP2/TL1	SW846 3546	SW846-8082A
Aroclor-1242	2.4		1	0.24	mg/kg	12/30/25 13:04	12/31/25 15:12	NP2/TL1	SW846 3546	SW846-8082A
Aroclor-1248	ND		1	0.24	mg/kg	12/30/25 13:04	12/31/25 15:12	NP2/TL1	SW846 3546	SW846-8082A
Aroclor-1254	2.4		1	0.24	mg/kg	12/30/25 13:04	12/31/25 15:12	NP2/TL1	SW846 3546	SW846-8082A
Aroclor-1260	ND		1	0.24	mg/kg	12/30/25 13:04	12/31/25 15:12	NP2/TL1	SW846 3546	SW846-8082A
Aroclor-1262	ND		1	0.24	mg/kg	12/30/25 13:04	12/31/25 15:12	NP2/TL1	SW846 3546	SW846-8082A
Aroclor-1268	ND		1	0.24	mg/kg	12/30/25 13:04	12/31/25 15:12	NP2/TL1	SW846 3546	SW846-8082A
Surrogate(s)	Recovery	Q	Limits							
<i>Surrogate: Tetrachloro-m-xylene</i>	65%		10-112			12/30/25 13:04	12/31/25 15:12	NP2/TL1	SW846 3546	SW846-8082A
<i>Surrogate: Decachlorobiphenyl</i>	63%		10-123			12/30/25 13:04	12/31/25 15:12	NP2/TL1	SW846 3546	SW846-8082A

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax:cs@emsl.com
EMSL-CIN-01

Table of Contents**EMSL Order ID:** 012340401**LIMS Reference ID:** AD46401**EMSL Customer ID:** WSPN36**Attention:** AP

WSP Canada, Inc. [WSPN36]
36 Pippy Place
Saint John's, NL A1B 4A5
(709) 722-7023
capayablesinvoice@wsp.com

Project Name:

CA0037087.2445-NAVFAC Paint Sampling

Project ID:

_Master Project-WSPN36

Customer PO:**Sales Rep:**

Sarah Jamieson

Received:

12/29/2025 09:00

Reported:**Sample Results****(Continued)**

Sample: TE-Rm51-PCB002A/TE Bldg. Room 52/Light blue on drywall wall
AD46401-03 (Solid)

Analyte	Result	Q	DF	RL	Units	Prepared Date/Time	Analyzed Date/Time	Prep/Analyst Initials	Prep Method	Analytical Method
GC-SVOA										
Aroclor-1016	ND		1	0.24	mg/kg	12/30/25 15:40	12/31/25 14:53	MxB/TL1	SW846 3540C	SW846-8082A
Aroclor-1221	ND		1	0.24	mg/kg	12/30/25 15:40	12/31/25 14:53	MxB/TL1	SW846 3540C	SW846-8082A
Aroclor-1232	ND		1	0.24	mg/kg	12/30/25 15:40	12/31/25 14:53	MxB/TL1	SW846 3540C	SW846-8082A
Aroclor-1242	2.4		1	0.24	mg/kg	12/30/25 15:40	12/31/25 14:53	MxB/TL1	SW846 3540C	SW846-8082A
Aroclor-1248	ND		1	0.24	mg/kg	12/30/25 15:40	12/31/25 14:53	MxB/TL1	SW846 3540C	SW846-8082A
Aroclor-1254	4.2		1	0.24	mg/kg	12/30/25 15:40	12/31/25 14:53	MxB/TL1	SW846 3540C	SW846-8082A
Aroclor-1260	ND		1	0.24	mg/kg	12/30/25 15:40	12/31/25 14:53	MxB/TL1	SW846 3540C	SW846-8082A
Aroclor-1262	ND		1	0.24	mg/kg	12/30/25 15:40	12/31/25 14:53	MxB/TL1	SW846 3540C	SW846-8082A
Aroclor-1268	ND		1	0.24	mg/kg	12/30/25 15:40	12/31/25 14:53	MxB/TL1	SW846 3540C	SW846-8082A
Surrogate(s)	Recovery	Q	Limits							
<i>Surrogate: Tetrachloro-m-xylene</i>	91%		10-112			12/30/25 15:40	12/31/25 14:53	MxB/TL1	SW846 3540C	SW846-8082A
<i>Surrogate: Decachlorobiphenyl</i>	87%		10-123			12/30/25 15:40	12/31/25 14:53	MxB/TL1	SW846 3540C	SW846-8082A

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax:cs@emsl.com
EMSL-CIN-01

Table of Contents**EMSL Order ID:** 012340401**LIMS Reference ID:** AD46401**EMSL Customer ID:** WSPN36**Attention:** AP

WSP Canada, Inc. [WSPN36]
36 Pippy Place
Saint John's, NL A1B 4A5
(709) 722-7023
capayablesinvoice@wsp.com

Project Name:

CA0037087.2445-NAVFAC Paint Sampling

Project ID:

_Master Project-WSPN36

Customer PO:**Sales Rep:**

Sarah Jamieson

Received:

12/29/2025 09:00

Reported:**Sample Results****(Continued)**

Sample: TE-Rm42-PCB002B/TE Bldg. Room 52/Light blue on drywall wall
AD46401-04 (Solid)

Analyte	Result	Q	DF	RL	Units	Prepared Date/Time	Analyzed Date/Time	Prep/Analyst Initials	Prep Method	Analytical Method
GC-SVOA										
Aroclor-1016	ND		1	0.25	mg/kg	12/30/25 13:04	12/31/25 15:34	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1221	ND		1	0.25	mg/kg	12/30/25 13:04	12/31/25 15:34	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1232	ND		1	0.25	mg/kg	12/30/25 13:04	12/31/25 15:34	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1242	2.2		1	0.25	mg/kg	12/30/25 13:04	12/31/25 15:34	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1248	ND		1	0.25	mg/kg	12/30/25 13:04	12/31/25 15:34	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1254	1.1		1	0.25	mg/kg	12/30/25 13:04	12/31/25 15:34	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1260	ND		1	0.25	mg/kg	12/30/25 13:04	12/31/25 15:34	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1262	ND		1	0.25	mg/kg	12/30/25 13:04	12/31/25 15:34	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1268	ND		1	0.25	mg/kg	12/30/25 13:04	12/31/25 15:34	NP2/AxJ	SW846 3546	SW846-8082A
Surrogate(s)	Recovery	Q	Limits							
<i>Surrogate: Tetrachloro-m-xylene</i>	81%		10-112			12/30/25 13:04	12/31/25 15:34	NP2/AxJ	SW846 3546	SW846-8082A
<i>Surrogate: Decachlorobiphenyl</i>	80%		10-123			12/30/25 13:04	12/31/25 15:34	NP2/AxJ	SW846 3546	SW846-8082A

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax:cs@emsl.com
EMSL-CIN-01

Table of Contents**EMSL Order ID:** 012340401**LIMS Reference ID:** AD46401**EMSL Customer ID:** WSPN36**Attention:** AP

WSP Canada, Inc. [WSPN36]
36 Pippy Place
Saint John's, NL A1B 4A5
(709) 722-7023
capayablesinvoice@wsp.com

Project Name:

CA0037087.2445-NAVFAC Paint Sampling

Project ID:

_Master Project-WSPN36

Customer PO:**Sales Rep:**

Sarah Jamieson

Received:

12/29/2025 09:00

Reported:**Sample Results****(Continued)**

Sample: TE-Rm46-PCB003A/TE Bldg. Room 46/Light brown on drywall wall
AD46401-05 (Solid)

Analyte	Result	Q	DF	RL	Units	Prepared Date/Time	Analyzed Date/Time	Prep/Analyst Initials	Prep Method	Analytical Method
GC-SVOA										
Aroclor-1016	ND		1	0.25	mg/kg	12/30/25 13:04	12/31/25 15:56	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1221	ND		1	0.25	mg/kg	12/30/25 13:04	12/31/25 15:56	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1232	ND		1	0.25	mg/kg	12/30/25 13:04	12/31/25 15:56	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1242	3.8		1	0.25	mg/kg	12/30/25 13:04	12/31/25 15:56	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1248	ND		1	0.25	mg/kg	12/30/25 13:04	12/31/25 15:56	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1254	2.7		1	0.25	mg/kg	12/30/25 13:04	12/31/25 15:56	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1260	ND		1	0.25	mg/kg	12/30/25 13:04	12/31/25 15:56	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1262	ND		1	0.25	mg/kg	12/30/25 13:04	12/31/25 15:56	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1268	ND		1	0.25	mg/kg	12/30/25 13:04	12/31/25 15:56	NP2/AxJ	SW846 3546	SW846-8082A
Surrogate(s)	Recovery	Q		Limits						
<i>Surrogate: Tetrachloro-m-xylene</i>	82%			10-112		12/30/25 13:04	12/31/25 15:56	NP2/AxJ	SW846 3546	SW846-8082A
<i>Surrogate: Decachlorobiphenyl</i>	81%			10-123		12/30/25 13:04	12/31/25 15:56	NP2/AxJ	SW846 3546	SW846-8082A

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax:cs@emsl.com
EMSL-CIN-01

Table of Contents**EMSL Order ID:** 012340401**LIMS Reference ID:** AD46401**EMSL Customer ID:** WSPN36**Attention:** AP

WSP Canada, Inc. [WSPN36]
36 Pippy Place
Saint John's, NL A1B 4A5
(709) 722-7023
capayablesinvoice@wsp.com

Project Name:

CA0037087.2445-NAVFAC Paint Sampling

Project ID:

_Master Project-WSPN36

Customer PO:**Sales Rep:**

Sarah Jamieson

Received:

12/29/2025 09:00

Reported:**Sample Results****(Continued)**

Sample: TE-Rm46-PCB003B/TE Bldg. Room 40/Light brown on drywall wall
AD46401-06 (Solid)

Analyte	Result	Q	DF	RL	Units	Prepared Date/Time	Analyzed Date/Time	Prep/Analyst Initials	Prep Method	Analytical Method
GC-SVOA										
Aroclor-1016	ND	D	2	0.51	mg/kg	12/30/25 13:04	01/02/26 12:58	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1221	ND	D	2	0.51	mg/kg	12/30/25 13:04	01/02/26 12:58	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1232	ND	D	2	0.51	mg/kg	12/30/25 13:04	01/02/26 12:58	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1242	ND	D	2	0.51	mg/kg	12/30/25 13:04	01/02/26 12:58	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1248	ND	D	2	0.51	mg/kg	12/30/25 13:04	01/02/26 12:58	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1254	12	D	2	0.51	mg/kg	12/30/25 13:04	01/02/26 12:58	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1260	ND	D	2	0.51	mg/kg	12/30/25 13:04	01/02/26 12:58	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1262	ND	D	2	0.51	mg/kg	12/30/25 13:04	01/02/26 12:58	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1268	ND	D	2	0.51	mg/kg	12/30/25 13:04	01/02/26 12:58	NP2/AxJ	SW846 3546	SW846-8082A
Surrogate(s)	Recovery	Q	Limits							
<i>Surrogate: Tetrachloro-m-xylene</i>	77%		10-112			12/30/25 13:04	01/02/26 12:58	NP2/AxJ	SW846 3546	SW846-8082A
<i>Surrogate: Decachlorobiphenyl</i>	79%		10-123			12/30/25 13:04	01/02/26 12:58	NP2/AxJ	SW846 3546	SW846-8082A

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax:cs@emsl.com
EMSL-CIN-01

Table of Contents**EMSL Order ID:** 012340401**LIMS Reference ID:** AD46401**EMSL Customer ID:** WSPN36**Attention:** AP

WSP Canada, Inc. [WSPN36]
36 Pippy Place
Saint John's, NL A1B 4A5
(709) 722-7023
capayablesinvoice@wsp.com

Project Name:

CA0037087.2445-NAVFAC Paint Sampling

Project ID:

_Master Project-WSPN36

Customer PO:**Sales Rep:**

Sarah Jamieson

Received:

12/29/2025 09:00

Reported:**Sample Results****(Continued)**

Sample: TE-Rm43-PCB004A/TE Bldg. Room 43/Off-white on drywall wall
AD46401-07 (Solid)

Analyte	Result	Q	DF	RL	Units	Prepared Date/Time	Analyzed Date/Time	Prep/Analyst Initials	Prep Method	Analytical Method
GC-SVOA										
Aroclor-1016	ND		1	0.25	mg/kg	12/30/25 13:04	12/31/25 16:39	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1221	ND		1	0.25	mg/kg	12/30/25 13:04	12/31/25 16:39	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1232	ND		1	0.25	mg/kg	12/30/25 13:04	12/31/25 16:39	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1242	3.8		1	0.25	mg/kg	12/30/25 13:04	12/31/25 16:39	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1248	ND		1	0.25	mg/kg	12/30/25 13:04	12/31/25 16:39	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1254	1.7		1	0.25	mg/kg	12/30/25 13:04	12/31/25 16:39	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1260	ND		1	0.25	mg/kg	12/30/25 13:04	12/31/25 16:39	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1262	ND		1	0.25	mg/kg	12/30/25 13:04	12/31/25 16:39	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1268	ND		1	0.25	mg/kg	12/30/25 13:04	12/31/25 16:39	NP2/AxJ	SW846 3546	SW846-8082A
Surrogate(s)	Recovery	Q		Limits						
<i>Surrogate: Tetrachloro-m-xylene</i>	79%			10-112		12/30/25 13:04	12/31/25 16:39	NP2/AxJ	SW846 3546	SW846-8082A
<i>Surrogate: Decachlorobiphenyl</i>	81%			10-123		12/30/25 13:04	12/31/25 16:39	NP2/AxJ	SW846 3546	SW846-8082A

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax:cs@emsl.com
EMSL-CIN-01

EMSL Order ID: 012340401

LIMS Reference ID: AD46401

EMSL Customer ID: WSPN36

Attention: AP

WSP Canada, Inc. [WSPN36]
36 Pippy Place
Saint John's, NL A1B 4A5
(709) 722-7023
capayablesinvoice@wsp.com

Project Name:

CA0037087.2445-NAVFAC Paint Sampling

Project ID:

_Master Project-WSPN36

Customer PO:**Sales Rep:**

Sarah Jamieson

Received:

12/29/2025 09:00

Reported:**Sample Results**

(Continued)

Sample: TE-Rm43-PCB004B/TE Bldg. Room 43/Off-white on drywall wall
AD46401-08 (Solid)

Analyte	Result	Q	DF	RL	Units	Prepared Date/Time	Analyzed Date/Time	Prep/Analyst Initials	Prep Method	Analytical Method
GC-SVOA										
Aroclor-1016	ND		1	0.24	mg/kg	12/30/25 13:04	12/31/25 17:01	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1221	ND		1	0.24	mg/kg	12/30/25 13:04	12/31/25 17:01	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1232	ND		1	0.24	mg/kg	12/30/25 13:04	12/31/25 17:01	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1242	3.7		1	0.24	mg/kg	12/30/25 13:04	12/31/25 17:01	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1248	ND		1	0.24	mg/kg	12/30/25 13:04	12/31/25 17:01	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1254	1.8		1	0.24	mg/kg	12/30/25 13:04	12/31/25 17:01	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1260	ND		1	0.24	mg/kg	12/30/25 13:04	12/31/25 17:01	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1262	ND		1	0.24	mg/kg	12/30/25 13:04	12/31/25 17:01	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1268	ND		1	0.24	mg/kg	12/30/25 13:04	12/31/25 17:01	NP2/AxJ	SW846 3546	SW846-8082A
Surrogate(s)	Recovery	Q	Limits							
<i>Surrogate: Tetrachloro-m-xylene</i>	85%		10-112			12/30/25 13:04	12/31/25 17:01	NP2/AxJ	SW846 3546	SW846-8082A
<i>Surrogate: Decachlorobiphenyl</i>	82%		10-123			12/30/25 13:04	12/31/25 17:01	NP2/AxJ	SW846 3546	SW846-8082A

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax:cs@emsl.com
EMSL-CIN-01

Table of Contents**EMSL Order ID:** 012340401**LIMS Reference ID:** AD46401**EMSL Customer ID:** WSPN36**Attention:** AP

WSP Canada, Inc. [WSPN36]
36 Pippy Place
Saint John's, NL A1B 4A5
(709) 722-7023
capayablesinvoice@wsp.com

Project Name:

CA0037087.2445-NAVFAC Paint Sampling

Project ID:

_Master Project-WSPN36

Customer PO:**Sales Rep:**

Sarah Jamieson

Received:

12/29/2025 09:00

Reported:**Sample Results****(Continued)**

Sample: TE-Rm7-PCB005A/TE Bldg. Room 4/Blue on drywall wall
AD46401-09 (Solid)

Analyte	Result	Q	DF	RL	Units	Prepared Date/Time	Analyzed Date/Time	Prep/Analyst Initials	Prep Method	Analytical Method
GC-SVOA										
Aroclor-1016	ND		1	0.26	mg/kg	12/30/25 13:04	12/31/25 17:23	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1221	ND		1	0.26	mg/kg	12/30/25 13:04	12/31/25 17:23	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1232	ND		1	0.26	mg/kg	12/30/25 13:04	12/31/25 17:23	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1242	1.6		1	0.26	mg/kg	12/30/25 13:04	12/31/25 17:23	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1248	ND		1	0.26	mg/kg	12/30/25 13:04	12/31/25 17:23	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1254	2.2		1	0.26	mg/kg	12/30/25 13:04	12/31/25 17:23	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1260	ND		1	0.26	mg/kg	12/30/25 13:04	12/31/25 17:23	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1262	ND		1	0.26	mg/kg	12/30/25 13:04	12/31/25 17:23	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1268	ND		1	0.26	mg/kg	12/30/25 13:04	12/31/25 17:23	NP2/AxJ	SW846 3546	SW846-8082A
Surrogate(s)	Recovery	Q	Limits							
<i>Surrogate: Tetrachloro-m-xylene</i>	75%		10-112			12/30/25 13:04	12/31/25 17:23	NP2/AxJ	SW846 3546	SW846-8082A
<i>Surrogate: Decachlorobiphenyl</i>	77%		10-123			12/30/25 13:04	12/31/25 17:23	NP2/AxJ	SW846 3546	SW846-8082A

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
 Telephone: 856-858-4800 Fax:cs@emsl.com
 EMSL-CIN-01

EMSL Order ID: 012340401

LIMS Reference ID: AD46401

EMSL Customer ID: WSPN36

Attention: AP

WSP Canada, Inc. [WSPN36]
 36 Pippy Place
 Saint John's, NL A1B 4A5
 (709) 722-7023
 capayablesinvoice@wsp.com

Project Name:

CA0037087.2445-NAVFAC Paint Sampling

Project ID:

_Master Project-WSPN36

Customer PO:**Sales Rep:**

Sarah Jamieson

Received:

12/29/2025 09:00

Reported:**Sample Results**

(Continued)

Sample: TE-Rm4-PCB005B/TE Bldg. Room 7/Blue on dyrwall wall
AD46401-10 (Solid)

Analyte	Result	Q	DF	RL	Units	Prepared Date/Time	Analyzed Date/Time	Prep/Analyst Initials	Prep Method	Analytical Method
GC-SVOA										
Aroclor-1016	ND		1	0.25	mg/kg	12/30/25 13:04	12/31/25 17:45	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1221	ND		1	0.25	mg/kg	12/30/25 13:04	12/31/25 17:45	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1232	ND		1	0.25	mg/kg	12/30/25 13:04	12/31/25 17:45	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1242	4.0		1	0.25	mg/kg	12/30/25 13:04	12/31/25 17:45	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1248	ND		1	0.25	mg/kg	12/30/25 13:04	12/31/25 17:45	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1254	7.4		1	0.25	mg/kg	12/30/25 13:04	12/31/25 17:45	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1260	1.0		1	0.25	mg/kg	12/30/25 13:04	12/31/25 17:45	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1262	ND		1	0.25	mg/kg	12/30/25 13:04	12/31/25 17:45	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1268	ND		1	0.25	mg/kg	12/30/25 13:04	12/31/25 17:45	NP2/AxJ	SW846 3546	SW846-8082A
Surrogate(s)	Recovery	Q		Limits						
<i>Surrogate: Tetrachloro-m-xylene</i>	83%			10-112		12/30/25 13:04	12/31/25 17:45	NP2/AxJ	SW846 3546	SW846-8082A
<i>Surrogate: Decachlorobiphenyl</i>	80%			10-123		12/30/25 13:04	12/31/25 17:45	NP2/AxJ	SW846 3546	SW846-8082A

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
 Telephone: 856-858-4800 Fax:cs@emsl.com
 EMSL-CIN-01

EMSL Order ID: 012340401

LIMS Reference ID: AD46401

EMSL Customer ID: WSPN36

Attention: AP

WSP Canada, Inc. [WSPN36]
 36 Pippy Place
 Saint John's, NL A1B 4A5
 (709) 722-7023
 capayablesinvoice@wsp.com

Project Name:

CA0037087.2445-NAVFAC Paint Sampling

Project ID:

_Master Project-WSPN36

Customer PO:**Sales Rep:**

Sarah Jamieson

Received:

12/29/2025 09:00

Reported:**Sample Results**

(Continued)

Sample: TE-Rm10-PCB006A/TE Bldg. Room 10/Greenish blue on drywall wall
AD46401-11 (Solid)

Analyte	Result	Q	DF	RL	Units	Prepared Date/Time	Analyzed Date/Time	Prep/Analyst Initials	Prep Method	Analytical Method
GC-SVOA										
Aroclor-1016	ND		1	0.26	mg/kg	12/30/25 13:04	12/31/25 18:07	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1221	ND		1	0.26	mg/kg	12/30/25 13:04	12/31/25 18:07	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1232	ND		1	0.26	mg/kg	12/30/25 13:04	12/31/25 18:07	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1242	2.7		1	0.26	mg/kg	12/30/25 13:04	12/31/25 18:07	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1248	ND		1	0.26	mg/kg	12/30/25 13:04	12/31/25 18:07	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1254	2.5		1	0.26	mg/kg	12/30/25 13:04	12/31/25 18:07	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1260	ND		1	0.26	mg/kg	12/30/25 13:04	12/31/25 18:07	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1262	ND		1	0.26	mg/kg	12/30/25 13:04	12/31/25 18:07	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1268	ND		1	0.26	mg/kg	12/30/25 13:04	12/31/25 18:07	NP2/AxJ	SW846 3546	SW846-8082A
Surrogate(s)	Recovery	Q	Limits							
<i>Surrogate: Tetrachloro-m-xylene</i>	82%		10-112			12/30/25 13:04	12/31/25 18:07	NP2/AxJ	SW846 3546	SW846-8082A
<i>Surrogate: Decachlorobiphenyl</i>	83%		10-123			12/30/25 13:04	12/31/25 18:07	NP2/AxJ	SW846 3546	SW846-8082A

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax:cs@emsl.com
EMSL-CIN-01

Table of Contents**EMSL Order ID:** 012340401**LIMS Reference ID:** AD46401**EMSL Customer ID:** WSPN36**Attention:** AP

WSP Canada, Inc. [WSPN36]
36 Pippy Place
Saint John's, NL A1B 4A5
(709) 722-7023
capayablesinvoice@wsp.com

Project Name:

CA0037087.2445-NAVFAC Paint Sampling

Project ID:

_Master Project-WSPN36

Customer PO:**Sales Rep:**

Sarah Jamieson

Received:

12/29/2025 09:00

Reported:**Sample Results****(Continued)**

Sample: TE-Rm10-PCB006B/TE Bldg. Room 10/Greenish blue on drywall wall
AD46401-12 (Solid)

Analyte	Result	Q	DF	RL	Units	Prepared Date/Time	Analyzed Date/Time	Prep/Analyst Initials	Prep Method	Analytical Method
GC-SVOA										
Aroclor-1016	ND		1	0.26	mg/kg	12/30/25 13:04	12/31/25 18:29	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1221	ND		1	0.26	mg/kg	12/30/25 13:04	12/31/25 18:29	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1232	ND		1	0.26	mg/kg	12/30/25 13:04	12/31/25 18:29	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1242	3.5		1	0.26	mg/kg	12/30/25 13:04	12/31/25 18:29	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1248	ND		1	0.26	mg/kg	12/30/25 13:04	12/31/25 18:29	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1254	2.4		1	0.26	mg/kg	12/30/25 13:04	12/31/25 18:29	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1260	ND		1	0.26	mg/kg	12/30/25 13:04	12/31/25 18:29	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1262	ND		1	0.26	mg/kg	12/30/25 13:04	12/31/25 18:29	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1268	ND		1	0.26	mg/kg	12/30/25 13:04	12/31/25 18:29	NP2/AxJ	SW846 3546	SW846-8082A
Surrogate(s)	Recovery	Q	Limits							
Surrogate: Tetrachloro-m-xylene	77%		10-112			12/30/25 13:04	12/31/25 18:29	NP2/AxJ	SW846 3546	SW846-8082A
Surrogate: Decachlorobiphenyl	76%		10-123			12/30/25 13:04	12/31/25 18:29	NP2/AxJ	SW846 3546	SW846-8082A

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax:cs@emsl.com
EMSL-CIN-01

Table of Contents**EMSL Order ID:** 012340401**LIMS Reference ID:** AD46401**EMSL Customer ID:** WSPN36**Attention:** AP

WSP Canada, Inc. [WSPN36]
36 Pippy Place
Saint John's, NL A1B 4A5
(709) 722-7023
capayablesinvoice@wsp.com

Project Name:

CA0037087.2445-NAVFAC Paint Sampling

Project ID:

_Master Project-WSPN36

Customer PO:**Sales Rep:**

Sarah Jamieson

Received:

12/29/2025 09:00

Reported:**Sample Results****(Continued)**

Sample: TE-Rm65-PCB007A/TE Bldg. Room 65/Yellow on drywall wall
AD46401-13 (Solid)

Analyte	Result	Q	DF	RL	Units	Prepared Date/Time	Analyzed Date/Time	Prep/Analyst Initials	Prep Method	Analytical Method
GC-SVOA										
Aroclor-1016	ND		1	0.25	mg/kg	12/30/25 13:04	12/31/25 19:13	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1221	ND		1	0.25	mg/kg	12/30/25 13:04	12/31/25 19:13	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1232	ND		1	0.25	mg/kg	12/30/25 13:04	12/31/25 19:13	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1242	4.8		1	0.25	mg/kg	12/30/25 13:04	12/31/25 19:13	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1248	ND		1	0.25	mg/kg	12/30/25 13:04	12/31/25 19:13	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1254	3.6		1	0.25	mg/kg	12/30/25 13:04	12/31/25 19:13	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1260	0.65		1	0.25	mg/kg	12/30/25 13:04	12/31/25 19:13	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1262	ND		1	0.25	mg/kg	12/30/25 13:04	12/31/25 19:13	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1268	ND		1	0.25	mg/kg	12/30/25 13:04	12/31/25 19:13	NP2/AxJ	SW846 3546	SW846-8082A
Surrogate(s)	Recovery	Q	Limits							
<i>Surrogate: Tetrachloro-m-xylene</i>	67%		10-112			12/30/25 13:04	12/31/25 19:13	NP2/AxJ	SW846 3546	SW846-8082A
<i>Surrogate: Decachlorobiphenyl</i>	70%		10-123			12/30/25 13:04	12/31/25 19:13	NP2/AxJ	SW846 3546	SW846-8082A

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax:cs@emsl.com
EMSL-CIN-01

Table of Contents**EMSL Order ID:** 012340401**LIMS Reference ID:** AD46401**EMSL Customer ID:** WSPN36**Attention:** AP

WSP Canada, Inc. [WSPN36]
36 Pippy Place
Saint John's, NL A1B 4A5
(709) 722-7023
capayablesinvoice@wsp.com

Project Name:

CA0037087.2445-NAVFAC Paint Sampling

Project ID:

_Master Project-WSPN36

Customer PO:**Sales Rep:**

Sarah Jamieson

Received:

12/29/2025 09:00

Reported:**Sample Results****(Continued)**

Sample: TE-Rm65-PCB007B/TE Bldg. Room 65/Yellow on drywall wall
AD46401-14 (Solid)

Analyte	Result	Q	DF	RL	Units	Prepared Date/Time	Analyzed Date/Time	Prep/Analyst Initials	Prep Method	Analytical Method
GC-SVOA										
Aroclor-1016	ND		1	0.24	mg/kg	12/30/25 15:40	12/31/25 15:15	MxB/TL1	SW846 3540C	SW846-8082A
Aroclor-1221	ND		1	0.24	mg/kg	12/30/25 15:40	12/31/25 15:15	MxB/TL1	SW846 3540C	SW846-8082A
Aroclor-1232	ND		1	0.24	mg/kg	12/30/25 15:40	12/31/25 15:15	MxB/TL1	SW846 3540C	SW846-8082A
Aroclor-1242	2.2		1	0.24	mg/kg	12/30/25 15:40	12/31/25 15:15	MxB/TL1	SW846 3540C	SW846-8082A
Aroclor-1248	ND		1	0.24	mg/kg	12/30/25 15:40	12/31/25 15:15	MxB/TL1	SW846 3540C	SW846-8082A
Aroclor-1254	0.90		1	0.24	mg/kg	12/30/25 15:40	12/31/25 15:15	MxB/TL1	SW846 3540C	SW846-8082A
Aroclor-1260	ND		1	0.24	mg/kg	12/30/25 15:40	12/31/25 15:15	MxB/TL1	SW846 3540C	SW846-8082A
Aroclor-1262	ND		1	0.24	mg/kg	12/30/25 15:40	12/31/25 15:15	MxB/TL1	SW846 3540C	SW846-8082A
Aroclor-1268	ND		1	0.24	mg/kg	12/30/25 15:40	12/31/25 15:15	MxB/TL1	SW846 3540C	SW846-8082A
Surrogate(s)	Recovery	Q		Limits						
<i>Surrogate: Tetrachloro-m-xylene</i>	83%			10-112		12/30/25 15:40	12/31/25 15:15	MxB/TL1	SW846 3540C	SW846-8082A
<i>Surrogate: Decachlorobiphenyl</i>	83%			10-123		12/30/25 15:40	12/31/25 15:15	MxB/TL1	SW846 3540C	SW846-8082A

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax:cs@emsl.com
EMSL-CIN-01

Table of Contents**EMSL Order ID:** 012340401**LIMS Reference ID:** AD46401**EMSL Customer ID:** WSPN36**Attention:** AP

WSP Canada, Inc. [WSPN36]
36 Pippy Place
Saint John's, NL A1B 4A5
(709) 722-7023
capayablesinvoice@wsp.com

Project Name:

CA0037087.2445-NAVFAC Paint Sampling

Project ID:

_Master Project-WSPN36

Customer PO:**Sales Rep:**

Sarah Jamieson

Received:

12/29/2025 09:00

Reported:**Sample Results****(Continued)**

Sample: TE-Rm67-PCB008A/TE Bldg. Room 67/Yellow on drywall wall
AD46401-15 (Solid)

Analyte	Result	Q	DF	RL	Units	Prepared Date/Time	Analyzed Date/Time	Prep/Analyst Initials	Prep Method	Analytical Method
GC-SVOA										
Aroclor-1016	ND		1	0.27	mg/kg	12/30/25 13:04	12/31/25 19:34	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1221	ND		1	0.27	mg/kg	12/30/25 13:04	12/31/25 19:34	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1232	ND		1	0.27	mg/kg	12/30/25 13:04	12/31/25 19:34	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1242	4.5		1	0.27	mg/kg	12/30/25 13:04	12/31/25 19:34	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1248	ND		1	0.27	mg/kg	12/30/25 13:04	12/31/25 19:34	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1254	2.5		1	0.27	mg/kg	12/30/25 13:04	12/31/25 19:34	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1260	ND		1	0.27	mg/kg	12/30/25 13:04	12/31/25 19:34	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1262	ND		1	0.27	mg/kg	12/30/25 13:04	12/31/25 19:34	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1268	ND		1	0.27	mg/kg	12/30/25 13:04	12/31/25 19:34	NP2/AxJ	SW846 3546	SW846-8082A
Surrogate(s)	Recovery	Q	Limits							
<i>Surrogate: Tetrachloro-m-xylene</i>	66%		10-112			12/30/25 13:04	12/31/25 19:34	NP2/AxJ	SW846 3546	SW846-8082A
<i>Surrogate: Decachlorobiphenyl</i>	70%		10-123			12/30/25 13:04	12/31/25 19:34	NP2/AxJ	SW846 3546	SW846-8082A

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax:cs@emsl.com
EMSL-CIN-01

Table of Contents**EMSL Order ID:** 012340401**LIMS Reference ID:** AD46401**EMSL Customer ID:** WSPN36**Attention:** AP

WSP Canada, Inc. [WSPN36]
36 Pippy Place
Saint John's, NL A1B 4A5
(709) 722-7023
capayablesinvoice@wsp.com

Project Name:

CA0037087.2445-NAVFAC Paint Sampling

Project ID:

_Master Project-WSPN36

Customer PO:**Sales Rep:**

Sarah Jamieson

Received:

12/29/2025 09:00

Reported:**Sample Results****(Continued)**

Sample: TE-Rm50-PCB008B/TE Bldg. Room 50/Yellow on drywall wall
AD46401-16 (Solid)

Analyte	Result	Q	DF	RL	Units	Prepared Date/Time	Analyzed Date/Time	Prep/Analyst Initials	Prep Method	Analytical Method
GC-SVOA										
Aroclor-1016	ND		1	0.24	mg/kg	12/30/25 13:04	12/31/25 19:56	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1221	ND		1	0.24	mg/kg	12/30/25 13:04	12/31/25 19:56	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1232	ND		1	0.24	mg/kg	12/30/25 13:04	12/31/25 19:56	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1242	1.4		1	0.24	mg/kg	12/30/25 13:04	12/31/25 19:56	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1248	ND		1	0.24	mg/kg	12/30/25 13:04	12/31/25 19:56	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1254	0.49		1	0.24	mg/kg	12/30/25 13:04	12/31/25 19:56	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1260	ND		1	0.24	mg/kg	12/30/25 13:04	12/31/25 19:56	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1262	ND		1	0.24	mg/kg	12/30/25 13:04	12/31/25 19:56	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1268	ND		1	0.24	mg/kg	12/30/25 13:04	12/31/25 19:56	NP2/AxJ	SW846 3546	SW846-8082A
Surrogate(s)	Recovery	Q	Limits							
<i>Surrogate: Tetrachloro-m-xylene</i>	64%		10-112			12/30/25 13:04	12/31/25 19:56	NP2/AxJ	SW846 3546	SW846-8082A
<i>Surrogate: Decachlorobiphenyl</i>	67%		10-123			12/30/25 13:04	12/31/25 19:56	NP2/AxJ	SW846 3546	SW846-8082A

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax:cs@emsl.com
EMSL-CIN-01

Table of Contents**EMSL Order ID:** 012340401**LIMS Reference ID:** AD46401**EMSL Customer ID:** WSPN36**Attention:** AP

WSP Canada, Inc. [WSPN36]
36 Pippy Place
Saint John's, NL A1B 4A5
(709) 722-7023
capayablesinvoice@wsp.com

Project Name:

CA0037087.2445-NAVFAC Paint Sampling

Project ID:

_Master Project-WSPN36

Customer PO:**Sales Rep:**

Sarah Jamieson

Received:

12/29/2025 09:00

Reported:**Sample Results****(Continued)**

Sample: TE-Rm66-PCB009A/TE Bldg. Room 66/Brownish-grey on drywall wall
AD46401-17 (Solid)

Analyte	Result	Q	DF	RL	Units	Prepared Date/Time	Analyzed Date/Time	Prep/Analyst Initials	Prep Method	Analytical Method
GC-SVOA										
Aroclor-1016	ND		1	0.25	mg/kg	12/30/25 13:04	12/31/25 20:18	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1221	ND		1	0.25	mg/kg	12/30/25 13:04	12/31/25 20:18	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1232	ND		1	0.25	mg/kg	12/30/25 13:04	12/31/25 20:18	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1242	3.0		1	0.25	mg/kg	12/30/25 13:04	12/31/25 20:18	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1248	ND		1	0.25	mg/kg	12/30/25 13:04	12/31/25 20:18	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1254	3.0		1	0.25	mg/kg	12/30/25 13:04	12/31/25 20:18	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1260	ND		1	0.25	mg/kg	12/30/25 13:04	12/31/25 20:18	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1262	ND		1	0.25	mg/kg	12/30/25 13:04	12/31/25 20:18	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1268	ND		1	0.25	mg/kg	12/30/25 13:04	12/31/25 20:18	NP2/AxJ	SW846 3546	SW846-8082A
Surrogate(s)	Recovery	Q	Limits							
<i>Surrogate: Tetrachloro-m-xylene</i>	65%		10-112			12/30/25 13:04	12/31/25 20:18	NP2/AxJ	SW846 3546	SW846-8082A
<i>Surrogate: Decachlorobiphenyl</i>	63%		10-123			12/30/25 13:04	12/31/25 20:18	NP2/AxJ	SW846 3546	SW846-8082A

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax:cs@emsl.com
EMSL-CIN-01

Table of Contents**EMSL Order ID:** 012340401**LIMS Reference ID:** AD46401**EMSL Customer ID:** WSPN36**Attention:** AP

WSP Canada, Inc. [WSPN36]
36 Pippy Place
Saint John's, NL A1B 4A5
(709) 722-7023
capayablesinvoice@wsp.com

Project Name:

CA0037087.2445-NAVFAC Paint Sampling

Project ID:

_Master Project-WSPN36

Customer PO:**Sales Rep:**

Sarah Jamieson

Received:

12/29/2025 09:00

Reported:**Sample Results****(Continued)**

Sample: TE-Rm66-PCB009B/TE Bldg. Room 66/Brownish-grey on drywall wall
AD46401-18 (Solid)

Analyte	Result	Q	DF	RL	Units	Prepared Date/Time	Analyzed Date/Time	Prep/Analyst Initials	Prep Method	Analytical Method
GC-SVOA										
Aroclor-1016	ND		1	0.25	mg/kg	12/30/25 13:04	12/31/25 20:40	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1221	ND		1	0.25	mg/kg	12/30/25 13:04	12/31/25 20:40	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1232	ND		1	0.25	mg/kg	12/30/25 13:04	12/31/25 20:40	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1242	2.5		1	0.25	mg/kg	12/30/25 13:04	12/31/25 20:40	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1248	ND		1	0.25	mg/kg	12/30/25 13:04	12/31/25 20:40	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1254	2.3		1	0.25	mg/kg	12/30/25 13:04	12/31/25 20:40	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1260	ND		1	0.25	mg/kg	12/30/25 13:04	12/31/25 20:40	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1262	ND		1	0.25	mg/kg	12/30/25 13:04	12/31/25 20:40	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1268	ND		1	0.25	mg/kg	12/30/25 13:04	12/31/25 20:40	NP2/AxJ	SW846 3546	SW846-8082A
Surrogate(s)	Recovery	Q	Limits							
<i>Surrogate: Tetrachloro-m-xylene</i>	55%		10-112			12/30/25 13:04	12/31/25 20:40	NP2/AxJ	SW846 3546	SW846-8082A
<i>Surrogate: Decachlorobiphenyl</i>	56%		10-123			12/30/25 13:04	12/31/25 20:40	NP2/AxJ	SW846 3546	SW846-8082A

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax:cs@emsl.com
EMSL-CIN-01

Table of Contents**EMSL Order ID:** 012340401**LIMS Reference ID:** AD46401**EMSL Customer ID:** WSPN36**Attention:** AP

WSP Canada, Inc. [WSPN36]
36 Pippy Place
Saint John's, NL A1B 4A5
(709) 722-7023
capayablesinvoice@wsp.com

Project Name:

CA0037087.2445-NAVFAC Paint Sampling

Project ID:

_Master Project-WSPN36

Customer PO:**Sales Rep:**

Sarah Jamieson

Received:

12/29/2025 09:00

Reported:**Sample Results****(Continued)**

Sample: TE-Rm64-PCB010A/TE Bldg. Room 14/Grey on drywall wall
AD46401-19 (Solid)

Analyte	Result	Q	DF	RL	Units	Prepared Date/Time	Analyzed Date/Time	Prep/Analyst Initials	Prep Method	Analytical Method
GC-SVOA										
Aroclor-1016	ND		1	0.26	mg/kg	12/30/25 13:04	12/31/25 21:02	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1221	ND		1	0.26	mg/kg	12/30/25 13:04	12/31/25 21:02	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1232	ND		1	0.26	mg/kg	12/30/25 13:04	12/31/25 21:02	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1242	1.1		1	0.26	mg/kg	12/30/25 13:04	12/31/25 21:02	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1248	ND		1	0.26	mg/kg	12/30/25 13:04	12/31/25 21:02	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1254	0.77		1	0.26	mg/kg	12/30/25 13:04	12/31/25 21:02	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1260	ND		1	0.26	mg/kg	12/30/25 13:04	12/31/25 21:02	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1262	ND		1	0.26	mg/kg	12/30/25 13:04	12/31/25 21:02	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1268	ND		1	0.26	mg/kg	12/30/25 13:04	12/31/25 21:02	NP2/AxJ	SW846 3546	SW846-8082A
Surrogate(s)	Recovery	Q		Limits						
<i>Surrogate: Tetrachloro-m-xylene</i>	62%			10-112		12/30/25 13:04	12/31/25 21:02	NP2/AxJ	SW846 3546	SW846-8082A
<i>Surrogate: Decachlorobiphenyl</i>	64%			10-123		12/30/25 13:04	12/31/25 21:02	NP2/AxJ	SW846 3546	SW846-8082A

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax:cs@emsl.com
EMSL-CIN-01

Table of Contents**EMSL Order ID:** 012340401**LIMS Reference ID:** AD46401**EMSL Customer ID:** WSPN36**Attention:** AP

WSP Canada, Inc. [WSPN36]
36 Pippy Place
Saint John's, NL A1B 4A5
(709) 722-7023
capayablesinvoice@wsp.com

Project Name:

CA0037087.2445-NAVFAC Paint Sampling

Project ID:

_Master Project-WSPN36

Customer PO:**Sales Rep:**

Sarah Jamieson

Received:

12/29/2025 09:00

Reported:**Sample Results****(Continued)**

Sample: TE-Rm64-PCB010B/TE Bldg. Room 64/Grey on drywall wall
AD46401-20 (Solid)

Analyte	Result	Q	DF	RL	Units	Prepared Date/Time	Analyzed Date/Time	Prep/Analyst Initials	Prep Method	Analytical Method
GC-SVOA										
Aroclor-1016	ND		1	0.25	mg/kg	12/30/25 13:04	12/31/25 21:24	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1221	ND		1	0.25	mg/kg	12/30/25 13:04	12/31/25 21:24	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1232	ND		1	0.25	mg/kg	12/30/25 13:04	12/31/25 21:24	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1242	1.5		1	0.25	mg/kg	12/30/25 13:04	12/31/25 21:24	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1248	ND		1	0.25	mg/kg	12/30/25 13:04	12/31/25 21:24	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1254	1.2		1	0.25	mg/kg	12/30/25 13:04	12/31/25 21:24	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1260	ND		1	0.25	mg/kg	12/30/25 13:04	12/31/25 21:24	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1262	ND		1	0.25	mg/kg	12/30/25 13:04	12/31/25 21:24	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1268	ND		1	0.25	mg/kg	12/30/25 13:04	12/31/25 21:24	NP2/AxJ	SW846 3546	SW846-8082A
Surrogate(s)	Recovery	Q		Limits						
<i>Surrogate: Tetrachloro-m-xylene</i>	62%			10-112		12/30/25 13:04	12/31/25 21:24	NP2/AxJ	SW846 3546	SW846-8082A
<i>Surrogate: Decachlorobiphenyl</i>	65%			10-123		12/30/25 13:04	12/31/25 21:24	NP2/AxJ	SW846 3546	SW846-8082A

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax:cs@emsl.com
EMSL-CIN-01

Table of Contents**EMSL Order ID:** 012340401**LIMS Reference ID:** AD46401**EMSL Customer ID:** WSPN36**Attention:** AP

WSP Canada, Inc. [WSPN36]
36 Pippy Place
Saint John's, NL A1B 4A5
(709) 722-7023
capayablesinvoice@wsp.com

Project Name:

CA0037087.2445-NAVFAC Paint Sampling

Project ID:

_Master Project-WSPN36

Customer PO:**Sales Rep:**

Sarah Jamieson

Received:

12/29/2025 09:00

Reported:**Sample Results****(Continued)**

Sample: TE-Rm68-PCB011A/TE Bldg. Room 68/Light green on plaster
AD46401-21 (Solid)

Analyte	Result	Q	DF	RL	Units	Prepared Date/Time	Analyzed Date/Time	Prep/Analyst Initials	Prep Method	Analytical Method
GC-SVOA										
Aroclor-1016	ND		1	0.24	mg/kg	12/30/25 15:40	12/31/25 15:37	MxB/TL1	SW846 3540C	SW846-8082A
Aroclor-1221	ND		1	0.24	mg/kg	12/30/25 15:40	12/31/25 15:37	MxB/TL1	SW846 3540C	SW846-8082A
Aroclor-1232	ND		1	0.24	mg/kg	12/30/25 15:40	12/31/25 15:37	MxB/TL1	SW846 3540C	SW846-8082A
Aroclor-1242	2.6		1	0.24	mg/kg	12/30/25 15:40	12/31/25 15:37	MxB/TL1	SW846 3540C	SW846-8082A
Aroclor-1248	ND		1	0.24	mg/kg	12/30/25 15:40	12/31/25 15:37	MxB/TL1	SW846 3540C	SW846-8082A
Aroclor-1254	3.8		1	0.24	mg/kg	12/30/25 15:40	12/31/25 15:37	MxB/TL1	SW846 3540C	SW846-8082A
Aroclor-1260	ND		1	0.24	mg/kg	12/30/25 15:40	12/31/25 15:37	MxB/TL1	SW846 3540C	SW846-8082A
Aroclor-1262	ND		1	0.24	mg/kg	12/30/25 15:40	12/31/25 15:37	MxB/TL1	SW846 3540C	SW846-8082A
Aroclor-1268	ND		1	0.24	mg/kg	12/30/25 15:40	12/31/25 15:37	MxB/TL1	SW846 3540C	SW846-8082A
Surrogate(s)	Recovery	Q	Limits							
<i>Surrogate: Tetrachloro-m-xylene</i>	94%		10-112			12/30/25 15:40	12/31/25 15:37	MxB/TL1	SW846 3540C	SW846-8082A
<i>Surrogate: Decachlorobiphenyl</i>	88%		10-123			12/30/25 15:40	12/31/25 15:37	MxB/TL1	SW846 3540C	SW846-8082A

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax:cs@emsl.com
EMSL-CIN-01

Table of Contents**EMSL Order ID:** 012340401**LIMS Reference ID:** AD46401**EMSL Customer ID:** WSPN36**Attention:** AP

WSP Canada, Inc. [WSPN36]
36 Pippy Place
Saint John's, NL A1B 4A5
(709) 722-7023
capayablesinvoice@wsp.com

Project Name:

CA0037087.2445-NAVFAC Paint Sampling

Project ID:

_Master Project-WSPN36

Customer PO:**Sales Rep:**

Sarah Jamieson

Received:

12/29/2025 09:00

Reported:**Sample Results****(Continued)**

Sample: TE-Rm68-PCB011B/TE Bldg. Room 68/Light green on plaster
AD46401-22 (Solid)

Analyte	Result	Q	DF	RL	Units	Prepared Date/Time	Analyzed Date/Time	Prep/Analyst Initials	Prep Method	Analytical Method
GC-SVOA										
Aroclor-1016	ND		1	0.25	mg/kg	12/30/25 15:40	12/31/25 15:59	MxB/TL1	SW846 3540C	SW846-8082A
Aroclor-1221	ND		1	0.25	mg/kg	12/30/25 15:40	12/31/25 15:59	MxB/TL1	SW846 3540C	SW846-8082A
Aroclor-1232	ND		1	0.25	mg/kg	12/30/25 15:40	12/31/25 15:59	MxB/TL1	SW846 3540C	SW846-8082A
Aroclor-1242	1.0		1	0.25	mg/kg	12/30/25 15:40	12/31/25 15:59	MxB/TL1	SW846 3540C	SW846-8082A
Aroclor-1248	ND		1	0.25	mg/kg	12/30/25 15:40	12/31/25 15:59	MxB/TL1	SW846 3540C	SW846-8082A
Aroclor-1254	1.3		1	0.25	mg/kg	12/30/25 15:40	12/31/25 15:59	MxB/TL1	SW846 3540C	SW846-8082A
Aroclor-1260	ND		1	0.25	mg/kg	12/30/25 15:40	12/31/25 15:59	MxB/TL1	SW846 3540C	SW846-8082A
Aroclor-1262	ND		1	0.25	mg/kg	12/30/25 15:40	12/31/25 15:59	MxB/TL1	SW846 3540C	SW846-8082A
Aroclor-1268	ND		1	0.25	mg/kg	12/30/25 15:40	12/31/25 15:59	MxB/TL1	SW846 3540C	SW846-8082A
Surrogate(s)	Recovery	Q	Limits							
<i>Surrogate: Tetrachloro-m-xylene</i>	50%		10-112			12/30/25 15:40	12/31/25 15:59	MxB/TL1	SW846 3540C	SW846-8082A
<i>Surrogate: Decachlorobiphenyl</i>	53%		10-123			12/30/25 15:40	12/31/25 15:59	MxB/TL1	SW846 3540C	SW846-8082A

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax:cs@emsl.com
EMSL-CIN-01

Table of Contents**EMSL Order ID:** 012340401**LIMS Reference ID:** AD46401**EMSL Customer ID:** WSPN36**Attention:** AP

WSP Canada, Inc. [WSPN36]
36 Pippy Place
Saint John's, NL A1B 4A5
(709) 722-7023
capayablesinvoice@wsp.com

Project Name:

CA0037087.2445-NAVFAC Paint Sampling

Project ID:

_Master Project-WSPN36

Customer PO:**Sales Rep:**

Sarah Jamieson

Received:

12/29/2025 09:00

Reported:**Sample Results****(Continued)**

Sample: TE-Rm69-PCB012A/TE Bldg. Room 69/Very light brown on plaster wall
AD46401-23 (Solid)

Analyte	Result	Q	DF	RL	Units	Prepared Date/Time	Analyzed Date/Time	Prep/Analyst Initials	Prep Method	Analytical Method
GC-SVOA										
Aroclor-1016	ND	D	5	1.2	mg/kg	12/30/25 15:40	01/02/26 12:57	MxB/AxJ	SW846 3540C	SW846-8082A
Aroclor-1221	ND	D	5	1.2	mg/kg	12/30/25 15:40	01/02/26 12:57	MxB/AxJ	SW846 3540C	SW846-8082A
Aroclor-1232	ND	D	5	1.2	mg/kg	12/30/25 15:40	01/02/26 12:57	MxB/AxJ	SW846 3540C	SW846-8082A
Aroclor-1242	ND	D	5	1.2	mg/kg	12/30/25 15:40	01/02/26 12:57	MxB/AxJ	SW846 3540C	SW846-8082A
Aroclor-1248	ND	D	5	1.2	mg/kg	12/30/25 15:40	01/02/26 12:57	MxB/AxJ	SW846 3540C	SW846-8082A
Aroclor-1254	17	D	5	1.2	mg/kg	12/30/25 15:40	01/02/26 12:57	MxB/AxJ	SW846 3540C	SW846-8082A
Aroclor-1260	ND	D	5	1.2	mg/kg	12/30/25 15:40	01/02/26 12:57	MxB/AxJ	SW846 3540C	SW846-8082A
Aroclor-1262	ND	D	5	1.2	mg/kg	12/30/25 15:40	01/02/26 12:57	MxB/AxJ	SW846 3540C	SW846-8082A
Aroclor-1268	ND	D	5	1.2	mg/kg	12/30/25 15:40	01/02/26 12:57	MxB/AxJ	SW846 3540C	SW846-8082A
Surrogate(s)	Recovery	Q	Limits							
<i>Surrogate: Tetrachloro-m-xylene</i>	91%		10-112			12/30/25 15:40	01/02/26 12:57	MxB/AxJ	SW846 3540C	SW846-8082A
<i>Surrogate: Decachlorobiphenyl</i>	104%		10-123			12/30/25 15:40	01/02/26 12:57	MxB/AxJ	SW846 3540C	SW846-8082A

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax:cs@emsl.com
EMSL-CIN-01

Table of Contents**EMSL Order ID:** 012340401**LIMS Reference ID:** AD46401**EMSL Customer ID:** WSPN36**Attention:** AP

WSP Canada, Inc. [WSPN36]
36 Pippy Place
Saint John's, NL A1B 4A5
(709) 722-7023
capayablesinvoice@wsp.com

Project Name:

CA0037087.2445-NAVFAC Paint Sampling

Project ID:

_Master Project-WSPN36

Customer PO:**Sales Rep:**

Sarah Jamieson

Received:

12/29/2025 09:00

Reported:**Sample Results****(Continued)**

Sample: TE-Rm53-PCB012B/TE Bldg. Room 53/Very light brown on plaster wall
AD46401-24 (Solid)

Analyte	Result	Q	DF	RL	Units	Prepared Date/Time	Analyzed Date/Time	Prep/Analyst Initials	Prep Method	Analytical Method
GC-SVOA										
Aroclor-1016	ND		1	0.24	mg/kg	12/30/25 15:40	12/31/25 16:43	MxB/TL1	SW846 3540C	SW846-8082A
Aroclor-1221	ND		1	0.24	mg/kg	12/30/25 15:40	12/31/25 16:43	MxB/TL1	SW846 3540C	SW846-8082A
Aroclor-1232	ND		1	0.24	mg/kg	12/30/25 15:40	12/31/25 16:43	MxB/TL1	SW846 3540C	SW846-8082A
Aroclor-1242	4.3		1	0.24	mg/kg	12/30/25 15:40	12/31/25 16:43	MxB/TL1	SW846 3540C	SW846-8082A
Aroclor-1248	ND		1	0.24	mg/kg	12/30/25 15:40	12/31/25 16:43	MxB/TL1	SW846 3540C	SW846-8082A
Aroclor-1254	5.3		1	0.24	mg/kg	12/30/25 15:40	12/31/25 16:43	MxB/TL1	SW846 3540C	SW846-8082A
Aroclor-1260	ND		1	0.24	mg/kg	12/30/25 15:40	12/31/25 16:43	MxB/TL1	SW846 3540C	SW846-8082A
Aroclor-1262	ND		1	0.24	mg/kg	12/30/25 15:40	12/31/25 16:43	MxB/TL1	SW846 3540C	SW846-8082A
Aroclor-1268	ND		1	0.24	mg/kg	12/30/25 15:40	12/31/25 16:43	MxB/TL1	SW846 3540C	SW846-8082A
Surrogate(s)	Recovery	Q		Limits						
<i>Surrogate: Tetrachloro-m-xylene</i>	82%			10-112		12/30/25 15:40	12/31/25 16:43	MxB/TL1	SW846 3540C	SW846-8082A
<i>Surrogate: Decachlorobiphenyl</i>	83%			10-123		12/30/25 15:40	12/31/25 16:43	MxB/TL1	SW846 3540C	SW846-8082A

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax:cs@emsl.com
EMSL-CIN-01

Table of Contents**EMSL Order ID:** 012340401**LIMS Reference ID:** AD46401**EMSL Customer ID:** WSPN36**Attention:** AP

WSP Canada, Inc. [WSPN36]
36 Pippy Place
Saint John's, NL A1B 4A5
(709) 722-7023
capayablesinvoice@wsp.com

Project Name:

CA0037087.2445-NAVFAC Paint Sampling

Project ID:

_Master Project-WSPN36

Customer PO:**Sales Rep:**

Sarah Jamieson

Received:

12/29/2025 09:00

Reported:**Sample Results****(Continued)**

Sample: TE-Rm69-PCB013A/TE Bldg. Room 69/Light brown on plaster wall
AD46401-25 (Solid)

Analyte	Result	Q	DF	RL	Units	Prepared Date/Time	Analyzed Date/Time	Prep/Analyst Initials	Prep Method	Analytical Method
GC-SVOA										
Aroclor-1016	ND		1	0.25	mg/kg	12/30/25 15:40	12/31/25 17:05	MxB/TL1	SW846 3540C	SW846-8082A
Aroclor-1221	ND		1	0.25	mg/kg	12/30/25 15:40	12/31/25 17:05	MxB/TL1	SW846 3540C	SW846-8082A
Aroclor-1232	ND		1	0.25	mg/kg	12/30/25 15:40	12/31/25 17:05	MxB/TL1	SW846 3540C	SW846-8082A
Aroclor-1242	0.52		1	0.25	mg/kg	12/30/25 15:40	12/31/25 17:05	MxB/TL1	SW846 3540C	SW846-8082A
Aroclor-1248	ND		1	0.25	mg/kg	12/30/25 15:40	12/31/25 17:05	MxB/TL1	SW846 3540C	SW846-8082A
Aroclor-1254	1.3		1	0.25	mg/kg	12/30/25 15:40	12/31/25 17:05	MxB/TL1	SW846 3540C	SW846-8082A
Aroclor-1260	ND		1	0.25	mg/kg	12/30/25 15:40	12/31/25 17:05	MxB/TL1	SW846 3540C	SW846-8082A
Aroclor-1262	ND		1	0.25	mg/kg	12/30/25 15:40	12/31/25 17:05	MxB/TL1	SW846 3540C	SW846-8082A
Aroclor-1268	ND		1	0.25	mg/kg	12/30/25 15:40	12/31/25 17:05	MxB/TL1	SW846 3540C	SW846-8082A
Surrogate(s)	Recovery	Q	Limits							
<i>Surrogate: Tetrachloro-m-xylene</i>	79%		10-112			12/30/25 15:40	12/31/25 17:05	MxB/TL1	SW846 3540C	SW846-8082A
<i>Surrogate: Decachlorobiphenyl</i>	82%		10-123			12/30/25 15:40	12/31/25 17:05	MxB/TL1	SW846 3540C	SW846-8082A

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax:cs@emsl.com
EMSL-CIN-01

Table of Contents**EMSL Order ID:** 012340401**LIMS Reference ID:** AD46401**EMSL Customer ID:** WSPN36**Attention:** AP

WSP Canada, Inc. [WSPN36]
36 Pippy Place
Saint John's, NL A1B 4A5
(709) 722-7023
capayablesinvoice@wsp.com

Project Name:

CA0037087.2445-NAVFAC Paint Sampling

Project ID:

_Master Project-WSPN36

Customer PO:**Sales Rep:**

Sarah Jamieson

Received:

12/29/2025 09:00

Reported:**Sample Results****(Continued)**

Sample: TE-Rm69-PCB013B/TE Bldg. Room 69/Light brown on plaster wall
AD46401-26 (Solid)

Analyte	Result	Q	DF	RL	Units	Prepared Date/Time	Analyzed Date/Time	Prep/Analyst Initials	Prep Method	Analytical Method
GC-SVOA										
Aroclor-1016	ND		1	0.25	mg/kg	12/30/25 15:40	12/31/25 17:26	MxB/TL1	SW846 3540C	SW846-8082A
Aroclor-1221	ND		1	0.25	mg/kg	12/30/25 15:40	12/31/25 17:26	MxB/TL1	SW846 3540C	SW846-8082A
Aroclor-1232	ND		1	0.25	mg/kg	12/30/25 15:40	12/31/25 17:26	MxB/TL1	SW846 3540C	SW846-8082A
Aroclor-1242	0.43		1	0.25	mg/kg	12/30/25 15:40	12/31/25 17:26	MxB/TL1	SW846 3540C	SW846-8082A
Aroclor-1248	ND		1	0.25	mg/kg	12/30/25 15:40	12/31/25 17:26	MxB/TL1	SW846 3540C	SW846-8082A
Aroclor-1254	1.0		1	0.25	mg/kg	12/30/25 15:40	12/31/25 17:26	MxB/TL1	SW846 3540C	SW846-8082A
Aroclor-1260	ND		1	0.25	mg/kg	12/30/25 15:40	12/31/25 17:26	MxB/TL1	SW846 3540C	SW846-8082A
Aroclor-1262	ND		1	0.25	mg/kg	12/30/25 15:40	12/31/25 17:26	MxB/TL1	SW846 3540C	SW846-8082A
Aroclor-1268	ND		1	0.25	mg/kg	12/30/25 15:40	12/31/25 17:26	MxB/TL1	SW846 3540C	SW846-8082A
Surrogate(s)	Recovery	Q	Limits							
<i>Surrogate: Tetrachloro-m-xylene</i>	75%		10-112			12/30/25 15:40	12/31/25 17:26	MxB/TL1	SW846 3540C	SW846-8082A
<i>Surrogate: Decachlorobiphenyl</i>	79%		10-123			12/30/25 15:40	12/31/25 17:26	MxB/TL1	SW846 3540C	SW846-8082A

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax:cs@emsl.com
EMSL-CIN-01

Table of Contents**EMSL Order ID:** 012340401**LIMS Reference ID:** AD46401**EMSL Customer ID:** WSPN36**Attention:** AP

WSP Canada, Inc. [WSPN36]
36 Pippy Place
Saint John's, NL A1B 4A5
(709) 722-7023
capayablesinvoice@wsp.com

Project Name:

CA0037087.2445-NAVFAC Paint Sampling

Project ID:

_Master Project-WSPN36

Customer PO:**Sales Rep:**

Sarah Jamieson

Received:

12/29/2025 09:00

Reported:**Sample Results****(Continued)**

Sample: TE-Rm73-PCB014A/TE Bldg. Room 73/Gloss white on drywall wall
AD46401-27 (Solid)

Analyte	Result	Q	DF	RL	Units	Prepared Date/Time	Analyzed Date/Time	Prep/Analyst Initials	Prep Method	Analytical Method
GC-SVOA										
Aroclor-1016	ND		1	0.24	mg/kg	12/30/25 15:40	12/31/25 18:09	MxB/TL1	SW846 3540C	SW846-8082A
Aroclor-1221	ND		1	0.24	mg/kg	12/30/25 15:40	12/31/25 18:09	MxB/TL1	SW846 3540C	SW846-8082A
Aroclor-1232	ND		1	0.24	mg/kg	12/30/25 15:40	12/31/25 18:09	MxB/TL1	SW846 3540C	SW846-8082A
Aroclor-1242	3.1		1	0.24	mg/kg	12/30/25 15:40	12/31/25 18:09	MxB/TL1	SW846 3540C	SW846-8082A
Aroclor-1248	ND		1	0.24	mg/kg	12/30/25 15:40	12/31/25 18:09	MxB/TL1	SW846 3540C	SW846-8082A
Aroclor-1254	4.2		1	0.24	mg/kg	12/30/25 15:40	12/31/25 18:09	MxB/TL1	SW846 3540C	SW846-8082A
Aroclor-1260	ND		1	0.24	mg/kg	12/30/25 15:40	12/31/25 18:09	MxB/TL1	SW846 3540C	SW846-8082A
Aroclor-1262	ND		1	0.24	mg/kg	12/30/25 15:40	12/31/25 18:09	MxB/TL1	SW846 3540C	SW846-8082A
Aroclor-1268	ND		1	0.24	mg/kg	12/30/25 15:40	12/31/25 18:09	MxB/TL1	SW846 3540C	SW846-8082A
Surrogate(s)	Recovery	Q		Limits						
<i>Surrogate: Tetrachloro-m-xylene</i>	85%			10-112		12/30/25 15:40	12/31/25 18:09	MxB/TL1	SW846 3540C	SW846-8082A
<i>Surrogate: Decachlorobiphenyl</i>	83%			10-123		12/30/25 15:40	12/31/25 18:09	MxB/TL1	SW846 3540C	SW846-8082A

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
 Telephone: 856-858-4800 Fax:cs@emsl.com
 EMSL-CIN-01

EMSL Order ID: 012340401

LIMS Reference ID: AD46401

EMSL Customer ID: WSPN36

Attention: AP

WSP Canada, Inc. [WSPN36]
 36 Pippy Place
 Saint John's, NL A1B 4A5
 (709) 722-7023
 capayablesinvoice@wsp.com

Project Name:

CA0037087.2445-NAVFAC Paint Sampling

Project ID:

_Master Project-WSPN36

Customer PO:**Sales Rep:**

Sarah Jamieson

Received:

12/29/2025 09:00

Reported:**Sample Results**

(Continued)

Sample: TE-Rm73-PCB014B/TE Bldg. Room 73/Gloss white on drywall wall
AD46401-28 (Solid)

Analyte	Result	Q	DF	RL	Units	Prepared Date/Time	Analyzed Date/Time	Prep/Analyst Initials	Prep Method	Analytical Method
GC-SVOA										
Aroclor-1016	ND		1	0.24	mg/kg	12/30/25 15:40	12/31/25 18:31	MxB/TL1	SW846 3540C	SW846-8082A
Aroclor-1221	ND		1	0.24	mg/kg	12/30/25 15:40	12/31/25 18:31	MxB/TL1	SW846 3540C	SW846-8082A
Aroclor-1232	ND		1	0.24	mg/kg	12/30/25 15:40	12/31/25 18:31	MxB/TL1	SW846 3540C	SW846-8082A
Aroclor-1242	4.0		1	0.24	mg/kg	12/30/25 15:40	12/31/25 18:31	MxB/TL1	SW846 3540C	SW846-8082A
Aroclor-1248	ND		1	0.24	mg/kg	12/30/25 15:40	12/31/25 18:31	MxB/TL1	SW846 3540C	SW846-8082A
Aroclor-1254	4.8		1	0.24	mg/kg	12/30/25 15:40	12/31/25 18:31	MxB/TL1	SW846 3540C	SW846-8082A
Aroclor-1260	ND		1	0.24	mg/kg	12/30/25 15:40	12/31/25 18:31	MxB/TL1	SW846 3540C	SW846-8082A
Aroclor-1262	ND		1	0.24	mg/kg	12/30/25 15:40	12/31/25 18:31	MxB/TL1	SW846 3540C	SW846-8082A
Aroclor-1268	ND		1	0.24	mg/kg	12/30/25 15:40	12/31/25 18:31	MxB/TL1	SW846 3540C	SW846-8082A
Surrogate(s)	Recovery	Q		Limits						
<i>Surrogate: Tetrachloro-m-xylene</i>	91%			10-112		12/30/25 15:40	12/31/25 18:31	MxB/TL1	SW846 3540C	SW846-8082A
<i>Surrogate: Decachlorobiphenyl</i>	90%			10-123		12/30/25 15:40	12/31/25 18:31	MxB/TL1	SW846 3540C	SW846-8082A

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax:cs@emsl.com
EMSL-CIN-01

Table of Contents**EMSL Order ID:** 012340401**LIMS Reference ID:** AD46401**EMSL Customer ID:** WSPN36**Attention:** AP

WSP Canada, Inc. [WSPN36]
36 Pippy Place
Saint John's, NL A1B 4A5
(709) 722-7023
capayablesinvoice@wsp.com

Project Name:

CA0037087.2445-NAVFAC Paint Sampling

Project ID:

_Master Project-WSPN36

Customer PO:**Sales Rep:**

Sarah Jamieson

Received:

12/29/2025 09:00

Reported:**Sample Results****(Continued)**

Sample: TE-Rm53-PCB015A/TE Bldg. Room 53/Sky blue on drywall wall
AD46401-29 (Solid)

Analyte	Result	Q	DF	RL	Units	Prepared Date/Time	Analyzed Date/Time	Prep/Analyst Initials	Prep Method	Analytical Method
GC-SVOA										
Aroclor-1016	ND		1	0.24	mg/kg	12/30/25 15:40	12/31/25 18:53	MxB/TL1	SW846 3540C	SW846-8082A
Aroclor-1221	ND		1	0.24	mg/kg	12/30/25 15:40	12/31/25 18:53	MxB/TL1	SW846 3540C	SW846-8082A
Aroclor-1232	ND		1	0.24	mg/kg	12/30/25 15:40	12/31/25 18:53	MxB/TL1	SW846 3540C	SW846-8082A
Aroclor-1242	4.7		1	0.24	mg/kg	12/30/25 15:40	12/31/25 18:53	MxB/TL1	SW846 3540C	SW846-8082A
Aroclor-1248	ND		1	0.24	mg/kg	12/30/25 15:40	12/31/25 18:53	MxB/TL1	SW846 3540C	SW846-8082A
Aroclor-1254	2.8		1	0.24	mg/kg	12/30/25 15:40	12/31/25 18:53	MxB/TL1	SW846 3540C	SW846-8082A
Aroclor-1260	ND		1	0.24	mg/kg	12/30/25 15:40	12/31/25 18:53	MxB/TL1	SW846 3540C	SW846-8082A
Aroclor-1262	ND		1	0.24	mg/kg	12/30/25 15:40	12/31/25 18:53	MxB/TL1	SW846 3540C	SW846-8082A
Aroclor-1268	ND		1	0.24	mg/kg	12/30/25 15:40	12/31/25 18:53	MxB/TL1	SW846 3540C	SW846-8082A
Surrogate(s)	Recovery	Q		Limits						
<i>Surrogate: Tetrachloro-m-xylene</i>	82%			10-112		12/30/25 15:40	12/31/25 18:53	MxB/TL1	SW846 3540C	SW846-8082A
<i>Surrogate: Decachlorobiphenyl</i>	78%			10-123		12/30/25 15:40	12/31/25 18:53	MxB/TL1	SW846 3540C	SW846-8082A

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax:cs@emsl.com
EMSL-CIN-01

Table of Contents**EMSL Order ID:** 012340401**LIMS Reference ID:** AD46401**EMSL Customer ID:** WSPN36**Attention:** AP

WSP Canada, Inc. [WSPN36]
36 Pippy Place
Saint John's, NL A1B 4A5
(709) 722-7023
capayablesinvoice@wsp.com

Project Name:

CA0037087.2445-NAVFAC Paint Sampling

Project ID:

_Master Project-WSPN36

Customer PO:**Sales Rep:**

Sarah Jamieson

Received:

12/29/2025 09:00

Reported:**Sample Results****(Continued)**

Sample: TE-Rm72-PCB015B/TE Bldg. Room 72/Sky blue on drywall wall
AD46401-30 (Solid)

Analyte	Result	Q	DF	RL	Units	Prepared Date/Time	Analyzed Date/Time	Prep/Analyst Initials	Prep Method	Analytical Method
GC-SVOA										
Aroclor-1016	ND		1	0.25	mg/kg	12/30/25 13:04	12/31/25 21:46	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1221	ND		1	0.25	mg/kg	12/30/25 13:04	12/31/25 21:46	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1232	ND		1	0.25	mg/kg	12/30/25 13:04	12/31/25 21:46	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1242	2.9		1	0.25	mg/kg	12/30/25 13:04	12/31/25 21:46	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1248	ND		1	0.25	mg/kg	12/30/25 13:04	12/31/25 21:46	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1254	3.6		1	0.25	mg/kg	12/30/25 13:04	12/31/25 21:46	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1260	ND		1	0.25	mg/kg	12/30/25 13:04	12/31/25 21:46	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1262	ND		1	0.25	mg/kg	12/30/25 13:04	12/31/25 21:46	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1268	ND		1	0.25	mg/kg	12/30/25 13:04	12/31/25 21:46	NP2/AxJ	SW846 3546	SW846-8082A
Surrogate(s)	Recovery	Q		Limits						
<i>Surrogate: Tetrachloro-m-xylene</i>	71%			10-112		12/30/25 13:04	12/31/25 21:46	NP2/AxJ	SW846 3546	SW846-8082A
<i>Surrogate: Decachlorobiphenyl</i>	65%			10-123		12/30/25 13:04	12/31/25 21:46	NP2/AxJ	SW846 3546	SW846-8082A

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax:cs@emsl.com
EMSL-CIN-01

Table of Contents

EMSL Order ID: 012340401

LIMS Reference ID: AD46401

EMSL Customer ID: WSPN36

Attention: AP

WSP Canada, Inc. [WSPN36]
36 Pippy Place
Saint John's, NL A1B 4A5
(709) 722-7023
capayablesinvoice@wsp.com

Project Name:

CA0037087.2445-NAVFAC Paint Sampling

Project ID:

_Master Project-WSPN36

Customer PO:**Sales Rep:**

Sarah Jamieson

Received:

12/29/2025 09:00

Reported:**Sample Results**

(Continued)

Sample: TE-Rm74-PCB016A/TE Bldg. Room 74/Very light green on plaster wall
AD46401-31 (Solid)

Analyte	Result	Q	DF	RL	Units	Prepared Date/Time	Analyzed Date/Time	Prep/Analyst Initials	Prep Method	Analytical Method
GC-SVOA										
Aroclor-1016	ND	D	2	0.49	mg/kg	12/30/25 15:40	01/02/26 13:20	MxB/AxJ	SW846 3540C	SW846-8082A
Aroclor-1221	ND	D	2	0.49	mg/kg	12/30/25 15:40	01/02/26 13:20	MxB/AxJ	SW846 3540C	SW846-8082A
Aroclor-1232	ND	D	2	0.49	mg/kg	12/30/25 15:40	01/02/26 13:20	MxB/AxJ	SW846 3540C	SW846-8082A
Aroclor-1242	3.8	D	2	0.49	mg/kg	12/30/25 15:40	01/02/26 13:20	MxB/AxJ	SW846 3540C	SW846-8082A
Aroclor-1248	ND	D	2	0.49	mg/kg	12/30/25 15:40	01/02/26 13:20	MxB/AxJ	SW846 3540C	SW846-8082A
Aroclor-1254	11	D	2	0.49	mg/kg	12/30/25 15:40	01/02/26 13:20	MxB/AxJ	SW846 3540C	SW846-8082A
Aroclor-1260	5.7	D	2	0.49	mg/kg	12/30/25 15:40	01/02/26 13:20	MxB/AxJ	SW846 3540C	SW846-8082A
Aroclor-1262	ND	D	2	0.49	mg/kg	12/30/25 15:40	01/02/26 13:20	MxB/AxJ	SW846 3540C	SW846-8082A
Aroclor-1268	ND	D	2	0.49	mg/kg	12/30/25 15:40	01/02/26 13:20	MxB/AxJ	SW846 3540C	SW846-8082A
Surrogate(s)	Recovery	Q	Limits							
<i>Surrogate: Tetrachloro-m-xylene</i>	100%		10-112			12/30/25 15:40	01/02/26 13:20	MxB/AxJ	SW846 3540C	SW846-8082A
<i>Surrogate: Decachlorobiphenyl</i>	102%		10-123			12/30/25 15:40	01/02/26 13:20	MxB/AxJ	SW846 3540C	SW846-8082A

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax:cs@emsl.com
EMSL-CIN-01

Table of Contents

EMSL Order ID: 012340401

LIMS Reference ID: AD46401

EMSL Customer ID: WSPN36

Attention: AP

WSP Canada, Inc. [WSPN36]
36 Pippy Place
Saint John's, NL A1B 4A5
(709) 722-7023
capayablesinvoice@wsp.com

Project Name:

CA0037087.2445-NAVFAC Paint Sampling

Project ID:

_Master Project-WSPN36

Customer PO:**Sales Rep:**

Sarah Jamieson

Received:

12/29/2025 09:00

Reported:**Sample Results**

(Continued)

Sample: TE-Rm74-PCB016B/TE Bldg. Room 74/Very light green on plaster wall
AD46401-32 (Solid)

Analyte	Result	Q	DF	RL	Units	Prepared Date/Time	Analyzed Date/Time	Prep/Analyst Initials	Prep Method	Analytical Method
GC-SVOA										
Aroclor-1016	ND	D	2	0.49	mg/kg	12/30/25 15:40	01/02/26 13:41	MxB/AxJ	SW846 3540C	SW846-8082A
Aroclor-1221	ND	D	2	0.49	mg/kg	12/30/25 15:40	01/02/26 13:41	MxB/AxJ	SW846 3540C	SW846-8082A
Aroclor-1232	ND	D	2	0.49	mg/kg	12/30/25 15:40	01/02/26 13:41	MxB/AxJ	SW846 3540C	SW846-8082A
Aroclor-1242	4.2	D	2	0.49	mg/kg	12/30/25 15:40	01/02/26 13:41	MxB/AxJ	SW846 3540C	SW846-8082A
Aroclor-1248	ND	D	2	0.49	mg/kg	12/30/25 15:40	01/02/26 13:41	MxB/AxJ	SW846 3540C	SW846-8082A
Aroclor-1254	12	D	2	0.49	mg/kg	12/30/25 15:40	01/02/26 13:41	MxB/AxJ	SW846 3540C	SW846-8082A
Aroclor-1260	2.0	D	2	0.49	mg/kg	12/30/25 15:40	01/02/26 13:41	MxB/AxJ	SW846 3540C	SW846-8082A
Aroclor-1262	ND	D	2	0.49	mg/kg	12/30/25 15:40	01/02/26 13:41	MxB/AxJ	SW846 3540C	SW846-8082A
Aroclor-1268	ND	D	2	0.49	mg/kg	12/30/25 15:40	01/02/26 13:41	MxB/AxJ	SW846 3540C	SW846-8082A
Surrogate(s)	Recovery	Q	Limits							
<i>Surrogate: Tetrachloro-m-xylene</i>	87%		10-112			12/30/25 15:40	01/02/26 13:41	MxB/AxJ	SW846 3540C	SW846-8082A
<i>Surrogate: Decachlorobiphenyl</i>	92%		10-123			12/30/25 15:40	01/02/26 13:41	MxB/AxJ	SW846 3540C	SW846-8082A

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax:cs@emsl.com
EMSL-CIN-01

Table of Contents**EMSL Order ID:** 012340401**LIMS Reference ID:** AD46401**EMSL Customer ID:** WSPN36**Attention:** AP

WSP Canada, Inc. [WSPN36]
36 Pippy Place
Saint John's, NL A1B 4A5
(709) 722-7023
capayablesinvoice@wsp.com

Project Name:

CA0037087.2445-NAVFAC Paint Sampling

Project ID:

_Master Project-WSPN36

Customer PO:**Sales Rep:**

Sarah Jamieson

Received:

12/29/2025 09:00

Reported:**Sample Results****(Continued)**

Sample: TE-Rm57-PCB017A/TE Bldg. Room 57/Blue on drywall wall
AD46401-33 (Solid)

Analyte	Result	Q	DF	RL	Units	Prepared Date/Time	Analyzed Date/Time	Prep/Analyst Initials	Prep Method	Analytical Method
GC-SVOA										
Aroclor-1016	ND		1	0.25	mg/kg	12/30/25 15:40	12/31/25 19:59	MxB/TL1	SW846 3540C	SW846-8082A
Aroclor-1221	ND		1	0.25	mg/kg	12/30/25 15:40	12/31/25 19:59	MxB/TL1	SW846 3540C	SW846-8082A
Aroclor-1232	ND		1	0.25	mg/kg	12/30/25 15:40	12/31/25 19:59	MxB/TL1	SW846 3540C	SW846-8082A
Aroclor-1242	1.4		1	0.25	mg/kg	12/30/25 15:40	12/31/25 19:59	MxB/TL1	SW846 3540C	SW846-8082A
Aroclor-1248	ND		1	0.25	mg/kg	12/30/25 15:40	12/31/25 19:59	MxB/TL1	SW846 3540C	SW846-8082A
Aroclor-1254	2.6		1	0.25	mg/kg	12/30/25 15:40	12/31/25 19:59	MxB/TL1	SW846 3540C	SW846-8082A
Aroclor-1260	ND		1	0.25	mg/kg	12/30/25 15:40	12/31/25 19:59	MxB/TL1	SW846 3540C	SW846-8082A
Aroclor-1262	ND		1	0.25	mg/kg	12/30/25 15:40	12/31/25 19:59	MxB/TL1	SW846 3540C	SW846-8082A
Aroclor-1268	ND		1	0.25	mg/kg	12/30/25 15:40	12/31/25 19:59	MxB/TL1	SW846 3540C	SW846-8082A
Surrogate(s)	Recovery	Q	Limits							
<i>Surrogate: Tetrachloro-m-xylene</i>	76%		10-112			12/30/25 15:40	12/31/25 19:59	MxB/TL1	SW846 3540C	SW846-8082A
<i>Surrogate: Decachlorobiphenyl</i>	78%		10-123			12/30/25 15:40	12/31/25 19:59	MxB/TL1	SW846 3540C	SW846-8082A

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax:cs@emsl.com
EMSL-CIN-01

Table of Contents**EMSL Order ID:** 012340401**LIMS Reference ID:** AD46401**EMSL Customer ID:** WSPN36**Attention:** AP

WSP Canada, Inc. [WSPN36]
36 Pippy Place
Saint John's, NL A1B 4A5
(709) 722-7023
capayablesinvoice@wsp.com

Project Name:

CA0037087.2445-NAVFAC Paint Sampling

Project ID:

_Master Project-WSPN36

Customer PO:**Sales Rep:**

Sarah Jamieson

Received:

12/29/2025 09:00

Reported:**Sample Results****(Continued)**

Sample: TE-Rm21-PCB017B/TE Bldg. Room 21/Blue on plaster wall
AD46401-34 (Solid)

Analyte	Result	Q	DF	RL	Units	Prepared Date/Time	Analyzed Date/Time	Prep/Analyst Initials	Prep Method	Analytical Method
GC-SVOA										
Aroclor-1016	ND		1	0.25	mg/kg	12/30/25 15:40	12/31/25 20:20	MxB/TL1	SW846 3540C	SW846-8082A
Aroclor-1221	ND		1	0.25	mg/kg	12/30/25 15:40	12/31/25 20:20	MxB/TL1	SW846 3540C	SW846-8082A
Aroclor-1232	ND		1	0.25	mg/kg	12/30/25 15:40	12/31/25 20:20	MxB/TL1	SW846 3540C	SW846-8082A
Aroclor-1242	5.0		1	0.25	mg/kg	12/30/25 15:40	12/31/25 20:20	MxB/TL1	SW846 3540C	SW846-8082A
Aroclor-1248	ND		1	0.25	mg/kg	12/30/25 15:40	12/31/25 20:20	MxB/TL1	SW846 3540C	SW846-8082A
Aroclor-1254	6.7		1	0.25	mg/kg	12/30/25 15:40	12/31/25 20:20	MxB/TL1	SW846 3540C	SW846-8082A
Aroclor-1260	0.87		1	0.25	mg/kg	12/30/25 15:40	12/31/25 20:20	MxB/TL1	SW846 3540C	SW846-8082A
Aroclor-1262	ND		1	0.25	mg/kg	12/30/25 15:40	12/31/25 20:20	MxB/TL1	SW846 3540C	SW846-8082A
Aroclor-1268	ND		1	0.25	mg/kg	12/30/25 15:40	12/31/25 20:20	MxB/TL1	SW846 3540C	SW846-8082A
Surrogate(s)	Recovery	Q	Limits							
<i>Surrogate: Tetrachloro-m-xylene</i>	81%		10-112			12/30/25 15:40	12/31/25 20:20	MxB/TL1	SW846 3540C	SW846-8082A
<i>Surrogate: Decachlorobiphenyl</i>	85%		10-123			12/30/25 15:40	12/31/25 20:20	MxB/TL1	SW846 3540C	SW846-8082A

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
 Telephone: 856-858-4800 Fax:cs@emsl.com
 EMSL-CIN-01

EMSL Order ID: 012340401

LIMS Reference ID: AD46401

EMSL Customer ID: WSPN36

Attention: AP

WSP Canada, Inc. [WSPN36]
 36 Pippy Place
 Saint John's, NL A1B 4A5
 (709) 722-7023
 capayablesinvoice@wsp.com

Project Name:

CA0037087.2445-NAVFAC Paint Sampling

Project ID:

_Master Project-WSPN36

Customer PO:**Sales Rep:**

Sarah Jamieson

Received:

12/29/2025 09:00

Reported:**Sample Results**

(Continued)

Sample: TE-Rm40-PCB018A/TE Bldg. Room 40/Grey on concrete floor
AD46401-35 (Solid)

Analyte	Result	Q	DF	RL	Units	Prepared Date/Time	Analyzed Date/Time	Prep/Analyst Initials	Prep Method	Analytical Method
GC-SVOA										
Aroclor-1016	ND		1	0.36	mg/kg	12/30/25 15:40	12/31/25 20:42	MxB/TL1	SW846 3540C	SW846-8082A
Aroclor-1221	ND		1	0.36	mg/kg	12/30/25 15:40	12/31/25 20:42	MxB/TL1	SW846 3540C	SW846-8082A
Aroclor-1232	2.3		1	0.36	mg/kg	12/30/25 15:40	12/31/25 20:42	MxB/TL1	SW846 3540C	SW846-8082A
Aroclor-1242	ND		1	0.36	mg/kg	12/30/25 15:40	12/31/25 20:42	MxB/TL1	SW846 3540C	SW846-8082A
Aroclor-1248	ND		1	0.36	mg/kg	12/30/25 15:40	12/31/25 20:42	MxB/TL1	SW846 3540C	SW846-8082A
Aroclor-1254	6.7		1	0.36	mg/kg	12/30/25 15:40	12/31/25 20:42	MxB/TL1	SW846 3540C	SW846-8082A
Aroclor-1260	1.2		1	0.36	mg/kg	12/30/25 15:40	12/31/25 20:42	MxB/TL1	SW846 3540C	SW846-8082A
Aroclor-1262	ND		1	0.36	mg/kg	12/30/25 15:40	12/31/25 20:42	MxB/TL1	SW846 3540C	SW846-8082A
Aroclor-1268	ND		1	0.36	mg/kg	12/30/25 15:40	12/31/25 20:42	MxB/TL1	SW846 3540C	SW846-8082A
Surrogate(s)	Recovery	Q	Limits							
<i>Surrogate: Tetrachloro-m-xylene</i>	83%		10-112			12/30/25 15:40	12/31/25 20:42	MxB/TL1	SW846 3540C	SW846-8082A
<i>Surrogate: Decachlorobiphenyl</i>	98%		10-123			12/30/25 15:40	12/31/25 20:42	MxB/TL1	SW846 3540C	SW846-8082A

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
 Telephone: 856-858-4800 Fax:cs@emsl.com
 EMSL-CIN-01

EMSL Order ID: 012340401

LIMS Reference ID: AD46401

EMSL Customer ID: WSPN36

Attention: AP

WSP Canada, Inc. [WSPN36]
 36 Pippy Place
 Saint John's, NL A1B 4A5
 (709) 722-7023
 capayablesinvoice@wsp.com

Project Name:

CA0037087.2445-NAVFAC Paint Sampling

Project ID:

_Master Project-WSPN36

Customer PO:**Sales Rep:**

Sarah Jamieson

Received:

12/29/2025 09:00

Reported:**Sample Results**

(Continued)

Sample: TE-Rm40-PCB018B/TE Bldg. Room 40/Grey on concrete floor
AD46401-36 (Solid)

Analyte	Result	Q	DF	RL	Units	Prepared Date/Time	Analyzed Date/Time	Prep/Analyst Initials	Prep Method	Analytical Method
GC-SVOA										
Aroclor-1016	ND		1	0.47	mg/kg	12/30/25 15:40	12/31/25 21:03	MxB/TL1	SW846 3540C	SW846-8082A
Aroclor-1221	ND		1	0.47	mg/kg	12/30/25 15:40	12/31/25 21:03	MxB/TL1	SW846 3540C	SW846-8082A
Aroclor-1232	2.1		1	0.47	mg/kg	12/30/25 15:40	12/31/25 21:03	MxB/TL1	SW846 3540C	SW846-8082A
Aroclor-1242	ND		1	0.47	mg/kg	12/30/25 15:40	12/31/25 21:03	MxB/TL1	SW846 3540C	SW846-8082A
Aroclor-1248	ND		1	0.47	mg/kg	12/30/25 15:40	12/31/25 21:03	MxB/TL1	SW846 3540C	SW846-8082A
Aroclor-1254	5.2		1	0.47	mg/kg	12/30/25 15:40	12/31/25 21:03	MxB/TL1	SW846 3540C	SW846-8082A
Aroclor-1260	1.0		1	0.47	mg/kg	12/30/25 15:40	12/31/25 21:03	MxB/TL1	SW846 3540C	SW846-8082A
Aroclor-1262	ND		1	0.47	mg/kg	12/30/25 15:40	12/31/25 21:03	MxB/TL1	SW846 3540C	SW846-8082A
Aroclor-1268	ND		1	0.47	mg/kg	12/30/25 15:40	12/31/25 21:03	MxB/TL1	SW846 3540C	SW846-8082A
Surrogate(s)	Recovery	Q	Limits							
<i>Surrogate: Tetrachloro-m-xylene</i>	72%		10-112			12/30/25 15:40	12/31/25 21:03	MxB/TL1	SW846 3540C	SW846-8082A
<i>Surrogate: Decachlorobiphenyl</i>	81%		10-123			12/30/25 15:40	12/31/25 21:03	MxB/TL1	SW846 3540C	SW846-8082A

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax:cs@emsl.com
EMSL-CIN-01

Table of Contents**EMSL Order ID:** 012340401**LIMS Reference ID:** AD46401**EMSL Customer ID:** WSPN36**Attention:** AP

WSP Canada, Inc. [WSPN36]
36 Pippy Place
Saint John's, NL A1B 4A5
(709) 722-7023
capayablesinvoice@wsp.com

Project Name:

CA0037087.2445-NAVFAC Paint Sampling

Project ID:

_Master Project-WSPN36

Customer PO:**Sales Rep:**

Sarah Jamieson

Received:

12/29/2025 09:00

Reported:**Sample Results****(Continued)**

Sample: TE-Rm25-PCB019A/TE Bldg. Room 25/Bluish black on drywall ceiling
AD46401-37 (Solid)

Analyte	Result	Q	DF	RL	Units	Prepared Date/Time	Analyzed Date/Time	Prep/Analyst Initials	Prep Method	Analytical Method
GC-SVOA										
Aroclor-1016	ND	D	2	0.49	mg/kg	12/30/25 15:40	01/02/26 14:04	MxB/AxJ	SW846 3540C	SW846-8082A
Aroclor-1221	ND	D	2	0.49	mg/kg	12/30/25 15:40	01/02/26 14:04	MxB/AxJ	SW846 3540C	SW846-8082A
Aroclor-1232	ND	D	2	0.49	mg/kg	12/30/25 15:40	01/02/26 14:04	MxB/AxJ	SW846 3540C	SW846-8082A
Aroclor-1242	ND	D	2	0.49	mg/kg	12/30/25 15:40	01/02/26 14:04	MxB/AxJ	SW846 3540C	SW846-8082A
Aroclor-1248	ND	D	2	0.49	mg/kg	12/30/25 15:40	01/02/26 14:04	MxB/AxJ	SW846 3540C	SW846-8082A
Aroclor-1254	7.0	D	2	0.49	mg/kg	12/30/25 15:40	01/02/26 14:04	MxB/AxJ	SW846 3540C	SW846-8082A
Aroclor-1260	1.3	D	2	0.49	mg/kg	12/30/25 15:40	01/02/26 14:04	MxB/AxJ	SW846 3540C	SW846-8082A
Aroclor-1262	ND	D	2	0.49	mg/kg	12/30/25 15:40	01/02/26 14:04	MxB/AxJ	SW846 3540C	SW846-8082A
Aroclor-1268	ND	D	2	0.49	mg/kg	12/30/25 15:40	01/02/26 14:04	MxB/AxJ	SW846 3540C	SW846-8082A
Surrogate(s)	Recovery	Q	Limits							
Surrogate: Tetrachloro-m-xylene	86%		10-112			12/30/25 15:40	01/02/26 14:04	MxB/AxJ	SW846 3540C	SW846-8082A
Surrogate: Decachlorobiphenyl	92%		10-123			12/30/25 15:40	01/02/26 14:04	MxB/AxJ	SW846 3540C	SW846-8082A

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax:cs@emsl.com
EMSL-CIN-01

Table of Contents**EMSL Order ID:** 012340401**LIMS Reference ID:** AD46401**EMSL Customer ID:** WSPN36**Attention:** AP

WSP Canada, Inc. [WSPN36]
36 Pippy Place
Saint John's, NL A1B 4A5
(709) 722-7023
capayablesinvoice@wsp.com

Project Name:

CA0037087.2445-NAVFAC Paint Sampling

Project ID:

_Master Project-WSPN36

Customer PO:**Sales Rep:**

Sarah Jamieson

Received:

12/29/2025 09:00

Reported:**Sample Results****(Continued)**

Sample: TE-Rm23-PCB019B/TE Bldg. Room 23/Bluish black on drywall ceiling
AD46401-38 (Solid)

Analyte	Result	Q	DF	RL	Units	Prepared Date/Time	Analyzed Date/Time	Prep/Analyst Initials	Prep Method	Analytical Method
GC-SVOA										
Aroclor-1016	ND	D	2	0.50	mg/kg	12/30/25 13:04	01/02/26 13:19	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1221	ND	D	2	0.50	mg/kg	12/30/25 13:04	01/02/26 13:19	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1232	ND	D	2	0.50	mg/kg	12/30/25 13:04	01/02/26 13:19	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1242	ND	D	2	0.50	mg/kg	12/30/25 13:04	01/02/26 13:19	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1248	ND	D	2	0.50	mg/kg	12/30/25 13:04	01/02/26 13:19	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1254	11	D	2	0.50	mg/kg	12/30/25 13:04	01/02/26 13:19	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1260	3.2	D	2	0.50	mg/kg	12/30/25 13:04	01/02/26 13:19	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1262	ND	D	2	0.50	mg/kg	12/30/25 13:04	01/02/26 13:19	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1268	ND	D	2	0.50	mg/kg	12/30/25 13:04	01/02/26 13:19	NP2/AxJ	SW846 3546	SW846-8082A
Surrogate(s)	Recovery	Q	Limits							
<i>Surrogate: Tetrachloro-m-xylene</i>	70%		10-112			12/30/25 13:04	01/02/26 13:19	NP2/AxJ	SW846 3546	SW846-8082A
<i>Surrogate: Decachlorobiphenyl</i>	74%		10-123			12/30/25 13:04	01/02/26 13:19	NP2/AxJ	SW846 3546	SW846-8082A

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax:cs@emsl.com
EMSL-CIN-01

Table of Contents**EMSL Order ID:** 012340401**LIMS Reference ID:** AD46401**EMSL Customer ID:** WSPN36**Attention:** AP

WSP Canada, Inc. [WSPN36]
36 Pippy Place
Saint John's, NL A1B 4A5
(709) 722-7023
capayablesinvoice@wsp.com

Project Name:

CA0037087.2445-NAVFAC Paint Sampling

Project ID:

_Master Project-WSPN36

Customer PO:**Sales Rep:**

Sarah Jamieson

Received:

12/29/2025 09:00

Reported:**Sample Results****(Continued)**

Sample: TE-Ext-PCB020A/TE Bldg. exterior/V. light brown on concrete wall
AD46401-39 (Solid)

Analyte	Result	Q	DF	RL	Units	Prepared Date/Time	Analyzed Date/Time	Prep/Analyst Initials	Prep Method	Analytical Method
GC-SVOA										
Aroclor-1016	ND		1	0.24	mg/kg	12/30/25 15:40	12/31/25 21:46	MxB/TL1	SW846 3540C	SW846-8082A
Aroclor-1221	ND		1	0.24	mg/kg	12/30/25 15:40	12/31/25 21:46	MxB/TL1	SW846 3540C	SW846-8082A
Aroclor-1232	ND		1	0.24	mg/kg	12/30/25 15:40	12/31/25 21:46	MxB/TL1	SW846 3540C	SW846-8082A
Aroclor-1242	ND		1	0.24	mg/kg	12/30/25 15:40	12/31/25 21:46	MxB/TL1	SW846 3540C	SW846-8082A
Aroclor-1248	ND		1	0.24	mg/kg	12/30/25 15:40	12/31/25 21:46	MxB/TL1	SW846 3540C	SW846-8082A
Aroclor-1254	ND		1	0.24	mg/kg	12/30/25 15:40	12/31/25 21:46	MxB/TL1	SW846 3540C	SW846-8082A
Aroclor-1260	ND		1	0.24	mg/kg	12/30/25 15:40	12/31/25 21:46	MxB/TL1	SW846 3540C	SW846-8082A
Aroclor-1262	ND		1	0.24	mg/kg	12/30/25 15:40	12/31/25 21:46	MxB/TL1	SW846 3540C	SW846-8082A
Aroclor-1268	ND		1	0.24	mg/kg	12/30/25 15:40	12/31/25 21:46	MxB/TL1	SW846 3540C	SW846-8082A
Surrogate(s)	Recovery	Q	Limits							
<i>Surrogate: Tetrachloro-m-xylene</i>	86%		10-112			12/30/25 15:40	12/31/25 21:46	MxB/TL1	SW846 3540C	SW846-8082A
<i>Surrogate: Decachlorobiphenyl</i>	86%		10-123			12/30/25 15:40	12/31/25 21:46	MxB/TL1	SW846 3540C	SW846-8082A

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax:cs@emsl.com
EMSL-CIN-01

Table of Contents**EMSL Order ID:** 012340401**LIMS Reference ID:** AD46401**EMSL Customer ID:** WSPN36**Attention:** AP

WSP Canada, Inc. [WSPN36]
36 Pippy Place
Saint John's, NL A1B 4A5
(709) 722-7023
capayablesinvoice@wsp.com

Project Name:

CA0037087.2445-NAVFAC Paint Sampling

Project ID:

_Master Project-WSPN36

Customer PO:**Sales Rep:**

Sarah Jamieson

Received:

12/29/2025 09:00

Reported:**Sample Results****(Continued)**

Sample: TE-Ext-PCB020B/TE Bldg. exterior/V. light brown on concrete wall
AD46401-40 (Solid)

Analyte	Result	Q	DF	RL	Units	Prepared Date/Time	Analyzed Date/Time	Prep/Analyst Initials	Prep Method	Analytical Method
GC-SVOA										
Aroclor-1016	ND		1	0.25	mg/kg	01/02/26 14:20	01/05/26 13:46	TAY/TL1	SW846 3540C	SW846-8082A
Aroclor-1221	ND		1	0.25	mg/kg	01/02/26 14:20	01/05/26 13:46	TAY/TL1	SW846 3540C	SW846-8082A
Aroclor-1232	ND		1	0.25	mg/kg	01/02/26 14:20	01/05/26 13:46	TAY/TL1	SW846 3540C	SW846-8082A
Aroclor-1242	ND		1	0.25	mg/kg	01/02/26 14:20	01/05/26 13:46	TAY/TL1	SW846 3540C	SW846-8082A
Aroclor-1248	ND		1	0.25	mg/kg	01/02/26 14:20	01/05/26 13:46	TAY/TL1	SW846 3540C	SW846-8082A
Aroclor-1254	ND		1	0.25	mg/kg	01/02/26 14:20	01/05/26 13:46	TAY/TL1	SW846 3540C	SW846-8082A
Aroclor-1260	ND		1	0.25	mg/kg	01/02/26 14:20	01/05/26 13:46	TAY/TL1	SW846 3540C	SW846-8082A
Aroclor-1262	ND		1	0.25	mg/kg	01/02/26 14:20	01/05/26 13:46	TAY/TL1	SW846 3540C	SW846-8082A
Aroclor-1268	ND		1	0.25	mg/kg	01/02/26 14:20	01/05/26 13:46	TAY/TL1	SW846 3540C	SW846-8082A
Surrogate(s)	Recovery	Q	Limits							
<i>Surrogate: Tetrachloro-m-xylene</i>	74%		10-112			01/02/26 14:20	01/05/26 13:46	TAY/TL1	SW846 3540C	SW846-8082A
<i>Surrogate: Decachlorobiphenyl</i>	73%		10-123			01/02/26 14:20	01/05/26 13:46	TAY/TL1	SW846 3540C	SW846-8082A

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax:cs@emsl.com
EMSL-CIN-01

Table of Contents**EMSL Order ID:** 012340401**LIMS Reference ID:** AD46401**EMSL Customer ID:** WSPN36**Attention:** AP

WSP Canada, Inc. [WSPN36]
36 Pippy Place
Saint John's, NL A1B 4A5
(709) 722-7023
capayablesinvoice@wsp.com

Project Name:

CA0037087.2445-NAVFAC Paint Sampling

Project ID:

_Master Project-WSPN36

Customer PO:**Sales Rep:**

Sarah Jamieson

Received:

12/29/2025 09:00

Reported:**Sample Results****(Continued)**

Sample: TE-Ext-PCB021A/TE Bldg. exterior/V. light brown on plywood wall
AD46401-41 (Solid)

Analyte	Result	Q	DF	RL	Units	Prepared Date/Time	Analyzed Date/Time	Prep/Analyst Initials	Prep Method	Analytical Method
GC-SVOA										
Aroclor-1016	ND		1	0.25	mg/kg	01/02/26 14:20	01/05/26 14:08	TAY/TL1	SW846 3540C	SW846-8082A
Aroclor-1221	ND		1	0.25	mg/kg	01/02/26 14:20	01/05/26 14:08	TAY/TL1	SW846 3540C	SW846-8082A
Aroclor-1232	ND		1	0.25	mg/kg	01/02/26 14:20	01/05/26 14:08	TAY/TL1	SW846 3540C	SW846-8082A
Aroclor-1242	ND		1	0.25	mg/kg	01/02/26 14:20	01/05/26 14:08	TAY/TL1	SW846 3540C	SW846-8082A
Aroclor-1248	ND		1	0.25	mg/kg	01/02/26 14:20	01/05/26 14:08	TAY/TL1	SW846 3540C	SW846-8082A
Aroclor-1254	ND		1	0.25	mg/kg	01/02/26 14:20	01/05/26 14:08	TAY/TL1	SW846 3540C	SW846-8082A
Aroclor-1260	ND		1	0.25	mg/kg	01/02/26 14:20	01/05/26 14:08	TAY/TL1	SW846 3540C	SW846-8082A
Aroclor-1262	ND		1	0.25	mg/kg	01/02/26 14:20	01/05/26 14:08	TAY/TL1	SW846 3540C	SW846-8082A
Aroclor-1268	ND		1	0.25	mg/kg	01/02/26 14:20	01/05/26 14:08	TAY/TL1	SW846 3540C	SW846-8082A
Surrogate(s)	Recovery	Q	Limits							
<i>Surrogate: Tetrachloro-m-xylene</i>	80%		10-112			01/02/26 14:20	01/05/26 14:08	TAY/TL1	SW846 3540C	SW846-8082A
<i>Surrogate: Decachlorobiphenyl</i>	80%		10-123			01/02/26 14:20	01/05/26 14:08	TAY/TL1	SW846 3540C	SW846-8082A

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax:cs@emsl.com
EMSL-CIN-01

Table of Contents**EMSL Order ID:** 012340401**LIMS Reference ID:** AD46401**EMSL Customer ID:** WSPN36**Attention:** AP

WSP Canada, Inc. [WSPN36]
36 Pippy Place
Saint John's, NL A1B 4A5
(709) 722-7023
capayablesinvoice@wsp.com

Project Name:

CA0037087.2445-NAVFAC Paint Sampling

Project ID:

_Master Project-WSPN36

Customer PO:**Sales Rep:**

Sarah Jamieson

Received:

12/29/2025 09:00

Reported:**Sample Results****(Continued)**

Sample: TE-Ext-PCB021B/TE Bldg. exterior/V. light brown on plywood wall
AD46401-42 (Solid)

Analyte	Result	Q	DF	RL	Units	Prepared Date/Time	Analyzed Date/Time	Prep/Analyst Initials	Prep Method	Analytical Method
GC-SVOA										
Aroclor-1016	ND		1	0.24	mg/kg	12/30/25 13:04	12/31/25 22:29	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1221	ND		1	0.24	mg/kg	12/30/25 13:04	12/31/25 22:29	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1232	ND		1	0.24	mg/kg	12/30/25 13:04	12/31/25 22:29	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1242	ND		1	0.24	mg/kg	12/30/25 13:04	12/31/25 22:29	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1248	ND		1	0.24	mg/kg	12/30/25 13:04	12/31/25 22:29	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1254	0.32		1	0.24	mg/kg	12/30/25 13:04	12/31/25 22:29	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1260	ND		1	0.24	mg/kg	12/30/25 13:04	12/31/25 22:29	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1262	ND		1	0.24	mg/kg	12/30/25 13:04	12/31/25 22:29	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1268	ND		1	0.24	mg/kg	12/30/25 13:04	12/31/25 22:29	NP2/AxJ	SW846 3546	SW846-8082A
Surrogate(s)	Recovery	Q	Limits							
<i>Surrogate: Tetrachloro-m-xylene</i>	77%		10-112			12/30/25 13:04	12/31/25 22:29	NP2/AxJ	SW846 3546	SW846-8082A
<i>Surrogate: Decachlorobiphenyl</i>	80%		10-123			12/30/25 13:04	12/31/25 22:29	NP2/AxJ	SW846 3546	SW846-8082A

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax:cs@emsl.com
EMSL-CIN-01

Table of Contents**EMSL Order ID:** 012340401**LIMS Reference ID:** AD46401**EMSL Customer ID:** WSPN36**Attention:** AP

WSP Canada, Inc. [WSPN36]
36 Pippy Place
Saint John's, NL A1B 4A5
(709) 722-7023
capayablesinvoice@wsp.com

Project Name:

CA0037087.2445-NAVFAC Paint Sampling

Project ID:

_Master Project-WSPN36

Customer PO:**Sales Rep:**

Sarah Jamieson

Received:

12/29/2025 09:00

Reported:**Sample Results****(Continued)**

Sample: TE-Ext-PCB022A/TE Bldg. exterior/V. light brown on concrete wall board
AD46401-43 (Solid)

Analyte	Result	Q	DF	RL	Units	Prepared Date/Time	Analyzed Date/Time	Prep/Analyst Initials	Prep Method	Analytical Method
GC-SVOA										
Aroclor-1016	ND		1	0.25	mg/kg	01/02/26 14:20	01/05/26 14:30	TAY/TL1	SW846 3540C	SW846-8082A
Aroclor-1221	ND		1	0.25	mg/kg	01/02/26 14:20	01/05/26 14:30	TAY/TL1	SW846 3540C	SW846-8082A
Aroclor-1232	ND		1	0.25	mg/kg	01/02/26 14:20	01/05/26 14:30	TAY/TL1	SW846 3540C	SW846-8082A
Aroclor-1242	ND		1	0.25	mg/kg	01/02/26 14:20	01/05/26 14:30	TAY/TL1	SW846 3540C	SW846-8082A
Aroclor-1248	ND		1	0.25	mg/kg	01/02/26 14:20	01/05/26 14:30	TAY/TL1	SW846 3540C	SW846-8082A
Aroclor-1254	ND		1	0.25	mg/kg	01/02/26 14:20	01/05/26 14:30	TAY/TL1	SW846 3540C	SW846-8082A
Aroclor-1260	ND		1	0.25	mg/kg	01/02/26 14:20	01/05/26 14:30	TAY/TL1	SW846 3540C	SW846-8082A
Aroclor-1262	ND		1	0.25	mg/kg	01/02/26 14:20	01/05/26 14:30	TAY/TL1	SW846 3540C	SW846-8082A
Aroclor-1268	ND		1	0.25	mg/kg	01/02/26 14:20	01/05/26 14:30	TAY/TL1	SW846 3540C	SW846-8082A
Surrogate(s)	Recovery	Q	Limits							
<i>Surrogate: Tetrachloro-m-xylene</i>	80%		10-112							
<i>Surrogate: Decachlorobiphenyl</i>	80%		10-123							

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax:cs@emsl.com
EMSL-CIN-01

Table of Contents**EMSL Order ID:** 012340401**LIMS Reference ID:** AD46401**EMSL Customer ID:** WSPN36**Attention:** AP

WSP Canada, Inc. [WSPN36]
36 Pippy Place
Saint John's, NL A1B 4A5
(709) 722-7023
capayablesinvoice@wsp.com

Project Name:

CA0037087.2445-NAVFAC Paint Sampling

Project ID:

_Master Project-WSPN36

Customer PO:**Sales Rep:**

Sarah Jamieson

Received:

12/29/2025 09:00

Reported:**Sample Results****(Continued)**

Sample: TE-Ext-PCB022B/TE Bldg. exterior/V. light brown on concrete wall board
AD46401-44 (Solid)

Analyte	Result	Q	DF	RL	Units	Prepared Date/Time	Analyzed Date/Time	Prep/Analyst Initials	Prep Method	Analytical Method
GC-SVOA										
Aroclor-1016	ND		1	0.53	mg/kg	01/02/26 14:20	01/05/26 14:52	TAY/TL1	SW846 3540C	SW846-8082A
Aroclor-1221	ND		1	0.53	mg/kg	01/02/26 14:20	01/05/26 14:52	TAY/TL1	SW846 3540C	SW846-8082A
Aroclor-1232	ND		1	0.53	mg/kg	01/02/26 14:20	01/05/26 14:52	TAY/TL1	SW846 3540C	SW846-8082A
Aroclor-1242	ND		1	0.53	mg/kg	01/02/26 14:20	01/05/26 14:52	TAY/TL1	SW846 3540C	SW846-8082A
Aroclor-1248	ND		1	0.53	mg/kg	01/02/26 14:20	01/05/26 14:52	TAY/TL1	SW846 3540C	SW846-8082A
Aroclor-1254	ND		1	0.53	mg/kg	01/02/26 14:20	01/05/26 14:52	TAY/TL1	SW846 3540C	SW846-8082A
Aroclor-1260	ND		1	0.53	mg/kg	01/02/26 14:20	01/05/26 14:52	TAY/TL1	SW846 3540C	SW846-8082A
Aroclor-1262	ND		1	0.53	mg/kg	01/02/26 14:20	01/05/26 14:52	TAY/TL1	SW846 3540C	SW846-8082A
Aroclor-1268	ND		1	0.53	mg/kg	01/02/26 14:20	01/05/26 14:52	TAY/TL1	SW846 3540C	SW846-8082A
Surrogate(s)	Recovery	Q	Limits							
<i>Surrogate: Tetrachloro-m-xylene</i>	75%		10-112			01/02/26 14:20	01/05/26 14:52	TAY/TL1	SW846 3540C	SW846-8082A
<i>Surrogate: Decachlorobiphenyl</i>	76%		10-123			01/02/26 14:20	01/05/26 14:52	TAY/TL1	SW846 3540C	SW846-8082A

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
 Telephone: 856-858-4800 Fax:cs@emsl.com
 EMSL-CIN-01

Table of Contents

EMSL Order ID: 012340401

LIMS Reference ID: AD46401

EMSL Customer ID: WSPN36

Attention: AP

WSP Canada, Inc. [WSPN36]
 36 Pippy Place
 Saint John's, NL A1B 4A5
 (709) 722-7023
 capayablesinvoice@wsp.com

Project Name:

CA0037087.2445-NAVFAC Paint Sampling

Project ID:

_Master Project-WSPN36

Customer PO:**Sales Rep:**

Sarah Jamieson

Received:

12/29/2025 09:00

Reported:**Sample Results**

(Continued)

Sample: TE-Ext-PCB023A/TE Bldg. exterior/V. light brown on metal pipe
AD46401-45 (Solid)

Analyte	Result	Q	DF	RL	Units	Prepared Date/Time	Analyzed Date/Time	Prep/Analyst Initials	Prep Method	Analytical Method
GC-SVOA										
Aroclor-1016	ND		1	0.25	mg/kg	01/02/26 14:20	01/05/26 15:14	TAY/TL1	SW846 3540C	SW846-8082A
Aroclor-1221	ND		1	0.25	mg/kg	01/02/26 14:20	01/05/26 15:14	TAY/TL1	SW846 3540C	SW846-8082A
Aroclor-1232	ND		1	0.25	mg/kg	01/02/26 14:20	01/05/26 15:14	TAY/TL1	SW846 3540C	SW846-8082A
Aroclor-1242	ND		1	0.25	mg/kg	01/02/26 14:20	01/05/26 15:14	TAY/TL1	SW846 3540C	SW846-8082A
Aroclor-1248	ND		1	0.25	mg/kg	01/02/26 14:20	01/05/26 15:14	TAY/TL1	SW846 3540C	SW846-8082A
Aroclor-1254	ND		1	0.25	mg/kg	01/02/26 14:20	01/05/26 15:14	TAY/TL1	SW846 3540C	SW846-8082A
Aroclor-1260	ND		1	0.25	mg/kg	01/02/26 14:20	01/05/26 15:14	TAY/TL1	SW846 3540C	SW846-8082A
Aroclor-1262	ND		1	0.25	mg/kg	01/02/26 14:20	01/05/26 15:14	TAY/TL1	SW846 3540C	SW846-8082A
Aroclor-1268	ND		1	0.25	mg/kg	01/02/26 14:20	01/05/26 15:14	TAY/TL1	SW846 3540C	SW846-8082A
Surrogate(s)	Recovery	Q	Limits							
<i>Surrogate: Tetrachloro-m-xylene</i>	88%		10-112							
<i>Surrogate: Decachlorobiphenyl</i>	83%		10-123							

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax:cs@emsl.com
EMSL-CIN-01

Table of Contents**EMSL Order ID:** 012340401**LIMS Reference ID:** AD46401**EMSL Customer ID:** WSPN36**Attention:** AP

WSP Canada, Inc. [WSPN36]
36 Pippy Place
Saint John's, NL A1B 4A5
(709) 722-7023
capayablesinvoice@wsp.com

Project Name:

CA0037087.2445-NAVFAC Paint Sampling

Project ID:

_Master Project-WSPN36

Customer PO:**Sales Rep:**

Sarah Jamieson

Received:

12/29/2025 09:00

Reported:**Sample Results****(Continued)**

Sample: TE-Ext-PCB023B/TE Bldg. exterior/V. light brown on metal pipe
AD46401-46 (Solid)

Analyte	Result	Q	DF	RL	Units	Prepared Date/Time	Analyzed Date/Time	Prep/Analyst Initials	Prep Method	Analytical Method
GC-SVOA										
Aroclor-1016	ND		1	0.24	mg/kg	01/02/26 14:20	01/05/26 15:36	TAY/TL1	SW846 3540C	SW846-8082A
Aroclor-1221	ND		1	0.24	mg/kg	01/02/26 14:20	01/05/26 15:36	TAY/TL1	SW846 3540C	SW846-8082A
Aroclor-1232	ND		1	0.24	mg/kg	01/02/26 14:20	01/05/26 15:36	TAY/TL1	SW846 3540C	SW846-8082A
Aroclor-1242	ND		1	0.24	mg/kg	01/02/26 14:20	01/05/26 15:36	TAY/TL1	SW846 3540C	SW846-8082A
Aroclor-1248	ND		1	0.24	mg/kg	01/02/26 14:20	01/05/26 15:36	TAY/TL1	SW846 3540C	SW846-8082A
Aroclor-1254	ND		1	0.24	mg/kg	01/02/26 14:20	01/05/26 15:36	TAY/TL1	SW846 3540C	SW846-8082A
Aroclor-1260	1.7		1	0.24	mg/kg	01/02/26 14:20	01/05/26 15:36	TAY/TL1	SW846 3540C	SW846-8082A
Aroclor-1262	ND		1	0.24	mg/kg	01/02/26 14:20	01/05/26 15:36	TAY/TL1	SW846 3540C	SW846-8082A
Aroclor-1268	ND		1	0.24	mg/kg	01/02/26 14:20	01/05/26 15:36	TAY/TL1	SW846 3540C	SW846-8082A
Surrogate(s)	Recovery	Q	Limits							
<i>Surrogate: Tetrachloro-m-xylene</i>	85%		10-112			01/02/26 14:20	01/05/26 15:36	TAY/TL1	SW846 3540C	SW846-8082A
<i>Surrogate: Decachlorobiphenyl</i>	75%		10-123			01/02/26 14:20	01/05/26 15:36	TAY/TL1	SW846 3540C	SW846-8082A

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax:cs@emsl.com
EMSL-CIN-01

EMSL Order ID: 012340401

LIMS Reference ID: AD46401

EMSL Customer ID: WSPN36

Attention: AP

WSP Canada, Inc. [WSPN36]
36 Pippy Place
Saint John's, NL A1B 4A5
(709) 722-7023
capayablesinvoice@wsp.com

Project Name:

CA0037087.2445-NAVFAC Paint Sampling

Project ID:

_Master Project-WSPN36

Customer PO:**Sales Rep:**

Sarah Jamieson

Received:

12/29/2025 09:00

Reported:**Sample Results**

(Continued)

Sample: TE-Rm73-PCB024A/TE Bldg. Room 73/Dark grey on metal door and frame
AD46401-47 (Solid)

Analyte	Result	Q	DF	RL	Units	Prepared Date/Time	Analyzed Date/Time	Prep/Analyst Initials	Prep Method	Analytical Method
GC-SVOA										
Aroclor-1016	ND	D	2	0.49	mg/kg	01/02/26 14:20	01/05/26 22:22	TAY/TL1	SW846 3540C	SW846-8082A
Aroclor-1221	ND	D	2	0.49	mg/kg	01/02/26 14:20	01/05/26 22:22	TAY/TL1	SW846 3540C	SW846-8082A
Aroclor-1232	ND	D	2	0.49	mg/kg	01/02/26 14:20	01/05/26 22:22	TAY/TL1	SW846 3540C	SW846-8082A
Aroclor-1242	4.2	D	2	0.49	mg/kg	01/02/26 14:20	01/05/26 22:22	TAY/TL1	SW846 3540C	SW846-8082A
Aroclor-1248	ND	D	2	0.49	mg/kg	01/02/26 14:20	01/05/26 22:22	TAY/TL1	SW846 3540C	SW846-8082A
Aroclor-1254	4.4	D	2	0.49	mg/kg	01/02/26 14:20	01/05/26 22:22	TAY/TL1	SW846 3540C	SW846-8082A
Aroclor-1260	ND	D	2	0.49	mg/kg	01/02/26 14:20	01/05/26 22:22	TAY/TL1	SW846 3540C	SW846-8082A
Aroclor-1262	ND	D	2	0.49	mg/kg	01/02/26 14:20	01/05/26 22:22	TAY/TL1	SW846 3540C	SW846-8082A
Aroclor-1268	ND	D	2	0.49	mg/kg	01/02/26 14:20	01/05/26 22:22	TAY/TL1	SW846 3540C	SW846-8082A
Surrogate(s)	Recovery	Q	Limits							
<i>Surrogate: Tetrachloro-m-xylene</i>	84%		10-112			01/02/26 14:20	01/05/26 22:22	TAY/TL1	SW846 3540C	SW846-8082A
<i>Surrogate: Decachlorobiphenyl</i>	74%		10-123			01/02/26 14:20	01/05/26 22:22	TAY/TL1	SW846 3540C	SW846-8082A

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax:cs@emsl.com
EMSL-CIN-01

Table of Contents**EMSL Order ID:** 012340401**LIMS Reference ID:** AD46401**EMSL Customer ID:** WSPN36**Attention:** AP

WSP Canada, Inc. [WSPN36]
36 Pippy Place
Saint John's, NL A1B 4A5
(709) 722-7023
capayablesinvoice@wsp.com

Project Name:

CA0037087.2445-NAVFAC Paint Sampling

Project ID:

_Master Project-WSPN36

Customer PO:**Sales Rep:**

Sarah Jamieson

Received:

12/29/2025 09:00

Reported:**Sample Results****(Continued)**

Sample: TE-Rm63-PCB024B/TE Bldg. Room 63/Dark grey on metal door and frame
AD46401-48 (Solid)

Analyte	Result	Q	DF	RL	Units	Prepared Date/Time	Analyzed Date/Time	Prep/Analyst Initials	Prep Method	Analytical Method
GC-SVOA										
Aroclor-1016	ND	D	2	0.47	mg/kg	01/02/26 14:20	01/06/26 11:21	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1221	ND	D	2	0.47	mg/kg	01/02/26 14:20	01/06/26 11:21	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1232	ND	D	2	0.47	mg/kg	01/02/26 14:20	01/06/26 11:21	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1242	5.1	D	2	0.47	mg/kg	01/02/26 14:20	01/06/26 11:21	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1248	ND	D	2	0.47	mg/kg	01/02/26 14:20	01/06/26 11:21	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1254	8.1	D	2	0.47	mg/kg	01/02/26 14:20	01/06/26 11:21	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1260	ND	D	2	0.47	mg/kg	01/02/26 14:20	01/06/26 11:21	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1262	ND	D	2	0.47	mg/kg	01/02/26 14:20	01/06/26 11:21	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1268	ND	D	2	0.47	mg/kg	01/02/26 14:20	01/06/26 11:21	TAY/AxJ	SW846 3540C	SW846-8082A
Surrogate(s)	Recovery	Q	Limits							
<i>Surrogate: Tetrachloro-m-xylene</i>	79%		10-112			01/02/26 14:20	01/06/26 11:21	TAY/AxJ	SW846 3540C	SW846-8082A
<i>Surrogate: Decachlorobiphenyl</i>	85%		10-123			01/02/26 14:20	01/06/26 11:21	TAY/AxJ	SW846 3540C	SW846-8082A

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
 Telephone: 856-858-4800 Fax:cs@emsl.com
 EMSL-CIN-01

EMSL Order ID: 012340401

LIMS Reference ID: AD46401

EMSL Customer ID: WSPN36

Attention: AP

WSP Canada, Inc. [WSPN36]
 36 Pippy Place
 Saint John's, NL A1B 4A5
 (709) 722-7023
 capayablesinvoice@wsp.com

Project Name:

CA0037087.2445-NAVFAC Paint Sampling

Project ID:

_Master Project-WSPN36

Customer PO:**Sales Rep:**

Sarah Jamieson

Received:

12/29/2025 09:00

Reported:**Sample Results**

(Continued)

Sample: TE-Rm63-PCB025A/TE Bldg. Room 63/Dark grey on metal door and frame
AD46401-49 (Solid)

Analyte	Result	Q	DF	RL	Units	Prepared Date/Time	Analyzed Date/Time	Prep/Analyst Initials	Prep Method	Analytical Method
GC-SVOA										
Aroclor-1016	ND		1	0.48	mg/kg	12/30/25 13:12	01/02/26 19:30	TAY/TL1	SW846 3546	SW846-8082A
Aroclor-1221	ND		1	0.48	mg/kg	12/30/25 13:12	01/02/26 19:30	TAY/TL1	SW846 3546	SW846-8082A
Aroclor-1232	ND		1	0.48	mg/kg	12/30/25 13:12	01/02/26 19:30	TAY/TL1	SW846 3546	SW846-8082A
Aroclor-1242	4.7		1	0.48	mg/kg	12/30/25 13:12	01/02/26 19:30	TAY/TL1	SW846 3546	SW846-8082A
Aroclor-1248	ND		1	0.48	mg/kg	12/30/25 13:12	01/02/26 19:30	TAY/TL1	SW846 3546	SW846-8082A
Aroclor-1254	3.8		1	0.48	mg/kg	12/30/25 13:12	01/02/26 19:30	TAY/TL1	SW846 3546	SW846-8082A
Aroclor-1260	ND		1	0.48	mg/kg	12/30/25 13:12	01/02/26 19:30	TAY/TL1	SW846 3546	SW846-8082A
Aroclor-1262	ND		1	0.48	mg/kg	12/30/25 13:12	01/02/26 19:30	TAY/TL1	SW846 3546	SW846-8082A
Aroclor-1268	ND		1	0.48	mg/kg	12/30/25 13:12	01/02/26 19:30	TAY/TL1	SW846 3546	SW846-8082A
Surrogate(s)	Recovery	Q	Limits							
<i>Surrogate: Tetrachloro-m-xylene</i>	60%		10-112			12/30/25 13:12	01/02/26 19:30	TAY/TL1	SW846 3546	SW846-8082A
<i>Surrogate: Decachlorobiphenyl</i>	66%		10-123			12/30/25 13:12	01/02/26 19:30	TAY/TL1	SW846 3546	SW846-8082A

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax:cs@emsl.com
EMSL-CIN-01

Table of Contents**EMSL Order ID:** 012340401**LIMS Reference ID:** AD46401**EMSL Customer ID:** WSPN36**Attention:** AP

WSP Canada, Inc. [WSPN36]
36 Pippy Place
Saint John's, NL A1B 4A5
(709) 722-7023
capayablesinvoice@wsp.com

Project Name:

CA0037087.2445-NAVFAC Paint Sampling

Project ID:

_Master Project-WSPN36

Customer PO:**Sales Rep:**

Sarah Jamieson

Received:

12/29/2025 09:00

Reported:**Sample Results****(Continued)**

**Sample: TE-Rm15-PCB025B/TE Bldg. Room 15/Brown on metal door and frame
AD46401-50 (Solid)**

Analyte	Result	Q	DF	RL	Units	Prepared Date/Time	Analyzed Date/Time	Prep/Analyst Initials	Prep Method	Analytical Method
GC-SVOA										
Aroclor-1016	ND	D	3	0.73	mg/kg	01/02/26 14:20	01/06/26 11:43	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1221	ND	D	3	0.73	mg/kg	01/02/26 14:20	01/06/26 11:43	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1232	ND	D	3	0.73	mg/kg	01/02/26 14:20	01/06/26 11:43	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1242	8.5	D	3	0.73	mg/kg	01/02/26 14:20	01/06/26 11:43	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1248	ND	D	3	0.73	mg/kg	01/02/26 14:20	01/06/26 11:43	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1254	10	D	3	0.73	mg/kg	01/02/26 14:20	01/06/26 11:43	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1260	ND	D	3	0.73	mg/kg	01/02/26 14:20	01/06/26 11:43	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1262	ND	D	3	0.73	mg/kg	01/02/26 14:20	01/06/26 11:43	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1268	ND	D	3	0.73	mg/kg	01/02/26 14:20	01/06/26 11:43	TAY/AxJ	SW846 3540C	SW846-8082A
Surrogate(s)	Recovery	Q	Limits							
<i>Surrogate: Tetrachloro-m-xylene</i>	111%		10-112			01/02/26 14:20	01/06/26 11:43	TAY/AxJ	SW846 3540C	SW846-8082A
<i>Surrogate: Decachlorobiphenyl</i>	116%		10-123			01/02/26 14:20	01/06/26 11:43	TAY/AxJ	SW846 3540C	SW846-8082A

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax:cs@emsl.com
EMSL-CIN-01

Table of Contents**EMSL Order ID:** 012340401**LIMS Reference ID:** AD46401**EMSL Customer ID:** WSPN36**Attention:** AP

WSP Canada, Inc. [WSPN36]
36 Pippy Place
Saint John's, NL A1B 4A5
(709) 722-7023
capayablesinvoice@wsp.com

Project Name:

CA0037087.2445-NAVFAC Paint Sampling

Project ID:

_Master Project-WSPN36

Customer PO:**Sales Rep:**

Sarah Jamieson

Received:

12/29/2025 09:00

Reported:**Sample Results****(Continued)**

**Sample: TE-Rm27-PCB026A/TE Bldg. Room 27/Black on metal door and frame
AD46401-51 (Solid)**

Analyte	Result	Q	DF	RL	Units	Prepared Date/Time	Analyzed Date/Time	Prep/Analyst Initials	Prep Method	Analytical Method
GC-SVOA										
Aroclor-1016	ND		1	1.7	mg/kg	12/30/25 13:12	01/02/26 19:52	TAY/TL1	SW846 3546	SW846-8082A
Aroclor-1221	ND		1	1.7	mg/kg	12/30/25 13:12	01/02/26 19:52	TAY/TL1	SW846 3546	SW846-8082A
Aroclor-1232	ND		1	1.7	mg/kg	12/30/25 13:12	01/02/26 19:52	TAY/TL1	SW846 3546	SW846-8082A
Aroclor-1242	6.0		1	1.7	mg/kg	12/30/25 13:12	01/02/26 19:52	TAY/TL1	SW846 3546	SW846-8082A
Aroclor-1248	ND		1	1.7	mg/kg	12/30/25 13:12	01/02/26 19:52	TAY/TL1	SW846 3546	SW846-8082A
Aroclor-1254	7.0		1	1.7	mg/kg	12/30/25 13:12	01/02/26 19:52	TAY/TL1	SW846 3546	SW846-8082A
Aroclor-1260	ND		1	1.7	mg/kg	12/30/25 13:12	01/02/26 19:52	TAY/TL1	SW846 3546	SW846-8082A
Aroclor-1262	ND		1	1.7	mg/kg	12/30/25 13:12	01/02/26 19:52	TAY/TL1	SW846 3546	SW846-8082A
Aroclor-1268	ND		1	1.7	mg/kg	12/30/25 13:12	01/02/26 19:52	TAY/TL1	SW846 3546	SW846-8082A
Surrogate(s)	Recovery	Q	Limits							
<i>Surrogate: Tetrachloro-m-xylene</i>	61%		10-112			12/30/25 13:12	01/02/26 19:52	TAY/TL1	SW846 3546	SW846-8082A
<i>Surrogate: Decachlorobiphenyl</i>	66%		10-123			12/30/25 13:12	01/02/26 19:52	TAY/TL1	SW846 3546	SW846-8082A

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax:cs@emsl.com
EMSL-CIN-01

Table of Contents**EMSL Order ID:** 012340401**LIMS Reference ID:** AD46401**EMSL Customer ID:** WSPN36**Attention:** AP

WSP Canada, Inc. [WSPN36]
36 Pippy Place
Saint John's, NL A1B 4A5
(709) 722-7023
capayablesinvoice@wsp.com

Project Name:

CA0037087.2445-NAVFAC Paint Sampling

Project ID:

_Master Project-WSPN36

Customer PO:**Sales Rep:**

Sarah Jamieson

Received:

12/29/2025 09:00

Reported:**Sample Results****(Continued)**

**Sample: TE-Rm30-PCB026B/TE Bldg. Room 30/Brown on metal door and frame
AD46401-52 (Solid)**

Analyte	Result	Q	DF	RL	Units	Prepared Date/Time	Analyzed Date/Time	Prep/Analyst Initials	Prep Method	Analytical Method
GC-SVOA										
Aroclor-1016	ND		1	0.75	mg/kg	12/30/25 13:12	01/02/26 20:14	TAY/TL1	SW846 3546	SW846-8082A
Aroclor-1221	ND		1	0.75	mg/kg	12/30/25 13:12	01/02/26 20:14	TAY/TL1	SW846 3546	SW846-8082A
Aroclor-1232	ND		1	0.75	mg/kg	12/30/25 13:12	01/02/26 20:14	TAY/TL1	SW846 3546	SW846-8082A
Aroclor-1242	ND		1	0.75	mg/kg	12/30/25 13:12	01/02/26 20:14	TAY/TL1	SW846 3546	SW846-8082A
Aroclor-1248	ND		1	0.75	mg/kg	12/30/25 13:12	01/02/26 20:14	TAY/TL1	SW846 3546	SW846-8082A
Aroclor-1254	8.5		1	0.75	mg/kg	12/30/25 13:12	01/02/26 20:14	TAY/TL1	SW846 3546	SW846-8082A
Aroclor-1260	ND		1	0.75	mg/kg	12/30/25 13:12	01/02/26 20:14	TAY/TL1	SW846 3546	SW846-8082A
Aroclor-1262	ND		1	0.75	mg/kg	12/30/25 13:12	01/02/26 20:14	TAY/TL1	SW846 3546	SW846-8082A
Aroclor-1268	ND		1	0.75	mg/kg	12/30/25 13:12	01/02/26 20:14	TAY/TL1	SW846 3546	SW846-8082A
Surrogate(s)	Recovery	Q	Limits							
<i>Surrogate: Tetrachloro-m-xylene</i>	56%		10-112			12/30/25 13:12	01/02/26 20:14	TAY/TL1	SW846 3546	SW846-8082A
<i>Surrogate: Decachlorobiphenyl</i>	58%		10-123			12/30/25 13:12	01/02/26 20:14	TAY/TL1	SW846 3546	SW846-8082A

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax:cs@emsl.com
EMSL-CIN-01

Table of Contents

EMSL Order ID: 012340401

LIMS Reference ID: AD46401

EMSL Customer ID: WSPN36

Attention: AP

WSP Canada, Inc. [WSPN36]
36 Pippy Place
Saint John's, NL A1B 4A5
(709) 722-7023
capayablesinvoice@wsp.com

Project Name:

CA0037087.2445-NAVFAC Paint Sampling

Project ID:

_Master Project-WSPN36

Customer PO:**Sales Rep:**

Sarah Jamieson

Received:

12/29/2025 09:00

Reported:**Sample Results**

(Continued)

Sample: TE-Rm47-PCB027A/TE Bldg. Room 47/Green on metal door and frame
AD46401-53 (Solid)

Analyte	Result	Q	DF	RL	Units	Prepared Date/Time	Analyzed Date/Time	Prep/Analyst Initials	Prep Method	Analytical Method
GC-SVOA										
Aroclor-1016	ND	D	3	0.73	mg/kg	01/02/26 14:20	01/06/26 12:04	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1221	ND	D	3	0.73	mg/kg	01/02/26 14:20	01/06/26 12:04	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1232	ND	D	3	0.73	mg/kg	01/02/26 14:20	01/06/26 12:04	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1242	5.2	D	3	0.73	mg/kg	01/02/26 14:20	01/06/26 12:04	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1248	ND	D	3	0.73	mg/kg	01/02/26 14:20	01/06/26 12:04	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1254	6.4	D	3	0.73	mg/kg	01/02/26 14:20	01/06/26 12:04	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1260	ND	D	3	0.73	mg/kg	01/02/26 14:20	01/06/26 12:04	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1262	ND	D	3	0.73	mg/kg	01/02/26 14:20	01/06/26 12:04	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1268	ND	D	3	0.73	mg/kg	01/02/26 14:20	01/06/26 12:04	TAY/AxJ	SW846 3540C	SW846-8082A
Surrogate(s)	Recovery	Q	Limits							
<i>Surrogate: Tetrachloro-m-xylene</i>	89%		10-112			01/02/26 14:20	01/06/26 12:04	TAY/AxJ	SW846 3540C	SW846-8082A
<i>Surrogate: Decachlorobiphenyl</i>	98%		10-123			01/02/26 14:20	01/06/26 12:04	TAY/AxJ	SW846 3540C	SW846-8082A

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax:cs@emsl.com
EMSL-CIN-01

Table of Contents

EMSL Order ID: 012340401

LIMS Reference ID: AD46401

EMSL Customer ID: WSPN36

Attention: AP

WSP Canada, Inc. [WSPN36]
36 Pippy Place
Saint John's, NL A1B 4A5
(709) 722-7023
capayablesinvoice@wsp.com

Project Name:

CA0037087.2445-NAVFAC Paint Sampling

Project ID:

_Master Project-WSPN36

Customer PO:**Sales Rep:**

Sarah Jamieson

Received:

12/29/2025 09:00

Reported:**Sample Results**

(Continued)

Sample: TE-Rm47-PCB027B/TE Bldg. Room 47/Green on metal door and frame
AD46401-54 (Solid)

Analyte	Result	Q	DF	RL	Units	Prepared Date/Time	Analyzed Date/Time	Prep/Analyst Initials	Prep Method	Analytical Method
GC-SVOA										
Aroclor-1016	ND	D	2	0.50	mg/kg	01/02/26 14:20	01/06/26 12:26	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1221	ND	D	2	0.50	mg/kg	01/02/26 14:20	01/06/26 12:26	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1232	ND	D	2	0.50	mg/kg	01/02/26 14:20	01/06/26 12:26	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1242	4.3	D	2	0.50	mg/kg	01/02/26 14:20	01/06/26 12:26	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1248	ND	D	2	0.50	mg/kg	01/02/26 14:20	01/06/26 12:26	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1254	6.3	D	2	0.50	mg/kg	01/02/26 14:20	01/06/26 12:26	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1260	ND	D	2	0.50	mg/kg	01/02/26 14:20	01/06/26 12:26	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1262	ND	D	2	0.50	mg/kg	01/02/26 14:20	01/06/26 12:26	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1268	ND	D	2	0.50	mg/kg	01/02/26 14:20	01/06/26 12:26	TAY/AxJ	SW846 3540C	SW846-8082A
Surrogate(s)	Recovery	Q	Limits							
<i>Surrogate: Tetrachloro-m-xylene</i>	88%		10-112			01/02/26 14:20	01/06/26 12:26	TAY/AxJ	SW846 3540C	SW846-8082A
<i>Surrogate: Decachlorobiphenyl</i>	96%		10-123			01/02/26 14:20	01/06/26 12:26	TAY/AxJ	SW846 3540C	SW846-8082A

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax:cs@emsl.com
EMSL-CIN-01

Table of Contents**EMSL Order ID:** 012340401**LIMS Reference ID:** AD46401**EMSL Customer ID:** WSPN36**Attention:** AP

WSP Canada, Inc. [WSPN36]
36 Pippy Place
Saint John's, NL A1B 4A5
(709) 722-7023
capayablesinvoice@wsp.com

Project Name:

CA0037087.2445-NAVFAC Paint Sampling

Project ID:

_Master Project-WSPN36

Customer PO:**Sales Rep:**

Sarah Jamieson

Received:

12/29/2025 09:00

Reported:**Sample Results****(Continued)**

Sample: TE-Rm52-PCB028A/TE Bldg. Room 52/White on metal wall panels
AD46401-55 (Solid)

Analyte	Result	Q	DF	RL	Units	Prepared Date/Time	Analyzed Date/Time	Prep/Analyst Initials	Prep Method	Analytical Method
GC-SVOA										
Aroclor-1016	ND		1	1.2	mg/kg	12/30/25 13:12	01/02/26 20:36	TAY/TL1	SW846 3546	SW846-8082A
Aroclor-1221	ND		1	1.2	mg/kg	12/30/25 13:12	01/02/26 20:36	TAY/TL1	SW846 3546	SW846-8082A
Aroclor-1232	ND		1	1.2	mg/kg	12/30/25 13:12	01/02/26 20:36	TAY/TL1	SW846 3546	SW846-8082A
Aroclor-1242	ND		1	1.2	mg/kg	12/30/25 13:12	01/02/26 20:36	TAY/TL1	SW846 3546	SW846-8082A
Aroclor-1248	ND		1	1.2	mg/kg	12/30/25 13:12	01/02/26 20:36	TAY/TL1	SW846 3546	SW846-8082A
Aroclor-1254	4.6		1	1.2	mg/kg	12/30/25 13:12	01/02/26 20:36	TAY/TL1	SW846 3546	SW846-8082A
Aroclor-1260	ND		1	1.2	mg/kg	12/30/25 13:12	01/02/26 20:36	TAY/TL1	SW846 3546	SW846-8082A
Aroclor-1262	ND		1	1.2	mg/kg	12/30/25 13:12	01/02/26 20:36	TAY/TL1	SW846 3546	SW846-8082A
Aroclor-1268	ND		1	1.2	mg/kg	12/30/25 13:12	01/02/26 20:36	TAY/TL1	SW846 3546	SW846-8082A
Surrogate(s)	Recovery	Q	Limits							
<i>Surrogate: Tetrachloro-m-xylene</i>	61%		10-112			12/30/25 13:12	01/02/26 20:36	TAY/TL1	SW846 3546	SW846-8082A
<i>Surrogate: Decachlorobiphenyl</i>	66%		10-123			12/30/25 13:12	01/02/26 20:36	TAY/TL1	SW846 3546	SW846-8082A

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
 Telephone: 856-858-4800 Fax:cs@emsl.com
 EMSL-CIN-01

EMSL Order ID: 012340401

LIMS Reference ID: AD46401

EMSL Customer ID: WSPN36

Attention: AP

WSP Canada, Inc. [WSPN36]
 36 Pippy Place
 Saint John's, NL A1B 4A5
 (709) 722-7023
 capayablesinvoice@wsp.com

Project Name:

CA0037087.2445-NAVFAC Paint Sampling

Project ID:

_Master Project-WSPN36

Customer PO:**Sales Rep:**

Sarah Jamieson

Received:

12/29/2025 09:00

Reported:**Sample Results**

(Continued)

Sample: TE-Rm52-PCB028B/TE Bldg. Room 52/White on metal wall panels
AD46401-56 (Solid)

Analyte	Result	Q	DF	RL	Units	Prepared Date/Time	Analyzed Date/Time	Prep/Analyst Initials	Prep Method	Analytical Method
GC-SVOA										
Aroclor-1016	ND		1	0.24	mg/kg	12/30/25 13:12	01/02/26 20:57	TAY/TL1	SW846 3546	SW846-8082A
Aroclor-1221	ND		1	0.24	mg/kg	12/30/25 13:12	01/02/26 20:57	TAY/TL1	SW846 3546	SW846-8082A
Aroclor-1232	ND		1	0.24	mg/kg	12/30/25 13:12	01/02/26 20:57	TAY/TL1	SW846 3546	SW846-8082A
Aroclor-1242	2.3		1	0.24	mg/kg	12/30/25 13:12	01/02/26 20:57	TAY/TL1	SW846 3546	SW846-8082A
Aroclor-1248	ND		1	0.24	mg/kg	12/30/25 13:12	01/02/26 20:57	TAY/TL1	SW846 3546	SW846-8082A
Aroclor-1254	3.7		1	0.24	mg/kg	12/30/25 13:12	01/02/26 20:57	TAY/TL1	SW846 3546	SW846-8082A
Aroclor-1260	1.8		1	0.24	mg/kg	12/30/25 13:12	01/02/26 20:57	TAY/TL1	SW846 3546	SW846-8082A
Aroclor-1262	ND		1	0.24	mg/kg	12/30/25 13:12	01/02/26 20:57	TAY/TL1	SW846 3546	SW846-8082A
Aroclor-1268	ND		1	0.24	mg/kg	12/30/25 13:12	01/02/26 20:57	TAY/TL1	SW846 3546	SW846-8082A
Surrogate(s)	Recovery	Q	Limits							
<i>Surrogate: Tetrachloro-m-xylene</i>	73%		10-112			12/30/25 13:12	01/02/26 20:57	TAY/TL1	SW846 3546	SW846-8082A
<i>Surrogate: Decachlorobiphenyl</i>	74%		10-123			12/30/25 13:12	01/02/26 20:57	TAY/TL1	SW846 3546	SW846-8082A

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
 Telephone: 856-858-4800 Fax:cs@emsl.com
 EMSL-CIN-01

EMSL Order ID: 012340401

LIMS Reference ID: AD46401

EMSL Customer ID: WSPN36

Attention: AP

WSP Canada, Inc. [WSPN36]
 36 Pippy Place
 Saint John's, NL A1B 4A5
 (709) 722-7023
 capayablesinvoice@wsp.com

Project Name:

CA0037087.2445-NAVFAC Paint Sampling

Project ID:

_Master Project-WSPN36

Customer PO:**Sales Rep:**

Sarah Jamieson

Received:

12/29/2025 09:00

Reported:**Sample Results**

(Continued)

Sample: TE-Rm52-PCB029A/TE Bldg. Room 52/Light blue on metal wall panels
AD46401-57 (Solid)

Analyte	Result	Q	DF	RL	Units	Prepared Date/Time	Analyzed Date/Time	Prep/Analyst Initials	Prep Method	Analytical Method
GC-SVOA										
Aroclor-1016	ND	D	3	0.79	mg/kg	12/30/25 13:12	01/06/26 13:10	TAY/AxJ	SW846 3546	SW846-8082A
Aroclor-1221	ND	D	3	0.79	mg/kg	12/30/25 13:12	01/06/26 13:10	TAY/AxJ	SW846 3546	SW846-8082A
Aroclor-1232	ND	D	3	0.79	mg/kg	12/30/25 13:12	01/06/26 13:10	TAY/AxJ	SW846 3546	SW846-8082A
Aroclor-1242	5.0	D	3	0.79	mg/kg	12/30/25 13:12	01/06/26 13:10	TAY/AxJ	SW846 3546	SW846-8082A
Aroclor-1248	ND	D	3	0.79	mg/kg	12/30/25 13:12	01/06/26 13:10	TAY/AxJ	SW846 3546	SW846-8082A
Aroclor-1254	9.2	D	3	0.79	mg/kg	12/30/25 13:12	01/06/26 13:10	TAY/AxJ	SW846 3546	SW846-8082A
Aroclor-1260	2.5	D	3	0.79	mg/kg	12/30/25 13:12	01/06/26 13:10	TAY/AxJ	SW846 3546	SW846-8082A
Aroclor-1262	ND	D	3	0.79	mg/kg	12/30/25 13:12	01/06/26 13:10	TAY/AxJ	SW846 3546	SW846-8082A
Aroclor-1268	ND	D	3	0.79	mg/kg	12/30/25 13:12	01/06/26 13:10	TAY/AxJ	SW846 3546	SW846-8082A
Surrogate(s)	Recovery	Q	Limits							
<i>Surrogate: Tetrachloro-m-xylene</i>	97%		10-112			12/30/25 13:12	01/06/26 13:10	TAY/AxJ	SW846 3546	SW846-8082A
<i>Surrogate: Decachlorobiphenyl</i>	108%		10-123			12/30/25 13:12	01/06/26 13:10	TAY/AxJ	SW846 3546	SW846-8082A

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
 Telephone: 856-858-4800 Fax:cs@emsl.com
 EMSL-CIN-01

EMSL Order ID: 012340401

LIMS Reference ID: AD46401

EMSL Customer ID: WSPN36

Attention: AP

WSP Canada, Inc. [WSPN36]
 36 Pippy Place
 Saint John's, NL A1B 4A5
 (709) 722-7023
 capayablesinvoice@wsp.com

Project Name:

CA0037087.2445-NAVFAC Paint Sampling

Project ID:

_Master Project-WSPN36

Customer PO:**Sales Rep:**

Sarah Jamieson

Received:

12/29/2025 09:00

Reported:**Sample Results**

(Continued)

Sample: TE-Rm52-PCB029B/TE Bldg. Room 52/Light blue on metal wall panels
AD46401-58 (Solid)

Analyte	Result	Q	DF	RL	Units	Prepared Date/Time	Analyzed Date/Time	Prep/Analyst Initials	Prep Method	Analytical Method
GC-SVOA										
Aroclor-1016	ND	D	3	0.72	mg/kg	01/02/26 14:20	01/06/26 12:48	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1221	ND	D	3	0.72	mg/kg	01/02/26 14:20	01/06/26 12:48	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1232	ND	D	3	0.72	mg/kg	01/02/26 14:20	01/06/26 12:48	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1242	4.2	D	3	0.72	mg/kg	01/02/26 14:20	01/06/26 12:48	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1248	ND	D	3	0.72	mg/kg	01/02/26 14:20	01/06/26 12:48	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1254	6.7	D	3	0.72	mg/kg	01/02/26 14:20	01/06/26 12:48	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1260	5.0	D	3	0.72	mg/kg	01/02/26 14:20	01/06/26 12:48	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1262	ND	D	3	0.72	mg/kg	01/02/26 14:20	01/06/26 12:48	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1268	ND	D	3	0.72	mg/kg	01/02/26 14:20	01/06/26 12:48	TAY/AxJ	SW846 3540C	SW846-8082A
Surrogate(s)	Recovery	Q	Limits							
<i>Surrogate: Tetrachloro-m-xylene</i>	99%		10-112			01/02/26 14:20	01/06/26 12:48	TAY/AxJ	SW846 3540C	SW846-8082A
<i>Surrogate: Decachlorobiphenyl</i>	107%		10-123			01/02/26 14:20	01/06/26 12:48	TAY/AxJ	SW846 3540C	SW846-8082A

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax:cs@emsl.com
EMSL-CIN-01

EMSL Order ID: 012340401

LIMS Reference ID: AD46401

EMSL Customer ID: WSPN36

Attention: AP

WSP Canada, Inc. [WSPN36]
36 Pippy Place
Saint John's, NL A1B 4A5
(709) 722-7023
capayablesinvoice@wsp.com

Project Name:

CA0037087.2445-NAVFAC Paint Sampling

Project ID:

_Master Project-WSPN36

Customer PO:**Sales Rep:**

Sarah Jamieson

Received:

12/29/2025 09:00

Reported:**Sample Results**

(Continued)

**Sample: TE-Rm51-PCB030A/TE Bldg. Room 51/Black on concrete and metal pad
AD46401-59 (Solid)**

Analyte	Result	Q	DF	RL	Units	Prepared Date/Time	Analyzed Date/Time	Prep/Analyst Initials	Prep Method	Analytical Method
GC-SVOA										
Aroclor-1016	ND		1	0.94	mg/kg	01/02/26 14:20	01/05/26 19:05	TAY/TL1	SW846 3540C	SW846-8082A
Aroclor-1221	ND		1	0.94	mg/kg	01/02/26 14:20	01/05/26 19:05	TAY/TL1	SW846 3540C	SW846-8082A
Aroclor-1232	ND		1	0.94	mg/kg	01/02/26 14:20	01/05/26 19:05	TAY/TL1	SW846 3540C	SW846-8082A
Aroclor-1242	4.7		1	0.94	mg/kg	01/02/26 14:20	01/05/26 19:05	TAY/TL1	SW846 3540C	SW846-8082A
Aroclor-1248	ND		1	0.94	mg/kg	01/02/26 14:20	01/05/26 19:05	TAY/TL1	SW846 3540C	SW846-8082A
Aroclor-1254	4.5		1	0.94	mg/kg	01/02/26 14:20	01/05/26 19:05	TAY/TL1	SW846 3540C	SW846-8082A
Aroclor-1260	ND		1	0.94	mg/kg	01/02/26 14:20	01/05/26 19:05	TAY/TL1	SW846 3540C	SW846-8082A
Aroclor-1262	ND		1	0.94	mg/kg	01/02/26 14:20	01/05/26 19:05	TAY/TL1	SW846 3540C	SW846-8082A
Aroclor-1268	ND		1	0.94	mg/kg	01/02/26 14:20	01/05/26 19:05	TAY/TL1	SW846 3540C	SW846-8082A
Surrogate(s)	Recovery	Q	Limits							
<i>Surrogate: Tetrachloro-m-xylene</i>	89%		10-112			01/02/26 14:20	01/05/26 19:05	TAY/TL1	SW846 3540C	SW846-8082A
<i>Surrogate: Decachlorobiphenyl</i>	73%		10-123			01/02/26 14:20	01/05/26 19:05	TAY/TL1	SW846 3540C	SW846-8082A

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax:cs@emsl.com
EMSL-CIN-01

Table of Contents**EMSL Order ID:** 012340401**LIMS Reference ID:** AD46401**EMSL Customer ID:** WSPN36**Attention:** AP

WSP Canada, Inc. [WSPN36]
36 Pippy Place
Saint John's, NL A1B 4A5
(709) 722-7023
capayablesinvoice@wsp.com

Project Name:

CA0037087.2445-NAVFAC Paint Sampling

Project ID:

_Master Project-WSPN36

Customer PO:**Sales Rep:**

Sarah Jamieson

Received:

12/29/2025 09:00

Reported:**Sample Results****(Continued)**

**Sample: TE-Rm51-PCB030B/TE Bldg. Room 51/Black on concrete and metal pad
AD46401-60 (Solid)**

Analyte	Result	Q	DF	RL	Units	Prepared Date/Time	Analyzed Date/Time	Prep/Analyst Initials	Prep Method	Analytical Method
GC-SVOA										
Aroclor-1016	ND		1	0.93	mg/kg	01/02/26 14:20	01/05/26 19:27	TAY/TL1	SW846 3540C	SW846-8082A
Aroclor-1221	ND		1	0.93	mg/kg	01/02/26 14:20	01/05/26 19:27	TAY/TL1	SW846 3540C	SW846-8082A
Aroclor-1232	ND		1	0.93	mg/kg	01/02/26 14:20	01/05/26 19:27	TAY/TL1	SW846 3540C	SW846-8082A
Aroclor-1242	7.9		1	0.93	mg/kg	01/02/26 14:20	01/05/26 19:27	TAY/TL1	SW846 3540C	SW846-8082A
Aroclor-1248	ND		1	0.93	mg/kg	01/02/26 14:20	01/05/26 19:27	TAY/TL1	SW846 3540C	SW846-8082A
Aroclor-1254	4.8		1	0.93	mg/kg	01/02/26 14:20	01/05/26 19:27	TAY/TL1	SW846 3540C	SW846-8082A
Aroclor-1260	ND		1	0.93	mg/kg	01/02/26 14:20	01/05/26 19:27	TAY/TL1	SW846 3540C	SW846-8082A
Aroclor-1262	ND		1	0.93	mg/kg	01/02/26 14:20	01/05/26 19:27	TAY/TL1	SW846 3540C	SW846-8082A
Aroclor-1268	ND		1	0.93	mg/kg	01/02/26 14:20	01/05/26 19:27	TAY/TL1	SW846 3540C	SW846-8082A
Surrogate(s)	Recovery	Q	Limits							
<i>Surrogate: Tetrachloro-m-xylene</i>	81%		10-112			01/02/26 14:20	01/05/26 19:27	TAY/TL1	SW846 3540C	SW846-8082A
<i>Surrogate: Decachlorobiphenyl</i>	76%		10-123			01/02/26 14:20	01/05/26 19:27	TAY/TL1	SW846 3540C	SW846-8082A

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax:cs@emsl.com
EMSL-CIN-01

Table of Contents**EMSL Order ID:** 012340401**LIMS Reference ID:** AD46401**EMSL Customer ID:** WSPN36**Attention:** AP

WSP Canada, Inc. [WSPN36]
36 Pippy Place
Saint John's, NL A1B 4A5
(709) 722-7023
capayablesinvoice@wsp.com

Project Name:

CA0037087.2445-NAVFAC Paint Sampling

Project ID:

_Master Project-WSPN36

Customer PO:**Sales Rep:**

Sarah Jamieson

Received:

12/29/2025 09:00

Reported:**Sample Results****(Continued)**

Sample: TE-Rm45-PCB031A/TE Bldg. Room 45/White on drywall wall
AD46401-61 (Solid)

Analyte	Result	Q	DF	RL	Units	Prepared Date/Time	Analyzed Date/Time	Prep/Analyst Initials	Prep Method	Analytical Method
GC-SVOA										
Aroclor-1016	ND		1	0.25	mg/kg	01/02/26 14:20	01/05/26 20:11	TAY/TL1	SW846 3540C	SW846-8082A
Aroclor-1221	ND		1	0.25	mg/kg	01/02/26 14:20	01/05/26 20:11	TAY/TL1	SW846 3540C	SW846-8082A
Aroclor-1232	ND		1	0.25	mg/kg	01/02/26 14:20	01/05/26 20:11	TAY/TL1	SW846 3540C	SW846-8082A
Aroclor-1242	0.88		1	0.25	mg/kg	01/02/26 14:20	01/05/26 20:11	TAY/TL1	SW846 3540C	SW846-8082A
Aroclor-1248	ND		1	0.25	mg/kg	01/02/26 14:20	01/05/26 20:11	TAY/TL1	SW846 3540C	SW846-8082A
Aroclor-1254	0.83		1	0.25	mg/kg	01/02/26 14:20	01/05/26 20:11	TAY/TL1	SW846 3540C	SW846-8082A
Aroclor-1260	ND		1	0.25	mg/kg	01/02/26 14:20	01/05/26 20:11	TAY/TL1	SW846 3540C	SW846-8082A
Aroclor-1262	ND		1	0.25	mg/kg	01/02/26 14:20	01/05/26 20:11	TAY/TL1	SW846 3540C	SW846-8082A
Aroclor-1268	ND		1	0.25	mg/kg	01/02/26 14:20	01/05/26 20:11	TAY/TL1	SW846 3540C	SW846-8082A
Surrogate(s)	Recovery	Q	Limits							
<i>Surrogate: Tetrachloro-m-xylene</i>	74%		10-112			01/02/26 14:20	01/05/26 20:11	TAY/TL1	SW846 3540C	SW846-8082A
<i>Surrogate: Decachlorobiphenyl</i>	76%		10-123			01/02/26 14:20	01/05/26 20:11	TAY/TL1	SW846 3540C	SW846-8082A

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax:cs@emsl.com
EMSL-CIN-01

Table of Contents**EMSL Order ID:** 012340401**LIMS Reference ID:** AD46401**EMSL Customer ID:** WSPN36**Attention:** AP

WSP Canada, Inc. [WSPN36]
36 Pippy Place
Saint John's, NL A1B 4A5
(709) 722-7023
capayablesinvoice@wsp.com

Project Name:

CA0037087.2445-NAVFAC Paint Sampling

Project ID:

_Master Project-WSPN36

Customer PO:**Sales Rep:**

Sarah Jamieson

Received:

12/29/2025 09:00

Reported:**Sample Results****(Continued)**

Sample: TE-Rm63-PCB031B/TE Bldg. Room 63/White on drywall wall
AD46401-62 (Solid)

Analyte	Result	Q	DF	RL	Units	Prepared Date/Time	Analyzed Date/Time	Prep/Analyst Initials	Prep Method	Analytical Method
GC-SVOA										
Aroclor-1016	ND		1	0.24	mg/kg	01/02/26 14:20	01/05/26 20:33	TAY/TL1	SW846 3540C	SW846-8082A
Aroclor-1221	ND		1	0.24	mg/kg	01/02/26 14:20	01/05/26 20:33	TAY/TL1	SW846 3540C	SW846-8082A
Aroclor-1232	ND		1	0.24	mg/kg	01/02/26 14:20	01/05/26 20:33	TAY/TL1	SW846 3540C	SW846-8082A
Aroclor-1242	2.9		1	0.24	mg/kg	01/02/26 14:20	01/05/26 20:33	TAY/TL1	SW846 3540C	SW846-8082A
Aroclor-1248	ND		1	0.24	mg/kg	01/02/26 14:20	01/05/26 20:33	TAY/TL1	SW846 3540C	SW846-8082A
Aroclor-1254	2.6		1	0.24	mg/kg	01/02/26 14:20	01/05/26 20:33	TAY/TL1	SW846 3540C	SW846-8082A
Aroclor-1260	ND		1	0.24	mg/kg	01/02/26 14:20	01/05/26 20:33	TAY/TL1	SW846 3540C	SW846-8082A
Aroclor-1262	ND		1	0.24	mg/kg	01/02/26 14:20	01/05/26 20:33	TAY/TL1	SW846 3540C	SW846-8082A
Aroclor-1268	ND		1	0.24	mg/kg	01/02/26 14:20	01/05/26 20:33	TAY/TL1	SW846 3540C	SW846-8082A
Surrogate(s)	Recovery	Q		Limits						
<i>Surrogate: Tetrachloro-m-xylene</i>	79%			10-112		01/02/26 14:20	01/05/26 20:33	TAY/TL1	SW846 3540C	SW846-8082A
<i>Surrogate: Decachlorobiphenyl</i>	76%			10-123		01/02/26 14:20	01/05/26 20:33	TAY/TL1	SW846 3540C	SW846-8082A

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax:cs@emsl.com
EMSL-CIN-01

Table of Contents**EMSL Order ID:** 012340401**LIMS Reference ID:** AD46401**EMSL Customer ID:** WSPN36**Attention:** AP

WSP Canada, Inc. [WSPN36]
36 Pippy Place
Saint John's, NL A1B 4A5
(709) 722-7023
capayablesinvoice@wsp.com

Project Name:

CA0037087.2445-NAVFAC Paint Sampling

Project ID:

_Master Project-WSPN36

Customer PO:**Sales Rep:**

Sarah Jamieson

Received:

12/29/2025 09:00

Reported:**Sample Results****(Continued)**

**Sample: TE-Rm51-PCB032A/TE Bldg. Room 51/Light blue on pipe insulation and paper
AD46401-63 (Solid)**

Analyte	Result	Q	DF	RL	Units	Prepared Date/Time	Analyzed Date/Time	Prep/Analyst Initials	Prep Method	Analytical Method
GC-SVOA										
Aroclor-1016	ND		1	0.24	mg/kg	01/02/26 14:20	01/06/26 12:57	TAY/TL1	SW846 3540C	SW846-8082A
Aroclor-1221	ND		1	0.24	mg/kg	01/02/26 14:20	01/06/26 12:57	TAY/TL1	SW846 3540C	SW846-8082A
Aroclor-1232	ND		1	0.24	mg/kg	01/02/26 14:20	01/06/26 12:57	TAY/TL1	SW846 3540C	SW846-8082A
Aroclor-1242	1.7		1	0.24	mg/kg	01/02/26 14:20	01/06/26 12:57	TAY/TL1	SW846 3540C	SW846-8082A
Aroclor-1248	ND		1	0.24	mg/kg	01/02/26 14:20	01/06/26 12:57	TAY/TL1	SW846 3540C	SW846-8082A
Aroclor-1254	2.9		1	0.24	mg/kg	01/02/26 14:20	01/06/26 12:57	TAY/TL1	SW846 3540C	SW846-8082A
Aroclor-1260	ND		1	0.24	mg/kg	01/02/26 14:20	01/06/26 12:57	TAY/TL1	SW846 3540C	SW846-8082A
Aroclor-1262	ND		1	0.24	mg/kg	01/02/26 14:20	01/06/26 12:57	TAY/TL1	SW846 3540C	SW846-8082A
Aroclor-1268	ND		1	0.24	mg/kg	01/02/26 14:20	01/06/26 12:57	TAY/TL1	SW846 3540C	SW846-8082A
Surrogate(s)	Recovery	Q	Limits							
<i>Surrogate: Tetrachloro-m-xylene</i>	97%		10-112			01/02/26 14:20	01/06/26 12:57	TAY/TL1	SW846 3540C	SW846-8082A
<i>Surrogate: Decachlorobiphenyl</i>	90%		10-123			01/02/26 14:20	01/06/26 12:57	TAY/TL1	SW846 3540C	SW846-8082A

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax:cs@emsl.com
EMSL-CIN-01

Table of Contents**EMSL Order ID:** 012340401**LIMS Reference ID:** AD46401**EMSL Customer ID:** WSPN36**Attention:** AP

WSP Canada, Inc. [WSPN36]
36 Pippy Place
Saint John's, NL A1B 4A5
(709) 722-7023
capayablesinvoice@wsp.com

Project Name:

CA0037087.2445-NAVFAC Paint Sampling

Project ID:

_Master Project-WSPN36

Customer PO:**Sales Rep:**

Sarah Jamieson

Received:

12/29/2025 09:00

Reported:**Sample Results****(Continued)**

**Sample: TE-Rm71-PCB032B/TE Bldg. Room 71/Light blue on pipe insulation and paper
AD46401-64 (Solid)**

Analyte	Result	Q	DF	RL	Units	Prepared Date/Time	Analyzed Date/Time	Prep/Analyst Initials	Prep Method	Analytical Method
GC-SVOA										
Aroclor-1016	ND	D	4	0.97	mg/kg	01/02/26 14:20	01/06/26 14:05	TAY/TL1	SW846 3540C	SW846-8082A
Aroclor-1221	ND	D	4	0.97	mg/kg	01/02/26 14:20	01/06/26 14:05	TAY/TL1	SW846 3540C	SW846-8082A
Aroclor-1232	ND	D	4	0.97	mg/kg	01/02/26 14:20	01/06/26 14:05	TAY/TL1	SW846 3540C	SW846-8082A
Aroclor-1242	2.6	D	4	0.97	mg/kg	01/02/26 14:20	01/06/26 14:05	TAY/TL1	SW846 3540C	SW846-8082A
Aroclor-1248	ND	D	4	0.97	mg/kg	01/02/26 14:20	01/06/26 14:05	TAY/TL1	SW846 3540C	SW846-8082A
Aroclor-1254	6.3	D	4	0.97	mg/kg	01/02/26 14:20	01/06/26 14:05	TAY/TL1	SW846 3540C	SW846-8082A
Aroclor-1260	ND	D	4	0.97	mg/kg	01/02/26 14:20	01/06/26 14:05	TAY/TL1	SW846 3540C	SW846-8082A
Aroclor-1262	ND	D	4	0.97	mg/kg	01/02/26 14:20	01/06/26 14:05	TAY/TL1	SW846 3540C	SW846-8082A
Aroclor-1268	ND	D	4	0.97	mg/kg	01/02/26 14:20	01/06/26 14:05	TAY/TL1	SW846 3540C	SW846-8082A
Surrogate(s)	Recovery	Q	Limits							
<i>Surrogate: Tetrachloro-m-xylene</i>	96%		10-112			01/02/26 14:20	01/06/26 14:05	TAY/TL1	SW846 3540C	SW846-8082A
<i>Surrogate: Decachlorobiphenyl</i>	106%		10-123			01/02/26 14:20	01/06/26 14:05	TAY/TL1	SW846 3540C	SW846-8082A

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
 Telephone: 856-858-4800 Fax:cs@emsl.com
 EMSL-CIN-01

EMSL Order ID: 012340401

LIMS Reference ID: AD46401

EMSL Customer ID: WSPN36

Attention: AP

WSP Canada, Inc. [WSPN36]
 36 Pippy Place
 Saint John's, NL A1B 4A5
 (709) 722-7023
 capayablesinvoice@wsp.com

Project Name:

CA0037087.2445-NAVFAC Paint Sampling

Project ID:

_Master Project-WSPN36

Customer PO:**Sales Rep:**

Sarah Jamieson

Received:

12/29/2025 09:00

Reported:**Sample Results**

(Continued)

**Sample: TE-Rm51-PCB033A/TE Bldg. Room 51/White on pipe insulation and paper
 AD46401-65 (Solid)**

Analyte	Result	Q	DF	RL	Units	Prepared Date/Time	Analyzed Date/Time	Prep/Analyst Initials	Prep Method	Analytical Method
GC-SVOA										
Aroclor-1016	ND		1	0.25	mg/kg	01/02/26 14:20	01/06/26 13:42	TAY/TL1	SW846 3540C	SW846-8082A
Aroclor-1221	ND		1	0.25	mg/kg	01/02/26 14:20	01/06/26 13:42	TAY/TL1	SW846 3540C	SW846-8082A
Aroclor-1232	ND		1	0.25	mg/kg	01/02/26 14:20	01/06/26 13:42	TAY/TL1	SW846 3540C	SW846-8082A
Aroclor-1242	2.2		1	0.25	mg/kg	01/02/26 14:20	01/06/26 13:42	TAY/TL1	SW846 3540C	SW846-8082A
Aroclor-1248	ND		1	0.25	mg/kg	01/02/26 14:20	01/06/26 13:42	TAY/TL1	SW846 3540C	SW846-8082A
Aroclor-1254	3.2		1	0.25	mg/kg	01/02/26 14:20	01/06/26 13:42	TAY/TL1	SW846 3540C	SW846-8082A
Aroclor-1260	1.2		1	0.25	mg/kg	01/02/26 14:20	01/06/26 13:42	TAY/TL1	SW846 3540C	SW846-8082A
Aroclor-1262	ND		1	0.25	mg/kg	01/02/26 14:20	01/06/26 13:42	TAY/TL1	SW846 3540C	SW846-8082A
Aroclor-1268	ND		1	0.25	mg/kg	01/02/26 14:20	01/06/26 13:42	TAY/TL1	SW846 3540C	SW846-8082A
Surrogate(s)	Recovery	Q		Limits						
<i>Surrogate: Tetrachloro-m-xylene</i>	98%			10-112		01/02/26 14:20	01/06/26 13:42	TAY/TL1	SW846 3540C	SW846-8082A
<i>Surrogate: Decachlorobiphenyl</i>	87%			10-123		01/02/26 14:20	01/06/26 13:42	TAY/TL1	SW846 3540C	SW846-8082A

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax:cs@emsl.com
EMSL-CIN-01

EMSL Order ID: 012340401

LIMS Reference ID: AD46401

EMSL Customer ID: WSPN36

Attention: AP

WSP Canada, Inc. [WSPN36]
36 Pippy Place
Saint John's, NL A1B 4A5
(709) 722-7023
capayablesinvoice@wsp.com

Project Name:

CA0037087.2445-NAVFAC Paint Sampling

Project ID:

_Master Project-WSPN36

Customer PO:**Sales Rep:**

Sarah Jamieson

Received:

12/29/2025 09:00

Reported:**Sample Results**

(Continued)

Sample: TE-Rm27-PCB033B/TE Bldg. Room 51/White on pipe insulation and paper
AD46401-66 (Solid)

Analyte	Result	Q	DF	RL	Units	Prepared Date/Time	Analyzed Date/Time	Prep/Analyst Initials	Prep Method	Analytical Method
GC-SVOA										
Aroclor-1016	ND		1	0.25	mg/kg	01/02/26 14:20	01/06/26 14:34	TAY/TL1	SW846 3540C	SW846-8082A
Aroclor-1221	ND		1	0.25	mg/kg	01/02/26 14:20	01/06/26 14:34	TAY/TL1	SW846 3540C	SW846-8082A
Aroclor-1232	ND		1	0.25	mg/kg	01/02/26 14:20	01/06/26 14:34	TAY/TL1	SW846 3540C	SW846-8082A
Aroclor-1242	1.9		1	0.25	mg/kg	01/02/26 14:20	01/06/26 14:34	TAY/TL1	SW846 3540C	SW846-8082A
Aroclor-1248	ND		1	0.25	mg/kg	01/02/26 14:20	01/06/26 14:34	TAY/TL1	SW846 3540C	SW846-8082A
Aroclor-1254	7.3		1	0.25	mg/kg	01/02/26 14:20	01/06/26 14:34	TAY/TL1	SW846 3540C	SW846-8082A
Aroclor-1260	ND		1	0.25	mg/kg	01/02/26 14:20	01/06/26 14:34	TAY/TL1	SW846 3540C	SW846-8082A
Aroclor-1262	ND		1	0.25	mg/kg	01/02/26 14:20	01/06/26 14:34	TAY/TL1	SW846 3540C	SW846-8082A
Aroclor-1268	ND		1	0.25	mg/kg	01/02/26 14:20	01/06/26 14:34	TAY/TL1	SW846 3540C	SW846-8082A
Surrogate(s)	Recovery	Q	Limits							
<i>Surrogate: Tetrachloro-m-xylene</i>	73%		10-112			01/02/26 14:20	01/06/26 14:34	TAY/TL1	SW846 3540C	SW846-8082A
<i>Surrogate: Decachlorobiphenyl</i>	78%		10-123			01/02/26 14:20	01/06/26 14:34	TAY/TL1	SW846 3540C	SW846-8082A

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax:cs@emsl.com
EMSL-CIN-01

Table of Contents**EMSL Order ID:** 012340401**LIMS Reference ID:** AD46401**EMSL Customer ID:** WSPN36**Attention:** AP

WSP Canada, Inc. [WSPN36]
36 Pippy Place
Saint John's, NL A1B 4A5
(709) 722-7023
capayablesinvoice@wsp.com

Project Name:

CA0037087.2445-NAVFAC Paint Sampling

Project ID:

_Master Project-WSPN36

Customer PO:**Sales Rep:**

Sarah Jamieson

Received:

12/29/2025 09:00

Reported:**Sample Results****(Continued)**

Sample: GB-Rm1-PCB001A/Gen. Bldg. Room 1/White on metal walls
AD46401-67 (Solid)

Analyte	Result	Q	DF	RL	Units	Prepared Date/Time	Analyzed Date/Time	Prep/Analyst Initials	Prep Method	Analytical Method
GC-SVOA										
Aroclor-1016	ND	D	3	0.75	mg/kg	01/05/26 14:30	01/07/26 15:18	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1221	ND	D	3	0.75	mg/kg	01/05/26 14:30	01/07/26 15:18	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1232	ND	D	3	0.75	mg/kg	01/05/26 14:30	01/07/26 15:18	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1242	ND	D	3	0.75	mg/kg	01/05/26 14:30	01/07/26 15:18	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1248	ND	D	3	0.75	mg/kg	01/05/26 14:30	01/07/26 15:18	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1254	17	D	3	0.75	mg/kg	01/05/26 14:30	01/07/26 15:18	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1260	3.8	D	3	0.75	mg/kg	01/05/26 14:30	01/07/26 15:18	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1262	ND	D	3	0.75	mg/kg	01/05/26 14:30	01/07/26 15:18	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1268	ND	D	3	0.75	mg/kg	01/05/26 14:30	01/07/26 15:18	AJX/AxJ	SW846 3540C	SW846-8082A
Surrogate(s)	Recovery	Q	Limits							
<i>Surrogate: Tetrachloro-m-xylene</i>	108%		10-112			01/05/26 14:30	01/07/26 15:18	AJX/AxJ	SW846 3540C	SW846-8082A
<i>Surrogate: Decachlorobiphenyl</i>	112%		10-123			01/05/26 14:30	01/07/26 15:18	AJX/AxJ	SW846 3540C	SW846-8082A

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
 Telephone: 856-858-4800 Fax:cs@emsl.com
 EMSL-CIN-01

EMSL Order ID: 012340401

LIMS Reference ID: AD46401

EMSL Customer ID: WSPN36

Attention: AP

WSP Canada, Inc. [WSPN36]
 36 Pippy Place
 Saint John's, NL A1B 4A5
 (709) 722-7023
 capayablesinvoice@wsp.com

Project Name:

CA0037087.2445-NAVFAC Paint Sampling

Project ID:

_Master Project-WSPN36

Customer PO:**Sales Rep:**

Sarah Jamieson

Received:

12/29/2025 09:00

Reported:**Sample Results**

(Continued)

Sample: GB-Rm10-PCB001B/Gen. Bldg. Room 10/White on metal walls
AD46401-68 (Solid)

Analyte	Result	Q	DF	RL	Units	Prepared Date/Time	Analyzed Date/Time	Prep/Analyst Initials	Prep Method	Analytical Method
GC-SVOA										
Aroclor-1016	ND		1	0.25	mg/kg	01/05/26 14:30	01/07/26 15:39	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1221	ND		1	0.25	mg/kg	01/05/26 14:30	01/07/26 15:39	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1232	ND		1	0.25	mg/kg	01/05/26 14:30	01/07/26 15:39	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1242	ND		1	0.25	mg/kg	01/05/26 14:30	01/07/26 15:39	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1248	ND		1	0.25	mg/kg	01/05/26 14:30	01/07/26 15:39	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1254	3.7		1	0.25	mg/kg	01/05/26 14:30	01/07/26 15:39	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1260	ND		1	0.25	mg/kg	01/05/26 14:30	01/07/26 15:39	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1262	0.90		1	0.25	mg/kg	01/05/26 14:30	01/07/26 15:39	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1268	ND		1	0.25	mg/kg	01/05/26 14:30	01/07/26 15:39	AJX/AxJ	SW846 3540C	SW846-8082A
Surrogate(s)	Recovery	Q	Limits							
<i>Surrogate: Tetrachloro-m-xylene</i>	97%		10-112			01/05/26 14:30	01/07/26 15:39	AJX/AxJ	SW846 3540C	SW846-8082A
<i>Surrogate: Decachlorobiphenyl</i>	97%		10-123			01/05/26 14:30	01/07/26 15:39	AJX/AxJ	SW846 3540C	SW846-8082A

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax:cs@emsl.com
EMSL-CIN-01

Table of Contents**EMSL Order ID:** 012340401**LIMS Reference ID:** AD46401**EMSL Customer ID:** WSPN36**Attention:** AP

WSP Canada, Inc. [WSPN36]
36 Pippy Place
Saint John's, NL A1B 4A5
(709) 722-7023
capayablesinvoice@wsp.com

Project Name:

CA0037087.2445-NAVFAC Paint Sampling

Project ID:

_Master Project-WSPN36

Customer PO:**Sales Rep:**

Sarah Jamieson

Received:

12/29/2025 09:00

Reported:**Sample Results****(Continued)**

Sample: GB-Rm6-PCB002A/Gen. Bldg. Room 6/White on metal walls
AD46401-69 (Solid)

Analyte	Result	Q	DF	RL	Units	Prepared Date/Time	Analyzed Date/Time	Prep/Analyst Initials	Prep Method	Analytical Method
GC-SVOA										
Aroclor-1016	ND		1	0.24	mg/kg	12/30/25 13:12	01/02/26 21:41	TAY/TL1	SW846 3546	SW846-8082A
Aroclor-1221	ND		1	0.24	mg/kg	12/30/25 13:12	01/02/26 21:41	TAY/TL1	SW846 3546	SW846-8082A
Aroclor-1232	ND		1	0.24	mg/kg	12/30/25 13:12	01/02/26 21:41	TAY/TL1	SW846 3546	SW846-8082A
Aroclor-1242	ND		1	0.24	mg/kg	12/30/25 13:12	01/02/26 21:41	TAY/TL1	SW846 3546	SW846-8082A
Aroclor-1248	ND		1	0.24	mg/kg	12/30/25 13:12	01/02/26 21:41	TAY/TL1	SW846 3546	SW846-8082A
Aroclor-1254	2.3		1	0.24	mg/kg	12/30/25 13:12	01/02/26 21:41	TAY/TL1	SW846 3546	SW846-8082A
Aroclor-1260	ND		1	0.24	mg/kg	12/30/25 13:12	01/02/26 21:41	TAY/TL1	SW846 3546	SW846-8082A
Aroclor-1262	ND		1	0.24	mg/kg	12/30/25 13:12	01/02/26 21:41	TAY/TL1	SW846 3546	SW846-8082A
Aroclor-1268	ND		1	0.24	mg/kg	12/30/25 13:12	01/02/26 21:41	TAY/TL1	SW846 3546	SW846-8082A
Surrogate(s)	Recovery	Q	Limits							
<i>Surrogate: Tetrachloro-m-xylene</i>	68%		10-112			12/30/25 13:12	01/02/26 21:41	TAY/TL1	SW846 3546	SW846-8082A
<i>Surrogate: Decachlorobiphenyl</i>	72%		10-123			12/30/25 13:12	01/02/26 21:41	TAY/TL1	SW846 3546	SW846-8082A

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax:cs@emsl.com
EMSL-CIN-01

Table of Contents**EMSL Order ID:** 012340401**LIMS Reference ID:** AD46401**EMSL Customer ID:** WSPN36**Attention:** AP

WSP Canada, Inc. [WSPN36]
36 Pippy Place
Saint John's, NL A1B 4A5
(709) 722-7023
capayablesinvoice@wsp.com

Project Name:

CA0037087.2445-NAVFAC Paint Sampling

Project ID:

_Master Project-WSPN36

Customer PO:**Sales Rep:**

Sarah Jamieson

Received:

12/29/2025 09:00

Reported:**Sample Results****(Continued)**

Sample: GB-Rm9-PCB002B/Gen. Bldg. Room 9/White on drywall walls
AD46401-70 (Solid)

Analyte	Result	Q	DF	RL	Units	Prepared Date/Time	Analyzed Date/Time	Prep/Analyst Initials	Prep Method	Analytical Method
GC-SVOA										
Aroclor-1016	ND		1	0.25	mg/kg	01/05/26 14:30	01/07/26 16:01	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1221	ND		1	0.25	mg/kg	01/05/26 14:30	01/07/26 16:01	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1232	ND		1	0.25	mg/kg	01/05/26 14:30	01/07/26 16:01	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1242	ND		1	0.25	mg/kg	01/05/26 14:30	01/07/26 16:01	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1248	ND		1	0.25	mg/kg	01/05/26 14:30	01/07/26 16:01	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1254	3.2		1	0.25	mg/kg	01/05/26 14:30	01/07/26 16:01	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1260	ND		1	0.25	mg/kg	01/05/26 14:30	01/07/26 16:01	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1262	ND		1	0.25	mg/kg	01/05/26 14:30	01/07/26 16:01	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1268	ND		1	0.25	mg/kg	01/05/26 14:30	01/07/26 16:01	AJX/AxJ	SW846 3540C	SW846-8082A
Surrogate(s)	Recovery	Q	Limits							
<i>Surrogate: Tetrachloro-m-xylene</i>	84%		10-112			01/05/26 14:30	01/07/26 16:01	AJX/AxJ	SW846 3540C	SW846-8082A
<i>Surrogate: Decachlorobiphenyl</i>	84%		10-123			01/05/26 14:30	01/07/26 16:01	AJX/AxJ	SW846 3540C	SW846-8082A

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax:cs@emsl.com
EMSL-CIN-01

Table of Contents**EMSL Order ID:** 012340401**LIMS Reference ID:** AD46401**EMSL Customer ID:** WSPN36**Attention:** AP

WSP Canada, Inc. [WSPN36]
36 Pippy Place
Saint John's, NL A1B 4A5
(709) 722-7023
capayablesinvoice@wsp.com

Project Name:

CA0037087.2445-NAVFAC Paint Sampling

Project ID:

_Master Project-WSPN36

Customer PO:**Sales Rep:**

Sarah Jamieson

Received:

12/29/2025 09:00

Reported:**Sample Results****(Continued)**

Sample: GB-Rm5-PCB003A/Gen. Bldg. Room 5/Beige on drywall walls
AD46401-71 (Solid)

Analyte	Result	Q	DF	RL	Units	Prepared Date/Time	Analyzed Date/Time	Prep/Analyst Initials	Prep Method	Analytical Method
GC-SVOA										
Aroclor-1016	ND		1	0.25	mg/kg	01/05/26 14:30	01/07/26 16:23	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1221	ND		1	0.25	mg/kg	01/05/26 14:30	01/07/26 16:23	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1232	ND		1	0.25	mg/kg	01/05/26 14:30	01/07/26 16:23	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1242	ND		1	0.25	mg/kg	01/05/26 14:30	01/07/26 16:23	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1248	ND		1	0.25	mg/kg	01/05/26 14:30	01/07/26 16:23	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1254	1.3		1	0.25	mg/kg	01/05/26 14:30	01/07/26 16:23	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1260	ND		1	0.25	mg/kg	01/05/26 14:30	01/07/26 16:23	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1262	ND		1	0.25	mg/kg	01/05/26 14:30	01/07/26 16:23	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1268	ND		1	0.25	mg/kg	01/05/26 14:30	01/07/26 16:23	AJX/AxJ	SW846 3540C	SW846-8082A
Surrogate(s)	Recovery	Q	Limits							
<i>Surrogate: Tetrachloro-m-xylene</i>	84%		10-112			01/05/26 14:30	01/07/26 16:23	AJX/AxJ	SW846 3540C	SW846-8082A
<i>Surrogate: Decachlorobiphenyl</i>	93%		10-123			01/05/26 14:30	01/07/26 16:23	AJX/AxJ	SW846 3540C	SW846-8082A

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax:cs@emsl.com
EMSL-CIN-01

Table of Contents**EMSL Order ID:** 012340401**LIMS Reference ID:** AD46401**EMSL Customer ID:** WSPN36**Attention:** AP

WSP Canada, Inc. [WSPN36]
36 Pippy Place
Saint John's, NL A1B 4A5
(709) 722-7023
capayablesinvoice@wsp.com

Project Name:

CA0037087.2445-NAVFAC Paint Sampling

Project ID:

_Master Project-WSPN36

Customer PO:**Sales Rep:**

Sarah Jamieson

Received:

12/29/2025 09:00

Reported:**Sample Results****(Continued)**

Sample: GB-Rm5-PCB003B/Gen. Bldg. Room 5/Beige on drywall walls
AD46401-72 (Solid)

Analyte	Result	Q	DF	RL	Units	Prepared Date/Time	Analyzed Date/Time	Prep/Analyst Initials	Prep Method	Analytical Method
GC-SVOA										
Aroclor-1016	ND		1	0.26	mg/kg	01/05/26 14:30	01/07/26 16:45	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1221	ND		1	0.26	mg/kg	01/05/26 14:30	01/07/26 16:45	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1232	ND		1	0.26	mg/kg	01/05/26 14:30	01/07/26 16:45	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1242	ND		1	0.26	mg/kg	01/05/26 14:30	01/07/26 16:45	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1248	ND		1	0.26	mg/kg	01/05/26 14:30	01/07/26 16:45	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1254	0.91		1	0.26	mg/kg	01/05/26 14:30	01/07/26 16:45	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1260	ND		1	0.26	mg/kg	01/05/26 14:30	01/07/26 16:45	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1262	ND		1	0.26	mg/kg	01/05/26 14:30	01/07/26 16:45	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1268	ND		1	0.26	mg/kg	01/05/26 14:30	01/07/26 16:45	AJX/AxJ	SW846 3540C	SW846-8082A
Surrogate(s)	Recovery	Q	Limits							
<i>Surrogate: Tetrachloro-m-xylene</i>	84%		10-112			01/05/26 14:30	01/07/26 16:45	AJX/AxJ	SW846 3540C	SW846-8082A
<i>Surrogate: Decachlorobiphenyl</i>	99%		10-123			01/05/26 14:30	01/07/26 16:45	AJX/AxJ	SW846 3540C	SW846-8082A

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax:cs@emsl.com
EMSL-CIN-01

Table of Contents**EMSL Order ID:** 012340401**LIMS Reference ID:** AD46401**EMSL Customer ID:** WSPN36**Attention:** AP

WSP Canada, Inc. [WSPN36]
36 Pippy Place
Saint John's, NL A1B 4A5
(709) 722-7023
capayablesinvoice@wsp.com

Project Name:

CA0037087.2445-NAVFAC Paint Sampling

Project ID:

_Master Project-WSPN36

Customer PO:**Sales Rep:**

Sarah Jamieson

Received:

12/29/2025 09:00

Reported:**Sample Results****(Continued)**

Sample: GB-Rm1-PCB004A/Gen. Bldg. Room 1/White on concrete block walls
AD46401-73 (Solid)

Analyte	Result	Q	DF	RL	Units	Prepared Date/Time	Analyzed Date/Time	Prep/Analyst Initials	Prep Method	Analytical Method
GC-SVOA										
Aroclor-1016	ND		1	0.25	mg/kg	01/05/26 14:30	01/07/26 17:07	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1221	ND		1	0.25	mg/kg	01/05/26 14:30	01/07/26 17:07	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1232	ND		1	0.25	mg/kg	01/05/26 14:30	01/07/26 17:07	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1242	ND		1	0.25	mg/kg	01/05/26 14:30	01/07/26 17:07	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1248	ND		1	0.25	mg/kg	01/05/26 14:30	01/07/26 17:07	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1254	2.9		1	0.25	mg/kg	01/05/26 14:30	01/07/26 17:07	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1260	ND		1	0.25	mg/kg	01/05/26 14:30	01/07/26 17:07	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1262	ND		1	0.25	mg/kg	01/05/26 14:30	01/07/26 17:07	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1268	ND		1	0.25	mg/kg	01/05/26 14:30	01/07/26 17:07	AJX/AxJ	SW846 3540C	SW846-8082A
Surrogate(s)	Recovery	Q	Limits							
<i>Surrogate: Tetrachloro-m-xylene</i>	88%		10-112			01/05/26 14:30	01/07/26 17:07	AJX/AxJ	SW846 3540C	SW846-8082A
<i>Surrogate: Decachlorobiphenyl</i>	88%		10-123			01/05/26 14:30	01/07/26 17:07	AJX/AxJ	SW846 3540C	SW846-8082A

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax:cs@emsl.com
EMSL-CIN-01

Table of Contents**EMSL Order ID:** 012340401**LIMS Reference ID:** AD46401**EMSL Customer ID:** WSPN36**Attention:** AP

WSP Canada, Inc. [WSPN36]
36 Pippy Place
Saint John's, NL A1B 4A5
(709) 722-7023
capayablesinvoice@wsp.com

Project Name:

CA0037087.2445-NAVFAC Paint Sampling

Project ID:

_Master Project-WSPN36

Customer PO:**Sales Rep:**

Sarah Jamieson

Received:

12/29/2025 09:00

Reported:**Sample Results****(Continued)**

Sample: GB-Rm1-PCB004B/Gen. Bldg. Room 1/White on concrete block walls
AD46401-74 (Solid)

Analyte	Result	Q	DF	RL	Units	Prepared Date/Time	Analyzed Date/Time	Prep/Analyst Initials	Prep Method	Analytical Method
GC-SVOA										
Aroclor-1016	ND		1	0.24	mg/kg	01/05/26 14:30	01/07/26 17:29	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1221	ND		1	0.24	mg/kg	01/05/26 14:30	01/07/26 17:29	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1232	ND		1	0.24	mg/kg	01/05/26 14:30	01/07/26 17:29	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1242	ND		1	0.24	mg/kg	01/05/26 14:30	01/07/26 17:29	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1248	ND		1	0.24	mg/kg	01/05/26 14:30	01/07/26 17:29	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1254	2.2		1	0.24	mg/kg	01/05/26 14:30	01/07/26 17:29	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1260	ND		1	0.24	mg/kg	01/05/26 14:30	01/07/26 17:29	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1262	ND		1	0.24	mg/kg	01/05/26 14:30	01/07/26 17:29	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1268	ND		1	0.24	mg/kg	01/05/26 14:30	01/07/26 17:29	AJX/AxJ	SW846 3540C	SW846-8082A
Surrogate(s)	Recovery	Q	Limits							
<i>Surrogate: Tetrachloro-m-xylene</i>	87%		10-112			01/05/26 14:30	01/07/26 17:29	AJX/AxJ	SW846 3540C	SW846-8082A
<i>Surrogate: Decachlorobiphenyl</i>	89%		10-123			01/05/26 14:30	01/07/26 17:29	AJX/AxJ	SW846 3540C	SW846-8082A

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax:cs@emsl.com
EMSL-CIN-01

Table of Contents**EMSL Order ID:** 012340401**LIMS Reference ID:** AD46401**EMSL Customer ID:** WSPN36**Attention:** AP

WSP Canada, Inc. [WSPN36]
36 Pippy Place
Saint John's, NL A1B 4A5
(709) 722-7023
capayablesinvoice@wsp.com

Project Name:

CA0037087.2445-NAVFAC Paint Sampling

Project ID:

_Master Project-WSPN36

Customer PO:**Sales Rep:**

Sarah Jamieson

Received:

12/29/2025 09:00

Reported:**Sample Results****(Continued)**

Sample: GB-Rm1-PCB005A/Gen. Bldg. Room 1/Black on concrete block walls
AD46401-75 (Solid)

Analyte	Result	Q	DF	RL	Units	Prepared Date/Time	Analyzed Date/Time	Prep/Analyst Initials	Prep Method	Analytical Method
GC-SVOA										
Aroclor-1016	ND		1	0.85	mg/kg	01/05/26 14:30	01/07/26 17:51	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1221	ND		1	0.85	mg/kg	01/05/26 14:30	01/07/26 17:51	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1232	ND		1	0.85	mg/kg	01/05/26 14:30	01/07/26 17:51	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1242	ND		1	0.85	mg/kg	01/05/26 14:30	01/07/26 17:51	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1248	ND		1	0.85	mg/kg	01/05/26 14:30	01/07/26 17:51	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1254	15		1	0.85	mg/kg	01/05/26 14:30	01/07/26 17:51	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1260	ND		1	0.85	mg/kg	01/05/26 14:30	01/07/26 17:51	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1262	ND		1	0.85	mg/kg	01/05/26 14:30	01/07/26 17:51	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1268	ND		1	0.85	mg/kg	01/05/26 14:30	01/07/26 17:51	AJX/AxJ	SW846 3540C	SW846-8082A
Surrogate(s)	Recovery	Q	Limits							
<i>Surrogate: Tetrachloro-m-xylene</i>	96%		10-112			01/05/26 14:30	01/07/26 17:51	AJX/AxJ	SW846 3540C	SW846-8082A
<i>Surrogate: Decachlorobiphenyl</i>	97%		10-123			01/05/26 14:30	01/07/26 17:51	AJX/AxJ	SW846 3540C	SW846-8082A

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax:cs@emsl.com
EMSL-CIN-01

Table of Contents**EMSL Order ID:** 012340401**LIMS Reference ID:** AD46401**EMSL Customer ID:** WSPN36**Attention:** AP

WSP Canada, Inc. [WSPN36]
36 Pippy Place
Saint John's, NL A1B 4A5
(709) 722-7023
capayablesinvoice@wsp.com

Project Name:

CA0037087.2445-NAVFAC Paint Sampling

Project ID:

_Master Project-WSPN36

Customer PO:**Sales Rep:**

Sarah Jamieson

Received:

12/29/2025 09:00

Reported:**Sample Results****(Continued)**

Sample: GB-Rm1-PCB005B/Gen. Bldg. Room 1/Black on concrete block walls
AD46401-76 (Solid)

Analyte	Result	Q	DF	RL	Units	Prepared Date/Time	Analyzed Date/Time	Prep/Analyst Initials	Prep Method	Analytical Method
GC-SVOA										
Aroclor-1016	ND		1	1.1	mg/kg	01/05/26 14:30	01/07/26 18:13	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1221	ND		1	1.1	mg/kg	01/05/26 14:30	01/07/26 18:13	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1232	ND		1	1.1	mg/kg	01/05/26 14:30	01/07/26 18:13	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1242	ND		1	1.1	mg/kg	01/05/26 14:30	01/07/26 18:13	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1248	ND		1	1.1	mg/kg	01/05/26 14:30	01/07/26 18:13	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1254	15		1	1.1	mg/kg	01/05/26 14:30	01/07/26 18:13	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1260	ND		1	1.1	mg/kg	01/05/26 14:30	01/07/26 18:13	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1262	ND		1	1.1	mg/kg	01/05/26 14:30	01/07/26 18:13	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1268	ND		1	1.1	mg/kg	01/05/26 14:30	01/07/26 18:13	AJX/AxJ	SW846 3540C	SW846-8082A
Surrogate(s)	Recovery	Q	Limits							
<i>Surrogate: Tetrachloro-m-xylene</i>	89%		10-112			01/05/26 14:30	01/07/26 18:13	AJX/AxJ	SW846 3540C	SW846-8082A
<i>Surrogate: Decachlorobiphenyl</i>	89%		10-123			01/05/26 14:30	01/07/26 18:13	AJX/AxJ	SW846 3540C	SW846-8082A

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax:cs@emsl.com
EMSL-CIN-01

Table of Contents**EMSL Order ID:** 012340401**LIMS Reference ID:** AD46401**EMSL Customer ID:** WSPN36**Attention:** AP

WSP Canada, Inc. [WSPN36]
36 Pippy Place
Saint John's, NL A1B 4A5
(709) 722-7023
capayablesinvoice@wsp.com

Project Name:

CA0037087.2445-NAVFAC Paint Sampling

Project ID:

_Master Project-WSPN36

Customer PO:**Sales Rep:**

Sarah Jamieson

Received:

12/29/2025 09:00

Reported:**Sample Results****(Continued)**

Sample: GB-Rm4-PCB006A/Gen. Bldg. Room 4/Black on drywall walls
AD46401-77 (Solid)

Analyte	Result	Q	DF	RL	Units	Prepared Date/Time	Analyzed Date/Time	Prep/Analyst Initials	Prep Method	Analytical Method
GC-SVOA										
Aroclor-1016	ND		1	0.25	mg/kg	01/05/26 14:30	01/07/26 18:34	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1221	ND		1	0.25	mg/kg	01/05/26 14:30	01/07/26 18:34	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1232	ND		1	0.25	mg/kg	01/05/26 14:30	01/07/26 18:34	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1242	ND		1	0.25	mg/kg	01/05/26 14:30	01/07/26 18:34	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1248	ND		1	0.25	mg/kg	01/05/26 14:30	01/07/26 18:34	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1254	4.5		1	0.25	mg/kg	01/05/26 14:30	01/07/26 18:34	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1260	ND		1	0.25	mg/kg	01/05/26 14:30	01/07/26 18:34	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1262	ND		1	0.25	mg/kg	01/05/26 14:30	01/07/26 18:34	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1268	ND		1	0.25	mg/kg	01/05/26 14:30	01/07/26 18:34	AJX/AxJ	SW846 3540C	SW846-8082A
Surrogate(s)	Recovery	Q	Limits							
<i>Surrogate: Tetrachloro-m-xylene</i>	87%		10-112			01/05/26 14:30	01/07/26 18:34	AJX/AxJ	SW846 3540C	SW846-8082A
<i>Surrogate: Decachlorobiphenyl</i>	83%		10-123			01/05/26 14:30	01/07/26 18:34	AJX/AxJ	SW846 3540C	SW846-8082A

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
 Telephone: 856-858-4800 Fax:cs@emsl.com
 EMSL-CIN-01

EMSL Order ID: 012340401

LIMS Reference ID: AD46401

EMSL Customer ID: WSPN36

Attention: AP

WSP Canada, Inc. [WSPN36]
 36 Pippy Place
 Saint John's, NL A1B 4A5
 (709) 722-7023
 capayablesinvoice@wsp.com

Project Name:

CA0037087.2445-NAVFAC Paint Sampling

Project ID:

_Master Project-WSPN36

Customer PO:**Sales Rep:**

Sarah Jamieson

Received:

12/29/2025 09:00

Reported:**Sample Results**

(Continued)

Sample: GB-Rm4-PCB006B/Gen. Bldg. Room 4/Black on drywall walls
AD46401-78 (Solid)

Analyte	Result	Q	DF	RL	Units	Prepared Date/Time	Analyzed Date/Time	Prep/Analyst Initials	Prep Method	Analytical Method
GC-SVOA										
Aroclor-1016	ND		1	0.26	mg/kg	01/05/26 14:30	01/07/26 18:56	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1221	ND		1	0.26	mg/kg	01/05/26 14:30	01/07/26 18:56	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1232	ND		1	0.26	mg/kg	01/05/26 14:30	01/07/26 18:56	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1242	ND		1	0.26	mg/kg	01/05/26 14:30	01/07/26 18:56	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1248	ND		1	0.26	mg/kg	01/05/26 14:30	01/07/26 18:56	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1254	5.0		1	0.26	mg/kg	01/05/26 14:30	01/07/26 18:56	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1260	0.85		1	0.26	mg/kg	01/05/26 14:30	01/07/26 18:56	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1262	ND		1	0.26	mg/kg	01/05/26 14:30	01/07/26 18:56	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1268	ND		1	0.26	mg/kg	01/05/26 14:30	01/07/26 18:56	AJX/AxJ	SW846 3540C	SW846-8082A
Surrogate(s)	Recovery	Q	Limits							
<i>Surrogate: Tetrachloro-m-xylene</i>	85%		10-112			01/05/26 14:30	01/07/26 18:56	AJX/AxJ	SW846 3540C	SW846-8082A
<i>Surrogate: Decachlorobiphenyl</i>	82%		10-123			01/05/26 14:30	01/07/26 18:56	AJX/AxJ	SW846 3540C	SW846-8082A

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax:cs@emsl.com
EMSL-CIN-01

Table of Contents**EMSL Order ID:** 012340401**LIMS Reference ID:** AD46401**EMSL Customer ID:** WSPN36**Attention:** AP

WSP Canada, Inc. [WSPN36]
36 Pippy Place
Saint John's, NL A1B 4A5
(709) 722-7023
capayablesinvoice@wsp.com

Project Name:

CA0037087.2445-NAVFAC Paint Sampling

Project ID:

_Master Project-WSPN36

Customer PO:**Sales Rep:**

Sarah Jamieson

Received:

12/29/2025 09:00

Reported:**Sample Results****(Continued)**

Sample: GB-Rm4-PCB007A/Gen. Bldg. Room 4/Red on concrete walls
AD46401-79 (Solid)

Analyte	Result	Q	DF	RL	Units	Prepared Date/Time	Analyzed Date/Time	Prep/Analyst Initials	Prep Method	Analytical Method
GC-SVOA										
Aroclor-1016	ND		1	0.24	mg/kg	01/05/26 14:30	01/07/26 20:45	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1221	ND		1	0.24	mg/kg	01/05/26 14:30	01/07/26 20:45	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1232	ND		1	0.24	mg/kg	01/05/26 14:30	01/07/26 20:45	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1242	ND		1	0.24	mg/kg	01/05/26 14:30	01/07/26 20:45	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1248	ND		1	0.24	mg/kg	01/05/26 14:30	01/07/26 20:45	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1254	4.8		1	0.24	mg/kg	01/05/26 14:30	01/07/26 20:45	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1260	ND		1	0.24	mg/kg	01/05/26 14:30	01/07/26 20:45	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1262	ND		1	0.24	mg/kg	01/05/26 14:30	01/07/26 20:45	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1268	ND		1	0.24	mg/kg	01/05/26 14:30	01/07/26 20:45	AJX/AxJ	SW846 3540C	SW846-8082A
Surrogate(s)	Recovery	Q	Limits							
<i>Surrogate: Tetrachloro-m-xylene</i>	75%		10-112			01/05/26 14:30	01/07/26 20:45	AJX/AxJ	SW846 3540C	SW846-8082A
<i>Surrogate: Decachlorobiphenyl</i>	66%		10-123			01/05/26 14:30	01/07/26 20:45	AJX/AxJ	SW846 3540C	SW846-8082A

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax:cs@emsl.com
EMSL-CIN-01

Table of Contents**EMSL Order ID:** 012340401**LIMS Reference ID:** AD46401**EMSL Customer ID:** WSPN36**Attention:** AP

WSP Canada, Inc. [WSPN36]
36 Pippy Place
Saint John's, NL A1B 4A5
(709) 722-7023
capayablesinvoice@wsp.com

Project Name:

CA0037087.2445-NAVFAC Paint Sampling

Project ID:

_Master Project-WSPN36

Customer PO:**Sales Rep:**

Sarah Jamieson

Received:

12/29/2025 09:00

Reported:**Sample Results****(Continued)**

Sample: GB-Rm12-PCB007B/Gen. Bldg. Room 4/Red on concrete walls
AD46401-80 (Solid)

Analyte	Result	Q	DF	RL	Units	Prepared Date/Time	Analyzed Date/Time	Prep/Analyst Initials	Prep Method	Analytical Method
GC-SVOA										
Aroclor-1016	ND		1	0.25	mg/kg	01/05/26 14:30	01/07/26 21:07	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1221	ND		1	0.25	mg/kg	01/05/26 14:30	01/07/26 21:07	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1232	ND		1	0.25	mg/kg	01/05/26 14:30	01/07/26 21:07	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1242	ND		1	0.25	mg/kg	01/05/26 14:30	01/07/26 21:07	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1248	ND		1	0.25	mg/kg	01/05/26 14:30	01/07/26 21:07	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1254	6.2		1	0.25	mg/kg	01/05/26 14:30	01/07/26 21:07	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1260	ND		1	0.25	mg/kg	01/05/26 14:30	01/07/26 21:07	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1262	ND		1	0.25	mg/kg	01/05/26 14:30	01/07/26 21:07	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1268	ND		1	0.25	mg/kg	01/05/26 14:30	01/07/26 21:07	AJX/AxJ	SW846 3540C	SW846-8082A
Surrogate(s)	Recovery	Q	Limits							
<i>Surrogate: Tetrachloro-m-xylene</i>	84%		10-112			01/05/26 14:30	01/07/26 21:07	AJX/AxJ	SW846 3540C	SW846-8082A
<i>Surrogate: Decachlorobiphenyl</i>	80%		10-123			01/05/26 14:30	01/07/26 21:07	AJX/AxJ	SW846 3540C	SW846-8082A

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
 Telephone: 856-858-4800 Fax:cs@emsl.com
 EMSL-CIN-01

EMSL Order ID: 012340401

LIMS Reference ID: AD46401

EMSL Customer ID: WSPN36

Attention: AP

WSP Canada, Inc. [WSPN36]
 36 Pippy Place
 Saint John's, NL A1B 4A5
 (709) 722-7023
 capayablesinvoice@wsp.com

Project Name: CA0037087.2445-NAVFAC Paint Sampling**Project ID:** _Master Project-WSPN36**Customer PO:****Sales Rep:** Sarah Jamieson**Received:** 12/29/2025 09:00**Reported:****Sample Results****(Continued)**

Sample: GB-Rm10-PCB008A/Gen. Bldg. Room 10/Light grey on metal generator housing
AD46401-81 (Solid)

Analyte	Result	Q	DF	RL	Units	Prepared Date/Time	Analyzed Date/Time	Prep/Analyst Initials	Prep Method	Analytical Method
GC-SVOA										
Aroclor-1016	ND		1	0.24	mg/kg	01/05/26 14:30	01/07/26 21:29	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1221	ND		1	0.24	mg/kg	01/05/26 14:30	01/07/26 21:29	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1232	ND		1	0.24	mg/kg	01/05/26 14:30	01/07/26 21:29	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1242	ND		1	0.24	mg/kg	01/05/26 14:30	01/07/26 21:29	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1248	ND		1	0.24	mg/kg	01/05/26 14:30	01/07/26 21:29	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1254	2.5		1	0.24	mg/kg	01/05/26 14:30	01/07/26 21:29	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1260	ND		1	0.24	mg/kg	01/05/26 14:30	01/07/26 21:29	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1262	0.51		1	0.24	mg/kg	01/05/26 14:30	01/07/26 21:29	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1268	ND		1	0.24	mg/kg	01/05/26 14:30	01/07/26 21:29	AJX/AxJ	SW846 3540C	SW846-8082A
Surrogate(s)	Recovery	Q		Limits						
<i>Surrogate: Tetrachloro-m-xylene</i>	94%			10-112		01/05/26 14:30	01/07/26 21:29	AJX/AxJ	SW846 3540C	SW846-8082A
<i>Surrogate: Decachlorobiphenyl</i>	84%			10-123		01/05/26 14:30	01/07/26 21:29	AJX/AxJ	SW846 3540C	SW846-8082A

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
 Telephone: 856-858-4800 Fax:cs@emsl.com
 EMSL-CIN-01

EMSL Order ID: 012340401

LIMS Reference ID: AD46401

EMSL Customer ID: WSPN36

Attention: AP

WSP Canada, Inc. [WSPN36]
 36 Pippy Place
 Saint John's, NL A1B 4A5
 (709) 722-7023
 capayablesinvoice@wsp.com

Project Name: CA0037087.2445-NAVFAC Paint Sampling**Project ID:** _Master Project-WSPN36**Customer PO:****Sales Rep:** Sarah Jamieson**Received:** 12/29/2025 09:00**Reported:****Sample Results****(Continued)**

Sample: GB-Rm10-PCB008B/Gen. Bldg. Room 10/Light grey on metal generator housing
AD46401-82 (Solid)

Analyte	Result	Q	DF	RL	Units	Prepared Date/Time	Analyzed Date/Time	Prep/Analyst Initials	Prep Method	Analytical Method
GC-SVOA										
Aroclor-1016	ND		1	0.24	mg/kg	01/05/26 14:30	01/07/26 21:51	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1221	ND		1	0.24	mg/kg	01/05/26 14:30	01/07/26 21:51	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1232	ND		1	0.24	mg/kg	01/05/26 14:30	01/07/26 21:51	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1242	ND		1	0.24	mg/kg	01/05/26 14:30	01/07/26 21:51	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1248	ND		1	0.24	mg/kg	01/05/26 14:30	01/07/26 21:51	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1254	2.1		1	0.24	mg/kg	01/05/26 14:30	01/07/26 21:51	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1260	ND		1	0.24	mg/kg	01/05/26 14:30	01/07/26 21:51	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1262	0.48		1	0.24	mg/kg	01/05/26 14:30	01/07/26 21:51	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1268	ND		1	0.24	mg/kg	01/05/26 14:30	01/07/26 21:51	AJX/AxJ	SW846 3540C	SW846-8082A
Surrogate(s)	Recovery	Q		Limits						
<i>Surrogate: Tetrachloro-m-xylene</i>	85%			10-112		01/05/26 14:30	01/07/26 21:51	AJX/AxJ	SW846 3540C	SW846-8082A
<i>Surrogate: Decachlorobiphenyl</i>	85%			10-123		01/05/26 14:30	01/07/26 21:51	AJX/AxJ	SW846 3540C	SW846-8082A

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
 Telephone: 856-858-4800 Fax:cs@emsl.com
 EMSL-CIN-01

Table of Contents

EMSL Order ID: 012340401

LIMS Reference ID: AD46401

EMSL Customer ID: WSPN36

Attention: AP

WSP Canada, Inc. [WSPN36]
 36 Pippy Place
 Saint John's, NL A1B 4A5
 (709) 722-7023
 capayablesinvoice@wsp.com

Project Name:

CA0037087.2445-NAVFAC Paint Sampling

Project ID:

_Master Project-WSPN36

Customer PO:**Sales Rep:**

Sarah Jamieson

Received:

12/29/2025 09:00

Reported:**Sample Results**

(Continued)

Sample: GB-Rm10-PCB009A/Gen. Bldg. Room 10/Black on pipe insulation paper
AD46401-83 (Solid)

Analyte	Result	Q	DF	RL	Units	Prepared Date/Time	Analyzed Date/Time	Prep/Analyst Initials	Prep Method	Analytical Method
GC-SVOA										
Aroclor-1016	ND		1	0.24	mg/kg	01/05/26 14:30	01/08/26 12:02	AJX/TL1	SW846 3540C	SW846-8082A
Aroclor-1221	ND		1	0.24	mg/kg	01/05/26 14:30	01/08/26 12:02	AJX/TL1	SW846 3540C	SW846-8082A
Aroclor-1232	ND		1	0.24	mg/kg	01/05/26 14:30	01/08/26 12:02	AJX/TL1	SW846 3540C	SW846-8082A
Aroclor-1242	ND		1	0.24	mg/kg	01/05/26 14:30	01/08/26 12:02	AJX/TL1	SW846 3540C	SW846-8082A
Aroclor-1248	ND		1	0.24	mg/kg	01/05/26 14:30	01/08/26 12:02	AJX/TL1	SW846 3540C	SW846-8082A
Aroclor-1254	0.95		1	0.24	mg/kg	01/05/26 14:30	01/08/26 12:02	AJX/TL1	SW846 3540C	SW846-8082A
Aroclor-1260	ND		1	0.24	mg/kg	01/05/26 14:30	01/08/26 12:02	AJX/TL1	SW846 3540C	SW846-8082A
Aroclor-1262	ND		1	0.24	mg/kg	01/05/26 14:30	01/08/26 12:02	AJX/TL1	SW846 3540C	SW846-8082A
Aroclor-1268	ND		1	0.24	mg/kg	01/05/26 14:30	01/08/26 12:02	AJX/TL1	SW846 3540C	SW846-8082A
Surrogate(s)	Recovery	Q	Limits							
<i>Surrogate: Tetrachloro-m-xylene</i>	17%		10-112			01/05/26 14:30	01/08/26 12:02	AJX/TL1	SW846 3540C	SW846-8082A
<i>Surrogate: Decachlorobiphenyl</i>	39%		10-123			01/05/26 14:30	01/08/26 12:02	AJX/TL1	SW846 3540C	SW846-8082A

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax:cs@emsl.com
EMSL-CIN-01

Table of Contents**EMSL Order ID:** 012340401**LIMS Reference ID:** AD46401**EMSL Customer ID:** WSPN36**Attention:** AP

WSP Canada, Inc. [WSPN36]
36 Pippy Place
Saint John's, NL A1B 4A5
(709) 722-7023
capayablesinvoice@wsp.com

Project Name:

CA0037087.2445-NAVFAC Paint Sampling

Project ID:

_Master Project-WSPN36

Customer PO:**Sales Rep:**

Sarah Jamieson

Received:

12/29/2025 09:00

Reported:**Sample Results****(Continued)**

Sample: GB-Rm10-PCB009B/Gen. Bldg. Room 10/Black on pipe insulation paper
AD46401-84 (Solid)

Analyte	Result	Q	DF	RL	Units	Prepared Date/Time	Analyzed Date/Time	Prep/Analyst Initials	Prep Method	Analytical Method
GC-SVOA										
Aroclor-1016	ND		1	0.25	mg/kg	01/05/26 14:30	01/08/26 12:24	AJX/TL1	SW846 3540C	SW846-8082A
Aroclor-1221	ND		1	0.25	mg/kg	01/05/26 14:30	01/08/26 12:24	AJX/TL1	SW846 3540C	SW846-8082A
Aroclor-1232	ND		1	0.25	mg/kg	01/05/26 14:30	01/08/26 12:24	AJX/TL1	SW846 3540C	SW846-8082A
Aroclor-1242	ND		1	0.25	mg/kg	01/05/26 14:30	01/08/26 12:24	AJX/TL1	SW846 3540C	SW846-8082A
Aroclor-1248	ND		1	0.25	mg/kg	01/05/26 14:30	01/08/26 12:24	AJX/TL1	SW846 3540C	SW846-8082A
Aroclor-1254	1.1		1	0.25	mg/kg	01/05/26 14:30	01/08/26 12:24	AJX/TL1	SW846 3540C	SW846-8082A
Aroclor-1260	ND		1	0.25	mg/kg	01/05/26 14:30	01/08/26 12:24	AJX/TL1	SW846 3540C	SW846-8082A
Aroclor-1262	ND		1	0.25	mg/kg	01/05/26 14:30	01/08/26 12:24	AJX/TL1	SW846 3540C	SW846-8082A
Aroclor-1268	ND		1	0.25	mg/kg	01/05/26 14:30	01/08/26 12:24	AJX/TL1	SW846 3540C	SW846-8082A
Surrogate(s)	Recovery	Q	Limits							
<i>Surrogate: Tetrachloro-m-xylene</i>	18%		10-112			01/05/26 14:30	01/08/26 12:24	AJX/TL1	SW846 3540C	SW846-8082A
<i>Surrogate: Decachlorobiphenyl</i>	78%		10-123			01/05/26 14:30	01/08/26 12:24	AJX/TL1	SW846 3540C	SW846-8082A

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
 Telephone: 856-858-4800 Fax:cs@emsl.com
 EMSL-CIN-01

EMSL Order ID: 012340401

LIMS Reference ID: AD46401

EMSL Customer ID: WSPN36

Attention: AP

WSP Canada, Inc. [WSPN36]
 36 Pippy Place
 Saint John's, NL A1B 4A5
 (709) 722-7023
 capayablesinvoice@wsp.com

Project Name:

CA0037087.2445-NAVFAC Paint Sampling

Project ID:

_Master Project-WSPN36

Customer PO:**Sales Rep:**

Sarah Jamieson

Received:

12/29/2025 09:00

Reported:**Sample Results**

(Continued)

Sample: GB-Rm10-PCB010A/Gen. Bldg. Room 10/Light grey on metal pipe
AD46401-85 (Solid)

Analyte	Result	Q	DF	RL	Units	Prepared Date/Time	Analyzed Date/Time	Prep/Analyst Initials	Prep Method	Analytical Method
GC-SVOA										
Aroclor-1016	ND		1	0.24	mg/kg	01/05/26 14:30	01/07/26 19:18	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1221	ND		1	0.24	mg/kg	01/05/26 14:30	01/07/26 19:18	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1232	ND		1	0.24	mg/kg	01/05/26 14:30	01/07/26 19:18	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1242	ND		1	0.24	mg/kg	01/05/26 14:30	01/07/26 19:18	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1248	ND		1	0.24	mg/kg	01/05/26 14:30	01/07/26 19:18	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1254	2.4		1	0.24	mg/kg	01/05/26 14:30	01/07/26 19:18	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1260	ND		1	0.24	mg/kg	01/05/26 14:30	01/07/26 19:18	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1262	ND		1	0.24	mg/kg	01/05/26 14:30	01/07/26 19:18	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1268	0.43		1	0.24	mg/kg	01/05/26 14:30	01/07/26 19:18	AJX/AxJ	SW846 3540C	SW846-8082A
Surrogate(s)	Recovery	Q	Limits							
<i>Surrogate: Tetrachloro-m-xylene</i>	86%		10-112			01/05/26 14:30	01/07/26 19:18	AJX/AxJ	SW846 3540C	SW846-8082A
<i>Surrogate: Decachlorobiphenyl</i>	88%		10-123			01/05/26 14:30	01/07/26 19:18	AJX/AxJ	SW846 3540C	SW846-8082A

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax:cs@emsl.com
EMSL-CIN-01

Table of Contents**EMSL Order ID:** 012340401**LIMS Reference ID:** AD46401**EMSL Customer ID:** WSPN36**Attention:** AP

WSP Canada, Inc. [WSPN36]
36 Pippy Place
Saint John's, NL A1B 4A5
(709) 722-7023
capayablesinvoice@wsp.com

Project Name:

CA0037087.2445-NAVFAC Paint Sampling

Project ID:

_Master Project-WSPN36

Customer PO:**Sales Rep:**

Sarah Jamieson

Received:

12/29/2025 09:00

Reported:**Sample Results****(Continued)**

Sample: GB-Rm10-PCB010B/Gen. Bldg. Room 10/Light grey on metal pipe
AD46401-86 (Solid)

Analyte	Result	Q	DF	RL	Units	Prepared Date/Time	Analyzed Date/Time	Prep/Analyst Initials	Prep Method	Analytical Method
GC-SVOA										
Aroclor-1016	ND		1	0.25	mg/kg	01/05/26 14:30	01/07/26 19:40	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1221	ND		1	0.25	mg/kg	01/05/26 14:30	01/07/26 19:40	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1232	ND		1	0.25	mg/kg	01/05/26 14:30	01/07/26 19:40	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1242	ND		1	0.25	mg/kg	01/05/26 14:30	01/07/26 19:40	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1248	ND		1	0.25	mg/kg	01/05/26 14:30	01/07/26 19:40	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1254	6.1		1	0.25	mg/kg	01/05/26 14:30	01/07/26 19:40	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1260	ND		1	0.25	mg/kg	01/05/26 14:30	01/07/26 19:40	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1262	ND		1	0.25	mg/kg	01/05/26 14:30	01/07/26 19:40	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1268	0.61		1	0.25	mg/kg	01/05/26 14:30	01/07/26 19:40	AJX/AxJ	SW846 3540C	SW846-8082A
Surrogate(s)	Recovery	Q	Limits							
<i>Surrogate: Tetrachloro-m-xylene</i>	85%		10-112			01/05/26 14:30	01/07/26 19:40	AJX/AxJ	SW846 3540C	SW846-8082A
<i>Surrogate: Decachlorobiphenyl</i>	81%		10-123			01/05/26 14:30	01/07/26 19:40	AJX/AxJ	SW846 3540C	SW846-8082A

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax:cs@emsl.com
EMSL-CIN-01

Table of Contents**EMSL Order ID:** 012340401**LIMS Reference ID:** AD46401**EMSL Customer ID:** WSPN36**Attention:** AP

WSP Canada, Inc. [WSPN36]
36 Pippy Place
Saint John's, NL A1B 4A5
(709) 722-7023
capayablesinvoice@wsp.com

Project Name:

CA0037087.2445-NAVFAC Paint Sampling

Project ID:

_Master Project-WSPN36

Customer PO:**Sales Rep:**

Sarah Jamieson

Received:

12/29/2025 09:00

Reported:**Sample Results****(Continued)**

Sample: GB-Rm2-PCB011A/Gen. Bldg. Room 2/Light grey on concrete floor
AD46401-87 (Solid)

Analyte	Result	Q	DF	RL	Units	Prepared Date/Time	Analyzed Date/Time	Prep/Analyst Initials	Prep Method	Analytical Method
GC-SVOA										
Aroclor-1016	ND		1	0.25	mg/kg	01/05/26 14:30	01/07/26 20:02	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1221	ND		1	0.25	mg/kg	01/05/26 14:30	01/07/26 20:02	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1232	ND		1	0.25	mg/kg	01/05/26 14:30	01/07/26 20:02	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1242	ND		1	0.25	mg/kg	01/05/26 14:30	01/07/26 20:02	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1248	ND		1	0.25	mg/kg	01/05/26 14:30	01/07/26 20:02	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1254	0.67		1	0.25	mg/kg	01/05/26 14:30	01/07/26 20:02	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1260	ND		1	0.25	mg/kg	01/05/26 14:30	01/07/26 20:02	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1262	ND		1	0.25	mg/kg	01/05/26 14:30	01/07/26 20:02	AJX/AxJ	SW846 3540C	SW846-8082A
Aroclor-1268	ND		1	0.25	mg/kg	01/05/26 14:30	01/07/26 20:02	AJX/AxJ	SW846 3540C	SW846-8082A
Surrogate(s)	Recovery	Q		Limits						
<i>Surrogate: Tetrachloro-m-xylene</i>	73%			10-112		01/05/26 14:30	01/07/26 20:02	AJX/AxJ	SW846 3540C	SW846-8082A
<i>Surrogate: Decachlorobiphenyl</i>	64%			10-123		01/05/26 14:30	01/07/26 20:02	AJX/AxJ	SW846 3540C	SW846-8082A

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax:cs@emsl.com
EMSL-CIN-01

EMSL Order ID: 012340401

LIMS Reference ID: AD46401

EMSL Customer ID: WSPN36

Attention: AP

WSP Canada, Inc. [WSPN36]
36 Pippy Place
Saint John's, NL A1B 4A5
(709) 722-7023
capayablesinvoice@wsp.com

Project Name:

CA0037087.2445-NAVFAC Paint Sampling

Project ID:

_Master Project-WSPN36

Customer PO:**Sales Rep:**

Sarah Jamieson

Received:

12/29/2025 09:00

Reported:**Sample Results**

(Continued)

Sample: GB-Rm2-PCB011B/Gen. Bldg. Room 2/Light grey on concrete floor
AD46401-88 (Solid)

Analyte	Result	Q	DF	RL	Units	Prepared Date/Time	Analyzed Date/Time	Prep/Analyst Initials	Prep Method	Analytical Method
GC-SVOA										
Aroclor-1016	ND		1	0.25	mg/kg	01/05/26 10:20	01/06/26 17:31	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1221	ND		1	0.25	mg/kg	01/05/26 10:20	01/06/26 17:31	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1232	ND		1	0.25	mg/kg	01/05/26 10:20	01/06/26 17:31	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1242	0.71		1	0.25	mg/kg	01/05/26 10:20	01/06/26 17:31	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1248	ND		1	0.25	mg/kg	01/05/26 10:20	01/06/26 17:31	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1254	0.92		1	0.25	mg/kg	01/05/26 10:20	01/06/26 17:31	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1260	0.32		1	0.25	mg/kg	01/05/26 10:20	01/06/26 17:31	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1262	ND		1	0.25	mg/kg	01/05/26 10:20	01/06/26 17:31	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1268	ND		1	0.25	mg/kg	01/05/26 10:20	01/06/26 17:31	TAY/AxJ	SW846 3540C	SW846-8082A
Surrogate(s)	Recovery	Q	Limits							
<i>Surrogate: Tetrachloro-m-xylene</i>	74%		10-112			01/05/26 10:20	01/06/26 17:31	TAY/AxJ	SW846 3540C	SW846-8082A
<i>Surrogate: Decachlorobiphenyl</i>	67%		10-123			01/05/26 10:20	01/06/26 17:31	TAY/AxJ	SW846 3540C	SW846-8082A

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
 Telephone: 856-858-4800 Fax:cs@emsl.com
 EMSL-CIN-01

EMSL Order ID: 012340401

LIMS Reference ID: AD46401

EMSL Customer ID: WSPN36

Attention: AP

WSP Canada, Inc. [WSPN36]
 36 Pippy Place
 Saint John's, NL A1B 4A5
 (709) 722-7023
 capayablesinvoice@wsp.com

Project Name:

CA0037087.2445-NAVFAC Paint Sampling

Project ID:

_Master Project-WSPN36

Customer PO:**Sales Rep:**

Sarah Jamieson

Received:

12/29/2025 09:00

Reported:**Sample Results**

(Continued)

Sample: GB-Rm4-PCB012A/Gen. Bldg. Room 4/Black on metal ceiling hangers
AD46401-89 (Solid)

Analyte	Result	Q	DF	RL	Units	Prepared Date/Time	Analyzed Date/Time	Prep/Analyst Initials	Prep Method	Analytical Method
GC-SVOA										
Aroclor-1016	ND	D	5	2.9	mg/kg	01/05/26 10:20	01/07/26 17:18	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1221	ND	D	5	2.9	mg/kg	01/05/26 10:20	01/07/26 17:18	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1232	ND	D	5	2.9	mg/kg	01/05/26 10:20	01/07/26 17:18	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1242	ND	D	5	2.9	mg/kg	01/05/26 10:20	01/07/26 17:18	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1248	ND	D	5	2.9	mg/kg	01/05/26 10:20	01/07/26 17:18	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1254	60	D	5	2.9	mg/kg	01/05/26 10:20	01/07/26 17:18	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1260	11	D	5	2.9	mg/kg	01/05/26 10:20	01/07/26 17:18	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1262	ND	D	5	2.9	mg/kg	01/05/26 10:20	01/07/26 17:18	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1268	ND	D	5	2.9	mg/kg	01/05/26 10:20	01/07/26 17:18	TAY/AxJ	SW846 3540C	SW846-8082A
Surrogate(s)	Recovery	Q	Limits							
<i>Surrogate: Tetrachloro-m-xylene</i>	104%		10-112			01/05/26 10:20	01/07/26 17:18	TAY/AxJ	SW846 3540C	SW846-8082A
<i>Surrogate: Decachlorobiphenyl</i>	112%		10-123			01/05/26 10:20	01/07/26 17:18	TAY/AxJ	SW846 3540C	SW846-8082A

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
 Telephone: 856-858-4800 Fax:cs@emsl.com
 EMSL-CIN-01

EMSL Order ID: 012340401

LIMS Reference ID: AD46401

EMSL Customer ID: WSPN36

Attention: AP

WSP Canada, Inc. [WSPN36]
 36 Pippy Place
 Saint John's, NL A1B 4A5
 (709) 722-7023
 capayablesinvoice@wsp.com

Project Name:

CA0037087.2445-NAVFAC Paint Sampling

Project ID:

_Master Project-WSPN36

Customer PO:**Sales Rep:**

Sarah Jamieson

Received:

12/29/2025 09:00

Reported:**Sample Results**

(Continued)

Sample: GB-Rm4-PCB012B/Gen. Bldg. Room 4/Black on metal ceiling hangers
AD46401-90 (Solid)

Analyte	Result	Q	DF	RL	Units	Prepared Date/Time	Analyzed Date/Time	Prep/Analyst Initials	Prep Method	Analytical Method
GC-SVOA										
Aroclor-1016	ND	D	3	3.0	mg/kg	01/05/26 10:20	01/07/26 17:40	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1221	ND	D	3	3.0	mg/kg	01/05/26 10:20	01/07/26 17:40	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1232	ND	D	3	3.0	mg/kg	01/05/26 10:20	01/07/26 17:40	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1242	ND	D	3	3.0	mg/kg	01/05/26 10:20	01/07/26 17:40	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1248	ND	D	3	3.0	mg/kg	01/05/26 10:20	01/07/26 17:40	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1254	58	D	3	3.0	mg/kg	01/05/26 10:20	01/07/26 17:40	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1260	10	D	3	3.0	mg/kg	01/05/26 10:20	01/07/26 17:40	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1262	ND	D	3	3.0	mg/kg	01/05/26 10:20	01/07/26 17:40	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1268	ND	D	3	3.0	mg/kg	01/05/26 10:20	01/07/26 17:40	TAY/AxJ	SW846 3540C	SW846-8082A
Surrogate(s)	Recovery	Q	Limits							
<i>Surrogate: Tetrachloro-m-xylene</i>	99%		10-112			01/05/26 10:20	01/07/26 17:40	TAY/AxJ	SW846 3540C	SW846-8082A
<i>Surrogate: Decachlorobiphenyl</i>	107%		10-123			01/05/26 10:20	01/07/26 17:40	TAY/AxJ	SW846 3540C	SW846-8082A

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax:cs@emsl.com
EMSL-CIN-01

Table of Contents**EMSL Order ID:** 012340401**LIMS Reference ID:** AD46401**EMSL Customer ID:** WSPN36**Attention:** AP

WSP Canada, Inc. [WSPN36]
36 Pippy Place
Saint John's, NL A1B 4A5
(709) 722-7023
capayablesinvoice@wsp.com

Project Name:

CA0037087.2445-NAVFAC Paint Sampling

Project ID:

_Master Project-WSPN36

Customer PO:**Sales Rep:**

Sarah Jamieson

Received:

12/29/2025 09:00

Reported:**Sample Results****(Continued)**

**Sample: GB-Rm14-PCB013A/Gen. Bldg. Room 14/Blue on metal door and frame
AD46401-91 (Solid)**

Analyte	Result	Q	DF	RL	Units	Prepared Date/Time	Analyzed Date/Time	Prep/Analyst Initials	Prep Method	Analytical Method
GC-SVOA										
Aroclor-1016	ND		1	0.34	mg/kg	01/05/26 10:20	01/06/26 18:36	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1221	ND		1	0.34	mg/kg	01/05/26 10:20	01/06/26 18:36	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1232	ND		1	0.34	mg/kg	01/05/26 10:20	01/06/26 18:36	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1242	ND		1	0.34	mg/kg	01/05/26 10:20	01/06/26 18:36	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1248	ND		1	0.34	mg/kg	01/05/26 10:20	01/06/26 18:36	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1254	1.0		1	0.34	mg/kg	01/05/26 10:20	01/06/26 18:36	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1260	ND		1	0.34	mg/kg	01/05/26 10:20	01/06/26 18:36	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1262	ND		1	0.34	mg/kg	01/05/26 10:20	01/06/26 18:36	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1268	ND		1	0.34	mg/kg	01/05/26 10:20	01/06/26 18:36	TAY/AxJ	SW846 3540C	SW846-8082A
Surrogate(s)	Recovery	Q	Limits							
<i>Surrogate: Tetrachloro-m-xylene</i>	76%		10-112			01/05/26 10:20	01/06/26 18:36	TAY/AxJ	SW846 3540C	SW846-8082A
<i>Surrogate: Decachlorobiphenyl</i>	74%		10-123			01/05/26 10:20	01/06/26 18:36	TAY/AxJ	SW846 3540C	SW846-8082A

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
 Telephone: 856-858-4800 Fax:cs@emsl.com
 EMSL-CIN-01

Table of Contents

EMSL Order ID: 012340401

LIMS Reference ID: AD46401

EMSL Customer ID: WSPN36

Attention: AP

WSP Canada, Inc. [WSPN36]
 36 Pippy Place
 Saint John's, NL A1B 4A5
 (709) 722-7023
 capayablesinvoice@wsp.com

Project Name:

CA0037087.2445-NAVFAC Paint Sampling

Project ID:

_Master Project-WSPN36

Customer PO:**Sales Rep:**

Sarah Jamieson

Received:

12/29/2025 09:00

Reported:**Sample Results**

(Continued)

Sample: GB-Rm14-PCB013B/Gen. Bldg. Room 14/Blue on metal door and frame
AD46401-92 (Solid)

Analyte	Result	Q	DF	RL	Units	Prepared Date/Time	Analyzed Date/Time	Prep/Analyst Initials	Prep Method	Analytical Method
GC-SVOA										
Aroclor-1016	ND		1	0.45	mg/kg	01/05/26 10:20	01/06/26 18:57	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1221	ND		1	0.45	mg/kg	01/05/26 10:20	01/06/26 18:57	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1232	ND		1	0.45	mg/kg	01/05/26 10:20	01/06/26 18:57	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1242	ND		1	0.45	mg/kg	01/05/26 10:20	01/06/26 18:57	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1248	ND		1	0.45	mg/kg	01/05/26 10:20	01/06/26 18:57	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1254	1.4		1	0.45	mg/kg	01/05/26 10:20	01/06/26 18:57	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1260	ND		1	0.45	mg/kg	01/05/26 10:20	01/06/26 18:57	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1262	ND		1	0.45	mg/kg	01/05/26 10:20	01/06/26 18:57	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1268	ND		1	0.45	mg/kg	01/05/26 10:20	01/06/26 18:57	TAY/AxJ	SW846 3540C	SW846-8082A
Surrogate(s)	Recovery	Q	Limits							
<i>Surrogate: Tetrachloro-m-xylene</i>	82%		10-112			01/05/26 10:20	01/06/26 18:57	TAY/AxJ	SW846 3540C	SW846-8082A
<i>Surrogate: Decachlorobiphenyl</i>	82%		10-123			01/05/26 10:20	01/06/26 18:57	TAY/AxJ	SW846 3540C	SW846-8082A

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax:cs@emsl.com
EMSL-CIN-01

Table of Contents**EMSL Order ID:** 012340401**LIMS Reference ID:** AD46401**EMSL Customer ID:** WSPN36**Attention:** AP

WSP Canada, Inc. [WSPN36]
36 Pippy Place
Saint John's, NL A1B 4A5
(709) 722-7023
capayablesinvoice@wsp.com

Project Name:

CA0037087.2445-NAVFAC Paint Sampling

Project ID:

_Master Project-WSPN36

Customer PO:**Sales Rep:**

Sarah Jamieson

Received:

12/29/2025 09:00

Reported:**Sample Results****(Continued)**

Sample: GB-Ext-PCB014A/Gen. Bldg. Exterior/V. light brown on concrete wall board
AD46401-93 (Solid)

Analyte	Result	Q	DF	RL	Units	Prepared Date/Time	Analyzed Date/Time	Prep/Analyst Initials	Prep Method	Analytical Method
GC-SVOA										
Aroclor-1016	ND		1	0.26	mg/kg	01/05/26 10:20	01/06/26 19:19	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1221	ND		1	0.26	mg/kg	01/05/26 10:20	01/06/26 19:19	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1232	ND		1	0.26	mg/kg	01/05/26 10:20	01/06/26 19:19	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1242	ND		1	0.26	mg/kg	01/05/26 10:20	01/06/26 19:19	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1248	ND		1	0.26	mg/kg	01/05/26 10:20	01/06/26 19:19	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1254	ND		1	0.26	mg/kg	01/05/26 10:20	01/06/26 19:19	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1260	ND		1	0.26	mg/kg	01/05/26 10:20	01/06/26 19:19	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1262	ND		1	0.26	mg/kg	01/05/26 10:20	01/06/26 19:19	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1268	ND		1	0.26	mg/kg	01/05/26 10:20	01/06/26 19:19	TAY/AxJ	SW846 3540C	SW846-8082A
Surrogate(s)	Recovery	Q	Limits							
<i>Surrogate: Tetrachloro-m-xylene</i>	84%		10-112			01/05/26 10:20	01/06/26 19:19	TAY/AxJ	SW846 3540C	SW846-8082A
<i>Surrogate: Decachlorobiphenyl</i>	83%		10-123			01/05/26 10:20	01/06/26 19:19	TAY/AxJ	SW846 3540C	SW846-8082A

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax:cs@emsl.com
EMSL-CIN-01

Table of Contents**EMSL Order ID:** 012340401**LIMS Reference ID:** AD46401**EMSL Customer ID:** WSPN36**Attention:** AP

WSP Canada, Inc. [WSPN36]
36 Pippy Place
Saint John's, NL A1B 4A5
(709) 722-7023
capayablesinvoice@wsp.com

Project Name:

CA0037087.2445-NAVFAC Paint Sampling

Project ID:

_Master Project-WSPN36

Customer PO:**Sales Rep:**

Sarah Jamieson

Received:

12/29/2025 09:00

Reported:**Sample Results****(Continued)**

Sample: GB-Ext-PCB014B/Gen. Bldg. Exterior/V. light brown on concrete wall board
AD46401-94 (Solid)

Analyte	Result	Q	DF	RL	Units	Prepared Date/Time	Analyzed Date/Time	Prep/Analyst Initials	Prep Method	Analytical Method
GC-SVOA										
Aroclor-1016	ND		1	0.25	mg/kg	01/05/26 10:20	01/06/26 19:40	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1221	ND		1	0.25	mg/kg	01/05/26 10:20	01/06/26 19:40	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1232	ND		1	0.25	mg/kg	01/05/26 10:20	01/06/26 19:40	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1242	ND		1	0.25	mg/kg	01/05/26 10:20	01/06/26 19:40	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1248	ND		1	0.25	mg/kg	01/05/26 10:20	01/06/26 19:40	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1254	ND		1	0.25	mg/kg	01/05/26 10:20	01/06/26 19:40	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1260	ND		1	0.25	mg/kg	01/05/26 10:20	01/06/26 19:40	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1262	ND		1	0.25	mg/kg	01/05/26 10:20	01/06/26 19:40	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1268	ND		1	0.25	mg/kg	01/05/26 10:20	01/06/26 19:40	TAY/AxJ	SW846 3540C	SW846-8082A
Surrogate(s)	Recovery	Q	Limits							
<i>Surrogate: Tetrachloro-m-xylene</i>	82%		10-112			01/05/26 10:20	01/06/26 19:40	TAY/AxJ	SW846 3540C	SW846-8082A
<i>Surrogate: Decachlorobiphenyl</i>	84%		10-123			01/05/26 10:20	01/06/26 19:40	TAY/AxJ	SW846 3540C	SW846-8082A

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax:cs@emsl.com
EMSL-CIN-01

Table of Contents**EMSL Order ID:** 012340401**LIMS Reference ID:** AD46401**EMSL Customer ID:** WSPN36**Attention:** AP

WSP Canada, Inc. [WSPN36]
36 Pippy Place
Saint John's, NL A1B 4A5
(709) 722-7023
capayablesinvoice@wsp.com

Project Name:

CA0037087.2445-NAVFAC Paint Sampling

Project ID:

_Master Project-WSPN36

Customer PO:**Sales Rep:**

Sarah Jamieson

Received:

12/29/2025 09:00

Reported:**Sample Results****(Continued)**

Sample: GB-Ext-PCB015A/Gen. Bldg. Exterior/V. light brown on concrete wall
AD46401-95 (Solid)

Analyte	Result	Q	DF	RL	Units	Prepared Date/Time	Analyzed Date/Time	Prep/Analyst Initials	Prep Method	Analytical Method
GC-SVOA										
Aroclor-1016	ND		1	0.25	mg/kg	12/30/25 13:12	01/02/26 22:03	TAY/TL1	SW846 3546	SW846-8082A
Aroclor-1221	ND		1	0.25	mg/kg	12/30/25 13:12	01/02/26 22:03	TAY/TL1	SW846 3546	SW846-8082A
Aroclor-1232	ND		1	0.25	mg/kg	12/30/25 13:12	01/02/26 22:03	TAY/TL1	SW846 3546	SW846-8082A
Aroclor-1242	ND		1	0.25	mg/kg	12/30/25 13:12	01/02/26 22:03	TAY/TL1	SW846 3546	SW846-8082A
Aroclor-1248	ND		1	0.25	mg/kg	12/30/25 13:12	01/02/26 22:03	TAY/TL1	SW846 3546	SW846-8082A
Aroclor-1254	1.0		1	0.25	mg/kg	12/30/25 13:12	01/02/26 22:03	TAY/TL1	SW846 3546	SW846-8082A
Aroclor-1260	ND		1	0.25	mg/kg	12/30/25 13:12	01/02/26 22:03	TAY/TL1	SW846 3546	SW846-8082A
Aroclor-1262	ND		1	0.25	mg/kg	12/30/25 13:12	01/02/26 22:03	TAY/TL1	SW846 3546	SW846-8082A
Aroclor-1268	ND		1	0.25	mg/kg	12/30/25 13:12	01/02/26 22:03	TAY/TL1	SW846 3546	SW846-8082A
Surrogate(s)	Recovery	Q	Limits							
<i>Surrogate: Tetrachloro-m-xylene</i>	45%		10-112			12/30/25 13:12	01/02/26 22:03	TAY/TL1	SW846 3546	SW846-8082A
<i>Surrogate: Decachlorobiphenyl</i>	48%		10-123			12/30/25 13:12	01/02/26 22:03	TAY/TL1	SW846 3546	SW846-8082A

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax:cs@emsl.com
EMSL-CIN-01

Table of Contents**EMSL Order ID:** 012340401**LIMS Reference ID:** AD46401**EMSL Customer ID:** WSPN36**Attention:** AP

WSP Canada, Inc. [WSPN36]
36 Pippy Place
Saint John's, NL A1B 4A5
(709) 722-7023
capayablesinvoice@wsp.com

Project Name:

CA0037087.2445-NAVFAC Paint Sampling

Project ID:

_Master Project-WSPN36

Customer PO:**Sales Rep:**

Sarah Jamieson

Received:

12/29/2025 09:00

Reported:**Sample Results****(Continued)**

Sample: GB-Ext-PCB015B/Gen. Bldg. Exterior/V. light brown on concrete wall
AD46401-96 (Solid)

Analyte	Result	Q	DF	RL	Units	Prepared Date/Time	Analyzed Date/Time	Prep/Analyst Initials	Prep Method	Analytical Method
GC-SVOA										
Aroclor-1016	ND		1	0.27	mg/kg	12/30/25 13:12	01/02/26 22:25	TAY/TL1	SW846 3546	SW846-8082A
Aroclor-1221	ND		1	0.27	mg/kg	12/30/25 13:12	01/02/26 22:25	TAY/TL1	SW846 3546	SW846-8082A
Aroclor-1232	ND		1	0.27	mg/kg	12/30/25 13:12	01/02/26 22:25	TAY/TL1	SW846 3546	SW846-8082A
Aroclor-1242	ND		1	0.27	mg/kg	12/30/25 13:12	01/02/26 22:25	TAY/TL1	SW846 3546	SW846-8082A
Aroclor-1248	ND		1	0.27	mg/kg	12/30/25 13:12	01/02/26 22:25	TAY/TL1	SW846 3546	SW846-8082A
Aroclor-1254	ND		1	0.27	mg/kg	12/30/25 13:12	01/02/26 22:25	TAY/TL1	SW846 3546	SW846-8082A
Aroclor-1260	ND		1	0.27	mg/kg	12/30/25 13:12	01/02/26 22:25	TAY/TL1	SW846 3546	SW846-8082A
Aroclor-1262	ND		1	0.27	mg/kg	12/30/25 13:12	01/02/26 22:25	TAY/TL1	SW846 3546	SW846-8082A
Aroclor-1268	ND		1	0.27	mg/kg	12/30/25 13:12	01/02/26 22:25	TAY/TL1	SW846 3546	SW846-8082A
Surrogate(s)	Recovery	Q	Limits							
<i>Surrogate: Tetrachloro-m-xylene</i>	69%		10-112			12/30/25 13:12	01/02/26 22:25	TAY/TL1	SW846 3546	SW846-8082A
<i>Surrogate: Decachlorobiphenyl</i>	70%		10-123			12/30/25 13:12	01/02/26 22:25	TAY/TL1	SW846 3546	SW846-8082A

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax:cs@emsl.com
EMSL-CIN-01

Table of Contents**EMSL Order ID:** 012340401**LIMS Reference ID:** AD46401**EMSL Customer ID:** WSPN36**Attention:** AP

WSP Canada, Inc. [WSPN36]
36 Pippy Place
Saint John's, NL A1B 4A5
(709) 722-7023
capayablesinvoice@wsp.com

Project Name:

CA0037087.2445-NAVFAC Paint Sampling

Project ID:

_Master Project-WSPN36

Customer PO:**Sales Rep:**

Sarah Jamieson

Received:

12/29/2025 09:00

Reported:**Sample Results****(Continued)**

Sample: GB-Ext-PCB016A/Gen. Bldg. Exterior/V. light brown on plywood wall
AD46401-97 (Solid)

Analyte	Result	Q	DF	RL	Units	Prepared Date/Time	Analyzed Date/Time	Prep/Analyst Initials	Prep Method	Analytical Method
GC-SVOA										
Aroclor-1016	ND		1	0.67	mg/kg	01/05/26 10:20	01/06/26 20:02	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1221	ND		1	0.67	mg/kg	01/05/26 10:20	01/06/26 20:02	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1232	ND		1	0.67	mg/kg	01/05/26 10:20	01/06/26 20:02	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1242	ND		1	0.67	mg/kg	01/05/26 10:20	01/06/26 20:02	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1248	ND		1	0.67	mg/kg	01/05/26 10:20	01/06/26 20:02	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1254	ND		1	0.67	mg/kg	01/05/26 10:20	01/06/26 20:02	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1260	ND		1	0.67	mg/kg	01/05/26 10:20	01/06/26 20:02	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1262	ND		1	0.67	mg/kg	01/05/26 10:20	01/06/26 20:02	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1268	ND		1	0.67	mg/kg	01/05/26 10:20	01/06/26 20:02	TAY/AxJ	SW846 3540C	SW846-8082A
Surrogate(s)	Recovery	Q	Limits							
<i>Surrogate: Tetrachloro-m-xylene</i>	93%		10-112			01/05/26 10:20	01/06/26 20:02	TAY/AxJ	SW846 3540C	SW846-8082A
<i>Surrogate: Decachlorobiphenyl</i>	93%		10-123			01/05/26 10:20	01/06/26 20:02	TAY/AxJ	SW846 3540C	SW846-8082A

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax:cs@emsl.com
EMSL-CIN-01

Table of Contents**EMSL Order ID:** 012340401**LIMS Reference ID:** AD46401**EMSL Customer ID:** WSPN36**Attention:** AP

WSP Canada, Inc. [WSPN36]
36 Pippy Place
Saint John's, NL A1B 4A5
(709) 722-7023
capayablesinvoice@wsp.com

Project Name:

CA0037087.2445-NAVFAC Paint Sampling

Project ID:

_Master Project-WSPN36

Customer PO:**Sales Rep:**

Sarah Jamieson

Received:

12/29/2025 09:00

Reported:**Sample Results****(Continued)**

Sample: GB-Ext-PCB016B/Gen. Bldg. Exterior/V. light brown on plywood wall
AD46401-98 (Solid)

Analyte	Result	Q	DF	RL	Units	Prepared Date/Time	Analyzed Date/Time	Prep/Analyst Initials	Prep Method	Analytical Method
GC-SVOA										
Aroclor-1016	ND		1	0.25	mg/kg	01/05/26 10:20	01/06/26 20:23	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1221	ND		1	0.25	mg/kg	01/05/26 10:20	01/06/26 20:23	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1232	ND		1	0.25	mg/kg	01/05/26 10:20	01/06/26 20:23	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1242	ND		1	0.25	mg/kg	01/05/26 10:20	01/06/26 20:23	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1248	ND		1	0.25	mg/kg	01/05/26 10:20	01/06/26 20:23	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1254	ND		1	0.25	mg/kg	01/05/26 10:20	01/06/26 20:23	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1260	ND		1	0.25	mg/kg	01/05/26 10:20	01/06/26 20:23	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1262	ND		1	0.25	mg/kg	01/05/26 10:20	01/06/26 20:23	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1268	ND		1	0.25	mg/kg	01/05/26 10:20	01/06/26 20:23	TAY/AxJ	SW846 3540C	SW846-8082A
Surrogate(s)	Recovery	Q	Limits							
<i>Surrogate: Tetrachloro-m-xylene</i>	65%		10-112			01/05/26 10:20	01/06/26 20:23	TAY/AxJ	SW846 3540C	SW846-8082A
<i>Surrogate: Decachlorobiphenyl</i>	70%		10-123			01/05/26 10:20	01/06/26 20:23	TAY/AxJ	SW846 3540C	SW846-8082A

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax:cs@emsl.com
EMSL-CIN-01

Table of Contents**EMSL Order ID:** 012340401**LIMS Reference ID:** AD46401**EMSL Customer ID:** WSPN36**Attention:** AP

WSP Canada, Inc. [WSPN36]
36 Pippy Place
Saint John's, NL A1B 4A5
(709) 722-7023
capayablesinvoice@wsp.com

Project Name:

CA0037087.2445-NAVFAC Paint Sampling

Project ID:

_Master Project-WSPN36

Customer PO:**Sales Rep:**

Sarah Jamieson

Received:

12/29/2025 09:00

Reported:**Sample Results****(Continued)**

Sample: GB-Ext-PCB017A/Gen. Bldg. Exterior/V. light brown on metal pipe
AD46401-99 (Solid)

Analyte	Result	Q	DF	RL	Units	Prepared Date/Time	Analyzed Date/Time	Prep/Analyst Initials	Prep Method	Analytical Method
GC-SVOA										
Aroclor-1016	ND		1	0.24	mg/kg	01/05/26 10:20	01/06/26 20:45	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1221	ND		1	0.24	mg/kg	01/05/26 10:20	01/06/26 20:45	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1232	ND		1	0.24	mg/kg	01/05/26 10:20	01/06/26 20:45	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1242	ND		1	0.24	mg/kg	01/05/26 10:20	01/06/26 20:45	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1248	ND		1	0.24	mg/kg	01/05/26 10:20	01/06/26 20:45	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1254	ND		1	0.24	mg/kg	01/05/26 10:20	01/06/26 20:45	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1260	ND		1	0.24	mg/kg	01/05/26 10:20	01/06/26 20:45	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1262	ND		1	0.24	mg/kg	01/05/26 10:20	01/06/26 20:45	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1268	ND		1	0.24	mg/kg	01/05/26 10:20	01/06/26 20:45	TAY/AxJ	SW846 3540C	SW846-8082A
Surrogate(s)	Recovery	Q	Limits							
<i>Surrogate: Tetrachloro-m-xylene</i>	70%		10-112							
<i>Surrogate: Decachlorobiphenyl</i>	75%		10-123							

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax:cs@emsl.com
EMSL-CIN-01

Table of Contents**EMSL Order ID:** 012340401**LIMS Reference ID:** AD46401**EMSL Customer ID:** WSPN36**Attention:** AP

WSP Canada, Inc. [WSPN36]
36 Pippy Place
Saint John's, NL A1B 4A5
(709) 722-7023
capayablesinvoice@wsp.com

Project Name:

CA0037087.2445-NAVFAC Paint Sampling

Project ID:

_Master Project-WSPN36

Customer PO:**Sales Rep:**

Sarah Jamieson

Received:

12/29/2025 09:00

Reported:**Sample Results****(Continued)**

Sample: GB-Ext-PCB017B/Gen. Bldg. Exterior/V. light brown on metal pipe
AD46401-AA (Solid)

Analyte	Result	Q	DF	RL	Units	Prepared Date/Time	Analyzed Date/Time	Prep/Analyst Initials	Prep Method	Analytical Method
GC-SVOA										
Aroclor-1016	ND		1	0.24	mg/kg	01/05/26 10:20	01/06/26 21:07	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1221	ND		1	0.24	mg/kg	01/05/26 10:20	01/06/26 21:07	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1232	ND		1	0.24	mg/kg	01/05/26 10:20	01/06/26 21:07	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1242	ND		1	0.24	mg/kg	01/05/26 10:20	01/06/26 21:07	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1248	ND		1	0.24	mg/kg	01/05/26 10:20	01/06/26 21:07	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1254	ND		1	0.24	mg/kg	01/05/26 10:20	01/06/26 21:07	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1260	ND		1	0.24	mg/kg	01/05/26 10:20	01/06/26 21:07	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1262	ND		1	0.24	mg/kg	01/05/26 10:20	01/06/26 21:07	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1268	ND		1	0.24	mg/kg	01/05/26 10:20	01/06/26 21:07	TAY/AxJ	SW846 3540C	SW846-8082A
Surrogate(s)	Recovery	Q	Limits							
<i>Surrogate: Tetrachloro-m-xylene</i>	61%		10-112			01/05/26 10:20	01/06/26 21:07	TAY/AxJ	SW846 3540C	SW846-8082A
<i>Surrogate: Decachlorobiphenyl</i>	64%		10-123			01/05/26 10:20	01/06/26 21:07	TAY/AxJ	SW846 3540C	SW846-8082A

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax:cs@emsl.com
EMSL-CIN-01

Table of Contents**EMSL Order ID:** 012340401**LIMS Reference ID:** AD46401**EMSL Customer ID:** WSPN36**Attention:** AP

WSP Canada, Inc. [WSPN36]
36 Pippy Place
Saint John's, NL A1B 4A5
(709) 722-7023
capayablesinvoice@wsp.com

Project Name:

CA0037087.2445-NAVFAC Paint Sampling

Project ID:

_Master Project-WSPN36

Customer PO:**Sales Rep:**

Sarah Jamieson

Received:

12/29/2025 09:00

Reported:**Sample Results****(Continued)**

Sample: GS-Rm1-PCB001A/Guard Shack, Room 1/Off-white on drywall wall
AD46401-AB (Solid)

Analyte	Result	Q	DF	RL	Units	Prepared Date/Time	Analyzed Date/Time	Prep/Analyst Initials	Prep Method	Analytical Method
GC-SVOA										
Aroclor-1016	ND		1	0.26	mg/kg	12/30/25 13:12	01/02/26 22:47	TAY/TL1	SW846 3546	SW846-8082A
Aroclor-1221	ND		1	0.26	mg/kg	12/30/25 13:12	01/02/26 22:47	TAY/TL1	SW846 3546	SW846-8082A
Aroclor-1232	ND		1	0.26	mg/kg	12/30/25 13:12	01/02/26 22:47	TAY/TL1	SW846 3546	SW846-8082A
Aroclor-1242	ND		1	0.26	mg/kg	12/30/25 13:12	01/02/26 22:47	TAY/TL1	SW846 3546	SW846-8082A
Aroclor-1248	ND		1	0.26	mg/kg	12/30/25 13:12	01/02/26 22:47	TAY/TL1	SW846 3546	SW846-8082A
Aroclor-1254	ND		1	0.26	mg/kg	12/30/25 13:12	01/02/26 22:47	TAY/TL1	SW846 3546	SW846-8082A
Aroclor-1260	ND		1	0.26	mg/kg	12/30/25 13:12	01/02/26 22:47	TAY/TL1	SW846 3546	SW846-8082A
Aroclor-1262	ND		1	0.26	mg/kg	12/30/25 13:12	01/02/26 22:47	TAY/TL1	SW846 3546	SW846-8082A
Aroclor-1268	ND		1	0.26	mg/kg	12/30/25 13:12	01/02/26 22:47	TAY/TL1	SW846 3546	SW846-8082A
Surrogate(s)	Recovery	Q	Limits							
<i>Surrogate: Tetrachloro-m-xylene</i>	56%		10-112							
<i>Surrogate: Decachlorobiphenyl</i>	54%		10-123							

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax:cs@emsl.com
EMSL-CIN-01

Table of Contents**EMSL Order ID:** 012340401**LIMS Reference ID:** AD46401**EMSL Customer ID:** WSPN36**Attention:** AP

WSP Canada, Inc. [WSPN36]
36 Pippy Place
Saint John's, NL A1B 4A5
(709) 722-7023
capayablesinvoice@wsp.com

Project Name:

CA0037087.2445-NAVFAC Paint Sampling

Project ID:

_Master Project-WSPN36

Customer PO:**Sales Rep:**

Sarah Jamieson

Received:

12/29/2025 09:00

Reported:**Sample Results****(Continued)**

Sample: GS-Rm1-PCB001B/Guard Shack, Room 1/Off-white on drywall wall
AD46401-AC (Solid)

Analyte	Result	Q	DF	RL	Units	Prepared Date/Time	Analyzed Date/Time	Prep/Analyst Initials	Prep Method	Analytical Method
GC-SVOA										
Aroclor-1016	ND		1	0.26	mg/kg	01/05/26 10:20	01/06/26 21:28	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1221	ND		1	0.26	mg/kg	01/05/26 10:20	01/06/26 21:28	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1232	ND		1	0.26	mg/kg	01/05/26 10:20	01/06/26 21:28	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1242	ND		1	0.26	mg/kg	01/05/26 10:20	01/06/26 21:28	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1248	ND		1	0.26	mg/kg	01/05/26 10:20	01/06/26 21:28	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1254	ND		1	0.26	mg/kg	01/05/26 10:20	01/06/26 21:28	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1260	ND		1	0.26	mg/kg	01/05/26 10:20	01/06/26 21:28	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1262	ND		1	0.26	mg/kg	01/05/26 10:20	01/06/26 21:28	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1268	ND		1	0.26	mg/kg	01/05/26 10:20	01/06/26 21:28	TAY/AxJ	SW846 3540C	SW846-8082A
Surrogate(s)	Recovery	Q	Limits							
<i>Surrogate: Tetrachloro-m-xylene</i>	51%		10-112			01/05/26 10:20	01/06/26 21:28	TAY/AxJ	SW846 3540C	SW846-8082A
<i>Surrogate: Decachlorobiphenyl</i>	51%		10-123			01/05/26 10:20	01/06/26 21:28	TAY/AxJ	SW846 3540C	SW846-8082A

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax:cs@emsl.com
EMSL-CIN-01

Table of Contents**EMSL Order ID:** 012340401**LIMS Reference ID:** AD46401**EMSL Customer ID:** WSPN36**Attention:** AP

WSP Canada, Inc. [WSPN36]
36 Pippy Place
Saint John's, NL A1B 4A5
(709) 722-7023
capayablesinvoice@wsp.com

Project Name:

CA0037087.2445-NAVFAC Paint Sampling

Project ID:

_Master Project-WSPN36

Customer PO:**Sales Rep:**

Sarah Jamieson

Received:

12/29/2025 09:00

Reported:**Sample Results****(Continued)**

Sample: GS-Rm1-PCB002A/Guard Shack, Room 1/White on drywall wall
AD46401-AD (Solid)

Analyte	Result	Q	DF	RL	Units	Prepared Date/Time	Analyzed Date/Time	Prep/Analyst Initials	Prep Method	Analytical Method
GC-SVOA										
Aroclor-1016	ND		1	0.27	mg/kg	12/30/25 13:12	01/02/26 23:30	TAY/TL1	SW846 3546	SW846-8082A
Aroclor-1221	ND		1	0.27	mg/kg	12/30/25 13:12	01/02/26 23:30	TAY/TL1	SW846 3546	SW846-8082A
Aroclor-1232	ND		1	0.27	mg/kg	12/30/25 13:12	01/02/26 23:30	TAY/TL1	SW846 3546	SW846-8082A
Aroclor-1242	ND		1	0.27	mg/kg	12/30/25 13:12	01/02/26 23:30	TAY/TL1	SW846 3546	SW846-8082A
Aroclor-1248	ND		1	0.27	mg/kg	12/30/25 13:12	01/02/26 23:30	TAY/TL1	SW846 3546	SW846-8082A
Aroclor-1254	ND		1	0.27	mg/kg	12/30/25 13:12	01/02/26 23:30	TAY/TL1	SW846 3546	SW846-8082A
Aroclor-1260	ND		1	0.27	mg/kg	12/30/25 13:12	01/02/26 23:30	TAY/TL1	SW846 3546	SW846-8082A
Aroclor-1262	ND		1	0.27	mg/kg	12/30/25 13:12	01/02/26 23:30	TAY/TL1	SW846 3546	SW846-8082A
Aroclor-1268	ND		1	0.27	mg/kg	12/30/25 13:12	01/02/26 23:30	TAY/TL1	SW846 3546	SW846-8082A
Surrogate(s)	Recovery	Q	Limits							
<i>Surrogate: Tetrachloro-m-xylene</i>	59%		10-112			12/30/25 13:12	01/02/26 23:30	TAY/TL1	SW846 3546	SW846-8082A
<i>Surrogate: Decachlorobiphenyl</i>	59%		10-123			12/30/25 13:12	01/02/26 23:30	TAY/TL1	SW846 3546	SW846-8082A

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax:cs@emsl.com
EMSL-CIN-01

Table of Contents**EMSL Order ID:** 012340401**LIMS Reference ID:** AD46401**EMSL Customer ID:** WSPN36**Attention:** AP

WSP Canada, Inc. [WSPN36]
36 Pippy Place
Saint John's, NL A1B 4A5
(709) 722-7023
capayablesinvoice@wsp.com

Project Name:

CA0037087.2445-NAVFAC Paint Sampling

Project ID:

_Master Project-WSPN36

Customer PO:**Sales Rep:**

Sarah Jamieson

Received:

12/29/2025 09:00

Reported:**Sample Results****(Continued)**

Sample: GS-Rm2-PCB002B/Guard Shack, Room 2/White on drywall wall
AD46401-AE (Solid)

Analyte	Result	Q	DF	RL	Units	Prepared Date/Time	Analyzed Date/Time	Prep/Analyst Initials	Prep Method	Analytical Method
GC-SVOA										
Aroclor-1016	ND		1	0.26	mg/kg	01/05/26 10:20	01/06/26 21:50	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1221	ND		1	0.26	mg/kg	01/05/26 10:20	01/06/26 21:50	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1232	ND		1	0.26	mg/kg	01/05/26 10:20	01/06/26 21:50	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1242	ND		1	0.26	mg/kg	01/05/26 10:20	01/06/26 21:50	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1248	ND		1	0.26	mg/kg	01/05/26 10:20	01/06/26 21:50	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1254	ND		1	0.26	mg/kg	01/05/26 10:20	01/06/26 21:50	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1260	ND		1	0.26	mg/kg	01/05/26 10:20	01/06/26 21:50	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1262	ND		1	0.26	mg/kg	01/05/26 10:20	01/06/26 21:50	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1268	ND		1	0.26	mg/kg	01/05/26 10:20	01/06/26 21:50	TAY/AxJ	SW846 3540C	SW846-8082A
Surrogate(s)	Recovery	Q	Limits							
<i>Surrogate: Tetrachloro-m-xylene</i>	82%		10-112			01/05/26 10:20	01/06/26 21:50	TAY/AxJ	SW846 3540C	SW846-8082A
<i>Surrogate: Decachlorobiphenyl</i>	83%		10-123			01/05/26 10:20	01/06/26 21:50	TAY/AxJ	SW846 3540C	SW846-8082A

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax:cs@emsl.com
EMSL-CIN-01

Table of Contents**EMSL Order ID:** 012340401**LIMS Reference ID:** AD46401**EMSL Customer ID:** WSPN36**Attention:** AP

WSP Canada, Inc. [WSPN36]
36 Pippy Place
Saint John's, NL A1B 4A5
(709) 722-7023
capayablesinvoice@wsp.com

Project Name:

CA0037087.2445-NAVFAC Paint Sampling

Project ID:

_Master Project-WSPN36

Customer PO:**Sales Rep:**

Sarah Jamieson

Received:

12/29/2025 09:00

Reported:**Sample Results****(Continued)**

Sample: GS-Rm2-PCB003A/Guard Shack, Exterior/V. light brown on concrete eve
AD46401-AF (Solid)

Analyte	Result	Q	DF	RL	Units	Prepared Date/Time	Analyzed Date/Time	Prep/Analyst Initials	Prep Method	Analytical Method
GC-SVOA										
Aroclor-1016	ND		1	0.27	mg/kg	01/05/26 10:20	01/06/26 22:12	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1221	ND		1	0.27	mg/kg	01/05/26 10:20	01/06/26 22:12	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1232	ND		1	0.27	mg/kg	01/05/26 10:20	01/06/26 22:12	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1242	ND		1	0.27	mg/kg	01/05/26 10:20	01/06/26 22:12	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1248	ND		1	0.27	mg/kg	01/05/26 10:20	01/06/26 22:12	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1254	ND		1	0.27	mg/kg	01/05/26 10:20	01/06/26 22:12	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1260	ND		1	0.27	mg/kg	01/05/26 10:20	01/06/26 22:12	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1262	ND		1	0.27	mg/kg	01/05/26 10:20	01/06/26 22:12	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1268	ND		1	0.27	mg/kg	01/05/26 10:20	01/06/26 22:12	TAY/AxJ	SW846 3540C	SW846-8082A
Surrogate(s)	Recovery	Q	Limits							
<i>Surrogate: Tetrachloro-m-xylene</i>	83%		10-112			01/05/26 10:20	01/06/26 22:12	TAY/AxJ	SW846 3540C	SW846-8082A
<i>Surrogate: Decachlorobiphenyl</i>	85%		10-123			01/05/26 10:20	01/06/26 22:12	TAY/AxJ	SW846 3540C	SW846-8082A

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax:cs@emsl.com
EMSL-CIN-01

Table of Contents**EMSL Order ID:** 012340401**LIMS Reference ID:** AD46401**EMSL Customer ID:** WSPN36**Attention:** AP

WSP Canada, Inc. [WSPN36]
36 Pippy Place
Saint John's, NL A1B 4A5
(709) 722-7023
capayablesinvoice@wsp.com

Project Name:

CA0037087.2445-NAVFAC Paint Sampling

Project ID:

_Master Project-WSPN36

Customer PO:**Sales Rep:**

Sarah Jamieson

Received:

12/29/2025 09:00

Reported:**Sample Results****(Continued)**

Sample: GS-Ext-PCB003B/Guard Shack, Exterior/V. light brown on concrete foundation
AD46401-AG (Solid)

Analyte	Result	Q	DF	RL	Units	Prepared Date/Time	Analyzed Date/Time	Prep/Analyst Initials	Prep Method	Analytical Method
GC-SVOA										
Aroclor-1016	ND		1	0.25	mg/kg	01/05/26 10:20	01/06/26 22:34	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1221	ND		1	0.25	mg/kg	01/05/26 10:20	01/06/26 22:34	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1232	ND		1	0.25	mg/kg	01/05/26 10:20	01/06/26 22:34	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1242	ND		1	0.25	mg/kg	01/05/26 10:20	01/06/26 22:34	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1248	ND		1	0.25	mg/kg	01/05/26 10:20	01/06/26 22:34	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1254	ND		1	0.25	mg/kg	01/05/26 10:20	01/06/26 22:34	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1260	ND		1	0.25	mg/kg	01/05/26 10:20	01/06/26 22:34	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1262	ND		1	0.25	mg/kg	01/05/26 10:20	01/06/26 22:34	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1268	ND		1	0.25	mg/kg	01/05/26 10:20	01/06/26 22:34	TAY/AxJ	SW846 3540C	SW846-8082A
Surrogate(s)	Recovery	Q		Limits						
<i>Surrogate: Tetrachloro-m-xylene</i>	78%			10-112		01/05/26 10:20	01/06/26 22:34	TAY/AxJ	SW846 3540C	SW846-8082A
<i>Surrogate: Decachlorobiphenyl</i>	81%			10-123		01/05/26 10:20	01/06/26 22:34	TAY/AxJ	SW846 3540C	SW846-8082A

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax:cs@emsl.com
EMSL-CIN-01

Table of Contents**EMSL Order ID:** 012340401**LIMS Reference ID:** AD46401**EMSL Customer ID:** WSPN36**Attention:** AP

WSP Canada, Inc. [WSPN36]
36 Pippy Place
Saint John's, NL A1B 4A5
(709) 722-7023
capayablesinvoice@wsp.com

Project Name:

CA0037087.2445-NAVFAC Paint Sampling

Project ID:

_Master Project-WSPN36

Customer PO:**Sales Rep:**

Sarah Jamieson

Received:

12/29/2025 09:00

Reported:**Sample Results****(Continued)**

**Sample: GS-Ext-PCB004A/Guard Shack, Exterior/V. light brown on concrete wall board
AD46401-AH (Solid)**

Analyte	Result	Q	DF	RL	Units	Prepared Date/Time	Analyzed Date/Time	Prep/Analyst Initials	Prep Method	Analytical Method
GC-SVOA										
Aroclor-1016	ND		1	0.25	mg/kg	01/05/26 10:20	01/06/26 22:56	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1221	ND		1	0.25	mg/kg	01/05/26 10:20	01/06/26 22:56	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1232	ND		1	0.25	mg/kg	01/05/26 10:20	01/06/26 22:56	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1242	ND		1	0.25	mg/kg	01/05/26 10:20	01/06/26 22:56	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1248	ND		1	0.25	mg/kg	01/05/26 10:20	01/06/26 22:56	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1254	ND		1	0.25	mg/kg	01/05/26 10:20	01/06/26 22:56	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1260	ND		1	0.25	mg/kg	01/05/26 10:20	01/06/26 22:56	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1262	ND		1	0.25	mg/kg	01/05/26 10:20	01/06/26 22:56	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1268	ND		1	0.25	mg/kg	01/05/26 10:20	01/06/26 22:56	TAY/AxJ	SW846 3540C	SW846-8082A
Surrogate(s)	Recovery	Q	Limits							
<i>Surrogate: Tetrachloro-m-xylene</i>	36%		10-112			01/05/26 10:20	01/06/26 22:56	TAY/AxJ	SW846 3540C	SW846-8082A
<i>Surrogate: Decachlorobiphenyl</i>	46%		10-123			01/05/26 10:20	01/06/26 22:56	TAY/AxJ	SW846 3540C	SW846-8082A

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
 Telephone: 856-858-4800 Fax:cs@emsl.com
 EMSL-CIN-01

EMSL Order ID: 012340401

LIMS Reference ID: AD46401

EMSL Customer ID: WSPN36

Attention: AP

WSP Canada, Inc. [WSPN36]
 36 Pippy Place
 Saint John's, NL A1B 4A5
 (709) 722-7023
 capayablesinvoice@wsp.com

Project Name: CA0037087.2445-NAVFAC Paint Sampling**Project ID:** _Master Project-WSPN36**Customer PO:****Sales Rep:** Sarah Jamieson**Received:** 12/29/2025 09:00**Reported:****Sample Results****(Continued)**

Sample: GS-Ext-PCB004B/Guard Shack, Exterior/V. light brown on concrete wall board
AD46401-AI (Solid)

Analyte	Result	Q	DF	RL	Units	Prepared Date/Time	Analyzed Date/Time	Prep/Analyst Initials	Prep Method	Analytical Method
GC-SVOA										
Aroclor-1016	ND		1	0.27	mg/kg	01/05/26 10:20	01/06/26 23:40	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1221	ND		1	0.27	mg/kg	01/05/26 10:20	01/06/26 23:40	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1232	ND		1	0.27	mg/kg	01/05/26 10:20	01/06/26 23:40	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1242	ND		1	0.27	mg/kg	01/05/26 10:20	01/06/26 23:40	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1248	ND		1	0.27	mg/kg	01/05/26 10:20	01/06/26 23:40	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1254	ND		1	0.27	mg/kg	01/05/26 10:20	01/06/26 23:40	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1260	ND		1	0.27	mg/kg	01/05/26 10:20	01/06/26 23:40	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1262	ND		1	0.27	mg/kg	01/05/26 10:20	01/06/26 23:40	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1268	ND		1	0.27	mg/kg	01/05/26 10:20	01/06/26 23:40	TAY/AxJ	SW846 3540C	SW846-8082A
Surrogate(s)	Recovery	Q	Limits							
<i>Surrogate: Tetrachloro-m-xylene</i>	81%		10-112			01/05/26 10:20	01/06/26 23:40	TAY/AxJ	SW846 3540C	SW846-8082A
<i>Surrogate: Decachlorobiphenyl</i>	88%		10-123			01/05/26 10:20	01/06/26 23:40	TAY/AxJ	SW846 3540C	SW846-8082A

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax:cs@emsl.com
EMSL-CIN-01

Table of Contents**EMSL Order ID:** 012340401**LIMS Reference ID:** AD46401**EMSL Customer ID:** WSPN36**Attention:** AP

WSP Canada, Inc. [WSPN36]
36 Pippy Place
Saint John's, NL A1B 4A5
(709) 722-7023
capayablesinvoice@wsp.com

Project Name:

CA0037087.2445-NAVFAC Paint Sampling

Project ID:

_Master Project-WSPN36

Customer PO:**Sales Rep:**

Sarah Jamieson

Received:

12/29/2025 09:00

Reported:**Sample Results****(Continued)**

Sample: GS-Ext-PCB005A/Guard Shack, Exterior/V. light brown on metal pipe
AD46401-AJ (Solid)

Analyte	Result	Q	DF	RL	Units	Prepared Date/Time	Analyzed Date/Time	Prep/Analyst Initials	Prep Method	Analytical Method
GC-SVOA										
Aroclor-1016	ND		1	0.96	mg/kg	01/05/26 10:20	01/07/26 00:02	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1221	ND		1	0.96	mg/kg	01/05/26 10:20	01/07/26 00:02	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1232	ND		1	0.96	mg/kg	01/05/26 10:20	01/07/26 00:02	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1242	ND		1	0.96	mg/kg	01/05/26 10:20	01/07/26 00:02	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1248	ND		1	0.96	mg/kg	01/05/26 10:20	01/07/26 00:02	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1254	ND		1	0.96	mg/kg	01/05/26 10:20	01/07/26 00:02	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1260	ND		1	0.96	mg/kg	01/05/26 10:20	01/07/26 00:02	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1262	ND		1	0.96	mg/kg	01/05/26 10:20	01/07/26 00:02	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1268	ND		1	0.96	mg/kg	01/05/26 10:20	01/07/26 00:02	TAY/AxJ	SW846 3540C	SW846-8082A
Surrogate(s)	Recovery	Q	Limits							
<i>Surrogate: Tetrachloro-m-xylene</i>	83%		10-112			01/05/26 10:20	01/07/26 00:02	TAY/AxJ	SW846 3540C	SW846-8082A
<i>Surrogate: Decachlorobiphenyl</i>	94%		10-123			01/05/26 10:20	01/07/26 00:02	TAY/AxJ	SW846 3540C	SW846-8082A

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax:cs@emsl.com
EMSL-CIN-01

Table of Contents**EMSL Order ID:** 012340401**LIMS Reference ID:** AD46401**EMSL Customer ID:** WSPN36**Attention:** AP

WSP Canada, Inc. [WSPN36]
36 Pippy Place
Saint John's, NL A1B 4A5
(709) 722-7023
capayablesinvoice@wsp.com

Project Name:

CA0037087.2445-NAVFAC Paint Sampling

Project ID:

_Master Project-WSPN36

Customer PO:**Sales Rep:**

Sarah Jamieson

Received:

12/29/2025 09:00

Reported:**Sample Results****(Continued)**

Sample: GS-Ext-PCB005B/Guard Shack, Exterior/V. light brown on metal pipe
AD46401-AK (Solid)

Analyte	Result	Q	DF	RL	Units	Prepared Date/Time	Analyzed Date/Time	Prep/Analyst Initials	Prep Method	Analytical Method
GC-SVOA										
Aroclor-1016	ND		1	0.85	mg/kg	01/05/26 10:20	01/07/26 00:23	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1221	ND		1	0.85	mg/kg	01/05/26 10:20	01/07/26 00:23	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1232	ND		1	0.85	mg/kg	01/05/26 10:20	01/07/26 00:23	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1242	ND		1	0.85	mg/kg	01/05/26 10:20	01/07/26 00:23	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1248	ND		1	0.85	mg/kg	01/05/26 10:20	01/07/26 00:23	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1254	ND		1	0.85	mg/kg	01/05/26 10:20	01/07/26 00:23	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1260	ND		1	0.85	mg/kg	01/05/26 10:20	01/07/26 00:23	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1262	ND		1	0.85	mg/kg	01/05/26 10:20	01/07/26 00:23	TAY/AxJ	SW846 3540C	SW846-8082A
Aroclor-1268	ND		1	0.85	mg/kg	01/05/26 10:20	01/07/26 00:23	TAY/AxJ	SW846 3540C	SW846-8082A
Surrogate(s)	Recovery	Q	Limits							
<i>Surrogate: Tetrachloro-m-xylene</i>	87%		10-112			01/05/26 10:20	01/07/26 00:23	TAY/AxJ	SW846 3540C	SW846-8082A
<i>Surrogate: Decachlorobiphenyl</i>	96%		10-123			01/05/26 10:20	01/07/26 00:23	TAY/AxJ	SW846 3540C	SW846-8082A

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax:cs@emsl.com
EMSL-CIN-01

Table of Contents**EMSL Order ID:** 012340401**LIMS Reference ID:** AD46401**EMSL Customer ID:** WSPN36**Attention:** AP

WSP Canada, Inc. [WSPN36]
36 Pippy Place
Saint John's, NL A1B 4A5
(709) 722-7023
capayablesinvoice@wsp.com

Project Name:

CA0037087.2445-NAVFAC Paint Sampling

Project ID:

_Master Project-WSPN36

Customer PO:**Sales Rep:**

Sarah Jamieson

Received:

12/29/2025 09:00

Reported:**Quality Control****GC-SVOA**

Analyte	Result Qual	Reporting Limit	Units	Spike Level	Source Result	%REC	%REC Limits	RPD	RPD Limit
---------	-------------	-----------------	-------	-------------	---------------	------	-------------	-----	-----------

Batch: BDL3190 - SW846 3540C**Blank (BDL3190-BLK1)**

Prepared: 12/30/2025 Analyzed: 12/31/2025

Aroclor-1016	ND	0.25	mg/kg
Aroclor-1221	ND	0.25	mg/kg
Aroclor-1232	ND	0.25	mg/kg
Aroclor-1242	ND	0.25	mg/kg
Aroclor-1248	ND	0.25	mg/kg
Aroclor-1254	ND	0.25	mg/kg
Aroclor-1260	ND	0.25	mg/kg
Aroclor-1262	ND	0.25	mg/kg
Aroclor-1268	ND	0.25	mg/kg

Surrogate(s)

Surrogate: Tetrachloro-m-xylene	0.5000	71	10-112
Surrogate: Decachlorobiphenyl	0.5000	80	10-123

LCS (BDL3190-BS1)

Prepared: 12/30/2025 Analyzed: 12/31/2025

Aroclor-1016	1.98	0.25	mg/kg	2.500	79	23-111
Aroclor-1260	2.13	0.25	mg/kg	2.500	85	29-119

Surrogate(s)

Surrogate: Tetrachloro-m-xylene	0.5000	72	10-112
Surrogate: Decachlorobiphenyl	0.5000	81	10-123

Matrix Spike (BDL3190-MS1)**Source: AD46401-29**

Prepared: 12/30/2025 Analyzed: 12/31/2025

Aroclor-1016	5.90 R3	0.25	mg/kg	2.463	ND	239	10-111
Aroclor-1260	2.54	0.25	mg/kg	2.463	ND	103	10-132

Surrogate(s)

Surrogate: Tetrachloro-m-xylene	0.4926	81	10-112
Surrogate: Decachlorobiphenyl	0.4926	76	10-123

Matrix Spike Dup (BDL3190-MSD1)**Source: AD46401-29**

Prepared: 12/30/2025 Analyzed: 12/31/2025

Aroclor-1016	5.38 R3	0.25	mg/kg	2.463	ND	219	10-111	9	28
Aroclor-1260	2.56	0.25	mg/kg	2.463	ND	104	10-132	0.5	28

Surrogate(s)

Surrogate: Tetrachloro-m-xylene	0.4926	82	10-112
Surrogate: Decachlorobiphenyl	0.4926	77	10-123

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax:cs@emsl.com
EMSL-CIN-01

Table of Contents**EMSL Order ID:** 012340401**LIMS Reference ID:** AD46401**EMSL Customer ID:** WSPN36**Attention:** AP

WSP Canada, Inc. [WSPN36]
36 Pippy Place
Saint John's, NL A1B 4A5
(709) 722-7023
capayablesinvoice@wsp.com

Project Name: CA0037087.2445-NAVFAC Paint Sampling**Project ID:** _Master Project-WSPN36**Customer PO:****Sales Rep:** Sarah Jamieson**Received:** 12/29/2025 09:00**Reported:****Quality Control
(Continued)****GC-SVOA (Continued)**

Analyte	Result Qual	Reporting Limit	Units	Spike Level	Source Result	%REC	%REC Limits	RPD	RPD Limit
---------	-------------	-----------------	-------	-------------	---------------	------	-------------	-----	-----------

Batch: BDL3191 - SW846 3546**Blank (BDL3191-BLK1)**

Prepared: 12/30/2025 Analyzed: 12/31/2025

Aroclor-1016	ND	0.25	mg/kg
Aroclor-1221	ND	0.25	mg/kg
Aroclor-1232	ND	0.25	mg/kg
Aroclor-1242	ND	0.25	mg/kg
Aroclor-1248	ND	0.25	mg/kg
Aroclor-1254	ND	0.25	mg/kg
Aroclor-1260	ND	0.25	mg/kg
Aroclor-1262	ND	0.25	mg/kg
Aroclor-1268	ND	0.25	mg/kg

Surrogate(s)

Surrogate: Tetrachloro-m-xylene	0.5000	82	10-112
Surrogate: Decachlorobiphenyl	0.5000	82	10-123

LCS (BDL3191-BS1)

Prepared: 12/30/2025 Analyzed: 12/31/2025

Aroclor-1016	2.22	0.25	mg/kg	2.500	89	23-111
Aroclor-1260	2.39	0.25	mg/kg	2.500	96	29-119

Surrogate(s)

Surrogate: Tetrachloro-m-xylene	0.5000	87	10-112
Surrogate: Decachlorobiphenyl	0.5000	96	10-123

Matrix Spike (BDL3191-MS1)**Source: AD46401-02**

Prepared: 12/30/2025 Analyzed: 12/31/2025

Aroclor-1016	3.46	0.26	mg/kg	2.551	ND	135	10-111
Aroclor-1260	2.00	0.26	mg/kg	2.551	ND	79	10-132

Surrogate(s)

Surrogate: Tetrachloro-m-xylene	0.5102	74	10-112
Surrogate: Decachlorobiphenyl	0.5102	65	10-123

Matrix Spike Dup (BDL3191-MSD1)**Source: AD46401-02**

Prepared: 12/30/2025 Analyzed: 12/31/2025

Aroclor-1016	2.99	0.24	mg/kg	2.392	ND	125	10-111	15	28
Aroclor-1260	1.85	0.24	mg/kg	2.392	ND	77	10-132	8	28

Surrogate(s)

Surrogate: Tetrachloro-m-xylene	0.4785	68	10-112
Surrogate: Decachlorobiphenyl	0.4785	62	10-123

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax:cs@emsl.com
EMSL-CIN-01

Table of Contents**EMSL Order ID:** 012340401**LIMS Reference ID:** AD46401**EMSL Customer ID:** WSPN36**Attention:** AP

WSP Canada, Inc. [WSPN36]
36 Pippy Place
Saint John's, NL A1B 4A5
(709) 722-7023
capayablesinvoice@wsp.com

Project Name:

CA0037087.2445-NAVFAC Paint Sampling

Project ID:

_Master Project-WSPN36

Customer PO:**Sales Rep:**

Sarah Jamieson

Received:

12/29/2025 09:00

Reported:**Quality Control
(Continued)****GC-SVOA (Continued)**

Analyte	Result Qual	Reporting Limit	Units	Spike Level	Source Result	%REC	%REC Limits	RPD	RPD Limit
---------	-------------	-----------------	-------	-------------	---------------	------	-------------	-----	-----------

Batch: BDL3192 - SW846 3546**Blank (BDL3192-BLK1)**

Prepared: 12/30/2025 Analyzed: 1/2/2026

Aroclor-1016	ND	0.25	mg/kg
Aroclor-1221	ND	0.25	mg/kg
Aroclor-1232	ND	0.25	mg/kg
Aroclor-1242	ND	0.25	mg/kg
Aroclor-1248	ND	0.25	mg/kg
Aroclor-1254	ND	0.25	mg/kg
Aroclor-1260	ND	0.25	mg/kg
Aroclor-1262	ND	0.25	mg/kg
Aroclor-1268	ND	0.25	mg/kg

Surrogate(s)

Surrogate: Tetrachloro-m-xylene	0.5000	82	10-112
Surrogate: Decachlorobiphenyl	0.5000	85	10-123

LCS (BDL3192-BS1)

Prepared: 12/30/2025 Analyzed: 1/2/2026

Aroclor-1016	1.98	0.25	mg/kg	2.500	79	23-111
Aroclor-1260	2.13	0.25	mg/kg	2.500	85	29-119

Surrogate(s)

Surrogate: Tetrachloro-m-xylene	0.5000	78	10-112
Surrogate: Decachlorobiphenyl	0.5000	85	10-123

LCS Dup (BDL3192-BSD1)

Prepared: 12/30/2025 Analyzed: 1/2/2026

Aroclor-1016	1.91	0.25	mg/kg	2.500	76	23-111	4	25
Aroclor-1260	2.04	0.25	mg/kg	2.500	81	29-119	5	25

Surrogate(s)

Surrogate: Tetrachloro-m-xylene	0.5000	70	10-112
Surrogate: Decachlorobiphenyl	0.5000	76	10-123

Batch: BEA0019 - SW846 3540C**Blank (BEA0019-BLK1)**

Prepared: 1/2/2026 Analyzed: 1/5/2026

Aroclor-1016	ND	0.25	mg/kg
Aroclor-1221	ND	0.25	mg/kg
Aroclor-1232	ND	0.25	mg/kg
Aroclor-1242	ND	0.25	mg/kg
Aroclor-1248	ND	0.25	mg/kg
Aroclor-1254	ND	0.25	mg/kg
Aroclor-1260	ND	0.25	mg/kg

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
 Telephone: 856-858-4800 Fax:cs@emsl.com
 EMSL-CIN-01

EMSL Order ID: 012340401

LIMS Reference ID: AD46401

EMSL Customer ID: WSPN36

Attention: AP

WSP Canada, Inc. [WSPN36]
 36 Pippy Place
 Saint John's, NL A1B 4A5
 (709) 722-7023
 capayablesinvoice@wsp.com

Project Name: CA0037087.2445-NAVFAC Paint Sampling**Project ID:** _Master Project-WSPN36**Customer PO:****Sales Rep:** Sarah Jamieson**Received:** 12/29/2025 09:00**Reported:**

Quality Control (Continued)

GC-SVOA (Continued)

Analyte	Result Qual	Reporting Limit	Units	Spike Level	Source Result	%REC	%REC Limits	RPD	RPD Limit
---------	-------------	-----------------	-------	-------------	---------------	------	-------------	-----	-----------

Batch: BEA0019 - SW846 3540C (Continued)**Blank (BEA0019-BLK1)**

Prepared: 1/2/2026 Analyzed: 1/5/2026

Aroclor-1262	ND	0.25	mg/kg
Aroclor-1268	ND	0.25	mg/kg

Surrogate(s)

Surrogate: Tetrachloro-m-xylene	0.5000	78	10-112
Surrogate: Decachlorobiphenyl	0.5000	85	10-123

Blank (BEA0019-BLK2)

Prepared: 1/2/2026 Analyzed: 1/6/2026

Aroclor-1016	ND	0.25	mg/kg
Aroclor-1221	ND	0.25	mg/kg
Aroclor-1232	ND	0.25	mg/kg
Aroclor-1242	ND	0.25	mg/kg
Aroclor-1248	ND	0.25	mg/kg
Aroclor-1254	ND	0.25	mg/kg
Aroclor-1260	ND	0.25	mg/kg
Aroclor-1262	ND	0.25	mg/kg
Aroclor-1268	ND	0.25	mg/kg

Surrogate(s)

Surrogate: Tetrachloro-m-xylene	0.5000	83	10-112
Surrogate: Decachlorobiphenyl	0.5000	84	10-123

LCS (BEA0019-BS1)

Prepared: 1/2/2026 Analyzed: 1/5/2026

Aroclor-1016	2.09	0.25	mg/kg	2.500	84	23-111
Aroclor-1260	2.27	0.25	mg/kg	2.500	91	29-119

Surrogate(s)

Surrogate: Tetrachloro-m-xylene	0.5000	77	10-112
Surrogate: Decachlorobiphenyl	0.5000	87	10-123

LCS (BEA0019-BS2)

Prepared: 1/2/2026 Analyzed: 1/6/2026

Aroclor-1016	2.26	0.25	mg/kg	2.500	91	23-111
Aroclor-1260	2.53	0.25	mg/kg	2.500	101	29-119

Surrogate(s)

Surrogate: Tetrachloro-m-xylene	0.5000	92	10-112
Surrogate: Decachlorobiphenyl	0.5000	94	10-123

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax:cs@emsl.com
EMSL-CIN-01

Table of Contents**EMSL Order ID:** 012340401**LIMS Reference ID:** AD46401**EMSL Customer ID:** WSPN36**Attention:** AP

WSP Canada, Inc. [WSPN36]
36 Pippy Place

Saint John's, NL A1B 4A5
(709) 722-7023

capayablesinvoice@wsp.com

Project Name:

CA0037087.2445-NAVFAC Paint Sampling

Project ID:

_Master Project-WSPN36

Customer PO:**Sales Rep:**

Sarah Jamieson

Received:

12/29/2025 09:00

Reported:**Quality Control**
(Continued)**GC-SVOA (Continued)**

Analyte	Result Qual	Reporting Limit	Units	Spike Level	Source Result	%REC	%REC Limits	RPD	RPD Limit
---------	-------------	-----------------	-------	-------------	---------------	------	-------------	-----	-----------

Batch: BEA0019 - SW846 3540C (Continued)**Matrix Spike (BEA0019-MS1)****Source: AD46401-62**

Prepared: 1/2/2026 Analyzed: 1/5/2026

Aroclor-1016	7.63 R3	0.25	mg/kg	2.475	ND	308	10-111
Aroclor-1260	2.85	0.25	mg/kg	2.475	ND	115	10-132

Surrogate(s)

Surrogate: Tetrachloro-m-xylene	0.4950	75	10-112
Surrogate: Decachlorobiphenyl	0.4950	72	10-123

Matrix Spike Dup (BEA0019-MSD1)**Source: AD46401-62**

Prepared: 1/2/2026 Analyzed: 1/5/2026

Aroclor-1016	8.58 R3	0.25	mg/kg	2.500	ND	343	10-111	12	28
Aroclor-1260	3.10	0.25	mg/kg	2.500	ND	124	10-132	8	28

Surrogate(s)

Surrogate: Tetrachloro-m-xylene	0.5000	84	10-112
Surrogate: Decachlorobiphenyl	0.5000	80	10-123

Batch: BEA0198 - SW846 3540C**Blank (BEA0198-BLK1)**

Prepared: 1/5/2026 Analyzed: 1/7/2026

Aroclor-1016	ND	0.25	mg/kg
Aroclor-1221	ND	0.25	mg/kg
Aroclor-1232	ND	0.25	mg/kg
Aroclor-1242	ND	0.25	mg/kg
Aroclor-1248	ND	0.25	mg/kg
Aroclor-1254	ND	0.25	mg/kg
Aroclor-1260	ND	0.25	mg/kg
Aroclor-1262	ND	0.25	mg/kg
Aroclor-1268	ND	0.25	mg/kg

Surrogate(s)

Surrogate: Tetrachloro-m-xylene	0.5000	66	10-112
Surrogate: Decachlorobiphenyl	0.5000	80	10-123

Blank (BEA0198-BLK2)

Prepared: 1/5/2026 Analyzed: 1/7/2026

Aroclor-1016	ND	0.25	mg/kg
Aroclor-1221	ND	0.25	mg/kg
Aroclor-1232	ND	0.25	mg/kg
Aroclor-1242	ND	0.25	mg/kg
Aroclor-1248	ND	0.25	mg/kg
Aroclor-1254	ND	0.25	mg/kg
Aroclor-1260	ND	0.25	mg/kg

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax:cs@emsl.com
EMSL-CIN-01

EMSL Order ID: 012340401

LIMS Reference ID: AD46401

EMSL Customer ID: WSPN36

Attention: AP

WSP Canada, Inc. [WSPN36]
36 Pippy Place
Saint John's, NL A1B 4A5
(709) 722-7023
capayablesinvoice@wsp.com

Project Name:

CA0037087.2445-NAVFAC Paint Sampling

Project ID:

_Master Project-WSPN36

Customer PO:**Sales Rep:**

Sarah Jamieson

Received:

12/29/2025 09:00

Reported:**Quality Control
(Continued)****GC-SVOA (Continued)**

Analyte	Result Qual	Reporting Limit	Units	Spike Level	Source Result	%REC	%REC Limits	RPD	RPD Limit
---------	-------------	-----------------	-------	-------------	---------------	------	-------------	-----	-----------

Batch: BEA0198 - SW846 3540C (Continued)**Blank (BEA0198-BLK2)**

Prepared: 1/5/2026 Analyzed: 1/7/2026

Aroclor-1262	ND	0.25	mg/kg
Aroclor-1268	ND	0.25	mg/kg

Surrogate(s)

Surrogate: Tetrachloro-m-xylene	0.5000	89	10-112
Surrogate: Decachlorobiphenyl	0.5000	96	10-123

LCS (BEA0198-BS1)

Prepared: 1/5/2026 Analyzed: 1/7/2026

Aroclor-1016	1.89	0.25	mg/kg	2.500	76	23-111
Aroclor-1260	2.07	0.25	mg/kg	2.500	83	29-119

Surrogate(s)

Surrogate: Tetrachloro-m-xylene	0.5000	72	10-112
Surrogate: Decachlorobiphenyl	0.5000	82	10-123

LCS (BEA0198-BS2)

Prepared: 1/5/2026 Analyzed: 1/7/2026

Aroclor-1016	1.60	0.25	mg/kg	2.500	64	23-111
Aroclor-1260	1.86	0.25	mg/kg	2.500	74	29-119

Surrogate(s)

Surrogate: Tetrachloro-m-xylene	0.5000	65	10-112
Surrogate: Decachlorobiphenyl	0.5000	71	10-123

Matrix Spike (BEA0198-MS1)**Source: AD46401-68**

Prepared: 1/5/2026 Analyzed: 1/7/2026

Aroclor-1016	3.49 R3	0.25	mg/kg	2.451	ND	142	10-111
Aroclor-1260	3.52 R3	0.25	mg/kg	2.451	ND	144	10-132

Surrogate(s)

Surrogate: Tetrachloro-m-xylene	0.4902	113	10-112
Surrogate: Decachlorobiphenyl	0.4902	116	10-123

Matrix Spike Dup (BEA0198-MSD1)**Source: AD46401-68**

Prepared: 1/5/2026 Analyzed: 1/7/2026

Aroclor-1016	3.26 R3	0.25	mg/kg	2.463	ND	132	10-111	7	28
Aroclor-1260	3.34 R3	0.25	mg/kg	2.463	ND	136	10-132	5	28

Surrogate(s)

Surrogate: Tetrachloro-m-xylene	0.4926	105	10-112
Surrogate: Decachlorobiphenyl	0.4926	108	10-123

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax:cs@emsl.com
EMSL-CIN-01

Table of Contents**EMSL Order ID:** 012340401**LIMS Reference ID:** AD46401**EMSL Customer ID:** WSPN36**Attention:** AP

WSP Canada, Inc. [WSPN36]
36 Pippy Place
Saint John's, NL A1B 4A5
(709) 722-7023
capayablesinvoice@wsp.com

Project Name: CA0037087.2445-NAVFAC Paint Sampling**Project ID:** _Master Project-WSPN36**Customer PO:****Sales Rep:** Sarah Jamieson**Received:** 12/29/2025 09:00**Reported:****Quality Control
(Continued)****GC-SVOA (Continued)**

Analyte	Result Qual	Reporting Limit	Units	Spike Level	Source Result	%REC	%REC Limits	RPD	RPD Limit
---------	-------------	-----------------	-------	-------------	---------------	------	-------------	-----	-----------

Batch: BEA0199 - SW846 3540C**Blank (BEA0199-BLK1)**

Prepared: 1/5/2026 Analyzed: 1/6/2026

Aroclor-1016	ND	0.25	mg/kg
Aroclor-1221	ND	0.25	mg/kg
Aroclor-1232	ND	0.25	mg/kg
Aroclor-1242	ND	0.25	mg/kg
Aroclor-1248	ND	0.25	mg/kg
Aroclor-1254	ND	0.25	mg/kg
Aroclor-1260	ND	0.25	mg/kg
Aroclor-1262	ND	0.25	mg/kg
Aroclor-1268	ND	0.25	mg/kg

Surrogate(s)

Surrogate: Tetrachloro-m-xylene	0.5000	93	10-112
Surrogate: Decachlorobiphenyl	0.5000	99	10-123

LCS (BEA0199-BS1)

Prepared: 1/5/2026 Analyzed: 1/6/2026

Aroclor-1016	2.34	0.25	mg/kg	2.500	93	23-111
Aroclor-1260	2.62	0.25	mg/kg	2.500	105	29-119

Surrogate(s)

Surrogate: Tetrachloro-m-xylene	0.5000	95	10-112
Surrogate: Decachlorobiphenyl	0.5000	102	10-123

Matrix Spike (BEA0199-MS1)**Source: AD46401-88**

Prepared: 1/5/2026 Analyzed: 1/6/2026

Aroclor-1016	2.07	0.25	mg/kg	2.451	ND	85	10-111
Aroclor-1260	1.92	0.25	mg/kg	2.451	0.323	65	10-132

Surrogate(s)

Surrogate: Tetrachloro-m-xylene	0.4902	69	10-112
Surrogate: Decachlorobiphenyl	0.4902	61	10-123

Matrix Spike Dup (BEA0199-MSD1)**Source: AD46401-88**

Prepared: 1/5/2026 Analyzed: 1/6/2026

Aroclor-1016	1.99	0.24	mg/kg	2.392	ND	83	10-111	4	28
Aroclor-1260	1.95	0.24	mg/kg	2.392	0.323	68	10-132	1	28

Surrogate(s)

Surrogate: Tetrachloro-m-xylene	0.4785	73	10-112
Surrogate: Decachlorobiphenyl	0.4785	64	10-123

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
 Telephone: 856-858-4800 Fax:cs@emsl.com
 EMSL-CIN-01

Table of Contents

EMSL Order ID: 012340401

LIMS Reference ID: AD46401

EMSL Customer ID: WSPN36

Attention: AP

WSP Canada, Inc. [WSPN36]
 36 Pippy Place
 Saint John's, NL A1B 4A5
 (709) 722-7023
 capayablesinvoice@wsp.com

Project Name: CA0037087.2445-NAVFAC Paint Sampling**Project ID:** _Master Project-WSPN36**Customer PO:****Sales Rep:** Sarah Jamieson**Received:** 12/29/2025 09:00**Reported:****Certified Analyses included in this Report**

Analyte	CAS #	Certifications
<i>SW846-8082A in Solid</i>		
Aroclor-1016	12674-11-2	NJDEP,NYSDOH,PADEP,California ELAP
Aroclor-1221	11104-28-2	NJDEP,NYSDOH,PADEP,California ELAP
Aroclor-1232	11141-16-5	NJDEP,NYSDOH,PADEP,California ELAP
Aroclor-1242	53469-21-9	NJDEP,NYSDOH,PADEP,California ELAP
Aroclor-1242 [2C]	53469-21-9	NJDEP,NYSDOH,PADEP,California ELAP
Aroclor-1248	12672-29-6	NJDEP,NYSDOH,PADEP,California ELAP
Aroclor-1254	11097-69-1	NJDEP,NYSDOH,PADEP,California ELAP
Aroclor-1254 [2C]	11097-69-1	NJDEP,NYSDOH,PADEP,California ELAP
Aroclor-1260	11096-82-5	NJDEP,NYSDOH,PADEP,California ELAP
Aroclor-1260 [2C]	11096-82-5	NJDEP,NYSDOH,PADEP,California ELAP
Aroclor-1262	37324-23-5	NJDEP,NYSDOH,PADEP
Aroclor-1262 [2C]	37324-23-5	NJDEP,NYSDOH,PADEP
Aroclor-1268	11100-14-4	NJDEP,NYSDOH,PADEP

List of Certifications

Code	Description	Number	Expires
PADEP	Pennsylvania Department of Environmental Protection	2845.25	11/30/2025
NYSDOH	New York State Department of Health ELAP	10872	04/01/2026
NJDEP	New Jersey Department of Environmental Protection	03036	06/30/2026
MADEP	Massachusetts Department of Environmental Protection	M-NJ337	06/30/2026
CTDPH	Connecticut Department of Public Health	PH-0270	06/30/2026
California ELAP	California Water Boards	1877	06/30/2026
AIHA LAP	American Industrial Hygiene Association (AIHA LAP, LLC)	100194	04/01/2027
A2LA	A2LA Environmental Certificate	2845.01	07/31/2026
21-A2LA	A2LA Food Chem/Mat Sci	2845.15	07/31/2026

Please see the specific Field of Testing (FOT) on www.emsl.com <<http://www.emsl.com>> for a complete listing of parameters for which EMSL is certified.

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax:cs@emsl.com
EMSL-CIN-01

Table of Contents**EMSL Order ID:** 012340401**LIMS Reference ID:** AD46401**EMSL Customer ID:** WSPN36**Attention:** AP

WSP Canada, Inc. [WSPN36]
36 Pippy Place
Saint John's, NL A1B 4A5
(709) 722-7023
capayablesinvoice@wsp.com

Project Name:

CA0037087.2445-NAVFAC Paint Sampling

Project ID:

_Master Project-WSPN36

Customer PO:**Sales Rep:**

Sarah Jamieson

Received:

12/29/2025 09:00

Reported:**Notes and Definitions**

Item	Definition
D	Analyte was reported from a dilution run.
IC	Sample was received in an incorrect container.
R3	Recovery is outside of the control limits due to matrix interference.
RT	Sample was submitted outside of the required temperature.
S6	Surrogate recovery is outside control limits due to matrix interference.
(Dig)	For metals analysis, sample was digested.
[2C]	Reported from the second channel in dual column analysis.
DA	Direct Analysis
DF	Dilution Factor
MDL	Method Detection Limit.
ND	Analyte was NOT DETECTED at or above the detection limit.
NR	Spike/Surrogate showed no recovery.
Q	Qualifier
RCS	Respirable Crystalline Silica
RL	Reporting Limit
Wet	Sample is not dry weight corrected.
%REC	Percent Recovery
RPD	Relative Percent Difference
Source	Sample that was matrix spiked or duplicated

Measurement of uncertainty and any applicable definitions of method modifications are available upon request. Per EPA NLLAP policy, sample results are not blank corrected.



EMSL ANALYTICAL, INC.
TESTING LABS • PRODUCTS • TRAINING

AD46401

EMSL Chain of Custody - One Chain

EMSL Order Number / Lab Use Only

552022918

EMSL Analytical, Inc.
200 Route 130 North
Cinnaminson, NJ 08077

PHONE: (800) 220-3675
EMAIL: CinnAslab@EMSL.com

Customer Information Customer ID: Company Name: WSP Canada Inc. Contact Name: Veronica Reid / Brian Lane Street Address: 36 Pippy Place City, State, Zip: St. John's, NL A1B 4A5 Country: Canada Phone: 902-536-0942 / 709-687-8001 Email(s) for Report: veronica.reid@wsp.com / brian.lane@wsp.com		Billing Information Billing ID: Company Name: Billing Contact: capayablesinvoice@wsp.com Street Address: City, State, Zip: Country: Phone: Email(s) for Invoice: capayablesinvoice@wsp.com	
Project Information			
Project Name/No: CA0037087.2445 - NAVFAC Paint Sampling		Purchase Order: To be provided	
EMSL LIMS Project ID: (if applicable, EMSL will provide)		US State where samples collected: State of Connecticut (CT) must select project location: ☐ Commercial (Taxable) ☐ Residential (Non-Taxable)	
Sampled By Name: BL		Sampled By Signature: No. of Samples in Shipment: 110	
Turn-Around-Time (TAT) ☐ 3 Hour ☐ 6 Hour ☐ 24 Hour ☐ 32 Hour ☐ 48 Hour ☐ 72 Hour ☐ 96 Hour ☒ 1 Week ☐ 2 Week Please call ahead for large projects and/or turnaround times 5 Hours or Less. *32 Hour TAT available for select tests only; samples must be submitted by 11:30am.			
PCM Air ☐ NIOSH 7400 ☐ NIOSH 7400 w/ 8hr. TWA PLM - Bulk (reporting limit) ☐ PLM EPA 600/R-93/116 (<1%) ☐ PLM EPA NOB (<1%) ☐ POINT COUNT ☐ 400 (<0.25%) ☐ 1,000 (<0.1%) ☐ POINT COUNT w/ GRAVIMETRIC ☐ 400 (<0.25%) ☐ 1,000 (<0.1%) ☐ NIOSH 9002 (<1%) ☐ NYS 198.1 (Friable - NY) ☐ NYS 198.6 NOB (Non-Friable - NY) ☐ NYS 198.8 (Vermiculite SM-V) ASBESTOS TEM - Air ☐ AHERA 40 CFR, Part 763 ☐ NIOSH 7402 ☐ EPA Level II ☐ ISO 10312* TEM - Bulk ☐ TEM EPA NOB ☐ NYS NOB 198.4 (Non-Friable-NY) ☐ TEM EPA 600/R-93/116 w Milling Prep (0.1%) ☐ Chatfield SOP Other Test (please specify) ✓ TEM - Settled Dust ☐ Microvac - ASTM D5755 ☐ Wipe - ASTM D6480 ☐ Qualitative via Filtration Prep ☐ Qualitative via Drop Mount Prep Soil - Rock - Vermiculite (reporting limit)* ☐ PLM EPA 600/R-93/116 with milling prep (<0.25%) ☐ PLM EPA 600/R-93/116 with milling prep (<0.1%) ☐ TEM EPA 600/R-93/116 with milling prep (<0.1%) ☐ TEM Qualitative via Filtration Prep ☐ TEM Qualitative via Drop Mount Prep *Please call with your project-specific requirements.			
☐ Positive Stop - Clearly Identified Homogeneous Areas (HA)		Filter Pore Size (Air Samples) ☐ 0.8um ☐ 0.45um	
LEAD (PB) Flame Atomic Absorption ☐ Chips SW846-7000B or AOAC 974.2 ☐ Soil SW846-7000B/7420 ☐ Air NIOSH 7082 ☐ Wastewater SM3111B or SW846-7000B/7420 ☐ ASTM Wipe SW846-7000B/7420 ☐ non-ASTM Wipe SW846-7000B/7420 ☒ TCLP SW846-1311/ 7420/ SM3111B		ICP ☐ Solids SW-846 6010D ☐ Air NIOSH 7303	
MICROBIOLOGY Swab and Bulk Samples ☐ Mold & Fungi - Direct Examination ☐ Mold & Fungi Culture (Genus Only) ☐ Mold & Fungi Culture (Genus & Species) ☐ Bacterial Count & ID (Up to 3 Types) ☐ Bacterial Count & ID (Up to 5 Types) Sewage Screen ☐ Sewage Screen (P/A) ☐ Sewage Screen (Membrane Filtration) Water Samples ☐ Total Coliform & E. Coli (P/A, SM 9223B) ☐ Heterotrophic Plate Count (PP, SM 9251B) ☐ Fecal Coliform (SM 9222D) Air Samples ☐ Mold & Fungi (Spore Trap) ☐ Mold & Fungi Culture (Genus Only) ☐ Mold & Fungi Culture (Genus & Species) ☐ Bacterial Count & ID (Up to 3 Types) ☐ Bacterial Count & ID (Up to 5 Types) DNA & PCR Testing: (See Analytical Guide for Code) Test Code: Legionella: (See Analytical Guide for Code) Test Code: P/A= Presence/Absence, PP= Pour Plate			
MAT-SCI (TAT End of Business Day) ☐ Common Particle ID (large particles) ☐ Full Particle ID (environmental dust) ☐ Basic Material ID (solids) ☐ Advanced Material ID ☐ Physical Testing (Tensile, Compression) ☐ Combustion-By-Products (Soot, Char, Etc.) ☐ X-Ray Fluorescence (elem. Analysis) ☐ X-Ray Diffraction (Crystalline Part.) ☐ MMVF's (Fibrous Glass, RCF's) ☐ Particle Size (Sieve, Microscopy, Laser) ☐ Combustible Dust ☐ Petrographic Examination			
IAQ (TAT End of Business Day) ☐ Nuisance Dust ☐ Airborne Dust Silica Analysis: ☐ Silica Analysis - Single Species ☐ Alpha Quartz ☐ Cristobalite ☐ Tridymite ☐ HVAC Efficiency ☐ Carbon Black ☐ Airborn Oil Mist Radon Testing: Call for Kit and CQC ☐ NIOSH 0500 ☐ PM10 ☐ All Species ☐ NIOSH 0600 ☐ TSP			

Other Test (please specify) Bulk Metals (Lead and Mercury) and PCB Analyses. Hold ML# samples for potential TCLP analysis.

Special Instructions and/or Regulatory Requirements (Sample Specifications, Processing Methods, Limits of Detection, etc.)

1. Hold "ML#" samples for potential TCLP analysis. 2. Homogenize Each Sample

Method of Shipment:		Sample Condition Upon Receipt:	
Relinquished by: Brian Lane	Date/Time: 2002-25 4:00pm	Received by: LAB 55/KC	Date/Time: 12/23/25 @ 12:34pm
Relinquished by:	Date/Time:	Received by:	Date/Time:

Controlled Document - COC-17 One Chain EMSL R6 08/18/2025

☐ AGREE TO ELECTRONIC SIGNATURE By checking, I consent to signing this Chain of Custody document by electronic signature.

EMSL Analytical, Inc.'s Laboratory Terms and Conditions are incorporated into this Chain of Custody by reference in the Submission of samples to EMSL Analytical, Inc. constitutes acceptance and acknowledgment of all terms and conditions by Customer.

Puro: 3357 4204 5818



EMSL ANALYTICAL, INC.
TESTING LABS • PRODUCTS • TRAINING

EMSL Chain of Custody - One Chain

EMSL Order Number / Lab Use Only

EMSL Analytical, Inc.
200 Route 130 North
Cinnaminson, NJ 08077

PHONE: (800) 220-3675
EMAIL: CinnAslab@EMSL.com

Additional Pages of the Chain of Custody are only necessary if needed for additional sample information

Special Instructions and/or Regulatory Requirements (Sample Specifications, Processing Methods, Limits of Detection, etc.)

1. Hold "ML#" samples for potential TCLP analysis. 2. Homogenize Each Sample

Sample Number	Sample Location / Description	Volume, Area or Homogeneous Area	Date / Time Sampled (Air Monitoring Only)
TE-Rm52-ML001A	TE Bldg. Room 52 / Red flaking on concrete floor		16-Dec-25
TE-Rm52-PCB001A	TE Bldg. Room 52 / Red flaking on concrete floor		16-Dec-25
TE-Rm52-ML001A	TE Bldg. Room 52 / Red flaking on concrete floor	Hold for analysis	16-Dec-25
TE-Rm52-M001B	TE Bldg. Room 52 / Red flaking on concrete floor		16-Dec-25
TE-Rm52-PCB001B	TE Bldg. Room 52 / Red flaking on concrete floor		16-Dec-25
TE-Rm52-ML001B	TE Bldg. Room 52 / Red flaking on concrete floor	Hold for analysis	16-Dec-25
TE-Rm52-M002A	TE Bldg. Room 52 / Light blue on drywall wall		16-Dec-25
TE-Rm52-PCB002A	TE Bldg. Room 52 / Light blue on drywall wall		16-Dec-25
TE-Rm52-ML002A	TE Bldg. Room 52 / Light blue on drywall wall	Hold for analysis	16-Dec-25
TE-Rm42-M002B	TE Bldg. Room 42 / Light blue on drywall wall		16-Dec-25
TE-Rm42-PCB002B	TE Bldg. Room 42 / Light blue on drywall wall		16-Dec-25
TE-Rm42-ML002B	TE Bldg. Room 42 / Light blue on drywall wall	Hold for analysis	16-Dec-25
TE-Rm46-M003A	TE Bldg. Room 46 / Light brown on drywall wall		16-Dec-25
TE-Rm46-PCB003A	TE Bldg. Room 46 / Light brown on drywall wall		16-Dec-25
TE-Rm46-ML003A	TE Bldg. Room 46 / Light brown on drywall wall	Hold for analysis	16-Dec-25
TE-Rm40-M003B	TE Bldg. Room 40 / Light brown on drywall wall		16-Dec-25
TE-Rm40-PCB003B	TE Bldg. Room 40 / Light brown on drywall wall		16-Dec-25
TE-Rm40-ML003B	TE Bldg. Room 40 / Light brown on drywall wall	Hold for analysis	16-Dec-25
TE-Rm43-M004A	TE Bldg. Room 43 / Off-white on drywall wall		17-Dec-25
TE-Rm43-PCB004A	TE Bldg. Room 43 / Off-white on drywall wall		17-Dec-25
TE-Rm43-ML004A	TE Bldg. Room 43 / Off-white on drywall wall	Hold for analysis	17-Dec-25
TE-Rm43-M004B	TE Bldg. Room 43 / Off-white on drywall wall		17-Dec-25
Method of Shipment:		Sample Condition Upon Receipt:	
Relinquished by:	Date/Time:	Received by:	Date/Time:
Relinquished by:	Date/Time:	Received by:	Date/Time:

Controlled Document - COC-17 One Chain EMSL R6 08/18/2025

☐ AGREE TO ELECTRONIC SIGNATURE (By checking, I consent to signing this Chain of Custody document by electronic signature.)

EMSL Analytical, Inc.'s Laboratory Terms and Conditions are incorporated into this Chain of Custody by reference in their entirety.
Submission of samples to EMSL Analytical, Inc. constitutes acceptance and acknowledgment of all terms and conditions by Customer.



EMSL ANALYTICAL, INC.
TESTING LABS • PRODUCTS • TRAINING

EMSL Chain of Custody - One Chain

EMSL Order Number / Lab Use Only

EMSL Analytical, Inc.
200 Route 130 North
Cinnaminson, NJ 08077

PHONE: (800) 220-3675
EMAIL: CinnAslab@EMSL.com

Additional Pages of the Chain of Custody are only necessary if needed for additional sample information

Special Instructions and/or Regulatory Requirements (Sample Specifications, Processing Methods, Limits of Detection, etc.)

1. Hold "ML#" samples for potential TCLP analysis. 2. Homogenize Each Sample

Sample Number	Sample Location / Description	Volume, Area or Homogeneous Area	Date / Time Sampled (Air Monitoring Only)
8 TE-Rm43-PCB004B	TE Bldg. Room 43 / Off-white on drywall wall		17-Dec-25
TE-Rm43-ML004B	TE Bldg. Room 43 / Off-white on drywall wall	Hold for analysis	17-Dec-25
TE-Rm4-M005A	TE Bldg. Room 4 / Blue on drywall wall		16-Dec-25
9 TE-Rm4-PCB005A	TE Bldg. Room 4 / Blue on drywall wall		16-Dec-25
TE-Rm4-ML005A	TE Bldg. Room 4 / Blue on drywall wall	Hold for analysis	16-Dec-25
TE-Rm7-M005B	TE Bldg. Room 7 / Blue on drywall wall		16-Dec-25
10 TE-Rm7-PCB005B	TE Bldg. Room 7 / Blue on drywall wall		16-Dec-25
TE-Rm7-ML005B	TE Bldg. Room 7 / Blue on drywall wall	Hold for analysis	16-Dec-25
TE-Rm10-M006A	TE Bldg. Room 10 / Greenish blue on drywall wall		16-Dec-25
11 TE-Rm10-PCB006A	TE Bldg. Room 10 / Greenish blue on drywall wall		16-Dec-25
TE-Rm10-ML006A	TE Bldg. Room 10 / Greenish blue on drywall wall	Hold for analysis	16-Dec-25
TE-Rm10-M006B	TE Bldg. Room 10 / Greenish blue on drywall wall		16-Dec-25
12 TE-Rm10-PCB006B	TE Bldg. Room 10 / Greenish blue on drywall wall		16-Dec-25
TE-Rm10-ML006B	TE Bldg. Room 10 / Greenish blue on drywall wall	Hold for analysis	16-Dec-25
TE-Rm65-M007A	TE Bldg. Room 65 / Yellow on drywall wall		16-Dec-25
13 TE-Rm65-PCB007A	TE Bldg. Room 65 / Yellow on drywall wall		16-Dec-25
TE-Rm65-ML007A	TE Bldg. Room 65 / Yellow on drywall wall	Hold for analysis	16-Dec-25
TE-Rm65-M007B	TE Bldg. Room 65 / Yellow on drywall wall		17-Dec-25
14 TE-Rm65-PCB007B	TE Bldg. Room 65 / Yellow on drywall wall		17-Dec-25
TE-Rm65-ML007B	TE Bldg. Room 65 / Yellow on drywall wall	Hold for analysis	17-Dec-25
TE-Rm67-M008A	TE Bldg. Room 67 / Light yellow on drywall wall		16-Dec-25
15 TE-Rm67-PCB008A	TE Bldg. Room 67 / Light yellow on drywall wall		16-Dec-25
Method of Shipment:		Sample Condition Upon Receipt:	
Relinquished by:	Date/Time:	Received by: <i>[Signature]</i>	Date/Time: 12/29/25 0900
Relinquished by:	Date/Time:	Received by:	Date/Time:

Controlled Document - COC-17 One Chain EMSL Rev 08/18/2025

☐ AGREE TO ELECTRONIC SIGNATURE (By checking, I consent to signing this Chain of Custody document by electronic signature.)

EMSL Analytical, Inc.'s Laboratory Terms and Conditions are incorporated into this Chain of Custody by reference in their entirety.
Submission of samples to EMSL Analytical, Inc. constitutes acceptance and acknowledgment of all terms and conditions by Customer.



EMSL ANALYTICAL, INC.
TESTING LABS • PRODUCTS • TRAINING

AD46401

EMSL Chain of Custody - One Chain

EMSL Order Number / Lab Use Only

EMSL Analytical, Inc.
200 Route 130 North
Cinnaminson, NJ 08077

PHONE: (800) 220-3675
EMAIL: CinnAslab@EMSL.com

Additional Pages of the Chain of Custody are only necessary if needed for additional sample information

Special Instructions and/or Regulatory Requirements (Sample Specifications, Processing Methods, Limits of Detection, etc.)

1. Hold "ML#" samples for potential TCLP analysis. 2. Homogenize Each Sample

Sample Number	Sample Location / Description	Volume, Area or Homogeneous Area	Date / Time Sampled (Air Monitoring Only)
TE-Rm67-ML008A	TE Bldg. Room 67 / Light yellow on drywall wall	Hold for analysis	16-Dec-25
TE-Rm50-M008B	TE Bldg. Room 50 / Light yellow on drywall wall		17-Dec-25
16 TE-Rm50-PCB008B	TE Bldg. Room 50 / Light yellow on drywall wall		17-Dec-25
TE-Rm50-ML008B	TE Bldg. Room 50 / Light yellow on drywall wall	Hold for analysis	17-Dec-25
TE-Rm66-M009A	TE Bldg. Room 66 / Brownish-grey on drywall wall		16-Dec-25
17 TE-Rm66-PCB009A	TE Bldg. Room 66 / Brownish-grey on drywall wall		16-Dec-25
TE-Rm66-ML009A	TE Bldg. Room 66 / Brownish-grey on drywall wall	Hold for analysis	16-Dec-25
TE-Rm66-M009B	TE Bldg. Room 66 / Brownish-grey on drywall wall		17-Dec-25
18 TE-Rm66-PCB009B	TE Bldg. Room 66 / Brownish-grey on drywall wall		17-Dec-25
TE-Rm66-ML009B	TE Bldg. Room 66 / Brownish-grey on drywall wall	Hold for analyses	17-Dec-25
TE-Rm14-M010A	TE Bldg. Room 14 / Grey on drywall wall		16-Dec-25
19 TE-Rm14-PCB010A	TE Bldg. Room 14 / Grey on drywall wall		16-Dec-25
TE-Rm14-ML010A	TE Bldg. Room 14 / Grey on drywall wall	Hold for analysis	16-Dec-25
TE-Rm64-M010B	TE Bldg. Room 64 / Grey on drywall wall		17-Dec-25
20 TE-Rm64-PCB010B	TE Bldg. Room 64 / Grey on drywall wall		17-Dec-25
TE-Rm64-ML010B	TE Bldg. Room 64 / Grey on drywall wall	Hold for analysis	17-Dec-25
TE-Rm68-M011A	TE Bldg. Room 68 / Light green on plaster		16-Dec-25
21 TE-Rm68-PCB011A	TE Bldg. Room 68 / Light green on plaster		16-Dec-25
TE-Rm68-ML011A	TE Bldg. Room 68 / Light green on plaster	Hold for analysis	16-Dec-25
TE-Rm68-M011B	TE Bldg. Room 68 / Light green on plaster		17-Dec-25
22 TE-Rm68-PCB011B	TE Bldg. Room 68 / Light green on plaster		17-Dec-25
TE-Rm68-ML011B	TE Bldg. Room 68 / Light green on plaster	Hold for analysis	17-Dec-25
Method of Shipment:		Sample Condition Upon Receipt:	
Relinquished by:	Date/Time:	Received by:	Date/Time: 12/29/25 0900
Relinquished by:	Date/Time:	Received by:	Date/Time:

Controlled Document - CDC-17 One Chain EMSL R8 08/18/2025

☐ AGREE TO ELECTRONIC SIGNATURE (By checking, I consent to signing this Chain of Custody document by electronic signature.)

EMSL Analytical, Inc.'s Laboratory Terms and Conditions are incorporated into this Chain of Custody by reference in their entirety.
Submission of samples to EMSL Analytical, Inc. constitutes acceptance and acknowledgment of all terms and conditions by Customer.



EMSL ANALYTICAL, INC.
TESTING LABS • PRODUCTS • TRAINING

EMSL Chain of Custody - One Chain

EMSL Order Number / Lab Use Only

EMSL Analytical, Inc.
200 Route 130 North
Cinnaminson, NJ 08077

PHONE: (800) 220-3675
EMAIL: CinnAslab@EMSL.com

Additional Pages of the Chain of Custody are only necessary if needed for additional sample information

Special Instructions and/or Regulatory Requirements (Sample Specifications, Processing Methods, Limits of Detection, etc.)

1. Hold "ML#" samples for potential TCLP analysis. 2. Homogenize Each Samp

Sample Number	Sample Location / Description	Volume, Area or Homogeneous Area	Date / Time Sampled (Air Monitoring Only)
TE-Rm69-M012A	TE Bldg. Room 69 / Very light brown on plaster wall		16-Dec-25
23 TE-Rm69-PCB012A	TE Bldg. Room 69 / Very light brown on plaster wall		16-Dec-25
TE-Rm69-ML012A	TE Bldg. Room 69 / Very light brown on plaster wall	Hold for analysis	16-Dec-25
TE-Rm53-M012B	TE Bldg. Room 53 / Very light brown on drywall wall		16-Dec-25
24 TE-Rm53-PCB012B	TE Bldg. Room 53 / Very light brown on drywall wall		16-Dec-25
TE-Rm53-ML012B	TE Bldg. Room 53 / Very light brown on drywall wall	Hold for analysis	16-Dec-25
TE-Rm69-M013A	TE Bldg. Room 69 / Light brown on plaster wall		16-Dec-25
25 TE-Rm69-PCB013A	TE Bldg. Room 69 / Light brown on plaster wall		16-Dec-25
TE-Rm69-ML013A	TE Bldg. Room 69 / Light brown on plaster wall	Hold for analysis	16-Dec-25
TE-Rm69-M013B	TE Bldg. Room 69 / Light brown on plaster wall		17-Dec-25
26 TE-Rm69-PCB013B	TE Bldg. Room 69 / Light brown on plaster wall		17-Dec-25
TE-Rm69-ML013B	TE Bldg. Room 69 / Light brown on plaster wall	Hold for analysis	17-Dec-25
TE-Rm73-M014A	TE Bldg. Room 73 / Gloss white on drywall wall		16-Dec-25
TE-Rm73-ML014A	TE Bldg. Room 73 / Gloss white on drywall wall		16-Dec-25
27 TE-Rm73-PCB014A	TE Bldg. Room 73 / Gloss white on drywall wall	Hold for analysis	16-Dec-25
TE-Rm73-M014B	TE Bldg. Room 73 / Gloss white on drywall wall		17-Dec-25
28 TE-Rm73-PCB014B	TE Bldg. Room 73 / Gloss white on drywall wall		17-Dec-25
TE-Rm73-ML014B	TE Bldg. Room 73 / Gloss white on drywall wall	Hold for analysis	17-Dec-25
TE-Rm53-M015A	TE Bldg. Room 53 / Sky bue on drywall wall		16-Dec-25
29 TE-Rm53-PCB015A	TE Bldg. Room 53 / Sky bue on drywall wall		16-Dec-25
TE-Rm53-ML015A	TE Bldg. Room 53 / Sky bue on drywall wall	Hold for analysis	16-Dec-25
TE-Rm72-M015B	TE Bldg. Room 72 / Sky blue on drywall wall		16-Dec-25
Method of Shipment:		Sample Condition Upon Receipt:	
Relinquished by:	Date/Time:	Received by: <i>AS</i>	Date/Time: 12/29/25 0900
Relinquished by:	Date/Time:	Received by:	Date/Time:

Controlled Document - COC-17 One Chain EMSL R8 08/18/2025

☐ AGREE TO ELECTRONIC SIGNATURE (By checking, I consent to signing this Chain of Custody document by electronic signature.)

EMSL Analytical, Inc.'s Laboratory Terms and Conditions are incorporated into this Chain of Custody by reference in their entirety.
Submission of samples to EMSL Analytical, Inc. constitutes acceptance and acknowledgment of all terms and conditions by Customer.



EMSL ANALYTICAL, INC.
TESTING LABS • PRODUCTS • TRAINING

AD46401

EMSL Chain of Custody - One Chain

EMSL Order Number / Lab Use Only

EMSL Analytical, Inc.
200 Route 130 North
Cinnaminson, NJ 08077

PHONE: (800) 220-3675
EMAIL: CinnAsblab@EMSL.com

Additional Pages of the Chain of Custody are only necessary if needed for additional sample information

Special Instructions and/or Regulatory Requirements (Sample Specifications, Processing Methods, Limits of Detection, etc.)

1. Hold "ML#" samples for potential TCLP analysis. 2. Homogenize Each Samp

Sample Number	Sample Location / Description	Volume, Area or Homogeneous Area	Date / Time Sampled (Air Monitoring Only)
30 TE-Rm72-PCB015B	TE Bldg. Room 72 / Sky blue on drywall wall		16-Dec-25
TE-Rm72-ML015B	TE Bldg. Room 72 / Sky blue on drywall wall	Hold for analysis	16-Dec-25
TE-Rm74-M016A	TE Bldg. Room 74 / Very light green on plaster wall		16-Dec-25
31 TE-Rm74-PCB016A	TE Bldg. Room 74 / Very light green on plaster wall		16-Dec-25
TE-Rm74-ML016A	TE Bldg. Room 74 / Very light green on plaster wall	Hold for analysis	16-Dec-25
TE-Rm74-M016B	TE Bldg. Room 74 / Very light green on plaster wall		17-Dec-25
32 TE-Rm74-PCB016B	TE Bldg. Room 74 / Very light green on plaster wall		17-Dec-25
TE-Rm74-ML016B	TE Bldg. Room 74 / Very light green on plaster wall	Hold for analysis	17-Dec-25
TE-Rm57-M017A	TE Bldg. Room 57 / Blue on drywall wall		16-Dec-25
33 TE-Rm57-PCB017A	TE Bldg. Room 57 / Blue on drywall wall		16-Dec-25
TE-Rm57-ML017A	TE Bldg. Room 57 / Blue on drywall wall	Hold for analysis	16-Dec-25
TE-Rm21-M017B	TE Bldg. Room 21 / Blue on plaster wall		16-Dec-25
34 TE-Rm21-PCB017B	TE Bldg. Room 21 / Blue on plaster wall		16-Dec-25
TE-Rm21-ML017B	TE Bldg. Room 21 / Blue on plaster wall	Hold for analysis	16-Dec-25
TE-Rm40-M018A	TE Bldg. Room 40 / Grey on concrete floor		17-Dec-25
35 TE-Rm40-PCB018A	TE Bldg. Room 40 / Grey on concrete floor		17-Dec-25
TE-Rm40-ML018A	TE Bldg. Room 40 / Grey on concrete floor	Hold for analysis	17-Dec-25
TE-Rm40-M018B	TE Bldg. Room 40 / Grey on concrete floor		17-Dec-25
36 TE-Rm40-PCB018B	TE Bldg. Room 40 / Grey on concrete floor		17-Dec-25
TE-Rm40-ML018B	TE Bldg. Room 40 / Grey on concrete floor	Hold for analysis	17-Dec-25
TE-Rm25-M019A	TE Bldg. Room 25 / Bluish black on drywall ceiling		17-Dec-25
37 TE-Rm25-PCB019A	TE Bldg. Room 25 / Bluish black on drywall ceiling		17-Dec-25

Method of Shipment:

Sample Condition Upon Receipt:

Relinquished by:

Date/Time:

Received by: *[Signature]*

Date/Time: 12/29/25 0900

Relinquished by:

Date/Time:

Received by:

Date/Time:

Controlled Document - COC-17 One Chain EMSL R6 08/18/2025

☐ AGREE TO ELECTRONIC SIGNATURE (By checking, I consent to signing this Chain of Custody document by electronic signature.)

EMSL Analytical, Inc.'s Laboratory Terms and Conditions are incorporated into this Chain of Custody by reference in their entirety. Submission of samples to EMSL Analytical, Inc. constitutes acceptance and acknowledgment of all terms and conditions by Customer.



EMSL ANALYTICAL, INC.
TESTING LABS • PRODUCTS • TRAINING

EMSL Chain of Custody - One Chain

EMSL Order Number / Lab Use Only

EMSL Analytical, Inc.
200 Route 130 North
Cinnaminson, NJ 08077

PHONE: (800) 220-3675
EMAIL: CinnAslab@EMSL.com

Additional Pages of the Chain of Custody are only necessary if needed for additional sample information

Special Instructions and/or Regulatory Requirements (Sample Specifications, Processing Methods, Limits of Detection, etc.)

1. Hold "ML#" samples for potential TCLP analysis. 2. Homogenize Each Samp

Sample Number	Sample Location / Description	Volume, Area or Homogeneous Area	Date / Time Sampled (Air Monitoring Only)
TE-Rm25-ML019A	TE Bldg. Room 25 / Bluish black on drywall ceiling	Hold for analysis	17-Dec-25
TE-Rm23-M019B	TE Bldg. Room 23 / Bluish black on drywall ceiling		17-Dec-25
38 TE-Rm23-PCB019B	TE Bldg. Room 23 / Bluish black on drywall ceiling		17-Dec-25
TE-Rm23-ML019B	TE Bldg. Room 23 / Bluish black on drywall ceiling	Hold for analysis	17-Dec-25
TE-Ext-M020A	TE Bldg. Exterior / V. light brown on concrete wall		17-Dec-25
39 TE-Ext-PCB020A	TE Bldg. Exterior / V. light brown on concrete wall		17-Dec-25
TE-Ext-ML020A	TE Bldg. Exterior / V. light brown on concrete wall	Hold for analysis	17-Dec-25
TE-Ext-M020B	TE Bldg. Exterior / V. light brown on concrete wall		17-Dec-25
40 TE-Ext-PCB020B	TE Bldg. Exterior / V. light brown on concrete wall		17-Dec-25
TE-Ext-ML020B	TE Bldg. Exterior / V. light brown on concrete wall	Hold for analysis	17-Dec-25
TE-Ext-M021A	TE Bldg. Exterior / V. light brown on plywood wall		17-Dec-25
41 TE-Ext-PCB021A	TE Bldg. Exterior / V. light brown on plywood wall		17-Dec-25
TE-Ext-ML021A	TE Bldg. Exterior / V. light brown on plywood wall	Hold for analysis	17-Dec-25
TE-Ext-M021B	TE Bldg. Exterior / V. light brown on plywood wall		17-Dec-25
42 TE-Ext-PCB021B	TE Bldg. Exterior / V. light brown on plywood wall		17-Dec-25
TE-Ext-ML021B	TE Bldg. Exterior / V. light brown on plywood wall	Hold for analysis	17-Dec-25
TE-Ext-M022A	TE Bldg. Exterior / V. light brown on concrete wall board		17-Dec-25
43 TE-Ext-PCB022A	TE Bldg. Exterior / V. light brown on concrete wall board		17-Dec-25
TE-Ext-ML022A	TE Bldg. Exterior / V. light brown on concrete wall board	Hold for analysis	17-Dec-25
TE-Ext-M022B	TE Bldg. Exterior / V. light brown on concrete wall board		17-Dec-25
44 TE-Ext-PCB022B	TE Bldg. Exterior / V. light brown on concrete wall board		17-Dec-25
TE-Ext-ML022B	TE Bldg. Exterior / V. light brown on concrete wall board	Hold for analysis	17-Dec-25
Method of Shipment:		Sample Condition Upon Receipt:	
Relinquished by:	Date/Time:	Received by:	Date/Time: 12/29/25 0900
Relinquished by:	Date/Time:	Received by:	Date/Time:

Controlled Document - COC-17 One Chain EMSL R6 08/18/2025

☐ AGREE TO ELECTRONIC SIGNATURE (By checking, I consent to signing this Chain of Custody document by electronic signature.)

EMSL Analytical, Inc.'s Laboratory Terms and Conditions are incorporated into this Chain of Custody by reference in their entirety.
Submission of samples to EMSL Analytical, Inc. constitutes acceptance and acknowledgment of all terms and conditions by Customer.



EMSL ANALYTICAL, INC.
TESTING LABS • PRODUCTS • TRAINING

AD46401

EMSL Chain of Custody - One Chain

EMSL Order Number / Lab Use Only

EMSL Analytical, Inc.
200 Route 130 North
Cinnaminson, NJ 08077

PHONE: (800) 220-3675
EMAIL: CinnAslab@EMSL.com

Additional Pages of the Chain of Custody are only necessary if needed for additional sample information

Special Instructions and/or Regulatory Requirements (Sample Specifications, Processing Methods, Limits of Detection, etc.)

1. Hold "ML#" samples for potential TCLP analysis. 2. Homogenize Each Samp

Sample Number	Sample Location / Description	Volume, Area or Homogeneous Area	Date / Time Sampled (Air Monitoring Only)
TE-Ext-M023A	TE Bldg. Exterior / V. light brown on metal pipe		18-Dec-25
45 TE-Ext-PCB023A	TE Bldg. Exterior / V. light brown on metal pipe		18-Dec-25
TE-Ext-ML023A	TE Bldg. Exterior / V. light brown on metal pipe	Hold for analysis	18-Dec-25
TE-Ext-M023B	TE Bldg. Exterior / V. light brown on metal pipe		18-Dec-25
40 TE-Ext-PCB023B	TE Bldg. Exterior / V. light brown on metal pipe		18-Dec-25
TE-Ext-ML023B	TE Bldg. Exterior / V. light brown on metal pipe	Hold for analysis	18-Dec-25
TE-Rm73-M024A	TE Bldg. Room 73 / Dark grey on metal door and frame		18-Dec-25
47 TE-Rm73-PCB024A	TE Bldg. Room 73 / Dark grey on metal door and frame		18-Dec-25
TE-Rm73-ML024A	TE Bldg. Room 73 / Dark grey on metal door and frame	Hold for analysis	18-Dec-25
TE-Rm63-M024B	TE Bldg. Room 63 / Dark grey on metal door and frame		18-Dec-25
48 TE-Rm63-PCB024B	TE Bldg. Room 63 / Dark grey on metal door and frame		18-Dec-25
TE-Rm63-ML024B	TE Bldg. Room 63 / Dark grey on metal door and frame	Hold for analysis	18-Dec-25
TE-Rm63-M025A	TE Bldg. Room 63 / Brown on metal door and frame		18-Dec-25
49 TE-Rm63-PCB025A	TE Bldg. Room 63 / Brown on metal door and frame		18-Dec-25
TE-Rm63-ML025A	TE Bldg. Room 63 / Brown on metal door and frame	Hold for analysis	18-Dec-25
TE-Rm15-M025B	TE Bldg. Room 15 / Brown on metal door and frame		18-Dec-25
50 TE-Rm15-PCB025B	TE Bldg. Room 15 / Brown on metal door and frame		18-Dec-25
TE-Rm15-ML025B	TE Bldg. Room 15 / Brown on metal door and frame	Hold for analysis	18-Dec-25
TE-Rm27-M026A	TE Bldg. Room 27 / Black on metal door and frame		18-Dec-25
51 TE-Rm27-PCB026A	TE Bldg. Room 27 / Black on metal door and frame		18-Dec-25
TE-Rm27-ML026A	TE Bldg. Room 27 / Black on metal door and frame	Hold for analysis	18-Dec-25
TE-Rm30-M026B	TE Bldg. Room 30 / Brown on metal door and frame		18-Dec-25
Method of Shipment:		Sample Condition Upon Receipt:	
Relinquished by:	Date/Time:	Received <i>28</i>	Date/Time <i>12/29/25 0900</i>
Relinquished by:	Date/Time:	Received by:	Date/Time:

Controlled Document - COC-17 One Chain EMSL R6 08/18/2025

☐ AGREE TO ELECTRONIC SIGNATURE (By checking, I consent to signing this Chain of Custody document by electronic signature.)

EMSL Analytical, Inc.'s Laboratory Terms and Conditions are incorporated into this Chain of Custody by reference in their entirety.
Submission of samples to EMSL Analytical, Inc. constitutes acceptance and acknowledgment of all terms and conditions by Customer.



EMSL ANALYTICAL, INC.
TESTING LABS • PRODUCTS • TRAINING

EMSL Chain of Custody - One Chain

EMSL Order Number / Lab Use Only

EMSL Analytical, Inc.
200 Route 130 North
Cinnaminson, NJ 08077

PHONE: (800) 220-3675
EMAIL: CinnAslab@EMSL.com

AD46401

Additional Pages of the Chain of Custody are only necessary if needed for additional sample information

Special Instructions and/or Regulatory Requirements (Sample Specifications, Processing Methods, Limits of Detection, etc.)

1. Hold "ML#" samples for potential TCLP analysis. 2. Homogenize Each Samp

Sample Number	Sample Location / Description	Volume, Area or Homogeneous Area	Date / Time Sampled (Air Monitoring Only)
52 TE-Rm30-PCB026B	TE Bldg. Room 30 / Brown on metal door and frame		18-Dec-25
TE-Rm30-ML026B	TE Bldg. Room 30 / Brown on metal door and frame	Hold for analysis	18-Dec-25
TE-Rm47-M027A	TE Bldg. Room 47 / Green on metal door and frame		18-Dec-25
53 TE-Rm47-PCB027A	TE Bldg. Room 47 / Green on metal door and frame		18-Dec-25
TE-Rm47-ML027A	TE Bldg. Room 47 / Green on metal door and frame	Hold for analysis	18-Dec-25
TE-Rm47-M027B	TE Bldg. Room 47 / Green on metal door and frame		18-Dec-25
54 TE-Rm47-PCB027B	TE Bldg. Room 47 / Green on metal door and frame		18-Dec-25
TE-Rm47-ML027B	TE Bldg. Room 47 / Green on metal door and frame	Hold for analysis	18-Dec-25
TE-Rm52-M028A	TE Bldg. Room 52 / White on metal wall panels		18-Dec-25
55 TE-Rm52-PCB028A	TE Bldg. Room 52 / White on metal wall panels		18-Dec-25
TE-Rm52-ML028A	TE Bldg. Room 52 / White on metal wall panels	Hold for analysis	18-Dec-25
TE-Rm52-M028B	TE Bldg. Room 52 / White on metal wall panels		18-Dec-25
56 TE-Rm52-PCB028B	TE Bldg. Room 52 / White on metal wall panels		18-Dec-25
TE-Rm52-ML028B	TE Bldg. Room 52 / White on metal wall panels	Hold for analysis	18-Dec-25
TE-Rm52-M029A	TE Bldg. Room 52 / Light blue on metal wall panels		18-Dec-25
57 TE-Rm52-PCB029A	TE Bldg. Room 52 / Light blue on metal wall panels		18-Dec-25
TE-Rm52-ML029A	TE Bldg. Room 52 / Light blue on metal wall panels	Hold for analysis	18-Dec-25
TE-Rm52-M029B	TE Bldg. Room 52 / Light blue on metal wall panels		18-Dec-25
58 TE-Rm52-PCB029B	TE Bldg. Room 52 / Light blue on metal wall panels		18-Dec-25
TE-Rm52-ML029B	TE Bldg. Room 52 / Light blue on metal wall panels	Hold for analysis	18-Dec-25
TE-Rm51-M030A	TE Bldg. Room 51 / Black on concrete and metal pad		18-Dec-25
59 TE-Rm51-PCB030A	TE Bldg. Room 51 / Black on concrete and metal pad		18-Dec-25

Method of Shipment:

Sample Condition Upon Receipt:

Relinquished by:

Date/Time:

Received by:

Date/Time:

Relinquished by:

Date/Time:

Received by:

Date/Time:

Controlled Document - COC-17 One Chain EMSL R6 08/18/2025

☐ AGREE TO ELECTRONIC SIGNATURE (By checking, I consent to signing this Chain of Custody document by electronic signature.)

EMSL Analytical, Inc.'s Laboratory Terms and Conditions are incorporated into this Chain of Custody by reference in their entirety.
Submission of samples to EMSL Analytical, Inc. constitutes acceptance and acknowledgment of all terms and conditions by Customer.



EMSL ANALYTICAL, INC.
TESTING LABS • PRODUCTS • TRAINING

AD46401

EMSL Chain of Custody - One Chain

EMSL Order Number / Lab Use Only

EMSL Analytical, Inc.
200 Route 130 North
Cinnaminson, NJ 08077

PHONE: (800) 220-3675
EMAIL: CinnAslab@EMSL.com

Additional Pages of the Chain of Custody are only necessary if needed for additional sample information

Special Instructions and/or Regulatory Requirements (Sample Specifications, Processing Methods, Limits of Detection, etc.)

1. Hold "ML#" samples for potential TCLP analysis. 2. Homogenize Each Samp

Sample Number	Sample Location / Description	Volume, Area or Homogeneous Area	Date / Time Sampled (Air Monitoring Only)
TE-Rm51-ML030A	TE Bldg. Room 51 / Black on concrete and metal pad	Hold for analysis	18-Dec-25
TE-Rm51-M030B	TE Bldg. Room 51 / Black on concrete and metal pad		18-Dec-25
TE-Rm51-PCB030B	TE Bldg. Room 51 / Black on concrete and metal pad		18-Dec-25
TE-Rm51-ML030B	TE Bldg. Room 51 / Black on concrete and metal pad	Hold for analysis	18-Dec-25
TE-Rm45-M031A	TE Bldg. Room 45 / White on drywall wall		19-Dec-25
TE-Rm45-PCB031A	TE Bldg. Room 45 / White on drywall wall		19-Dec-25
TE-Rm45-ML031A	TE Bldg. Room 45 / White on drywall wall	Hold for analysis	19-Dec-25
TE-Rm63-M031B	TE Bldg. Room 63 / White on drywall wall		19-Dec-25
TE-Rm63-PCB031B	TE Bldg. Room 63 / White on drywall wall		19-Dec-25
TE-Rm63-ML031B	TE Bldg. Room 63 / White on drywall wall	Hold for analysis	19-Dec-25
TE-Rm51-M032A	TE Bldg. Room 51 / Light blue on pipe insulation and paper		19-Dec-25
TE-Rm51-PCB032A	TE Bldg. Room 51 / Light blue on pipe insulation and paper		19-Dec-25
TE-Rm51-ML032A	TE Bldg. Room 51 / Light blue on pipe insulation and paper	Hold for analysis	19-Dec-25
TE-Rm71-M032B	TE Bldg. Room 71 / Light blue on pipe insulation and paper		19-Dec-25
TE-Rm71-PCB032B	TE Bldg. Room 71 / Light blue on pipe insulation and paper		19-Dec-25
TE-Rm71-ML032B	TE Bldg. Room 71 / Light blue on pipe insulation and paper	Hold for analysis	19-Dec-25
TE-Rm51-M033A	TE Bldg. Room 51 / White on pipe insulation and paper		19-Dec-25
TE-Rm51-PCB033A	TE Bldg. Room 51 / White on pipe insulation and paper		19-Dec-25
TE-Rm51-ML033A	TE Bldg. Room 51 / White on pipe insulation and paper	Hold for analysis	19-Dec-25
TE-Rm51-M033B	TE Bldg. Room 51 / White on pipe insulation and paper		19-Dec-25
TE-Rm51-PCB033B	TE Bldg. Room 51 / White on pipe insulation and paper		19-Dec-25
TE-Rm51-ML033B	TE Bldg. Room 51 / White on pipe insulation and paper	Hold for analysis	19-Dec-25

Method of Shipment:

Sample Condition Upon Receipt:

Relinquished by:

Date/Time:

Received by:

Date/Time:

Relinquished by:

Date/Time:

Received by:

Date/Time:

Controlled Document - COC-17 One Chain EMSL R6 08/18/2025

☐ AGREE TO ELECTRONIC SIGNATURE (By checking, I consent to signing this Chain of Custody document by electronic signature.)

EMSL Analytical, Inc.'s Laboratory Terms and Conditions are incorporated into this Chain of Custody by reference in their entirety.
Submission of samples to EMSL Analytical, Inc. constitutes acceptance and acknowledgment of all terms and conditions by Customer.



EMSL ANALYTICAL, INC.
TESTING LABS • PRODUCTS • TRAINING

EMSL Chain of Custody - One Chain

EMSL Order Number / Lab Use Only

EMSL Analytical, Inc.
200 Route 130 North
Cinnaminson, NJ 08077

PHONE: (800) 220-3675
EMAIL: CinnAslab@EMSL.com

AD46401

Additional Pages of the Chain of Custody are only necessary if needed for additional sample information

Special Instructions and/or Regulatory Requirements (Sample Specifications, Processing Methods, Limits of Detection, etc.)

1. Hold "ML#" samples for potential TCLP analysis. 2. Homogenize Each Samp

Sample Number	Sample Location / Description	Volume, Area or Homogeneous Area	Date / Time Sampled (Air Monitoring Only)
GB-Rm1-M001A	Gen. Bldg. Room 1 / White on metal walls		9-Dec-25
61 GB-Rm1-PCB001A	Gen. Bldg. Room 1 / White on metal walls		9-Dec-25
GB-Rm1-ML001A	Gen. Bldg. Room 1 / White on metal walls	Hold for analysis	9-Dec-25
GB-Rm10-M001B	Gen. Bldg. Room 10 / White on metal walls		9-Dec-25
68 GB-Rm10-PCB001B	Gen. Bldg. Room 10 / White on metal walls		9-Dec-25
GB-Rm10-ML001B	Gen. Bldg. Room 10 / White on metal walls	Hold for analysis	9-Dec-25
GB-Rm6-M002A	Gen. Bldg. Room 6 / White on drywall walls		9-Dec-25
69 GB-Rm6-PCB002A	Gen. Bldg. Room 6 / White on drywall walls		9-Dec-25
GB-Rm6-ML002A	Gen. Bldg. Room 6 / White on drywall walls	Hold for analysis	9-Dec-25
GB-Rm9-M002B	Gen. Bldg. Room 9 / White on drywall walls		9-Dec-25
70 GB-Rm9-PCB002B	Gen. Bldg. Room 9 / White on drywall walls		9-Dec-25
GB-Rm9-ML002B	Gen. Bldg. Room 9 / White on drywall walls	Hold for analysis	9-Dec-25
GB-Rm5-M003A	Gen. Bldg. Room 5 / Beige on drywall walls		9-Dec-25
71 GB-Rm5-PCB003A	Gen. Bldg. Room 5 / Beige on drywall walls		9-Dec-25
GB-Rm5-ML003A	Gen. Bldg. Room 5 / Beige on drywall walls	Hold for analysis	9-Dec-25
GB-Rm5-M003B	Gen. Bldg. Room 5 / Beige on drywall walls		9-Dec-25
72 GB-Rm5-PCB003B	Gen. Bldg. Room 5 / Beige on drywall walls		9-Dec-25
GB-Rm5-ML003B	Gen. Bldg. Room 5 / Beige on drywall walls	Hold for analysis	9-Dec-25
GB-Rm1-M004A	Gen. Bldg. Room 1 / White on concrete block walls		9-Dec-25
73 GB-Rm1-PCB004A	Gen. Bldg. Room 1 / White on concrete block walls		9-Dec-25
GB-Rm1-ML004A	Gen. Bldg. Room 1 / White on concrete block walls	Hold for analysis	9-Dec-25
GB-Rm1-M004B	Gen. Bldg. Room 1 / White on concrete block walls		9-Dec-25

Method of Shipment:

Sample Condition Upon Receipt:

Relinquished by:

Date/Time:

Received by:

Date/Time:

Relinquished by:

Date/Time:

Received by:

Date/Time:

Controlled Document - COC-17 One Chain EMSL R6 08/18/2025

☐ AGREE TO ELECTRONIC SIGNATURE (By checking, I consent to signing this Chain of Custody document by electronic signature.)

EMSL Analytical, Inc.'s Laboratory Terms and Conditions are incorporated into this Chain of Custody by reference in their entirety.
Submission of samples to EMSL Analytical, Inc. constitutes acceptance and acknowledgment of all terms and conditions by Customer.



EMSL ANALYTICAL, INC.
TESTING LABS • PRODUCTS • TRAINING

EMSL Chain of Custody - One Chain

EMSL Order Number / Lab Use Only

EMSL Analytical, Inc.
200 Route 130 North
Cinnaminson, NJ 08077

PHONE: (800) 220-3675
EMAIL: CinnAslab@EMSL.com

AD46401

Additional Pages of the Chain of Custody are only necessary if needed for additional sample information

Special Instructions and/or Regulatory Requirements (Sample Specifications, Processing Methods, Limits of Detection, etc.)

1. Hold "ML#" samples for potential TCLP analysis. 2. Homogenize Each Samp

Sample Number	Sample Location / Description	Volume, Area or Homogeneous Area	Date / Time Sampled (Air Monitoring Only)
14 GB-Rm1-PCB004B	Gen. Bldg. Room 1 / White on concrete block walls		9-Dec-25
GB-Rm1-ML004B	Gen. Bldg. Room 1 / White on concrete block walls	Hold for analysis	9-Dec-25
GB-Rm1-M005A	Gen. Bldg. Room 1 / Black on concrete block walls		9-Dec-25
15 GB-Rm1-PCB005A	Gen. Bldg. Room 1 / Black on concrete block walls		9-Dec-25
GB-Rm1-ML005A	Gen. Bldg. Room 1 / Black on concrete block walls	Hold for analysis	9-Dec-25
GB-Rm1-M005B	Gen. Bldg. Room 1 / Black on concrete block walls		9-Dec-25
16 GB-Rm1-PCB005B	Gen. Bldg. Room 1 / Black on concrete block walls		9-Dec-25
GB-Rm1-ML005B	Gen. Bldg. Room 1 / Black on concrete block walls	Hold for analysis	9-Dec-25
GB-Rm4-M006A	Gen. Bldg. Room 4 / Black on drywall walls		12-Dec-25
17 GB-Rm4-PCB006A	Gen. Bldg. Room 4 / Black on drywall walls		12-Dec-25
GB-Rm4-ML006A	Gen. Bldg. Room 4 / Black on drywall walls	Hold for analysis	12-Dec-25
GB-Rm4-M006B	Gen. Bldg. Room 4 / Black on drywall walls		12-Dec-25
18 GB-Rm4-PCB006B	Gen. Bldg. Room 4 / Black on drywall walls		12-Dec-25
GB-Rm4-ML006B	Gen. Bldg. Room 4 / Black on drywall walls	Hold for analysis	12-Dec-25
GB-Rm4-M007A	Gen. Bldg. Room 4 / Red on concrete walls		12-Dec-25
19 GB-Rm4-PCB007A	Gen. Bldg. Room 4 / Red on concrete walls		12-Dec-25
GB-Rm4-ML007A	Gen. Bldg. Room 4 / Red on concrete walls	Hold for analysis	12-Dec-25
GB-Rm12-M007B	Gen. Bldg. Room 12 / Red on concrete walls		12-Dec-25
20 GB-Rm12-PCB007B	Gen. Bldg. Room 12 / Red on concrete walls		12-Dec-25
GB-Rm12-ML007B	Gen. Bldg. Room 12 / Red on concrete walls	Hold for analysis	12-Dec-25
GB-Rm10-M008A	Gen. Bldg. Room 10 / Light grey on metal generator housing		12-Dec-25
21 GB-Rm10-PCB008A	Gen. Bldg. Room 10 / Light grey on metal generator housing		12-Dec-25
Method of Shipment:		Sample Condition Upon Receipt:	
Relinquished by:	Date/Time:	Received by: <i>[Signature]</i>	Date/Time: 12/29/25 0900
Relinquished by:	Date/Time:	Received by:	Date/Time:

Controlled Document - COC-17 One Chain EMSL R8 08/18/2025

☐ AGREE TO ELECTRONIC SIGNATURE (By checking, I consent to signing this Chain of Custody document by electronic signature.)

EMSL Analytical, Inc.'s Laboratory Terms and Conditions are incorporated into this Chain of Custody by reference in their entirety.
Submission of samples to EMSL Analytical, Inc. constitutes acceptance and acknowledgment of all terms and conditions by Customer.



EMSL ANALYTICAL, INC.
TESTING LABS • PRODUCTS • TRAINING

AD46401

EMSL Chain of Custody - One Chain

EMSL Order Number / Lab Use Only

EMSL Analytical, Inc.
200 Route 130 North
Cinnaminson, NJ 08077

PHONE: (800) 220-3675
EMAIL: CinnAslab@EMSL.com

Additional Pages of the Chain of Custody are only necessary if needed for additional sample information

Special Instructions and/or Regulatory Requirements (Sample Specifications, Processing Methods, Limits of Detection, etc.)

1. Hold "ML#" samples for potential TCLP analysis. 2. Homogenize Each Samp

Sample Number	Sample Location / Description	Volume, Area or Homogeneous Area	Date / Time Sampled (Air Monitoring Only)
GB-Rm10-ML008A	Gen. Bldg. Room 10 / Light grey on metal generator housing	Hold for analysis	12-Dec-25
GB-Rm10-M008B	Gen. Bldg. Room 10 / Light grey on metal generator housing		12-Dec-25
82 GB-Rm10-PCB008B	Gen. Bldg. Room 10 / Light grey on metal generator housing		12-Dec-25
GB-Rm10-ML008B	Gen. Bldg. Room 10 / Light grey on metal generator housing	Hold for analysis	12-Dec-25
GB-Rm10-M009A	Gen. Bldg. Room 10 / Black on pipe insulation paper		12-Dec-25
83 GB-Rm10-PCB009A	Gen. Bldg. Room 10 / Black on pipe insulation paper		12-Dec-25
GB-Rm10-ML009A	Gen. Bldg. Room 10 / Black on pipe insulation paper	Hold for analysis	12-Dec-25
GB-Rm10-M009B	Gen. Bldg. Room 10 / Black on pipe insulation paper		12-Dec-25
84 GB-Rm10-PCB009B	Gen. Bldg. Room 10 / Black on pipe insulation paper		12-Dec-25
GB-Rm10-ML009B	Gen. Bldg. Room 10 / Black on pipe insulation paper	Hold for analysis	12-Dec-25
GB-Rm10-M010A	Gen. Bldg. Room 10 / Light grey on metal pipe		12-Dec-25
85 GB-Rm10-PCB010A	Gen. Bldg. Room 10 / Light grey on metal pipe		12-Dec-25
GB-Rm10-ML010A	Gen. Bldg. Room 10 / Light grey on metal pipe	Hold for analysis	12-Dec-25
GB-Rm10-M010B	Gen. Bldg. Room 10 / Light grey on metal pipe		12-Dec-25
86 GB-Rm10-PCB010B	Gen. Bldg. Room 10 / Light grey on metal pipe		12-Dec-25
GB-Rm10-ML010B	Gen. Bldg. Room 10 / Light grey on metal pipe	Hold for analysis	12-Dec-25
GB-Rm2-M011A	Gen. Bldg. Room 2 / Light grey on concrete floor		12-Dec-25
87 GB-Rm2-PCB011A	Gen. Bldg. Room 2 / Light grey on concrete floor		12-Dec-25
GB-Rm2-ML011A	Gen. Bldg. Room 2 / Light grey on concrete floor	Hold for analysis	12-Dec-25
GB-Rm2-M011B	Gen. Bldg. Room 2 / Light grey on concrete floor		12-Dec-25
88 GB-Rm2-PCB011B	Gen. Bldg. Room 2 / Light grey on concrete floor		12-Dec-25
GB-Rm2-ML011B	Gen. Bldg. Room 2 / Light grey on concrete floor	Hold for analysis	12-Dec-25
Method of Shipment:		Sample Condition Upon Receipt:	
Relinquished by:	Date/Time:	Received by:	Date/Time: 12/29/25 0900
Relinquished by:	Date/Time:	Received by:	Date/Time:

Controlled Document - COC-17 One Chain EMSL R6 08/18/2025

☐ AGREE TO ELECTRONIC SIGNATURE (By checking, I consent to signing this Chain of Custody document by electronic signature.)

EMSL Analytical, Inc.'s Laboratory Terms and Conditions are incorporated into this Chain of Custody by reference in their entirety.
Submission of samples to EMSL Analytical, Inc. constitutes acceptance and acknowledgment of all terms and conditions by Customer.



EMSL ANALYTICAL, INC.
TESTING LABS • PRODUCTS • TRAINING

EMSL Chain of Custody - One Chain

EMSL Order Number / Lab Use Only

EMSL Analytical, Inc.
200 Route 130 North
Cinnaminson, NJ 08077

PHONE: (800) 220-3675
EMAIL: CinnAslab@EMSL.com

Additional Pages of the Chain of Custody are only necessary if needed for additional sample information

Special Instructions and/or Regulatory Requirements (Sample Specifications, Processing Methods, Limits of Detection, etc.)

1. Hold "ML#" samples for potential TCLP analysis. 2. Homogenize Each Samp

Sample Number	Sample Location / Description	Volume, Area or Homogeneous Area	Date / Time Sampled (Air Monitoring Only)
GB-Rm4-M012A	Gen. Bldg. Room 4 / Black on metal ceiling hangers		15-Dec-25
89 GB-Rm4-PCB012A	Gen. Bldg. Room 4 / Black on metal ceiling hangers		15-Dec-25
GB-Rm4-ML012A	Gen. Bldg. Room 4 / Black on metal ceiling hangers	Hold for analysis	15-Dec-25
GB-Rm4-M012B	Gen. Bldg. Room 4 / Black on metal ceiling hangers		15-Dec-25
90 GB-Rm4-PCB012B	Gen. Bldg. Room 4 / Black on metal ceiling hangers		15-Dec-25
GB-Rm4-ML012B	Gen. Bldg. Room 4 / Black on metal ceiling hangers	Hold for analysis	15-Dec-25
GB-Rm14-M013A	Gen. Bldg. Room 14 / Blue on metal door and frame		15-Dec-25
91 GB-Rm14-PCB013A	Gen. Bldg. Room 14 / Blue on metal door and frame		15-Dec-25
GB-Rm14-ML013A	Gen. Bldg. Room 14 / Blue on metal door and frame	Hold for analysis	15-Dec-25
GB-Rm14-M013B	Gen. Bldg. Room 14 / Blue on metal door and frame		15-Dec-25
92 GB-Rm14-PCB013B	Gen. Bldg. Room 14 / Blue on metal door and frame		15-Dec-25
GB-Rm14-ML013B	Gen. Bldg. Room 14 / Blue on metal door and frame	Hold for analysis	15-Dec-25
GB-Ext-M014A	Gen. Bldg. Exterior / V. light brown on concrete wall board		15-Dec-25
93 GB-Ext-PCB014A	Gen. Bldg. Exterior / V. light brown on concrete wall board		15-Dec-25
GB-Ext-ML014A	Gen. Bldg. Exterior / V. light brown on concrete wall board	Hold for analysis	15-Dec-25
GB-Ext-M014B	Gen. Bldg. Exterior / V. light brown on concrete wall board		15-Dec-25
94 GB-Ext-PCB014B	Gen. Bldg. Exterior / V. light brown on concrete wall board		15-Dec-25
GB-Ext-ML014B	Gen. Bldg. Exterior / V. light brown on concrete wall board	Hold for analysis	15-Dec-25
GB-Ext-M015A	Gen. Bldg. Exterior / V. light brown on concrete wall		15-Dec-25
95 GB-Ext-PCB015A	Gen. Bldg. Exterior / V. light brown on concrete wall		15-Dec-25
GB-Ext-ML015A	Gen. Bldg. Exterior / V. light brown on concrete wall	Hold for analysis	15-Dec-25
GB-Ext-M015B	Gen. Bldg. Exterior / V. light brown on concrete wall		15-Dec-25
Method of Shipment:		Sample Condition Upon Receipt:	
Relinquished by:	Date/Time:	Received by:	Date/Time: 12/29/25 0900
Relinquished by:	Date/Time:	Received by:	Date/Time:

Controlled Document - COC-17 One Chain EMSL, RB 08/18/2025

☐ AGREE TO ELECTRONIC SIGNATURE (By checking, I consent to signing this Chain of Custody document by electronic signature.)

EMSL Analytical, Inc.'s Laboratory Terms and Conditions are incorporated into this Chain of Custody by reference in their entirety.
Submission of samples to EMSL Analytical, Inc. constitutes acceptance and acknowledgment of all terms and conditions by Customer.



EMSL ANALYTICAL, INC.
TESTING LABS • PRODUCTS • TRAINING

EMSL Chain of Custody - One Chain

EMSL Order Number / Lab Use Only

EMSL Analytical, Inc.
200 Route 130 North
Cinnaminson, NJ 08077

PHONE: (800) 220-3675
EMAIL: CinnAslab@EMSL.com

Table of Contents

AD46401

Additional Pages of the Chain of Custody are only necessary if needed for additional sample information

Special Instructions and/or Regulatory Requirements (Sample Specifications, Processing Methods, Limits of Detection, etc.)

1. Hold "ML#" samples for potential TCLP analysis. 2. Homogenize Each Samp

Sample Number	Sample Location / Description	Volume, Area or Homogeneous Area	Date / Time Sampled (Air Monitoring Only)
GS-Rm1-M001A	Guard Shack, Room 1 / Off-white on drywall wall		9-Dec-25
GS-Rm1-PCB001A	Guard Shack, Room 1 / Off-white on drywall wall		9-Dec-25
GS-Rm1-ML001A	Guard Shack, Room 1 / Off-white on drywall wall	Hold for analysis	9-Dec-25
GS-Rm1-M001B	Guard Shack, Room 1 / Off-white on drywall wall		9-Dec-25
GS-Rm1-PCB001B	Guard Shack, Room 1 / Off-white on drywall wall		9-Dec-25
GS-Rm1-ML001B	Guard Shack, Room 1 / Off-white on drywall wall	Hold for analysis	9-Dec-25
GS-Rm1-M002A	Guard Shack, Room 1 / White on drywall wall		9-Dec-25
GS-Rm1-PCB002A	Guard Shack, Room 1 / White on drywall wall		9-Dec-25
GS-Rm1-ML002A	Guard Shack, Room 1 / White on drywall wall	Hold for analysis	9-Dec-25
GS-Rm2-M002B	Guard Shack, Room 2 / White on drywall wall		9-Dec-25
GS-Rm2-PCB002B	Guard Shack, Room 2 / White on drywall wall		9-Dec-25
GS-Rm2-ML002B	Guard Shack, Room 2 / White on drywall wall	Hold for analysis	9-Dec-25
GS-Ext-M003A	Guard Shack, Exterior / V. light brown on concrete eve		9-Dec-25
GS-Ext-PCB003A	Guard Shack, Exterior / V. light brown on concrete eve		9-Dec-25
GS-Ext-ML003A	Guard Shack, Exterior / V. light brown on concrete eve	Hold for analysis	9-Dec-25
GS-Ext-M003B	Guard Shack, Exterior / V. light brown on concrete foundation		9-Dec-25
GS-Ext-PCB003B	Guard Shack, Exterior / V. light brown on concrete foundation		9-Dec-25
GS-Ext-ML003B	Guard Shack, Exterior / V. light brown on concrete foundation	Hold for analysis	9-Dec-25
GS-Ext-M004A	Guard Shack, Exterior / V. light brown on concrete wall board		9-Dec-25
GS-Ext-PCB004A	Guard Shack, Exterior / V. light brown on concrete wall board		9-Dec-25
GS-Ext-ML004A	Guard Shack, Exterior / V. light brown on concrete wall board	Hold for analysis	9-Dec-25
GS-Ext-M004B	Guard Shack, Exterior / V. light brown on concrete wall board		9-Dec-25

Method of Shipment:

Sample Condition Upon Receipt:

Relinquished by:

Date/Time:

Received by:

Date/Time:

Relinquished by:

Date/Time:

Received by:

Date/Time:

Controlled Document - COC-17 One Chain EMSL R6 08/18/2025

☐ AGREE TO ELECTRONIC SIGNATURE (By checking, I consent to signing this Chain of Custody document by electronic signature.)

EMSL Analytical, Inc.'s Laboratory Terms and Conditions are incorporated into this Chain of Custody by reference in their entirety.
Submission of samples to EMSL Analytical, Inc. constitutes acceptance and acknowledgment of all terms and conditions by Customer.

**EMSL Canada Inc.**

2756 Slough Street, Mississauga, ON L4T 1G3

Phone/Fax: (289) 997-4602 / (289) 997-4607

<http://www.EMSL.com>torontolab@emsl.com

EMSL Canada Or 552522970
CustomerID: 55WSPN36
CustomerPO: TBD
ProjectID:

Attn: **Veronica Reid**
WSP Canada, Inc.
36 Pippy Place
Saint John's, NL A1B 4A5

Phone: (709) 722-7023
Fax:
Received: 12/23/2025 12:34 PM
Collected: 12/19/2025

Project: **CA0037087.2445 - Project NAVFAC Paint Sampling****Test Report: Lead in Paint Chips by Flame AAS (SW 846 3050B/7000B)***

<i>Client Sample</i>	<i>Description</i>	<i>Collected</i>	<i>Analyzed</i>	<i>Weight</i>	<i>RDL</i>	<i>Lead Concentration</i>
TE-Rm52-M001A 552522970-0001	12/16/2025 12/29/2025 Site: TE Bldg. Room 52 / Red flaking on concrete floor			0.2529 g	64 ppm	1800 ppm
TE-Rm52-M001B 552522970-0002	12/16/2025 12/29/2025 Site: TE Bldg. Room 52 / Red flaking on concrete floor			0.2504 g	64 ppm	2100 ppm
TE-Rm51-M002A 552522970-0003	12/16/2025 12/29/2025 Site: TE Bldg. Room 51 / Light blue on drywall wall			0.2592 g	64 ppm	1100 ppm
TE-Rm42-M002B 552522970-0004	12/16/2025 12/29/2025 Site: TE Bldg. Room 42 / Light blue on drywall wall			0.2551 g	64 ppm	130 ppm
TE-Rm46-M003A 552522970-0005	12/16/2025 12/29/2025 Site: TE Bldg. Room 46 / Light brown on drywall wal			0.2520 g	64 ppm	280 ppm
TE-Rm40-M003B 552522970-0006	12/16/2025 12/29/2025 Site: TE Bldg. Room 40 / Light brown on drywall wall			0.2515 g	64 ppm	3600 ppm
TE-Rm43-M004A 552522970-0007	12/17/2025 12/29/2025 Site: TE Bldg. Room 43 / Off-white on drywall wall			0.2518 g	64 ppm	970 ppm
TE-Rm43-M004B 552522970-0008	12/17/2025 12/29/2025 Site: TE Bldg. Room 43 / Off-white on drywall wall			0.2535 g	64 ppm	1700 ppm
TE-Rm7-M005A 552522970-0009	12/16/2025 12/29/2025 Site: TE Bldg. Room 7 / Blue on drywall wall			0.2587 g	64 ppm	<64 ppm
TE-Rm4-M005B 552522970-0010	12/16/2025 12/29/2025 Site: TE Bldg. Room 4 / Blue on drywall wall			0.2567 g	64 ppm	3800 ppm
TE-Rm10-M006A 552522970-0011	12/16/2025 12/29/2025 Site: TE Bldg. Room 10 / Greenish blue on drywall wall			0.2515 g	64 ppm	1600 ppm

Rowena Fanto, Lead Supervisor
or other approved signatory

EMSL maintains liability limited to cost of analysis. Interpretation and use of test results are the responsibility of the client. This report relates only to the samples reported above, and may not be reproduced, except in full, without written approval by EMSL. EMSL bears no responsibility for sample collection activities or analytical method limitations. The report reflects the samples as received. Results are generated from the field sampling data (sampling volumes and areas, locations, etc.) provided by the client on the Chain of Custody. Samples are within quality control criteria and met method specifications unless otherwise noted. * Analysis following Lead in Paint by EMSL SOP/Determination of Environmental Lead by FLAA. Reporting limit is 0.0064% wt based on the minimum sample weight per our SOP. "<" (less than) result signifies the analyte was not detected at or above the reporting limit. Measurement of uncertainty is available upon request. Definitions of modifications are available upon request.

Samples analyzed by EMSL Canada Inc. Mississauga, ON AIHA LAP, LLC-ELLAP Accredited #196142

Report Amended: 01/06/2026 09:26:26 Replaces Report Amended: 01/05/2026 16:01:54. Reason Code: unit change to ppm

**EMSL Canada Inc.**

2756 Slough Street, Mississauga, ON L4T 1G3

Phone/Fax: (289) 997-4602 / (289) 997-4607

<http://www.EMSL.com>torontolab@emsl.com

EMSL Canada Or 552522970
CustomerID: 55WSPN36
CustomerPO: TBD
ProjectID:

Attn: **Veronica Reid**
WSP Canada, Inc.
36 Pippy Place
Saint John's, NL A1B 4A5

Phone: (709) 722-7023
Fax:
Received: 12/23/2025 12:34 PM
Collected: 12/19/2025

Project: **CA0037087.2445 - Project NAVFAC Paint Sampling****Test Report: Lead in Paint Chips by Flame AAS (SW 846 3050B/7000B)***

<i>Client Sample</i>	<i>Description</i>	<i>Collected</i>	<i>Analyzed</i>	<i>Weight</i>	<i>RDL</i>	<i>Lead Concentration</i>
TE-Rm10-M006B 552522970-0012	12/16/2025 12/29/2025 Site: TE Bldg. Room 10 / Greenish blue on drywall wall			0.2549 g	64 ppm	370 ppm
TE-Rm65-M007A 552522970-0013	12/16/2025 12/29/2025 Site: TE Bldg. Room 65 / Yellow on drywall wall			0.2532 g	64 ppm	<64 ppm
TE-Rm65-M007B 552522970-0014	12/17/2025 12/29/2025 Site: TE Bldg. Room 65 / Yellow on drywall wall			0.2503 g	64 ppm	<64 ppm
TE-Rm67-M008A 552522970-0015	12/16/2025 12/29/2025 Site: TE Bldg. Room 67 / Light yellow on drywall wall			0.2508 g	64 ppm	1200 ppm
TE-Rm50-M008B 552522970-0016	12/17/2025 12/29/2025 Site: TE Bldg. Room 50 / Light yellow on drywall wall			0.2525 g	64 ppm	290 ppm
TE-Rm66-M009A 552522970-0017	12/16/2025 12/29/2025 Site: TE Bldg. Room 66 / Brownish-grey on drywall wall			0.2511 g	64 ppm	1900 ppm
TE-Rm66-M009B 552522970-0018	12/17/2025 12/29/2025 Site: TE Bldg. Room 66 / Brownish-grey on drywall wall			0.2554 g	64 ppm	1500 ppm
TE-Rm64-M010A 552522970-0019	12/16/2025 12/29/2025 Site: TE Bldg. Room 64 / Grey on drywall wall			0.2545 g	64 ppm	<64 ppm
TE-Rm64-M010B 552522970-0020	12/17/2025 12/29/2025 Site: TE Bldg. Room 64 / Grey on drywall wall			0.2504 g	64 ppm	87 ppm
TE-Rm68-M011A 552522970-0021	12/16/2025 12/29/2025 Site: TE Bldg. Room 68 / Light green on plaster			0.2525 g	64 ppm	360 ppm
TE-Rm68-M011B 552522970-0022	12/17/2025 12/29/2025 Site: TE Bldg. Room 68 / Light green on plaster			0.2561 g	64 ppm	260 ppm

Rowena Fanto, Lead Supervisor
or other approved signatory

EMSL maintains liability limited to cost of analysis. Interpretation and use of test results are the responsibility of the client. This report relates only to the samples reported above, and may not be reproduced, except in full, without written approval by EMSL. EMSL bears no responsibility for sample collection activities or analytical method limitations. The report reflects the samples as received. Results are generated from the field sampling data (sampling volumes and areas, locations, etc.) provided by the client on the Chain of Custody. Samples are within quality control criteria and met method specifications unless otherwise noted. * Analysis following Lead in Paint by EMSL SOP/Determination of Environmental Lead by FLAA. Reporting limit is 0.0064% wt based on the minimum sample weight per our SOP. "<" (less than) result signifies the analyte was not detected at or above the reporting limit. Measurement of uncertainty is available upon request. Definitions of modifications are available upon request.

Samples analyzed by EMSL Canada Inc. Mississauga, ON AIHA LAP, LLC-ELLAP Accredited #196142

Report Amended: 01/06/2026 09:26:26 Replaces Report Amended: 01/05/2026 16:01:54. Reason Code: unit change to ppm

**EMSL Canada Inc.**

2756 Slough Street, Mississauga, ON L4T 1G3

Phone/Fax: (289) 997-4602 / (289) 997-4607

<http://www.EMSL.com>torontolab@emsl.com

EMSL Canada Or 552522970
CustomerID: 55WSPN36
CustomerPO: TBD
ProjectID:

Attn: **Veronica Reid**
WSP Canada, Inc.
36 Pippy Place
Saint John's, NL A1B 4A5

Phone: (709) 722-7023
Fax:
Received: 12/23/2025 12:34 PM
Collected: 12/19/2025

Project: **CA0037087.2445 - Project NAVFAC Paint Sampling****Test Report: Lead in Paint Chips by Flame AAS (SW 846 3050B/7000B)***

<i>Client Sample</i>	<i>Description</i>	<i>Collected</i>	<i>Analyzed</i>	<i>Weight</i>	<i>RDL</i>	<i>Lead Concentration</i>
TE-Rm69-M012A 552522970-0023	12/16/2025 12/29/2025 Site: TE Bldg. Room 69 / Very light brown on plaster wall			0.2543 g	320 ppm	7100 ppm
TE-Rm53-M012B 552522970-0024	12/16/2025 12/29/2025 Site: TE Bldg. Room 53 / Very light brown on plaster wall			0.2514 g	130 ppm	4600 ppm
TE-Rm69-M013A 552522970-0025	12/16/2025 12/29/2025 Site: TE Bldg. Room 69 / Light brown on plaster wall			0.2576 g	130 ppm	4500 ppm
TE-Rm69-M013B 552522970-0026	12/17/2025 12/29/2025 Site: TE Bldg. Room 69 / Light brown on plaster wall			0.2502 g	64 ppm	3600 ppm
TE-Rm73-M014A 552522970-0027	12/16/2025 12/29/2025 Site: TE Bldg. Room 73 / Gloss white on drywall wall			0.2590 g	64 ppm	1100 ppm
TE-Rm73-M014B 552522970-0028	12/17/2025 12/29/2025 Site: TE Bldg. Room 73 / Gloss white on drywall wall			0.2502 g	64 ppm	<64 ppm
TE-Rm53-M015A 552522970-0029	12/16/2025 12/29/2025 Site: TE Bldg. Room 53 / Sky bue on drywall wall			0.2533 g	64 ppm	1200 ppm
TE-Rm72-M015B 552522970-0030	12/16/2025 12/29/2025 Site: TE Bldg. Room 72 / Sky bue on drywall wall			0.2512 g	64 ppm	1200 ppm
TE-Rm74-M016A 552522970-0031	12/16/2025 12/29/2025 Site: TE Bldg. Room 74 / Very light green on plaster wall			0.2592 g	64 ppm	3700 ppm
TE-Rm74-M016B 552522970-0032	12/17/2025 12/29/2025 Site: TE Bldg. Room 74 / Very light green on plaster wall			0.2553 g	320 ppm	6600 ppm
TE-Rm57-M017A 552522970-0033	12/16/2025 12/29/2025 Site: TE Bldg. Room 57 / Blue on drywall wall			0.2576 g	64 ppm	<64 ppm

Rowena Fanto, Lead Supervisor
or other approved signatory

EMSL maintains liability limited to cost of analysis. Interpretation and use of test results are the responsibility of the client. This report relates only to the samples reported above, and may not be reproduced, except in full, without written approval by EMSL. EMSL bears no responsibility for sample collection activities or analytical method limitations. The report reflects the samples as received. Results are generated from the field sampling data (sampling volumes and areas, locations, etc.) provided by the client on the Chain of Custody. Samples are within quality control criteria and met method specifications unless otherwise noted. * Analysis following Lead in Paint by EMSL SOP/Determination of Environmental Lead by FLAA. Reporting limit is 0.0064% wt based on the minimum sample weight per our SOP. "<" (less than) result signifies the analyte was not detected at or above the reporting limit. Measurement of uncertainty is available upon request. Definitions of modifications are available upon request.

Samples analyzed by EMSL Canada Inc. Mississauga, ON AIHA LAP, LLC-ELLAP Accredited #196142

Report Amended: 01/06/2026 09:26:26 Replaces Report Amended: 01/05/2026 16:01:54. Reason Code: unit change to ppm

**EMSL Canada Inc.**

2756 Slough Street, Mississauga, ON L4T 1G3

Phone/Fax: (289) 997-4602 / (289) 997-4607

<http://www.EMSL.com>torontolab@emsl.com

EMSL Canada Or 552522970
CustomerID: 55WSPN36
CustomerPO: TBD
ProjectID:

Attn: **Veronica Reid**
WSP Canada, Inc.
36 Pippy Place
Saint John's, NL A1B 4A5

Phone: (709) 722-7023
Fax:
Received: 12/23/2025 12:34 PM
Collected: 12/19/2025

Project: **CA0037087.2445 - Project NAVFAC Paint Sampling****Test Report: Lead in Paint Chips by Flame AAS (SW 846 3050B/7000B)***

<i>Client Sample</i>	<i>Description</i>	<i>Collected</i>	<i>Analyzed</i>	<i>Weight</i>	<i>RDL</i>	<i>Lead Concentration</i>
TE-Rm21-M017B 552522970-0034	12/16/2025 12/29/2025 Site: TE Bldg. Room 21 / Blue on drywall wall			0.2529 g	64 ppm	2700 ppm
TE-Rm40-M018A 552522970-0035	12/17/2025 12/29/2025 Site: TE Bldg. Room 40 / Grey on concrete floor			0.2537 g	64 ppm	790 ppm
TE-Rm40-M018B 552522970-0036	12/17/2025 12/29/2025 Site: TE Bldg. Room 40 / Grey on concrete floor			0.2541 g	64 ppm	680 ppm
TE-Rm25-M019A 552522970-0037	12/17/2025 12/29/2025 Site: TE Bldg. Room 25 / Bluish black on drywall ceiling			0.2535 g	64 ppm	330 ppm
TE-Rm23-M019B 552522970-0038	12/17/2025 12/29/2025 Site: TE Bldg. Room 23 / Bluish black on drywall ceiling			0.2514 g	64 ppm	380 ppm
TE-Ext-M020A 552522970-0039	12/17/2025 12/29/2025 Site: TE Bldg. Exterior / V. light brown on concrete wall			0.2512 g	64 ppm	1500 ppm
TE-Ext-M020B 552522970-0040	12/17/2025 12/29/2025 Site: TE Bldg. Exterior / V. light brown on concrete wall			0.2514 g	64 ppm	<64 ppm
TE-Ext-M021A 552522970-0041	12/17/2025 12/29/2025 Site: TE Bldg. Exterior / V. light brown on plywood wall			0.2563 g	64 ppm	<64 ppm
TE-Ext-M021B 552522970-0042	12/17/2025 12/29/2025 Site: TE Bldg. Exterior / V. light brown on plywood wall			0.2507 g	64 ppm	<64 ppm
TE-Ext-M022A 552522970-0043	12/17/2025 12/29/2025 Site: TE Bldg. Exterior / V. light brown on concrete wall board			0.2524 g	64 ppm	<64 ppm
TE-Ext-M022B 552522970-0044	12/17/2025 12/29/2025 Site: TE Bldg. Exterior / V. light brown on concrete wall board			0.2538 g	64 ppm	<64 ppm

Rowena Fanto, Lead Supervisor
or other approved signatory

EMSL maintains liability limited to cost of analysis. Interpretation and use of test results are the responsibility of the client. This report relates only to the samples reported above, and may not be reproduced, except in full, without written approval by EMSL. EMSL bears no responsibility for sample collection activities or analytical method limitations. The report reflects the samples as received. Results are generated from the field sampling data (sampling volumes and areas, locations, etc.) provided by the client on the Chain of Custody. Samples are within quality control criteria and met method specifications unless otherwise noted. * Analysis following Lead in Paint by EMSL SOP/Determination of Environmental Lead by FLAA. Reporting limit is 0.0064% wt based on the minimum sample weight per our SOP. "<" (less than) result signifies the analyte was not detected at or above the reporting limit. Measurement of uncertainty is available upon request. Definitions of modifications are available upon request.

Samples analyzed by EMSL Canada Inc. Mississauga, ON AIHA LAP, LLC-ELLAP Accredited #196142

Report Amended: 01/06/2026 09:26:26 Replaces Report Amended: 01/05/2026 16:01:54. Reason Code: unit change to ppm

**EMSL Canada Inc.**

2756 Slough Street, Mississauga, ON L4T 1G3

Phone/Fax: (289) 997-4602 / (289) 997-4607

<http://www.EMSL.com>torontolab@emsl.com

EMSL Canada Or 552522970

CustomerID: 55WSPN36

CustomerPO: TBD

ProjectID:

Attn: **Veronica Reid**
WSP Canada, Inc.
36 Pippy Place
Saint John's, NL A1B 4A5

Phone: (709) 722-7023
Fax:
Received: 12/23/2025 12:34 PM
Collected: 12/19/2025

Project: **CA0037087.2445 - Project NAVFAC Paint Sampling****Test Report: Lead in Paint Chips by Flame AAS (SW 846 3050B/7000B)***

<i>Client Sample</i>	<i>Description</i>	<i>Collected</i>	<i>Analyzed</i>	<i>Weight</i>	<i>RDL</i>	<i>Lead Concentration</i>
TE-Ext-M023A 552522970-0045	12/18/2025 12/29/2025 Site: TE Bldg. Exterior / V. light brown on metal pipe			0.2571 g	64 ppm	<64 ppm
TE-Ext-M023B 552522970-0046	12/18/2025 12/29/2025 Site: TE Bldg. Exterior / V. light brown on metal pipe			0.2517 g	64 ppm	800 ppm
TE-Rm73-M024A 552522970-0047	12/18/2025 12/29/2025 Site: TE Bldg. Room 73 / Dark grey on metal door and frame			0.2527 g	320 ppm	12000 ppm
TE-Rm63-M024B 552522970-0048	12/18/2025 12/29/2025 Site: TE Bldg. Room 63 / Dark grey on metal door and frame			0.2582 g	64 ppm	1100 ppm
TE-Rm63-M025A 552522970-0049	12/18/2025 12/29/2025 Site: TE Bldg. Room 63 / Brown on metal door and frame			0.2580 g	64 ppm	550 ppm
TE-Rm15-M025B 552522970-0050	12/18/2025 12/29/2025 Site: TE Bldg. Room 15 / Brown on metal door and frame			0.2556 g	64 ppm	670 ppm
TE-Rm27-M026A 552522970-0051	12/18/2025 12/29/2025 Site: TE Bldg. Room 27 / Black on metal door and frame			0.2556 g	6400 ppm	140000 ppm
TE-Rm30-M026B 552522970-0052	12/18/2025 12/29/2025 Site: TE Bldg. Room 30 / Black on metal door and frame			0.2586 g	3200 ppm	90000 ppm
TE-Rm47-M027A 552522970-0053	12/18/2025 12/29/2025 Site: TE Bldg. Room 47 / Green on metal door and frame			0.2532 g	320 ppm	12000 ppm
TE-Rm47-M027B 552522970-0054	12/18/2025 12/29/2025 Site: TE Bldg. Room 47 / Green on metal door and frame			0.2540 g	64 ppm	<64 ppm
TE-Rm52-M028A 552522970-0055	12/18/2025 12/29/2025 Site: TE Bldg. Room 52 / White on metal wall panels			0.2518 g	64 ppm	130 ppm

Rowena Fanto, Lead Supervisor
or other approved signatory

EMSL maintains liability limited to cost of analysis. Interpretation and use of test results are the responsibility of the client. This report relates only to the samples reported above, and may not be reproduced, except in full, without written approval by EMSL. EMSL bears no responsibility for sample collection activities or analytical method limitations. The report reflects the samples as received. Results are generated from the field sampling data (sampling volumes and areas, locations, etc.) provided by the client on the Chain of Custody. Samples are within quality control criteria and met method specifications unless otherwise noted. * Analysis following Lead in Paint by EMSL SOP/Determination of Environmental Lead by FLAA. Reporting limit is 0.0064% wt based on the minimum sample weight per our SOP. "<" (less than) result signifies the analyte was not detected at or above the reporting limit. Measurement of uncertainty is available upon request. Definitions of modifications are available upon request.

Samples analyzed by EMSL Canada Inc. Mississauga, ON AIHA LAP, LLC-ELLAP Accredited #196142

Report Amended: 01/06/2026 09:26:26 Replaces Report Amended: 01/05/2026 16:01:54. Reason Code: unit change to ppm

**EMSL Canada Inc.**

2756 Slough Street, Mississauga, ON L4T 1G3

Phone/Fax: (289) 997-4602 / (289) 997-4607

<http://www.EMSL.com>torontolab@emsl.com

EMSL Canada Or 552522970
CustomerID: 55WSPN36
CustomerPO: TBD
ProjectID:

Attn: **Veronica Reid**
WSP Canada, Inc.
36 Pippy Place
Saint John's, NL A1B 4A5

Phone: (709) 722-7023
Fax:
Received: 12/23/2025 12:34 PM
Collected: 12/19/2025

Project: **CA0037087.2445 - Project NAVFAC Paint Sampling****Test Report: Lead in Paint Chips by Flame AAS (SW 846 3050B/7000B)***

<i>Client Sample</i>	<i>Description</i>	<i>Collected</i>	<i>Analyzed</i>	<i>Weight</i>	<i>RDL</i>	<i>Lead Concentration</i>
TE-Rm52-M028B 552522970-0056	12/18/2025 12/29/2025 Site: TE Bldg. Room 52 / White on metal wall panels			0.2558 g	64 ppm	1800 ppm
TE-Rm52-M029A 552522970-0057	12/18/2025 12/29/2025 Site: TE Bldg. Room 52 / Light blue on metal wall panels			0.2553 g	130 ppm	4300 ppm
TE-Rm52-M029B 552522970-0058	12/18/2025 12/30/2025 Site: TE Bldg. Room 52 / Light blue on metal wall panels			0.2545 g	130 ppm	4500 ppm
TE-Rm51-M030A 552522970-0059	12/18/2025 12/30/2025 Site: TE Bldg. Room 51 / Black on concrete and metal pad			0.2571 g	130 ppm	5200 ppm
TE-Rm51-M030B 552522970-0060	12/18/2025 12/30/2025 Site: TE Bldg. Room 51 / Black on concrete and metal pad			0.2537 g	320 ppm	5800 ppm
TE-Rm45- M031A 552522970-0061	12/19/2025 12/30/2025 Site: TE Bldg. Room 45 / White on drywall wall			0.2557 g	64 ppm	<64 ppm
TE-Rm63- M031B 552522970-0062	12/19/2025 12/30/2025 Site: TE Bldg. Room 63 / White on drywall wall			0.2589 g	64 ppm	2300 ppm
TE-Rm51-M032A 552522970-0063	12/19/2025 12/30/2025 Site: TE Bldg. Room 51 / Light blue on pipe insulation and paper			0.2563 g	64 ppm	770 ppm
TE-Rm71-M032B 552522970-0064	12/19/2025 12/30/2025 Site: TE Bldg. Room 71 / Light blue on pipe insulation and paper			0.2540 g	64 ppm	<64 ppm
TE-Rm51-M033A 552522970-0065	12/19/2025 12/30/2025 Site: TE Bldg. Room 51 / White on pipe insulation and paper			0.2537 g	64 ppm	440 ppm
TE-Rm27-M033B 552522970-0066	12/18/2025 12/30/2025 Site: TE Bldg. Room 27 / White on pipe insulation and paper			0.2517 g	64 ppm	<64 ppm

Rowena Fanto, Lead Supervisor
or other approved signatory

EMSL maintains liability limited to cost of analysis. Interpretation and use of test results are the responsibility of the client. This report relates only to the samples reported above, and may not be reproduced, except in full, without written approval by EMSL. EMSL bears no responsibility for sample collection activities or analytical method limitations. The report reflects the samples as received. Results are generated from the field sampling data (sampling volumes and areas, locations, etc.) provided by the client on the Chain of Custody. Samples are within quality control criteria and met method specifications unless otherwise noted. * Analysis following Lead in Paint by EMSL SOP/Determination of Environmental Lead by FLAA. Reporting limit is 0.0064% wt based on the minimum sample weight per our SOP. "<" (less than) result signifies the analyte was not detected at or above the reporting limit. Measurement of uncertainty is available upon request. Definitions of modifications are available upon request.

Samples analyzed by EMSL Canada Inc. Mississauga, ON AIHA LAP, LLC-ELLAP Accredited #196142

Report Amended: 01/06/2026 09:26:26 Replaces Report Amended: 01/05/2026 16:01:54. Reason Code: unit change to ppm

**EMSL Canada Inc.**

2756 Slough Street, Mississauga, ON L4T 1G3

Phone/Fax: (289) 997-4602 / (289) 997-4607

<http://www.EMSL.com>torontolab@emsl.com

EMSL Canada Or 552522970
 CustomerID: 55WSPN36
 CustomerPO: TBD
 ProjectID:

Attn: **Veronica Reid**
WSP Canada, Inc.
36 Pippy Place
Saint John's, NL A1B 4A5

Phone: (709) 722-7023
 Fax:
 Received: 12/23/2025 12:34 PM
 Collected: 12/19/2025

Project: **CA0037087.2445 - Project NAVFAC Paint Sampling****Test Report: Lead in Paint Chips by Flame AAS (SW 846 3050B/7000B)***

<i>Client Sample</i>	<i>Description</i>	<i>Collected</i>	<i>Analyzed</i>	<i>Weight</i>	<i>RDL</i>	<i>Lead Concentration</i>
GB-Rm1-M001A 552522970-0067		12/9/2025	12/30/2025	0.2586 g	130 ppm	4500 ppm
	Site: Gen. Bldg. Room 1 / White on metal walls					
GB-Rm10-M001B 552522970-0068		12/9/2025	12/30/2025	0.2567 g	64 ppm	2200 ppm
	Site: Gen. Bldg. Room 10 / White on metal walls					
GB-Rm6-M002A 552522970-0069		12/9/2025	12/30/2025	0.2515 g	64 ppm	2100 ppm
	Site: Gen. Bldg. Room 6 / White on drywall walls					
GB-Rm9-M002B 552522970-0070		12/9/2025	12/30/2025	0.2587 g	64 ppm	<64 ppm
	Site: Gen. Bldg. Room 9 / White on drywall walls					
GB-Rm5-M003A 552522970-0071		12/9/2025	12/30/2025	0.2566 g	64 ppm	<64 ppm
	Site: Gen. Bldg. Room 5 / Beige on drywall walls					
GB-Rm5-M003B 552522970-0072		12/9/2025	12/30/2025	0.2580 g	64 ppm	<64 ppm
	Site: Gen. Bldg. Room 5 / Beige on drywall walls					
GB-Rm1-M004A 552522970-0073		12/9/2025	12/30/2025	0.2504 g	64 ppm	150 ppm
	Site: Gen. Bldg. Room 1 / White on concrete block walls					
GB-Rm1-M004B 552522970-0074		12/9/2025	12/30/2025	0.2533 g	64 ppm	320 ppm
	Site: Gen. Bldg. Room 1 / White on concrete block walls					
GB-Rm1-M005A 552522970-0075		12/9/2025	12/30/2025	0.2542 g	64 ppm	3000 ppm
	Site: Gen. Bldg. Room 1 / Black on concrete block walls					
GB-Rm1-M005B 552522970-0076		12/9/2025	12/30/2025	0.2503 g	64 ppm	3900 ppm
	Site: Gen. Bldg. Room 1 / Black on concrete block walls					
GB-Rm4-M006A 552522970-0077		12/12/2025	12/30/2025	0.2518 g	64 ppm	3200 ppm
	Site: Gen. Bldg. Room 4 / Black on drywall walls					

Rowena Fanto, Lead Supervisor
 or other approved signatory

EMSL maintains liability limited to cost of analysis. Interpretation and use of test results are the responsibility of the client. This report relates only to the samples reported above, and may not be reproduced, except in full, without written approval by EMSL. EMSL bears no responsibility for sample collection activities or analytical method limitations. The report reflects the samples as received. Results are generated from the field sampling data (sampling volumes and areas, locations, etc.) provided by the client on the Chain of Custody. Samples are within quality control criteria and met method specifications unless otherwise noted. * Analysis following Lead in Paint by EMSL SOP/Determination of Environmental Lead by FLAA. Reporting limit is 0.0064% wt based on the minimum sample weight per our SOP. "<" (less than) result signifies the analyte was not detected at or above the reporting limit. Measurement of uncertainty is available upon request. Definitions of modifications are available upon request.

Samples analyzed by EMSL Canada Inc. Mississauga, ON AIHA LAP, LLC-ELLAP Accredited #196142

Report Amended: 01/06/2026 09:26:26 Replaces Report Amended: 01/05/2026 16:01:54. Reason Code: unit change to ppm

**EMSL Canada Inc.**

2756 Slough Street, Mississauga, ON L4T 1G3

Phone/Fax: (289) 997-4602 / (289) 997-4607

<http://www.EMSL.com>torontolab@emsl.com

EMSL Canada Or 552522970
 CustomerID: 55WSPN36
 CustomerPO: TBD
 ProjectID:

Attn: **Veronica Reid**
WSP Canada, Inc.
36 Pippy Place
Saint John's, NL A1B 4A5

Phone: (709) 722-7023
 Fax:
 Received: 12/23/2025 12:34 PM
 Collected: 12/19/2025

Project: **CA0037087.2445 - Project NAVFAC Paint Sampling****Test Report: Lead in Paint Chips by Flame AAS (SW 846 3050B/7000B)***

<i>Client Sample</i>	<i>Description</i>	<i>Collected</i>	<i>Analyzed</i>	<i>Weight</i>	<i>RDL</i>	<i>Lead Concentration</i>
GB-Rm4-M006B 552522970-0078		12/12/2025	12/30/2025	0.2593 g	64 ppm	2600 ppm
	Site: Gen. Bldg. Room 4 / Black on drywall walls					
GB-Rm4-M007A 552522970-0079		12/12/2025	12/30/2025	0.2545 g	64 ppm	1300 ppm
	Site: Gen. Bldg. Room 4 / Red on concrete walls					
GB-Rm12-M007B 552522970-0080		12/12/2025	12/30/2025	0.2537 g	64 ppm	3100 ppm
	Site: Gen. Bldg. Room 12 / Red on concrete walls					
GB-Rm10-M008A 552522970-0081		12/12/2025	12/30/2025	0.2533 g	640 ppm	23000 ppm
	Site: Gen. Bldg. Room 10 / Light grey on metal generator housing					
GB-Rm10-M008B 552522970-0082		12/12/2025	12/30/2025	0.2564 g	1300 ppm	27000 ppm
	Site: Gen. Bldg. Room 10 / Light grey on metal generator housing					
GB-Rm10-M009A 552522970-0083		12/12/2025	12/30/2025	0.2511 g	64 ppm	2500 ppm
	Site: Gen. Bldg. Room 10 / Black on pipe insulation paper					
GB-Rm10-M009B 552522970-0084		12/12/2025	12/30/2025	0.2565 g	64 ppm	2900 ppm
	Site: Gen. Bldg. Room 10 / Black on pipe insulation paper					
GB-Rm10-M010A 552522970-0085		12/12/2025	12/30/2025	0.2588 g	64 ppm	830 ppm
	Site: Gen. Bldg. Room 10 / Light grey on metal pipe					
GB-Rm10-M010A 552522970-0086		12/12/2025	12/30/2025	0.2559 g	64 ppm	1100 ppm
	Site: Gen. Bldg. Room 10 / Light grey on metal pipe					
GB-Rm2-M011A 552522970-0087		12/12/2025	12/30/2025	0.2553 g	64 ppm	600 ppm
	Site: Gen. Bldg. Room 2 / Light grey on concrete floor					
GB-Rm2-M011B 552522970-0088		12/12/2025	12/30/2025	0.2557 g	64 ppm	860 ppm
	Site: Gen. Bldg. Room 2 / Light grey on concrete floor					

Rowena Fanto, Lead Supervisor
 or other approved signatory

EMSL maintains liability limited to cost of analysis. Interpretation and use of test results are the responsibility of the client. This report relates only to the samples reported above, and may not be reproduced, except in full, without written approval by EMSL. EMSL bears no responsibility for sample collection activities or analytical method limitations. The report reflects the samples as received. Results are generated from the field sampling data (sampling volumes and areas, locations, etc.) provided by the client on the Chain of Custody. Samples are within quality control criteria and met method specifications unless otherwise noted. * Analysis following Lead in Paint by EMSL SOP/Determination of Environmental Lead by FLAA. Reporting limit is 0.0064% wt based on the minimum sample weight per our SOP. "<" (less than) result signifies the analyte was not detected at or above the reporting limit. Measurement of uncertainty is available upon request. Definitions of modifications are available upon request.

Samples analyzed by EMSL Canada Inc. Mississauga, ON AIHA LAP, LLC-ELLAP Accredited #196142

Report Amended: 01/06/2026 09:26:26 Replaces Report Amended: 01/05/2026 16:01:54. Reason Code: unit change to ppm

**EMSL Canada Inc.**

2756 Slough Street, Mississauga, ON L4T 1G3

Phone/Fax: (289) 997-4602 / (289) 997-4607

<http://www.EMSL.com>torontolab@emsl.com

EMSL Canada Or 552522970
CustomerID: 55WSPN36
CustomerPO: TBD
ProjectID:

Attn: **Veronica Reid**
WSP Canada, Inc.
36 Pippy Place
Saint John's, NL A1B 4A5

Phone: (709) 722-7023
Fax:
Received: 12/23/2025 12:34 PM
Collected: 12/19/2025

Project: **CA0037087.2445 - Project NAVFAC Paint Sampling****Test Report: Lead in Paint Chips by Flame AAS (SW 846 3050B/7000B)***

<i>Client Sample</i>	<i>Description</i>	<i>Collected</i>	<i>Analyzed</i>	<i>Weight</i>	<i>RDL</i>	<i>Lead Concentration</i>
GB-Rm4-M012A 552522970-0089	12/15/2025 12/30/2025 Site: Gen. Bldg. Room 4 / Black on metal ceiling hangers			0.2553 g	64 ppm	3200 ppm
GB-Rm4-M012B 552522970-0090	12/15/2025 12/30/2025 Site: Gen. Bldg. Room 4 / Black on metal ceiling hangers			0.2532 g	130 ppm	4300 ppm
GB-Rm14-M013A 552522970-0091	12/15/2025 12/30/2025 Site: Gen. Bldg. Room 14 / Blue on metal door and frame			0.2577 g	64 ppm	1700 ppm
GB-Rm14-M013B 552522970-0092	12/15/2025 12/30/2025 Site: Gen. Bldg. Room 14 / Blue on metal door and frame			0.2540 g	64 ppm	1800 ppm
GB-Ext-M014A 552522970-0093	12/15/2025 12/30/2025 Site: Gen. Bldg. Exterior / V. light brown on concrete wall board			0.2575 g	64 ppm	<64 ppm
GB-Ext-M014B 552522970-0094	12/15/2025 12/30/2025 Site: Gen. Bldg. Exterior / V. light brown on concrete wall board			0.2561 g	64 ppm	<64 ppm
GB-Ext-M015A 552522970-0095	12/15/2025 12/30/2025 Site: Gen. Bldg. Exterior / V. light brown on concrete wall			0.2590 g	64 ppm	640 ppm
GB-Ext-M015B 552522970-0096	12/15/2025 12/30/2025 Site: Gen. Bldg. Exterior / V. light brown on concrete wall			0.2538 g	64 ppm	<64 ppm
GB-Ext-M016A 552522970-0097	12/15/2025 12/30/2025 Site: Gen. Bldg. Exterior / V. light brown on plywood wall			0.2535 g	64 ppm	<64 ppm
GB-Ext-M016B 552522970-0098	12/15/2025 12/30/2025 Site: Gen. Bldg. Exterior / V. light brown on plywood wall			0.2514 g	64 ppm	<64 ppm
GB-Ext-M017A 552522970-0099	12/15/2025 12/30/2025 Site: Gen. Bldg. Exterior / V. light brown on metal pipe			0.2572 g	64 ppm	900 ppm

Rowena Fanto, Lead Supervisor
or other approved signatory

EMSL maintains liability limited to cost of analysis. Interpretation and use of test results are the responsibility of the client. This report relates only to the samples reported above, and may not be reproduced, except in full, without written approval by EMSL. EMSL bears no responsibility for sample collection activities or analytical method limitations. The report reflects the samples as received. Results are generated from the field sampling data (sampling volumes and areas, locations, etc.) provided by the client on the Chain of Custody. Samples are within quality control criteria and met method specifications unless otherwise noted. * Analysis following Lead in Paint by EMSL SOP/Determination of Environmental Lead by FLAA. Reporting limit is 0.0064% wt based on the minimum sample weight per our SOP. "<" (less than) result signifies the analyte was not detected at or above the reporting limit. Measurement of uncertainty is available upon request. Definitions of modifications are available upon request.

Samples analyzed by EMSL Canada Inc. Mississauga, ON AIHA LAP, LLC-ELLAP Accredited #196142

Report Amended: 01/06/2026 09:26:26 Replaces Report Amended: 01/05/2026 16:01:54. Reason Code: unit change to ppm

**EMSL Canada Inc.**

2756 Slough Street, Mississauga, ON L4T 1G3

Phone/Fax: (289) 997-4602 / (289) 997-4607

<http://www.EMSL.com>torontolab@emsl.com

EMSL Canada Or 552522970
CustomerID: 55WSPN36
CustomerPO: TBD
ProjectID:

Attn: **Veronica Reid**
WSP Canada, Inc.
36 Pippy Place
Saint John's, NL A1B 4A5

Phone: (709) 722-7023
Fax:
Received: 12/23/2025 12:34 PM
Collected: 12/19/2025

Project: **CA0037087.2445 - Project NAVFAC Paint Sampling****Test Report: Lead in Paint Chips by Flame AAS (SW 846 3050B/7000B)***

<i>Client Sample</i>	<i>Description</i>	<i>Collected</i>	<i>Analyzed</i>	<i>Weight</i>	<i>RDL</i>	<i>Lead Concentration</i>
GB-Ext-M017B 552522970-0100	12/15/2025 12/30/2025 Site: Gen. Bldg. Exterior / V. light brown on metal pipe			0.2550 g	64 ppm	300 ppm
GS-Rm1-M001A 552522970-0101	12/9/2025 12/30/2025 Site: Guard Shack, Room 1 / Off-white on drywall wall			0.2531 g	64 ppm	280 ppm
GS-Rm1-M001B 552522970-0102	12/9/2025 12/30/2025 Site: Guard Shack, Room 1 / Off-white on drywall wall			0.2507 g	64 ppm	570 ppm
GS-Rm1-M002A 552522970-0103	12/9/2025 12/30/2025 Site: Guard Shack, Room 1 / White on drywall wall			0.2532 g	64 ppm	<64 ppm
GS-Rm2-M002B 552522970-0104	12/9/2025 12/30/2025 Site: Guard Shack, Room 2 / White on drywall wall			0.2536 g	64 ppm	<64 ppm
GS-Ext-M003A 552522970-0105	12/9/2025 12/30/2025 Site: Guard Shack, Exterior / V. light brown on concrete eve			0.2543 g	64 ppm	<64 ppm
GS-Ext-M003B 552522970-0106	12/9/2025 12/30/2025 Site: Guard Shack, Exterior / V. light brown on concrete foundation			0.2579 g	64 ppm	<64 ppm
GS-Ext-M004A 552522970-0107	12/9/2025 12/30/2025 Site: Guard Shack, Exterior / V. light brown on concrete wall board			0.2591 g	64 ppm	<64 ppm
GS-Ext-M004B 552522970-0108	12/9/2025 12/30/2025 Site: Guard Shack, Exterior / V. light brown on concrete wall board			0.2528 g	64 ppm	<64 ppm
GS-Ext-M005A 552522970-0109	12/9/2025 12/30/2025 Site: Guard Shack, Exterior / V. light brown on metal pipe			0.2510 g	64 ppm	680 ppm
GS-Ext-M005B 552522970-0110	12/9/2025 12/30/2025 Site: Guard Shack, Exterior / V. light brown on metal pipe			0.2593 g	64 ppm	1000 ppm

Rowena Fanto, Lead Supervisor
or other approved signatory

EMSL maintains liability limited to cost of analysis. Interpretation and use of test results are the responsibility of the client. This report relates only to the samples reported above, and may not be reproduced, except in full, without written approval by EMSL. EMSL bears no responsibility for sample collection activities or analytical method limitations. The report reflects the samples as received. Results are generated from the field sampling data (sampling volumes and areas, locations, etc.) provided by the client on the Chain of Custody. Samples are within quality control criteria and met method specifications unless otherwise noted. * Analysis following Lead in Paint by EMSL SOP/Determination of Environmental Lead by FLAA. Reporting limit is 0.0064% wt based on the minimum sample weight per our SOP. "<" (less than) result signifies the analyte was not detected at or above the reporting limit. Measurement of uncertainty is available upon request. Definitions of modifications are available upon request.

Samples analyzed by EMSL Canada Inc. Mississauga, ON AIHA LAP, LLC-ELLAP Accredited #196142

Report Amended: 01/06/2026 09:26:26 Replaces Report Amended: 01/05/2026 16:01:54. Reason Code: unit change to ppm



EMSL Canada Inc.

2756 Slough Street, Mississauga, ON L4T 1G3

Phone: (289) 997-4602 Fax: (289) 997-4607 Email: torontolab@emsl.com

Attn: **Veronica Reid**
WSP Canada, Inc.
36 Pippy Place
Saint John's, NL A1B 4A5
Phone: (709) 722-7023
Fax:

1/8/2026

The following analytical report covers the analysis performed on samples submitted to EMSL Canada Inc. on 12/23/2025. The results are tabulated on the attached data pages for the following client designated project:

CA0037087.2445 - Project NAVFAC Paint Sampling

The reference number for these samples is EMSL Order #552522970. Please use this reference when calling about these samples. If you have any questions, please do not hesitate to contact me at (289) 997-4602.

Approved By:

Rowena Fanto, Lead Supervisor

Samples analyzed by EMSL Canada Inc., Mississauga, ON
AIHA LAP, LLC #196142

The samples associated with this report were received in good condition unless otherwise noted. This report relates only to those items tested as received by the laboratory. The QC data associated with the sample results meet the recovery and precision requirements established by the AIHA, unless specifically indicated. The final results are not field blank corrected. The laboratory is not responsible for final results calculated using air volumes that have been provided by non-laboratory personnel. This report may not be reproduced except in full and without written approval by EMSL Analytical, Inc.

**EMSL Canada Inc.**

2756 Slough Street, Mississauga, ON L4T 1G3

Phone/Fax: (289) 997-4602 / (289) 997-4607

<http://www.EMSL.com>torontolab@emsl.com

EMSL Canada Or 552522970
CustomerID: 55WSPN36
CustomerPO: TBD
ProjectID:

Attn: **Veronica Reid**
WSP Canada, Inc.
36 Pippy Place
Saint John's, NL A1B 4A5

Phone: (709) 722-7023
Fax:
Received: 12/23/2025 12:34 PM
Collected: 12/19/2025

Project: CA0037087.2445 - Project NAVFAC Paint Sampling

Analytical Results

Client Sample Description TE-Rm52-M001A
TE Bldg. Room 52 / Red flaking on concrete floor
Collected: 12/16/2025
Lab ID: 552522970-0111

Method	Parameter	Result	RL	Units	Prep Date & Analyst	Analysis Date & Analyst
METALS						
Mercury by CVAA, SW-846-7471B	Mercury	0.89	0.050	mg/Kg	12/30/2025 RF	12/30/2025 RF

Client Sample Description TE-Rm52-M001B
TE Bldg. Room 52 / Red flaking on concrete floor
Collected: 12/16/2025
Lab ID: 552522970-0112

Method	Parameter	Result	RL	Units	Prep Date & Analyst	Analysis Date & Analyst
METALS						
Mercury by CVAA, SW-846-7471B	Mercury	0.53	0.050	mg/Kg	12/30/2025 RF	12/30/2025 RF

Client Sample Description TE-Rm51-M002A
TE Bldg. Room 51 / Light blue on drywall wall
Collected: 12/16/2025
Lab ID: 552522970-0113

Method	Parameter	Result	RL	Units	Prep Date & Analyst	Analysis Date & Analyst
METALS						
Mercury by CVAA, SW-846-7471B	Mercury	16 D	1.0	mg/Kg	12/30/2025 RF	12/30/2025 RF

Client Sample Description TE-Rm42-M002B
TE Bldg. Room 42 / Light blue on drywall wall
Collected: 12/16/2025
Lab ID: 552522970-0114

Method	Parameter	Result	RL	Units	Prep Date & Analyst	Analysis Date & Analyst
METALS						
Mercury by CVAA, SW-846-7471B	Mercury	29 D	1.0	mg/Kg	12/30/2025 RF	12/30/2025 RF

Client Sample Description TE-Rm46-M003A
TE Bldg. Room 46 / Light brown on drywall wal
Collected: 12/16/2025
Lab ID: 552522970-0115

Method	Parameter	Result	RL	Units	Prep Date & Analyst	Analysis Date & Analyst
METALS						
Mercury by CVAA, SW-846-7471B	Mercury	8.5 D	0.50	mg/Kg	12/30/2025 RF	12/30/2025 RF

**EMSL Canada Inc.**

2756 Slough Street, Mississauga, ON L4T 1G3

Phone/Fax: (289) 997-4602 / (289) 997-4607

<http://www.EMSL.com>torontolab@emsl.com

EMSL Canada Or 552522970
CustomerID: 55WSPN36
CustomerPO: TBD
ProjectID:

Attn: **Veronica Reid**
WSP Canada, Inc.
36 Pippy Place
Saint John's, NL A1B 4A5

Phone: (709) 722-7023
Fax:
Received: 12/23/2025 12:34 PM
Collected: 12/19/2025

Project: CA0037087.2445 - Project NAVFAC Paint Sampling

Analytical Results

Client Sample Description TE-Rm40-M003B
TE Bldg. Room 40 / Light brown on drywall wall
Collected: 12/16/2025
Lab ID: 552522970-0116

Method	Parameter	Result	RL	Units	Prep Date & Analyst	Analysis Date & Analyst
METALS						
Mercury by CVAA, SW-846-7471B	Mercury	39 D	2.0	mg/Kg	12/30/2025 RF	12/30/2025 RF

Client Sample Description TE-Rm43-M004A
TE Bldg. Room 43 / Off-white on drywall wall
Collected: 12/17/2025
Lab ID: 552522970-0117

Method	Parameter	Result	RL	Units	Prep Date & Analyst	Analysis Date & Analyst
METALS						
Mercury by CVAA, SW-846-7471B	Mercury	24 D	1.0	mg/Kg	12/30/2025 RF	12/30/2025 RF

Client Sample Description TE-Rm43-M004B
TE Bldg. Room 43 / Off-white on drywall wall
Collected: 12/17/2025
Lab ID: 552522970-0118

Method	Parameter	Result	RL	Units	Prep Date & Analyst	Analysis Date & Analyst
METALS						
Mercury by CVAA, SW-846-7471B	Mercury	24 D	1.0	mg/Kg	12/30/2025 RF	12/30/2025 RF

Client Sample Description TE-Rm7-M005A
TE Bldg. Room 7 / Blue on drywall wall
Collected: 12/16/2025
Lab ID: 552522970-0119

Method	Parameter	Result	RL	Units	Prep Date & Analyst	Analysis Date & Analyst
METALS						
Mercury by CVAA, SW-846-7471B	Mercury	0.15	0.050	mg/Kg	12/30/2025 RF	12/30/2025 RF

Client Sample Description TE-Rm4-M005B
TE Bldg. Room 4 / Blue on drywall wall
Collected: 12/16/2025
Lab ID: 552522970-0120

Method	Parameter	Result	RL	Units	Prep Date & Analyst	Analysis Date & Analyst
METALS						
Mercury by CVAA, SW-846-7471B	Mercury	2.0 D	0.10	mg/Kg	12/30/2025 RF	12/30/2025 RF

**EMSL Canada Inc.**

2756 Slough Street, Mississauga, ON L4T 1G3

Phone/Fax: (289) 997-4602 / (289) 997-4607

<http://www.EMSL.com>torontolab@emsl.com

EMSL Canada Or 552522970
CustomerID: 55WSPN36
CustomerPO: TBD
ProjectID:

Attn: **Veronica Reid**
WSP Canada, Inc.
36 Pippy Place
Saint John's, NL A1B 4A5

Phone: (709) 722-7023
Fax:
Received: 12/23/2025 12:34 PM
Collected: 12/19/2025

Project: CA0037087.2445 - Project NAVFAC Paint Sampling

Analytical Results

Client Sample Description TE-Rm10-M006A
TE Bldg. Room 10 / Greenish blue on drywall wall
Collected: 12/16/2025
Lab ID: 552522970-0121

Method	Parameter	Result	RL	Units	Prep Date & Analyst	Analysis Date & Analyst
METALS						
Mercury by CVAA, SW-846-7471B	Mercury	14 D	1.0	mg/Kg	12/30/2025 RF	12/30/2025 RF

Client Sample Description TE-Rm10-M006B
TE Bldg. Room 10 / Greenish blue on drywall wall
Collected: 12/16/2025
Lab ID: 552522970-0122

Method	Parameter	Result	RL	Units	Prep Date & Analyst	Analysis Date & Analyst
METALS						
Mercury by CVAA, SW-846-7471B	Mercury	30 D	1.0	mg/Kg	12/30/2025 RF	12/30/2025 RF

Client Sample Description TE-Rm65-M007A
TE Bldg. Room 65 / Yellow on drywall wall
Collected: 12/16/2025
Lab ID: 552522970-0123

Method	Parameter	Result	RL	Units	Prep Date & Analyst	Analysis Date & Analyst
METALS						
Mercury by CVAA, SW-846-7471B	Mercury	7.0 D	0.50	mg/Kg	12/30/2025 RF	12/30/2025 RF

Client Sample Description TE-Rm65-M007B
TE Bldg. Room 65 / Yellow on drywall wall
Collected: 12/17/2025
Lab ID: 552522970-0124

Method	Parameter	Result	RL	Units	Prep Date & Analyst	Analysis Date & Analyst
METALS						
Mercury by CVAA, SW-846-7471B	Mercury	3.2 D	0.25	mg/Kg	12/30/2025 RF	12/30/2025 RF

Client Sample Description TE-Rm67-M008A
TE Bldg. Room 67 / Light yellow on drywall wall
Collected: 12/16/2025
Lab ID: 552522970-0125

Method	Parameter	Result	RL	Units	Prep Date & Analyst	Analysis Date & Analyst
METALS						
Mercury by CVAA, SW-846-7471B	Mercury	5.2 D	0.25	mg/Kg	12/30/2025 RF	12/30/2025 RF

**EMSL Canada Inc.**

2756 Slough Street, Mississauga, ON L4T 1G3

Phone/Fax: (289) 997-4602 / (289) 997-4607

<http://www.EMSL.com>torontolab@emsl.com

EMSL Canada Or 552522970
CustomerID: 55WSPN36
CustomerPO: TBD
ProjectID:

Attn: **Veronica Reid**
WSP Canada, Inc.
36 Pippy Place
Saint John's, NL A1B 4A5

Phone: (709) 722-7023
Fax:
Received: 12/23/2025 12:34 PM
Collected: 12/19/2025

Project: CA0037087.2445 - Project NAVFAC Paint Sampling

Analytical Results

Client Sample Description TE-Rm50-M008B
TE Bldg. Room 50 / Light yellow on drywall wall
Collected: 12/17/2025
Lab ID: 552522970-0126

Method	Parameter	Result	RL	Units	Prep Date & Analyst	Analysis Date & Analyst
METALS						
Mercury by CVAA, SW-846-7471B	Mercury	21 D	1.0	mg/Kg	12/30/2025 RF	12/30/2025 RF

Client Sample Description TE-Rm66-M009A
TE Bldg. Room 66 / Brownish-grey on drywall wall
Collected: 12/16/2025
Lab ID: 552522970-0127

Method	Parameter	Result	RL	Units	Prep Date & Analyst	Analysis Date & Analyst
METALS						
Mercury by CVAA, SW-846-7471B	Mercury	1.8 D	0.10	mg/Kg	12/30/2025 RF	12/30/2025 RF

Client Sample Description TE-Rm66-M009B
TE Bldg. Room 66 / Brownish-grey on drywall wall
Collected: 12/17/2025
Lab ID: 552522970-0128

Method	Parameter	Result	RL	Units	Prep Date & Analyst	Analysis Date & Analyst
METALS						
Mercury by CVAA, SW-846-7471B	Mercury	0.75	0.050	mg/Kg	12/30/2025 RF	12/30/2025 RF

Client Sample Description TE-Rm64-M010A
TE Bldg. Room 64 / Grey on drywall wall
Collected: 12/16/2025
Lab ID: 552522970-0129

Method	Parameter	Result	RL	Units	Prep Date & Analyst	Analysis Date & Analyst
METALS						
Mercury by CVAA, SW-846-7471B	Mercury	5.2 D	0.25	mg/Kg	12/30/2025 RF	12/30/2025 RF

Client Sample Description TE-Rm64-M010B
TE Bldg. Room 64 / Grey on drywall wall
Collected: 12/17/2025
Lab ID: 552522970-0130

Method	Parameter	Result	RL	Units	Prep Date & Analyst	Analysis Date & Analyst
METALS						
Mercury by CVAA, SW-846-7471B	Mercury	11 D	0.50	mg/Kg	12/30/2025 RF	12/30/2025 RF

**EMSL Canada Inc.**

2756 Slough Street, Mississauga, ON L4T 1G3

Phone/Fax: (289) 997-4602 / (289) 997-4607

<http://www.EMSL.com>torontolab@emsl.com

EMSL Canada Or 552522970
CustomerID: 55WSPN36
CustomerPO: TBD
ProjectID:

Attn: **Veronica Reid**
WSP Canada, Inc.
36 Pippy Place
Saint John's, NL A1B 4A5

Phone: (709) 722-7023
Fax:
Received: 12/23/2025 12:34 PM
Collected: 12/19/2025

Project: CA0037087.2445 - Project NAVFAC Paint Sampling

Analytical Results

Client Sample Description TE-Rm68-M011A
TE Bldg. Room 68 / Light green on plaster
Collected: 12/16/2025
Lab ID: 552522970-0131

Method	Parameter	Result	RL	Units	Prep Date & Analyst	Analysis Date & Analyst
METALS						
Mercury by CVAA, SW-846-7471B	Mercury	39 D	2.5	mg/Kg		1/2/2026 RF

Client Sample Description TE-Rm68-M011B
TE Bldg. Room 68 / Light green on plaster
Collected: 12/17/2025
Lab ID: 552522970-0132

Method	Parameter	Result	RL	Units	Prep Date & Analyst	Analysis Date & Analyst
METALS						
Mercury by CVAA, SW-846-7471B	Mercury	44 D	2.5	mg/Kg		1/2/2026 RF

Client Sample Description TE-Rm69-M012A
TE Bldg. Room 69 / Very light brown on plaster wall
Collected: 12/16/2025
Lab ID: 552522970-0133

Method	Parameter	Result	RL	Units	Prep Date & Analyst	Analysis Date & Analyst
METALS						
Mercury by CVAA, SW-846-7471B	Mercury	4.2 D	0.25	mg/Kg		1/2/2026 RF

Client Sample Description TE-Rm53-M012B
TE Bldg. Room 53 / Very light brown on plaster wall
Collected: 12/16/2025
Lab ID: 552522970-0134

Method	Parameter	Result	RL	Units	Prep Date & Analyst	Analysis Date & Analyst
METALS						
Mercury by CVAA, SW-846-7471B	Mercury	3.9 D	0.25	mg/Kg		1/2/2026 RF

Client Sample Description TE-Rm69-M013A
TE Bldg. Room 69 / Light brown on plaster wall
Collected: 12/16/2025
Lab ID: 552522970-0135

Method	Parameter	Result	RL	Units	Prep Date & Analyst	Analysis Date & Analyst
METALS						
Mercury by CVAA, SW-846-7471B	Mercury	2.2 D	0.10	mg/Kg		1/2/2026 RF

**EMSL Canada Inc.**

2756 Slough Street, Mississauga, ON L4T 1G3

Phone/Fax: (289) 997-4602 / (289) 997-4607

<http://www.EMSL.com>torontolab@emsl.com

EMSL Canada Or 552522970
CustomerID: 55WSPN36
CustomerPO: TBD
ProjectID:

Attn: **Veronica Reid**
WSP Canada, Inc.
36 Pippy Place
Saint John's, NL A1B 4A5

Phone: (709) 722-7023
Fax:
Received: 12/23/2025 12:34 PM
Collected: 12/19/2025

Project: CA0037087.2445 - Project NAVFAC Paint Sampling

Analytical Results

Client Sample Description		TE-Rm69-M013B TE Bldg. Room 69 / Light brown on plaster wall	Collected: 12/17/2025		Lab ID: 552522970-0136	
Method	Parameter	Result	RL	Units	Prep Date & Analyst	Analysis Date & Analyst
METALS						
Mercury by CVAA, SW-846-7471B	Mercury	1.7 D	0.10	mg/Kg		1/2/2026 RF
Client Sample Description		TE-Rm73-M014A TE Bldg. Room 73 / Gloss white on drywall wall	Collected: 12/16/2025		Lab ID: 552522970-0137	
Method	Parameter	Result	RL	Units	Prep Date & Analyst	Analysis Date & Analyst
METALS						
Mercury by CVAA, SW-846-7471B	Mercury	0.57	0.050	mg/Kg		1/2/2026 RF
Client Sample Description		TE-Rm73-M014B TE Bldg. Room 73 / Gloss white on drywall wall	Collected: 12/17/2025		Lab ID: 552522970-0138	
Method	Parameter	Result	RL	Units	Prep Date & Analyst	Analysis Date & Analyst
METALS						
Mercury by CVAA, SW-846-7471B	Mercury	0.12	0.050	mg/Kg		1/2/2026 RF
Client Sample Description		TE-Rm53-M015A TE Bldg. Room 53 / Sky bue on drywall wall	Collected: 12/16/2025		Lab ID: 552522970-0139	
Method	Parameter	Result	RL	Units	Prep Date & Analyst	Analysis Date & Analyst
METALS						
Mercury by CVAA, SW-846-7471B	Mercury	6.7 D	0.50	mg/Kg		1/2/2026 RF
Client Sample Description		TE-Rm72-M015B TE Bldg. Room 72 / Sky bue on drywall wall	Collected: 12/16/2025		Lab ID: 552522970-0140	
Method	Parameter	Result	RL	Units	Prep Date & Analyst	Analysis Date & Analyst
METALS						
Mercury by CVAA, SW-846-7471B	Mercury	7.6 D	0.50	mg/Kg		1/2/2026 RF

**EMSL Canada Inc.**

2756 Slough Street, Mississauga, ON L4T 1G3

Phone/Fax: (289) 997-4602 / (289) 997-4607

<http://www.EMSL.com>torontolab@emsl.com

EMSL Canada Or 552522970
CustomerID: 55WSPN36
CustomerPO: TBD
ProjectID:

Attn: **Veronica Reid**
WSP Canada, Inc.
36 Pippy Place
Saint John's, NL A1B 4A5

Phone: (709) 722-7023
Fax:
Received: 12/23/2025 12:34 PM
Collected: 12/19/2025

Project: CA0037087.2445 - Project NAVFAC Paint Sampling

Analytical Results

Client Sample Description TE-Rm74-M016A
TE Bldg. Room 74 / Very light green on plaster wall
Collected: 12/16/2025
Lab ID: 552522970-0141

Method	Parameter	Result	RL	Units	Prep Date & Analyst	Analysis Date & Analyst
METALS						
Mercury by CVAA, SW-846-7471B	Mercury	8.7 D	0.50	mg/Kg		1/2/2026 RF

Client Sample Description TE-Rm74-M016B
TE Bldg. Room 74 / Very light green on plaster wall
Collected: 12/17/2025
Lab ID: 552522970-0142

Method	Parameter	Result	RL	Units	Prep Date & Analyst	Analysis Date & Analyst
METALS						
Mercury by CVAA, SW-846-7471B	Mercury	9.6 D	0.50	mg/Kg		1/2/2026 RF

Client Sample Description TE-Rm57-M017A
TE Bldg. Room 57 / Blue on drywall wall
Collected: 12/16/2025
Lab ID: 552522970-0143

Method	Parameter	Result	RL	Units	Prep Date & Analyst	Analysis Date & Analyst
METALS						
Mercury by CVAA, SW-846-7471B	Mercury	17 D	2.5	mg/Kg		1/2/2026 RF

Client Sample Description TE-Rm21-M017B
TE Bldg. Room 21 / Blue on drywall wall
Collected: 12/16/2025
Lab ID: 552522970-0144

Method	Parameter	Result	RL	Units	Prep Date & Analyst	Analysis Date & Analyst
METALS						
Mercury by CVAA, SW-846-7471B	Mercury	1.3	0.050	mg/Kg		1/2/2026 RF

Client Sample Description TE-Rm40-M018A
TE Bldg. Room 40 / Grey on concrete floor
Collected: 12/17/2025
Lab ID: 552522970-0145

Method	Parameter	Result	RL	Units	Prep Date & Analyst	Analysis Date & Analyst
METALS						
Mercury by CVAA, SW-846-7471B	Mercury	0.36	0.050	mg/Kg		1/2/2026 RF

**EMSL Canada Inc.**

2756 Slough Street, Mississauga, ON L4T 1G3

Phone/Fax: (289) 997-4602 / (289) 997-4607

<http://www.EMSL.com>torontolab@emsl.com

EMSL Canada Or 552522970
CustomerID: 55WSPN36
CustomerPO: TBD
ProjectID:

Attn: **Veronica Reid**
WSP Canada, Inc.
36 Pippy Place
Saint John's, NL A1B 4A5

Phone: (709) 722-7023
Fax:
Received: 12/23/2025 12:34 PM
Collected: 12/19/2025

Project: CA0037087.2445 - Project NAVFAC Paint Sampling

Analytical Results

Client Sample Description TE-Rm40-M018B
TE Bldg. Room 40 / Grey on concrete floor
Collected: 12/17/2025
Lab ID: 552522970-0146

Method	Parameter	Result	RL	Units	Prep Date & Analyst	Analysis Date & Analyst
METALS						
Mercury by CVAA, SW-846-7471B	Mercury	0.29	0.050	mg/Kg		1/2/2026 RF

Client Sample Description TE-Rm25-M019A
TE Bldg. Room 25 / Bluish black on drywall ceiling
Collected: 12/17/2025
Lab ID: 552522970-0147

Method	Parameter	Result	RL	Units	Prep Date & Analyst	Analysis Date & Analyst
METALS						
Mercury by CVAA, SW-846-7471B	Mercury	2.9 D	0.25	mg/Kg		1/2/2026 RF

Client Sample Description TE-Rm23-M019B
TE Bldg. Room 23 / Bluish black on drywall ceiling
Collected: 12/17/2025
Lab ID: 552522970-0148

Method	Parameter	Result	RL	Units	Prep Date & Analyst	Analysis Date & Analyst
METALS						
Mercury by CVAA, SW-846-7471B	Mercury	3.3 D	0.25	mg/Kg		1/2/2026 RF

Client Sample Description TE-Ext-M020A
TE Bldg. Exterior / V. light brown on concrete wall
Collected: 12/17/2025
Lab ID: 552522970-0149

Method	Parameter	Result	RL	Units	Prep Date & Analyst	Analysis Date & Analyst
METALS						
Mercury by CVAA, SW-846-7471B	Mercury	0.10	0.050	mg/Kg		1/2/2026 RF

Client Sample Description TE-Ext-M020B
TE Bldg. Exterior / V. light brown on concrete wall
Collected: 12/17/2025
Lab ID: 552522970-0150

Method	Parameter	Result	RL	Units	Prep Date & Analyst	Analysis Date & Analyst
METALS						
Mercury by CVAA, SW-846-7471B	Mercury	ND	0.050	mg/Kg		1/2/2026 RF

**EMSL Canada Inc.**

2756 Slough Street, Mississauga, ON L4T 1G3

Phone/Fax: (289) 997-4602 / (289) 997-4607

<http://www.EMSL.com>torontolab@emsl.com

EMSL Canada Or 552522970
CustomerID: 55WSPN36
CustomerPO: TBD
ProjectID:

Attn: **Veronica Reid**
WSP Canada, Inc.
36 Pippy Place
Saint John's, NL A1B 4A5

Phone: (709) 722-7023
Fax:
Received: 12/23/2025 12:34 PM
Collected: 12/19/2025

Project: CA0037087.2445 - Project NAVFAC Paint Sampling

Analytical Results

Client Sample Description TE-Ext-M021A
TE Bldg. Exterior / V. light brown on plywood wall
Collected: 12/17/2025
Lab ID: 552522970-0151

Method	Parameter	Result	RL	Units	Prep Date & Analyst	Analysis Date & Analyst
METALS						
Mercury by CVAA, SW-846-7471B	Mercury	ND	0.050	mg/Kg		1/2/2026 RF

Client Sample Description TE-Ext-M021B
TE Bldg. Exterior / V. light brown on plywood wall
Collected: 12/17/2025
Lab ID: 552522970-0152

Method	Parameter	Result	RL	Units	Prep Date & Analyst	Analysis Date & Analyst
METALS						
Mercury by CVAA, SW-846-7471B	Mercury	ND	0.050	mg/Kg		1/2/2026 RF

Client Sample Description TE-Ext-M022A
TE Bldg. Exterior / V. light brown on concrete wall board
Collected: 12/17/2025
Lab ID: 552522970-0153

Method	Parameter	Result	RL	Units	Prep Date & Analyst	Analysis Date & Analyst
METALS						
Mercury by CVAA, SW-846-7471B	Mercury	3.8 D	0.25	mg/Kg		1/2/2026 RF

Client Sample Description TE-Ext-M022B
TE Bldg. Exterior / V. light brown on concrete wall board
Collected: 12/17/2025
Lab ID: 552522970-0154

Method	Parameter	Result	RL	Units	Prep Date & Analyst	Analysis Date & Analyst
METALS						
Mercury by CVAA, SW-846-7471B	Mercury	ND	0.050	mg/Kg		1/2/2026 RF

Client Sample Description TE-Ext-M023A
TE Bldg. Exterior / V. light brown on metal pipe
Collected: 12/18/2025
Lab ID: 552522970-0155

Method	Parameter	Result	RL	Units	Prep Date & Analyst	Analysis Date & Analyst
METALS						
Mercury by CVAA, SW-846-7471B	Mercury	ND	0.050	mg/Kg		1/2/2026 RF

**EMSL Canada Inc.**

2756 Slough Street, Mississauga, ON L4T 1G3

Phone/Fax: (289) 997-4602 / (289) 997-4607

<http://www.EMSL.com>torontolab@emsl.com

EMSL Canada Or 552522970
CustomerID: 55WSPN36
CustomerPO: TBD
ProjectID:

Attn: **Veronica Reid**
WSP Canada, Inc.
36 Pippy Place
Saint John's, NL A1B 4A5

Phone: (709) 722-7023
Fax:
Received: 12/23/2025 12:34 PM
Collected: 12/19/2025

Project: CA0037087.2445 - Project NAVFAC Paint Sampling

Analytical Results

Client Sample Description TE-Ext-M023B
TE Bldg. Exterior / V. light brown on metal pipe
Collected: 12/18/2025
Lab ID: 552522970-0156

Method	Parameter	Result	RL	Units	Prep Date & Analyst	Analysis Date & Analyst
METALS						
Mercury by CVAA, SW-846-7471B	Mercury	ND	0.050	mg/Kg	1/2/2026	RF

Client Sample Description TE-Rm73-M024A
TE Bldg. Room 73 / Dark grey on metal door and frame
Collected: 12/18/2025
Lab ID: 552522970-0157

Method	Parameter	Result	RL	Units	Prep Date & Analyst	Analysis Date & Analyst
METALS						
Mercury by CVAA, SW-846-7471B	Mercury	0.78	0.050	mg/Kg	1/2/2026	RF

Client Sample Description TE-Rm63-M024B
TE Bldg. Room 63 / Dark grey on metal door and frame
Collected: 12/18/2025
Lab ID: 552522970-0158

Method	Parameter	Result	RL	Units	Prep Date & Analyst	Analysis Date & Analyst
METALS						
Mercury by CVAA, SW-846-7471B	Mercury	3.3 D	0.25	mg/Kg	1/2/2026	RF

Client Sample Description TE-Rm63-M025A
TE Bldg. Room 63 / Brown on metal door and frame
Collected: 12/18/2025
Lab ID: 552522970-0159

Method	Parameter	Result	RL	Units	Prep Date & Analyst	Analysis Date & Analyst
METALS						
Mercury by CVAA, SW-846-7471B	Mercury	3.9 D	0.25	mg/Kg	1/2/2026	RF

Client Sample Description TE-Rm15-M025B
TE Bldg. Room 15 / Brown on metal door and frame
Collected: 12/18/2025
Lab ID: 552522970-0160

Method	Parameter	Result	RL	Units	Prep Date & Analyst	Analysis Date & Analyst
METALS						
Mercury by CVAA, SW-846-7471B	Mercury	3.5 D	0.25	mg/Kg	1/2/2026	RF

**EMSL Canada Inc.**

2756 Slough Street, Mississauga, ON L4T 1G3

Phone/Fax: (289) 997-4602 / (289) 997-4607

<http://www.EMSL.com>torontolab@emsl.com

EMSL Canada Or 552522970
CustomerID: 55WSPN36
CustomerPO: TBD
ProjectID:

Attn: **Veronica Reid**
WSP Canada, Inc.
36 Pippy Place
Saint John's, NL A1B 4A5

Phone: (709) 722-7023
Fax:
Received: 12/23/2025 12:34 PM
Collected: 12/19/2025

Project: CA0037087.2445 - Project NAVFAC Paint Sampling

Analytical Results

Client Sample Description TE-Rm27-M026A
TE Bldg. Room 27 / Black on metal door and frame
Collected: 12/18/2025
Lab ID: 552522970-0161

Method	Parameter	Result	RL	Units	Prep Date & Analyst	Analysis Date & Analyst
METALS						
Mercury by CVAA, SW-846-7471B	Mercury	4.7 D	0.25	mg/Kg		1/2/2026 RF

Client Sample Description TE-Rm30-M026B
TE Bldg. Room 30 / Black on metal door and frame
Collected: 12/18/2025
Lab ID: 552522970-0162

Method	Parameter	Result	RL	Units	Prep Date & Analyst	Analysis Date & Analyst
METALS						
Mercury by CVAA, SW-846-7471B	Mercury	7.5 D	0.50	mg/Kg		1/2/2026 RF

Client Sample Description TE-Rm47-M027A
TE Bldg. Room 47 / Green on metal door and frame
Collected: 12/18/2025
Lab ID: 552522970-0163

Method	Parameter	Result	RL	Units	Prep Date & Analyst	Analysis Date & Analyst
METALS						
Mercury by CVAA, SW-846-7471B	Mercury	5.3 D	0.25	mg/Kg		1/2/2026 RF

Client Sample Description TE-Rm47-M027B
TE Bldg. Room 47 / Green on metal door and frame
Collected: 12/18/2025
Lab ID: 552522970-0164

Method	Parameter	Result	RL	Units	Prep Date & Analyst	Analysis Date & Analyst
METALS						
Mercury by CVAA, SW-846-7471B	Mercury	0.51	0.050	mg/Kg		1/2/2026 RF

Client Sample Description TE-Rm52-M028A
TE Bldg. Room 52 / White on metal wall panels
Collected: 12/18/2025
Lab ID: 552522970-0165

Method	Parameter	Result	RL	Units	Prep Date & Analyst	Analysis Date & Analyst
METALS						
Mercury by CVAA, SW-846-7471B	Mercury	3.6 D	0.25	mg/Kg		1/2/2026 RF

**EMSL Canada Inc.**

2756 Slough Street, Mississauga, ON L4T 1G3

Phone/Fax: (289) 997-4602 / (289) 997-4607

<http://www.EMSL.com>torontolab@emsl.com

EMSL Canada Or 552522970
CustomerID: 55WSPN36
CustomerPO: TBD
ProjectID:

Attn: **Veronica Reid**
WSP Canada, Inc.
36 Pippy Place
Saint John's, NL A1B 4A5

Phone: (709) 722-7023
Fax:
Received: 12/23/2025 12:34 PM
Collected: 12/19/2025

Project: CA0037087.2445 - Project NAVFAC Paint Sampling

Analytical Results

Client Sample Description TE-Rm52-M028B
TE Bldg. Room 52 / White on metal wall panels
Collected: 12/18/2025
Lab ID: 552522970-0166

Method	Parameter	Result	RL	Units	Prep Date & Analyst	Analysis Date & Analyst
METALS						
Mercury by CVAA, SW-846-7471B	Mercury	6.6 D	0.50	mg/Kg		1/2/2026 RF

Client Sample Description TE-Rm52-M029A
TE Bldg. Room 52 / Light blue on metal wall panels
Collected: 12/18/2025
Lab ID: 552522970-0167

Method	Parameter	Result	RL	Units	Prep Date & Analyst	Analysis Date & Analyst
METALS						
Mercury by CVAA, SW-846-7471B	Mercury	4.9 D	0.25	mg/Kg		1/2/2026 RF

Client Sample Description TE-Rm52-M029B
TE Bldg. Room 52 / Light blue on metal wall panels
Collected: 12/18/2025
Lab ID: 552522970-0168

Method	Parameter	Result	RL	Units	Prep Date & Analyst	Analysis Date & Analyst
METALS						
Mercury by CVAA, SW-846-7471B	Mercury	2.7 D	0.25	mg/Kg		1/2/2026 RF

Client Sample Description TE-Rm51-M030A
TE Bldg. Room 51 / Black on concrete and metal pad
Collected: 12/18/2025
Lab ID: 552522970-0169

Method	Parameter	Result	RL	Units	Prep Date & Analyst	Analysis Date & Analyst
METALS						
Mercury by CVAA, SW-846-7471B	Mercury	22 D	2.5	mg/Kg		1/2/2026 RF

Client Sample Description TE-Rm51-M030B
TE Bldg. Room 51 / Black on concrete and metal pad
Collected: 12/18/2025
Lab ID: 552522970-0170

Method	Parameter	Result	RL	Units	Prep Date & Analyst	Analysis Date & Analyst
METALS						
Mercury by CVAA, SW-846-7471B	Mercury	7.2 D	0.50	mg/Kg		1/2/2026 RF

**EMSL Canada Inc.**

2756 Slough Street, Mississauga, ON L4T 1G3

Phone/Fax: (289) 997-4602 / (289) 997-4607

<http://www.EMSL.com>torontolab@emsl.com

EMSL Canada Or 552522970
CustomerID: 55WSPN36
CustomerPO: TBD
ProjectID:

Attn: **Veronica Reid**
WSP Canada, Inc.
36 Pippy Place
Saint John's, NL A1B 4A5

Phone: (709) 722-7023
Fax:
Received: 12/23/2025 12:34 PM
Collected: 12/19/2025

Project: CA0037087.2445 - Project NAVFAC Paint Sampling

Analytical Results

Client Sample Description TE-Rm45- M031A
TE Bldg. Room 45 / White on drywall wall
Collected: 12/19/2025
Lab ID: 552522970-0171

Method	Parameter	Result	RL	Units	Prep Date & Analyst	Analysis Date & Analyst
METALS						
Mercury by CVAA, SW-846-7471B	Mercury	0.15	0.050	mg/Kg	1/5/2026 RF	1/5/2026 RF

Client Sample Description TE-Rm63- M031B
TE Bldg. Room 63 / White on drywall wall
Collected: 12/19/2025
Lab ID: 552522970-0172

Method	Parameter	Result	RL	Units	Prep Date & Analyst	Analysis Date & Analyst
METALS						
Mercury by CVAA, SW-846-7471B	Mercury	3.0 D	0.25	mg/Kg	1/5/2026 RF	1/5/2026 RF

Client Sample Description TE-Rm51-M032A
TE Bldg. Room 51 / Light blue on pipe insulation and paper
Collected: 12/19/2025
Lab ID: 552522970-0173

Method	Parameter	Result	RL	Units	Prep Date & Analyst	Analysis Date & Analyst
METALS						
Mercury by CVAA, SW-846-7471B	Mercury	34 D	2.5	mg/Kg	1/5/2026 RF	1/5/2026 RF

Client Sample Description TE-Rm71-M032B
TE Bldg. Room 71 / Light blue on pipe insulation and paper
Collected: 12/19/2025
Lab ID: 552522970-0174

Method	Parameter	Result	RL	Units	Prep Date & Analyst	Analysis Date & Analyst
METALS						
Mercury by CVAA, SW-846-7471B	Mercury	10 D	0.50	mg/Kg	1/5/2026 RF	1/5/2026 RF

Client Sample Description TE-Rm51-M033A
TE Bldg. Room 51 / White on pipe insulation and paper
Collected: 12/19/2025
Lab ID: 552522970-0175

Method	Parameter	Result	RL	Units	Prep Date & Analyst	Analysis Date & Analyst
METALS						
Mercury by CVAA, SW-846-7471B	Mercury	33 D	2.5	mg/Kg	1/5/2026 RF	1/5/2026 RF

**EMSL Canada Inc.**

2756 Slough Street, Mississauga, ON L4T 1G3

Phone/Fax: (289) 997-4602 / (289) 997-4607

<http://www.EMSL.com>torontolab@emsl.com

EMSL Canada Or 552522970
CustomerID: 55WSPN36
CustomerPO: TBD
ProjectID:

Attn: **Veronica Reid**
WSP Canada, Inc.
36 Pippy Place
Saint John's, NL A1B 4A5

Phone: (709) 722-7023
Fax:
Received: 12/23/2025 12:34 PM
Collected: 12/19/2025

Project: CA0037087.2445 - Project NAVFAC Paint Sampling

Analytical Results

Client Sample Description TE-Rm27-M033B
TE Bldg. Room 27 / White on pipe insulation and paper
Collected: 12/18/2025
Lab ID: 552522970-0176

Method	Parameter	Result	RL	Units	Prep Date & Analyst	Analysis Date & Analyst
METALS						
Mercury by CVAA, SW-846-7471B	Mercury	31 D	2.5	mg/Kg	1/5/2026 RF	1/5/2026 RF

Client Sample Description GB-Rm1-M001A
Gen. Bldg. Room 1 / White on metal walls
Collected: 12/9/2025
Lab ID: 552522970-0177

Method	Parameter	Result	RL	Units	Prep Date & Analyst	Analysis Date & Analyst
METALS						
Mercury by CVAA, SW-846-7471B	Mercury	0.60	0.050	mg/Kg	1/5/2026 RF	1/5/2026 RF

Client Sample Description GB-Rm10-M001B
Gen. Bldg. Room 10 / White on metal walls
Collected: 12/9/2025
Lab ID: 552522970-0178

Method	Parameter	Result	RL	Units	Prep Date & Analyst	Analysis Date & Analyst
METALS						
Mercury by CVAA, SW-846-7471B	Mercury	0.20	0.050	mg/Kg	1/5/2026 RF	1/5/2026 RF

Client Sample Description GB-Rm6-M002A
Gen. Bldg. Room 6 / White on drywall walls
Collected: 12/9/2025
Lab ID: 552522970-0179

Method	Parameter	Result	RL	Units	Prep Date & Analyst	Analysis Date & Analyst
METALS						
Mercury by CVAA, SW-846-7471B	Mercury	0.69	0.050	mg/Kg	1/5/2026 RF	1/5/2026 RF

Client Sample Description GB-Rm9-M002B
Gen. Bldg. Room 9 / White on drywall walls
Collected: 12/9/2025
Lab ID: 552522970-0180

Method	Parameter	Result	RL	Units	Prep Date & Analyst	Analysis Date & Analyst
METALS						
Mercury by CVAA, SW-846-7471B	Mercury	13 D	1.0	mg/Kg	1/5/2026 RF	1/5/2026 RF

**EMSL Canada Inc.**

2756 Slough Street, Mississauga, ON L4T 1G3

Phone/Fax: (289) 997-4602 / (289) 997-4607

<http://www.EMSL.com>torontolab@emsl.com

EMSL Canada Or 552522970
CustomerID: 55WSPN36
CustomerPO: TBD
ProjectID:

Attn: **Veronica Reid**
WSP Canada, Inc.
36 Pippy Place
Saint John's, NL A1B 4A5

Phone: (709) 722-7023
Fax:
Received: 12/23/2025 12:34 PM
Collected: 12/19/2025

Project: CA0037087.2445 - Project NAVFAC Paint Sampling

Analytical Results

Client Sample Description GB-Rm5-M003A
Gen. Bldg. Room 5 / Beige on drywall walls
Collected: 12/9/2025
Lab ID: 552522970-0181

Method	Parameter	Result	RL	Units	Prep Date & Analyst	Analysis Date & Analyst
METALS						
Mercury by CVAA, SW-846-7471B	Mercury	ND	0.050	mg/Kg	1/5/2026 RF	1/5/2026 RF

Client Sample Description GB-Rm5-M003B
Gen. Bldg. Room 5 / Beige on drywall walls
Collected: 12/9/2025
Lab ID: 552522970-0182

Method	Parameter	Result	RL	Units	Prep Date & Analyst	Analysis Date & Analyst
METALS						
Mercury by CVAA, SW-846-7471B	Mercury	ND	0.050	mg/Kg	1/5/2026 RF	1/5/2026 RF

Client Sample Description GB-Rm1-M004A
Gen. Bldg. Room 1 / White on concrete block walls
Collected: 12/9/2025
Lab ID: 552522970-0183

Method	Parameter	Result	RL	Units	Prep Date & Analyst	Analysis Date & Analyst
METALS						
Mercury by CVAA, SW-846-7471B	Mercury	13 D	1.0	mg/Kg	1/5/2026 RF	1/5/2026 RF

Client Sample Description GB-Rm1-M004B
Gen. Bldg. Room 1 / White on concrete block walls
Collected: 12/9/2025
Lab ID: 552522970-0184

Method	Parameter	Result	RL	Units	Prep Date & Analyst	Analysis Date & Analyst
METALS						
Mercury by CVAA, SW-846-7471B	Mercury	5.3 D	0.25	mg/Kg	1/5/2026 RF	1/5/2026 RF

Client Sample Description GB-Rm1-M005A
Gen. Bldg. Room 1 / Black on concrete block walls
Collected: 12/9/2025
Lab ID: 552522970-0185

Method	Parameter	Result	RL	Units	Prep Date & Analyst	Analysis Date & Analyst
METALS						
Mercury by CVAA, SW-846-7471B	Mercury	0.40	0.050	mg/Kg	1/5/2026 RF	1/5/2026 RF

**EMSL Canada Inc.**

2756 Slough Street, Mississauga, ON L4T 1G3

Phone/Fax: (289) 997-4602 / (289) 997-4607

<http://www.EMSL.com>torontolab@emsl.com

EMSL Canada Or 552522970
CustomerID: 55WSPN36
CustomerPO: TBD
ProjectID:

Attn: **Veronica Reid**
WSP Canada, Inc.
36 Pippy Place
Saint John's, NL A1B 4A5

Phone: (709) 722-7023
Fax:
Received: 12/23/2025 12:34 PM
Collected: 12/19/2025

Project: CA0037087.2445 - Project NAVFAC Paint Sampling

Analytical Results

Client Sample Description GB-Rm1-M005B
Gen. Bldg. Room 1 / Black on concrete block walls
Collected: 12/9/2025
Lab ID: 552522970-0186

Method	Parameter	Result	RL	Units	Prep Date & Analyst	Analysis Date & Analyst
METALS						
Mercury by CVAA, SW-846-7471B	Mercury	0.32	0.050	mg/Kg	1/5/2026 RF	1/5/2026 RF

Client Sample Description GB-Rm4-M006A
Gen. Bldg. Room 4 / Black on drywall walls
Collected: 12/12/2025
Lab ID: 552522970-0187

Method	Parameter	Result	RL	Units	Prep Date & Analyst	Analysis Date & Analyst
METALS						
Mercury by CVAA, SW-846-7471B	Mercury	2.3 D	0.10	mg/Kg	1/5/2026 RF	1/5/2026 RF

Client Sample Description GB-Rm4-M006B
Gen. Bldg. Room 4 / Black on drywall walls
Collected: 12/12/2025
Lab ID: 552522970-0188

Method	Parameter	Result	RL	Units	Prep Date & Analyst	Analysis Date & Analyst
METALS						
Mercury by CVAA, SW-846-7471B	Mercury	0.30	0.050	mg/Kg	1/5/2026 RF	1/5/2026 RF

Client Sample Description GB-Rm4-M007A
Gen. Bldg. Room 4 / Red on concrete walls
Collected: 12/12/2025
Lab ID: 552522970-0189

Method	Parameter	Result	RL	Units	Prep Date & Analyst	Analysis Date & Analyst
METALS						
Mercury by CVAA, SW-846-7471B	Mercury	0.29	0.050	mg/Kg	1/5/2026 RF	1/5/2026 RF

Client Sample Description GB-Rm12-M007B
Gen. Bldg. Room 12 / Red on concrete walls
Collected: 12/12/2025
Lab ID: 552522970-0190

Method	Parameter	Result	RL	Units	Prep Date & Analyst	Analysis Date & Analyst
METALS						
Mercury by CVAA, SW-846-7471B	Mercury	0.84	0.050	mg/Kg	1/5/2026 RF	1/5/2026 RF

**EMSL Canada Inc.**

2756 Slough Street, Mississauga, ON L4T 1G3

Phone/Fax: (289) 997-4602 / (289) 997-4607

<http://www.EMSL.com>torontolab@emsl.com

EMSL Canada Or 552522970
CustomerID: 55WSPN36
CustomerPO: TBD
ProjectID:

Attn: **Veronica Reid**
WSP Canada, Inc.
36 Pippy Place
Saint John's, NL A1B 4A5

Phone: (709) 722-7023
Fax:
Received: 12/23/2025 12:34 PM
Collected: 12/19/2025

Project: CA0037087.2445 - Project NAVFAC Paint Sampling

Analytical Results

Client Sample Description GB-Rm10-M008A
Gen. Bldg. Room 10 / Light grey on metal generator housing
Collected: 12/12/2025
Lab ID: 552522970-0191

Method	Parameter	Result	RL	Units	Prep Date & Analyst	Analysis Date & Analyst
METALS						
Mercury by CVAA, SW-846-7471B	Mercury	0.38	0.050	mg/Kg	1/5/2026 RF	1/5/2026 RF

Client Sample Description GB-Rm10-M008B
Gen. Bldg. Room 10 / Light grey on metal generator housing
Collected: 12/12/2025
Lab ID: 552522970-0192

Method	Parameter	Result	RL	Units	Prep Date & Analyst	Analysis Date & Analyst
METALS						
Mercury by CVAA, SW-846-7471B	Mercury	0.32	0.050	mg/Kg	1/5/2026 RF	1/5/2026 RF

Client Sample Description GB-Rm10-M009A
Gen. Bldg. Room 10 / Black on pipe insulation paper
Collected: 12/12/2025
Lab ID: 552522970-0193

Method	Parameter	Result	RL	Units	Prep Date & Analyst	Analysis Date & Analyst
METALS						
Mercury by CVAA, SW-846-7471B	Mercury	0.21	0.050	mg/Kg	1/5/2026 RF	1/5/2026 RF

Client Sample Description GB-Rm10-M009B
Gen. Bldg. Room 10 / Black on pipe insulation paper
Collected: 12/12/2025
Lab ID: 552522970-0194

Method	Parameter	Result	RL	Units	Prep Date & Analyst	Analysis Date & Analyst
METALS						
Mercury by CVAA, SW-846-7471B	Mercury	0.22	0.050	mg/Kg	1/5/2026 RF	1/5/2026 RF

Client Sample Description GB-Rm10-M010A
Gen. Bldg. Room 10 / Light grey on metal pipe
Collected: 12/12/2025
Lab ID: 552522970-0195

Method	Parameter	Result	RL	Units	Prep Date & Analyst	Analysis Date & Analyst
METALS						
Mercury by CVAA, SW-846-7471B	Mercury	0.26	0.050	mg/Kg	1/5/2026 RF	1/5/2026 RF

**EMSL Canada Inc.**

2756 Slough Street, Mississauga, ON L4T 1G3

Phone/Fax: (289) 997-4602 / (289) 997-4607

<http://www.EMSL.com>torontolab@emsl.com

EMSL Canada Or 552522970
CustomerID: 55WSPN36
CustomerPO: TBD
ProjectID:

Attn: **Veronica Reid**
WSP Canada, Inc.
36 Pippy Place
Saint John's, NL A1B 4A5

Phone: (709) 722-7023
Fax:
Received: 12/23/2025 12:34 PM
Collected: 12/19/2025

Project: CA0037087.2445 - Project NAVFAC Paint Sampling

Analytical Results

Client Sample Description		GB-Rm10-M010A Gen. Bldg. Room 10 / Light grey on metal pipe	Collected: 12/12/2025		Lab ID: 552522970-0196	
Method	Parameter	Result	RL	Units	Prep Date & Analyst	Analysis Date & Analyst
METALS						
Mercury by CVAA, SW-846-7471B	Mercury	0.41	0.050	mg/Kg	1/5/2026 RF	1/5/2026 RF
Client Sample Description		GB-Rm2-M011A Gen. Bldg. Room 2 / Light grey on concrete floor	Collected: 12/12/2025		Lab ID: 552522970-0197	
Method	Parameter	Result	RL	Units	Prep Date & Analyst	Analysis Date & Analyst
METALS						
Mercury by CVAA, SW-846-7471B	Mercury	0.32	0.050	mg/Kg	1/5/2026 RF	1/5/2026 RF
Client Sample Description		GB-Rm2-M011B Gen. Bldg. Room 2 / Light grey on concrete floor	Collected: 12/12/2025		Lab ID: 552522970-0198	
Method	Parameter	Result	RL	Units	Prep Date & Analyst	Analysis Date & Analyst
METALS						
Mercury by CVAA, SW-846-7471B	Mercury	0.27	0.050	mg/Kg	1/5/2026 RF	1/5/2026 RF
Client Sample Description		GB-Rm4-M012A Gen. Bldg. Room 4 / Black on metal ceiling hangers	Collected: 12/15/2025		Lab ID: 552522970-0199	
Method	Parameter	Result	RL	Units	Prep Date & Analyst	Analysis Date & Analyst
METALS						
Mercury by CVAA, SW-846-7471B	Mercury	1.7 D	0.10	mg/Kg	1/5/2026 RF	1/5/2026 RF
Client Sample Description		GB-Rm4-M012B Gen. Bldg. Room 4 / Black on metal ceiling hangers	Collected: 12/15/2025		Lab ID: 552522970-0200	
Method	Parameter	Result	RL	Units	Prep Date & Analyst	Analysis Date & Analyst
METALS						
Mercury by CVAA, SW-846-7471B	Mercury	1.6 D	0.10	mg/Kg	1/5/2026 RF	1/5/2026 RF

**EMSL Canada Inc.**

2756 Slough Street, Mississauga, ON L4T 1G3

Phone/Fax: (289) 997-4602 / (289) 997-4607

<http://www.EMSL.com>torontolab@emsl.com

EMSL Canada Or 552522970
CustomerID: 55WSPN36
CustomerPO: TBD
ProjectID:

Attn: **Veronica Reid**
WSP Canada, Inc.
36 Pippy Place
Saint John's, NL A1B 4A5

Phone: (709) 722-7023
Fax:
Received: 12/23/2025 12:34 PM
Collected: 12/19/2025

Project: CA0037087.2445 - Project NAVFAC Paint Sampling

Analytical Results

Client Sample Description GB-Rm14-M013A
Gen. Bldg. Room 14 / Blue on metal door and frame
Collected: 12/15/2025
Lab ID: 552522970-0201

Method	Parameter	Result	RL	Units	Prep Date & Analyst	Analysis Date & Analyst
METALS						
Mercury by CVAA, SW-846-7471B	Mercury	28 D	2.5	mg/Kg	1/5/2026 RF	1/5/2026 RF

Client Sample Description GB-Rm14-M013B
Gen. Bldg. Room 14 / Blue on metal door and frame
Collected: 12/15/2025
Lab ID: 552522970-0202

Method	Parameter	Result	RL	Units	Prep Date & Analyst	Analysis Date & Analyst
METALS						
Mercury by CVAA, SW-846-7471B	Mercury	28 D	2.5	mg/Kg	1/5/2026 RF	1/5/2026 RF

Client Sample Description GB-Ext-M014A
Gen. Bldg. Exterior / V. light brown on concrete wall board
Collected: 12/15/2025
Lab ID: 552522970-0203

Method	Parameter	Result	RL	Units	Prep Date & Analyst	Analysis Date & Analyst
METALS						
Mercury by CVAA, SW-846-7471B	Mercury	ND	0.050	mg/Kg	1/5/2026 RF	1/5/2026 RF

Client Sample Description GB-Ext-M014B
Gen. Bldg. Exterior / V. light brown on concrete wall board
Collected: 12/15/2025
Lab ID: 552522970-0204

Method	Parameter	Result	RL	Units	Prep Date & Analyst	Analysis Date & Analyst
METALS						
Mercury by CVAA, SW-846-7471B	Mercury	ND	0.050	mg/Kg	1/5/2026 RF	1/5/2026 RF

Client Sample Description GB-Ext-M015A
Gen. Bldg. Exterior / V. light brown on concrete wall
Collected: 12/15/2025
Lab ID: 552522970-0205

Method	Parameter	Result	RL	Units	Prep Date & Analyst	Analysis Date & Analyst
METALS						
Mercury by CVAA, SW-846-7471B	Mercury	0.056	0.050	mg/Kg	1/5/2026 RF	1/5/2026 RF

**EMSL Canada Inc.**

2756 Slough Street, Mississauga, ON L4T 1G3

Phone/Fax: (289) 997-4602 / (289) 997-4607

<http://www.EMSL.com>torontolab@emsl.com

EMSL Canada Or 552522970
CustomerID: 55WSPN36
CustomerPO: TBD
ProjectID:

Attn: **Veronica Reid**
WSP Canada, Inc.
36 Pippy Place
Saint John's, NL A1B 4A5

Phone: (709) 722-7023
Fax:
Received: 12/23/2025 12:34 PM
Collected: 12/19/2025

Project: CA0037087.2445 - Project NAVFAC Paint Sampling

Analytical Results

Client Sample Description GB-Ext-M015B
Gen. Bldg. Exterior / V. light brown on concrete wall
Collected: 12/15/2025
Lab ID: 552522970-0206

Method	Parameter	Result	RL	Units	Prep Date & Analyst	Analysis Date & Analyst
METALS						
Mercury by CVAA, SW-846-7471B	Mercury	ND	0.050	mg/Kg	1/5/2026 RF	1/5/2026 RF

Client Sample Description GB-Ext-M016A
Gen. Bldg. Exterior / V. light brown on plywood wall
Collected: 12/15/2025
Lab ID: 552522970-0207

Method	Parameter	Result	RL	Units	Prep Date & Analyst	Analysis Date & Analyst
METALS						
Mercury by CVAA, SW-846-7471B	Mercury	ND	0.050	mg/Kg	1/5/2026 RF	1/5/2026 RF

Client Sample Description GB-Ext-M016B
Gen. Bldg. Exterior / V. light brown on plywood wall
Collected: 12/15/2025
Lab ID: 552522970-0208

Method	Parameter	Result	RL	Units	Prep Date & Analyst	Analysis Date & Analyst
METALS						
Mercury by CVAA, SW-846-7471B	Mercury	ND	0.050	mg/Kg	1/5/2026 RF	1/5/2026 RF

Client Sample Description GB-Ext-M017A
Gen. Bldg. Exterior / V. light brown on metal pipe
Collected: 12/15/2025
Lab ID: 552522970-0209

Method	Parameter	Result	RL	Units	Prep Date & Analyst	Analysis Date & Analyst
METALS						
Mercury by CVAA, SW-846-7471B	Mercury	ND	0.050	mg/Kg	1/5/2026 RF	1/5/2026 RF

Client Sample Description GB-Ext-M017B
Gen. Bldg. Exterior / V. light brown on metal pipe
Collected: 12/15/2025
Lab ID: 552522970-0210

Method	Parameter	Result	RL	Units	Prep Date & Analyst	Analysis Date & Analyst
METALS						
Mercury by CVAA, SW-846-7471B	Mercury	2.3 D	0.10	mg/Kg	1/5/2026 RF	1/5/2026 RF

**EMSL Canada Inc.**

2756 Slough Street, Mississauga, ON L4T 1G3

Phone/Fax: (289) 997-4602 / (289) 997-4607

<http://www.EMSL.com>torontolab@emsl.com

EMSL Canada Or 552522970
CustomerID: 55WSPN36
CustomerPO: TBD
ProjectID:

Attn: **Veronica Reid**
WSP Canada, Inc.
36 Pippy Place
Saint John's, NL A1B 4A5

Phone: (709) 722-7023
Fax:
Received: 12/23/2025 12:34 PM
Collected: 12/19/2025

Project: CA0037087.2445 - Project NAVFAC Paint Sampling

Analytical Results

Client Sample Description GS-Rm1-M001A
Guard Shack, Room 1 / Off-white on drywall wall
Collected: 12/9/2025
Lab ID: 552522970-0211

Method	Parameter	Result	RL	Units	Prep Date & Analyst	Analysis Date & Analyst
METALS						
Mercury by CVAA, SW-846-7471B	Mercury	3.9 D	0.25	mg/Kg	12/30/2025 RF	12/30/2025 RF

Client Sample Description GS-Rm1-M001B
Guard Shack, Room 1 / Off-white on drywall wall
Collected: 12/9/2025
Lab ID: 552522970-0212

Method	Parameter	Result	RL	Units	Prep Date & Analyst	Analysis Date & Analyst
METALS						
Mercury by CVAA, SW-846-7471B	Mercury	2.8 D	0.25	mg/Kg	12/30/2025 RF	12/30/2025 RF

Client Sample Description GS-Rm1-M002A
Guard Shack, Room 1 / White on drywall wall
Collected: 12/9/2025
Lab ID: 552522970-0213

Method	Parameter	Result	RL	Units	Prep Date & Analyst	Analysis Date & Analyst
METALS						
Mercury by CVAA, SW-846-7471B	Mercury	0.088	0.050	mg/Kg	12/30/2025 RF	12/30/2025 RF

Client Sample Description GS-Rm2-M002B
Guard Shack, Room 2 / White on drywall wall
Collected: 12/9/2025
Lab ID: 552522970-0214

Method	Parameter	Result	RL	Units	Prep Date & Analyst	Analysis Date & Analyst
METALS						
Mercury by CVAA, SW-846-7471B	Mercury	3.3 D	0.25	mg/Kg	12/30/2025 RF	12/30/2025 RF

Client Sample Description GS-Ext-M003A
Guard Shack, Exterior / V. light brown on concrete eve
Collected: 12/9/2025
Lab ID: 552522970-0215

Method	Parameter	Result	RL	Units	Prep Date & Analyst	Analysis Date & Analyst
METALS						
Mercury by CVAA, SW-846-7471B	Mercury	3.1 D	0.25	mg/Kg	12/30/2025 RF	12/30/2025 RF

**EMSL Canada Inc.**

2756 Slough Street, Mississauga, ON L4T 1G3

Phone/Fax: (289) 997-4602 / (289) 997-4607

<http://www.EMSL.com>torontolab@emsl.com

EMSL Canada Or 552522970
CustomerID: 55WSPN36
CustomerPO: TBD
ProjectID:

Attn: **Veronica Reid**
WSP Canada, Inc.
36 Pippy Place
Saint John's, NL A1B 4A5

Phone: (709) 722-7023
Fax:
Received: 12/23/2025 12:34 PM
Collected: 12/19/2025

Project: CA0037087.2445 - Project NAVFAC Paint Sampling

Analytical Results

Client Sample Description GS-Ext-M003B
Guard Shack, Exterior / V. light brown on concrete foundation
Collected: 12/9/2025
Lab ID: 552522970-0216

Method	Parameter	Result	RL	Units	Prep Date & Analyst	Analysis Date & Analyst
METALS						
Mercury by CVAA, SW-846-7471B	Mercury	5.2 D	0.25	mg/Kg	12/30/2025 RF	12/30/2025 RF

Client Sample Description GS-Ext-M004A
Guard Shack, Exterior / V. light brown on concrete wall board
Collected: 12/9/2025
Lab ID: 552522970-0217

Method	Parameter	Result	RL	Units	Prep Date & Analyst	Analysis Date & Analyst
METALS						
Mercury by CVAA, SW-846-7471B	Mercury	ND	0.050	mg/Kg	12/30/2025 RF	12/30/2025 RF

Client Sample Description GS-Ext-M004B
Guard Shack, Exterior / V. light brown on concrete wall board
Collected: 12/9/2025
Lab ID: 552522970-0218

Method	Parameter	Result	RL	Units	Prep Date & Analyst	Analysis Date & Analyst
METALS						
Mercury by CVAA, SW-846-7471B	Mercury	ND	0.050	mg/Kg	12/30/2025 RF	12/30/2025 RF

Client Sample Description GS-Ext-M005A
Guard Shack, Exterior / V. light brown on metal pipe
Collected: 12/9/2025
Lab ID: 552522970-0219

Method	Parameter	Result	RL	Units	Prep Date & Analyst	Analysis Date & Analyst
METALS						
Mercury by CVAA, SW-846-7471B	Mercury	ND	0.050	mg/Kg	12/30/2025 RF	12/30/2025 RF

Client Sample Description GS-Ext-M005B
Guard Shack, Exterior / V. light brown on metal pipe
Collected: 12/9/2025
Lab ID: 552522970-0220

Method	Parameter	Result	RL	Units	Prep Date & Analyst	Analysis Date & Analyst
METALS						
Mercury by CVAA, SW-846-7471B	Mercury	ND	0.050	mg/Kg	12/30/2025 RF	12/30/2025 RF



EMSL Canada Inc.

2756 Slough Street, Mississauga, ON L4T 1G3

Phone/Fax: (289) 997-4602 / (289) 997-4607

<http://www.EMSL.com>

torontolab@emsl.com

EMSL Canada Or	552522970
CustomerID:	55WSPN36
CustomerPO:	TBD
ProjectID:	

Definitions:

MDL - method detection limit

J - Result was below the reporting limit, but at or above the MDL

ND - indicates that the analyte was not detected at the reporting limit

RL - Reporting Limit (Analytical)

D - Dilution Sample required a dilution which was used to calculate final results

**EMSL Canada Inc.**

2756 Slough Street, Mississauga, ON L4T 1G3

Phone/Fax: (289) 997-4602 / (289) 997-4607

<http://www.EMSL.com>torontolab@emsl.com

EMSL Canada Or 552522970
CustomerID: 55WSPN36
CustomerPO: TBD
ProjectID:

Attn: **Veronica Reid**
WSP Canada, Inc.
36 Pippy Place
Saint John's, NL A1B 4A5

Phone: (709) 722-7023
Fax:
Received: 12/23/2025 12:34 PM
Collected:

Project: **CA0037087.2445 - Project NAVFAC Paint Sampling****Test Report: Toxicity Characteristic Leachate Procedure (1311/7000B)**

<i>Client Sample</i>	<i>Description</i>	<i>Collected</i>	<i>Analyzed</i>	<i>RDL</i>	<i>Lead Concentration</i>
TE-Rm69-M012A 552522970-0221	Site: Very light brown paint on plaster wall in Room 69 in the TE Building		1/29/2026	0.32 mg/L	0.36 mg/L
TE-Rm74-M016B 552522970-0222	Site: Very light green paint on plaster wall in Room 74 in the TE Building		1/29/2026	0.32 mg/L	0.37 mg/L
TE-Rm73-M024A 552522970-0223	Site: Dark grey paint on metal door and frame in Room 73 in the TE Building Sample weight (27g) did not meet the minimum requirement (100g) of EPA Method 1311.		1/29/2026	0.32 mg/L	2.3 mg/L
TE-Rm27-M026A + TE-Rm30-M026B 552522970-0224	Site: Black paint on metal door and frame in Room 27 & Room 30 in the TE Building Sample weight (20g) did not meet the minimum requirement (100g) of EPA Method 1311.		1/29/2026	6.4 mg/L	180 mg/L
TE-Rm47-M027A 552522970-0225	Site: Green paint on metal door and frame in Room 47 in the TE Building Sample weight (31g) did not meet the minimum requirement (100g) of EPA Method 1311.		1/29/2026	0.64 mg/L	22 mg/L
TE-Rm51-M030A 552522970-0226	Site: Black paint on concrete and metal pad in Room 51 in the TE Building Sample weight (61g) did not meet the minimum requirement (100g) of EPA Method 1311.		1/29/2026	0.32 mg/L	6.1 mg/L
TE-Rm51-M030B 552522970-0227	Site: Black paint on concrete and metal pad in Room 51 in the TE Building Sample weight (37g) did not meet the minimum requirement (100g) of EPA Method 1311.		1/29/2026	0.32 mg/L	8.9 mg/L

Rowena Fanto, Lead Supervisor
or other approved signatory

EMSL maintains liability limited to cost of analysis. Interpretation and use of test results are the responsibility of the client. This report relates only to the samples reported above, and may not be reproduced, except in full, without written approval by EMSL. EMSL bears no responsibility for sample collection activities or analytical method limitations. The report reflects the samples as received. Results are generated from the field sampling data (sampling volumes and areas, locations, etc.) provided by the client on the Chain of Custody. Samples are within quality control criteria and met method specifications unless otherwise noted. "<" (less than) result signifies that the analyte was not detected at or above the reporting limit. Measurement of uncertainty is available upon request. Definitions of modifications are available upon request.

Samples analyzed by EMSL Canada Inc. Mississauga, ON

Initial report from 02/02/2026 09:54:54

**EMSL Canada Inc.**

2756 Slough Street, Mississauga, ON L4T 1G3

Phone/Fax: (289) 997-4602 / (289) 997-4607

<http://www.EMSL.com>torontolab@emsl.com

EMSL Canada Or 552522970
CustomerID: 55WSPN36
CustomerPO: TBD
ProjectID:

Attn: **Veronica Reid**
WSP Canada, Inc.
36 Pippy Place
Saint John's, NL A1B 4A5

Phone: (709) 722-7023
Fax:
Received: 12/23/2025 12:34 PM
Collected:

Project: **CA0037087.2445 - Project NAVFAC Paint Sampling****Test Report: Toxicity Characteristic Leachate Procedure (1311/7000B)**

<i>Client Sample</i>	<i>Description</i>	<i>Collected</i>	<i>Analyzed</i>	<i>RDL</i>	<i>Lead Concentration</i>
GB-Rm10-M008A 552522970-0228	Site: Light grey paint on metal generator housing in Room 10 in the Generator Building		1/29/2026	0.32 mg/L	<0.32 mg/L
GB-Rm10-M008B 552522970-0229	Site: Light grey paint on metal generator housing in Room 10 in the Generator Building		1/29/2026	0.32 mg/L	<0.32 mg/L

RLVS recovery was outside the control limits.

Rowena Fanto, Lead Supervisor
or other approved signatory

EMSL maintains liability limited to cost of analysis. Interpretation and use of test results are the responsibility of the client. This report relates only to the samples reported above, and may not be reproduced, except in full, without written approval by EMSL. EMSL bears no responsibility for sample collection activities or analytical method limitations. The report reflects the samples as received. Results are generated from the field sampling data (sampling volumes and areas, locations, etc.) provided by the client on the Chain of Custody. Samples are within quality control criteria and met method specifications unless otherwise noted. "<" (less than) result signifies that the analyte was not detected at or above the reporting limit. Measurement of uncertainty is available upon request. Definitions of modifications are available upon request.

Samples analyzed by EMSL Canada Inc. Mississauga, ON

Initial report from 02/02/2026 09:54:54

ATTACHMENT 2

**Summary Table of Bulk and
Leachability Sample Results for
Lead, Mercury, and PCBs in Paints**

Summary of Bulk and Leachability Sample Results for Lead, Mercury, and PCBs in Paints

WSP PROJECT NO. CA0037087.2445

Sample ID	Sample Location	Sample Description	Lead Concentration (ppm)	Lead Leachate (mg/L)	Mercury Concentration (ppm)	Mercury Leachate (mg/L)	PCB Concentration (ppm)
TE-Rm52-M001A/PCB001A	TE Building / Room 52	Red paint on concrete floor	1,800	-	0.89	-	7.2
TE-Rm52-M001B/PCB001B	TE Building / Room 52	Red paint on concrete floor	2,100	-	0.53	-	4.8
TE-Rm51-M002A/PCB002A	TE Building / Room 51	Light blue paint on drywall wall	1,100	-	16	-	6.6
TE-Rm42-M002B/PCB002B	TE Building / Room 42	Light blue paint on drywall wall	130	-	29	-	3.3
TE-Rm46-M003A/PCB003A	TE Building / Room 46	Light brown paint on drywall wall	280	-	8.5	-	6.5
TE-Rm40-M003B/PCB003B	TE Building / Room 40	Light brown paint on drywall wall	3,600	-	39	-	12
TE-Rm43-M004A/PCB004A	TE Building / Room 43	Off-white paint on drywall wall	970	-	24	-	5.5
TE-Rm43-M004B/PCB004B	TE Building / Room 43	Off-white paint on drywall wall	1,700	-	24	-	5.5
TE-Rm7-M005A/PCB005A	TE Building / Room 7	Blue paint on drywall wall	<64	-	0.15	-	3.8
TE-Rm4-M005B/PCB005B	TE Building / Room 4	Blue paint on drywall wall	3,800	-	2.0	-	12
TE-Rm10-M006A/PCB006A	TE Building / Room 10	Greenish-blue paint on drywall wall	1,600	-	14	-	5.2
TE-Rm10-M006B/PCB006B	TE Building / Room 10	Greenish-blue paint on drywall wall	370	-	30	-	5.9
TE-Rm65-M007A/PCB007A	TE Building / Room 65	Yellow paint on drywall wall	<64	-	7.0	-	9.1
TE-Rm65-M007B/PCB007B	TE Building / Room 65	Yellow paint on drywall wall	<64	-	3.2	-	3.1
TE-Rm67-M008A/PCB008A	TE Building / Room 67	Light yellow paint on drywall wall	1,200	-	5.2	-	7.0
TE-Rm50-M008B/PCB008B	TE Building / Room 50	Light yellow paint on drywall wall	290	-	21	-	1.9
TE-Rm66-M009A/PCB009A	TE Building / Room 66	Brownish-grey paint on drywall wall	1,900	-	1.8	-	6.0
TE-Rm66-M009B/PCB009B	TE Building / Room 66	Brownish-grey paint on drywall wall	1,500	-	0.75	-	4.8
TE-Rm64-M010A/PCB010A	TE Building / Room 64	Grey paint on drywall wall	<64	-	5.2	-	1.9

Summary of Bulk and Leachability Sample Results for Lead, Mercury, and PCBs in Paints

WSP PROJECT NO. CA0037087.2445

Sample ID	Sample Location	Sample Description	Lead Concentration (ppm)	Lead Leachate (mg/L)	Mercury Concentration (ppm)	Mercury Leachate (mg/L)	PCB Concentration (ppm)
TE-Rm64-M010B/PCB010B	TE Building / Room 64	Grey paint on drywall wall	87	-	11	-	2.7
TE-Rm68-M011A/PCB011A	TE Building / Room 68	Light green paint on plaster wall	360	-	39	-	6.4
TE-Rm68-M011B/PCB011B	TE Building / Room 68	Light green paint on plaster wall	260	-	44	-	2.3
TE-Rm69-M012A/PCB012A	TE Building / Room 69	Very light brown paint on plaster wall	7,100	0.36	4.2	-	17
TE-Rm53-M012B/PCB012B	TE Building / Room 53	Very light brown paint on plaster wall	4,600	-	3.9	-	9.6
TE-Rm69-M013A/PCB013A	TE Building / Room 69	Light brown paint on plaster wall	4,500	-	2.2	-	1.8
TE-Rm69-M013B/PCB013B	TE Building / Room 69	Light brown paint on plaster wall	3,600	-	1.7	-	1.4
TE-Rm73-M014A/PCB014A	TE Building / Room 73	Gloss white paint on drywall wall	1,100	-	0.57	-	7.3
TE-Rm73-M014B/PCB014B	TE Building / Room 73	Gloss white paint on drywall wall	<64	-	0.12	-	8.8
TE-Rm53-M015A/PCB015A	TE Building / Room 53	Sky blue paint on drywall wall	1,200	-	6.7	-	7.5
TE-Rm72-M015B/PCB015B	TE Building / Room 72	Sky blue paint on drywall wall	1,200	-	7.6	-	6.5
TE-Rm74-M016A/PCB016A	TE Building / Room 74	Very light green paint on plaster wall	3,700	-	8.7	-	21
TE-Rm74-M016B/PCB016B	TE Building / Room 74	Very light green paint on plaster wall	6,600	0.37	9.6	-	18
TE-Rm57-M017A/PCB017A	TE Building / Room 57	Blue paint on drywall wall	<64	-	17	-	4.0
TE-Rm21-M017B/PCB017B	TE Building / Room 21	Blue paint on drywall wall	2,700	-	1.3	-	13
TE-Rm40-M018A/PCB018A	TE Building / Room 40	Grey paint on concrete floor	790	-	0.36	-	10
TE-Rm40-M018B/PCB018B	TE Building / Room 40	Grey paint on concrete floor	680	-	0.29	-	8.3
TE-Rm25-M019A/PCB019A	TE Building / Room 25	Blueish-black paint on drywall ceiling	330	-	2.9	-	8.3
TE-Rm23-M019B/PCB019B	TE Building / Room 23	Blueish-black paint on drywall ceiling	380	-	3.3	-	14
TE-Ext-M020A/PCB020A	TE Building / Exterior	Very light brown paint on concrete wall	1,500	-	0.10	-	ND
TE-Ext-M020B/PCB020B	TE Building / Exterior	Very light brown paint on concrete wall	<64	-	ND	-	ND
TE-Ext-M021A/PCB021A	TE Building / Exterior	Very light brown paint on plywood wall	<64	-	ND	-	ND
TE-Ext-M021B/PCB021B	TE Building / Exterior	Very light brown paint on plywood wall	<64	-	ND	-	0.3
TE-Ext-M022A/PCB022A	TE Building / Exterior	Very light brown paint on concrete wall board	<64	-	3.8	-	ND
TE-Ext-M022B/PCB022B	TE Building / Exterior	Very light brown paint on concrete wall board	<64	-	ND	-	ND
TE-Ext-M023A/PCB023A	TE Building / Exterior	Very light brown paint on metal pipe	<64	-	ND	-	ND
TE-Ext-M023B/PCB023B	TE Building / Exterior	Very light brown paint on metal pipe	800	-	ND	-	1.7
TE-Rm73-M024A/PCB024A	TE Building / Room 73	Dark grey paint on metal door and frame	12,000	2.3	0.78	-	8.6
TE-Rm63-M024B/PCB024B	TE Building / Room 63	Dark grey paint on metal door and frame	1,100	-	3.3	-	13

Summary of Bulk and Leachability Sample Results for Lead, Mercury, and PCBs in Paints

WSP PROJECT NO. CA0037087.2445

Sample ID	Sample Location	Sample Description	Lead Concentration (ppm)	Lead Leachate (mg/L)	Mercury Concentration (ppm)	Mercury Leachate (mg/L)	PCB Concentration (ppm)
TE-Rm63-M025A/PCB025A	TE Building / Room 63	Brown paint on metal door and frame	550	-	3.9	-	8.5
TE-Rm15-M025B/PCB025B	TE Building / Room 15	Brown paint on metal door and frame	670	-	3.5	-	19
TE-Rm27-M026A/PCB026A	TE Building / Room 27	Black paint on metal door and frame	140,000	180	4.7	-	13
TE-Rm30-M026B/PCB026B	TE Building / Room 30	Black paint on metal door and frame	90,000		7.5	-	8.5
TE-Rm47-M027A/PCB027A	TE Building / Room 47	Green paint on metal door and frame	12,000	22	5.3	-	12
TE-Rm47-M027B/PCB027B	TE Building / Room 47	Green paint on metal door and frame	<64	-	0.51	-	11
TE-Rm52-M028A/PCB028A	TE Building / Room 52	White paint on metal wall panels	130	-	3.6	-	4.6
TE-Rm52-M028B/PCB028B	TE Building / Room 52	White paint on metal wall panels	1,800	-	6.6	-	7.8
TE-Rm52-M029A/PCB029A	TE Building / Room 52	Light blue paint on metal wall panels	4,300	-	4.9	-	17
TE-Rm52-M029B/PCB029B	TE Building / Room 52	Light blue paint on metal wall panels	4,500	-	2.7	-	16
TE-Rm51-M030A/PCB030A	TE Building / Room 51	Black paint on concrete and metal pad	5,200	6.1	22	-	9.2
TE-Rm51-M030B/PCB030B	TE Building / Room 51	Black paint on concrete and metal pad	5,800	8.9	7.2	-	13
TE-Rm45-M031A/PCB031A	TE Building / Room 45	White paint on drywall wall	<64	-	0.15	-	1.7
TE-Rm63-M031B/PCB031B	TE Building / Room 63	White paint on drywall wall	2,300	-	3.0	-	5.5
TE-Rm51-M032A/PCB032A	TE Building / Room 51	Light blue paint on pipe insulation and paper	770	-	34	-	4.6
TE-Rm71-M032B/PCB032B	TE Building / Room 71	Light blue paint on pipe insulation and paper	<64	-	10	-	8.9
TE-Rm51-M033A/PCB033A	TE Building / Room 51	White paint on pipe insulation and paper	440	-	33	-	6.6
TE-Rm27-M033B/PCB033B	TE Building / Room 27	White paint on pipe insulation and paper	<64	-	31	-	9.2
GB-Rm1-M001A/PCB001A	Generator Building / Room 1	White paint on metal walls	4,500	-	0.60	-	21
GB-Rm10-M001B/PCB001B	Generator Building / Room 10	White paint on metal walls	2,200	-	0.20	-	4.6
GB-Rm6-M002A/PCB002A	Generator Building / Room 6	White paint on drywall walls	2,100	-	0.69	-	2.3
GB-Rm9-M002B/PCB002B	Generator Building / Room 9	White paint on drywall walls	<64	-	13	-	3.2
GB-Rm5-M003A/PCB003A	Generator Building / Room 5	Beige paint on drywall walls	<64	-	ND	-	1.3
GB-Rm5-M003B/PCB003B	Generator Building / Room 5	Beige paint on drywall walls	<64	-	ND	-	0.9
GB-Rm1-M004A/PCB004A	Generator Building / Room 1	White paint on concrete block walls	150	-	13	-	2.9
GB-Rm1-M004B/PCB004B	Generator Building / Room 1	White paint on concrete block walls	320	-	5.3	-	2.2
GB-Rm1-M005A/PCB005A	Generator Building / Room 1	Black paint on concrete block walls	3,000	-	0.4	-	15
GB-Rm1-M005B/PCB005B	Generator Building / Room 1	Black paint on concrete block walls	3,900	-	0.32	-	15
GB-Rm4-M006A/PCB006A	Generator Building / Room 4	Black paint on drywall walls	3,200	-	2.3	-	4.5

Summary of Bulk and Leachability Sample Results for Lead, Mercury, and PCBs in Paints

WSP PROJECT NO. CA0037087.2445

Sample ID	Sample Location	Sample Description	Lead Concentration (ppm)	Lead Leachate (mg/L)	Mercury Concentration (ppm)	Mercury Leachate (mg/L)	PCB Concentration (ppm)
GB-Rm4-M006B/PCB006B	Generator Building / Room 4	Black paint on drywall walls	2,600	-	0.30	-	5.9
GB-Rm4-M007A/PCB007A	Generator Building / Room 4	Red paint on concrete walls	1,300	-	0.29	-	4.8
GB-Rm12-M007B/PCB007B	Generator Building / Room 12	Red paint on concrete walls	3,100	-	0.84	-	6.2
GB-Rm10-M008A/PCB008A	Generator Building / Room 10	Light grey paint on metal generator housing	23,000	<0.32	0.38	-	3.0
GB-Rm10-M008B/PCB008B	Generator Building / Room 10	Light grey paint on metal generator housing	27,000	<0.32	0.32	-	2.6
GB-Rm10-M009A/PCB009A	Generator Building / Room 10	Black paint on pipe insulation paper	2,500	-	0.21	-	1.0
GB-Rm10-M009B/PCB009B	Generator Building / Room 10	Black paint on pipe insulation paper	2,900	-	0.22	-	1.1
GB-Rm10-M010A/PCB010A	Generator Building / Room 10	Light grey paint on metal pipe	830	-	0.26	-	2.8
GB-Rm10-M010B/PCB010B	Generator Building / Room 10	Light grey paint on metal pipe	1,100	-	0.41	-	6.7
GB-Rm2-M011A/PCB011A	Generator Building / Room 2	Light grey paint on concrete floor	600	-	0.32	-	0.7
GB-Rm2-M011B/PCB011B	Generator Building / Room 2	Light grey paint on concrete floor	860	-	0.27	-	2.0
GB-Rm4-M012A/PCB012A	Generator Building / Room 4	Black paint on metal ceiling hangers	3,200	-	1.7	-	71
GB-Rm4-M012B/PCB012B	Generator Building / Room 4	Black paint on metal ceiling hangers	4,300	-	1.6	-	68
GB-Rm14-M013A/PCB013A	Generator Building / Room 14	Blue paint on metal door and frame	1,700	-	28	-	1.0
GB-Rm14-M013B/PCB013B	Generator Building / Room 14	Blue paint on metal door and frame	1,800	-	28	-	1.4
GB-Ext-M014A/PCB014A	Generator Building / Exterior	Very light brown paint on concrete wall board	<64	-	ND	-	ND
GB-Ext-M014B/PCB014B	Generator Building / Exterior	Very light brown paint on concrete wall board	<64	-	ND	-	ND
GB-Ext-M015A/PCB015A	Generator Building / Exterior	Very light brown paint on concrete wall	640	-	0.056	-	1.0
GB-Ext-M015B/PCB015B	Generator Building / Exterior	Very light brown paint on concrete wall	<64	-	ND	-	ND
GB-Ext-M016A/PCB016A	Generator Building / Exterior	Very light brown paint on plywood wall	<64	-	ND	-	ND
GB-Ext-M016B/PCB016B	Generator Building / Exterior	Very light brown paint on plywood wall	<64	-	ND	-	ND
GB-Ext-M017A/PCB017A	Generator Building / Exterior	Very light brown paint on metal pipe	900	-	ND	-	ND
GB-Ext-M017B/PCB017B	Generator Building / Exterior	Very light brown paint on metal pipe	300	-	2.3	-	ND
GS-Rm1-M001A/PCB001A	Guard Shack / Room 1	Off-white paint on drywall wall	280	-	3.9	-	ND
GS-Rm1-M001B/PCB001B	Guard Shack / Room 1	Off-white paint on drywall wall	570	-	2.8	-	ND
GS-Rm1-M002A/PCB002A	Guard Shack / Room 1	White paint on drywall wall	<64	-	0.088	-	ND
GS-Rm2-M002B/PCB002B	Guard Shack / Room 2	White paint on drywall wall	<64	-	3.3	-	ND
GS-Ext-M003A/PCB003A	Guard Shack / Exterior	Very light brown paint on concrete eve	<64	-	3.1	-	ND
GS-Ext-M003B/PCB003B	Guard Shack / Exterior	Very light brown paint on concrete foundation	<64	-	5.2	-	ND

Summary of Bulk and Leachability Sample Results for Lead, Mercury, and PCBs in Paints

WSP PROJECT NO. CA0037087.2445

Sample ID	Sample Location	Sample Description	Lead Concentration (ppm)	Lead Leachate (mg/L)	Mercury Concentration (ppm)	Mercury Leachate (mg/L)	PCB Concentration (ppm)
GS-Ext-M004A/PCB004A	Guard Shack / Exterior	Very light brown paint on concrete wall board	<64	-	ND	-	ND
GS-Ext-M004B/PCB004B	Guard Shack / Exterior	Very light brown paint on concrete wall board	<64	-	ND	-	ND
GS-Ext-M005A/PCB005A	Guard Shack / Exterior	Very light brown paint on metal pipe	680	-	ND	-	ND
GS-Ext-M005B/PCB005B	Guard Shack / Exterior	Very light brown paint on metal pipe	1,000	-	ND	-	ND
Regulation Guidelines							
Federal Surface Coating Materials Regulations Limits			90		10		
Landfill Bans, Special Wastes and Diversion Programs (2010) Lead Waste Screening Guideline Limit			5,000				
Leachable Toxic Waste, Testing and Disposal (2003) and Schedule II Leachate Test, Canadian Environmental Protection Act (CEPA) Proposed Regulations (2002) Leachate Waste Screening Guideline				5			
Canadian Council of Ministers of the Environment (CCME) Canadian Soil Quality Guidelines (CSQG)					50		
Leachable Toxic Waste, Testing and Disposal (GD-PPD-26.1)						0.1	
Canadian Environmental Protection Act (CEPA) PCB Regulations							50
Notes:							

1. The units of milligram per kilogram (mg/Kg) are equal to parts per million (ppm).

2. ND indicates the analyte was not detected at the reporting limit.


3. Concentrations that are **bolded** exceed the limit for lead, mercury or PCB content in paint.

4. For concentrations that are shaded in red, leachability testing is required.

5. For concentrations that are shaded in blue, leachability exceeds waste disposal limits.


ATTACHMENT 3

Sample Location Figures

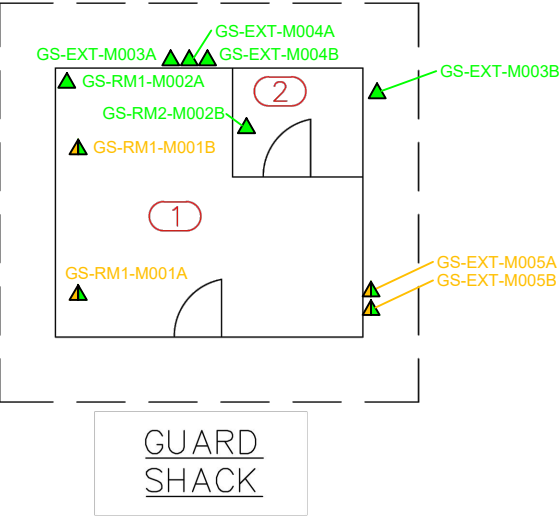

LEGEND:
PAINT SAMPLE LOCATION - NO CRITERIA EXCEEDANCES FOR LEAD OR MERCURY OR PCBs WHERE APPLICABLE
PAINT SAMPLE LOCATION - RESULTS EXCEED 90 mg/kg AND LESS THAN 5000 mg/kg FOR LEAD AND NO CRITERIA EXCEEDANCES FOR MERCURY OR PCBs WHERE APPLICABLE

NOTES: 1. ALL DIMENSIONS ARE IN METERS. 2. DO NOT SCALE FROM FIGURE. 3. THIS FIGURE IS INTENDED TO SHOW RELATIVE LOCATIONS AND CONFIGURATION OF THE STUDY AREA IN SUPPORT OF THIS REPORT. 4. ALL LOCATIONS, DIMENSIONS, AND ORIENTATIONS ARE APPROXIMATE. 5. THIS FIGURE SHOULD NOT BE USED FOR PURPOSES OTHER THAN THOSE OUTLINED ABOVE. 6. THIS FIGURE CONTAINS INTELLECTUAL PROPERTY OF NAVAL FACILITIES ENGINEERING SYSTEMS COMMAND AND MAY NOT BE REPRODUCED OR COPIED WITHOUT THEIR WRITTEN CONSENT.	Client: 		Drawn by: T. Rideout	Project: Hazardous Building Materials Assessment, Moll Point Joint Maritime Facility, Argentina Naval Air Station, Argentina, NL	Date: January 2026
	WSP Canada Inc. 36 Pippy Place St. John's, NL A1B 4A5 709-722-7023		Approved by: B. Lane		Project No. US0048429.8539
			Scale: NTS		Rev. No. 0
			Title: Sample Location Plan - Guard Shack		Figure No. 1

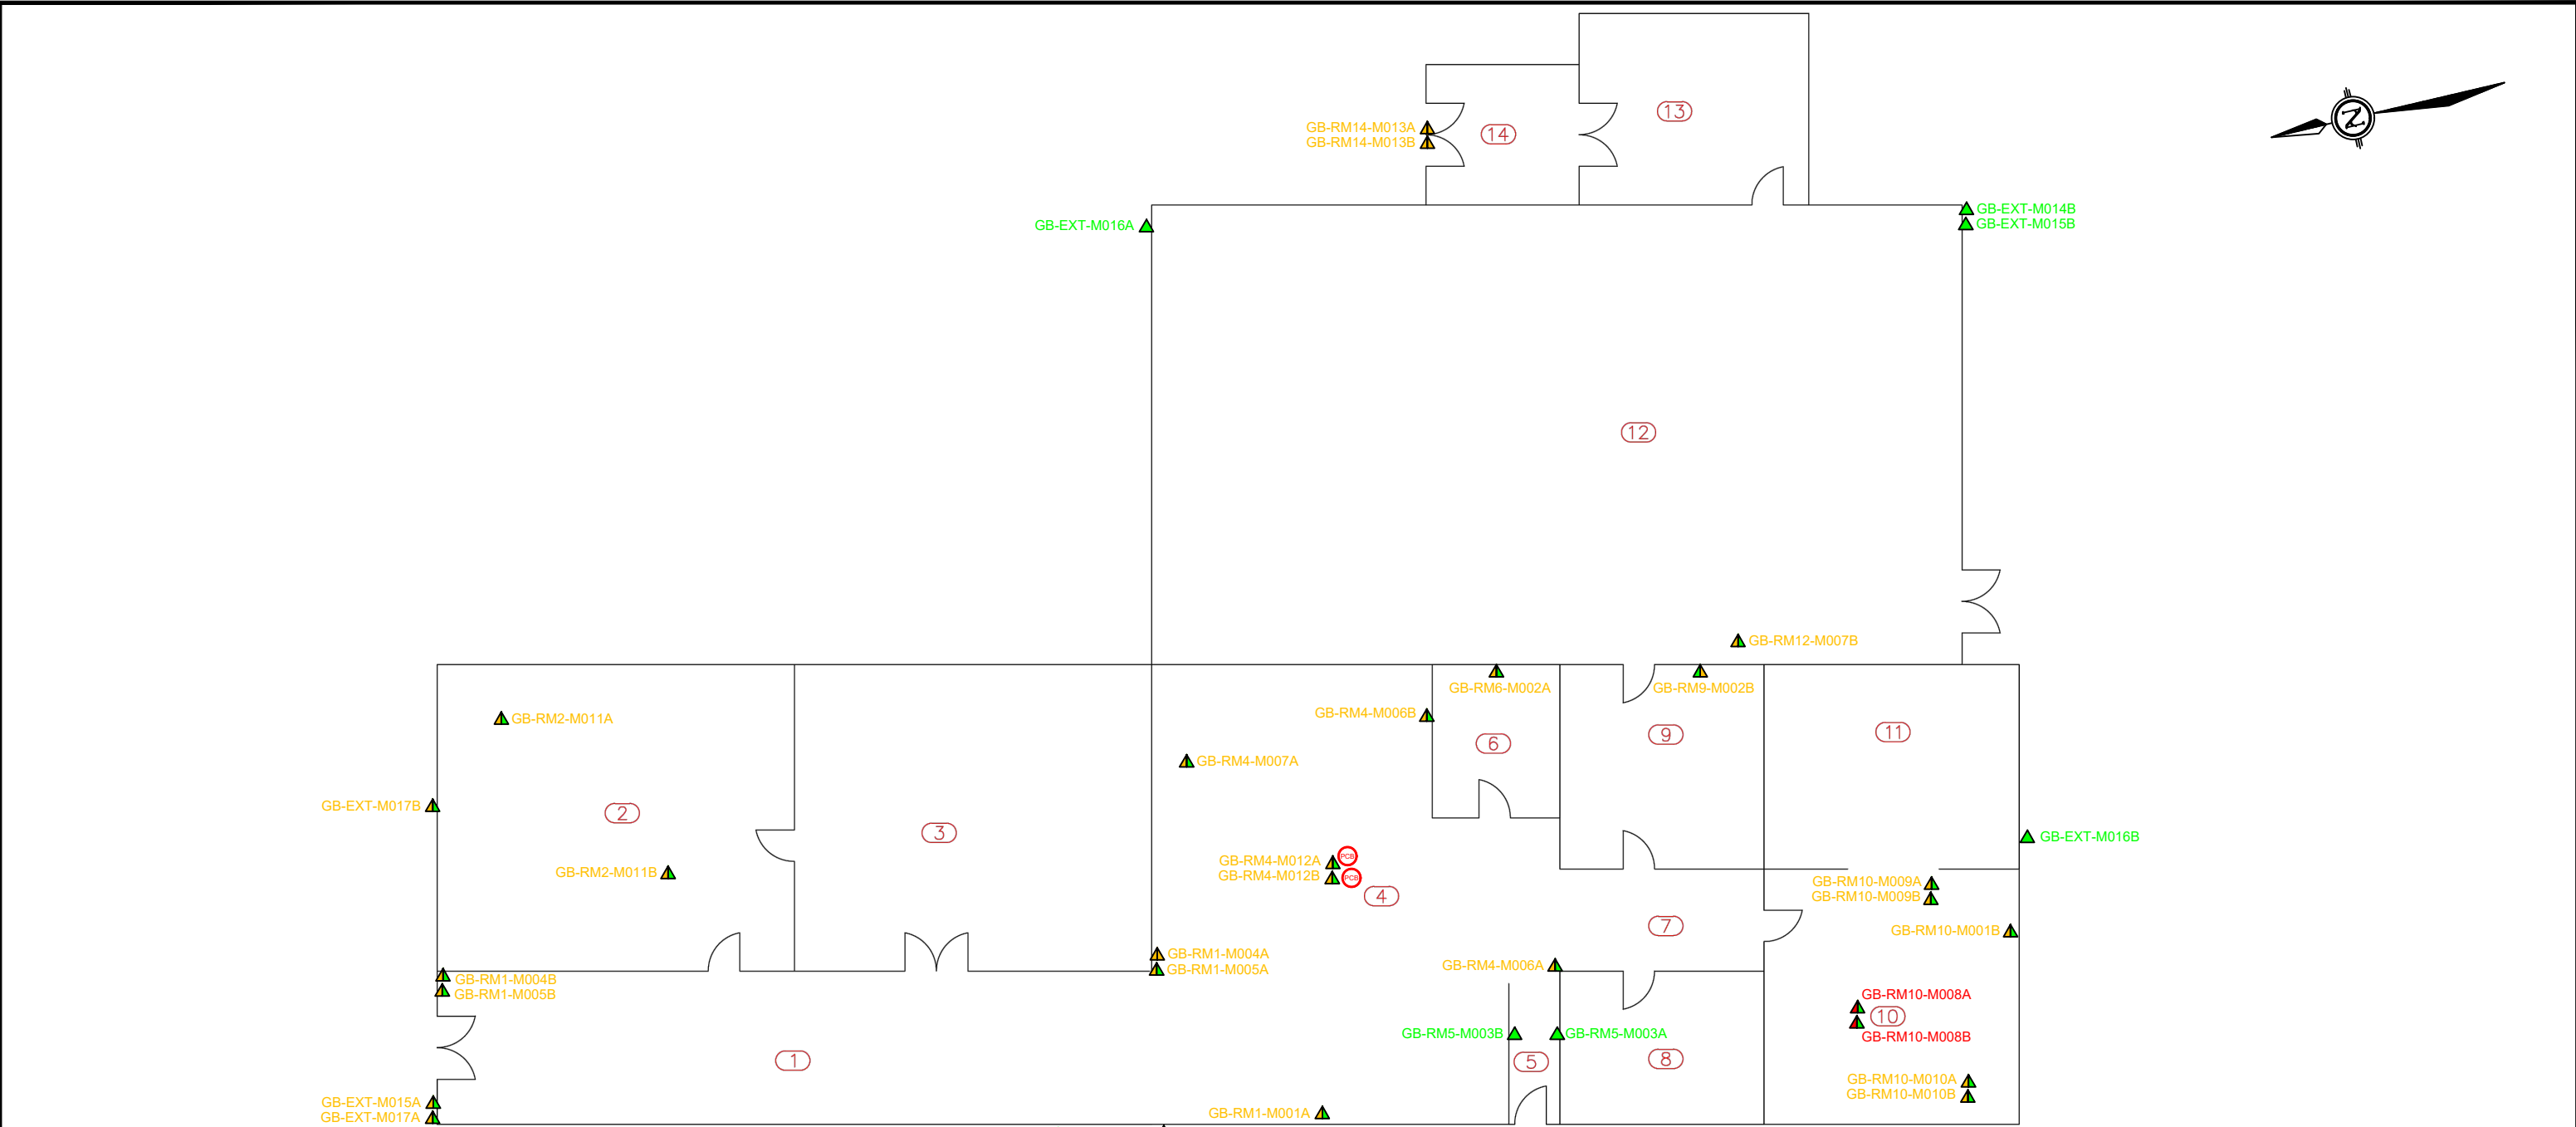

LEGEND:

- ▲ PAINT SAMPLE LOCATION - NO CRITERIA EXCEEDANCES FOR LEAD OR MERCURY OR PCBs WHERE APPLICABLE
- ▲ PAINT SAMPLE LOCATION - RESULTS EXCEED 90 mg/kg AND LESS THAN 5000 mg/kg FOR LEAD AND NO CRITERIA EXCEEDANCES FOR MERCURY OR PCBs WHERE APPLICABLE
- ▲ PAINT SAMPLE LOCATION - RESULTS EXCEED 10 mg/kg AND LESS THAN 50 mg/kg FOR MERCURY AND NO CRITERIA EXCEEDANCES FOR LEAD OR PCBs WHERE APPLICABLE
- ▲ PAINT SAMPLE LOCATION - RESULTS EXCEED 90 mg/kg AND LESS THAN 5000 mg/kg FOR LEAD AND EXCEED 10 mg/kg AND LESS THAN 50 mg/kg FOR MERCURY AND NO CRITERIA EXCEEDANCES FOR PCBs WHERE APPLICABLE
- ▲ PAINT SAMPLE LOCATION - RESULTS EXCEED 5000 mg/kg FOR LEAD AND NO CRITERIA EXCEEDANCES FOR MERCURY OR PCBs WHERE APPLICABLE
- Ⓢ RESULTS INDICATE PCB CONCENTRATIONS EXCEED 50 mg/kg FOR PCB SOLID PROVIDED IN THE CANADIAN ENVIRONMENTAL PROTECTION ACT (CEPA) PCB REGULATIONS

NOTES:

1. ALL DIMENSIONS ARE IN METERS.

2. DO NOT SCALE FROM FIGURE.

3. THIS FIGURE IS INTENDED TO SHOW RELATIVE LOCATIONS AND CONFIGURATION OF THE STUDY AREA IN SUPPORT OF THIS REPORT.


4. ALL LOCATIONS, DIMENSIONS, AND ORIENTATIONS ARE APPROXIMATE.

5. THIS FIGURE SHOULD NOT BE USED FOR PURPOSES OTHER THAN THOSE OUTLINED ABOVE.

6. THIS FIGURE CONTAINS INTELLECTUAL PROPERTY OF NAVAL FACILITIES ENGINEERING SYSTEMS COMMAND AND MAY NOT BE REPRODUCED OR COPIED WITHOUT THEIR WRITTEN CONSENT.

Client:


WSP
Canada Inc.
36 Pippy Place
St. John's, NL A1B 4A5
709-722-7023

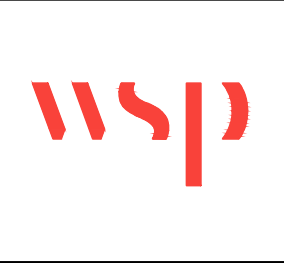

Drawn by:
T. Rideout

Approved by:
B. Lane

Scale:
NTS

Project:

Hazardous Building Materials Assessment,
Mulpoint Joint Maritime Facility,
Argentia, NL

Title:


Sample Location Plan - Generator Building

Date:
January 2026

Project No.
US0048429.8539

Rev. No.
0

Figure No.
2

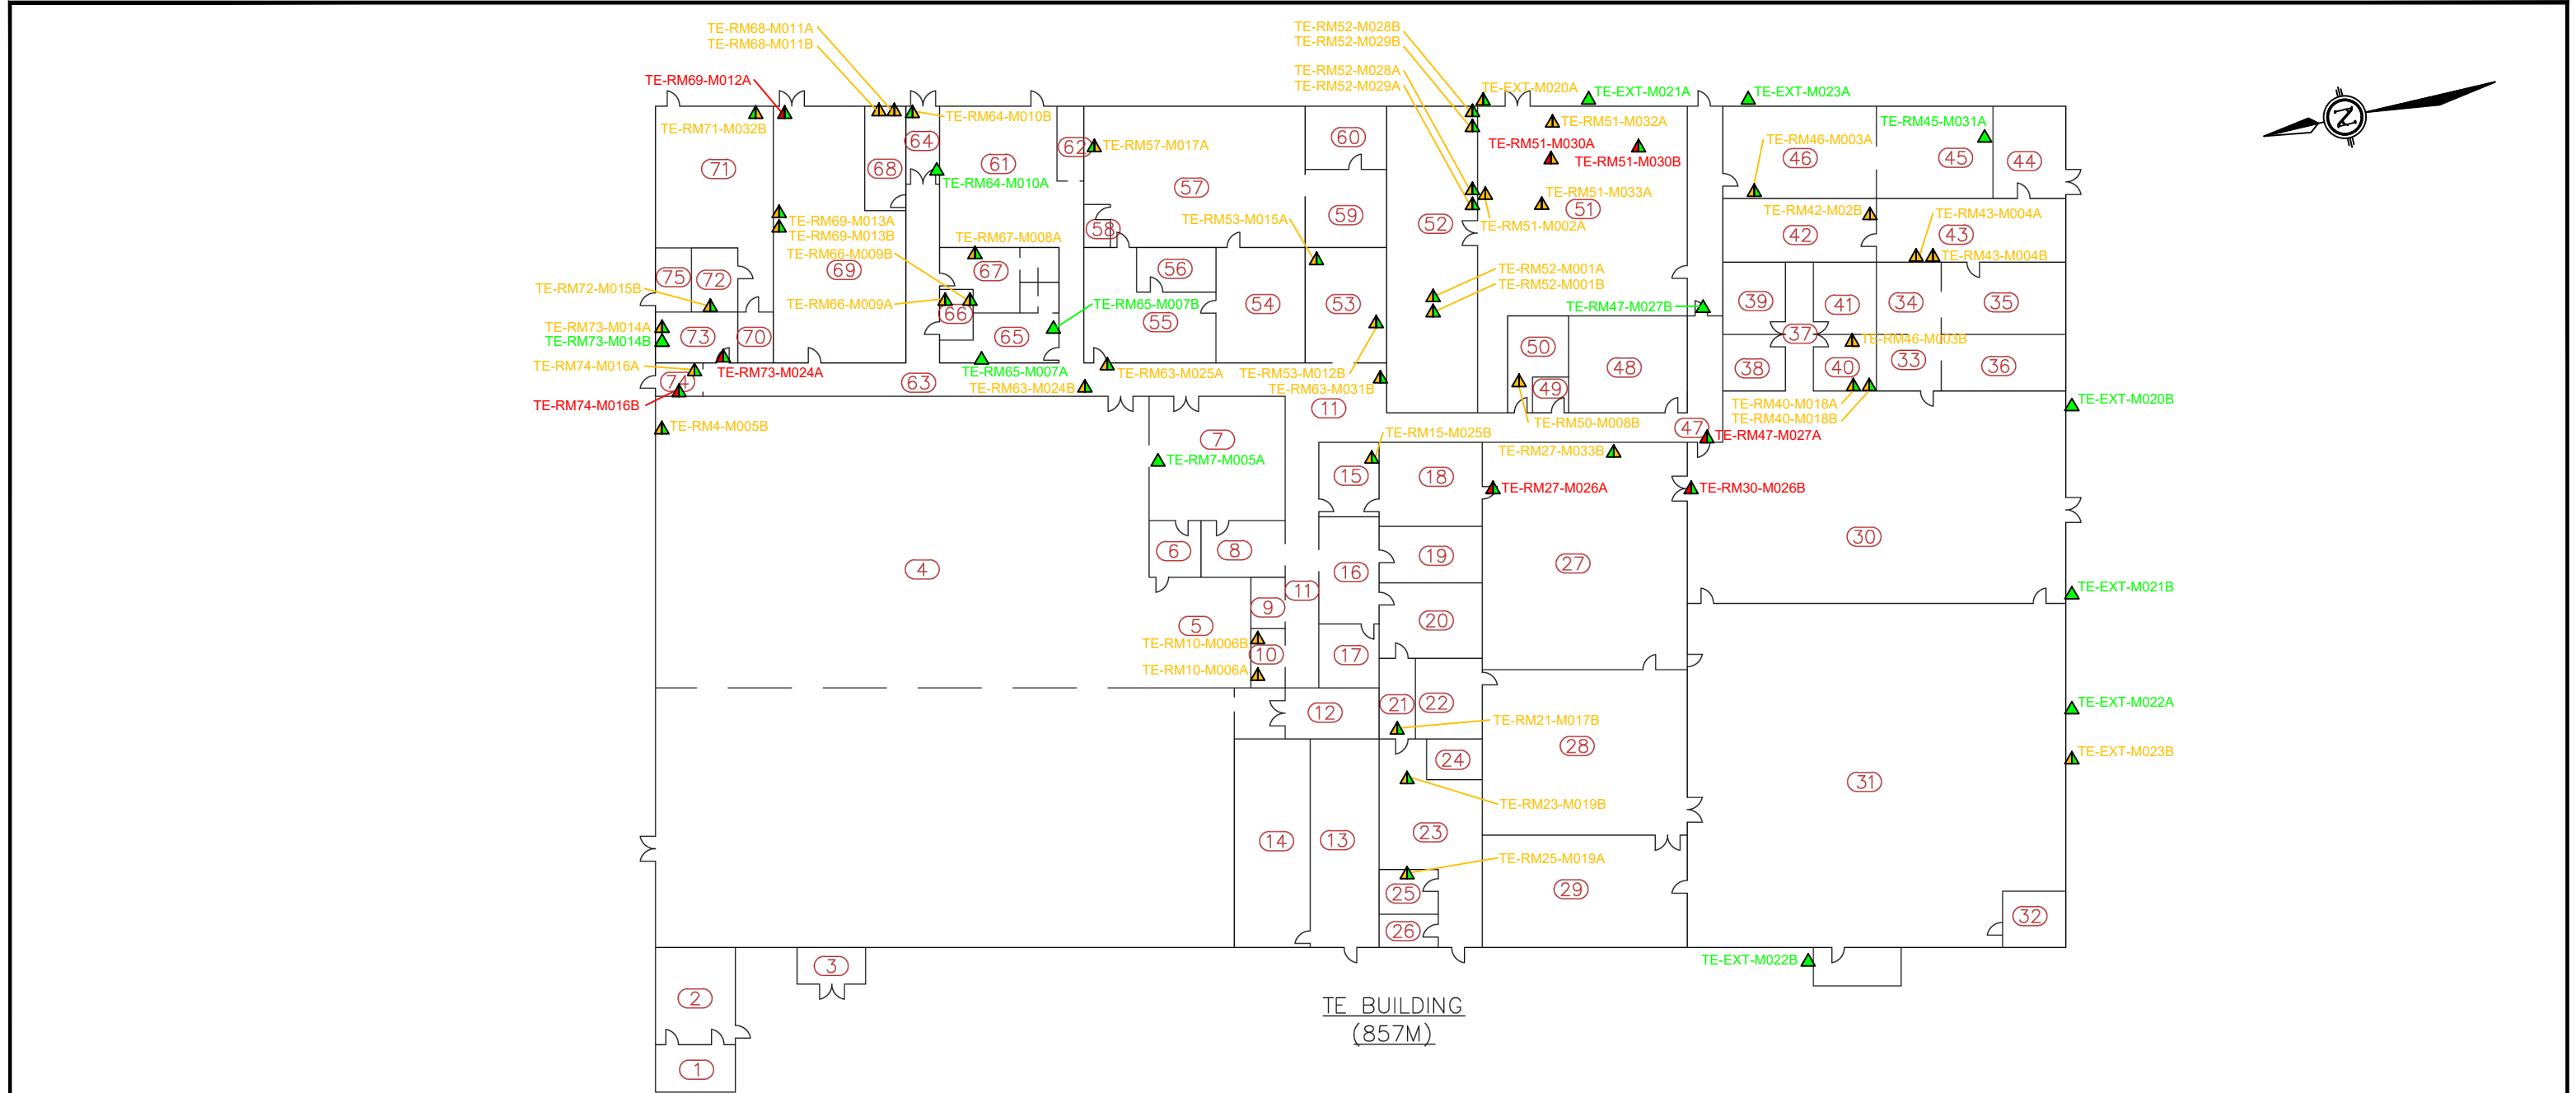

- LEGEND:**
- ▲ PAINT SAMPLE LOCATION - NO CRITERIA EXCEEDANCES FOR LEAD OR MERCURY OR PCBs WHERE APPLICABLE
 - ▲ PAINT SAMPLE LOCATION - RESULTS EXCEED 90 mg/kg AND LESS THAN 5000 mg/kg FOR LEAD AND NO CRITERIA EXCEEDANCES FOR MERCURY OR PCBs WHERE APPLICABLE
 - ▲ PAINT SAMPLE LOCATION - RESULTS EXCEED 10 mg/kg AND LESS THAN 50 mg/kg FOR MERCURY AND NO CRITERIA EXCEEDANCES FOR LEAD PCBs WHERE APPLICABLE
 - ▲ PAINT SAMPLE LOCATION - RESULTS EXCEED 90 mg/kg AND LESS THAN 5000 mg/kg FOR LEAD AND EXCEED 10 mg/kg AND LESS THAN 50 mg/kg FOR MERCURY AND NO CRITERIA EXCEEDANCES FOR PCBs WHERE APPLICABLE
 - ▲ PAINT SAMPLE LOCATION - RESULTS EXCEED 5000 mg/kg FOR LEAD AND NO CRITERIA EXCEEDANCES FOR MERCURY OR PCBs WHERE APPLICABLE
 - ▲ PAINT SAMPLE LOCATION - RESULTS EXCEED 5000 mg/kg FOR LEAD AND EXCEED 10 mg/kg AND LESS THAN 50 mg/kg FOR MERCURY AND NO CRITERIA EXCEEDANCES FOR PCBs WHERE APPLICABLE

NOTES:

1. ALL DIMENSIONS ARE IN METERS.

2. DO NOT SCALE FROM FIGURE.

3. THIS FIGURE IS INTENDED TO SHOW RELATIVE LOCATIONS AND CONFIGURATION OF THE STUDY AREA IN SUPPORT OF THIS REPORT.

4. ALL LOCATIONS, DIMENSIONS, AND ORIENTATIONS ARE APPROXIMATE.

5. THIS FIGURE SHOULD NOT BE USED FOR PURPOSES OTHER THAN THOSE OUTLINED ABOVE.

6. THIS FIGURE CONTAINS INTELLECTUAL PROPERTY OF NAVAL FACILITIES ENGINEERING SYSTEMS COMMAND AND MAY NOT BE REPRODUCED OR COPIED WITHOUT THEIR WRITTEN CONSENT.

Client:



WSP
Canada Inc.
36 Pippy Place
St. John's, NL A1B 4A5
709-722-7023



Drawn by:
T. Rideout

Approved by:
B. Lane

Scale:
NTS

Project:
Hazardous Building Materials Assessment,
Moll Point Joint Maritime Facility, Argentia
Naval Air Station, Argentia, NL

Title:
Sample Location Plan - TE Building (857M)

Date:
January 2026

Project No.
US0048429.8539

Rev. No.
0

Figure No.
3