

Ship/HULL NO.	Ship/HULL NAME	JON:	ICN:	Rev:	Key Op:
LCU-1651	NBU-7		38NBA10032		A01

TITLE:

Exterior Hull; repair

JOB SPECIFICATION

Anticipated Award Date: <i>4/17/2026</i>	Production Completion Date: <i>8/29/2026</i>	PREPARING ACTIVITY:			
POP Start Date: <i>6/01/2026</i>	POP End Date: <i>9/30/2026</i>	SASEBO			
PREPARED BY: T.SATO	CODE H ST	DATE 4/02/2026			
APPROVED BY: S.MURAKAMI	CODE S225				
CONCURRED BY: S.MOROOKA	CODE S231				
ASSIST PLANNER'S NAME: H.SENOO	CODE M SE				
ASSIST PLANNER'S NAME: M.YAMASHITA	CODE E YM				
ASSIST PLANNER'S NAME:	CODE				
DESCRIPTION:					
JSN(S): CU51-2098		CASREP #			
S/F CONTACT: MOREL MN2 / KHULLAR GSCS		CWP #		CCNS #	
Approved by S300/S900		A. REYES PM, S310		Date: <i>4/16/26</i>	
				Avl: 6C2	
				LWC:	
Work Completed					
S/Force:		Rate:		Date:	
Ship Supt:		Date:		SRF CONTROL NO.: 1301357121	
WORK CERTIFICATION SIGNATURES					
COMPLETION OF WORK REVIEW:	BADGE NO.:	SHOP/CODE:	PHONE:	DATE:	

Ship/HULL NO.	Ship/HULL NAME	JON:	ICN: 38NBA10032	Rev:	Key Op: A01
LCU-1651	NBU-7				

TITLE:

Exterior Hull; repair

1. SCOPE:

1.1 Title: Exterior Hull; repair

1.2 Location of Work:

1.2.1 Vehicle Deck, Main Deck Weather

1.2.2 Pilot House (1-28-1-C)

1.2.3 S.W Ballast Tank (2-18-1-W)

1.2.4 S.W Ballast Tank (2-18-2-W)

1.2.5 Deck House

1.2.6 Bulwark

1.2.7 Galley and Mess Room (1-35-1-L)

1.2.8 Ramp Handling Machinery Compartment (2-12-0-Q)

1.2.9 Boatswain's Storeroom (2-23-0-A)

1.2.10 Flammable Liquid Storeroom (2-23-2-A)

1.2.11 Craft Office and Training Center (2-28-0-L)

1.2.12 Air Conditioning Machinery Room (2-28-2-E)

1.2.13 Crew Berthing (2-33-0-L)

1.2.14 Craftmaster's Stateroom (2-33-1-L)

1.2.15 Crew Living Space (2-33-2-L)

1.2.16 Supply Storeroom (2-40-0-A)

1.2.17 Magazine (2-40-2-M)

1.2.18 FWD Engine Room (2-50-0-E)

1.2.19 AFT Engine Room (2-56-0-E)

1.2.20 Anchor Winch Compartment (2-62-0-Q)

1.2.21 Steering Gear Compartment (2-71-0-Q)

1.2.22 Void Space (2-18-0-V)

1.2.23 Void Space (2-66-1-V)

1.2.24 Void Space (2-66-2-V)

Ship/HULL NO.	Ship/HULL NAME	JON:	ICN:	Rev:	Key Op:
LCU-1651	NBU-7		38NBA10032		A01

TITLE:

Exterior Hull; repair

1.3 Identification:

1.3.1 Quantity (One EA), Central Machinery Monitoring and Control System (CMMCS) Pilot House Main Console Located in 1.2.2, Refer to Section 51-A of 2.4

1.3.1.1 Quantity (2 EA), Manual Throttle Control Head Cable, refer to PLAN 19-A of 2.4

1.3.1.2 Quantity (2 EA), Marine Gear Control Cable of PORT and Starboard (STBD) Engine, refer to PLAN 19-A of 2.4

1.3.1.3 Quantity (2 EA), PORT and STBD Engine Remote Shutdown Cable, refer to PLAN 19A of 2.4

1.3.2 Quantity (2 EA), Ballast Tank as Follow, Located in 1.2.3 and 1.2.4

<u>Tank No.</u>	<u>Capacity at 100 Percent Full</u>	<u>Tank</u>
2-18-1-W	3,400 GL	Ballast Tank
2-18-2-W	3,400 GL	Ballast Tank

1.3.3 A Total of (6 SF) of Bulkhead Plating on Forward of Pilot House, Located in 1.2.2 and 1.2.5

1.3.4 Quantity (One EA), Ventilation Duct Weather Opening on Deck House Exterior Bulkhead, SECTION "9-A" of 2.19, Located in 1.2.2 and 1.2.5

1.3.5 Quantity (2 EA), Freeing Port, DETAIL 4-B of 2.14, Located in 1.2.1 and 1.2.6

1.3.6 Quantity (14 EA), Staple on Deck for Hook of Freeing Port Cover, DETAIL 5-A of 2.14, Located in 1.2.1

2. REFERENCES:

2.1 Standard Items (FY26)

2.2 113-5108775 Rev A, Central Machinery Monitoring and Control System Console Fabrication

2.3 S9202-BW-OMP-010, Rev 2, Central Machinery Monitoring and Control System(CMMCS); Classes LCU-1610, 1627, 1646 and 1680; Operation and repair Manual, with Parts List

2.4 560-5108781, Central Machinery Monitoring and Control System MECH INSTL

Ship/HULL NO.	Ship/HULL NAME	JON:	ICN: 38NBA10032	Rev:	Key Op: A01
LCU-1651	NBU-7				

TITLE:

Exterior Hull; repair

- 2.5 300-5108779 Rev A, B/A 328A Central Machinery Monitoring and Control System Installation
- 2.6 320-5108780 Rev A, B/A 328A Central Machinery Monitoring and Control System Power MODS
- 2.7 300-5108783 Rev A, B/A 828A Central Machinery Monitoring and Control System Steering Consoles Assembly
- 2.8 300-5112181, LCU 1651 Electrical Selected Record Diagram
- 2.9 302-5111433, BOSN Storeroom Ventilation MOD ELEC INSTL
- 2.10 MIL-STD-1310H, Shipboard Bonding, Grounding, and Other Techniques for Electromagnetic Compatibility, Electromagnetic Pulse (EMP) Mitigation, and Safety
- 2.11 123-2889614 Rev G, Doors, Hatches, Manholes and Airport Schedule
- 2.12 805-1626726 Rev F, Flush W.T. & O.T. Bolted Plate Manhole 15" X 23" & 15" X 18"
- 2.13 100-2889594 Rev F, Shell Expansion
- 2.14 100-2889596 Rev B, Bulwarks
- 2.15 107-2889600 Rev F, Vehicle Deck Framing & Plating
- 2.16 111-2889602 Rev F, Deckhouse Structure and Joiner Bulkheads
- 2.17 600-2889671 Rev D, Deck Fittings Arrangement & Details
- 2.18 108-2889601 Rev A, Forecastle Deck, Side Plating & Framing
- 2.19 501-2889653 Rev H, Ventilating, Air Conditioning & Heating ARRGT & Details
- 2.20 607-2889680 Rev A, Hull Thermal Insulation
- 2.21 S9086-CH-STM-010/CH-074/V1/Rev 6, Welding and Allied Processes
- 2.22 S9086-DA-STM-010/CH-100/Rev 4, Hull Structures

3. REQUIREMENTS:

(V) "REPORT"

- 3.1 Submit one legible copy of Marine Chemist certificate to SUPERVISOR including certified location.

Ship/HULL NO.	Ship/HULL NAME	JON:	ICN:	Rev:	Key Op:
LCU-1651	NBU-7		38NBA10032		A01

TITLE:

Exterior Hull; repair

3.1.1 Clean each space affected hot work area for Marine Chemist inspection.

3.2 Disconnect electrically and mechanically, and remove CMMCS pilot house main console listed in 1.3.1 for repair work, using 2.2 and 2.5 through 2.9 for guidance.

3.2.1 Matchmark, identify and retain disconnected hardware.

3.2.2 Disconnect each cable listed in 1.3.1.1 through 1.3.1.3, using Paragraph 6-6.5.5 and Figure 7-4 of 2.3 and 2.4 for guidance.

3.2.2.1 Mark the location of each cable to ensure correct reinstallation.

3.2.2.2 Measure and record each existing cable installation condition of each cable connection.

3.3 Accomplish the requirements of ENCLOSURE (T) for cleaning of each ballast tank listed in 1.3.1, using 2.11 and 2.12 for guidance.

3.4 Accomplish the requirements for repair of each section listed in 1.3.3 through 1.3.6, using Section 6 of 2.21, 100-2.8 of 2.22, 2.13 through 2.20 and ENCLOSURE (A) for guidance.

3.4.1 Remove each damaged existing, template, fabricate and install each new bulkhead plating listed in 1.3.3 out of new 3/16 inch thick mild steel plate conforming to ABS Grade A.

3.4.2 Remove each damaged existing, template from ship, fabricate and install new ventilation duct weather opening listed in 1.3.4 out of 3/16 inch thick mild steel plate.

3.4.3 Remove each damaged existing, template from ship, fabricate and install each new freeing port listed in 1.3.5 out of new 1/4 inch thick mild steel plate.

3.4.4 Template, fabricate and install each new staple on deck listed in 1.3.6 out of new 3/8 inch diameter steel round bar with new link to suit shipboard condition.

3.4.5 Accomplish the requirements of 009-012 of 2.1, including Table 4, Column A, Lines One through 7 for welding. (See NOTE 4.3)

(V) "REPORT"

3.4.5.1 Ensure to notify which welding standard has been selected to SUPERVISOR.

3.4.6 Accomplish the requirements of 009-025 of 2.1 for a local air hose test of each new welded joint of watertight boundary. Allowable leakage: None.

Ship/HULL NO.	Ship/HULL NAME	JON:	ICN:	Rev:	Key Op:
LCU-1651	NBU-7		38NBA10032		A01

TITLE:

Exterior Hull; repair

3.5 Install and connect CMMCS pilot house main console listed in 1.3.1 and retained hardware of 3.2.1, using 2.2 and 2.5 through 2.9 for guidance.

3.5.1 Connect and verify connections.

3.5.2 Bonding and grounding must be in accordance with 2.10.

3.5.3 Connect each cable listed in 1.3.1.1 through 1.3.1.3 using recorded measurement data of 3.2.2.2, Paragraph 6-6.5.6 and Figure 7-4 of 2.3 and 2.4 for guidance.

3.5.3.1 Verify correct operation of each cable prior to starting each main engine. Binding of each cable is not allowed.

3.6 Accomplish the requirements of 009-032 of 2.1 for cleaning and preservation of each new and disturbed surface to match surrounding areas.

4. NOTES:

4.1 Initial Condition - It was discovered natural vent duct and FWD bulkhead of pilot house are heavily corroded, and required to repair them.

4.2 SRF Tool Room will issue pressure gauges, torque wrenches and depth gauges when required.

4.3 OPTION A) of Table 4 of 009-012 of 2.1 has been allowed to utilize under ELM-255171.

4.4 Fabrication and installation of cover plate for freeing port will be covered by ICN 38NBA52601_H01.

5. GOVERNMENT FURNISHED MATERIAL (GFM) :

5.1 Government Furnished Material as follows.

MATERIAL LIST

MATERIAL LIST									
ITEM NO.	PC NO.	REF NO.	M / C	DESCRIPTION	STOCK NUMBER	HAZ MAT	DOC NO.	QTY REQD/ UNIT	PARA NO.
008			M	BAR,ROUND, STEEL, GALVANIZED, 3/8-IN DIA, 8 FT/EA, P/N: 9120K34	9B 9510 SA2502008	N	5336E700	2/EA	3.4
009			M	LINK,CHAIN,END, SIZE: 1/2-IN DIA, GALVANIZED STEEL, P/N: 1014093	9B 4010 016171547 LC	N	5254B013	20/EA	3.4
010			M	SHEET,METAL, STEEL, 3/16 IN THK, 48-IN W X 12-FT LG, ASTM A36	9B 9515 012677569	N	5254B014	1/SH	3.4
011			M	STRUCTURAL ANGLE, 1-IN X 1-IN X 1/8-IN THK, GALVANIZED STEEL, 6-FT LG/EA, P/N: 8968K12	9Z 9520 SA2502009	N	5336E701	2/EA	3.4

Ship/HULL NO.	Ship/HULL NAME	JON:	ICN:	Rev:	Key Op:
LCU-1651	NBU-7		38NBA10032		A01

TITLE:

Exterior Hull; repair

MATERIAL LIST									
ITEM NO.	PC NO.	REF NO.	M / C	DESCRIPTION	STOCK NUMBER	HAZ MAT	DOC NO.	QTY REQD/ UNIT	PARA NO.
021			M	PLATE,METAL, MILD STEEL, 5 FT X 20 FT X 5/16" THK, MIL-S-22698C GRADE A	9B 9515 001533217	N	6090B027	1/PM	3.4
022			M	PLATE,METAL, MILD STEEL, 5FT X 20FT X 3/16"THK, MIL-S-22698C GRADE A	9B 9515 002375333	N	6090B028	1/PM	3.4
023			M	PLATE,METAL, MILD STEEL, 5FT X 20 FT X 1/4" THK, MIL-S-22698C GRADE A	9B 9515 001533184	N	6090B025	1/PM	3.4
024			M	ELECTROD, WELDING ROD, 1/8 INCH DIA, 14 INCH LG, 7018-M, MIL-E-22200/10, U/I; 10LBS/CN, P/N; 255014110 CERTIFICATION IS NOT REQUIRED.	9G 3439 SA4742863	N	6090E900	1/CN	3.4
025			M	ELECTROD, WELDING ROD, 3/32 INCH DIA, 14 INCH LG, 7018-M, MIL-E-22200/10, U/I; 10LBS/CN, P/N; 255014102 CERTIFICATION IS NOT REQUIRED.	9G 3439 SA4742861	N	6090E901	3/CN	3.4
026			M	INSULATION, BLOCK, THERMAL BOARD, 1 INCH THK X 2 FEET X 3 FEET , MIL-DTL-32585, TYPE 1, FORM 1, FACING B, 20 EA/BX	9Q 5640 008096312	N	6090B035	1/BX	3.4
027			M	INSULATION, BLOCK, THERMAL BOARD, 2 INCH THK X 2 FEET X 3 FEET , MIL-DTL-32585, TYPE 1, FORM 1, FACING B, 10 EA/BX	9Q 5640 008096315	N	6090B036	1/BX	3.4
028			M	ADHESIVE, WHITE, MIL-A-3316D CL-1 GR-A, 1GL/CN	9B 8040 002738708	Y	6090B808	1/GL	3.4
029			M	CAP,SNAP, FASTENER, FASTENER, ALUMINUM FOR INSULATION	9B 5325 007377648	N	6090B034	1/HD	3.4
030			M	TAPE,TEXTILE, 2 INCH W X 50 YARD, MIL-C-20079H TY-II CL-1, 50 YD/RL	9B 8315 002671632	N	6090B030	1/RO	3.4
031			M	NUT,PLAIN, HEXAGON, 5/8-11UNC-2B, BRASS	9B 5310 013502905	N	6090B037	75/EA	3.3
032			M	WASHER,FLAT, 0.656"ID X 1.312"OD X 0.095"THK, CRES, NASM15795, P/N: MS15795-820	9B 5310 006143505 SY	N	6090B032	75/EA	3.3
033			M	CORK AND RUBBER, SHEET, SAE-AMS-C-6183, TYPE-II CLASS-1, GRADE-B SIZE; 0.188 INCH THK X 36 INCH W X 36 INCH LG	9B 5330 SA6894411	N	6090E902	4/SH	3.3
034			M	ANTISEIZE COMPOUND, A-A-59313, 8 OZ/TU	9B 8030 002921102	Y	6090B809	1/TU	3.3
035			C	BAR,METAL, FLAT BAR, 1/2 INCH THK X 4 INCH WIDTH, ABS GR A	9Z 9515 SA2600846	N		12/FT	-
200			C	PACKING, P/N: M16685TYPE1SIZEA	9B 5330 013760818	N	5230B030	3/EA	-
201			C	PACKING, P/N: M16685TYPE1SIZEB	9B 5330 013760811	N	5230B031	3/EA	-
202			C	PACKING, P/N: M16685TYPE1SIZEC	9B 5330 013760812	N	5230B032	3/EA	-
203			C	PACKING, P/N: M16685TYPE1SIZED	9B 5330 013760819	N	5230B033	3/EA	-
204			C	PACKING ASSEMBLY, M16685TYPE1SIZEJ	9B 5330 013760816	N	5230B060	1/EA	-

Ship/HULL NO.	Ship/HULL NAME	JON:	ICN:	Rev:	Key Op:
LCU-1651	NBU-7		38NBA10032		A01

TITLE:

Exterior Hull; repair

General Requirements
For Tank, Void and/or Cofferdam Cleaning

Ver.05012021

1. REQUIREMENTS:

1.1 Open, ventilate, conduct gas free, empty, clean, render dry, and maintain each tank, void and/or cofferdam throughout the work item performance period.

1.1.1 Ensure that each harmful vapor, fume, and mist is ventilated to the exterior of the vessel.

(V) "REPORT"

1.1.1.1 Submit one legible copy of a report listing the location, origin, and quantity of each manhole cover removed in 1.1 with respect to its tank, ship's frame and distance off centerline to SUPERVISOR after the inspection.

1.1.2 Remove and dispose of waste liquid that is not being stored for reuse to a Government provided waste liquid conveyance.

1.1.2.1 Contact the SRF-JRMC Detachment Sasebo ESH Division, Environmental Branch, S106.3 prior to transfer of waste liquid to the conveyance.

1.1.2.2 Provide watches and following spill kits (absorbent pads, booms, etc. for oil or chemical spill containment) at each affected area where waste liquid is being transferred to ensure that each liquid is not released to any shipboard compartment or the sea. In case of a spill, take immediate action to contain the spill, and contact S106.3.

1.1.2.3 Identify each transfer hose to the conveyance by affixing the company's name and tank/space location pumping from on each hose.

1.1.2.4 Establish and maintain communication between the pumping station and the conveyance when the waste liquid is being transferred.

(V) "INSPECT PIPING AND HOSE ALIGNMENT"

1.1.2.5 Inspect alignment of each hose, valve and piping in the flow path prior to the start of pumping, purging, or flushing.

1.1.2.6 Accomplish a periodic walkthrough of each piping, hose, and valve alignment for leaks at least once an hour.

1.1.2.7 Pumping after sunset is not authorized unless approved by SUPERVISOR.

ENCLOSURE (T) 1/2

8/11

Ship/HULL NO.	Ship/HULL NAME	JON:	ICN:	Rev:	Key Op:
LCU-1651	NBU-7		38NBA10032		A01

TITLE:

Exterior Hull; repair

1.1.3 Coordinate the off-loading or transferring of each fluid through the ship's Damage Control Assistant (DCA), via SHIPSUPT, to maintain ship's stability and to prevent flooding.

(V) (G) "VISUAL INSPECTION"

1.2 Inspect each tank, void and/or cofferdam for cleanliness, prior to final closing. Document the personnel who were present during the inspection and confirm that they have exited the space prior to closure of each tank, void, and cofferdam. Designate one person to account for personnel who may have entered the space. -S130

1.2.1 Install each manhole cover for each tank, using each new gasket and fastener.

2. NOTES:

2.1 Booklet of General Plans and Tank Sounding Tables are available for review at the office of the SUPERVISOR.

2.2 The SUPERVISOR will provide a waste liquid conveyance to accumulate waste liquids in each tank for work being accomplished for SRF-JRMC availabilities.

2.3 See additional CHT/sewage tanks disinfection requirements of Local Standard Item 099-901YO for SRF-JRMC Sasebo availabilities.


ENCLOSURE (T) 2/2

9/11

Ship/HULL NO.	Ship/HULL NAME	JON:	ICN:	Rev:	Key Op:
LCU-1651	NBU-7		38NBA10032		A01


TITLE:

Exterior Hull; repair

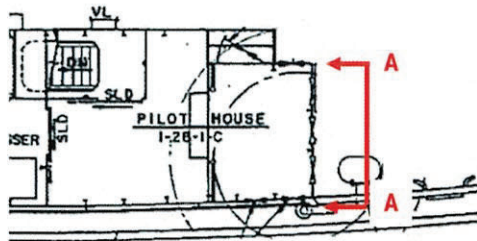

VIEW "A-A"

Yellow Box : Damaged Bulkhead of FWD Pilot House listed in 1.3.3

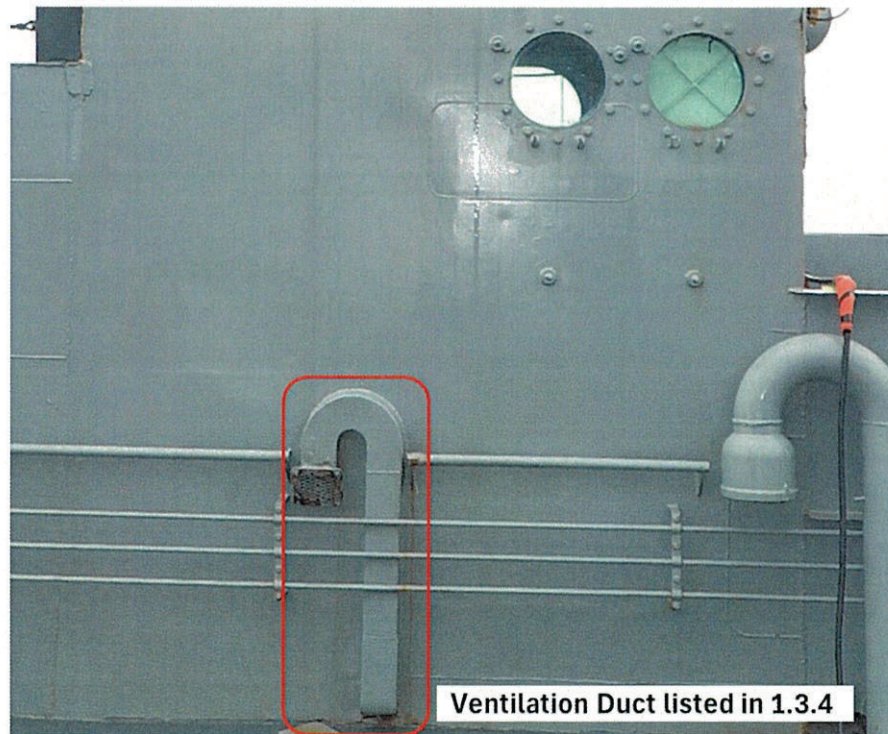

ENCLOSURE (A) 1/2

10/11

Ship/HULL NO.	Ship/HULL NAME	JON:	ICN:	Rev:	Key Op:
LCU-1651	NBU-7		38NBA10032		A01

TITLE:
Exterior Hull; repair

