

Project #3: Range 76, 30mm Gunnery

Part 1: Demolition Activities

- Building Demolition:
 - Demolish and remove four (4) existing range buildings, identified as U074B, U074C, U074E, and U074F.
 - This work includes the removal of all associated foundations and slabs, and the disposal of all resulting debris.
 - Electrical & Communication System Demolition:
 - Remove and dispose of existing overhead power and communication lines along the specified route. The electrical demolition includes:
 - Approximately 14,250 feet of #4 ACSR overhead primary conductor.
 - Twenty-five (25) 45-foot Class 2 wood poles.
 - One (1) 35-foot Class 2 wood guy pole.
 - One (1) 50kVA pole-mounted transformer and two (2) associated cut-outs.
 - Work includes the installation of new dead-end insulators and a guy wire assembly to safely terminate the remaining active line.
 - All work in this section must be coordinated and completed by City Light and Power (JBLM privatized utility service). It is expected to be a cost incurred by the Contractor.
 - Site Demolition:
 - Bulldoze and remove one (1) existing earth berm identified as an obstruction on the Range 76 Site Plan. The excavated material shall be graded to match the surrounding terrain or disposed of as needed.
-

Part 2: Installation of New Work


- Site Preparation:
 - Perform tree clearing and oak mitigation within the designated footprint of the new gunnery lane, as indicated on the Tree Removal site plan.
- Battle Positions:
 - Construct four (4) new Reverse Slope Battle Positions (BP #1, BP #2, BP #3, and BP #4) at the locations specified on the site plan.
 - Construction shall adhere strictly to the standard design drawings BP-04 and BP-05.
 - Work includes:
 - Excavation, grading, and site preparation for each position.

- Installation of concrete structures, including turning pads and retaining walls, using concrete with a minimum 28-day compressive strength of 4,000 PSI.
 - Installation of all reinforcing steel per ASTM A615, Grade 60 specifications.
 - Placement and compaction of gravel surfacing on access roads and pads.
 - Installation of rip-rap for erosion control on designated slopes.
 - All areas disturbed by construction shall be revegetated to match the natural surroundings without impeding target visibility.
 - Observation Position:
 - Construct a new range viewing area on Cherry Hill.
 - New observation position requires level space for parking and observation. Area must be cleared, leveled, and graded.
-


Part 3: Repair of Existing Systems

- Range Roads:
 - Repair existing range roads that are weathered and deteriorated.
 - Work includes grading to remove ruts and potholes, re-establishing the proper road cross-section, removing encroaching vegetation, and applying new crushed stone or gravel to create a stable, all-weather driving surface.
- Moving Armor Target (MAT) Track System:
 - Perform a comprehensive repair and realignment of the existing MAT track system.
 - Work includes:
 - Full replacement of the existing rail, ballast material, and deteriorated ties.
 - Realigning the track system geometry to ensure safe and proper operation of the targets.
 - Providing adequate drainage around the track system to prevent future water damage and ballast degradation.

Gunnery Range 76 – Project Locations

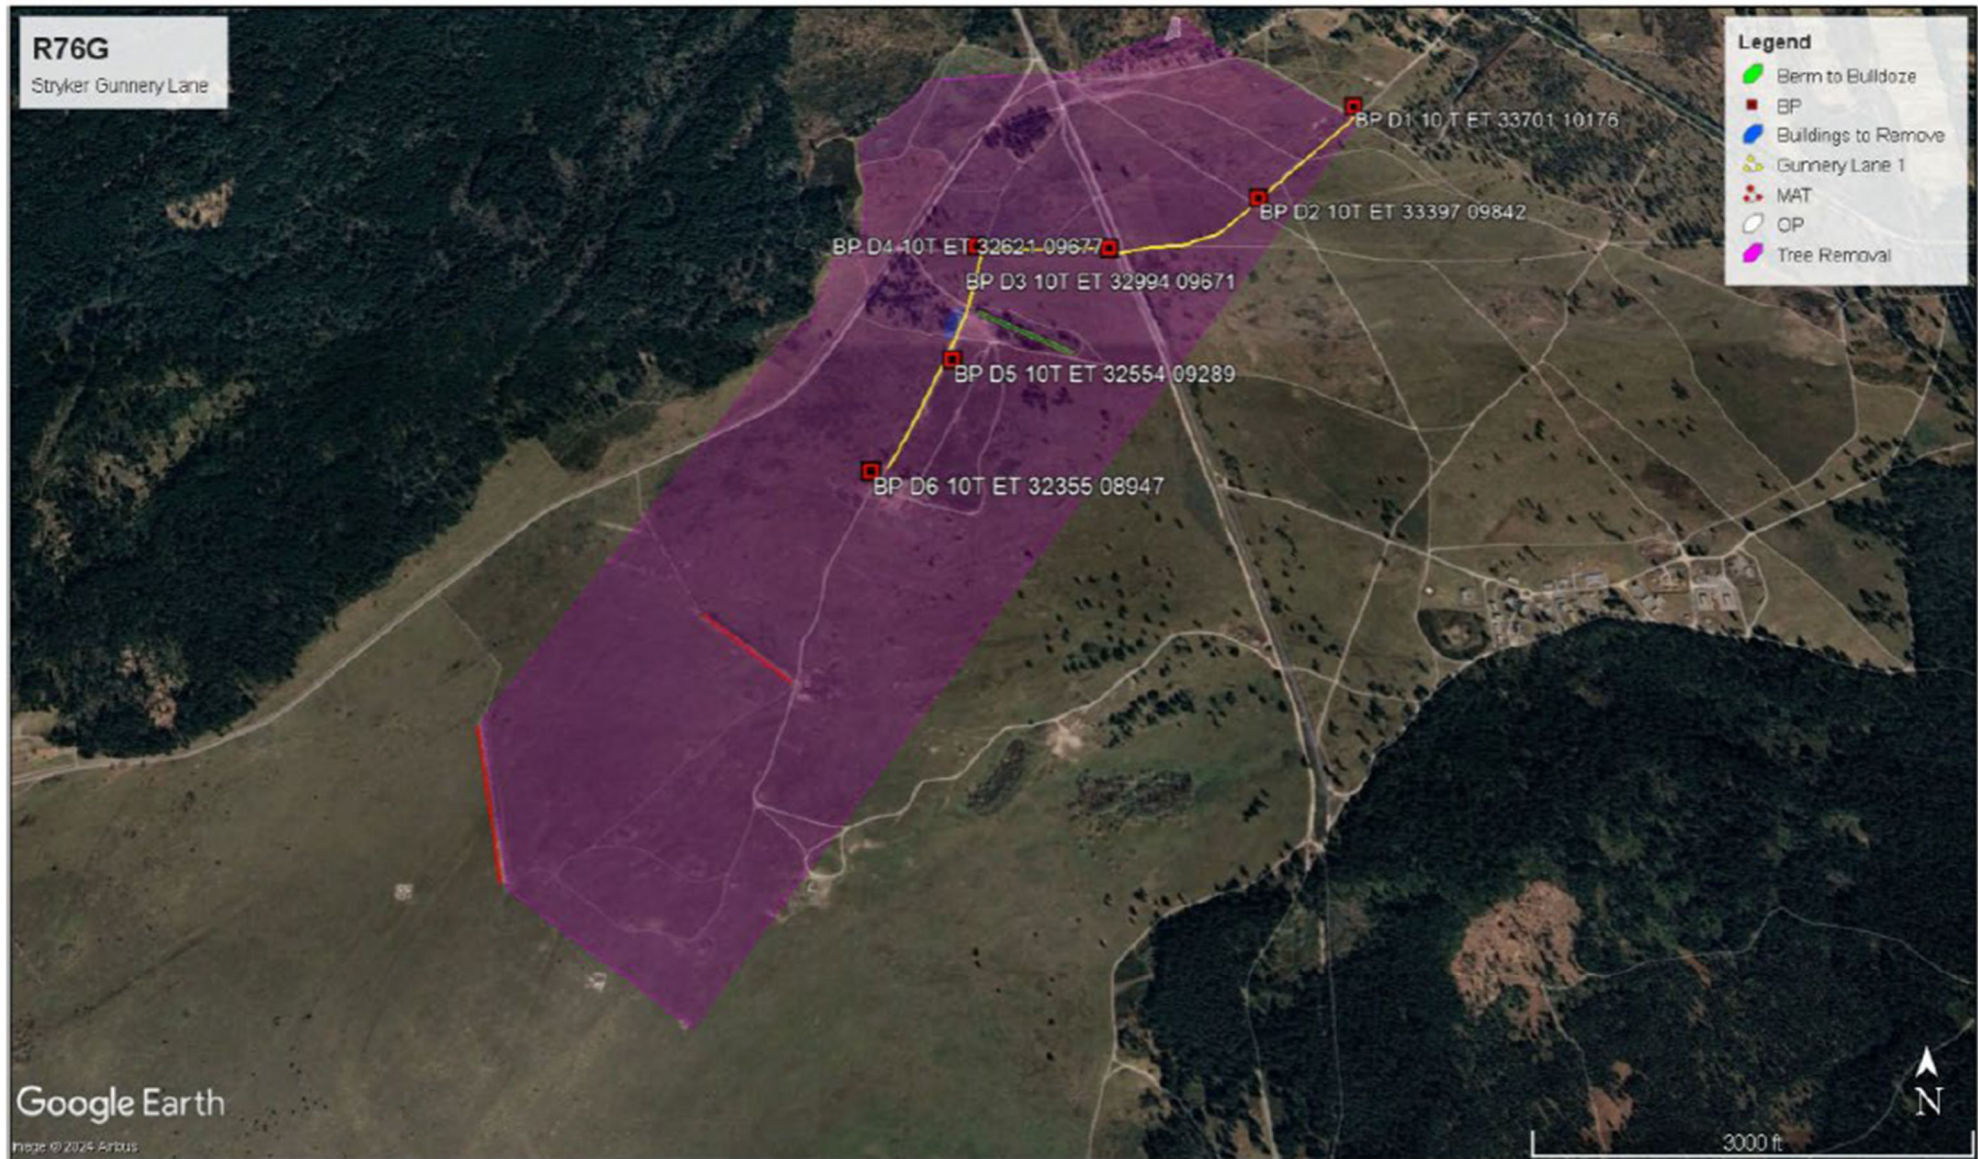

Gunnery 30mm Range 76 – Electrical Demolition Plan

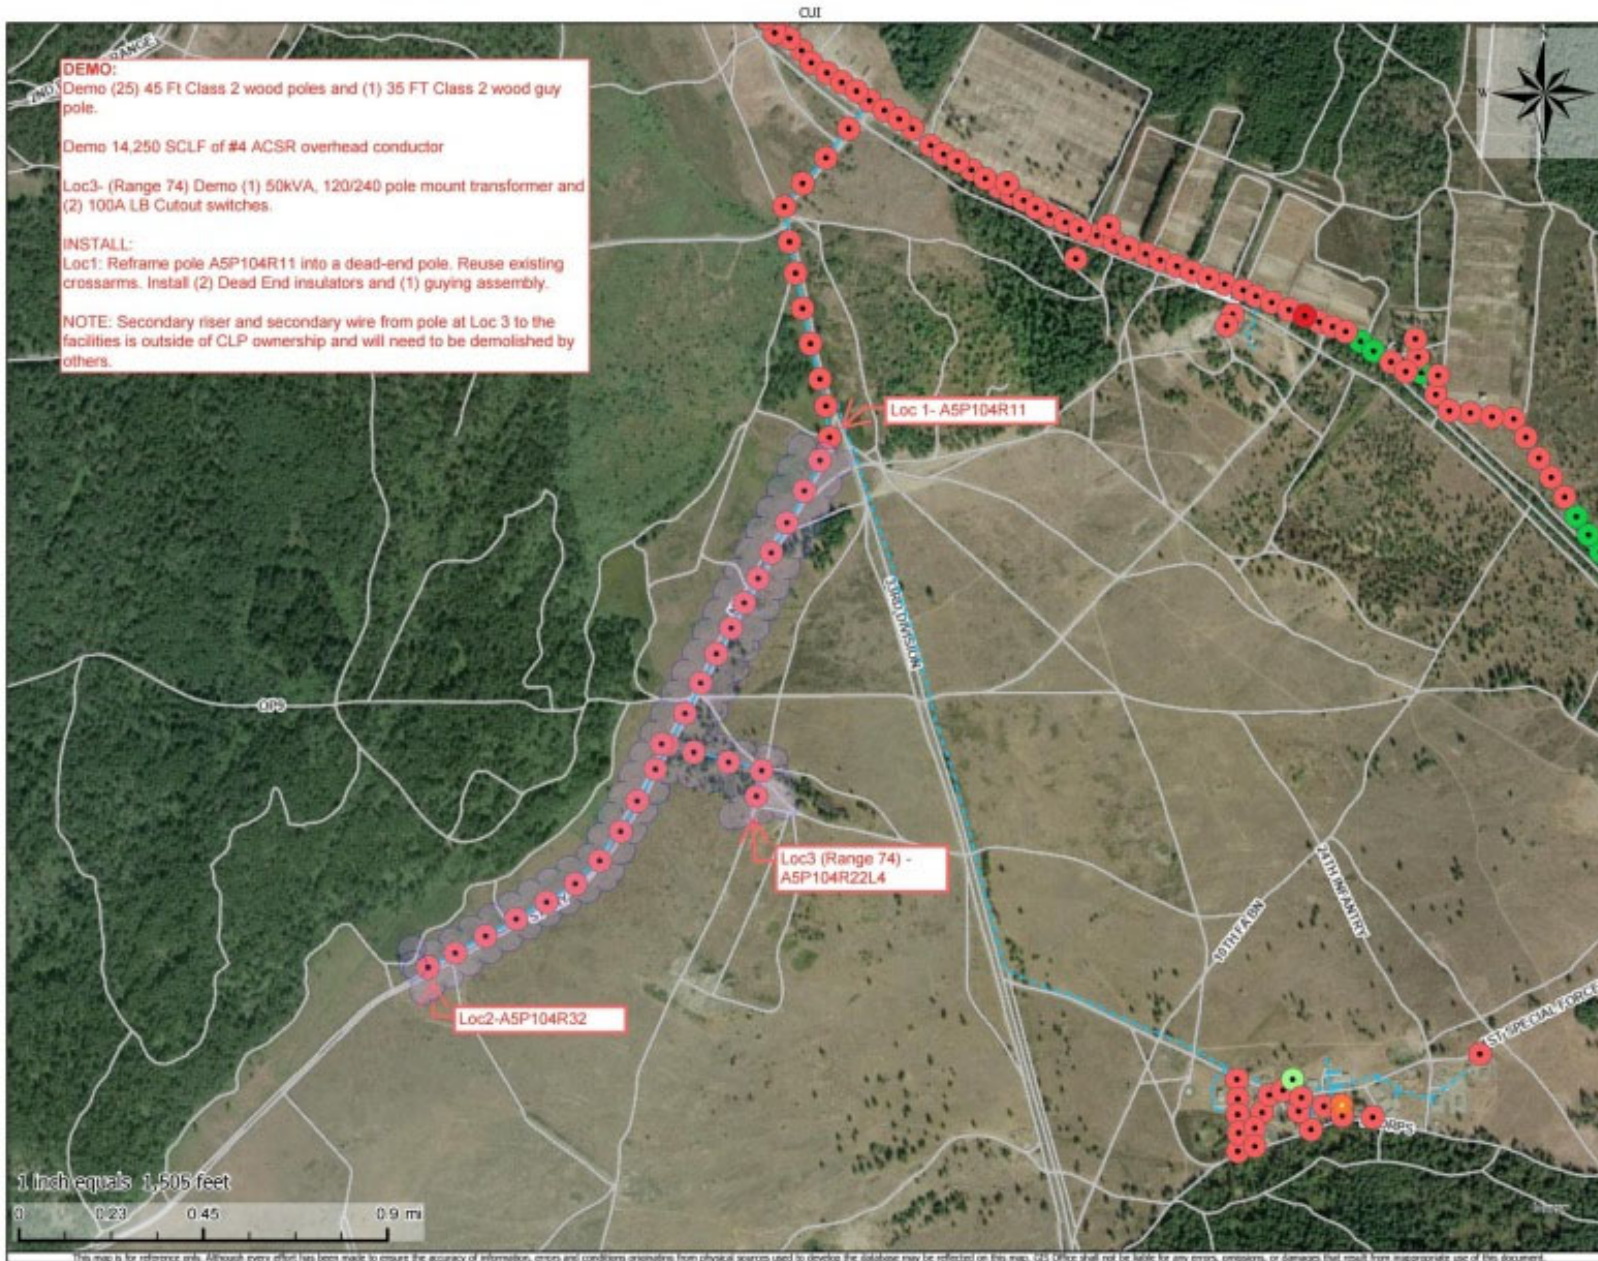


CLP GIS Map

Thursday, February 6, 2025

Proprietary & Confidential For Official Use Only (FOUO)
 Controlled by: City Light & Power
 Controlled by: CLP Engineering
 CLP Category - CBI
 Limited Dissemination Control: N/A
 DOC - Name and Email

RG76 - TA 06 TREE REMOVAL AREA

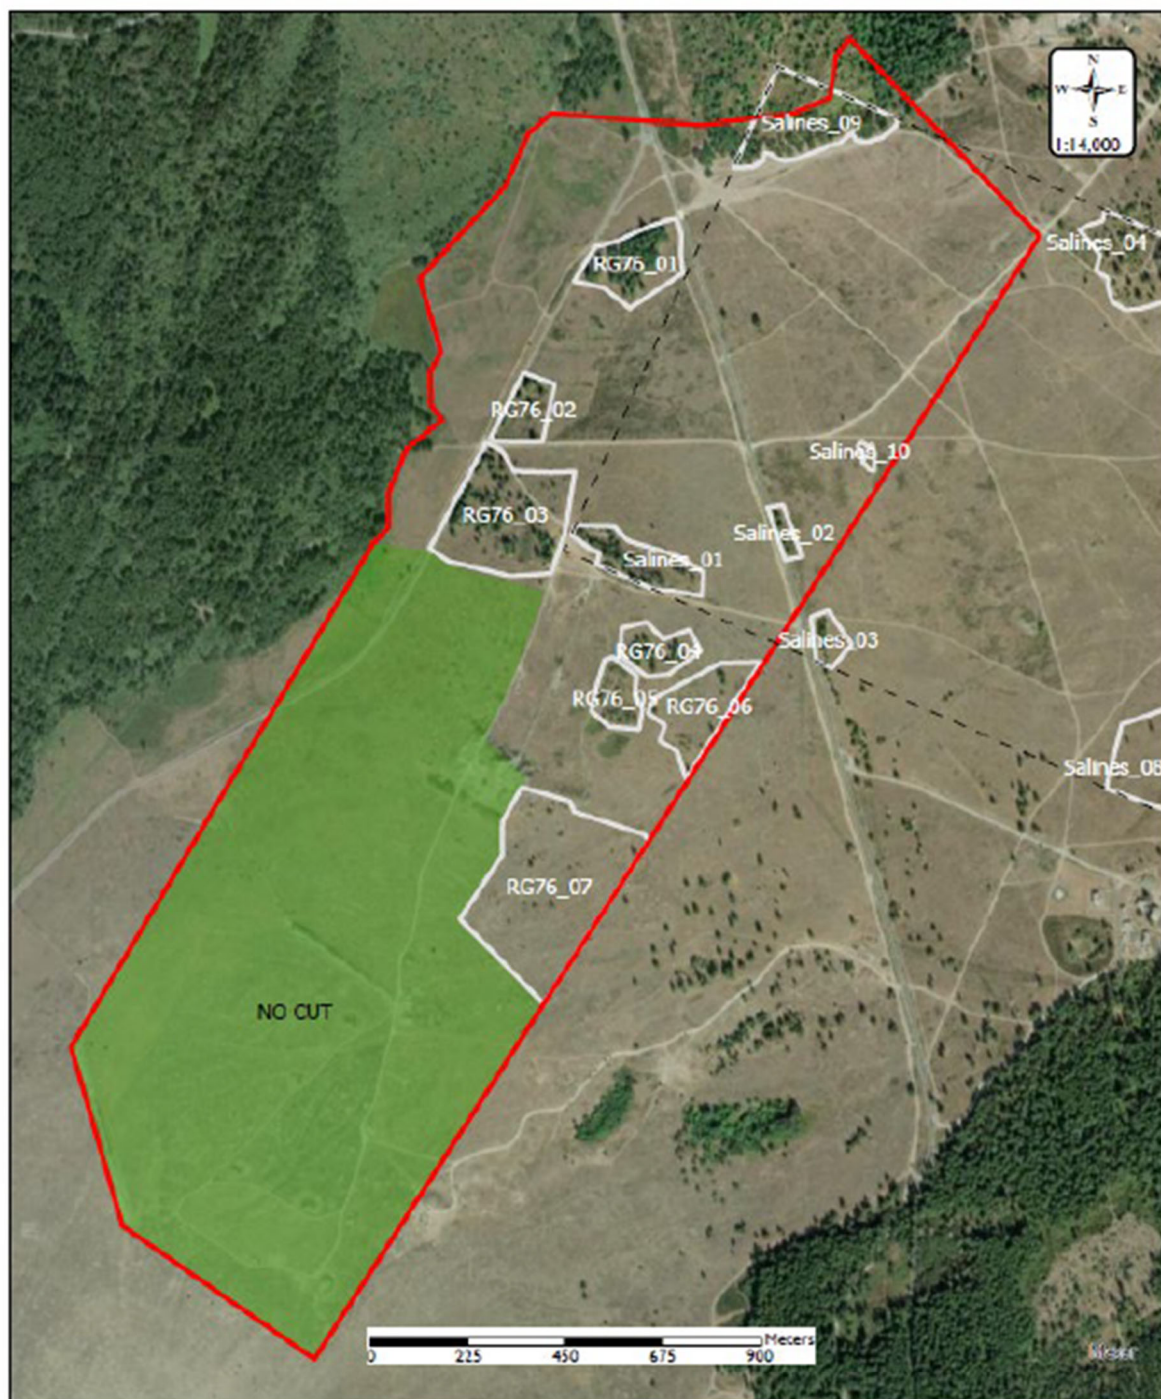


-  DZ_TreeRemoval_Areas
-  MilitaryDropZone_A
-  RG76_TreeRemoval_Boundary
-  NoCut_Areas


Produced for:
BUMRA & Wildlife
Date: 12/26/2004
Cartographer: MRS. LISA J. WILSON
Title: RG76
Project: Gunnery Range
Scale: 1:14,000
Data Source: 1999
Cadastral: 1999
Landscape: 1999
Data: 1999



RG76_01	Remove 100% of tall trees. Leave dead standing trees and any oaks or small firs that don't obstruct view. Coordinate with DPW - Fish & Wildlife on which specific live and dead trees to leave. Staging and yarding must occur outside of MPG-occupied areas. Work must occur outside of nesting season (1 Apr - 31 Aug). Equipment must avoid kinnickinnick patches.
RG76_02	Remove 100% of tall trees. Leave dead standing trees and any oaks or small firs that don't obstruct view. Coordinate with DPW - Fish & Wildlife on which specific live and dead trees to leave. Staging and yarding must occur outside of MPG-occupied areas. Work must occur outside of nesting season (1 Apr - 31 Aug). Equipment must avoid kinnickinnick patches.
RG76_03	Remove 100% of tall trees. Leave dead standing trees and any oaks or small firs that don't obstruct view. Coordinate with DPW - Fish & Wildlife on which specific live and dead trees to leave. Staging and yarding must occur outside of MPG-occupied areas. Work must occur outside of nesting season (1 Apr - 31 Aug). Equipment must avoid kinnickinnick patches.
RG76_04	Remove 100% of tall trees. Leave dead standing trees and any oaks or small firs that don't obstruct view. Coordinate with DPW - Fish & Wildlife on which specific live and dead trees to leave. Staging and yarding must occur outside of MPG-occupied areas. Work must occur outside of nesting season (1 Apr - 31 Aug). Equipment must avoid kinnickinnick patches.
RG76_05	Remove 100% of black locust trees. Leave dead standing trees with occupied cavities. Vehicles and equipment avoid gopher-occupied areas and butterfly plants (marked by FW). Work must occur outside of nesting season (1 Apr - 31 Aug).
RG76_06	Remove tall trees. Leave dead standing trees with occupied cavities and small firs. Vehicles and equipment avoid gopher-occupied areas and butterfly plants (marked by FW). Work must occur outside of nesting season (1 Apr - 31 Aug). Equipment must avoid kinnickinnick patches.
RG76_07	Remove tall trees. Leave dead standing trees with occupied cavities and small firs. Vehicles and equipment avoid gopher-occupied areas and butterfly plants (marked by FW). Work must occur outside of nesting season (1 Apr - 31 Aug). Equipment must avoid kinnickinnick patches.
Salines_01	Remove 95% of trees over 1 year (Leave 3 trees, selected by FW). Leave dead standing trees with occupied cavities. Vehicles and equipment avoid gopher-occupied areas and butterfly plants (marked by FW). Work must occur outside of nesting season (1 Apr - 31 Aug).
Salines_02	Remove 75% of trees over 1 year (leave 1 live tree). Leave dead standing trees with occupied cavities. Vehicles and equipment avoid gopher-occupied areas and butterfly plants (marked by FW). Work must occur outside of nesting season (1 Apr - 31 Aug).
Salines_09	Remove 100% of non-oak trees. Remove 100% of oaks < 4" dbh. Leave dead standing trees with occupied cavities. Vehicles and equipment avoid gopher-occupied areas and butterfly plants (marked by FW). Work must occur outside of nesting season (1 Apr - 31 Aug).
Salines_10	Remove 100% of black locust trees. Leave dead standing trees with occupied cavities. Vehicles and equipment avoid gopher-occupied areas and butterfly plants (marked by FW). Work must occur outside of nesting season (1 Apr - 31 Aug).

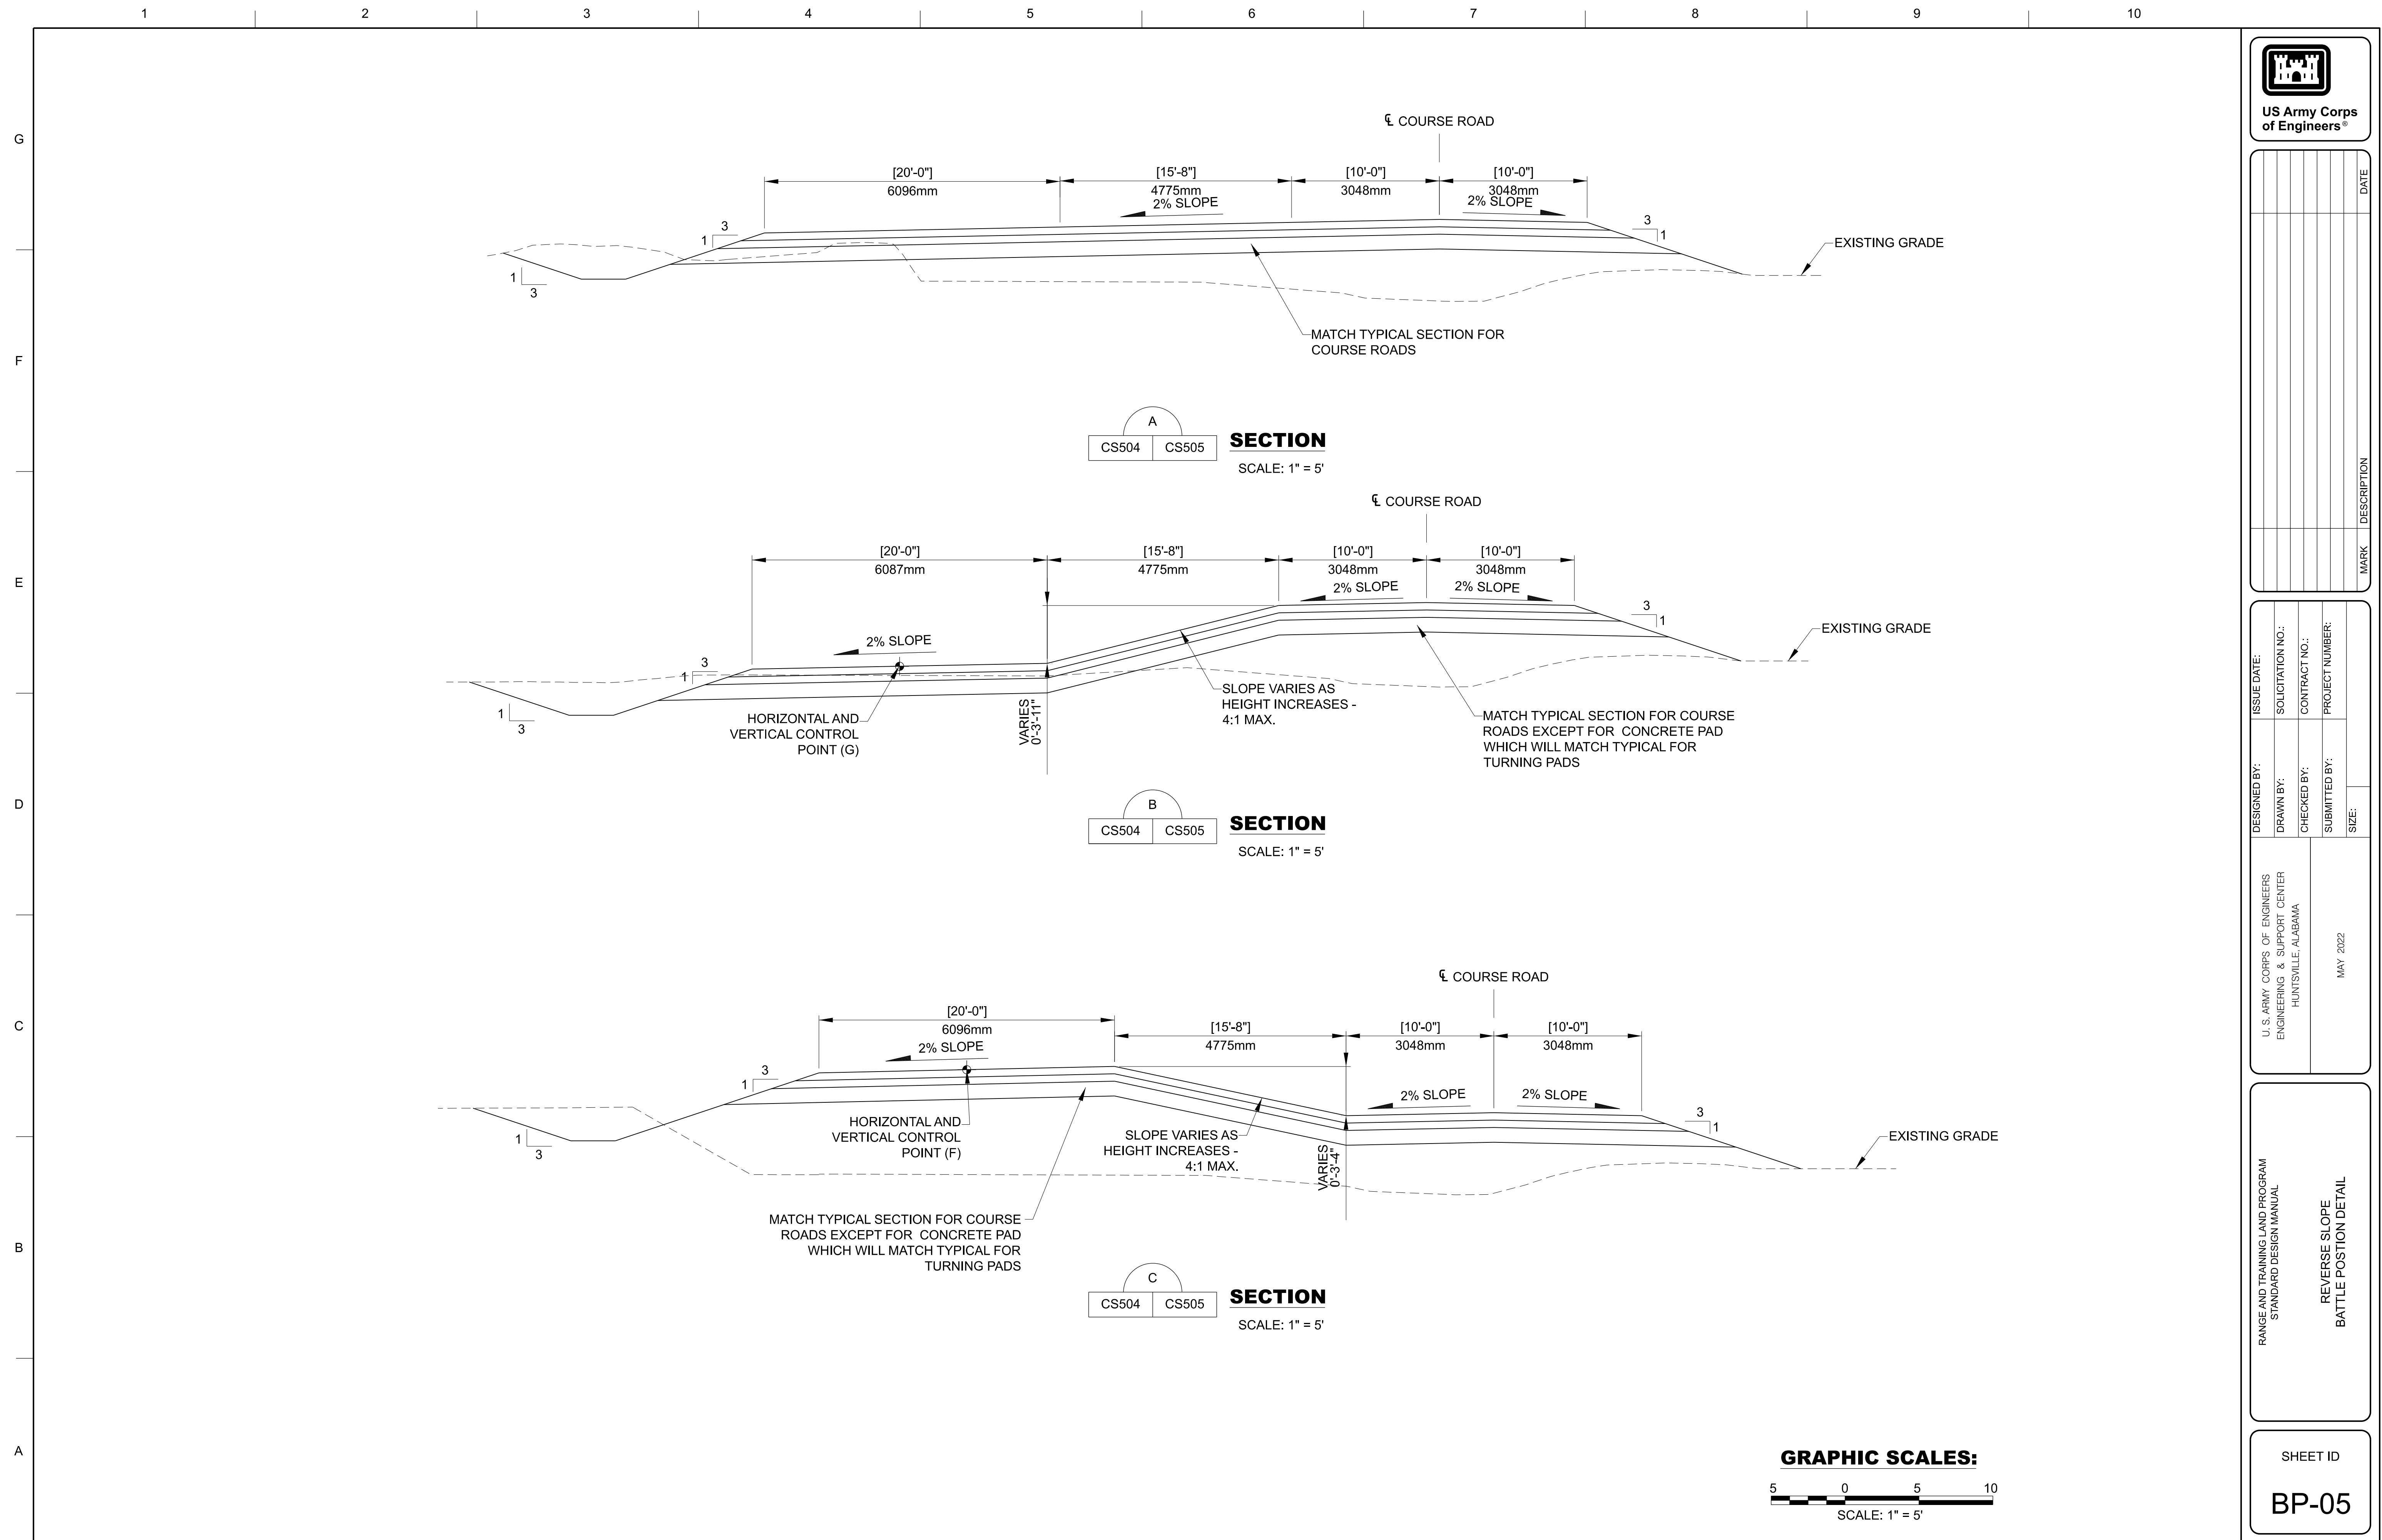

Observation Point

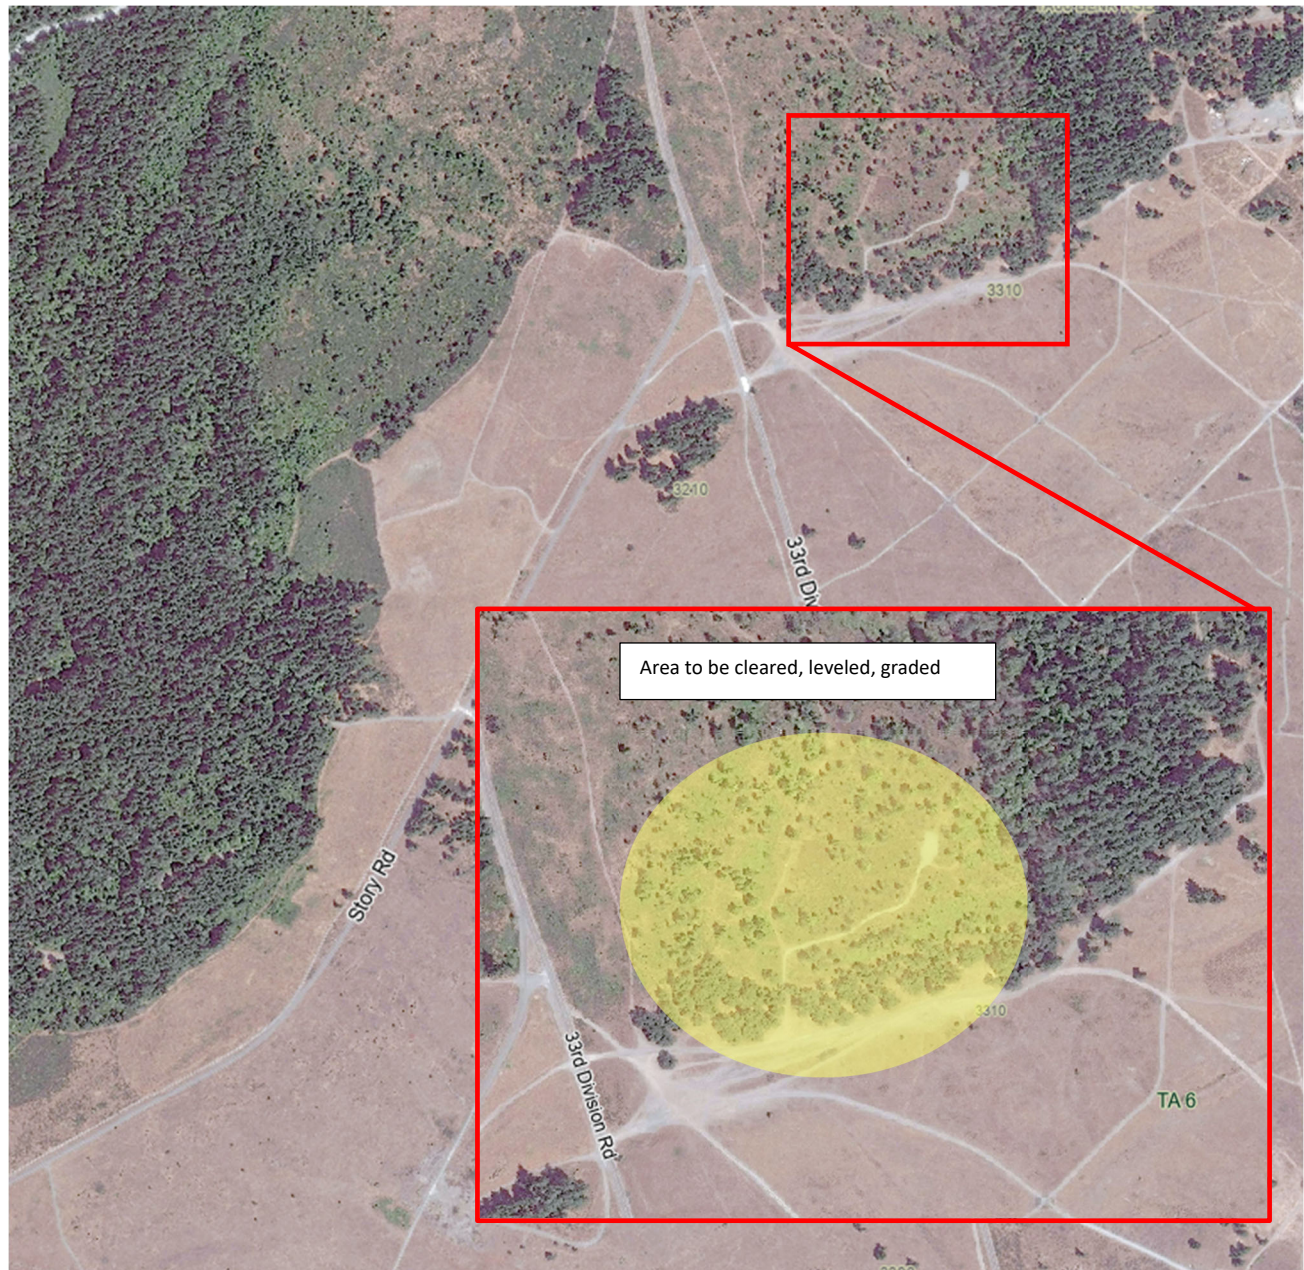

Building U074B



Building U074C



Building U074E



*no pictures of U074F