

TASK GROUP INSTRUCTION

AIM REV 20.11.4.0 (OCTOBER 2020)

TGI NO.:	COMPONENT NAME: 01-240-1-A STRL&DOOR	TYPE: AY	PHASE: A	REPEAT: 0	CHANGE: 0
SHIP/HULL NO.:	SHIP/HULL NAME:	SYSTEM:	PROJ/WO NO:	CASREP CAT:	
DDG-115	USS RAFAEL PERALTA		K61		
CU PHASE TITLE: F/O - ACCOMPLISH REPLT OF WTRTT DOOR 01-240-1 & REPAIR OF DEFECT IN 01-240-1-A					
PREPARING ACTIVITY:					
PREPARED BY: CHIKANAO SAITO	CODE 231B.	PHONE 315-243-5840	DATE 29-JAN-2026		
APPROVED BY: RYOUTA TAKAGI	CODE 231B.	PHONE 315-243-4502	DATE 29-JAN-2026		
CONCURRED BY:	CODE	PHONE	DATE		
CONCURRED BY:	CODE	PHONE	DATE		
CONCURRED BY:	CODE	PHONE	DATE		
CONCURRED BY:	CODE	PHONE	DATE		
REASON FOR WORK/NEED FOR CHANGE:					
CHANGE INSTRUCTIONS:					
SPECIAL REQUIREMENTS: This work affects a fire zone boundary. Fabrication and/or staging of a non-flammable closure is required.					

WORK CERTIFICATION SIGNATURES					
COMPLETION OF WORK REVIEW:		BADGE NO.:	SHOP/CODE:	PHONE:	DATE:
ACCEPTANCE OF COMPLETED WORK					
PHYSICAL INSPECTION REQUIRED: ☐ YES ☒ NO	PHYSICAL INSPECTION COMPLETED:	BADGE NO.:	SHOP/CODE:	PHONE:	DATE:
RECORDS REVIEW:		BADGE NO.:	SHOP/CODE:	PHONE:	DATE:



LIST OF EFFECTIVE PAGES									
SHT NO.	CHG NO.	SHT NO.	CHG NO.	SHT NO.	CHG NO.	SHT NO.	CHG NO.	SHT NO.	CHG NO.
1-6		Sketch (1)							
J1-2									
M1-2									
Engrg Inst (1- 2)									

1. SCOPE/PURPOSE

1.1 Title: Replacement of Watertight Door 01-240-1 and Repair of Defect on Collar Plate, Stuffing Tube, and 02 Level Deck Plating in 01-240-1-A; accomplish

1.2 Location of Work:

1.2.1 Deck Gear Locker (01-240-1-A)

1.2.2 Shore Power Station (01-240-0-Q)

1.2.3 Fan Room PZ No. 3 (01-240-01-Q)

1.2.4 01 Level Weather, Frame 240, Starboard (Stbd)

1.2.5 Uptake Engine Room No. 2 (02-242-0-Q)

1.2.6 02 Level Weather, Frames between 240 and 243, Stbd

1.2.7 Crew Messroom (1-220-01-L)

1.3 Identification:

1.3.1 Quantity (One Lot), Vent Duct, Collective Protection System (CPS) in 1-220-01-L

System No. : CPS SS 01-202-2

Type: Non-Watertight

Material: Galvanized Steel

Location: Frames between 240 and 244, Stbd

Remarks: See 2.3 for detail

1.3.2 Quantity (One EA), Door, Watertight

Door No. : 01-240-1

Size: 26 Inches x 66 Inches

Material: Steel

Type: Individually Dogged, 8 Dogs, Right Hand

JCN: ES01-NA7C

1.3.2.1 Quantity (8 EA), Door Bracket

Material: HTS, MIL-S-22698 GR-DH36, 10.2 LBs Plate

1.3.2.2 Quantity (One AY), Hook and Bumper Assembly

2 TGI NO.:

SHIP:

01-240-1-A STRL&DOOR	AY	A	0
DDG-115	CHG/VER:	0/0	

Material: CRES

Remarks: See Detail 42-E of 2.7 for detail

1.3.3 Quantity (4 EA), Label Plate, Watertight Door

1.3.3.1 Quantity (One EA), Label Plate, Exterior

Material: Aluminum Alloy, Type-I of 2.8

Inscription: 1st. Line: 01-240-1

2nd. Line: DECK GEAR LKR

3rd. Line: 01-240-1-A

1.3.3.2 Quantity (One EA), Label Plate, Interior

Material: Aluminum Alloy, Type-I of 2.8

Inscription: 1st. Line: 01-240-1

2nd. Line: WEATHER

1.3.3.3 Quantity (2 EA), Label Plate, Damage Control Closure Classification, Exterior and Interior

Material: Aluminum Alloy, Type-I of 2.8

Remarks: Figure-D of 2.8

1.3.4 Quantity (One Lot), Collar Plate, Watertight in 01-240-1-A, Frame 243

Weld Joint Design:

PT2S.1 of MIL-STD-22D for Collar Plate and Diagonal Deck Longitudinal

L2S.1 of MIL-STD-22D for Collar Plate and Transverse Bulkhead Plating

Fillet Weld Size:

1/8 Inch for Collar Plate and Diagonal Deck Longitudinal

3/16 Inch for Collar Plate and Transverse Bulkhead Plating

Remarks: See 2.9 for base material and detail, and Detail 1-B of Sketch Enclosure-02 for location detail

JCN: ES01-NA7E

1.3.5 Quantity (One Lot), Stuffing Tube on 02 Level Deck Plating in 01-240-1-A, Frames between 241 and 243

Base Material: CRES

Remarks: See Engrg Inst Enclosure-01 for detail

JCN: ES01-NA7D

1.3.6 Quantity (One Lot), Deck Plating, 02 Level Deck Plating in 01-240-1-A, between Frames 241 and 242, and Longitudinal No. 6S and House Side Bulkhead Plating

Base Material: HTS, MIL-S-22698 GR-DH36, 7.65 LBs Plate

Remarks: See Detail 1-D of Sketch Enclosure-02 for location detail

JCN: ES01-NA7F

1.4 Security Classification: None.

1.5 Initial Condition:

1.5.1 Potential Asbestos Hazard

1.6 Contractor work start date: 8/3/2026

1.7 Contractor work completion date: 9/1/2026

01-240-1-A STRL&DOOR	AY	A	0
DDG-115	CHG/VER:	0/0	

2. **REFERENCES:**

REF. NO.	DOCUMENT /DRAWING NUMBER	DOCUMENT/DRAWING TITLE	REV	CHG NO.	COPY REQ'D (Y/N)	SOURCE DOC (Y/N)	PARA	SEC	PG	CHP
1	NSI FY-26	NAVSEA Standard Items	-	1	N					
2	LI FY-26	Local Standard Items	-	ORG	N					
3	DWG 512-7027276	HTG VENT AIR COND INSTL DSGN ZONE 2350 MAIN DK FR 220-254	L		Y				3B 18	
4	DWG 168-8546662	STRUCTURAL DOOR LIST SSRD	A		Y				8A	
5	DWG 803-6397261	WATERTIGHT, INDIVIDUALLY DOGGED ARRANGEMENT	B		N					
6	DWG 803-6397262	WATERTIGHT, INDIVIDUALLY DOGGED SUB-ASSY & DETAILS	B		N					
7	DWG 150-7026726	UNIT STRL ARR DWG ASSY UNIT 4510	L		Y				SE E N O T E	
8	PDD 602-ELM-150531	SRF-JRMC STD ELM LABEL PLATE FOR CLOSURE	A		Y				AL L	
9	DWG 100-6218863	STANDARD STRUCTURAL & WELDING DETAILS	AJ		Y				12, 57	
10	TM S9086-DA-STM-010/CH-100	Hull Structures	4		N					

3. **APPENDICES:**

- 3.1 Appendix "J" TGI Job Summary Information Sheet 1/31/2026 C1209.2 K. YOSHIDA
 3.2 Appendix "M" TGI Material List
 3.3 Appendix "D" Deficiency Form

4. **GENERAL REQUIREMENTS:**

4.1 Not Applicable.

5. **PROCEDURE:**

- 5.1 Remove each existing vent duct listed in 1.3.1, using 2.3 for guidance.
- 5.2 Remove existing and install new each door and parts listed in 1.3.2 in accordance with 2.4 through 2.6, using 2.7 for guidance.
- 5.2.1 Fabricate each new door bracket listed in 1.3.2.1.
- 5.2.2 Remove existing and install new hook staple of bumper assembly.
- 5.2.3 Lubricate each new dogging mechanisms.
- 5.2.4 Remove existing, fabricate and install new gasket conforming to A-A-59588 Class 3B Grade 30.
- 5.2.5 Accomplish the requirements of 009-012 of 2.1, including Table 2, Column(s) A and D, Lines One through 7.
- 5.2.6 Accomplish the requirements of 009-025 of 2.1 for a local air hose test of each new weld of each door frame. Allowable leakage: None.

4 TGI NO.:

SHIP:

01-240-1-A STRL&DOOR	AY	A	0
DDG-115	CHG/VER:		0/0

5.2.7 Adjust each dogging mechanism for unobstructed operation and to obtain 100 percent centered contact with the imprint of chalk in the center three-fifths of the gasket.

5.3 Accomplish the requirements of 009-025 of 2.1 for a chalk test of each door listed in 1.3.2.

5.4 Accomplish the requirements of 009-025 of 2.1 for a local air hose test of door panel gasket and knife edge mating area of each door listed in 1.3.2. Allowable leakage: None.

5.5 Accomplish an operational test of each door listed in 1.3.2 to assure unobstructed operation. Allowable sticking or binding: None.

(V)(G) "OPERATION TEST"

5.6 Remove existing, fabricate and install new each label plate listed in 1.3.3 in accordance with 2.8.

5.7 Reinstall each vent duct listed in 1.3.1, using 2.3 for guidance.

5.8 Accomplish weld repair of deficient weld of each existing collar plate and stuffing tube listed in 1.3.4 and 1.3.5 in accordance with Enclosure-01, using 2.7 and 2.9 for guidance.

5.8.1 Gouge out deficient welds.

5.8.2 Accomplish the requirements of 009-012 of 2.1, including Table 2, Column(s) A, Lines One through 7.

5.8.3 Accomplish the requirements of 009-025 of 2.1 for a local air hose test of each new weld of the collar plate and stuffing tube. Allowable leakage: None.

5.9 Accomplish build up weld of mechanical damage on each existing deck plating listed in 1.3.6, using 2.7 for guidance.

5.9.1 Accomplish the requirements of 009-012 of 2.1, including Table 2, Column(s) A, Lines One through 7.

5.9.2 Accomplish visual (VT) inspection of back side surfaces of each new weld in accordance with Paragraph 100-2.8.4.3.1.a of 2.10 to confirm no evidence of burn and/or melt through.

(V) "VT INSPECTION"

5.10 Confirm that all personnel have exited the space prior to closure of each space listed in 1.2.2. Designate one person to account for all personnel who may have entered the space.

5.11 Accomplish the requirements of 009-032 of 2.1 for each new and disturbed surface.

5.12 Notes:

5.12.1 Planner: Code 231B C. Saito, 243-5840
Planner: Code 233 M. Takemura, 080-9350-1458
Engineer: Code C250 K. Ishiwata, 243-0092
Engineer: Code C270 T. Koshikiya, 243-4326

5.12.2 Work Integration Manager (WIM): Code 333 T. Yaginuma, 080-5419-0598

5.12.3 This TGI is in response to CCIMS report No. CCIMS-G1N6-DDG115-001-25 from TGI No. 38K6A11003I01.

5.12.4 WPC will copy the following pages in reference.

REF 2.7: 3-9, 5B-12, and 7-17

01-240-1-A STRL&DOOR	AY	A	0
DDG-115	CHG/VER:	0/0	

5.12.5 Work per this instruction involves cutting an access (or removal of a door) through a fire zone bulkhead, through the hull of the ship above the turn of the bilge, through ventilation components (ducting, plenums, etc.), or through any air-tight, fume-tight or watertight bulkheads normally used to control air flow in the event of a shipboard fire. A nonflammable closure is required in accordance with COMNAVSEASYSCOM MSG R 261400Z JUL 12. The closure, if not continuously in use, shall be staged near the access, readily visible and accessible, so that any emergency responder can install the closure to affect proper air flow onboard the ship.

5.12.6 JCNs ES01-NA7C, ES01-NA7D, ES01-NA7E, and ES01-NA7F are related to this TGI.

5.13 Government Furnished Material (GFM):

5.13.1 SRF-JRMC will provide GFM listed in Appendix "M".

5.14 SRF-JRMC will provide the following service work: (TGI No. 38K6112325S02).

5.14.1 [C740] Crane and crane rigging service.

5.14.2 [X99E] Utility service, electrical.

5.14.3 [X99M] Utilities service, including low pressure air supply, water supply, and steam supply.

5.14.4 [C106.1] Safety inspection for SRF-JRMC employees.

5.14.5 [C106.2] Gas free inspection for SRF-JRMC employees.

5.14.6 [C133] QA inspection for (G) symbol(s).

01-240-1-A STRL&DOOR	AY	A	0
DDG-115	CHG/VER:		0/0

APPENDIX "M"

TGI MATERIAL LIST

SYSTEM:	PLANT NO.:	COMPONENT NAME:	TYPE:	PHASE:	REPEAT:	CU PH VERSION:	CASREP CAT:
		01-240-1-A STRL&DOOR	AY	A	0	0	

CU PHASE TITLE:

F/O - ACCOMPLISH REPLT OF WTRTT DOOR 01-240-1 & REPAIR OF DEFECT IN 01-240-1-A

MATERIAL REFERENCES

REF NO.	DOCUMENT/DRAWING NUMBER	DOCUMENT/DRAWING TITLE	REV
------------	----------------------------	------------------------	-----

JOB ORDER:

38K6112325

KEY OP:

A01

MATERIAL LIST

ITEM NO.	PC NO.	REF NO.	M / C	DESCRIPTION	STOCK NUMBER	GENERIC MATL TYPE	LVL	QA	HAZ MAT	DOC NO.	QTY REQD/ UNIT	QTY USED/ UNIT
001			M	CAP,SNAP, ORDER FOR KTR ORIG: C231B, C. SAITO, 243- 5840	9B 5325 007377648		NA	4	N	60295006	100/EA	
501			M	INSULATI, ORDER FOR X57 ORIG: C231B, C. SAITO, 243- 5840	9Q 5640 013713263		NA	4	N	53165003	2/SH	
502			M	SOUND CO, ORDER FOR X57 ORIG: C231B, C. SAITO, 243- 5840	9Q 5640 013715238		NA	4	N	53165004	2/SH	
503			M	TAPE,TEX, ORDER FOR X57 ORIG: C231B, C. SAITO, 243- 5840	9B 8315 002671632		NA	4	N	53165007	1/RO	
504			M	ADHESIVE, ORDER FOR X57 ORIG: C231B, C. SAITO, 243- 5840	9B 8040 002738708		NA	4	Y	53165010	1/GL	
505			M	DOOR,METAL,MARINE S, ORDER FOR X11 ORIG: C226 H.SHIMIZU, 080- 9350-1431	3B 2040 009126751		NA	2	N	52875156	1/EA	
506			M	RUBBER S, ORDER FOR X11 ORIG: C231B, C. SAITO, 243- 5840	9B 5330 013717183		NA	4	N	53165016	15/FT	

NOTES:

M-1

TGI NO.:	01-240-1-A STRL&DOOR	AY	A	0
SHIP:	DDG-115	CHG/VER:	0/0	

MATERIAL LIST												
ITEM NO.	PC NO.	REF NO.	M / C	DESCRIPTION	STOCK NUMBER	GENERIC MATL TYPE	LVL	QA	HAZ MAT	DOC NO.	QTY REQD/ UNIT	QTY USED/ UNIT
507			M	PLATE,ME, ORDER FOR X11 ORIG: C231B, C. SAITO, 243-5840	9B 9515 002243086		NA	4	N	53165017	4/SF	
508			M	CAP, PROTECTIVE, CAP, PROTECTIVE, SLIP-ON, WITH REINFORCED BOTTOM, SIZE: FOR 7/8" LEG OD, HEIGHT: 1-5/16", MATL: SBR, COLOR: BLACK, 1EA/PG, ORDER FOR X11 ORIG: C231B, C. SAITO, 243-5840	9B 5340 LL9002434		NA	4	N	53227441	10/PG	
509			M	HOOK AND, ORDER FOR X11 ORIG: C231B, C. SAITO, 243-5840	9C 2040 LL9000644		NA	4	N	53167487	1/AY	
510			M	INSULATI, ORDER FOR X57 ORIG: C231B, C. SAITO, 243-5840	9Q 5640 013713263		NA	4	N	53285029	2/SH	
511			M	ADHESIVE, ORDER FOR X57 ORIG: C231B, C. SAITO, 243-5840	9B 8040 008419773		NA	4	Y	53285031	1/PT	
512			M	INSULATI, ORDER FOR X57 ORIG: C231B, C. SAITO, 243-5840	9Q 5640 013713263		NA	4	N	53075393	1/SH	
513			M	SOUND CO, ORDER FOR X57 ORIG: C231B, C. SAITO, 243-5840	9Q 5640 013715238		NA	4	N	53075394	2/SH	

M-2

TGI NO.:	01-240-1-A STRL&DOOR	AY	A	0
SHIP:	DDG-115	CHG/VER:	0/0	

☐ NUCLEAR

☐ NON-NUCLEAR

APPENDIX "D"
DEFICIENCY FORM

1. SHIP/HULL NO.: DDG-115	2a. DL or DR No. (Circle One)	2b. REVISION:	3a. COMPONENT NAME: 01-240-1-A STRL&DOOR	3b. TYPE: AY	3c. PHASE: A	3d. REPEAT: 0
4a. ICN: 38K6112325	4b. KEY OP: A01	5. LOC SPACE/LVL:	FRAME:	P/S/C:	6. CAUSED BY:	
7. DESCRIPTION:						
8. ORIGINATOR:	NAME:	BADGE:	SHOP/CODE:	DATE:	PHONE NO.:	
9. CORRECTIVE ACTION:						
10. EVALUATOR:	NAME:	BADGE:	SHOP/CODE:	DATE:	PHONE NO.:	
FOR NON-NUCLEAR USE ONLY						
11. RFD/RFW REQ'D ☐		LAR REQ'D ☐		SRD/PLAN REV REQ'D ☐		
ILS MOD REQ'D ☐		DWG NO.: _____ S/A NO.: _____				
12. ISOLATION SATISFACTORY:	SIGN:	BADGE:	SHOP/CODE:	DATE:	PHONE NO.:	
13. SUBSAFE OQE RECORD? YES ☐ NO ☐	SIGN:	BADGE:	SHOP/CODE:	DATE:	PHONE NO.	
14. CORRECTIVE ACTION COMPLETE:	SIGN:	BADGE:	SHOP/CODE:	DATE:	PHONE NO.	
15. INSPECTION REQ'D? :YES ☐ NO ☐	INSPECTION COMPLETE/SIGN:	BADGE:	SHOP/CODE:	DATE:	PHONE NO.	
16. RECORDS REVIEW COMPLETE (DR ONLY)	SIGN:	BADGE:	SHOP/CODE:	DATE:	PHONE NO.	
DL's ISSUED (DR ONLY)						

REFERENCES: ASTERISKED (*) REFERENCES ARE NOT REQUIRED FOR PRODUCTION WORK


- | | |
|---|---|
| * (a). DDG51CL-150-7026726 "L": | UNIT STRL ARR DWG ASSY UNIT 4510 |
| * (b). DDG51CL-301-7027058 "K": | INSTL ELEC AND ELEX EQPT DSGN ZN 4510 01 LVL FR 240-276 |
| * (c). DDG51CL-301-7027060 "H": | INSTL ELEC AND ELEX EQPT ZONE 4520 AFT STACK FR 242-276 |
| * (d). DDG51CL-331-7028051 "G": | ONE LINE DIAGRAM LIGHTING SYSTEM |
| * (e). NAVSEA S9AA0-AB-GOS-010/GSO REV 11: GENERAL SPECIFICATIONS FOR OVERHAUL OF SURFACE SHIPS | |

NOTES:

1. DRAWING LEGENDS FOR CABLE AND EQUIPMENT ARE AS FOLLOW: PHANTOM LINES (---) REPRESENT EXISTING, UNLESS OTHERWISE NOTED.
2. ALL ABBREVIATIONS ARE IN ACCORDANCE WITH ASME Y14.38.
3. WELDING FOR STEEL MATERIALS SHALL BE CONDUCTED IN ACCORDANCE WITH SRF-JRMC PROCESS INSTRUCTION NO. 100-2 OR NAVSEA STD ITEM NO. 009-012. AFTER ALL WELDING, VT SHALL BE REQUIRED IN ACCORDANCE WITH PARAGRAPH 6.4 OF MIL-STD-1689.
4. TEMPLATE ALL WORK FROM SHIP AND EQUIPMENT.

TEST NOTE:


- T-1. AFTER COMPLETION OF WORK, AIR HOSE TEST SHALL BE CONDUCTED APPLYING THE METHOD ON PARAGRAPH 192f OF REF (e) OR NAVSEA STD ITEM 009-025.

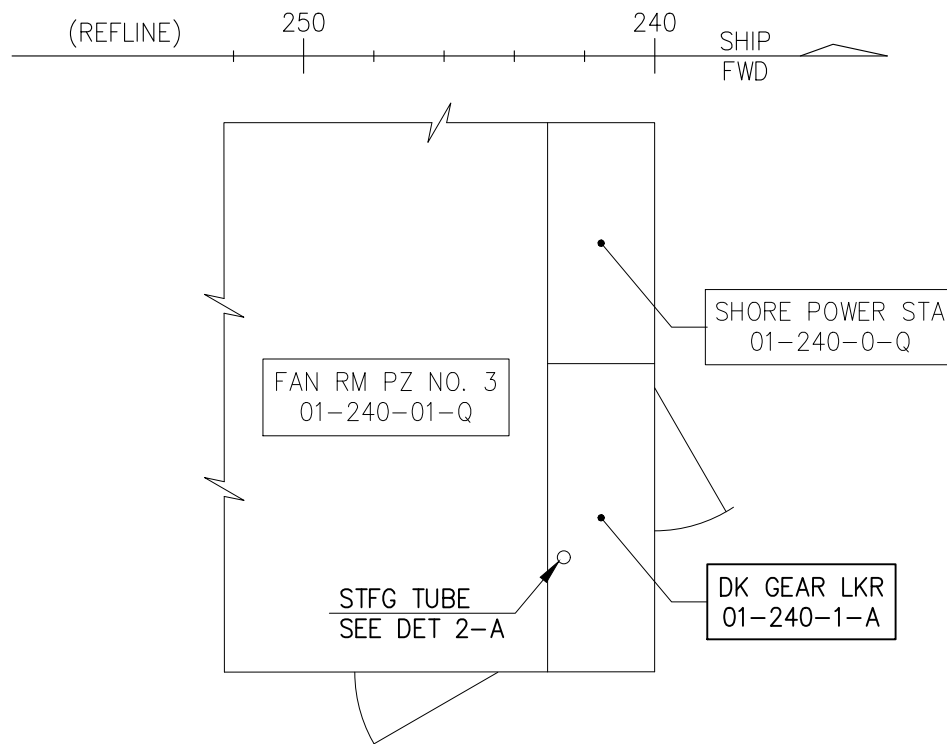

KEY PLAN

01 LVL, OVHD, STBD
-SCALE: NONE-

ENGRG INST
ENCLOSURE-01

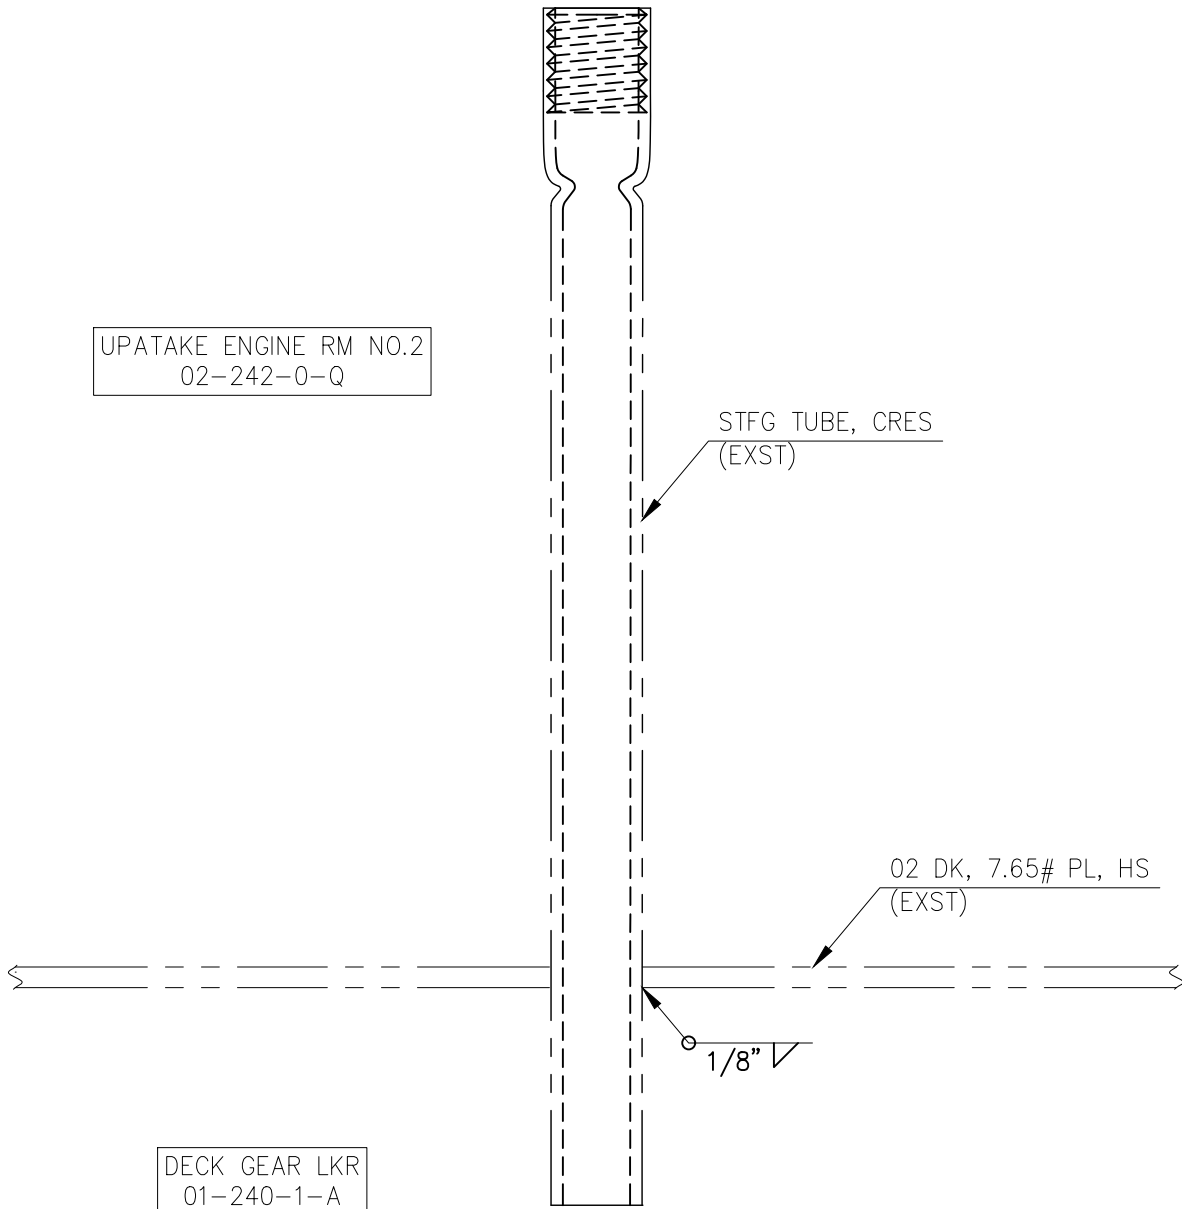

DET 2-A

(MOD)

STFG TUBE



01 LVL, FR 243, OVHD, STBD

-SCALE: NONE-


ENGRG INST

ENCLOSURE-01


LOCATION OF DEFICIENT WELD & MECH DAMAGE IN 01-240-1-A

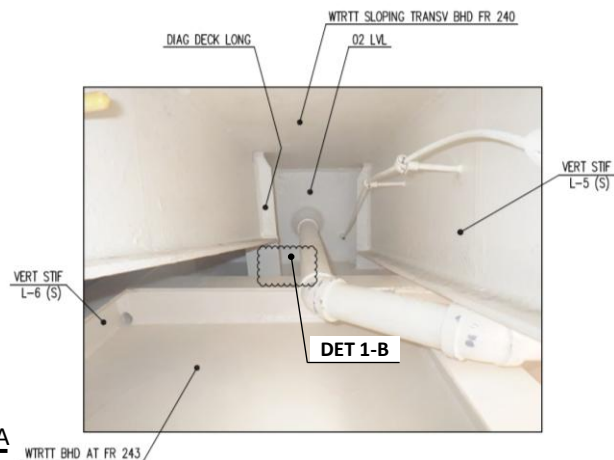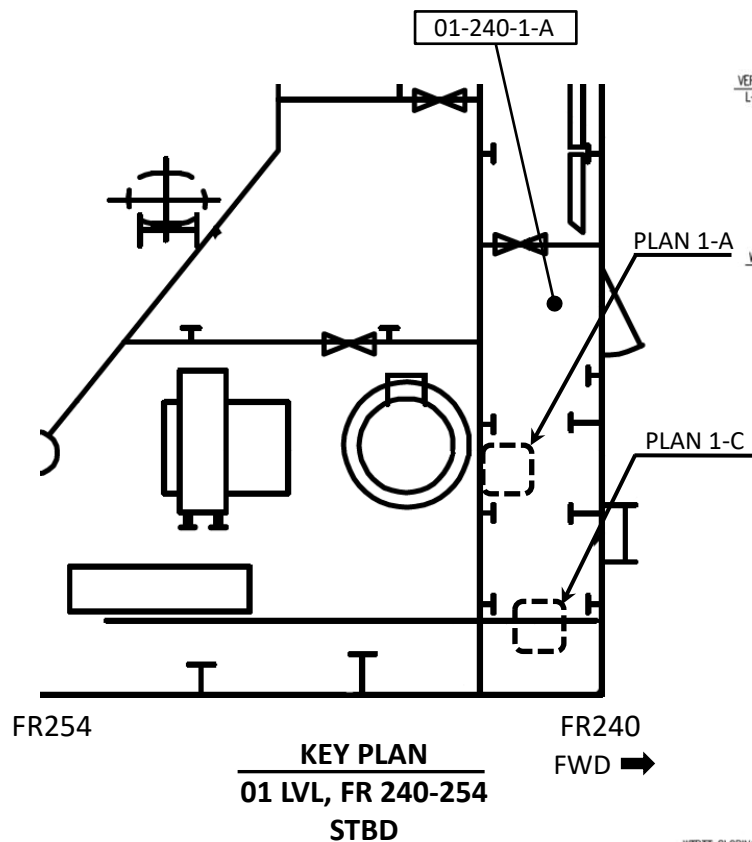


PLAN 1-A
02 LVL DK, FR 241-243
LKG OVHD

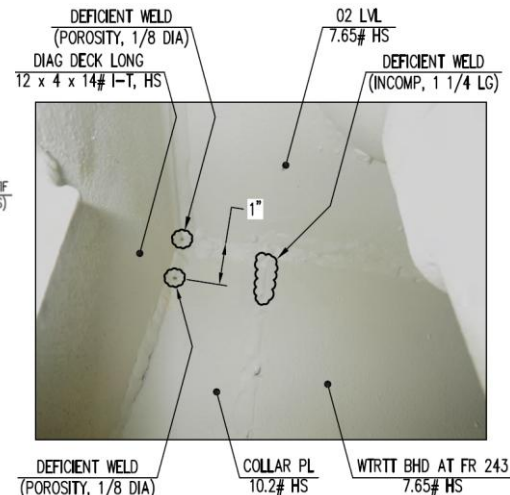

DET 1-B
DEFICIENT WELD ON
COLLAR PLATE

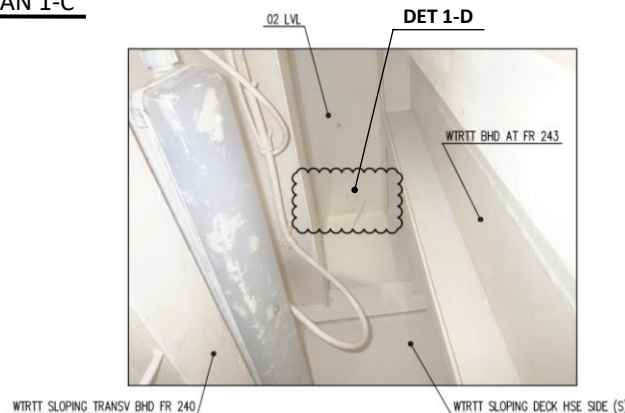

PLAN 1-C
02 LVL DK, FR 241-242
LKG OVHD

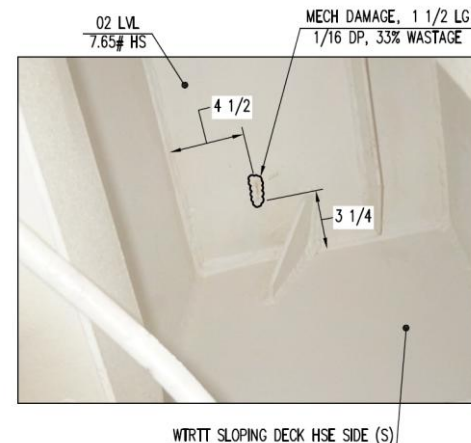

DET 1-D
MECH DAMAGE ON
02 LVL DK PLTG