HLB-D2 · F · age not recorded · position D2 · tether arm A

allego_1__uid0731-18-06-37

post-surgery day not recorded · day 1 post-tether · body weight not recorded · 27.90 h · ZT 9.1 to 13.0 · criterion HUM · QC epoch 10 s

LIFE TIMELINE



VERDICT LADDER

✓ 0 FILE — PASS

Is the recording file physically sound?

100,454,784 samples, 27.90 h

vs data samples == timestamp samples, remainder 0

100,454,784 data samples = 100,454,784 timestamp samples, remainder 0 and 0

✓ 1 IDENTITY — PASS

Which native channels belong to this animal?

EEG D/33 EMG D/34

vs layout derived from the file, never assumed

2 channels resolved from sensors_by_port; 112 wire-free inputs available as an in-file floor

✗ 2 CONNECTION — FAIL

Is the electrode connected, judged against wire-free inputs in the same file?

8.7% usable, longest unbroken block 13.2 min

vs 60 Hz < 98.4 uV (p1 of 112 wire-free inputs in this file), rms 10-150 uV, zero railed samples

INTERMITTENT: 8.7% of epochs usable but the longest unbroken run is only 13.2 min, under the 15 min a recording needs to be an outcome ...

– 3 SCOREABILITY — BLOCKED

Can the sleep question even be asked?

rung 2 CONNECTION did not pass

– 4 ARCHITECTURE — BLOCKED

What did the animal do?

rung 3 SCOREABILITY did not pass


– 5 EXPORT — BLOCKED

Can a human check us?

rung 3 SCOREABILITY did not pass

A rung is not evaluated if the rung below it failed: it reads BLOCKED. ? INSUFFICIENT means the question could not be asked, which is NOT the same as ✗ FAIL.

RUNG 2 evidence — usable epochs against the in-file wire-free floor

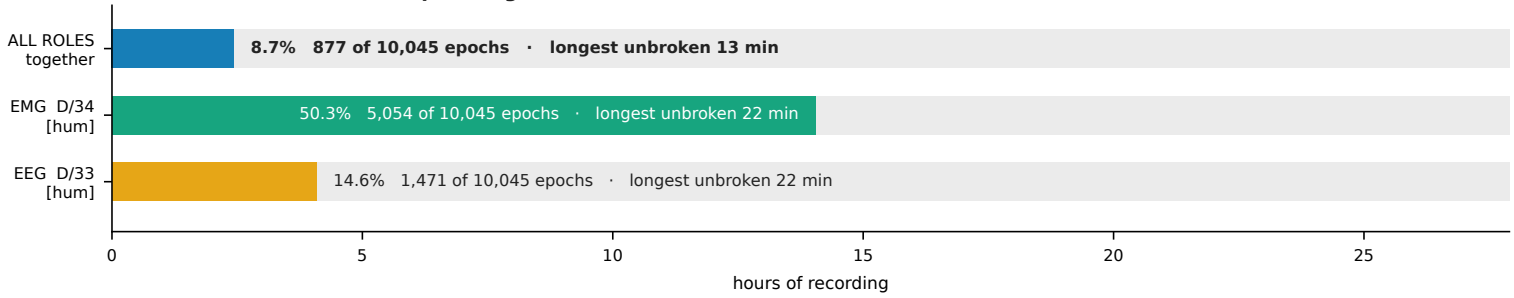

falsification: the same criterion scores the 112 wire-free inputs in this file at 0.88% usable, and must be near zero · floor 60 Hz p1 98 uV, 1-40 Hz slope p1 -3.48

– RUNG 4 ARCHITECTURE: BLOCKED

rung 3 SCOREABILITY did not pass

NO PANEL IS DRAWN FOR A RUNG THAT DID NOT PASS.

THE DEMONSTRATION THAT THE TETHER IS THE FIX. Went from 0.0 percent to 87.9 percent usable EEG after an arm C swap and nothing else: hum 916.9 to 133.2 uV, spectral slope -0.38 to -2.05, railing 29.7 to 0.0 percent, with its implant untouched. Tethered at day 8 after surgery, which is why long post-operative recovery is not required for a usable recording. ⚠A 40-sweep impedance block taken just after the swap said the swap had HARMED this animal, p = 8.4e-08. The block spanned 21 minutes and caught one long open state. The recording reversed it completely. This is the origin of the rule that impedance blocks screen and only a multi-hour recording is an