

Manual for Real-Time Quality Control of In-Situ Current Observations

A Guide to Quality Control and Quality Assurance of Acoustic Doppler Current Profiler Observations

Version 2.0 October 2015



Document Validation



U.S. IOOS Program Office Validation	
Zdenka S. Willis	10/12/2015
Zdenka S. Willis, Director, U.S. IOOS Program Office	Date
QARTOD Project Manager Validation	
Alexandres	10/12/2015
Joseph Swaykos, NOAA National Data Buoy Center	Date
· · · · · · · · · · · · · · · · · · ·	

QARTOD Board of Advisors Validation

Chris Paternostro, NOAA NOS Center for Operational Oceanographic Products and Services (CO-OPS)

10/12/2015

Date

Table of Contents

Docu	ament Validation	ii
Tabl	e of Contents	iii
List	of Figures	iv
List o	of Tables	iv
Revis	sion History	v
	orsement Disclaimer	
Ackn	owledgements	vii
	nyms and Abbreviations	
	nitions of Selected Terms	
1.0	Background and Introduction	
2.0	Purpose/Constraints/Applications	
2.1	Purpose	
2.2	Data Processing Methodology	4
2.3	Traceability to an Accepted Standard	
2.4	Sensor Deployment Considerations	
2.5	Hardware Limitations	
2.6	Other Important Considerations	
3.0	Quality Control	
	•	
3.1	QC Flags	
	QC Test Types and Hierarchy	
3.3	QC Test Descriptions	
Э.	Battery Power (Test 1) – Strongly Recommended	
	Check Sum (Test 1) – Strongry Recommended	
	Sensor Tilt (Test 3) - Required	
	Speed of Sound (Test 4) - Required	
3.	3.2 Signal Quality Tests	
	Noise Floor (Test 5) – Strongly Recommended	
	Signal Strength (Test 6) - Required	
	Signal-to-Noise (Test 7) – Strongly Recommended	
	Correlation Magnitude (Test 8) – Strongly Recommended	
	Percent Good (Test 9) – Strongly Recommended	17
3.	3.3 Current Velocity Tests	
	Current Speed (Test 10) - Required	19
	Current Direction (Test 11) - Required	
	Horizontal Velocity (Test 12) - Required	
	Vertical Velocity (Test 13) – Strongly Recommended	
	Error Velocity (Test 14) – Strongly Recommended	
	u,v Rate of Change (Test 15) – Strongly Recommended	
	u,v Spike (Test 16) – Strongly Recommended	
	Flat Line (Test 17) - Required	24

	.4 Overall Profile Tests	25
	Echo Intensity (Test 18) – Required	
	Echo Intensity Drop-off (Test 19) – Strongly Recommended	
	Current Gradient (Test 20) – Strongly Recommended	
4.0	Summary	27
5.0	References	28
App	ndix A. Quality Assurance	A-1
A.	Sensor Calibration Considerations	A-1
A.	Sensor Comparison	
Α.	Bio-fouling and Corrosion Prevention Strategies	
A.	Common QA Considerations	
Α.	QA Levels for Best Practices	
Α.	Additional Sources of QA Informatione-deployment QA Checklist	
	ployment Checklistployment Checklist	
	st-deployment Checklist	
ъ.	List of Figures	c
Figu	-1. Teledyne RDI ADCP (left); Nortek Aquadopp transducer head (right). (Photos cour	-
Eim	Teledyne RDI and Nortek)2. SonTek ADP (left); Aanderaa Doppler current sensors (right). (Photos courtesy of M	
rigu	Bushnell/NOAA and Aanderaa website)	
Figu	-3. A Nortek Aquadopp is fastened to a standard U.S. Coast Guard aid to navigation po for downward-looking observations. (Photo courtesy of Mark Bushnell/NOAA)	
Figu	-4. A bottom-mounted upward-looking Nortek AWAC is prepared for deployment. (Ph courtesy of Doug Wilson/NOAA)	
Figu	-5. A SonTek side-looking ADP is raised for cleaning. (Photo courtesy of Warren Krug/NOAA)	7
	List of Tables	
Tabl	1 Flags for real-time data from ADCPs. (UNESCO 2013)	10
	2. QC tests for real-time data from ADCPs and buoy-mounted sensors	
Table	3. QC tests in order of requirement hierarchy	12

Revision History

Date	Revision Description	Notes
6/2013	Original Document Published	
10/2015	Revise dates on Document Validation page (page ii)	Manual
	Add statement requesting feedback from Manual Users (page vii)	updated with revisions listed
	Update Acknowledgements to include manual update team members (page viii)	sequentially
	Update Acronyms and Abbreviations (pages ix-x)	
	Add Definitions of Selected Terms (after Acronyms and Abbreviations)	
	Revise Background and Introduction to reflect updated currents manual, as well as additional manuals that have been developed (page 1)	
	Revise section 2.0 content in various places to reflect feedback from reviewers.	
	Move Sensor Deployment Considerations from section 3.2 to section 2.4.	
	Add content addressing data uncertainty (page 8)	
	Update content in sections 3.1 and 3.2 (pages 10-13)	
	Correct the spelling of "codable" in test tables (various)	
	Add Rate of Change Test (page 22) and Spike Test (page 23)	
	Update language in section 4.0, summary, to reflect feedback from reviewers. (page 27)	
	Update References and Supporting Documents (pages 28-31)	
	Add bullet to deployment checklist (page A-5)	
	Update In-Situ Surface Currents Manual Team members (page B-1)	

Endorsement Disclaimer

Mention of a commercial company or product does not constitute an endorsement by NOAA. Use of information from this publication for publicity or advertising purposes concerning proprietary products or the tests of such products is not authorized.

Request to Manual Users

To gauge the success of the QARTOD project, it helps to be aware of groups working to utilize these QC tests. Please notify us of your efforts or intentions to implement QARTOD processes by sending a brief email to data.ioos@noaa.gov or posting a notice at http://www.linkedin.com/groups?gid=2521409.

Acknowledgements

Our thanks go to co-editors Jennifer Patterson, Central and Northern California Ocean Observing System (CeNCOOS) Information Manager at the Monterey Bay Aquarium Research Institute, and to Chris Paternostro, Lead Oceanographer at NOAA's Center for Operational Oceanographic Products and Services (CO-OPS) for their contributions to the update of this manual. We are also grateful to all reviewers of the original manual as well as the updated version (listed in appendix B).

Special thanks go to Zdenka Willis, Director of the U.S. Integrated Ocean Observing System (IOOS), for her continuing support of U.S. IOOS QARTOD. Also, we are grateful to the manufacturers, who participated at their own expense. Special thanks also to Dr. Richard Crout, former QARTOD Project Manager and now with the Navy Research Laboratory/Stennis Space Center, who led the development of the tests in section 3 of this document.

Through the process of five workshops of the Quality Assurance/Quality Control of Real-Time Oceanographic Data (QARTOD), these quality control steps were adapted from existing guidelines of NOAA's National Data Buoy Center (NDBC) and CO-OPS, the U.S. Army Corps of Engineers Field Research Facility (USACE FRF), and participating manufacturers of current measuring systems—Nortek, SonTek, and Teledyne RDI. Additionally, the individual tests have been mapped to existing tests of UNESCO (1993).

QARTOD Meetings (QARTOD 2003-2009)

QARTOD I: National Data Buoy Center, Stennis Space Center, Mississippi.

3-5 December 2003

QARTOD II: Norfolk, Virginia. 28 Feb-2 Mar 2005

QARTOD III: Scripps Institute of Oceanography, La Jolla, California,

2-4 November 2005

QARTOD IV: Woods Hole Oceanographic Institution, Woods Hole,

Massachusetts. 21-23 June 2006

QARTOD V: Omni Hotel, Atlanta, Georgia, 17-19 November 2009.

Agendas, attendees, and reports from QARTOD meetings are located at www.ioos.noaa.gov/qartod/meetings.html.

Acronyms and Abbreviations

ACT	Alliance for Coastal Technologies
ADCP	Acoustic Doppler Current Profiler
ADP	Acoustic Doppler Profiler
AOOS	Alaska Ocean Observing System
AST	Acoustic Surface Tracking
AWAC	Acoustic Waves and Currents
CariCOOS	Caribbean Coastal Observing System
CeNCOOS	Central and Northern California Ocean Observing System
CO-OPS	Center for Operational Oceanographic Products and Services
DMAC	Data Management and Communications
GCOOS	Gulf of Mexico Coastal Ocean Observing System
GLOS	Great Lakes Observing System
GOOS	Global Ocean Observing System
IOC	Intergovernmental Oceanographic Commission
IODE	International Oceanographic Date Exchange
IOOS	Integrated Ocean Observing System
MARACOOS	Mid-Atlantic Regional Association Coastal Ocean Observing System
NANOOS	Northwest Association of Networked Ocean Observing Systems
NDBC	National Data Buoy Center
NERACOOS	Northeastern Regional Association of Coastal Ocean Observing Systems
NIST	National Institute of Standards and Technology
NOAA	National Oceanic and Atmospheric Administration
PacIOOS	Pacific Islands Ocean Observing System
QARTOD	Quality Assurance/Quality Control of Real-Time Oceanographic Data
QA	Quality Assurance
QC	Quality Control
sccoos	Southern California Coastal Ocean Observing System
SECOORA	Southeast Coastal Ocean Observing Regional Association
UNESCO	United Nations Educational, Scientific, and Cultural Organization
USACE FRF	U.S. Army Corps of Engineers, Field Research Facility, [Duck, NC]
	1

Definitions of Selected Terms

This manual contains several terms whose meanings are critical to those using the manual. These terms are included in the following table to ensure that the meanings are clearly defined.

Codable Instructions	Specific guidance that can be used by a software programmer to design, construct, and implement a test. These instructions also include examples with sample thresholds.
Data Record	One or more messages that form a coherent, logical, and complete observation.
Message	A standalone data transmission. A data record can be composed of multiple messages.
Operator	Individuals or entities responsible for collecting and providing data.
Quality Assurance (QA)	Processes that are employed with hardware to support the generation of high quality data. (section 2.0 and appendix A)
Quality Control (QC)	Follow-on steps that support the delivery of high quality data and requires both automation and human intervention. (section 3.0)
Real Time	Data are delivered as soon as possible after acquisition for immediate use; time series extends only backwards in time, where the next data point is not available; and sample intervals may range from a few seconds to a few hours or even days, depending upon the variable. (section 1.0)
Thresholds	Limits that are defined by the operator.

1.0 Background and Introduction

The U.S. Integrated Ocean Observing System (IOOS) has a vested interest in collecting high quality data for the 26 core variables (U.S. IOOS 2010) measured on a national scale. In response to this interest, U.S. IOOS continues to establish written, authoritative procedures for the quality control (QC) of real-time data through the Quality Assurance/Quality Control of Real-Time Oceanographic Data (QARTOD) project, addressing each variable as funding permits. This manual on the real-time QC of in-situ current observations was first published in June 2013 as the third core variable to be addressed. Other QARTOD guidance documents that have been published to date are listed below and are available at http://www.ioos.noaa.gov/qartod/.

- 1) U.S IOOS QARTOD Project Plan dated April 1, 2012.
- 2) U.S. Integrated Ocean Observing System, 2015. Manual for Real-Time Quality Control of Dissolved Oxygen Observations Version 2.0: A Guide to Quality Control and Quality Assurance for Dissolved Oxygen Observations in Coastal Oceans. 48 pp.
- U.S. Integrated Ocean Observing System, 2015. Manual for Real-Time Quality Control of In-Situ Current Observations Version 2.0: A Guide to Quality Control and Quality Assurance of Acoustic Doppler Current Profiler Observations. 51 pp.
- 4) U.S. Integrated Ocean Observing System, 2015. Manual for Real-Time Quality Control of In-Situ Surface Wave Data Version 2.0: A Guide to Quality Control and Quality Assurance of In-Situ Surface Wave Observations. 64 pp.
- U.S. Integrated Ocean Observing System, 2013. Manual for Real-Time Quality Control of Temperature and Salinity Data: A Guide to Quality Control and Quality Assurance of Temperature and Salinity Observations. 55 pp.
- 6) U.S. Integrated Ocean Observing System, 2014. Manual for Real-Time Quality Control of Water Level Data: A Guide to Quality Control and Quality Assurance of Water Level Observations. 43 pp.
- U.S. Integrated Ocean Observing System, 2014. Manual for Real-Time Quality Control of Wind Data: A Guide to Quality Control and Quality Assurance of Coastal and Oceanic Wind Observations. 45 pp.
- 8) U.S. Integrated Ocean Observing System, 2015. Manual for Real-Time Quality Control of Ocean Optics Data: A Guide to Quality Control and Quality Assurance of Coastal and Oceanic Optics Observations. 46 pp.
- U.S. Integrated Ocean Observing System, 2015. Manual for Real-Time Quality Control of Dissolved Nutrients Data: A Guide to Quality Control and Quality Assurance of Coastal and Dissolved Nutrients Observations. 56 pp.

This document follows and expands on the National Surface Currents Plan (U.S. IOOS 2009). The U.S. Army Corps of Engineers (USACE) and the National Oceanic and Atmospheric Administration's (NOAA) National Data Buoy Center (NDBC) and Center for Operational Oceanographic Products and Services



(CO-OPS), well-recognized as established providers of current data, have long led the Nation with current observation programs. NDBC and CO-OPS have decades of experience applying QC checks for hundreds of deployments (NDBC 2009). However, the observation locations were based on local project or user requirements, resulting in a useful but ad hoc network with limited integration. The National Surface Currents Plan addresses this situation by defining a comprehensive current-observing network for the United States.

The National Surface Currents Plan documents the extensive effort that QARTOD workshops devoted to QC of currents data. The process for the development, distribution, review, refinement, and revision of this manual continues the QARTOD effort through collaboration by the QARTOD Board of Advisors, all the U.S. IOOS Regional Associations, manufacturers, and operators. Operators, individuals or entities who are responsible for collecting and providing currents data, are a key part of this endeavor.

This manual is a living document that reflects the state-of-the-art QC testing procedures for in-situ current observations using acoustic Doppler current profilers (ADCPs). It is written for the experienced operator but also provides examples for those who are just entering the field.

2.0 Purpose/Constraints/Applications

The following sections describe the purpose of this manual, as well as the constraints that operators may encounter when performing QC of in-situ current data and specific applications of those data.

2.1 Purpose

The purpose of this manual is to provide guidance to the U.S. IOOS and the in-situ currents community at large for the real-time QC of in-situ current measurements using an agreed-upon, documented, and implemented standard process. This manual is also a deliverable to the U.S. IOOS Regional Associations and the ocean-observing community and represents a contribution to a collection of core variable QC documents.

This manual documents a series of test procedures for ocean currents data QC. Current observations covered by these procedures are collected in oceans, coastal waters, and lakes in real time or near-real time. The scope of real time has expanded to accommodate the span of the 26 variables covered by U.S. IOOS. The characteristics of real time (in no particular order) are:

- data delivered as soon as possible after acquisition for immediate use
- a time series extending only backwards in time, where the next data point is not available
- sample intervals from a few seconds to a few hours or even days, depending upon the variable

High quality marine observations require sustained quality assurance (QA) and QC practices to ensure credibility and value to operators and data users. QA practices involve processes that are employed with hardware to support the generation of high-quality data, such as the use and application of a sufficiently accurate, precise, and reliable sensor with adequate resolution. Other QA practices include: sensor calibration; calibration checks, and/or in-situ verification, including post-deployment calibration; proper deployment considerations, such as measures for corrosion control and anti-fouling; solid data communications; adequate maintenance intervals; and creation of a robust quality-control process. Post-deployment calibration (instrument verification after recovery) issues are not part of the scope of this manual. Although QC and QA are interrelated and important to the process, QA considerations are addressed separately in appendix A.

QC involves follow-on steps that support the delivery of high-quality data and requires both automation and human intervention. QC practices include such things as data integrity checks (format, checksum, timely arrival of data), data value checks (threshold checks, minimum/maximum rate of change), neighbor checks, climatology checks, model comparisons, signal/noise ratios, the mark-up of the data, the verification of user satisfaction, and generation of data flags (Bushnell 2005).

These procedures are written as a high-level narrative from which a computer programmer can develop code to execute specific data flags (data quality indicators) within an automated software program. A code repository exists at https://github.com/ioos/qartod, where operators may find or post examples of code in use. Although certain tests are recommended, thresholds can vary among operators. The tests described here are designed to support a range of current sensors and operator capabilities. Some well-established programs with the highest standards have implemented very rigorous QC processes. Others, with different requirements, may utilize sensors with data streams that cannot support as many QC checks—all have value when used prudently. Users must understand and appropriately utilize data of varying quality, and operators must provide support by documenting and publishing their QC processes. A balance must be struck between the time-sensitive needs of real-time observing systems and the degree of rigor that has been applied to non-real-time systems by operators with decades of QC experience.



These tests apply only to the in-situ, real-time measurement of current points and current profiles as observed by sensors deployed on fixed or moored platforms and not to sensors deployed on moving platforms (e.g., drifting buoys, autonomous marine vehicles, ships) or remotely sensed current measurements (e.g., high frequency radar).

Through the process of the first four QARTOD workshops, a set of guidelines were collected and submitted to the Ocean.US Data Management and Communications (DMAC) Steering Committee (Bouchard et al. 2007). Those guidelines were adapted from existing guidelines developed and implemented by established providers of currents data, as well as participating manufacturers of current-measuring systems—Nortek, SonTek, and Teledyne RDI. Additionally, the individual tests have been mapped to existing tests of UNESCO (1993).

The following list includes currents data providers (operators) and manufacturers who contributed to developing this manual. Also included is the specific sensor manufacturer and where possible the individual sensors associated with the data provider. This list is not intended to be comprehensive but as a means to acknowledge the efforts of these operators and manufacturers.

- Woods Hole Oceanographic Institution, NDBC, University of South Florida (Teledyne RDI 1200, 600, 300, 75, and 38 kHz Acoustic Doppler Current Profilers)
- CO-OPS (Teledyne RDI 1200, 600, 300, and 75 kHz ADCPs; Nortek Aquadopp; SonTek 1000, 500, and 250 kHz ADP Acoustic Doppler Profilers)
- USACE FRF (Teledyne RDI, Nortek Aquadopp)
- Shell Oil Company (Teledyne RDI)

The process of ensuring data quality is not always straightforward. QA and QC procedures may be specific to a sensor technology or even to a particular manufacturer's model, so the establishment of a methodology that is applicable to every sensor is challenging.

2.2 Data Processing Methodology

The type of sensor system used to collect the data and the system used to process and transmit the information impact the QC algorithms that can be used on the data. In-situ systems with sufficient on-board processing power within the sensor and limited data transmission capability may process the original (raw) measurement and produce product summaries, such as mean currents. If ample transmission capability is available, the entire raw data stream may be transmitted ashore and subsequently quality controlled in real time from there. Therefore, because operators have different data processing methodologies, several levels of QC are proposed.

2.3 Traceability to an Accepted Standard

To ensure that ADCPs are producing accurate data, rigorous calibrations and calibration checks must be performed. Most operators rely upon manufacturer-recommended calibrations and conduct calibration checks, which are also usually described in their user manuals. These activities are considered QA and are further addressed in appendix A.

Calibrations and calibration checks must be traceable to accepted standards. The National Institute of Standards and Technology (NIST) (http://www.nist.gov/index.html), a provider of internationally accepted standards, is often the source for accepted standards, but there is no standard for measurement of currents. These activities must rely upon the fundamental standards for length, time, and the earth's magnetic field.

Fortunately, traceability to NIST is relatively easy because the standards for length, time, and compassbearing are readily available at the resolutions required.

2.4 Sensor Deployment Considerations

ADCPs can be mounted in a variety of configurations, such as:

- in a platform sitting on the bottom, looking upward
- on a buoy, looking downward
- attached to a structure, looking horizontally (side-looking)
- on an oil rig, looking in any direction
- aboard a surface vessel underway
- upward or downward on an autonomous underwater vehicle or glider
- upward or downward on an in-line mooring

Acoustic Doppler current meters and profilers may have two (the minimum required for horizontal profiling), three, four, or more transducers. In some cases, redundant transducers over-resolve the current measurements, and the results are used to provide an estimate of the quality of the observations. In other cases, multiple transducer pairings utilize different transmit frequencies and provide the benefits of longer range from a lower frequency and higher spatial resolution from the higher frequency. Examples of the variety of transducer configurations are shown in figs. 3-1 through 3-5. This manual does not cover the QC of all possible configurations, but it does include the most widely used tests provided by participating operators. Notes within each specific test provide application guidance.





Figure 3-1. Teledyne RDI ADCP (left); Nortek Aquadopp transducer head (right). (Photos courtesy of Teledyne RDI and Nortek)





Figure 3-2. SonTek ADP (left); Aanderaa Doppler current sensors (right). (Photos courtesy of Mark Bushnell/NOAA and Aanderaa website)

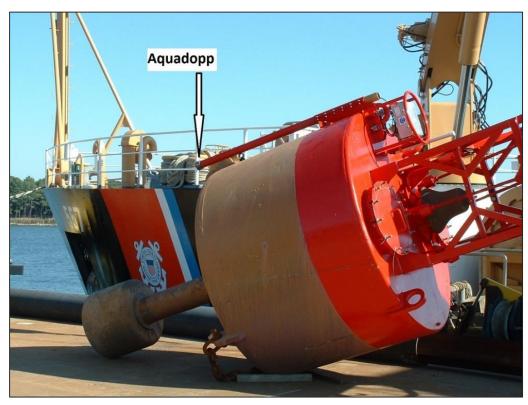


Figure 3-3. A Nortek Aquadopp is fastened to a standard U.S. Coast Guard aid to navigation positioned for downward-looking observations. (Photo courtesy of Mark Bushnell/NOAA)



Figure 3-4. A bottom-mounted upward-looking Nortek AWAC is prepared for deployment. (Photo courtesy of Doug Wilson/NOAA)



Figure 3-5. A SonTek side-looking ADP is raised for cleaning. (Photo courtesy of Warren Krug/NOAA)

2.5 Hardware Limitations

Advances in ADCP sensor technology have eliminated many of the problems encountered in older devices. Sensors are now smaller, more reliable, and draw less power. Ancillary sensors can be employed to make corrections, and most notably, signal processing hardware and software capabilities have grown enormously.



ADCP current sensors can withstand moderate bio-fouling, but observational accuracy gradually degrades as marine growth becomes excessive. As the bio-mass increases on the ADCP transducers, effective acoustic power output and transducer reception sensitivity also degrade, leading to reduced signal-to-noise ratios and less accurate observations. ADCPs using pressure sensors may find dampened output as the orifice becomes obstructed. The degree of bio-fouling will vary depending on a number of factors, but in some instances, effective anti-fouling materials and coatings may permit system deployments in excess of two years.

As with all instruments, ADCPs are depth/range limited by the pressure housing. ADCP measurements are further depth/range limited in two fundamental ways: 1) the acoustic signal strength loss over distance (higher frequency systems have shorter ranges) and 2) the acoustic beams spread with increasing range, both within an individual beam and among the multiple beams, which leads to reduced resolution and less certainty that the sampled field has uniform flow. Many of the QC tests address these limitations through the use of carefully selected thresholds and other test criteria.

ADCP transducer side-lobe reflections must also be considered. These reflections can come from the bottom, the surface, or adjacent structures and degrade ADCP performance. These errors are mitigated by proper deployment procedures. Manufacturer user manuals should be consulted to ensure that proper procedures are followed.

2.6 Other Important Considerations

Corrections for magnetic declination and deviation are important and must be given careful consideration. Although these corrections are beyond the scope of this manual, manufacturers provide processes for making corrections, which are specific to the sensor make/model, within their user manuals.

While outside the scope of the real-time tests described in this manual, QA is critical to data quality. Sensors require attention to proper QA measures both before and after the deployment (appendix A). Operators must follow the manufacturer's recommendations for factory calibration schedules and proper sensor maintenance.

Also important, but beyond the scope of this document at present, is the determination and reporting of data uncertainty. Knowledge of the accuracy of each observation is required to ensure that data are used appropriately and aids in the computation of error bounds for subsequent products derived by users. All sensors and measurements contain errors that are determined by hardware quality, methods of operation, and data processing techniques. Operators should routinely provide a quantitative measure of data uncertainty in the associated metadata. Such calculations can be challenging, so operators should also document the methods used to compute the uncertainty. The limits and thresholds implemented by operators for the data QC tests described here are a key component in establishing the observational error bounds. Operators are strongly encouraged to consider the impact of the QC tests on data uncertainty, as these two efforts greatly enhance the utility of their data.

Sensor redundancy is key to obtaining measurements and ensuring that uncertainties can be assigned to those measurements. Currents measurements are not independent, being sensitive primarily to local concentration. Hence, comparing two adjacent instruments can assist in evaluation of data quality, as well as provide two (or more) independent estimates of a parameter of interest. Variation in the estimated values can be useful in uncertainty calculations.

3.0 Quality Control

To conduct real-time QC on current observations, the first pre-requisite is to understand the science and context within which the measurements are being conducted. Currents are dependent upon many things such as tidal forces, density gradients, winds, and riverine flow. The real-time QC of these observations can be extremely challenging. Human involvement is therefore important to ensure that solid scientific principles are applied to the process to ensure that good data are not discarded and bad data are not distributed. Examples include selection of appropriate thresholds and examination of data flagged as questionable.

This manual focuses specifically on real-time data, so the operator is likely to encounter aspects of data QC where the flags and tests described in the following sections do not apply because the data are not considered to be real time. For example, for real-time QC, drift (slow changes in sensor calibration) cannot be detected or corrected. Fortunately, sensor drift and drift correction are not typically issues for ADCPs (except for clock drift). Another example might be the ability of some data providers to backfill data gaps. In both of these examples, the observations are not considered to be real time for purposes of QC checks. (However, in some sophisticated 24/7 QC operations, real-time dissemination may be switched from one sensor to another based on real-time QC flags.)

3.1 QC Flags

Data are evaluated using QC tests, and the results of those tests are recorded by inserting flags in the data files. Table 3-1 provides a simple set of flags and associated descriptions. Operators may incorporate additional flags for inclusion in metadata records. For example, an observation may fail the current speed test (test 10) and be flagged as having failed the test. Additional flags may be incorporated to provide more detailed information to assist with troubleshooting. If the data failed the current speed test by exceeding the upper limit, a "failed high" flag may indicate that the values were higher than the expected range, but such detailed flags primarily support maintenance efforts and are presently beyond U.S. IOOS requirements for QC of real-time data. For additional information regarding flags, see the *Manual for the Use of Real-Time Oceanographic Data Quality Control Flags* (U.S. IOOS 2014) posted on the U.S. IOOS QARTOD website.

Further post-processing of the data may yield different conclusions from those reached during initial assessments. Flags set in real time should not be changed to ensure that historical documentation is preserved. Results from post-processing should generate another set of flags.

Observations are time ordered, and the most recent observation is n_0 , preceded by a value at n-1, and so on backwards in time. The focus of this manual is primarily on the real-time QC of observations n, n-1, and n-2.



Table 3-1 Flags for real-time data from ADCPs. (UNESCO 2013)

Flag	Description	
Pass=1	Data have passed critical real-time QC tests and are deemed adequate for use as preliminary data.	
Not evaluated=2	Data have not been QC-tested, or the information on quality is not available.	
Suspect or Of High Interest=3	Data are considered to be either suspect or of high interest to operators and users. They are flagged suspect to draw further attention to them by operators.	
Fail=4	Data are considered to have failed one (or more) critical real-time QC check. If they are disseminated at all, it should be readily apparent that they are not of acceptable quality.	
Missing data=9	Data are missing; used as a placeholder.	

3.2 QC Test Types and Hierarchy

This section outlines the 20 real-time QC tests that are required and recommended for in-situ currents. Tests are listed in table 3-2 and are divided into four groups according to test type. The tests in group 1 (table 3-3) are required (where possible) for all current measurements collected for U.S. IOOS. However, the output of some instruments is not sufficient for some tests. Operators must consider each test in group 2 to determine if it can be applied in their particular instance—not all tests can be implemented in all situations. Operators should also consider that some of these tests can be carried out within the instrument, where thresholds can be defined in configuration files. Although more tests imply a more robust QC effort, there are many reasons operators could use to justify not conducting some tests. In those cases, operators need only to document reasons these tests do not apply to their observations. Such flexibility is needed to support the U.S. IOOS Regional Information Coordination Entities certification effort (IOOC 2012), since the number of tests conducted and the justification for not applying some tests are useful for evaluating an operator's skill level. Even though currently there are no suggested tests, group 3 is retained as a placeholder for possible future additions.

Table 3-2. QC tests for real-time current data from fixed or buoy-mounted current sensors

Test Type	Test Name	Status
	Battery Power (Test 1)	Strongly Recommended
Sensor Health	Check Sum (Test 2)	Required
sensor Hearth	Sensor Tilt (Test 3)	Required
	Speed of Sound (Test 4)	Required
	Noise Floor (Test 5)	Strongly Recommended
	Signal Strength (Test 6)	Required
Signal Quality	Signal-to-Noise (Test 7)	Strongly Recommended
	Correlation Magnitude (Test 8)	Strongly Recommended
	Percent Good (Test 9)	Strongly Recommended
	Current Speed (Test 10)	Required
	Current Direction (Test 11)	Required
	Horizontal Velocity (Test 12)	Required
Current	Vertical Velocity (Test 13)	Strongly Recommended
Velocity	Error Velocity (Test 14)	Strongly Recommended
	u, v Rate of Change (Test 15)	Strongly Recommended
	u, v Spike (Test 16)	Strongly Recommended
	Flat Line (Test 17)	Required
	Echo Intensity (Test 18)	Required
Overall Profile	Echo Intensity Drop-off (Test 19)	Strongly Recommended
	Current Gradient (Test 20)	Strongly Recommended



Table 3-3. QC tests in order of requirement hierarchy

Group 1 Required	Check Sum (Test 2) Sensor Tilt (Test 3) Speed of Sound (Test 4) Signal Strength (Test 6) Current Speed (Test 10) Current Direction (Test 11) Horizontal Velocity (Test 12) Flat Line (Test 17) Echo Intensity (Test 18)
Group 2 Strongly Recommended	Battery Power (Test 1) Noise Floor (Test 5) Signal-to-Noise (Test 7) Correlation Magnitude (Test 8) Percent Good (Test 9) Vertical Velocity Test (13) Error Velocity Test (14) u, v Rate of Change Test (15) u, v Spike Test (16) Echo Intensity Drop-off Test (19) Current Gradient Test (20)
Group 3 Suggested	

Some effort will be needed to select the best thresholds, which are determined at the operator level and may require trial and error/iteration before final selections are made. A successful QC effort is highly dependent upon selection of the proper thresholds, which should not be determined arbitrarily but can be based on a number of criteria, such as historical knowledge, statistics derived from more recently acquired data, and manufacturer recommendations. Although this manual provides some guidance for selecting thresholds based on input from various operators, it is assumed that operators have the subject matter expertise as well as a sincere interest in selecting the proper thresholds to maximize the value of their QC effort. Operators are required to openly provide thresholds as metadata for user support. This shared information will help U.S. IOOS to document standardized thresholds to be included in future releases of this manual.

3.3 QC Test Descriptions

A variety of tests can be performed on the sensor measurements to evaluate data quality. Testing the integrity of the data transmission is a first step. If the data are corrupted during transmission, further testing may be irrelevant. The checks defined in these 20 tests evaluate data through various comparisons to other data and to the expected conditions in the given environment. The tests listed in this section presume a time-ordered series of observations (..., n-2, n-1, n) and denote the most recent observation as previously described.

For each test described, i represents the bin number, with bin one being closest to the instrument, and j represents the beam number.

The test descriptions provided are examples of tests that may be employed. They are not intended to be the only acceptable tests, rather they serve to clearly identify the intent of the test. The examples are the best available at present and will be improved in updated manuals as tests are implemented. Specifically, the rate-of-change and spike tests are surprisingly challenging and have deficiencies as presently described. Both tests may suffer from false failure of subsequent valid observations when recovering from the initial detection of a flawed observation. Operators are strongly encouraged to share improved versions of all tests as they are developed.



3.3.1 Sensor Health Tests

Each test checks to ensure that the sensor is working properly.

Battery Power (Test 1) – Strongly Recommended

Check for sufficient battery voltage.		
Test determin	nes that there is sufficient battery power (E	BATTPOW) to provide a "good" measurement.
Flags	Condition Codable Instructions	
Fail = 4	Battery power is less than an accepted minimum value (MIN).	If BATTPOW < MIN, flag = 4
Suspect = 3	N/A	
Pass = 1	Battery power is sufficient.	If BATTPOW ≥ MIN, flag = 1
Test Exception: Test cannot be applied when no battery measurement is provided.		
Test specifications to be established by operator. Example 1: MIN = 11.6 Vdc Example 2: Teledyne RDI, MIN = 150 battery counts		

Check Sum (Test 2) - Required

•	•			
Check for d	Check for data message integrity.			
Test to ensure that the message transmitted from the sensor is valid. A checksum value (CKSUMXMT) is prepared from the message before it is transmitted and appended to the data stream. Once the message is received, a checksum is calculated from the message and that value is compared to the transmitted value.				
Flags	Condition Codable Instructions			
Fail = 4	The data message fails if the calculated checksum (CKSUMCAL) from the data stream does not match the transmitted checksum (CKSUMXMT) in the message.	IF CKSUMCAL ≠ CKSUMXMT, flag = 4		
Suspect = 3	N/A	None		
Pass = 1	The data message is valid if the calculated checksum (CKSUMCAL) is identical to the transmitted	IF CKSUMCAL = CKSUMXMT, flag = 1		

Test Exception: Test cannot be applied when no checksum or other message integrity verification is provided.

Example: CKSUMXMT = FF4A, CKSUMCAL = FF4A, flag = 1

checksum (CKSUMXMT).

14

Sensor Tilt (Test 3) - Required

Check for unexpected tilt or change in tilt.

Current sensors must be aligned within an expected range of tilt angles to properly measure horizontal and vertical currents. Sensors with the capability to measure tilt along two axes should undergo this sensor tilt test to ensure that the measurements are collected within the correct range of values for the type of current meter used. Manufacturers' specifications indicate the maximum allowable tilt.

Flags	Condition	Codable Instructions
Fail = 4	Tilt (TILTX, TILTY) angle is greater than the allowed value (TILTMAX).	If TILTX > TILTMAX OR TILTY > TILTMAX, flag = 4
Suspect = 3	N/A	
Pass = 1	Tilt angle is less than or equal to the allowed value.	If TILTX ≤ TILTMAX OR TILTY ≤ TILTMAX, flag = 1

Test Exception: Test cannot be applied when no tilt value is provided in real-time data stream.

TILTMAX values provided by manufacturer.

Example: TILTMAX = 15°, TILTX = 3, TILY = 1, flag = 1

Speed of Sound (Test 4) - Required

Check for a valid speed of sound value.

The speed of sound value is used in the calculation of acoustic pulse travel times and must be within a reasonable range given a known salinity and temperature of the water column and allowing for variations in density throughout.

Flags	Condition	Codable Instructions
Fail = 4	If the speed of sound value (SSVAL) is outside of acceptable sound speed range (SSMIN to SSMAX) it is not valid.	IF SSVAL < SSMIN OR SSVAL > SSMAX, flag = 4
Suspect = 3	N/A	None
Pass = 1	If the speed of sound value (SSVAL) is within the acceptable sound speed range (SSMIN to SSMAX) it is valid.	IF SSVAL ≥ SSMIN AND SSVAL ≤ SSMAX, flag = 1

Test Exception: None.

Test specifications to be established locally by operator: SSMIN and SSMAX Example: SSMIN = 1,475 m/s, SSMAX = 1,560 m/s, SSVAL = 1,528 m/s, flag = 1



3.3.2 Signal Quality Tests

Signal quality tests are applied to each beam of the sensor and to each depth level that is transmitted by the sensor.

Noise Floor (Test 5) - Strongly Recommended

Ensure that measured values of signal are above the noise value.

System noise within each of the beams should be within a specified range of values. If any of the beams fail the test, the sensor fails the test and should not be used.

Flags	Condition	Codable Instructions
Fail = 4	System noise values [SCMNOIS(j)] are outside a count range.	If $SCMNOIS(j) < COUNTMIN OR$ SCMNOIS(j) > COUNTMAX, flag $(j) = 4$
Suspect = 3	N/A	
Pass = 1	System noise values [SCMNOIS(j)] are within a count range.	If SCMNOIS(j) \geq COUNTMIN AND SCMNOIS(j) \leq COUNTMAX, flag (j) = 1 All flags must equal 1, FLAG(1) = FLAG(2) = FLAG(3) = 1 to continue

Test Exception: For instruments with extra beams, a solution can be achieved with a bad beam. A four-beam system can provide 3-D currents if just one beam is bad. At least three beams must pass this test for vertical profiling, and at least two beams are required for horizontal profiling.

Test specifications to be established locally by operator.

Example: COUNTMIN = 25 counts; COUNTMAX = 30 counts (Nortek Aquadopp)

Signal Strength (Test 6) - Required

Ensure that the signal strength is sufficient to produce good data.

Signal strength within each of the beams should be above a specified threshold (SCMDBMIN). At least three beams must pass this test for vertical profiling, and at least two beams are required for horizontal profiling.

Flags	Condition	Codable Instructions
Fail = 4	Signal strength values [SCMDB(j)] for each beam, j, are greater than a minimum value.	IF SCMDB(j) < SCMDBMIN, flag = 4
Suspect = 3	N/A	
Pass = 1	Signal strength values exceed the minimum value for good data.	IF SCMDB(j) ≥ SCMDBMIN, flag = 1

Test Exception: None.

Test specifications to be established by the manufacturer.

Example: SCMDBMIN = 25 counts (Nortek Aquadopp)

16

Signal-to-Noise (Test 7) - Strongly Recommended

Test that the signal-to-noise ratio is sufficient.

The signal-to-noise ratio value should exceed an operator-prescribed value for each bin for the measurements to be valid.

Flags	Condition	Codable Instructions
Fail = 4	If the signal-to-noise ratio value [SNRVAL(i)] is less than the operator-prescribed value (SNRMIN), the measurement is not valid.	If SNRVAL < SNRMIN, flag = 4
Suspect = 3	N/A	None
Pass = 1	Applies for test pass condition.	If SNRVAL ≥ SNRMIN, flag = 1

Test Exception: None.

Test specifications to be established locally by operator.

Example: Operators to provide examples as procedures are implemented.

Correlation Magnitude (Test 8) – Strongly Recommended

Test that correlation magnitude is above an acceptable threshold.

A key quality control parameter for broadband ADCPs is the correlation magnitude. This is essentially a measurement of how much the particle distribution has changed between phase measurements. The less the distribution has changed, the higher the correlation, and the more precise the velocity measurement.

Correlation magnitude is provided for each bin (i) and each beam (j).

Flags	Condition	Codable Instructions
Fail = 4	If the correlation magnitude [CMAG(i,j)] falls below a certain count level (CMAGMIN), the measurement for that bin and beam fails.	If CMAG(i,j) < CMAGMIN, flag = 4
Suspect = 3	If the correlation magnitude [CMAG(i,j)] is between the minimum (CMAGMIN) and maximum (CMAGMAX) count levels, the measurement for that bin and beam passes, but is considered suspect.	IF CMAG(i,j) \geq CMAGMIN AND CMAG(i,j) \leq CMAGMAX, flag = 3
Pass = 1	If the correlation magnitude [CMAG(i,j)] is above a maximum count level (CMAGMAX), the measurement for that bin and beam passes.	IF CMAG(i,j) > CMAGMAX, flag = 1

Test Exception: This test is primarily for the Teledyne RDI ADCP sensors.

Test specifications to be established by the manufacturer.

Example: Operators to provide examples as procedures are implemented.

Percent Good (Test 9) - Strongly Recommended

Percentage of high data quality measurements to produce good velocities.



A key quality control parameter, percent good, indicates what fraction of the pings passed the various error thresholds. The percent good test determines whether the data that are being returned are sufficient to provide the required data quality. Different methods are used by different manufacturers. For Teledyne RDI, there are percent good three-beam [PG1(j)] solutions (one beam rejected) and percent good fourbeam [PG4(j)] solutions. This test is applied to each depth bin, i.

Flags	Condition	Codable Instructions
Fail = 4	If PG1(i) and PG4(i) combined do not exceed a minimum value (PGMINLO), the measurement at that depth bin (i) fails.	IF PG1(i) + PG4(i) < PGMINLO, flag = 4
Suspect = 3	If PG1(i) and PG4(i) combined fall in the range between PGMINLO and PGMINHI, the measurement at that depth passes, but is flagged as suspect.	IF PG1(i) + PG4(i) \geq PGMINLO AND PG3(i) + PG4(i) \leq PGMINHI, flag = 3
Pass = 1	If PG1(i) and PG4(i) combined exceed a minimum value(PGMINHI), the measurement at that depth bin (i) passes.	IF PG1(i) + PG4(i) > PGMINHI, flag = 1

Test Exception: This applies only to Teledyne RDI sensors, excluding beam coordinate configuration.

Test specifications to be established by the manufacturer. In this case, the PGMINLO and PGMINHI values differ depending on the frequency of Teledyne RDI system used and the sampling strategy (pings per second and sampling interval).

Example: Percent good for Teledyne RDI ADCPs, fail = PG1 + PG4 < 25 and suspect = PG1 + PG4 < 75

3.3.3 Current Velocity Tests

These tests check the validity of the current velocity (speed and direction) measurements.

Current Speed (Test 10) - Required

Ensure that the current speed is reasonable.

Current speed is typically provided as a positive value. This test checks for unrealistically high current speed values and is applied to each depth bin (i). The maximum current speed should be set based on the environment in which the instrument will be deployed, as well as for all reasonable high-speed anomalies.

Flags	Condition	Codable Instructions
Fail = 4	If the current speed [CSPD(i)] exceeds a reasonable maximum value (SPDMAX), the measurement fails.	IF CSPD(i) > SPDMAX, flag = 4
Suspect = 3	N/A	
Pass = 1	If the current speed [CSPD(i)] is less than or equal to a reasonable maximum value (SPDMAX), the measurement passes.	IF CSPD(i) \leq SPDMAX, flag = 1

Test Exception: None.

Applies to: All current measurements.

Test specifications to be established locally by operator.

Example: SPDMAX = 250 cm/s

Current Direction (Test 11) - Required

Ensure that the current direction is reasonable.

This test ensures that the current direction values fall between 0 and 360 degrees, inclusive. In most systems, 0 is reported as the absence of any current and 360 degrees indicates a current to the north. This test is applied to each depth bin (*i*).

Flags	Condition	Codable Instructions
Fail = 4	If current direction [CDIR(i)] is less than 0.00 degrees or greater than 360 degrees, the measurement is invalid.	IF CDIR(i) < 0.00 OR CDIR(i) > 360.00, flag = 4
Suspect = 3	N/A	
Pass = 1	If current direction [CDIR(i)] is greater than 0.00 degrees and less than or equal to 360 degrees, the measurement is valid.	IF CDIR(i) \geq 0.00 AND CDIR(i) \leq 360.00, flag = 1

Test Exception: None. Applies to all current measurements.

Test specifications may be adjusted locally depending on their application of 0.00 and 360.00 values.

Examples: None needed.



Horizontal Velocity (Test 12) - Required

Ensure that horizontal velocities are valid measurements.

Horizontal velocities u(i) and v(i) may be represented as components (East-West and North-South; Alongshore and Cross-Shore: Along-shelf and Cross-Shelf, Along-Isobath and Cross-Isobath, etc.) of the current speed and direction. This test ensures that speeds in the respective horizontal directions (HVELMAXX) and HVELMAXY) are valid. Maximum allowed values may differ in the orthogonal directions. This test is applied to each depth bin (i).

Flags	Condition	Codable Instructions
Fail = 4	Horizontal velocities exceed expected maximum values in the two horizontal directions.	IF ABS[u(i)] > HVELMAXX OR IF ABS[v(i)] > HVELMAXY, flag = 4
Suspect = 3	N/A	
Pass = 1	Horizontal velocities fall within the expected range of values.	IF ABS[$u(j)$] \leq HVELMAXX AND ABS[$v(j)$] \leq HVELMAXY, flag = 1

Test Exception: None.

Test specifications to be established locally by operator.

Example: Operators to provide examples as procedures are implemented.

Vertical Velocity (Test 13) - Strongly Recommended

Ensure that vertical velocities are valid measurements.

Vertical velocities are reported by many ADCPs. They are calculated just like the horizontal velocities but along the vertical axis. This test is applied to each depth bin (i).

Flags	Condition	Codable Instructions
Fail = 4	N/A	None
Suspect = 3	If vertical velocity [w(i)] in a depth bin is greater than 1% of the current speed [CSPD(i)] in the depth bin, the measurement fails.	IF ABS[w(i)] > (0.01*CSPD(i)), flag = 3
Pass = 1	If vertical velocity [w(i)] in a depth bin is less than or equal to 1% of the current speed [CSPD(i)] in the depth bin, the measurement passes.	IF ABS[w(i)] \leq (0.01*CSPD(i)), flag = 1

Test Exception: Alternately, a maximum vertical velocity, VELMAX, may be set and inserted for the (0.01*CSPD(j)) value.

Test specifications may be established locally by operator.

Example: VELMAX = 0.3 m/s

20

Error Velocity (Test 14) - Strongly Recommended

Test that the error velocity is below an acceptable threshold.

Error velocity is a key QC parameter that derives from the four-beam geometry of an ADCP. Each pair of opposing beams provides one measurement of the vertical velocity and one component of the horizontal velocity, so there are two independent measurements of velocity that can be compared. If the flow field is homogeneous (http://www.rdinstruments.com/glossary.aspx#H), the difference between these velocities will average to zero. The error velocity can be treated as an indication of errors in the horizontal velocity measurements. This test is applied to each depth bin (i).

Flags	Condition	Codable Instructions
Fail = 4	If the error velocity [EV(i)] within a depth bin exceeds a manufacturer-provided maximum value (EVMAX), the velocity measurements at that depth fail.	IF EV(i) > EVMAX, flag = 4
Suspect = 3	If the error velocity [EV(i)] within a depth bin exceeds a manufacturer-provided minimum value (EVMIN) but is less than a manufacturer-provided maximum value (EVMAX), the velocity measurements at that depth pass but are flagged as suspect.	IF $EV(i) \le EVMAX$ AND $EV(i) \ge EVMIN$, flag = 3
Pass = 1	If the error velocity [EV(i)] within a depth bin is less than a manufacturer-provided minimum value (EVMIN), the velocity measurements at that depth pass.	IF EV(i) < EVMIN, flag = 1

Test Exception: Can be used only for ADCPs with four or more beams.

Test specifications to be established by the manufacturer.

Example: EVMAX = 20, EVMIN = 15



u, v Rate of Change (Test 15) - Strongly Recommended

Test that velocity/direction change is below an acceptable threshold.

The difference between the most recent u, v velocity components (n) are compared to the previous u, v observations (n-1). If the change exceeds the specified thresholds, data are flagged fail or suspect. This test is applied to each depth bin (i).

Some operators may wish to implement the rate of change test on pitch/roll/heading outputs of fixed mounted ADCPs to test for unexpected platform motion caused, for example, by a ship anchor strike.

Flags	Condition	Codable Instructions
Fail = 4	If the absolute value of the difference $u(i,n) - u(i,n-1)$ or $v(i,n) - v(i,n-1)$ exceeds the fail threshold RC_VEL_FAIL, the velocity/direction measurements at that depth fails.	IF ABS[$u(i,n) - u(i,n-1)$] OR ABS[$v(i,n) - v(i,n-1)$] \geq RC_VEL_FAIL, flag = 4
Suspect = 3	If the absolute value of the difference $u(i,n) - u(i,n-1)$ or $v(i,n) - v(i,n-1)$ exceeds the suspect threshold (RC_VEL_SUSPECT), the velocity/direction measurements at that depth are flagged as suspect.	IF ABS[$u(i,n) - u(i,n-1)$] OR ABS[$v(i,n) - v(i,n-1)$] \geq RC_VEL_SUSPECT AND $<$ RC_VEL_FAIL , flag = 3
Pass = 1	If the absolute value of the difference $u(i,n) - u(i,n-1)$ and $v(i,n) - v(i,n-1)$ are less than the suspect threshold RC_VEL_SUSPECT, the velocity/direction measurements at that depth pass.	IF ABS[$u(i,n) - u(i,n-1)$] AND ABS[$v(i,n) - v(i,n-1)$] $< RC_VEL_SUSPECT$, flag = 1

Test Exception: None.

Example 1: Simple fixed thresholds

RC_VEL_FAIL = 100 cm/s, RC_VEL_SUSPECT = 50 cm/s

Example 2: Thresholds based on recent variability

RC_VEL_FAIL = 3* SD u and v observations during previous 6 hours

RC VEL SUSPECT = 2*SD u and V observations during previous 6 hours

Example 3: Thresholds based upon elapsed spike gap duration (du/dt, dv/dt)

RC_VEL_FAIL = 50 cm/s per 6 min sample interval

RC_VEL_SUSPECT = 25 cm/s per 6 min sample interval

u, v Spike (Test 16) - Strongly Recommended

Test if u, v (n-1) values exceed selected thresholds relative to adjacent time series data points.

This check is for single-value spikes, specifically the u, v values at point n-1. Spikes consisting of more than one data point are difficult to capture, but their onset may be flagged by the rate of change test. This test is applied to each depth bin (i).

The spike test consists of two operator-selected thresholds, uv_SPIKE_FAIL and uv_SPIKE_SUSPECT. Adjacent data points $u(n_{-2} \text{ and } n_0)$ are averaged to form a spike reference (u_SPK_REF), and adjacent data points v(n-2 and n) are averaged to form a spike reference (v_SPK_REF). Only adjacent data points that have been flagged pass should be used to form the spike reference. When absent, earlier observations may need to be employed. The absolute value of the spike is tested to capture positive and negative spikes. Large spikes are easier to identify as outliers and flag as failures. Smaller spikes may be real and are only flagged suspect. The thresholds may be fixed values or dynamically established (for example, a multiple of the standard deviation over an operator-selected period). They may also be expressed as a function of time (e.g., d(u)/dt) to accommodate varying time increments.

An alternative spike test may use a third difference test, for example defined as Diff_n = u(n-3) - 3*u(n-2) + 3*u(n-1) - u(n).

Flags	Condition	Codable Instructions
Fail = 4	If the absolute value of the difference u(i,n-1) – u_SPK_REF or v(i,n-1) – v_SPK_REF exceeds the fail threshold uv_SPIKE_FAIL, the velocity/direction measurements at that depth fails.	IF ABS[u(i,n-1) — u_SPK_REF] OR ABS[v(i,n-1) — v_SPK_REF] ≥ uv_SPIKE_FAIL , flag = 4
Suspect = 3	If the absolute value of the difference u(i,n-1) – u_SPK_REF or v(i,n-1) – v_SPK_REF exceeds the Suspect threshold uv_SPIKE_SUSPECT, the velocity/direction measurements at that depth are flagged as suspect.	IF ABS[u(i,n-1) – u_SPK_REF] OR ABS[v(i,n-1) – v_SPK_REF] ≥ uv_SPIKE_SUSPECT AND < uv_SPIKE_FAIL, flag = 3
Pass = 1	If the absolute value of the difference u(i,n-1) – u_SPK_REF and v(i,n-1) – v_SPK_REF are less than the Suspect threshold uv_SPIKE_SUSPECT, the velocity/direction measurements at that depth pass.	IF ABS[u(i,n-1) – u_SPK_REF] AND ABS[v(i,n-1) – v_SPK_REF] < uv_SPIKE_SUSPECT , flag = 1

Test Exception: None.

Example 1: Simple fixed thresholds

uv_SPIKE_FAIL = 100 cm/s, uv_SPIKE_SUSPECT = 50 cm/s

Example 2: Thresholds based on recent variability

uv_SPIKE_FAIL = 3* SD u and v observations during previous 6 hours

uv_SPIKE_SUSPECT = 2*SD u and V observations during previous 6 hours

Example 3: Thresholds based upon elapsed spike gap duration (du/dt, dv/dt)

uv_SPIKE_FAIL = 50 cm/s per 6 min sample interval

uv_SPIKE_SUSPECT = 25 cm/s per 6 min sample interval



Flat Line (Test 17) - Required

This test checks for observations that do not change with time, and the test can be applied to many variables, such as velocities, directions, or pressure.

When some sensors and/or data collection platforms (DCPs) fail, the result can be a continuously repeated observation of the same value. This test compares the present observation (POn) to a number (REP_CNT_FAIL or REP_CNT_SUSPECT) of previous observations. POn is flagged if it has the same value as previous observations within a tolerance value EPS to allow for numerical round-off error. This test may apply to sensor outputs as well as derived values. Note that historical flags are not changed.

Flags	Condition	Codable Instructions
Fail = 4	When the five most recent observations are equal, PO _n is flagged fail.	For i=1,REP_CNT_FAIL PO _n -PO _{n-i} < EPS, flag = 4
Suspect = 3	It is possible but unlikely that the present observation and the two previous observations would be equal. When the three most recent observations are equal, POn is flagged suspect.	For i=1,REP_CNT_SUSPECT POn -POn-i < EPS, flag = 3
Pass = 1	Applies for test pass condition.	

Test Exception: None.

Examples: REP_CNT_FAIL = 5, REP_CNT_SUSPECT = 3

3.3.4 Overall Profile Tests

These tests use the entire beam length or current profile to check a variety of conditions. They do not apply to a single-point acoustic Doppler current meter.

Echo Intensity (Test 18) - Required

Check for echo intensities that may indicate interactions with the surface, bottom, or in-water structures.

If a beam reflects off a boundary, then the echo intensity increases from the previous bin. This test is a comparison of the echo intensity [EINT(i,j)] in bin i, beam j to the echo intensity in the previous bin, EINT(i-1,j). If other beams differ from the tested beam (when comparing adjacent bins) by a pre-described amount, the bin may be flagged.

Flags	Condition	Codable Instructions
Fail = 4	Two or more beams have adjacent	For <i>i</i> ≥ 2 and <i>j</i> =1,2,3,4
	bins that differ by more than an	If $EINT(i,j)$ - $EINT(i-1,j)$ > MAXEICNT
	operator-prescribed number of	BADBEAM++
	counts, MAXEICNT.	If BADBEAM ≥ 2, flag = 4
Suspect = 3	One beam has an adjacent bin that	If BADBEAM = 1, flag = 3
	differs by more than an operator-	
	prescribed number of counts,	
	MAXEICNT.	
Pass = 1	No other beams have an adjacent	If BADBEAM = 0, flag = 1
	bin that differs by more than an	
	operator-provided amount,	
	MAXEICNT.	

Test Exception: None.

Test specifications to be established locally by the operator.

Example: MAXEICNT = 30



Echo Intensity Drop-off (Test 19) - Strongly Recommended

Test of echo intensity with distance from the transmitter.

The echo intensity decreases with distance from the transmitter. Eventually, at some distant bin (and beyond), there may not be enough energy to provide a valid measure of current speed and direction.

Flags	Condition	Codable Instructions
Fail = 4	If echo intensity at bin <i>I</i> [EI(<i>i,j</i>)] falls below an accepted minimum value (EIMIN) in two or more bins, the data at this bin and farther from the transducer are invalid.	If $EI(i,j) < EIMIN OR$ $EI(i+1,j) < EIMIN OR$ $EI(i+2,j) < EIMIN OR$ $EI(i+3,j) < EIMIN, flag = 4$
Suspect = 3	N/A	N/A
Pass = 1	If echo intensity [EI(i,j)] exceeds an accepted minimum value (EIMIN) in three or more bins, the data at this bin are valid.	If $EI(i,j) \ge EIMIN$ AND $EI(i+1,j) \ge EIMIN$ AND $EI(i+2,j) \ge EIMIN$ AND $EI(i+3,j) \ge EIMIN$, flag = 1

Test Exception: None.

Test specifications to be established locally by the operator.

Examples: EIMIN = 25 counts

Current Gradient (Test 20) - Strongly Recommended

Test for excessive current speed/direction changes in the vertical profile.

Current speed is expected to change at a gradual rate with depth. A current difference with depth (CSPDDIF), to be determined locally, should be established and the rate of current speed difference with depth between two bins determined. The same test can be run with current direction.

Flags	Condition	Codable Instructions
Fail = 4	If current speed at bin <i>i</i> , CSPD(<i>i</i>) exceeds current speed at bin <i>i</i> -1, CSPD(<i>i</i> -1) by a prescribed amount, CSPDDIF, the data are not valid.	IF ABS[CSPD(i)-CSPD(i-1)] > CSPDDIF, flag = 4
Suspect = 3	N/A	None
Pass = 1	If current speed at bin <i>i</i> , CSPD(<i>i</i>) change from the current speed at bin(<i>i</i> -1), CSPD(<i>i</i> -1), is less than or equal to a prescribed amount, CURDIF, the data are valid.	IF ABS[CSPD(i)-CSPD(i-1)] \leq CSPDDIF, flag = 1

Test Exception: Applicable only to current profiles, and not to single-point measurement systems.

Test specifications to be established locally by the operator.

Examples: Operators to provide examples as procedures are implemented.

4.0 Summary

The QC tests in this currents document have been compiled from QARTOD workshops (QARTOD 2003-2009). Test suggestions came from several existing operators with extensive experience, and wherever possible, redundant tests have been merged. The considerations of operators who ensure the quality of real-time data may be different from those whose data are not published in real time, and these and other differences must be balanced according to the specific circumstances of each operator. Although these real-time tests are required, recommended, or suggested, it is the operator who is responsible for deciding which tests are appropriate. Each operator selects thresholds based on the specific program requirements that must be met. The scope of requirements can vary widely, from complex data streams that support myriad QC checks to ensure precise and accurate measurements - to basic data streams that do not need such details. Operators must publish their QC processes via metadata so that data users can readily see and understand the source and quality of those data.

The 20 QC tests identified apply to current observations from ADCPs and may apply to other types of current sensors. All tests are either required or strongly recommended, and they fall into four groups: sensor health, signal quality, current velocity, and overall profile. Further, some tests operate on the raw data used to generate current observations, while others apply to the derived current products. The individual tests are described and include codable instructions, output conditions, example thresholds, and exceptions (if any).

Selection of the proper thresholds is critical to a successful QC effort. Thresholds can be based on historical knowledge or statistics derived from more recently acquired data, but they should not be determined arbitrarily. This manual provides some guidance for selecting thresholds based on input from various operators, but also notes that operators need the subject matter expertise as well as a sincere interest in selecting the proper thresholds to maximize the value of their QC effort.

Sensors continue to become "smarter" and interoperable. For example, some QC procedures may be embedded within the sensor instrumentation package. Significant components of metadata will reside in the instrument and be transmitted either on demand or automatically along with the data stream. Users may also reference metadata through Uniform Resource Locators (URLs) to simplify the identification of which QC steps have been applied to data. However, QARTOD QC test procedures in this manual address only real-time, in-situ observations made by sensors on fixed or mobile platforms. The tests do not include post-processing, which is not conducted in real time but may be useful for ecosystem-based management, or delayed-mode, which is required for climate studies.

Future QARTOD reports will address standard QC procedures and best practices for all types of common as well as uncommon platforms and sensors for all the U.S. IOOS core variables. Each QC manual is envisioned as a dynamic document and will be posted on the QARTOD website at www.ioos.noaa.gov/qartod/. This process allows for QC manual updates as technology development occurs for both upgrades of existing sensors and new sensors.



5.0 References

- Bouchard, R.H. (Editor) and the participants in the QARTOD Workshops and Waves Technical Conference: 2007. Real-Time Quality Control Tests for In Situ Ocean Surface Waves, 25pp. http://nautilus.baruch.sc.edu/twiki/pub/Main/WaveQC/QARTOD WAVE QC for IOOS DMAC submission.pdf
- Bushnell, M., Presentation at QARTOD III: November 2005. Scripps Institution of Oceanography, La Jolla, California.
- Interagency Ocean Observation Committee (IOOC), 2012. Integrated Ocean Observing System (IOOS) Certification Criteria. 11 pp. Available online at: http://www.iooc.us/wp-content/uploads/2012/05/IOOS-Certification-Criteria 4-25-12.pdf
- National Data Buoy Center (NDBC) Technical Document 09-02, Handbook of Automated Data Quality Control Checks and Procedures, National Data Buoy Center, Stennis Space Center, Mississippi 39529-6000. August 2009.
- Paris. Intergovernmental Oceanographic Commission of UNESCO. 2013. Ocean Data Standards, Vol.3: Recommendation for a Quality Flag Scheme for the Exchange of Oceanographic and Marine Meteorological Data. (IOC Manuals and Guides, 54, Vol. 3.) 12 pp. (English.)(IOC/2013/MG/54-3). Available online at:
- http://www.iode.org/index.php?option=com_oe&task=viewDocumentRecord&docID=10762
- QARTOD I-V Reports 2003-2009. Available online at: http://nautilus.baruch.sc.edu/twiki/bin/view/
- UNESCO, 1993. Manual and Guides 26, Manual of Quality Control Procedures for Validation of Oceanographic Data, Section 2.2, Appendix A1: Wave Data. Prepared by CEC: DG-XII, MAST and IOC: IODE. 436pp. Available online at: http://unesdoc.unesco.org/images/0013/001388/138825eo.pdf
- U.S. IOOS QARTOD Project Plan Final. February 18, 2012. Available online at: http://www.ioos.noaa.gov/qartod/qa qc projectplan dec2012.pdf
- U.S. IOOS, September 2009. A Plan to Meet the Nation's Need for Surface Current Mapping. Available online at: http://www.ioos.noaa.gov/library/surfacecurrentplan9 3lowres.pdf.
- U.S. IOOS Office, November 2010. A Blueprint for Full Capability, Version 1.0, 254 pp. www.ioos.noaa.gov/library/us-ioos-blueprint-ver1.pdf
- U.S. Integrated Ocean Observing System, January 2014. Manual for the Use of Real-Time Oceanographic Data Quality Control Flags. 19 pp. http://www.ioos.noaa.gov/qartod/temperature-salinity/qartod-oceanographic data quality-manual.pdf

Additional References to Related Documents:

- Alliance for Coastal Technologies (ACT) 2012. Accessed September 20, 2012 at http://www.act-us.info/evaluations.php
- Argo Quality Control Manual available online at: http://www.argodatamgt.org/content/download/341/2650/file/argo-quality-control-manual-V2.7.pdf
- National Oceanographic Partnership Program (NOPP) January 2006. The First U.S. Integrated Ocean Observing System (IOOS) Development Plan A report of the National Ocean Research Leadership Council and the Interagency Committee on Ocean Science and Resource Management Integration. The National Office for Integrated and Sustained Ocean Observations. Ocean US Publication No. 9. Available online at: http://www.usnfra.org/documents/IOOSDevPlan_low-res.pdf
- Crout, R., D. Conlee, D. Gilhousen, R. Bouchard, M. Garcia, F. Demarco, M. Livingston, C. Cooper, and R. Raye, 2006: Real-time oil platform ocean current data in the Gulf of Mexico: an IOOS industry partnership success story. Proc. AMS, 22nd International Conference on Interactive Information Processing Systems for Meteorology, Oceanography, and Hydrology.
- Bender, L.C. and S.F. DiMarco. 2008. Quality control and analysis of acoustic Doppler current profiler data collected on offshore platforms of the Gulf of Mexico. U.S. Dept. of the Interior, Minerals Mgmt. Service, Gulf of Mexico OCS Region, New Orleans, LA. OCS Study MMS 2009-010. 63 pp. available at: http://www.data.boem.gov/PI/PDFImages/ESPIS/4/4888.pdf
- GTSPP Real-Time Quality Control Manual, First Revised Edition. UNESCO-IOC 2010. (IOC Manuals and Guides No. 22, Revised Edition.) (IOC/2010/MG/22Rev.) English only Available online at: http://www.nodc.noaa.gov/GTSPP/document/gcmans/MG22rev1.pdf
- Haines, S., R. Crout, J. Bosch, W. Burnett, J. Fredericks, D. Symonds and J. Thomas, 2011. A summary of quality control tests for waves and in situ currents and their effectiveness, in IEEE/OES 10th Current, Waves and Turbulence Measurements (CWTM), 100 106 DOI: 10.1109/CWTM.2011.5759534.

 Available online at: http://ieeexplore.ieee.org/xpls/abs-all.jsp?arnumber=5759534
- Hammarklint, T., D. Kassis, H. Wehde, L. Rickards. April 2010. Real time quality control of current measurements. GMES Marine Core Service, MyOceans Project: WP15. (http://www.myocean.eu.org or http://marine.copernicus.eu).
- Hankin, S. and DMAC Steering Committee, 2005. Data management and communications plans for research and operational integrated ocean observing systems: I interoperable data discovery, access, and archive, Ocean.US, Arlington, VA, 304 pp. http://www.ioos.noaa.gov/library/dmac_plan_2005.pdf
- Integrated Marine Observing System (https://github.com/aodn/imos-toolbox)
- Moore, A.N, D.L. Stewart, March 2003. "The effects of mobile scatterers on the quality of ADCP data in differing marine environments." Proceedings of the IEEE/OES Seventh Working Conference on Current Measurement Technology. p. 202-206.
- Recommendations for in-situ data Real Time Quality Control, Authors: Sylvie Pouliquen and the DATA-MEQ working group. (http://eurogoos.eu/download/publications/rtqc.pdf)
- Symonds, D. 2013. QA/QC Parameters for Acoustic Doppler Current Profilers. Teledyne RD Instruments. 17 pp.



Taylor, J.A.; Jonas, A.M. "Maximising data return: Towards a quality control strategy for managing and processing TRDI ADCP data sets from moored instrumentation", Current Measurement Technology, 2008. CMTC 2008. IEEE/OES 9th Working Conference, p. 80–88. Available online at: http://ieeexplore.ieee.org/xpls/abs-all.jsp?arnumber=4480848

Thomson, R. 2001. Data Analysis Methods in Physical Oceanography. Gulf Professional Publishing, Second Edition, 638pp. Available online at: <a href="http://books.google.com/books?id=A6ew-bJDIDIC&pg=PA83&lpg=PA83&dq=Acoustic+Doppler+Current+Profiler+book&source=bl&ots=PwSf29Bbuo&sig=LxTDjtmzKFVCgF8ZT0kwme964TU&hl=en&ei=WLtOTcSPFcP98Aaez9GCDw&sa=X&oi=book_result&ct=result&resnum=5&sqi=2&ved=0CDYQ6AEwBA#v=onepage&q=Acoustic%20Doppler%20Current%20Profiler%20book&f=false

Supporting Documents Found on the QARTOD Website:

(http://www.ioos.noaa.gov/qartod/currents_data)

National Data Buoy Center - Measurement Descriptions and Units

Quality Control and Analysis of Acoustic Doppler Current Profiler Data Collected on Offshore Platforms of the Gulf of Mexico.

Recommendations for In-Situ Data Real Time Quality Control

Appendix A. Quality Assurance

A major pre-requisite for establishing quality control standards for current measurements is a strong quality assurance program. Remember the mantra that good QC requires good QA, and good QA requires good scientists, engineers, and technicians.

The following sections suggest ways to ensure QA by using specific procedures and techniques.

A.1 Sensor Calibration Considerations

Observations must be traceable to one or more accepted standards through a calibration performed by the manufacturer or the operator. If the calibration is conducted by the manufacturer, the operator must also conduct some form of an acceptable calibration check. For instance, the instrument could be damaged in shipment from the manufacturer or have been exposed to a temperature outside its prescribed operating range.

An often overlooked calibration or calibration check can be performed by consensus standard. For example, deriving the same answer (within an acceptable level of accuracy) from four different sensors of four different manufacturers, preferably utilizing several different technologies, constitutes a perfectly acceptable reference. Because of the trend toward corporate conglomeration, those wishing to employ a consensus standard should ensure that the different manufacturers are truly independent.

A.2 Sensor Comparison

An effective QA effort continually strives to ensure that end data products are of high value and to prove they are free of error. Operators should seek out partnering opportunities to inter-compare systems by colocating differing sensors. Agreement of multiple systems would provide a robust observation, while disagreement may offer a measure of data uncertainty. If possible, operators should retain an alternate sensor or technology from a second manufacturer for similar in-house checks. For resource-constrained operators, however, it may not be possible to spend the time and funds needed to procure and maintain two systems. For those who do so and get two different results, the use of alternate sensors or technologies provide several important messages: a) a measure of the accuracy and precision achieved by an operator; b) a reason to investigate, understand the different results, and take corrective action; and c) increased understanding that when variables are measured with different technologies, different answers can be correct, and they must be understood in order to properly report results. For those who succeed, the additional sensors provide a highly robust demonstration of operator capability. Such efforts form the basis of a strong QA/QC effort. Further, it provides the operator with an expanded supply source, permitting less reliance upon a single manufacturer and providing competition that is often required by procurement offices.



A.3 Bio-fouling and Corrosion Prevention Strategies

Bio-fouling is the most frequent cause of sensor failure, so the following strategies may be useful for ameliorating the problem:

- Use anti-fouling paint with the highest copper content available (up to 75%) when possible (not on aluminum).
- Wrap body of sensor with clear packing tape for a small probe or plastic wrap for a large instrument. This keeps the PVC tape from leaving residue on the sensor. Heavy PVC underground cable tape is the best for bad bio-fouling.
- Wrap with copper tape (again, beware of aluminum).
- Coat with zinc oxide (Desitin ointment manufactured by Johnson and Johnson Inc.; 1 Johnson and Johnson Plaza, New Brunswick, NJ 08933 (732) 524-0400).
- Remember that growth is sensor-, depth-, location-, and season-dependent; plan instrument recovery frequency accordingly.
- Plan for routine changing or cleaning of sensor as necessary.
- Check with calibration facility on which anti-foulants will be handled (allowed) by the calibrators.
- Avoid or isolate dissimilar metals.
- Maintain sacrificial anodes and ensure they are properly installed (good electrical contact).
- Maximize use of non-metallic components.
- Use UV-stabilized components that are not subject to sunlight degradation.

A.4 Common QA Considerations

The following lists suggest ways to ensure QA by using specific procedures and techniques:

- Perform pre-deployment calibrations on every sensor
- Perform post-deployment calibrations on every sensor, plus in-situ comparison before recovery
- Perform periodic calibration of ready-to-use spares
- Monitor with redundant sensors whenever possible
- Take photos of sensor fouling for records
- Record all actions related to sensors calibration, cleaning, deployment, etc.
- Monitor battery voltage and watch for unexpected fluctuations

When evaluating which instrument to use, consider these factors:

- Selection of a reliable and supportive manufacturer and appropriate model
- Operating range (i.e., some instruments won't operate at certain temperatures, pressures, or depths)
- Resolution/precision required
- Sampling frequency how fast sensor can take measurements
- Reporting frequency how often the sensor reports the data
- Response time of the sensor sensor lag time response
- Instrument check visual inspection for defects, bio-fouling, etc.
- Power check master clock, battery, etc. variability among these sensors
- Standardize sensor clock to a reference such as GPS timing
- Capability to reveal a problem with data

When evaluating which specifications must be met:

- State the expected accuracy
- Determine how the sensor compares to the design specifications
- Determine if the sensor meets those specifications
- Determine whether result is good enough (fit for purpose: data are adequate for nominal use as preliminary data)

General comments regarding QA procedures:

- A diagram (http://www.ldeo.columbia.edu/~dale/dataflow/), contributed by Dale Chayes (LDEO) provides a visual representation of proper QA procedures.
- Require serial numbers and model ID from the supplier.
- Do not make the checklist so detailed that it will not be used.
- Do not assume the calibration is perfect (could be a calibration problem rather than a sensor problem).
- Keep good records of all related sensor calibrations and checks (e.g., temperature).
- Use NIST-traceable instrumentation when conducting calibrations or calibration checks.
- A sensor that maintains an internal file of past calibration constants is very useful since it can be downloaded instead of transcribed manually, introducing human error.
- The calibration constants or deviations from a standard should be plotted over time to determine if
 the sensor has a drift in one direction or another. A sudden change can indicate a problem with the
 sensor or the last calibration.



A.5 QA Levels for Best Practices

A wide variety of techniques are used by operators to assure that sensors are properly calibrated and operating within specifications. While all operators must conduct some form of validation, there is no need to force operators to adhere to one single method. Nevertheless, operators should always strive to achieve the best possible level of QA. If they are unable to do so, then they should provide valid justification. Operators must show due-diligence in maintenance of their systems. A balance exists between available resources, level of proficiency of the operator, and target data-reproducibility requirements. The various techniques span a range of validation levels and form a natural hierarchy that can be used to establish levels of certification for operators (table A-1). The lists in the following sections suggest ways to ensure QA by using specific procedures and techniques.

Table A-1. Best practices indicator for QA

QA Best Practices Indicator	Description
Good Process	Sensors are exchanged and/or serviced at sufficient regular intervals. Sensors are pre- and post-deployment calibration checked.
Better Process	Good process, plus an overlapping operational period during sensor swap-out to demonstrate continuity of observations.
Best Process	Better process, and follow a well-documented protocol or alternative sensors to validate in-situ deployments. Or, the better process employing manufacturer conducted pre- and post-calibrations.

A.6 Additional Sources of QA Information

Current sensor operators also have access to other sources of QA practices and information about a variety of instruments. For example, the Alliance for Coastal Technologies (ACT) serves as an unbiased, third-party testbed for evaluating sensors and platforms for use in coastal and ocean environments. ACT conducts instrument performance demonstrations and verifications so that effective existing technologies can be recognized, and promising new technologies can become available to support coastal science, resource management, and ocean observing systems (ACT 2012). The NOAA Ocean Systems Test and Evaluation Program (OSTEP) also conducts independent tests and evaluations on emerging technology as well as new sensor models. Both ACT and OSTEP publish findings that can provide information about QA, calibration, and other aspects of sensor functionality. The following list provides links to additional resources on QA practices.

- Manufacturer specifications and supporting Web pages/documents
- QARTOD http://www.ioos.noaa.gov/qartod/
- ACT http://www.act-us.info/
- CO-OPS http://tidesandcurrents.noaa.gov/pub.html under the heading Manuals and Standards
- WOCE http://woce.nodc.noaa.gov/wdiu/
- NDBC http://www.ndbc.noaa.gov/

The following samples provide hints for development of deployment checklists taken from QARTOD IV:

Pre	-deployment QA Checklist
	Read the manual.
	Establish, use, and submit (with a reference and version #) a documented sensor preparation
	procedure (protocol). Should include cleaning sensor according to the manufacturer's procedures.
	Calibrate sensor against an accepted standard and document (with a reference and version #). Compare the sensor with an identical, calibrated sensor measuring the same thing in the same area (in
_	a calibration lab).
	View calibration specifications with a critical eye (don't presume the calibration is infallible). Execute detailed review of calibrated data.
	Check the sensor history for past calibrations, including a plot over time of deviations from the
	standard for each (this will help identify trends such a progressively poorer performance). Maintain
	control of the plotted calibrations.
	Check the sensor history for past repairs, maintenance, and calibration.
	Consider storing and shipping information before deploying.
_	Heat, cold, vibration, etc.
	Provide detailed documentation when necessary.
	Record operator/user experiences with this sensor after reading the manual.
	Search the literature for information on your particular sensor(s) to see what experiences other
	researchers may have had with the sensor(s).
	Establish and use a formal pre-deployment checklist. Ensure that technicians are well-trained. Use a visual tracking system for training to identify those
	technicians who are highly trained and then pair them with inexperienced technicians. Have data
	quality review chain.
	quanty 20110 in Common
Dep	ployment Checklist
	Scrape bio-fouling off platform.
	Verify sensor serial numbers.
	Deploy and co-locate multiple sensors (attention to interference if too close).
	Perform visual inspection; take photos if possible (verify position of sensors, connectors, fouling,
	cable problems, etc.).
	Conduct magnetic calibration within 5 km of the development location to reduce the influence of
	batteries and local magnetism.
	Verify instrument function at deployment site prior to site departure. Allot sufficient time for
	temperature equilibration.
	Monitor sensors for issues (freezing, fouling).
	Automate processing so you can monitor the initial deployment and confirm the sensor is working
	while still onsite.
	Specify date/time for all recorded events and check to ensure proper time is set. Use GMT or UTC.
	Check software to ensure that the sensor configuration and calibration coefficients are correct. Also,
	check sampling rates and other timed events, like wiping and time averaging.
	Visually inspect data stream to ensure reasonable values.
	Compare up and down casts and/or dual sensors (if available).
	Note weather conditions and members of field crew



Post-deployment Checklist

Take pictures of recovered sensor as is for metadata
Check to make sure all clocks agree or, if they do not agree, record all times and compare with NIST.
Post-calibrate sensor and document before and after cleaning readings.
Perform in-situ, side-by-side check using another sensor.
Provide a mechanism for feedback on possible data problems and/or sensor diagnostics.
Clean and store the sensor properly or redeploy.
Visually inspect physical state of instrument.
Verify sensor performance by:

- o Checking nearby stations;
- Making historical data comparisons (e.g., long-term time-series plots, which are particularly useful for identifying long-term bio-fouling or calibration drift.)



Appendix B. In-Situ Currents Manual Team and Reviewers

Currents Manual Update Committee and Reviewers		
Name	Organization	
Mark Bushnell – Chair Chris Paternostro, co-editor Jennifer Patterson – co-editor Helen Worthington – co-editor Julie Bosch Bob Heitsenrether Christina Iarossi Chris Kontoes Dawn Petraitis Darryl Symonds Doug Wilson	CoastalObsTechServices LLC/CO-OPS NOAA/CO-OPS CeNCOOS REMSA/CO-OPS NOAA/National Centers for Environmental Information NOAA/CO-OPS SonTek Nortek, Inc. NOAA/NDBC Teledyne RDI Caribbean Wind LLC/MARACOOS	
	Manual Version 1.0 Reviewers	
Name	Organization	
Mark Bushnell – Chair Ray Toll – editor Helen Worthington – editor Dick Crout – significant contributor Charly Alexander Rob Bassett Rich Bouchard Rebecca Cowley Jeff Donnovan Shavawn Donoghue Chris Flanary Guilliaume Galibert Janet Fredericks Bob Heitsenrether Kris Holdereid Eoin Howlett Leonid Ivanov Bruce Magnell Alessandra Mantovanelli Kelli Paige Chris Paternostro	CoastalObsTechServices LLC/CO-OPS Old Dominion University/NDBC REMSA/CO-OPS Naval Research Laboratory/ Stennis U.S. IOOS NOAA/CO-OPS NOAA/NDBC Integrated Marine Observing System SECOORA Integrated Marine Observing System SECOORA Integrated Marine Observing System Woods Hole Oceanographic Institution NOAA/CO-OPS NOAA MARACOOS/Applied Science Associates Woods Hole Working Group Woods Hole Working Group Integrated Marine Observing System GLOS NOAA/CO-OPS	
Jennifer Patterson Torstein Pederson Xiaoyan Qi Samantha Simmons Rosemary Smith Derrick Snowden Craig Steinberg Vembu Subramanian Charles Sun Darryl Symonds Ed Verhamme Doug Wilson	CeNCOOS Nortek SECOORA Interagency Ocean Observing Committee Fugro GEOS U.S. IOOS Integrated Marine Observing System SECOORA National Centers for Environmental Information Teledyne RDI GLOS MARACOOS	

QARTOD Board of Advisors		
Name	Organization	
Joe Swaykos – Chair Kathy Bailey Julie Bosch Eugene Burger Janet Fredericks Matt Howard Bob Jensen Chris Paternostro Julie Thomas	NOAA/National Data Buoy Center U.S. IOOS NOAA/National Centers for Environmental Information NOAA/Pacific Marine Environmental Laboratory Woods Hole Oceanographic Institution GCOOS USACE NOAA/CO-OPS Scripps Institution of Oceanography/Coastal Data Information Program	
	DMAC Committee	
Name	Organization	
Rob Bochenek Eric Bridger Jorge Capella Jeremy Cothran Lisa Hazard Matt Howard Emilio Mayorga Jennifer Patterson Jim Potemra Rob Ragsdale Tad Slawecki Derrick Snowden Shane StClair Vembu Subramanian Kyle Wilcox	AOOS/CeNCOOS/Axiom Consulting & Design NERACOOS/Gulf of Maine Research Institute CariCOOS/University of Puerto Rico SECOORA/University of South Carolina SCCOOS/Scripps Institution of Oceanography GCOOS/Texas A&M University NANOOS/University of Washington CeNCOOS/Monterey Bay Aquarium Research Institute PaclOOS/University of Hawaii U.S. IOOS Program Office GLOS/LimnoTech U.S. IOOS Program Office AOOS/CeNCOOS/Axiom Consulting & Design SECOORA/University of South Florida MARACOOS/Applied Science Associates, Inc.	
U.S. 100	S REGIONAL ASSOCIATIONS	
Name	Organization	
Josie Quintrell David Anderson Debra Hernandez Barbara Kirkpatrick Gerhard Kuska Molly McCammon Julio Morell Ru Morrison Jan Newton Chris Ostrander Kelli Paige Julie Thomas	U.S. IOOS Association CeNCOOS SECOORA GCOOS MARACOOS AOOS CariCOOS NERACOOS NANOOS PacIOOS GLOS SCCOOS	