Weather Report

Ridgeline Schools Weather Network · 8 stations · 1 March – 11 April 2025

Data for the spring summary: almost all of it is usable. 91% is fine as recorded, 7% is fine after a simple fix, and only 2% must be left out.

Technician next week: S04, Foothills Community Garden. Its temperature reads about 4 °C too warm in sunshine and is getting worse. It looks like normal weather, so it would quietly make the summary too warm. Second choice: S03.

Main problems and solutions

S04	Too warm in sun (shield on newly painted post)	Clean or move the shield
S03	Temperature stuck, or −40 / 85 °C readings	Check cable; replace sensor
S06	Clock 6 h slow since battery swap	Set the clock to UTC
S07	Wind reads too low since new anemometer	Set units to km/h
S02	Pressure 6.6 hPa too high since board swap	Calibrate the board

Changes to the data, per station


S01	None. Colder only because it is high up.
S02	Pressure − 6.6 hPa from 21 Mar
S03	Drop temperature 18–21 Mar + 4 single readings
S04	Drop rain 23 Mar–2 Apr; drop temperature from 3 Apr
S05	Drop humidity 7–11 Mar; fix map latitude to 39.754
S06	Add 6 hours to all times from 24 Mar
S07	Wind × 3.6 from 26 Mar
S08	Delete the second copy of 5 Apr; 16–17 Mar missing

Suggested upgrades

New radiation shield for S04	$60–120
Spare temperature sensor (S03)	$30–80
Leaf guards for all 8 rain gauges	$80
Bigger batteries for S06 and S01 (cloudy / snowy weeks)	$100–200
Clocks set from GPS automatically (setting change)	$0
Auto top-up on SIM data plans	~$5 / month each

Rough guide only: parts, in US dollars, not including labour.

Maintenance score (out of 10)

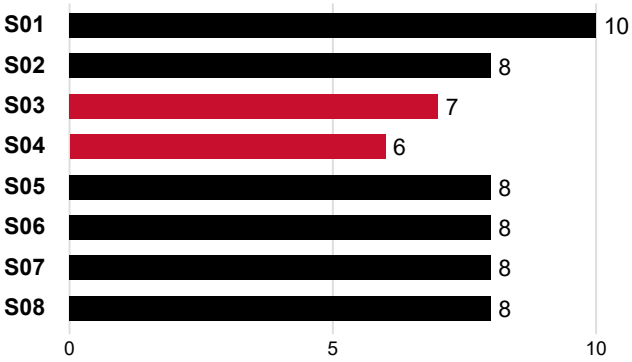

Start at 10. Minus 3 for a fault still losing data, minus 2 for one we can fix in the data, minus 1 for a past problem. Red = lowest.

Full details for every problem are in flags.csv (made by checker.py). Times are UTC.