



CCPIA

8725 W Amarillo Blvd
Amarillo, TX 79124

Toby Torres
05/19/2026



Inspector

Michael Morton

TREC #24690, Certified Master Inspector
8063181434
abetterinspection@gmail.com



Agent

Deeter Prater

806-681-1323
deeter@llanogroup.com

TABLE OF CONTENTS

1: General	6
2: Roof	7
3: Exterior	11
4: Basement, Foundation and Crawlspace	16
5: Heating and Ventilation	17
6: Cooling	19
7: Plumbing	22
8: Electrical	27
9: Attic, Insulation & Ventilation	29
10: Doors, Windows & Interior	30
11: Life Safety	35
12: Cooking Area	39
13: Accessibility Inspection Report	40
Standards of Practice	41

View our [Standards of Practice.](#)

View our [Code of Ethics.](#)



RECOMMENDATION



SAFETY HAZARD

- ⊖ 2.1.1 Roof - General: Damaged Roof Hatch
- ⊖ 2.2.1 Roof - Coverings & Slope: Damaged (General)
- ⊖ 2.2.2 Roof - Coverings & Slope: Flat Roof Blistering
- ⊖ 2.2.3 Roof - Coverings & Slope: Grease Accumulation on Roof
- ⊖ 2.5.1 Roof - Skylights, Chimneys & Other Roof Penetrations: Damaged Roof Vents
- ⊖ 2.5.2 Roof - Skylights, Chimneys & Other Roof Penetrations: Water Entrance at Roof Penetration
- ⊖ 3.2.1 Exterior - Siding, Flashing & Trim: Cracks in Stucco
- ⊖ 3.2.2 Exterior - Siding, Flashing & Trim: Separation at Expansion Joints
- ⊖ 3.4.1 Exterior - Exterior Doors & Windows: Door Does Not Close or Latch
- ⊖ 3.4.2 Exterior - Exterior Doors & Windows: Poor Weather Stripping
- ⊖ 3.5.1 Exterior - Flatwork: Parking Paint and Lines
- ⊖ 3.5.2 Exterior - Flatwork: Parking Lot- Potholes
- ⊖ 3.7.1 Exterior - Lighting: Damaged/Missing Light Poles
- ⊖ 3.8.1 Exterior - Landscaping: Trees Touching Structure
- ⚠ 4.2.1 Basement, Foundation and Crawlpace - Foundation: Foundation Cracks - Major
- ⊖ 5.1.1 Heating and Ventilation - General: NOVAR Management System
- ⊖ 5.2.1 Heating and Ventilation - Equipment: Equipment Covers Missing
- ⊖ 6.1.1 Cooling - General: Condensate Drain Termination on Roof
- ⊖ 6.2.1 Cooling - Cooling Equipment: Aging Cooling System
- ⊖ 7.3.1 Plumbing - Back-flow Prevention Device: Expired Back-Flow Prevention Certification
- ⊖ 7.4.1 Plumbing - Drain, Waste, & Vent Systems: Leak at Fixture
- ⊖ 7.4.2 Plumbing - Drain, Waste, & Vent Systems: Clogged Sinks
- ⊖ 7.4.3 Plumbing - Drain, Waste, & Vent Systems: Leak Behind Wall
- ⊖ 7.5.1 Plumbing - Water Supply, Distribution Systems & Fixtures: Water Flow Deficiency
- ⊖ 7.5.2 Plumbing - Water Supply, Distribution Systems & Fixtures: Leaking Toilet Connection
- ⊖ 7.5.3 Plumbing - Water Supply, Distribution Systems & Fixtures: Continuous Flushing Urinal
- ⊖ 7.6.1 Plumbing - Hot Water Systems, Controls, Flues & Vents: Water Heater Leak with Rust Accumulation
- ⊖ 7.6.2 Plumbing - Hot Water Systems, Controls, Flues & Vents: Hot Water System Age
- ⚠ 8.3.1 Electrical - Main & Subpanels, Service & Grounding, Main Overcurrent Device: Clearance
- ⊖ 8.4.1 Electrical - Branch Wiring Circuits, Breakers & Fuses: Damaged Conduit

- ⊖ 8.4.2 Electrical - Branch Wiring Circuits, Breakers & Fuses: No Power to Branch Circuit
- ⊖ 8.6.1 Electrical - GFCI & AFCI: No GFCI Protection Installed
- ⊖ 10.2.1 Doors, Windows & Interior - Doors: Damaged
- ⊖ 10.2.2 Doors, Windows & Interior - Doors: Damaged Door Closer
- ⊖ 10.2.3 Doors, Windows & Interior - Doors: Damaged Door Latch
- ⊖ 10.4.1 Doors, Windows & Interior - Floors: Trip Hazard - Carpet
- ⊖ 10.4.2 Doors, Windows & Interior - Floors: Damaged Anti-Slip Tiles
- ⊖ 10.4.3 Doors, Windows & Interior - Floors: Bathroom Floors Not Sloping to Drain
- ⊖ 10.6.1 Doors, Windows & Interior - Ceilings: Stain(s) on Ceiling
- ⊖ 10.6.2 Doors, Windows & Interior - Ceilings: Damaged Ceiling Tiles
- ⊖ 10.7.1 Doors, Windows & Interior - Steps, Stairways & Railings: Non Continuous Handrail
- ⊖ 11.2.1 Life Safety - Fire Access Roads: Repainting
- ⊖ 11.4.1 Life Safety - Storage of Flammable and Combustible Materials: Flammable Chemicals Not Properly Stored
- ⊖ 11.7.1 Life Safety - Portable Fire Extinguishers: Out Of Date Tags
- ⊖ 11.9.1 Life Safety - Sprinkler System: Missing Sprinkler Heads
- ⊖ 11.11.1 Life Safety - Exit Signs, Doors, Stairwells and Handrails: Missing Exit Sign
- ⊖ 11.12.1 Life Safety - Elevator Certification : Elevator Out of Certification
- ⊖ 13.3.1 Accessibility Inspection Report - Route of Travel: Multiple Entrapments Present
- ⊖ 13.7.1 Accessibility Inspection Report - Restrooms: Clearance in Front of Toilet

1: GENERAL

Information

Persons Present

Inspector

Weather

Clear

Temperature

53 Fahrenheit

Type Of Commercial Property

Retail

2: ROOF

2.1	General
2.2	Coverings & Slope
2.3	Roof Drainage Systems
2.4	Flashings
2.5	Skylights, Chimneys & Other Roof Penetrations

Information

General: Method of Inspection

Rooftop

General: Means of Access

Roof hatch

Coverings & Slope: Low-Slope Roof

TPO/PVC

Coverings & Slope: Roof Coatings

No coatings

Coverings & Slope: Condition of parapets and coping

The roofing material was pulling from the parapets and bubbling on all sides. The coping was properly secured and in good condition.

Coverings & Slope: Condition of the roof covering(s)

The PVC roof had many repairs. Some of the repairs appear to be improper/not holding. Even with the repairs the covering was extremely loose meaning it was no longer adhering to the decking. Heavy bubbling and blistering was present in all corners.

Roof Drainage Systems: Drainage System Type

Built-in drains

Roof Drainage Systems: Gutter Material

Steel

Roof Drainage Systems: Condition of Drainage System

The drainage system is in good condition. The scuppers need cleaned in all locations.

Flashings: Material

PVC

Skylights, Chimneys & Other Roof Penetrations: Condition of roof penetrations & roof structure

The roof vents were severely damaged (hail). Two of these vents had moisture intrusion around the penetration resulting in damaged ceiling tile underneath.

Observations

2.1.1 General

DAMAGED ROOF HATCH


The roof hatch shows signs of damage that compromise its function and weathertightness. This was observed during the roof inspection. Damage to the hatch can allow water infiltration into the building interior and may create a safety hazard when accessing the roof.

Recommendation

Contact a qualified professional.



Weight assist pistons damaged

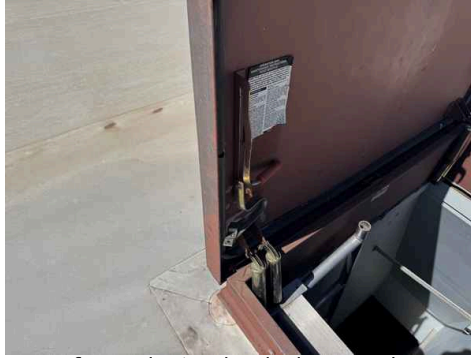

Keep from closing latch damaged

2.2.1 Coverings & Slope

DAMAGED (GENERAL)

Roof coverings showed moderate damage. Recommend a qualified roofing professional evaluate and repair.

Recommendation

Contact a qualified roofing professional.




2.2.2 Coverings & Slope

FLAT ROOF BLISTERING

The flat roof is blistered indicating moisture underneath roof material.

Recommendation

Contact a qualified professional.

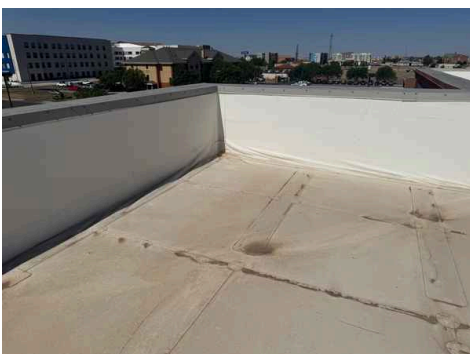



2.2.3 Coverings & Slope

GREASE ACCUMULATION ON ROOF

Grease from the kitchen hood vent is depositing onto the roof surface. This occurs when the hood exhaust system directs grease-laden air onto the roof rather than safely venting it away from the structure. Over time, grease buildup can damage roofing materials, promote mold and mildew growth, and create maintenance issues.

Recommendation

Contact a qualified professional.



2.5.1 Skylights, Chimneys & Other Roof Penetrations

DAMAGED ROOF VENTS

Roof vents observed with damage during inspection. Damaged vents compromise the roof's ability to properly ventilate moisture and heat, potentially leading to premature deterioration of roofing materials, moisture accumulation in attic spaces, and reduced energy efficiency. A roofing professional should evaluate the extent of damage and recommend repair or replacement to restore proper ventilation function.

Recommendation

Contact a qualified professional.





2.5.2 Skylights, Chimneys & Other Roof Penetrations

WATER ENTRANCE AT ROOF PENETRATION

Water is entering the structure at a roof penetration point, such as a skylight, chimney, or vent. This indicates failed flashing, sealant, or installation allowing moisture intrusion. Water damage, mold growth, and structural deterioration can result if not addressed promptly. A roofing professional should inspect and repair the penetration seal and flashing.

Recommendation

Contact a qualified professional.



Theater 12



Theater 13

3: EXTERIOR

3.1	General
3.2	Siding, Flashing & Trim
3.3	Eaves, Soffits & Fascia
3.4	Exterior Doors & Windows
3.5	Flatwork
3.6	Topography, Stormwater Drainage, and Retaining Walls
3.7	Lighting
3.8	Landscaping

Information

General: Inspection Method Visual, Infrared	Siding, Flashing & Trim: Siding Material Stucco, Masonry	Exterior Doors & Windows: Exterior Entry Door Steel
Flatwork: Driveway Material Asphalt	Topography, Stormwater Drainage, and Retaining Walls: General topography Positive	

Observations

3.2.1 Siding, Flashing & Trim

CRACKS IN STUCCO

Cracks were observed in the stucco siding during exterior inspection. Stucco cracks can allow water infiltration behind the siding, potentially leading to moisture damage, mold growth, and structural deterioration.

Recommendation
Contact a qualified professional.



Front Left



Front Left





Front




3.2.2 Siding, Flashing & Trim

SEPARATION AT EXPANSION JOINTS

Separation observed at expansion joints in the siding and trim during exterior inspection. Expansion joints are designed to allow materials to move with temperature and humidity changes without cracking. When separation occurs, it can allow water infiltration behind the siding, potentially leading to moisture damage, rot, or structural deterioration over time.

Recommendation

Contact a qualified professional.

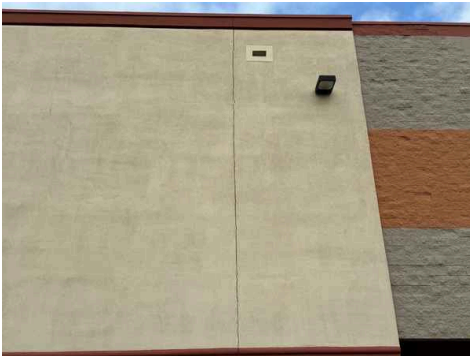


Right




Right



Back Right

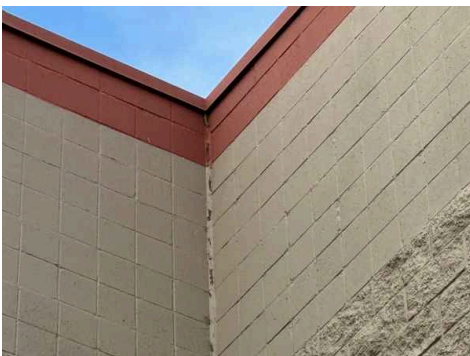

Back Right

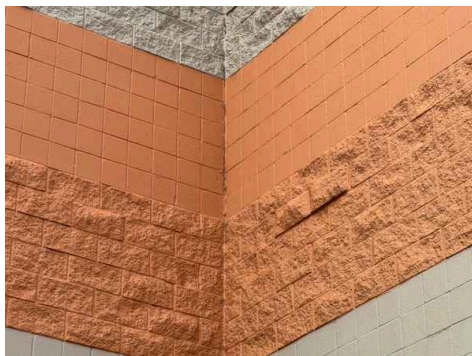

Back Right

3.4.1 Exterior Doors & Windows

DOOR DOES NOT CLOSE OR LATCH

Door does not close or latch properly.

Recommendation

Contact a qualified door repair/installation contractor.



3.4.2 Exterior Doors & Windows

POOR WEATHER STRIPPING


Weather stripping around exterior doors and windows is deteriorated, allowing dirt infiltration. This compromises the seal intended to prevent air and moisture leakage. Worn weather stripping should be replaced to restore proper protection and energy efficiency.

Recommendation

Contact a qualified professional.



Front Left Hallway

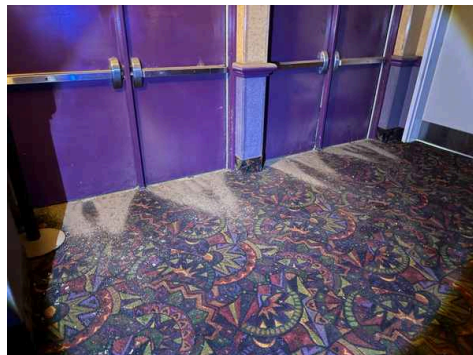

Left Side of Main Corridor



Right Side of Main Corridor



Front Right Hallway

3.5.1 Flatwork

PARKING PAINT AND LINES

The parking lot was not clearly striped. Accessible parking was not clearly identified.

Recommendation

Contact a qualified professional.



Front; Handi Cap




Back



Back



Front

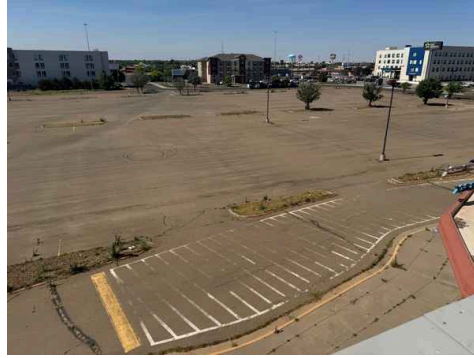

Front

3.5.2 Flatwork

PARKING LOT- POTHOLES

Observed a parking lot with potholes.

Recommendation

Contact a qualified professional.



Front Driveway

3.7.1 Lighting


DAMAGED/MISSING LIGHT POLES

FRONT

Multiple light poles in the parking lot are damaged or missing. This creates safety and security concerns for property users accessing the lot at night.

Recommendation

Contact a qualified professional.

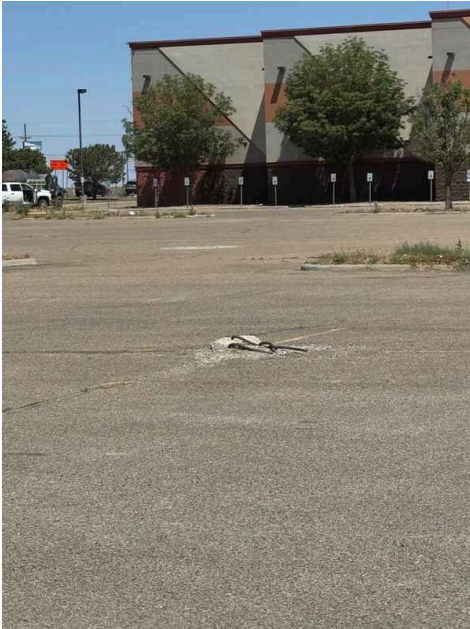

Front



Front



Right



Right



Back

3.8.1 Landscaping

TREES TOUCHING STRUCTURE

Tree branches and limbs are in contact with the exterior structure. This contact can damage siding, roofing materials, and gutters over time, and may provide pathways for pests and moisture intrusion.

Recommendation

Contact a qualified professional.

4: BASEMENT, FOUNDATION AND CRAWLSPACE

4.1	General
4.2	Foundation
4.3	Floor Structure

Information

General: Inspection Method

Infrared, Visual

Foundation: Type

Slab on grade

Foundation: Material

Concrete

Floor Structure: Material

Concrete

Observations

4.2.1 Foundation

FOUNDATION CRACKS - MAJOR

Severe cracking noted at the foundation. This is typically consistent with soil movement and could lead to serious damage to structural components, foundation and/or slabs. Recommend a structural engineer evaluate and provide a report on course of action and remedy.

Recommendation

Contact a qualified structural engineer.



Lobby at Hallway going to main corridor

5: HEATING AND VENTILATION

5.1	General
5.2	Equipment
5.3	Normal Operating Controls
5.4	Ventilation
5.5	Exhaust Systems
5.6	Distribution Systems
5.7	Vents, Flues & Chimneys
5.8	Presence of Installed Heat Source in Each Room

Information

Equipment: Energy Source Natural Gas	Equipment: Manufacturer Lennox, Trane	Equipment: Location Roof
Ventilation: Ventilation Type Make-up air	Exhaust Systems: Exhaust Fans Fan Only	Distribution Systems: Ductwork Non-insulated

General: AFUE Rating
80

AFUE (Annual fuel utilization efficiency) is a metric used to measure furnace efficiency in converting fuel to energy. A higher AFUE rating means greater energy efficiency. 90% or higher meets the Department of Energy's Energy Star program standard.

General: NOVAR Management System
The NOVAR Management System is a building automation and control platform used to manage heating, ventilation, and other mechanical systems in commercial properties. This system integrates multiple building functions to optimize energy efficiency, comfort, and operational performance across the facility.

Equipment: Operation
The new furnaces (2015, 2018) were operating at the time of the inspection. The settings the NOVAR system were programmed had them operating (53°F) outside.

Limitations

Equipment

NOVAR ENERGY MANAGEMENT SYSTEM

The property is equipped with a Novar energy management system (EMS) for building automation and control of HVAC, refrigeration, lighting, and/or related equipment. Due to the proprietary nature of the Novar system, its complexity, and the requirement for specialized manufacturer software, training, and access codes, a full functional evaluation of all system components, programming, sequences of operation, alarm history, or energy optimization features was not performed as part of this general commercial inspection.

Only visible and readily accessible components were observed. No attempt was made to access the Novar controller interfaces, software, or network. Operational status, setpoint accuracy, scheduling, trending data, and integration with other building systems could not be verified.

Recommendation: For a comprehensive assessment of the Novar EMS, including current programming, performance efficiency, and any outstanding service or upgrade needs, the client should engage a qualified Novar-certified technician or authorized service provider prior to closing or occupancy.

Observations

5.1.1 General

NOVAR MANAGEMENT SYSTEM

Observed a Novar/Honeywell building automation control system (BAS) installed within the facility. This system is a commercial HVAC energy management/control platform that likely controls and monitors rooftop HVAC units, zoning, occupancy schedules, temperature setpoints, economizers, and/or other mechanical building functions. These systems are commonly operated remotely, through wall-mounted sensors/thermostats, or through pre-programmed scheduling logic rather than direct manual control at the equipment.

At the time of inspection, the system appeared to be operating under existing programmed settings with limited onsite user functionality available. Due to the proprietary nature of many Novar systems, adjustments for new tenant occupancy, scheduling changes, zoning modifications, or operational reconfiguration may require specialized software access, passwords, and programming by a qualified commercial HVAC controls or building automation contractor familiar with Novar/Honeywell Niagara systems.

Clients should anticipate potential costs associated with recommissioning, reprogramming, or adapting the system for new occupancy needs. Minor schedule/setpoint modifications may range from approximately \$500-\$2,500, while more extensive tenant reconfiguration or recommissioning can commonly range from several thousand dollars upward depending on system access, programming availability, and building operational requirements.

Recommend further evaluation and consultation with a qualified commercial HVAC controls/BAS contractor prior to close of escrow or occupancy transition to determine operational capabilities, programming access, serviceability, and anticipated modification costs.

Recommendation

Contact a qualified professional.



2nd Floor; Left (Camera Room)

5.2.1 Equipment

EQUIPMENT COVERS MISSING

Protective covers for heating and ventilation equipment were not in place during inspection. Missing covers expose equipment components to dust, debris, and potential damage, which can reduce efficiency and lifespan. Have covers reinstalled or replaced to protect the equipment and maintain proper operation.

Recommendation

Contact a qualified professional.



6: COOLING

6.1	General
6.2	Cooling Equipment
6.3	Normal Operating Controls
6.4	Distribution System
6.5	Presence of Installed Cooling Source in Each Room

Information

Cooling Equipment: Energy Source/Type RTU	Cooling Equipment: Manufacturer Lennox, Trane, American Standard	Cooling Equipment: Location Roof
Distribution System: Configuration Central		

Limitations

General

ACCESSIBILITY LIMITATIONS

Lack of proper receptacle

General

NOVAR ENERGY MANAGEMENT SYSTEM

The property is equipped with a Novar energy management system (EMS) for building automation and control of HVAC, refrigeration, lighting, and/or related equipment. Due to the proprietary nature of the Novar system, its complexity, and the requirement for specialized manufacturer software, training, and access codes, a full functional evaluation of all system components, programming, sequences of operation, alarm history, or energy optimization features was not performed as part of this general commercial inspection.

Only visible and readily accessible components were observed. No attempt was made to access the Novar controller interfaces, software, or network. Operational status, setpoint accuracy, scheduling, trending data, and integration with other building systems could not be verified.

Recommendation: For a comprehensive assessment of the Novar EMS, including current programming, performance efficiency, and any outstanding service or upgrade needs, the client should engage a qualified Novar-certified technician or authorized service provider prior to closing or occupancy.

Observations

6.1.1 General

CONDENSATE DRAIN TERMINATION ON ROOF

The air conditioning condensate drain is terminating directly onto the roof surface. This allows water to pool on the roof rather than being directed away, which can lead to roof deterioration, water infiltration, and potential structural damage over time. The condensate drain should be extended to terminate at a proper drainage point, such as into a gutter system or downspout, or directed away from the building foundation.

Recommendation

Contact a qualified professional.





6.2.1 Cooling Equipment

AGING COOLING SYSTEM

The cooling system appears to be older and may be approaching the end of its serviceable life. As cooling equipment ages, efficiency typically declines and repair costs often increase.

Recommendation

Contact a qualified professional.

7: PLUMBING

7.1	General
7.2	Main Water Shut-off Device
7.3	Back-flow Prevention Device
7.4	Drain, Waste, & Vent Systems
7.5	Water Supply, Distribution Systems & Fixtures
7.6	Hot Water Systems, Controls, Flues & Vents
7.7	Fuel Storage & Distribution Systems
7.8	Sump Pump

Information

General: Filters

Multi-media Filters

General: Water Source

Public

Main Water Shut-off Device:

Location

Utility Room

Back-flow Prevention Device:

Location

Kitchen

Drain, Waste, & Vent Systems:

Waste System Type

Triple basins

Drain, Waste, & Vent Systems:

Drain Size

4"

Drain, Waste, & Vent Systems:

Material

PVC

Water Supply, Distribution

Systems & Fixtures: Distribution

Material

Copper

Water Supply, Distribution

Systems & Fixtures: Water Supply

Material

Galvanized

Hot Water Systems, Controls, Flues & Vents: Power

Source/Type

Electric, Gas

Hot Water Systems, Controls, Flues & Vents: Capacity

49 gallons

Hot Water Systems, Controls, Flues & Vents: Capacity 2

19.9



Rheem; 2016



Rheem; 2015 (RPX Theater)

Hot Water Systems, Controls, Flues & Vents: Location

Utility Room

Fuel Storage & Distribution Systems: Main Gas Shut-off

Location

Back

Sump Pump: Location

Not Present

Hot Water Systems, Controls, Flues & Vents: Manufacturer

Rheem

I recommend flushing & servicing your water heater tank annually for optimal performance. Water temperature should be set to at least 120 degrees F to kill microbes and no higher than 130 degrees F to prevent scalding.

[Here is a nice maintenance guide from Lowe's to help.](#)

Observations

7.3.1 Back-flow Prevention Device

EXPIRED BACK-FLOW PREVENTION CERTIFICATION

The back-flow prevention device certification has expired. Back-flow prevention devices require periodic testing and certification to ensure they function properly and protect the water supply from contamination. An expired certification indicates the device has not been recently validated and may not be providing adequate protection.

Recommendation

Contact a qualified professional.



7.4.1 Drain, Waste, & Vent Systems

LEAK AT FIXTURE

Observed a leak at a fixture drain line.

Recommendation

Contact a qualified professional.



Men's Left Bathroom; Middle Urinal

7.4.2 Drain, Waste, & Vent Systems

CLOGGED SINKS

Slow drainage or complete blockage was observed in one or more sinks during inspection. Clogs can result from accumulated debris, hair, grease, or mineral deposits within the drain lines. If left unaddressed, clogs may lead to standing water, odors, and potential water damage.

Recommendation

Contact a qualified professional.



Woman's Back Right Bathroom



Woman's Lobby Bathroom

7.4.3 Drain, Waste, & Vent Systems

LEAK BEHIND WALL

BASEMENT

A water leak has been identified within the wall cavity, likely originating from the drain, waste, or vent system. This hidden moisture can lead to structural damage, mold growth, and compromised wall integrity if not addressed promptly.

Recommendation

Contact a qualified professional.



Woman's Back Right Bathroom

7.5.1 Water Supply, Distribution Systems & Fixtures

WATER FLOW DEFICIENCY

The water did not flow.

Recommendation

Contact a qualified professional.



Woman's Lobby Bathroom

7.5.2 Water Supply, Distribution Systems & Fixtures

LEAKING TOILET CONNECTION

BATHROOM

A leak was observed at the metal-to-porcelain connection point on a commercial toilet during inspection. This connection failure can lead to water damage to surrounding flooring and substructure, as well as potential mold growth if not addressed promptly.

Recommendation


Contact a qualified professional.



Woman's Lobby Bathroom- Handicap Stall



Woman's Lobby Bathroom- Stall 8

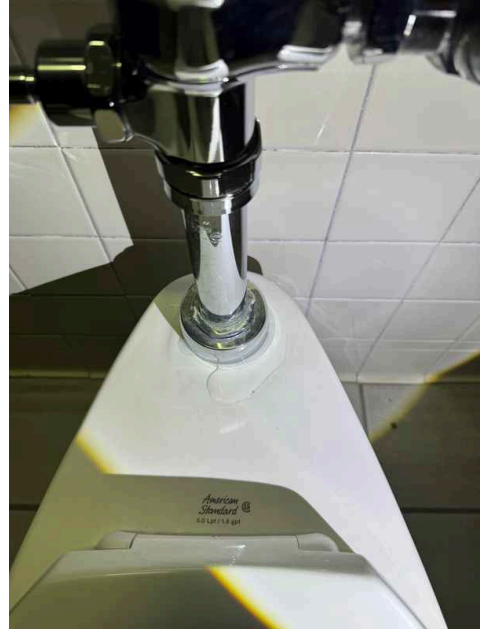

Woman's Left Restroom- Stall 8



7.5.3 Water Supply, Distribution Systems & Fixtures

CONTINUOUS FLUSHING URINAL

BATHROOM

The urinal continues to flush without stopping, indicating a malfunction in the flush valve or fill mechanism. This was observed during testing of plumbing fixtures. Continuous flushing wastes significant water and increases utility costs, and may indicate internal valve damage or debris obstruction.

Recommendation

Contact a qualified professional.



Main Corridor- Men's Left Bathroom


7.6.1 Hot Water Systems, Controls, Flues & Vents

WATER HEATER LEAK WITH RUST ACCUMULATION

Rust observed in the pan and base of the water heater, indicating an apparent leak from the unit. Water leaks from the heater can lead to water damage, mold growth, and potential structural deterioration of surrounding materials.

Recommendation

Contact a qualified professional.

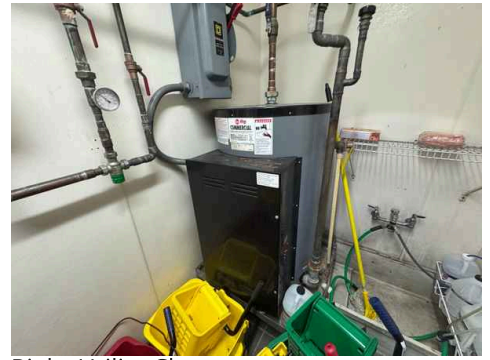

Right Utility Closet

7.6.2 Hot Water Systems, Controls, Flues & Vents

HOT WATER SYSTEM AGE

The hot water system appears to be of a certain age based on visual inspection. Older water heaters typically have reduced efficiency, increased maintenance needs, and a higher likelihood of failure.

Recommendation

Contact a qualified professional.



Right Utility Closet



Left Utility Closet

8: ELECTRICAL

8.1	General
8.2	Service Entrance Conductors
8.3	Main & Subpanels, Service & Grounding, Main Overcurrent Device
8.4	Branch Wiring Circuits, Breakers & Fuses
8.5	Lighting Fixtures, Switches & Receptacles
8.6	GFCI & AFCI
8.7	Smoke Detectors
8.8	Carbon Monoxide Detectors

Information

Service Entrance Conductors: Electrical Service Conductors Below Ground, 208/277	Main & Subpanels, Service & Grounding, Main Overcurrent Device: Main Panel Location Back	Main & Subpanels, Service & Grounding, Main Overcurrent Device: Panel Capacity 400 Amp
Main & Subpanels, Service & Grounding, Main Overcurrent Device: Panel Manufacturer Square D	Main & Subpanels, Service & Grounding, Main Overcurrent Device: Panel Type Circuit Breaker	Main & Subpanels, Service & Grounding, Main Overcurrent Device: Sub Panel Location Kitchen, Camera Rooms- Each side
Branch Wiring Circuits, Breakers & Fuses: Branch Wire 15 and 20 AMP Copper	Branch Wiring Circuits, Breakers & Fuses: Wiring Method Conduit	

Observations

8.3.1 Main & Subpanels, Service & Grounding, Main Overcurrent Device

CLEARANCE

Observed improper clearance in front of electrical panels. Recommend correction.

Recommendation

Contact a qualified professional.

 Safety Hazard



Kitchen



Kitchen

8.4.1 Branch Wiring Circuits, Breakers & Fuses

DAMAGED CONDUIT


Damaged electrical conduit was observed during inspection of the branch wiring circuits and breaker system. Conduit damage can expose live electrical wires, creating a shock hazard and potential fire risk.

Recommendation

Contact a qualified professional.



RTU

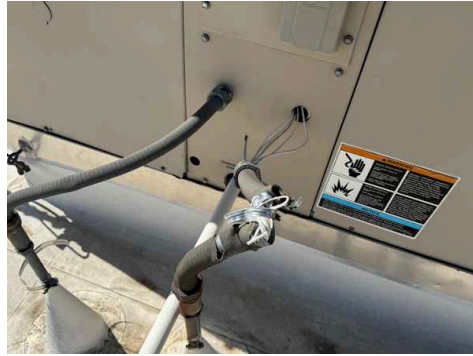

RTU


8.4.2 Branch Wiring Circuits, Breakers & Fuses

NO POWER TO BRANCH CIRCUIT

No electrical power is available to one or more branch circuits. This was discovered during inspection of the electrical panel and circuit breaker system. Loss of power to circuits prevents operation of connected outlets, switches, and fixtures, and may indicate a tripped breaker, open fuse, or wiring issue that requires professional evaluation to identify the root cause and restore service.

Recommendation

Contact a qualified professional.

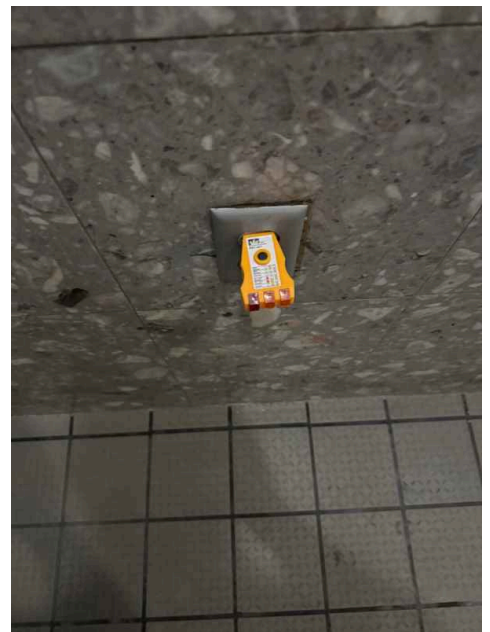

Lobby; left Wall

8.6.1 GFCI & AFCI

NO GFCI PROTECTION INSTALLED

No GFCI protection present in all locations. Recommend licensed electrician upgrade by installing ground fault receptacles in all locations.

[Here is a link](#) to read about how GFCI receptacles keep you safe.

Recommendation

Contact a qualified electrical contractor.

9: ATTIC, INSULATION & VENTILATION

9.1	General
9.2	Insulation of Unfinished Spaces

Information

Insulation of Unfinished Spaces:	Insulation of Unfinished Spaces:
R-value	Insulation Type
R-15	Blown, Cellulose, Insulated Panels

10: DOORS, WINDOWS & INTERIOR

10.1	General
10.2	Doors
10.3	Windows
10.4	Floors
10.5	Walls
10.6	Ceilings
10.7	Steps, Stairways & Railings

Information

Floors: Floor Coverings Carpet, Tile	Walls: Wall Material Gypsum Board	Ceilings: Ceiling Material Ceiling Tiles
--	---	--

Observations

10.2.1 Doors

DAMAGED

The door was damaged.

Recommendation
Contact a qualified professional.



Theater 13 Closet



Right Doors at end of Corridor

10.2.2 Doors

DAMAGED DOOR CLOSER

The door closer mechanism is damaged and not functioning properly. This was observed during inspection of the door assembly. A malfunctioning closer compromises the door's ability to close automatically and securely, potentially creating a safety or security concern.

Recommendation
Contact a qualified professional.



Front Right Hallway

10.2.3 Doors

DAMAGED DOOR LATCH

The door latch mechanism is damaged and not functioning properly. This was observed during inspection of the door hardware. A damaged latch compromises the door's ability to close and lock securely, creating both a security concern and potential safety issue.

Recommendation

Contact a qualified professional.



Door Right Corridor


10.4.1 Floors

TRIP HAZARD - CARPET

Carpet presents a trip hazard, likely due to wrinkled, bunched, or lifted edges observed during inspection. This creates a fall risk for occupants and visitors, particularly for children, elderly individuals, or those with mobility challenges. The carpet should be secured, re-stretched, or replaced to eliminate the hazard.

Recommendation

Contact a qualified professional.

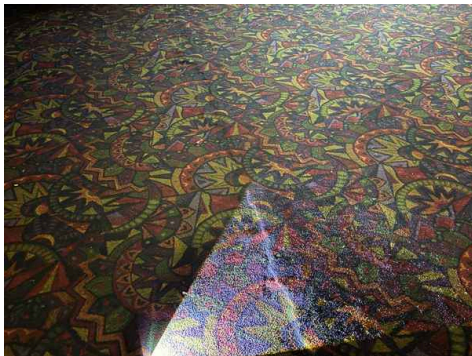

LEft Hallway



Left Hallway at Snack Bar

10.4.2 Floors

DAMAGED ANTI-SLIP TILES


Anti-slip tiles on the floor surface show signs of damage. Deteriorated anti-slip coating or cracked tiles reduce traction and create a slip hazard for occupants.

Recommendation

Contact a qualified professional.



Kitchen

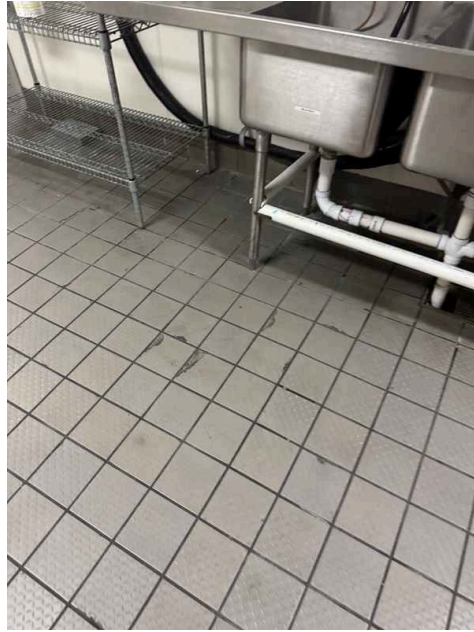

Kitchen



Snack bar

10.4.3 Floors

BATHROOM FLOORS NOT SLOPING TO DRAIN

BATHROOM

The bathroom floor does not slope toward the drain as designed. Proper floor slope is essential for water drainage and prevents pooling. Without adequate slope, water accumulation can lead to structural damage, mold growth, and deterioration of flooring materials.

Recommendation

Contact a qualified professional.



Men's left bathroom

10.6.1 Ceilings

STAIN(S) ON CEILING

There is a stain on ceiling/wall that requires repair and paint. Source of staining should be determined.

Recommendation

Contact a qualified professional.



2nd Floor Left




2nd Floor Left




2nd Floor Left



Theater 12

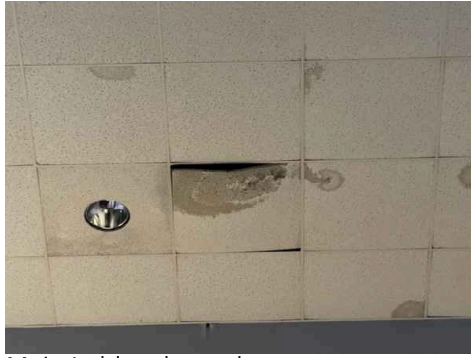

Main Lobby above doors

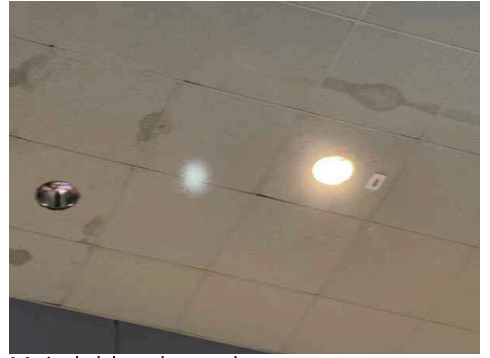

Main lobby above doors



Main Lobby above snack bar

10.6.2 Ceilings

DAMAGED CEILING TILES

Ceiling tiles are observed with damage during inspection. Damaged tiles may indicate water intrusion, impact damage, or deterioration from age or moisture exposure. Tiles should be inspected for the source of damage and replaced to maintain proper ceiling integrity and appearance.

Recommendation

Contact a qualified professional.




Theater 10



Theater 11



Theater 12

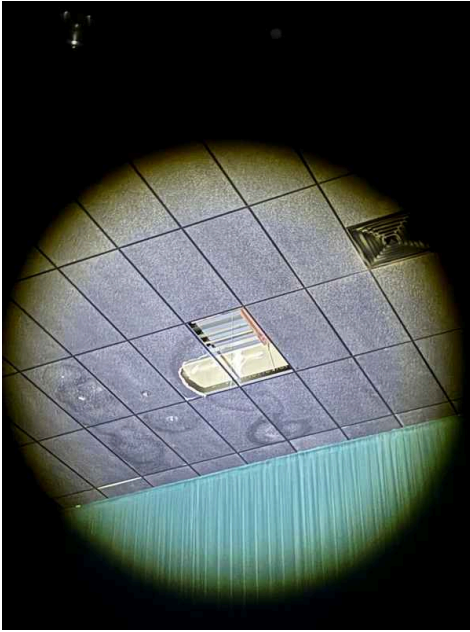

Theater 10

10.7.1 Steps, Stairways & Railings

NON CONTINUOUS HANDRAIL

Handrail was 2 separate runs.

Recommendation

Contact a qualified professional.



11: LIFE SAFETY

11.1	General
11.2	Fire Access Roads
11.3	Fire Hydrant Clearance
11.4	Storage of Flammable and Combustable Materials
11.5	No Smoking Signs
11.6	Fire Alarm Systems
11.7	Portable Fire Extinguishers
11.8	Commercial Cooking Appliances
11.9	Sprinkler System
11.10	Emergency Lighting Systems
11.11	Exit Signs, Doors, Stairwells and Handrails
11.12	Elevator Certification

Information

Elevator Certification : Elevator Operation

The Elevator was in the keyed-off position with no key present. There is no certification notice in the car.




Observations

11.2.1 Fire Access Roads

REPAINTING

The fire lanes were not clearly marked.

Recommendation
Contact a qualified professional.

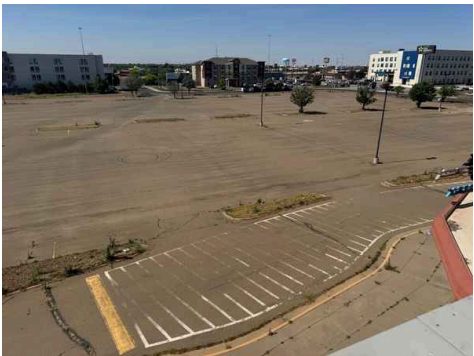


11.4.1 Storage of Flammable and Combustible Materials

FLAMMABLE CHEMICALS NOT PROPERLY STORED

Flammable and combustible materials were observed stored improperly during the inspection. Improper storage of these materials creates a significant fire hazard and may pose health risks to occupants. All flammable chemicals should be stored in approved, labeled containers in a designated, well-ventilated area away from ignition sources.

Recommendation

Contact a qualified professional.

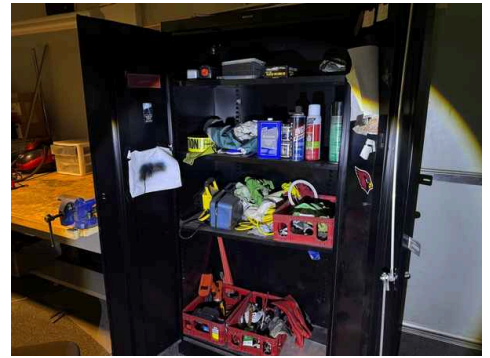

Right Camera Room



11.7.1 Portable Fire Extinguishers

OUT OF DATE TAGS

Observed fire extinguisher tags that were beyond inspection date or did not have an inspection date.

Recommendation

Contact a qualified professional.

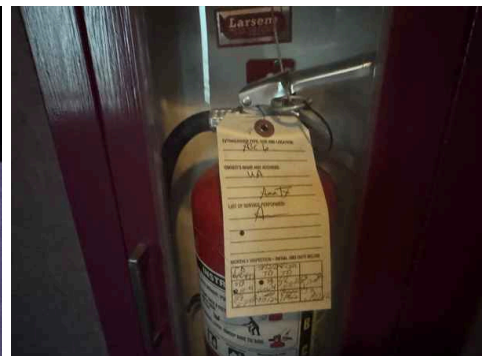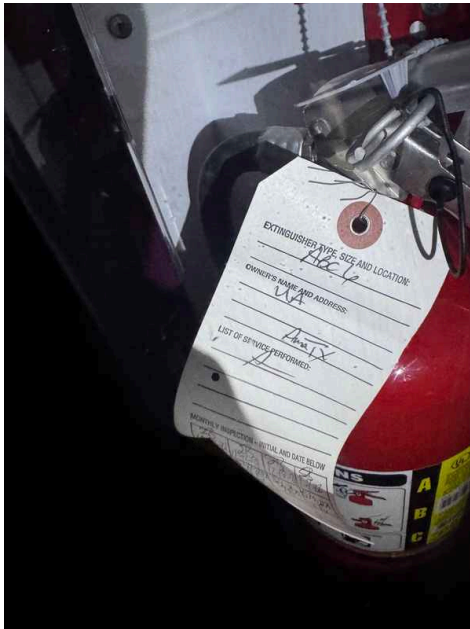



11.9.1 Sprinkler System

MISSING SPRINKLER HEADS

Several sprinkler heads are absent from the fire suppression system. This was observed during inspection of the sprinkler network. Missing heads compromise the system's ability to deliver adequate water coverage in affected areas, reducing fire suppression effectiveness.

Recommendation

Contact a qualified professional.



Left Hallway



Right Utility Closet



Left Hallway

11.11.1 Exit Signs, Doors, Stairwells and Handrails

MISSING EXIT SIGN

An exit sign was not present in a location where one is required for life safety purposes. Exit signs provide critical directional guidance during emergencies, allowing occupants to quickly identify escape routes. The absence of a required exit sign creates a safety concern and should be addressed promptly by installing an appropriate, illuminated exit sign in the proper location.

Recommendation

Contact a qualified professional.



Theater 9


11.12.1 Elevator Certification

ELEVATOR OUT OF CERTIFICATION

Based on records present, the elevator hasn't been inspected since 2022 and will need to be re-certified.

Recommendation

Contact a qualified professional.

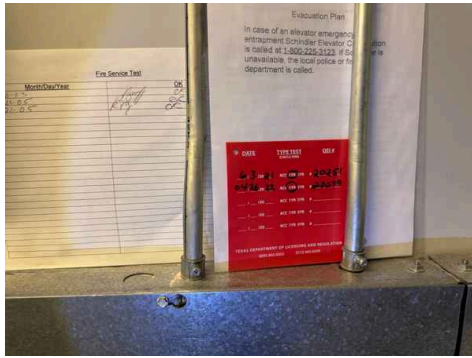

12: COOKING AREA

12.1	General
12.2	Cooking Equipment

Information

General: Hood Material
Steel

13: ACCESSIBILITY INSPECTION REPORT

13.1	General
13.2	Parking
13.3	Route of Travel
13.4	Entrance
13.5	Ramps
13.6	Interior
13.7	Restrooms
13.8	Elevators

Observations



13.3.1 Route of Travel

MULTIPLE ENTRAPMENTS PRESENT

Damaged flooring has resulted entrapments that need to be removed for ADA compliance.

Recommendation

Contact a qualified professional.

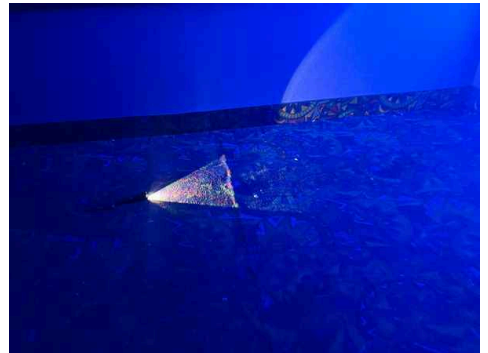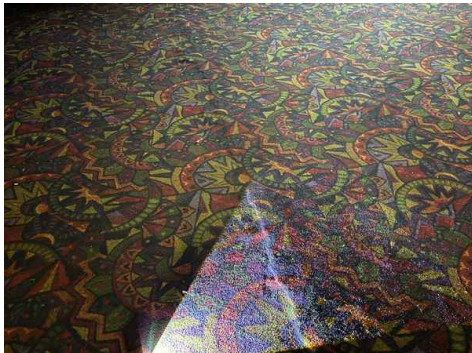


13.7.1 Restrooms

CLEARANCE IN FRONT OF TOILET

The Toilet did not have proper clearance for wheel chair.

Recommendation

Contact a qualified professional.

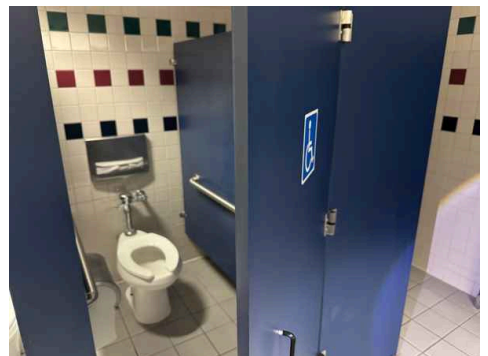

The Smaller Handicap Stall in Left Men's restroom

STANDARDS OF PRACTICE

Roof

I. The inspector should inspect from ground level, eaves or rooftop (if a rooftop access door exists):

- A. the roof covering;
- B. for the presence of exposed membrane;
- C. slopes;
- D. for evidence of significant ponding;
- E. the gutters;
- F. the downspouts;
- G. the vents, flashings, skylights, chimney and other roof penetrations;
- H. the general structure of the roof from the readily accessible panels, doors or stairs; and
- I. for the need for repairs.

II. The inspector is not required to:

- A. walk on any pitched roof surface.
- B. predict service-life expectancy.
- C. inspect underground downspout diverter drainage pipes.
- D. remove snow, ice, debris or other conditions that prohibit the observation of the roof surfaces.
- E. move insulation.
- F. inspect antennae, lightning arresters, de-icing equipment or similar attachments.
- G. walk on any roof areas that appear, in the opinion of the inspector, to be unsafe.
- H. walk on any roof areas if it might, in the opinion of the inspector, cause damage.
- I. perform a water test.
- J. warrant or certify the roof.
- K. walk on any roofs that lack rooftop access doors.

Exterior

I. The inspector should inspect:

- A. the siding, flashing and trim;
- B. all exterior doors, decks, stoops, steps, stairs, porches, railings, eaves, soffits and fasciae;
- C. and report as in need of repair any safety issues regarding intermediate balusters, spindles or rails for steps, stairways, balconies and railings;
- D. a representative number of windows;
- E. the vegetation, surface drainage, and retaining walls when these are likely to adversely affect the structure;
- F. the exterior for accessibility barriers;
- G. the storm water drainage system;
- H. the general topography;
- I. the parking areas;
- J. the sidewalks;
- K. exterior lighting;
- L. the landscaping;
- M. and determine that a 3-foot clear space exists around the circumference of fire hydrants;
- N. and describe the exterior wall covering.

II. The inspector is not required to:

- A. inspect or operate screens, storm windows, shutters, awnings, fences, outbuildings or exterior accent lighting.
- B. inspect items, including window and door flashings, that are not visible or readily accessible from the ground.
- C. inspect geological, geotechnical, hydrological or soil conditions.
- D. inspect recreational facilities.
- E. inspect seawalls, breakwalls or docks.
- F. inspect erosion-control or earth-stabilization measures.
- G. inspect for proof of safety-type glass.
- H. determine the integrity of thermal window seals or damaged glass.
- I. inspect underground utilities.
- J. inspect underground items.
- K. inspect wells or springs.
- L. inspect solar systems.
- M. inspect swimming pools or spas.
- N. inspect septic systems or cesspools.
- O. inspect playground equipment.

- P. inspect sprinkler systems.
- Q. inspect drainfields or dry wells.
- R. inspect manhole covers.
- S. operate or evaluate remote-control devices, or test door or gate operators.

Basement, Foundation and Crawlspace

I. The inspector should inspect:

- A. the basement;
- B. the foundation;
- C. the crawlspace;
- D. the visible structural components;
- E. and report on the location of under-floor access openings;
- F. and report any present conditions or clear indications of active water penetration observed by the inspector;
- G. for wood in contact with or near soil;
- H. and report any general indications of foundation movement that are observed by the inspector, such as, but not limited to: sheetrock cracks, brick cracks, out-of-square door frames, or floor slopes;
- I. and report on any cutting, notching or boring of framing members that may present a structural or safety concern.

II. The inspector is not required to:

- A. enter any crawlspaces that are not readily accessible, or where entry could cause damage or pose a hazard to the inspector.
- B. move stored items or debris.
- C. operate sump pumps.
- D. identify size, spacing, span or location, or determine the adequacy of foundation bolting, bracing, joists, joist spans or support systems.
- E. perform or provide any engineering or architectural service.
- F. report on the adequacy of any structural system or component.

Heating and Ventilation

I. The inspector should inspect:

- A. multiple gas meter installations, such as a building with multiple tenant spaces, and verify that each meter is clearly and permanently identified with the respective space supplied;
- B. the heating systems using normal operating controls, and describe the energy source and heating method;
- C. and report as in need of repair heating systems that do not operate;
- D. and report if the heating systems are deemed inaccessible;
- E. and verify that a permanent means of access, with permanent ladders and/or catwalks, are present for equipment and appliances on roofs higher than 16 feet;
- F. and verify the presence of level service platforms for appliances on roofs with a slope of 25% or greater;
- G. and verify that luminaire and receptacle outlets are provided at or near the appliance;
- H. and verify that the system piping appears to be sloped to permit the system to be drained;
- I. for connectors, tubing and piping that might be installed in a way that exposes them to physical damage;
- J. wood framing with cutting, notching or boring that might cause a structural or safety issue;
- K. pipe penetrations in concrete and masonry building elements to verify that they are sleeved;
- L. exposed gas piping for identification by a yellow label marked "Gas" in black letters occurring at intervals of 5 feet or less;
- M. and determine if any appliances or equipment with ignition sources are located in public, private, repair or parking garages or fuel-dispensing facilities;
- N. and verify that fuel-fired appliances are not located in or obtain combustion air from sleeping rooms, bathrooms, storage closets or surgical rooms;
- O. for the presence of exhaust systems in occupied areas where there is a likelihood of excess heat, odors, fumes, spray, gas, noxious gases or smoke;
- P. and verify that outdoor air-intake openings are located at least 10 feet away from any hazardous or noxious contaminant sources, such as vents, chimneys, plumbing vents, streets, alleys, parking lots or loading docks;
- Q. outdoor exhaust outlets for the likelihood that they may cause a public nuisance or fire hazard due to smoke, grease, gases, vapors or odors;
- R. for the potential of flooding or evidence of past flooding that could cause mold in ductwork or plenums; and
- S. condensate drains.

II. The inspector is not required to:

- A. inspect or evaluate interiors of flues or chimneys, fire chambers, heat exchangers, humidifiers, dehumidifiers, electronic air filters, solar heating systems, fuel tanks, safety devices, pressure gauges, or control mechanisms.
- B. determine the uniformity, temperature, flow, balance, distribution, size, capacity, BTU, or supply adequacy of the heating system.
- C. light or ignite pilot flames.
- D. activate heating, heat pump systems, or other heating systems when ambient temperatures or other circumstances are not conducive to safe operation or may damage the equipment.
- E. over-ride electronic thermostats.

- F. evaluate fuel quality.
- G. verify thermostat calibration, heat anticipation or automatic setbacks, timers, programs or clocks.
- H. inspect tenant-owned or tenant-maintained heating equipment.
- I. determine ventilation rates.
- J. perform capture and containment tests.
- K. test for mold.

Cooling

I. The inspector should inspect:

- A. multiple air-conditioning compressor installations, such as a building with multiple tenant spaces, and verify that each compressor is clearly and permanently identified with the respective space supplied;
- B. the central cooling equipment using normal operating controls;
- C. and verify that luminaire and receptacle outlets are provided at or near the appliance;
- D. and verify that a permanent means of access, with permanent ladders and/or catwalks, are present for equipment and appliances on roofs higher than 16 feet;
- E. and verify the presence of level service platforms for appliances on roofs with a slope of 25% or greater;
- F. wood framing with cutting, notching or boring that might cause a structural or safety issue;
- G. pipe penetrations in concrete and masonry building elements to verify that they are sleeved;
- H. piping support;
- I. for connectors, tubing and piping that might be installed in a way that exposes them to physical damage;
- J. for the potential of flooding or evidence of past flooding that could cause mold in ductwork and plenums; and
- K. condensate drains.

II. The inspector is not required to:

- A. inspect or test compressors, condensers, vessels, evaporators, safety devices, pressure gauges, or control mechanisms.
- B. determine the uniformity, temperature, flow, balance, distribution, size, capacity, BTU, or supply adequacy of the cooling system.
- C. inspect window units, through-wall units, or electronic air filters.
- D. operate equipment or systems if exterior temperature is below 60° Fahrenheit, or when other circumstances are not conducive to safe operation or may damage the equipment.
- E. inspect or determine thermostat calibration, cooling anticipation, or automatic setbacks or clocks.
- F. examine electrical current, coolant fluids or gases, or coolant leakage.
- G. inspect tenant-owned or tenant-maintained cooling equipment.
- H. test for mold.

Plumbing

I. The inspector should inspect:

- A. and verify the presence of and identify the location of the main water shut-off valve to each building;
- B. and verify the presence of a back-flow prevention device if, in the inspector's opinion, a cross-connection could occur between the water-distribution system and non-potable water or private source;
- C. the water-heating equipment, including combustion air, venting, connections, energy-source supply systems, and seismic bracing, and verify the presence or absence of temperature-/pressure-relief valves and/or Watts 210 valves;
- D. and flush a representative number of toilets;
- E. and water-test a representative number of sinks, tubs and showers for functional drainage;
- F. and verify that hinged shower doors open outward from the shower, and have safety glass-conformance stickers or indicators;
- G. the interior water supply, including a representative number of fixtures and faucets;
- H. the drain, waste and vent systems, including a representative number of fixtures;
- I. and describe any visible fuel-storage systems;
- J. and test sump pumps with accessible floats;
- K. and describe the water supply, drain, waste and main fuel shut-off valves, as well as the location of the water main and main fuel shut-off valves;
- L. and determine whether the water supply is public or private;
- M. the water supply by viewing the functional flow in several fixtures operated simultaneously, and report any deficiencies as in need of repair;
- N. and report as in need of repair deficiencies in installation and identification of hot and cold faucets;
- O. and report as in need of repair mechanical drain stops that are missing or do not operate if installed in sinks, lavatories and tubs;
- P. and report as in need of repair commodes that have cracks in the ceramic material, are improperly mounted on the floor, leak, or have tank components that do not operate; and
- Q. piping support.

II. The inspector is not required to:

- A. determine the adequacy of the size of pipes, supplies, vents, traps or stacks.
- B. ignite pilot flames.
- C. determine the size, temperature, age, life expectancy or adequacy of the water heater.
- D. inspect interiors of flues or chimneys, cleanouts, water-softening or filtering systems, dishwashers, interceptors,

separators, sump pumps, well pumps or tanks, safety or shut-off valves, whirlpools, swimming pools, floor drains, lawn sprinkler systems or fire sprinkler systems.

E. determine the exact flow rate, volume, pressure, temperature or adequacy of the water supply.

F. verify or test anti-scald devices.

G. determine the water quality, potability or reliability of the water supply or source.

H. open sealed plumbing access panels.

I. inspect clothes washing machines or their connections.

J. operate any main, branch or fixture valve.

K. test shower pans, tub and shower surrounds, or enclosures for leakage.

L. evaluate compliance with local or state conservation or energy standards, or the proper design or sizing of any water, waste or venting components, fixtures or piping.

M. determine the effectiveness of anti-siphon, back-flow prevention or drain-stop devices.

N. determine whether there are sufficient cleanouts for effective cleaning of drains.

O. evaluate gas, liquid propane or oil-storage tanks.

P. inspect any private sewage waste-disposal system or component within such a system.

Q. inspect water-treatment systems or water filters.

R. inspect water-storage tanks, pressure pumps, ejector pumps, or bladder tanks.

S. evaluate wait time for hot water at fixtures, or perform testing of any kind on water-heater elements.

T. evaluate or determine the adequacy of combustion air.

U. test, operate, open or close safety controls, manual stop valves, or temperature- or pressure-relief valves.

V. examine ancillary systems or components, such as, but not limited to, those relating to solar water heating or hot-water circulation.

W. determine the presence or condition of polybutylene plumbing.

Electrical

I. The inspector should inspect:

A. the service drop/lateral;

B. the meter socket enclosures;

C. the service-entrance conductors, and report on any noted deterioration of the conductor insulation or cable sheath;

D. the means for disconnecting the service main;

E. the service-entrance equipment, and report on any noted physical damage, overheating or corrosion;

F. and determine the rating of the service disconnect amperage, if labeled;

G. panelboards and over-current devices, and report on any noted physical damage, overheating, corrosion, or lack of accessibility or working space (minimum 30 inches wide, 36 inches deep, and 78 inches high in front of panel) that would hamper safe operation, maintenance or inspection;

H. and report on any unused circuit-breaker panel openings that are not filled;

I. and report on absent or poor labeling;

J. the service grounding and bonding;

K. a representative number of switches, lighting fixtures and receptacles, including receptacles observed and deemed to be AFCI-protected using the AFCI test button, where possible. Although a visual inspection, the removal of faceplates or other covers or luminaires (fixtures) to identify suspected hazards is permitted;

L. and report on any noted missing or damaged faceplates or box covers;

M. and report on any noted open junction boxes or open wiring splices;

N. and report on any noted switches and receptacles that are painted;

O. and test all ground-fault circuit interrupter (GFCI) receptacles and GFCI circuit breakers observed and deemed to be GFCIs using a GFCI tester, where possible;

P. and report the presence of solid-conductor aluminum branch-circuit wiring, if readily visible;

Q. and report on any tested GFCI receptacles in which power was not present, polarity was incorrect, the cover was not in place, the GFCI devices were not installed properly or did not operate properly, any evidence of arcing or excessive heat, or where the receptacle was not grounded or was not secured to the wall;

R. and report the absence of smoke detectors;

S. and report on the presence of flexible cords being improperly used as substitutes for the fixed wiring of a structure or running through walls, ceilings, floors, doorways, windows, or under carpets.

II. The inspector is not required to:

A. insert any tool, probe or device into the main panelboard, sub-panels, distribution panelboards, or electrical fixtures.

B. operate electrical systems that are shut down.

C. remove panelboard cabinet covers or dead fronts if they are not readily accessible.

D. operate over-current protection devices.

E. operate non-accessible smoke detectors.

F. measure or determine the amperage or voltage of the main service equipment, if not visibly labeled.

G. inspect the fire or alarm system and components.

H. inspect the ancillary wiring or remote-control devices.

I. activate any electrical systems or branch circuits that are not energized.

J. operate or reset overload devices.

K. inspect low-voltage systems, electrical de-icing tapes, swimming pool wiring, or any time-controlled devices.

L. verify the service ground.

M. inspect private or emergency electrical supply sources, including, but not limited to: generators, windmills, photovoltaic solar collectors, or the battery- or electrical-storage facility.

- N. inspect spark or lightning arrestors.
- O. inspect or test de-icing equipment.
- P. conduct voltage-drop calculations.
- Q. determine the accuracy of labeling.
- R. inspect tenant-owned equipment.
- S. inspect the condition of or determine the ampacity of extension cords.

Attic, Insulation & Ventilation

I. The inspector should inspect:

- A. the insulation in unfinished spaces;
- B. the ventilation of attic spaces;
- C. mechanical ventilation systems;
- D. and report on the general absence or lack of insulation.

II. The inspector is not required to:

- A. enter the attic or any unfinished spaces that are not readily accessible, or where entry could cause damage or pose a safety hazard to the inspector, in his or her opinion.
- B. move, touch or disturb insulation.
- C. move, touch or disturb vapor retarders.
- D. break or otherwise damage the surface finish or weather seal on or around access panels or covers.
- E. identify the composition or exact R-value of insulation material.
- F. activate thermostatically operated fans.
- G. determine the types of materials used in insulation or wrapping of pipes, ducts, jackets, boilers or wiring.
- H. determine the adequacy of ventilation.

Doors, Windows & Interior

I. The inspector should:

- A. open and close a representative number of doors and windows;
- B. inspect the walls, ceilings, steps, stairways and railings;
- C. inspect garage doors and garage door-openers;
- D. inspect interior steps, stairs and railings;
- E. inspect all loading docks;
- F. ride all elevators and escalators;
- G. and report as in need of repair any windows that are obviously fogged or display other evidence of broken seals.

II. The inspector is not required to:

- A. inspect paint, wallpaper, window treatments or finish treatments.
- B. inspect central-vacuum systems.
- C. inspect safety glazing.
- D. inspect security systems or components.
- E. evaluate the fastening of countertops, cabinets, sink tops or fixtures, or firewall compromises.
- F. move furniture, stored items, or any coverings, such as carpets or rugs, in order to inspect the concealed floor structure.
- G. move drop-ceiling tiles.
- H. inspect or move any appliances.
- I. inspect or operate equipment housed in the garage, except as otherwise noted.
- J. verify or certify safe operation of any auto-reverse or related safety function of a garage door.
- K. operate or evaluate any security bar-release and opening mechanisms, whether interior or exterior, including their compliance with local, state or federal standards.
- L. operate any system, appliance or component that requires the use of special keys, codes, combinations or devices.
- M. operate or evaluate self-cleaning oven cycles, tilt guards/latches, gauges or signal lights.
- N. inspect microwave ovens, or test leakage from microwave ovens.
- O. operate or examine any sauna, steam-jenny, kiln, toaster, ice maker, coffee maker, can opener, bread warmer, blender, instant hot-water dispenser, or other ancillary devices.
- P. inspect elevators.
- Q. inspect remote controls.
- R. inspect appliances.
- S. inspect items not permanently installed.
- T. examine or operate any above-ground, movable, freestanding, or otherwise non-permanently installed pool/spa, recreational equipment, or self-contained equipment.
- U. come into contact with any pool or spa water in order to determine the system's structure or components.
- V. determine the adequacy of a spa's jet water force or bubble effect.
- W. determine the structural integrity or leakage of a pool or spa.
- X. determine combustibility or flammability.
- Y. inspect tenant-owned equipment or personal property.

Life Safety

I. The inspector should:

- A. inspect fire access roads and report on any obstructions or overhead wires lower than 13 feet and 6 inches;
- B. inspect the address or street number to determine whether it is visible from the street, with numbers in contrast to their background;
- C. inspect to determine whether a 3-foot clear space exists around the circumference of fire hydrants;
- D. verify that hinged shower doors open outward from the shower and have safety glass-conformance stickers or indicators;
- E. inspect to determine whether the storage of flammable and combustible materials is orderly, separated from heaters by distance or shielding so that ignition cannot occur, and not stored in exits, boiler rooms, mechanical rooms or electrical equipment rooms;
- F. inspect to determine whether a "No Smoking" sign is posted in areas where flammable or combustible material is stored, dispensed or used;
- G. inspect for the presence of fire alarm systems;
- H. inspect for alarm panel accessibility;
- I. inspect for the presence of portable extinguishers, and determine whether they are located in conspicuous and readily available locations immediately available for use, and not obstructed or obscured from view;
- J. inspect to determine whether a portable fire extinguisher is stored within a 30-foot travel distance of commercial-type cooking equipment that uses cooking oil or animal fat;
- K. inspect to determine whether manual-actuation devices for commercial cooking appliances exist near the means of egress from the cooking area, 42 to 48 inches above the floor and 10 and 20 feet away, and clearly identifying the hazards protected;
- L. inspect to determine whether the maximum travel distance to a fire extinguisher is 75 feet;
- M. inspect for the presence of sprinkler systems, and determine if they were ever painted other than at the factory;
- N. inspect for the presence of emergency lighting systems;
- O. inspect for exit signs at all exits, and inspect for independent power sources, such as batteries;
- P. inspect for the presence of directional signs where an exit location is not obvious;
- Q. inspect for the presence of signs over lockable exit doors stating: "This Door Must Remain Unlocked During Business Hours";
- R. inspect for penetrations in any walls or ceilings that separate the exit corridors or stairwells from the rest of the building;
- S. inspect for fire-separation doors that appear to have been blocked or wedged open, or that do not automatically close and latch;
- T. inspect exit stairwell handrails;
- U. inspect for exit trip hazards;
- V. inspect for the presence of at least two exits to the outside, or one exit that has a maximum travel distance of 75 feet;
- W. inspect exit doorways to determine that they are less than 32 inches in clear width;
- X. inspect to determine whether the exit doors were locked from the inside, chained, bolted, barred, latched or otherwise rendered unusable at the time of the inspection;
- Y. inspect to determine whether the exit doors swing open in the direction of egress travel; and
- Z. inspect the storage to determine if it is potentially obstructing access to fire hydrants, fire extinguishers, alarm panels or electric panelboards, or if it is obstructing aisles, corridors, stairways or exit doors, or if it is within 18 inches of sprinkler heads, or if it is within 3 feet of heat-generating appliances or electrical panelboards.

II. The inspector is not required to:

- A. test alarm systems, or determine if alarms systems have been tested.
- B. inspect or test heat detectors, fire-suppression systems, or sprinkler systems.
- C. determine the combustibility or flammability of materials in storage.
- D. determine the adequate number of fire extinguishers needed, or their ratings.
- E. test or inspect fire extinguishers, their pressure, or for the presence of extinguisher inspection tags or tamper seals.
- F. inspect or test fire pumps or fire department connections.
- G. inspect or test cooking equipment suppression systems.
- H. determine the operational time of emergency lighting or exit signs.
- I. inspect for proper occupant load signs.
- J. determine fire ratings of walls, ceilings, doors, etc.
- K. inspect, test or determine the adequacy of fire escapes or ladders.
- L. inspect fire department lock boxes or keys.
- M. determine the flame resistance of curtains or draperies.
- N. inspect parking or outdoor lighting.
- O. inspect for unauthorized entry or crime issues.
- P. inspect or test security systems.
- Q. inspect for pet or livestock safety issues.
- R. inspect for unsafe candle use or decoration hazards.
- S. inspect or test emergency generators.
- T. test kitchen equipment, appliances or hoods.
- U. verify that elevator keys exist, or that they work properly.

Cooking Area**I. The inspector should:**

- A. verify that all smoke- or grease-laden, vapor-producing cooking equipment, such as deep-fat fryers, ranges, griddles, broilers and woks, is equipped with an exhaust system;

- B. inspect for the accessibility for cleaning and inspection of the exhaust system's interior surface;
- C. inspect for grease buildup;
- D. verify that hoods are made of steel or stainless steel;
- E. verify that visible grease filters are arranged so that all exhaust air passes through them;
- F. verify that visible sections of exhaust ducts are not interconnected with any other ventilation system;
- G. verify that visible sections of exhaust ducts are installed without dips or traps that might collect residue;
- H. verify that exhaust ducts do not appear to pass through firewalls;
- I. try to verify that exhaust ducts lead directly to the exterior of the building;
- J. try to verify that exterior exhaust outlets do not discharge into walkways, or create a nuisance, in the opinion of the inspector;
- K. inspect to determine that a portable fire extinguisher is stored within a 30-foot travel distance of commercial-type cooking equipment that uses cooking oil or animal fat; and
- L. inspect to determine that manual-actuation devices for commercial cooking appliances exist near the means of egress from the cooking area, 42 and 48 inches above the floor and 10 to 20 feet away, and clearly identifying the hazards protected.

II. The inspector is not required to:

- A. determine proper clearances.
- B. determine proper hood size or position.
- C. test hoods.
- D. test exhaust fans or dampers, or measure air flow.
- E. test fire extinguishers, fire-extinguishing equipment, or fusible links.
- F. test kitchen equipment, appliances, hoods or their gauges.
- G. inspect or test grease-removal devices, drip trays or grease filters.
- H. inspect or test air pollution-control devices or fume incinerators.
- I. inspect or test kitchen refrigeration.
- J. inspect for fuel-storage issues.
- K. inspect, test or determine anything regarding food safety.
- L. issue an opinion regarding cooking operating procedures.