Firmware Update SOP

This firmware update sop is for hardware version G1 with the running firmware 7.0.0 only.

Here you need to update two files on the router, first you need to update the 2mb file and then you can update the 7mb file.
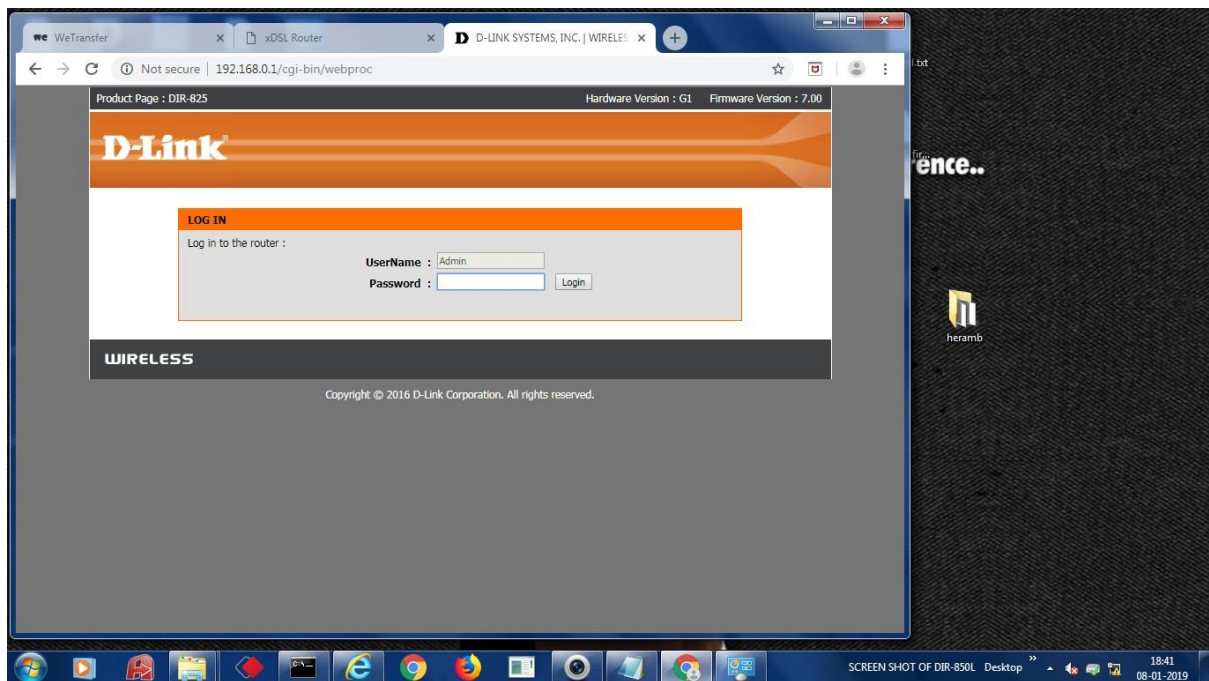
You can follow below given procedure:

Connect a pc to the router with a cable on one of the lan ports. Download both the firmware files and get it saved on this pc

Open browser and type 192.168.0.1 and hit enter, you will get login page
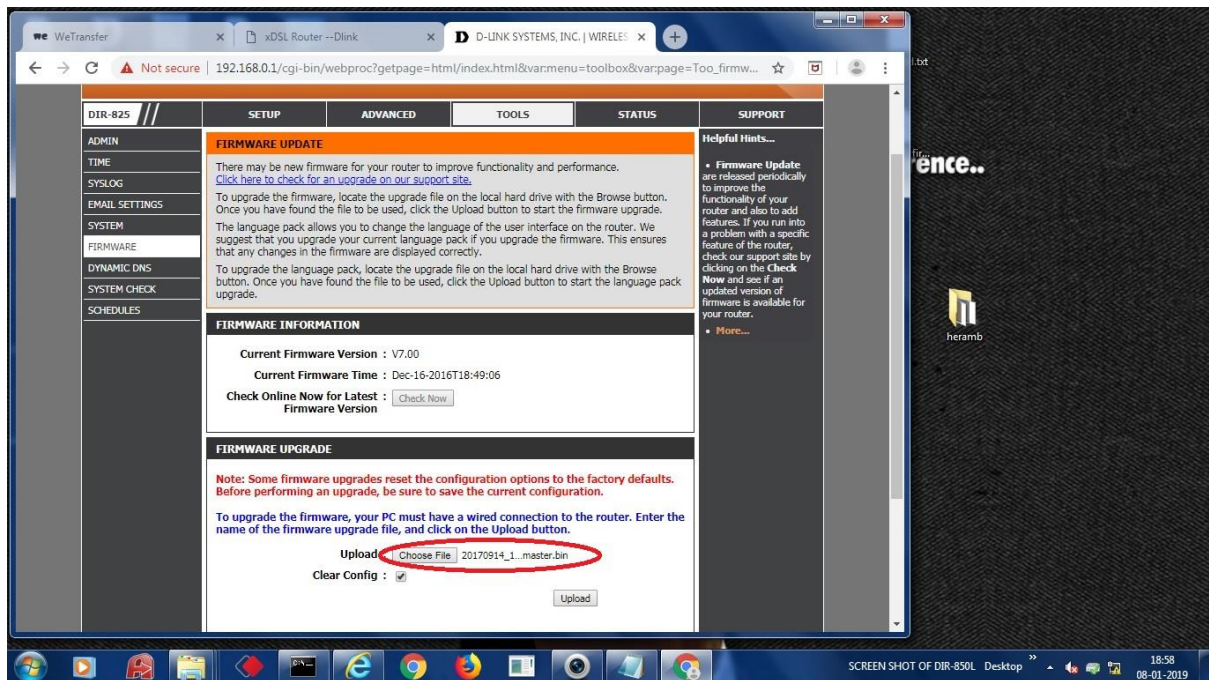
Login with username as admin and by default there will be no password for this

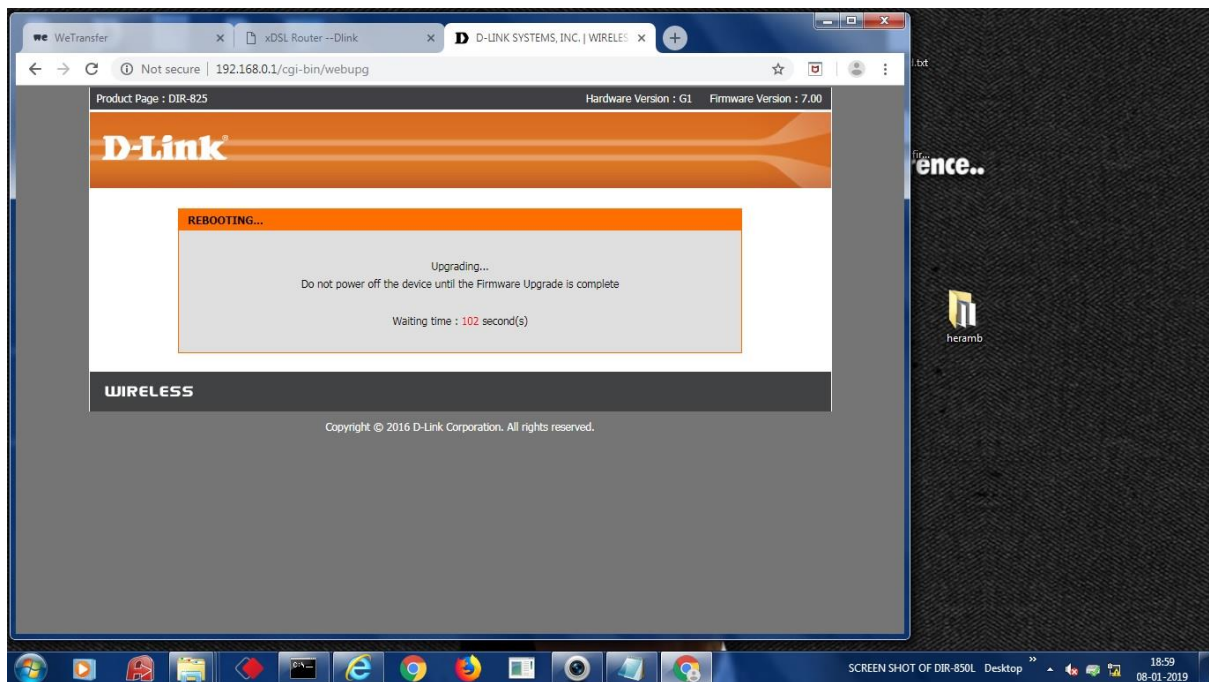It is advisable to use internet explorer for this procedure.

Once logged in, you need to click on Tools at the top and then click on Firmware on the left side

Then under firmware upgrade section click on choose file and select the master.bin (2mb) file and then click on upload.
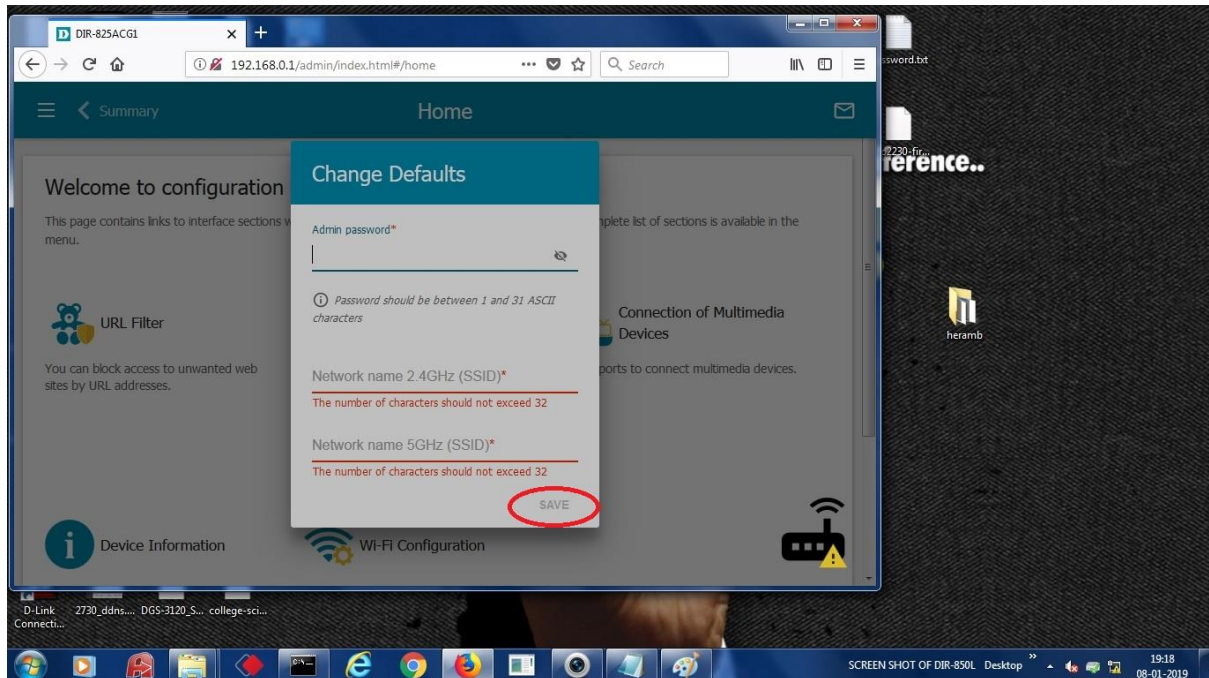

Note : update procedure might take some time.

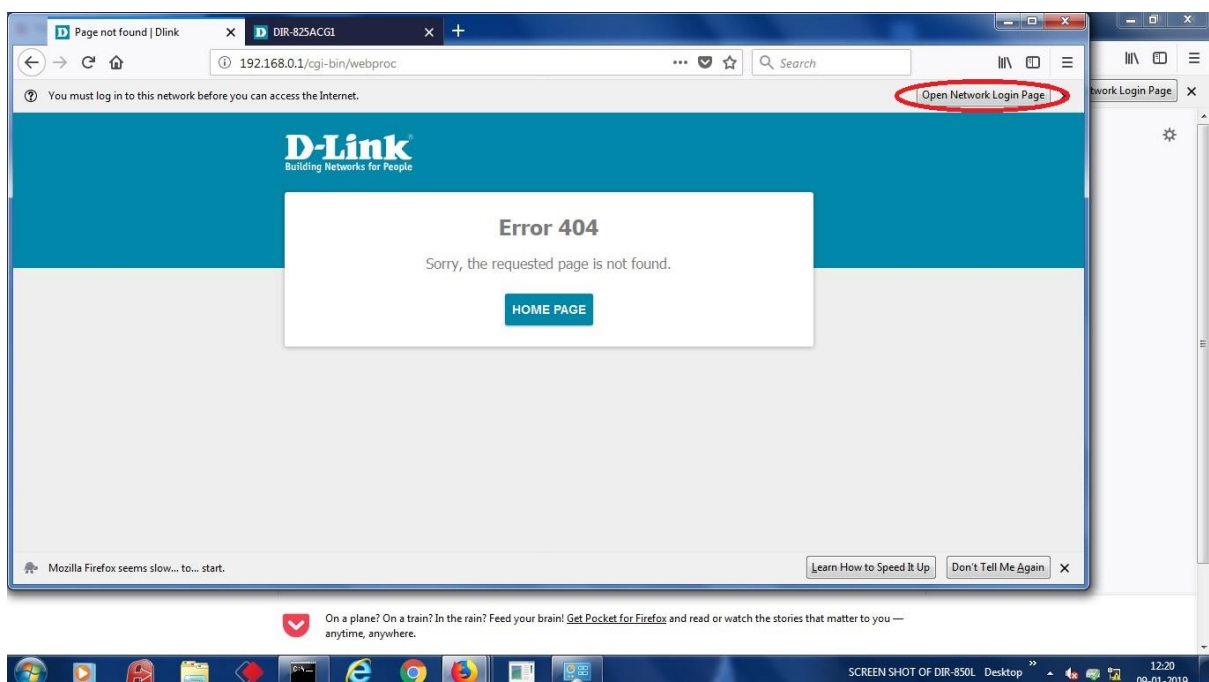Once this is completed you will get the page shown below:

Just enter a admin password of your choice. It should be more than six characters

Also you need to enter a network name for 2.4 ghz and 5 ghz of your choice, Only after you have entered these details the save button will be highlighted. You need to click on save now.

However after updating the first firmware file if you get the page shown below then kindly clear browsing history and cookies. Also you can try with a different browser such as mozilla firefox.

Also in case of Mozilla firefox you will get option of open network login page. If you click on it you will get the above show page.
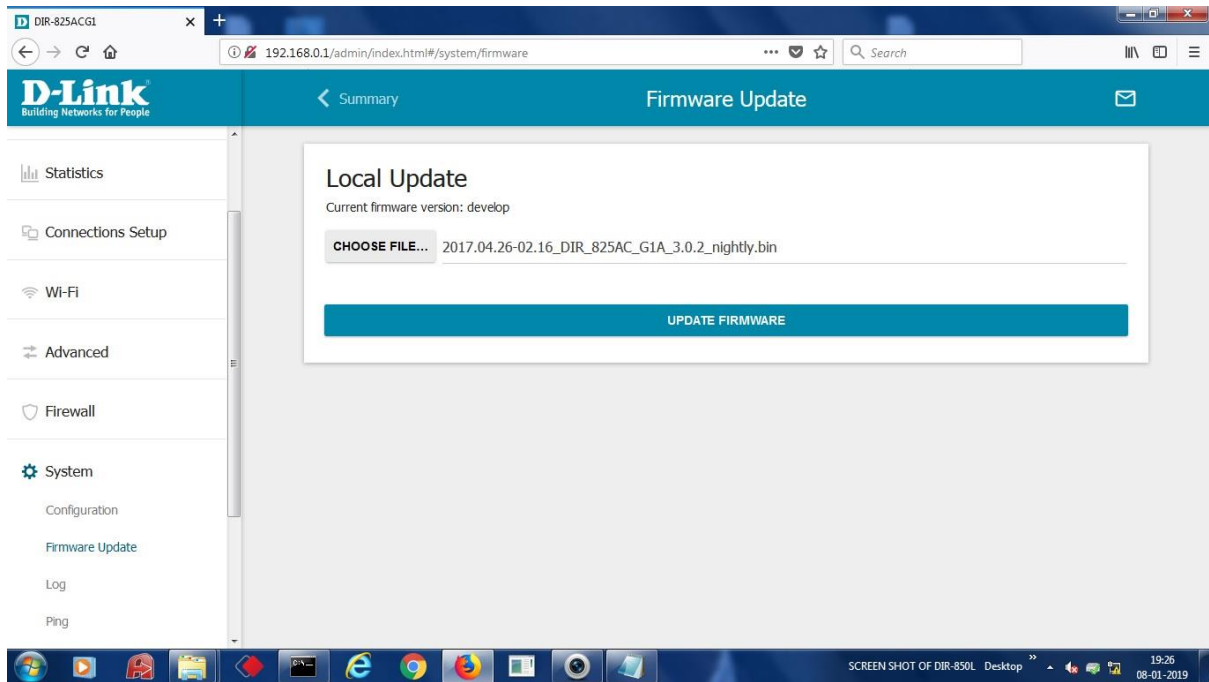
Once the above procedure is completed you need to update the second firmware file on the router.
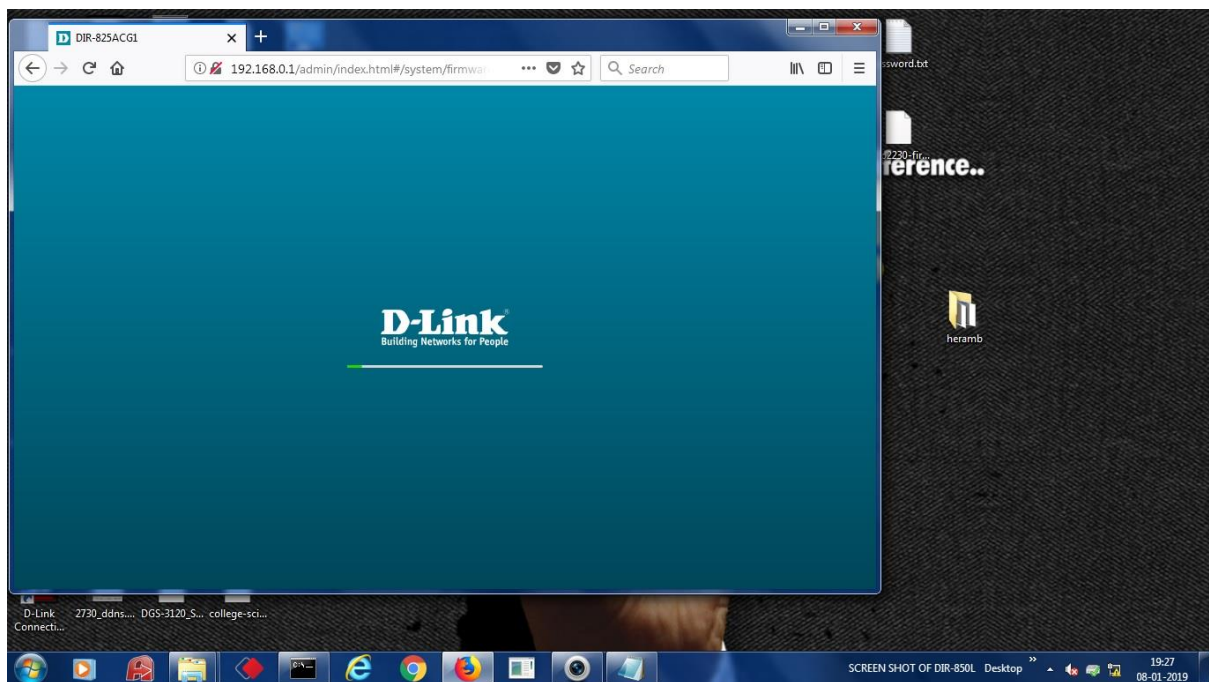
Click on System option on the left side and then go to firmware Update

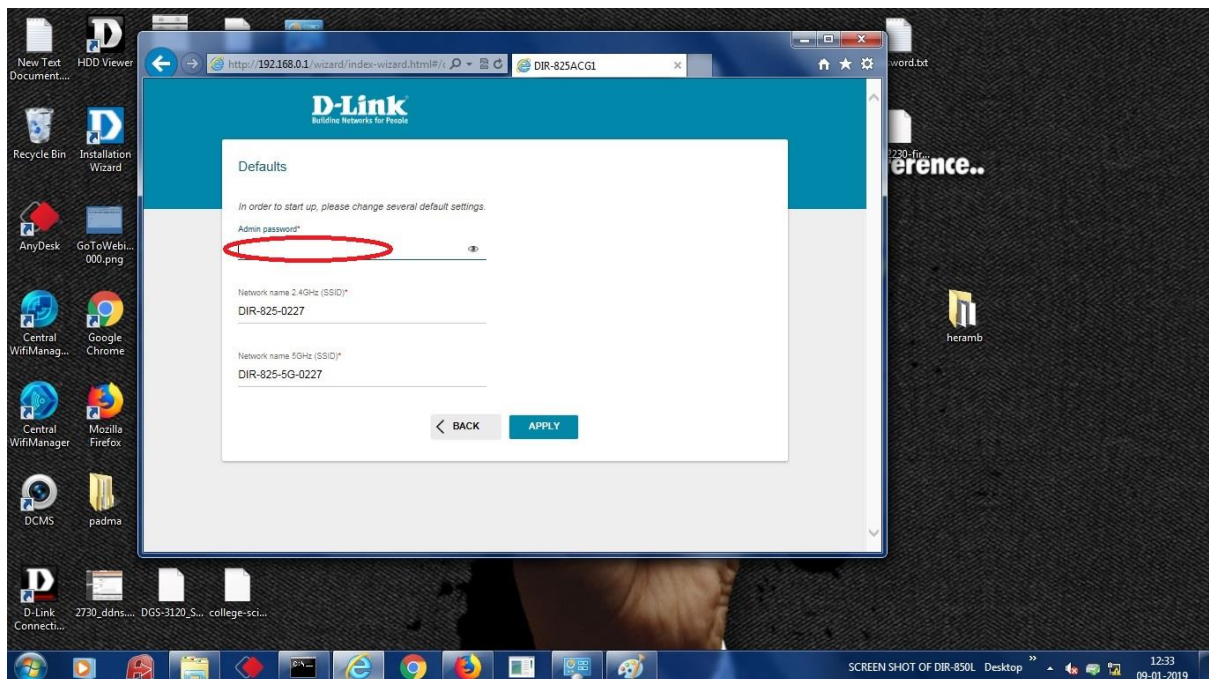Click on choose file and select the nightly.bin (7mb) from the pc

Click on Update firmware.

You need to wait for some time to get the firmware updated.

Again you will be on this page. Here you need to set the admin password again (minimum 6 characters). Make a note of this password and click apply.

Now you can click on Summary on the left side. The firmware version should show as 3.0.2.