
#### Solar 3 Hand Date: AS32A & VS42A

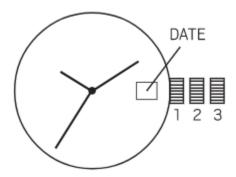

#### 3 Hand / 3 Hand Date

### **Date Setting**

- 1. Pull the crown out to position 2.
- 2. Turn the crown either clockwise or counter-clockwise and set the date for the previous day. The direction that moves the date varies on different watch models.

#### Time Setting

- 1. Pull crown out to position 3.
- 2. Turn counter-clockwise to advance the time and continue until the day changes to the present day.
- 3. Set to the correct time.
- 4. Push crown back to position 1.

NOTE: If watch has no date function, pull crown out to position 2 for time setting.

# **Expected Running Time: 4 - 6 Months**

# Power depletion warning

1. The second hand moves at two -second intervals when the power reserve is extremely low.

# Watch Charging:

- 1. When you start the watch or when the energy remaining in the secondary battery is very low, charge it sufficiently by exposing the watch to light.
- 2. Keep the watch exposed to the light until the second hand moves at one-second intervals.
- 3. Charge the watch significantly during the initial charge. It does not need to be fully charged before use.

Caution: When charging the watch, do not place it too close to a fluorescent lamp or other light sources as the watch temperature will become extremely high, causing damage to the parts inside the watch.

# **Energy Depletion Prevention:**

- 1. Avoid covering the watch face with your clothing while wearing it.
- 2. When the watch is not in use, leave it in a brightly lit place for as long as possible.
- 3. Make sure that the watch temperature does not exceed 50°C.

# **Guidelines for charging time:**

Condition A: Time required for full charge

Condition B: Time required for steady operation Condition C: Time required for 1 day's charge

#### AS32A

A contract of the contract of						
Illumination (Lx)	Source of light	Environment	A (Approx. Hours)	B (*) (Approx. Hours)	C (Approx. Minutes)	
700	A fluorescent lamp	Inside the office	ı	35	100	
3,000		30W 20cm	60	4	25	
10,000	Sunlight	Cloudy	20	1.5	8	
100,000		Fine weather	5	15 minutes	2	

#### VS42A

Illumination (Lx)	Source of light	Environment	A (Approx. Hours)	B (*) (Approx. Hours)	C (Approx. Minutes)
700	A fluorescent lamp	Inside the office	-	33	47
3,000		30W 20cm	47	8	15
10,000	Sunlight	Cloudy	13	2	4
100,000		Fine weather	5	42 minutes	1