

SOUTH CENTRAL RAILWAY
SC DIVISION – ALERT ADVICE No. 18/2025

No.sfy-12/SC/AA-18/2025

Date: 29.11.2025

Sub: Joint Procedural Order on Safe Execution of Shunting Operations

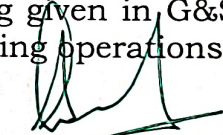
Ref: SCR-PCOM0RULE (JPO)/1/2020-RULES SECTION(67319) dated 21.10.2025

Vide the reference cited above, a Joint Procedural Order on Safe Execution of Shunting Operations-Special emphasis on push back movements towards dead end was issued by CTPM/SCR, CELE/SCR and CTE/SCR for implementation.

At CHZ yard on 22.11.2025 at about 03.10 hrs, while performing shunting from pit line no.1 to IOH shed with 06 mixed coaches with loco no. 11392 during forward movement engine and coach no. SC 157855 LWLRRM(next to engine) towards GT end trailed through the Hand operated point No.01 since pointsmen not set the Pt no.1 in favour of movement and remaining coaches are in between Pt No. 01 to Pt no.04. While backing the formation towards IOH shed the said coach (SC 157855 LWLRRM) taken two routes and trailing trolley derailed. In this incident PM taken off SPI without ensuring HL point -1 favour to movement and loco PM advised shunter to move the formation instead of exhibiting hand signals from concerned HL point.

In the above incident the shunting staff did not follow the Joint Procedural Order on Safe Execution of Shunting Operations. In view of the above, it should be ensured that concerned staff to be counselled regarding instructions of JPO and existing rule provisions for shunting given in G&SR for strict observance to avoid unusual incidents during shunting operations.

Encl: as above JPO.


[प्र. सुरेश]

वरि. मंसंधि/सिकं

[A. Suresh]

Sr. DSO/SC

Copy:DRM/SC for kind information.

ADRM/O and ADRM/I for kind information.

All Branch Officers for information and necessary action.

All Field Supervisors for information and necessary action.

दक्षिण मध्य रेलवे

सिकंदराबाद मंडल - चेतावनी सूचना सं.. 18/2025

सं..sfy-12/SC/AA-18/2025

दिनांक: 29.11.2025

विषय : शंटिंग परिचालन के सुरक्षित निष्पादन पर संयुक्त प्रक्रियात्मक आदेश.

संदर्भ: SCR-PCOM0RULE (JPO)/1/2020-RULES SECTION(67319) dated 21.10.2025

उपर्युक्त संदर्भ के अनुसार, सीटीपीएम/द.म.रे, सीईएलई/द.म.रे और सीटीई/द.म.रे ने डेड-एंड के लिए पुश-बैक मूवमेंट पर विशेष जोर देते हुए शंटिंग कार्यों के सुरक्षित निष्पादन के संबंध में एक संयुक्त प्रक्रियात्मक आदेश जारी किया था.

दिनांक 22.11.2025 को लगभग 03.10 बजे चर्लापल्ली यार्ड में, पिट लाइन संख्या 1 से आईओएच शेड तक लोको संख्या 11392 के साथ 06 मिश्रित कोचों के साथ शंटिंग करते समय, फॉरवर्ड मूवमेंट के दौरान इंजन और कोच संख्या एससी 157855 एलडब्ल्यूएलआरआरएम (इंजन के बगल में) घटकेसर छोर की ओर हथ-परिचालित पाइंट संख्या 01 से गुजरे, क्योंकि पॉइंट्समैन ने मूवमेंट के लिए पाइंट संख्या 1 को सेट नहीं किया था और शेष कोच पाइंट संख्या 01 से पाइंट संख्या 04 के बीच में थे. आईओएच शेड की ओर फॉर्मेशन को पीछे ले जाते समय उक्त कोच (एससी 157855 एलडब्ल्यूएलआरआरएम) दो रूट (सड़क) पर चले गए और पीछे वाली ट्रॉली पटरी से उतर गई.

इस घटना में, पाइंट्समैन ने एचएल पॉइंट-1 को मूवमेंट के लिए सुनिश्चित किए बिना एसपीआई से हट गए और लोको पीएम ने शंटर को संबंधित एचएल पॉइंट से हथ संकेत दिखाने के बजाय फॉर्मेशन को आगे बढ़ाने का परामर्श दिया.

उपरोक्त घटना में शंटिंग कर्मचारी ने शंटिंग परिचालन के सुरक्षित निष्पादन हेतु जारी संयुक्त प्रक्रियात्मक आदेश का पालन नहीं किया. उपरोक्त को ध्यान में रखते हुए, यह सुनिश्चित किया जाए कि संबंधित कर्मचारियों को संयुक्त प्रक्रियात्मक आदेश के निर्देशों और सा.व.सनि में दिए गए शंटिंग के मौजूदा नियम प्रावधानों के बारे में परामर्श दिया जाए ताकि शंटिंग परिचालन के दौरान असामान्य घटनाओं से बचा जा सके.

संलग्नक: यथोक्त जेपीओ.


(ए.सुरेश)

वमंसंधि/सिकंदराबाद

प्रतिलिपि: मरेप्र/सिकंदराबाद को सूचनार्थ.

अमरेप्र/प्रचा और अमरेप्र/इन्फ्रा को सूचनार्थ.

सभी शाखा अधिकारियों को सूचना एवं आवश्यक कार्रवाई के लिए.

सभी फील्ड पर्यवेक्षकों को सूचना एवं आवश्यक कार्रवाई के लिए.

JPO for safe execution of shunting operations – special emphasis on push back movements towards dead end.

- 1.1. At stations where separate shunting staff are employed, they shall attend all shunting operations. At all other stations, shunting operations shall be supervised personally by the TMR of the train, under the orders of Station Master.
- 1.2. Where shunting operations are supervised by TMR/SM, Loco Pilot shall be given Form No. T/806 (Shunting order) duly filled with additional Information regarding length of the siding should also be provided. The speed during shunting operations shall not exceed 15 kmph.
- 1.3. It is the responsibility of the LP/TMR/Shunter and shunting staff to acquaint with shunting restrictions before the commencement of shunting.
- 1.4. The person, who initially gives instructions for shunting operations, shall not change instructions and authorise the changing of points etc., unless he has satisfied himself that shunting operations have been stopped completely.
- 1.5. Loco Pilot/Shunter must ensure that hand signal is exhibited from the concerned points (not governed by signals) enroute by shunting supervisor/ Points man as an assurance of correct setting and locking of points.
- 1.6. Shunting staff shall have the knowledge of layout of the station, yard, or line where they are operating. They should clearly understand the length of the line up to the dead end, measured in terms of meters/ number of coaches or wagons it can accommodate. Before initiating push-back shunting, the Loco pilot/Shunter/Shunting staff shall know the number of wagons or coaches involved.
- 1.7. Shunting staff shall position themselves and continuously exhibit hand signals to the loco pilot and also have view of dead-end to monitor the movement safely. Absence of proceed hand signal from shunting staff shall be treated as danger, LP/Shunter shall stop and ascertain.
- 1.8. In case LP/Shunter is unable to see the hand signals due to curvature, lengthier load or obstruction an additional pointsman should be deputed in the working cab to relay the hand signals/shunting instructions. Walkie talkie can be used for continuous flow of instructions. No movement is to be carried out by Loco pilot/Shunter when there is any break in communication.

MENDA
YELVENDER YADAV

Digitally signed by MENDA
YELVENDER YADAV
Date: 2025.10.21 14:51:58
+05'30'

CTPM

PRADEEP
BAHADUR
SINGH
RATHORE

Digitally signed by
PRADEEP BAHADUR
SINGH RATHORE
Date: 2025.10.21
15:06:49 +05'30'

CELE

DASARI
SUBRAM
ANYAM

Digitally signed
by DASARI
SUBRAMANYAM
Date: 2025.10.21
15:36:21 +05'30'

CTE

- 1.9. The Chief Crew controller (CCC) must ensure that loco pilots and Shunters are provided with proper LR and handling Instructions before being assigned rostered shunting duties in the nominated yards. Additionally, Loco Inspectors (LIs) shall conduct regular checks on shunting operations and assess the driving techniques of Shunters during the course of shunting activities. TI/SM/YMs shall check the Shunting practices of the staff and educate them on safe working procedures.
- 2.0. While using walkie talkies, Staff shall clearly mention line and train number (Ex. GL1 BCNHL) and also confirm the identity of the speaker at the other end.
- 2.1. Provision of Standard buffers and regular maintenance of buffers/dead end shall be ensured by the Supervisor concerned. Illuminated strips to be provided to dead ends/buffer stops to enable shunting staff to notice nearness of buffer stop/ dead end clearly during night time.
- 2.2. Chief Crew controller/SM should ensure that walkie- talkies supplied to Shunters/ LPs and train manager are fully charged and in working condition. In case of non-functioning and communication/signal problem at the particular location of the yard, the matter should be brought to the notice of concerned supervisors for further action.
- 2.3. When a formation is split for placement across spurs through push-back movements on reaching five vehicles from dead end, shunting staff shall show hand signal indicating "move slowly towards the person signalling" and shall show stop hand signal when leading vehicle reached 20 meters before the dead end. LP/Shunter after stopping shall continue with utmost caution to avoid dashing against buffer end.
- 2.4. Formation limit boards shall be provided at all sidings which are in close proximity with outside roads/ residential areas/ dwellings/nullahs /culverts indicating the maximum permissible extent to which wagons/formation may be pushed. In this regard STOP and proceed with 03 kmph speed restriction board is to be provided at 20 metres before formation limit board of all such sidings to serve as a visible reminder for LP/Shunter to avoid any mishap during shunting near dead ends. Details and provision of such additional boards/ indicators shall be shown in SWR.
- 2.5. During push back, Shunter/ LP should follow the instructions of shunting staff, however when the Shunter / LP feels pushing hard than usual, he should stop the movement.
- 2.6. No shunting movement shall begin until all relevant points are properly set, securely clamped, and locked as per operational requirements.
- 2.7. Along with above instructions, existing provisions for shunting given under GR/SRs 5.13 to 5.23, Appendix XII and SWR shall be followed.

MENDA
YELVENDER
YADAV

Digitally signed by MENDA
YELVENDER YADAV
Date: 2025.10.21 14:52:14
+05'30'

CTPM

PRADEEP
BAHADUR SINGH
RATHORE

Digitally signed by
PRADEEP BAHADUR
SINGH RATHORE
Date: 2025.10.21
15:07:24 +05'30'

CELE

DASARI
SUBRAM
ANYAM

Digitally signed
by DASARI
SUBRAMANYAM
Date: 2025.10.21
15:33:48 +05'30'

CTE