



दक्षिण मध्य रेलवे
SOUTH CENTRAL RAILWAY

मंडल रेल प्रबंधक कार्यालय(T)
Office of the Divl. Rly. Manager(T)
सिकंदराबाद मंडल / Secunderabad Division
संचालन भवन/SanchalanBhavan
सिकंदराबाद/SECUNDERABAD-500025



No. C/T/187/ Optg. Safety Drive- 3/2025.

Dated: 03.11.2025.

All Section TIs.

Sub: Operating safety Drive for 45 days on Loading/Unloading and Safe Enroute movement of EUR Rakes - reg.

Ref: Rly.Bd Lr.No. 2012/M(N)/951/25 (E-3323637) dated 22.10.2025.

As per Railway Board instructions, a Safety drive has been launched for a period of 45 days from 03.11.2025 to 17.12.2025 on Loading/Unloading and Safe Enroute movement of EUR Rakes.

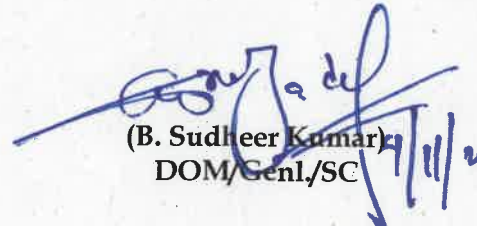
During the drive period all TIs to ensure:

- Strict compliance with the prescribed procedures for loading and unloading of rail panels.
- Ensure the implementation of safety checks and certification by SSE (P.Way) after every loading and unloading operation.
- Arrange for counselling of Train managers to maintain heightened vigilance during the movement of EUR rakes and to ensure immediate reporting of any enroute unusual occurrences.

In this connection a weekly report has to be submitted duly mentioning number of checks conducted, deficiencies noticed and number of staff counselled in the following format.

S.No.	TI	Station	Date	Number of checks conducted	Deficiencies noticed(if any)	Number of staff counselled

Encl: RB Letter.


(B. Sudheer Kumar)
DOM/Genl/SC 11/11/25



6457
GOVERNMENT OF INDIA
MINISTRY OF RAILWAYS
रेलवे बोर्ड RAILWAY BOARD



Sanjay/24.10

No.2012/M(N)/951/25 (E- 3323637)

PCOM

Date:22.10.2025

PCME

General Managers
All Zonal Railways&KRCL

PCE

Sub: Launching of 45 Days Safety Drive for Loading/Unloading and Safe Enroute Movement of EUR Rakes.

A recent incident in South East Central Railway has highlighted serious lapses in the handling of EUR rakes. In this case, the lever arm of a wagon in EUR rake struck the OHE mast causing it to bend resulting in OHE stagger dislumb.

As per the joint note, the following observations were made:

- (i) The Fit Certificate after loading/unloading of rail panels, as mandated in RDSO's Guidelines for Handling and Stacking of Rails (No. CT-35) and Railway Board's letter No. 2020/Track-I (P)/EUR dated 05.04.2023, was not issued by the SSE (P. Way) accompanying the EUR rake.
- (ii) After unloading, the lever arms of the rake were not properly secured by the unloading authority, resulting in one lever arm hitting the OHE mast.
- (iii) The Train Manager failed to report any abnormality despite the OHE mast being hit.
- (iv) A lever arm of wagon no. ECR-67101160019 was recovered from incident site. Stopper of lever arm found broken and locking bolt was missing.

In view of the above, it has been decided to launch an immediate 45-day Safety Drive focusing on the safe loading, unloading, and en-route movement of EUR rakes.

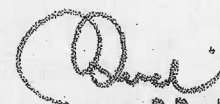
The following actions shall be ensured during the drive:

- (a) Ensure strict compliance with the prescribed procedures for loading and unloading of rail panels as outlined in Railway Board's letter No. 2020/Track-I (P)/EUR dated 05.04.2023 (copy enclosed).

- (b) Ensure the implementation of safety checks and certification by SSE (P.Way) after every loading and unloading operation, in accordance with Para 2.3.2 of RDSO's *Guidelines for Handling and Stacking of Rails* (No. CT-35).
- (c) Arrange for counselling of Train Managers to maintain heightened vigilance during the movement of EUR rakes and to ensure immediate reporting of any en-route unusual occurrences.
- (d) Ensure 100% availability and proper securing of end-wall bolts during the examination of EUR rakes.
- (e) Quality of welding of angle stoppers on side columns to prevent opening of lever arm outwards should be ensured in accordance to drawing no. RDSO/T-8407 (Revised and Redrawn), Alt. 04.

In addition to the above, 100% modification of all wagons of EUR rakes shall be carried out during ROH and POH in accordance with latest drawings of RDSO. List of latest drawings should be referenced from index drawing no. RDSO/T-8403 (Revised and Redrawn).

It is requested that the concerned PCEs, PCOMs and PCMEs may please be advised to closely monitor the progress of the Safety Drive and to submit day-wise progress reports to their respective Directorates in Railway Board on a weekly basis. A comprehensive summary report of the entire drive shall be submitted within five days of its completion.


22.10.24

(Happy Walia)
EDME (Freight)
Railway Board

Email: edmeff@rb.railnet.gov.in

Copy to:

1. PSO to CRB & CEO -for kind information of CRB & CEO.
2. PSO to MTRS -for kind information of MTRS
3. Sr. PPS to AM (ME) - for kind information of AM (ME)
4. Sr. PPS to AM (Traffic) - for kind information of AM (Traffic)
5. PED/Track (M&MC)- for kind information.
6. PCMEs/ All ZRs - for kind information and necessary action please.
7. PCEs/All ZRs - for kind information and necessary action please.
8. PCOMs/All ZR - for kind information and necessary action please.