

SOUTH CENTRAL RAILWAY



Office of the
Divisional Railway Manager/Safety
Fourth Floor, Sanchalan Bhavan
SECUNDERABAD
E-mail: srdsosecunderabad@gmail.com
Mob No.9701371750

No. C/SFY-5/SD-48/November-1/2025

Date 03.11.2025

SAFETY DRIVE NOVEMBER - 1/2025

Sub: Rly. Board's Drive No.17(FY-2025-26): Winter Preparedness drive.

Ref: 1.Railway Board Lr No.2025/Safety-1/3/11 dated 31.10.2025

2. PCSO/SCR Ltr No.safety.387/SD/Rly.Bd/ Vol.XIII dt 03.11.2025

Railway Board vide letter cited under reference, advised to launch a safety drive on Train Operations during Foggy & Inclement weather-Precautions as advised vide RB Letter No.98/Safety(A&R)/19/16 dated 10.10.2025 & 25.10.20¹⁹, a consolidated report to be submitted in the following format.

S No	Summary	Nos/details
1	No of inspections done by Officers	
2	Total No of staff Counseled:	
3	No of inspections done by Supervisors	
4	Total No of staff Counseled:	
5	Total No. of Inspections done	
6	No of deficiencies Noticed with details :	
7	No of deficiencies attended with details:	
8	No of pending Deficiencies/TDC:	

Weekly progress of the drives may please be submitted to this office on every Monday by 10.00hrs. After completion of the drive a consolidated report from each branch should be submitted to the undersigned by **15.12.2025** to enable this office for compilation of data and further forwarding to PCSO office and DRM/SC.

Note: Concerned BOs are requested to ensure that details of deficiencies noticed and its attention particulars with photos to be submitted both hard & soft copy.

Encl: RB letter dated 10.10.2025 & 25.10.2025

[ए. सुरेश]/ A. Suresh]
Sr. DSO/SC

Copy: DRM/SC for kind information.

ADRM/O & ADRM/I for kind information.

Sr DEE/TRSO, Sr DOM, Sr DSTE/Co, Sr DSTE & Sr DEE/TRD for information and necessary action pl

दक्षिण मध्य रेलवे / SOUTH CENTRAL RAILWAY

मुख्य संरक्षा अधिकारी का कार्यालय
Headquarters office,
Safety branch
सिकंदराबाद/Secunderabad
Date: 03-11-2025

No. Safety.387/Safety Drive/Rly.Bd/Vol.XIII

DRMs/SC, BZA, GTL, NED, HYB & GNT

विषय /Sub: Drive No.17 (FY-2025-26): Winter preparedness drive
संदर्भ/Ref: Railway Board Ir. No. 2025/Safety-I/3/11, dt: 31-10-2025.


A letter received from Railway Board regarding Winter preparedness Drive is enclosed herewith which is self-explanatory for your information and necessary action.

All the aspects mentioned in the Board's letter must be covered during the safety drives with regard to Winter preparedness & Fire Safety of Electrical items in coaches.

Officers and supervisors from Safety, Electrical, Engineering, Traffic, Mechanical and S&T departments from Headquarters and Divisions shall carry out the safety drive with all earnestness.

Weekly progress of the drives may please be submitted to this office on every Monday. After completion of the drives, consolidated Safety drive reports may please be submitted to this office for further appraisal to Railway Board by 15-12-2025.

Enc: As above


(K.Suryanarayana)
Dy.CSO/Electrical
कृते प्रमुखसंधि/सिकंदराबाद
For PCSO/SC

- C/ PCEE, PCE, PCOM, PCME & PCSTE for information and necessary action please.
- C/ Sr.DSOs- SC, BZA, GTL, NED, HYB & GNT for necessary action and to ensure that the safety drives are conducted in all earnestness and the daily report to be sent to Safety branch.
- C/ All Dy.CSOs for information & necessary action and to monitor the Safety drives.

**GOVERNMENT OF INDIA
MINISTRY OF RAILWAYS
(RAILWAY BOARD)**

No. 98/Safety(A&R)/19/16

New Delhi, dt. 10.10.2025

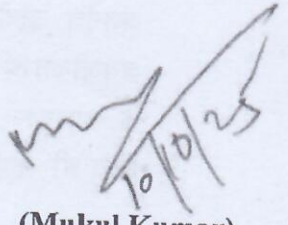
**General Managers
All Indian Railways,
Konkan Railway Corp., Navi Mumbai,
Metro Railway, Kolkata,
Railway Electrification, Allahabad**

**Sub: Train Operation during foggy & inclement weather – Precautions reg.
Ref: Board's letters of even number dated 22.11.2017, 15.03.2018, 23.10.2018,
25.10.2019, 14.10.2020, 11.10.2021, 12.10.2022, 11.10.2023, and 18.10.2024.**

Comprehensive instructions regarding preparatory action to be completed before the onset of foggy weather, precautions and rules to be observed during foggy/inclement weather have been issued to Zonal Railways from time to time. The instructions issued by Board during recent years are cited under reference. A copy of detailed instructions issued on 25.10.2019 is enclosed for ready reference. In the above instructions it has also been advised to ensure the training, education and counseling of staff and crew regarding working of trains during foggy weather before onset of fog.

The instructions under reference are reiterated. A feedback on the action taken regarding preparedness for smooth train operations during foggy weather, as indicated in the instructions may be furnished to Boards' Office.

Encl:- As above.


**(Mukul Kumar)
Executive Director/Safety(Traffic)
Railway Board**

Copy forwarded for information and necessary action to:-

1. The Principal Chief Operations Managers, All Indian Railways.
2. The Principal Chief Safety Officers, All Indian Railways.

GOVERNMENT OF INDIA/भारत सरकार
MINISTRY OF RAILWAYS/रेल मंत्रालय
(RAILWAY BOARD)/(रेलवे बोर्ड)

सं. 98/Safety(A&R)/19/16

नई दिल्ली, दिनांक: 10.10.2025

सभी महाप्रबंधक
भारतीय रेल,
कोंकण रेलवे कॉर्पोरेशन, नवी मुंबई,
मेट्रो रेलवे, कोलकाता,
रेलवे विद्युतीकरण, इलाहाबाद।

विषय: कोहरे और खराब मौसम के दौरान रेलगाड़ियों का परिचालन-सावधानियों के संबंध में।

संदर्भ: बोर्ड के दिनांक 22.11.2017, 15.03.2018, 23.10.2018, 25.10.2019,
14.10.2020, 11.10.2021, 12.10.2022, 11.10.2023 और
18.10.2024 के समसंख्यक पत्र।

क्षेत्रीय रेलों को कोहरे के मौसम की शुरुआत से पहले पूरी की जाने वाली प्रारंभिक तैयारियों और कोहरे/खराब मौसम के दौरान बरती जाने वाली सावधानियों और नियमों के बारे में समय-समय पर विस्तृत अनुदेश जारी किए गए हैं। हाल के वर्षों के दौरान बोर्ड द्वारा जारी अनुदेशों का संदर्भ के अंतर्गत उल्लेख किया गया है। बोर्ड के दिनांक 25.10.2019 को जारी विस्तृत अनुदेशों की एक प्रति अवलोकनार्थ संलग्न है। उपरोक्त अनुदेशों में, कोहरे की शुरुआत से पहले कोहरे के मौसम के दौरान रेलगाड़ियों के कामकाज के संबंध में कर्मचारियों और कर्मिंदल को प्रशिक्षण, शिक्षा और परामर्श सुनिश्चित करने के लिए भी कहा गया है।

संदर्भाधीन अनुदेशों को दोहराया जा रहा है। कोहरे के मौसम के दौरान सुचारू गाड़ी परिचालन के लिए तैयारियों के संबंध में, जैसा कि अनुदेशों में इंगित किया गया है, की गई कार्रवाई के संबंध में फीडबैक बोर्ड कार्यालय को प्रस्तुत किया जाए।

संलग्नक: यथोक्त

33/10/25
(मुकुल कुमार)

कार्यपालक निदेशक/संरक्षा (यातायात)
रेलवे बोर्ड

प्रतिलिपि सूचना एवं आवश्यक कार्रवाई हेतु प्रेषित:-

1. प्रधान मुख्य परिचालन प्रबंधक, सभी भारतीय रेलें।
2. प्रधान मुख्य सुरक्षा अधिकारी, सभी भारतीय रेलें।

**Government of India
Ministry of Railways
(Railway Board)**

No.98/Safety(A&R)/19/16

New Delhi, dt. 25.10.2019

The General Managers,
All Indian Railways,
Konkan Railway Corp., Navi Mumbai,
Metro Railway, Kolkata,
Railway Electrification, Allahabad.

Sub: Train Operation during Foggy & Inclement weather – Precautions.
Ref: Board's letter of even number dated 22.11.2017.

Detailed instruction on the above subject were issued to Zonal Railways vide Board's letter of even no. dated 22/11/2017. Subsequent to issue of these instructions, Board had decided that with the use of fog devices in locomotives, the maximum permissible speed during foggy/inclement weather condition be enhanced from 60 Kmph to 75 Kmph. References have been received from some of the Zonal Railways seeking clarification on the subject. It has therefore, been decided that following precaution/preparation be done by Zonal Railways for train operation during foggy/inclement weather as under:

(A) Infrastructure/Additions/Alterations.

(i) Provision of Fog Safe Device:-

Reliable Fog Safe Devices, if available, may be provided to the Loco Pilots in all Locomotives running in fog affected areas during fog. Placement of detonators under conditions as prescribed in Para E(ii) shall be dispensed with, where reliable Fog Safe Device is available and is in working order.

(ii) Modification of Automatic Signalling System:

Introduction of Modified Automatic Signalling System as per G.R 9.01 (3) & (4) and G.R 9.03 (3) and (4) and G.R 5.18 to be followed strictly

(B) Works to be completed before foggy weather to strengthen Rail Infrastructure:-

- (i) Adequate supply of detonators to be ensured.
- (ii) Lime marking across the track at the Sighting Board (or at Distant Signal in case of Double Distant Signals) must be done.
- (iii) All Signal Sighting Boards, Whistle Boards, fog signal posts and busy vulnerable level crossing gates which are accident prone should either be painted or provided with yellow/black luminous strips. The work of repainting for their proper visibility should be completed before onset of winter/foggy season.
- (iv) Lifting barriers at busy level crossings, where necessary, to be provided with Yellow/Black luminous indication strips.
- (v) The new existing SLRs are already being fitted with LED based flasher tail light, therefore, the existing SLRs with fixed Red lights should also be modified and fixed with LED lights. This will be a very important step to ensure safety in foggy weather.

The Railways should undertake this work on war footing. When the train is held up in Automatic territory (on double and multiple section) in abnormal situation including fog, the Guard will put the LED light to 'on' position. This will be in addition to Flashing Red Tail Lamp.

- vi) It should be ensured that retro reflective strip in Sigma shape for identification of stop signal be provided as per existing instructions.

(C) The following points are to be kept in mind during operation of trains in foggy weather:-

(i) **Reduced Movements During Fog:-**

Rationalization of movements in the Coaching yards, approach to terminals, and at/near terminals etc. has to be done to reduce pressure on congested areas; this may be achieved by reduction in loco changes, reduced shunting, etc. and cancellation of trains. 20 % reduction in movements during the fog has to be ensured i.e. by reduced movement of locos from and to shed, shunting in major yards, etc. and mainly by cancellation of trains - Mail/Express and Passenger trains running in and via Delhi area as also upto an equal no. also in other fog affected sections (other than the trains passing via Delhi area) to be proposed to be cancelled. A review be done by all Zonal Railways with mutual consultation to identify which Mail/Express and Passenger trains are to be cancelled and proposals sent to the Coaching Directorate, Railway Board. This will also help in tackling extra requirement of Loco pilots/Assistant Loco pilots and Guards for changing enroute on sections where there is abnormal increase in duty hours of crew. This will also increase availability of spare rakes to cater to late running of trains.

- (ii) PME/Refresher Training and other Safety/Promotional Courses of Loco pilots/Assistant Loco pilots and Guards in ZRTIs/STCs, etc. who become due between 15th December and 31st January should be completed by 15th December.
- (iii) Fog affected Railways should review the crew changing locations. In view of increased hours on road the Railways may create infrastructure at new/additional crew changing locations. Simultaneously the loco/crew/rake links be reviewed during the period of fog. All crews (Loco Pilots, Assistant Loco Pilots and Guards) on stationary duty should be utilized for train working especially during fog.
- (iv) The instructions on all matters including cancellation of train be made applicable from 20th December to 31st January every year subject to the provisions if the fog sets in early before 20th December and continues beyond 31st January respectively as the case may be.

(D) **Visibility Test Object (VTO):-**

- (i) The check of adequacy of visibility through the VTO is to guide the SM/ASM so as that he can decide when detonators are to be placed to warn the Loco Pilot of the location of an approach Stop Signal.
- (ii) VTO for Semaphore Signalling and for two aspect GLS:-
The VTO may be the light (or arm by day) of a Starter Signal (where exists) or the back light of the Home Signal etc. as defined in GR 3.61/(2)(b). In such cases, the VTO is normally located 300-350 meters at a place from where it is to be seen by the SM. During foggy or tempestuous weather, when such a VTO is not seen by the SM, it shall determine that fog has set in.

Note: The Visibility Test Object to be defined in the SWR of stations, which qualify for placement of detonators, should be on each end of a station (for junction stations there may be more than two VTOs).

(iii) Prescribed VTO for Multiple Aspect Colour Light Signalling:-

- (a) Stations with MACLS shall have a prescribed VTO located at a distance of 180 metres from a nominated location where the SM shall stand.
- (b) When a prescribed VTO is not visible from 180 metres or more during dense fog, the SM shall not use his discretion as per GR 3.61(2)(a) but will arrange to place the detonators to warn the Loco Pilot, unless specified otherwise in these instructions.

Note:- There should be one Visibility Test Post in MACLS territory (at stations which qualify for placement of detonators) located at a distance of 180 meter from the place where the SM shall normally stand to see the prescribed VTO.

(iv) When the VTO (or the prescribed VTO) provided under conditions laid down is not visible to the Station Master, he shall take action as under:-

- (a) Ensure that signals are lit during night as well as during day in Semaphore Signalling sections when visibility is impaired due to fog, and VTO is also lit.
- (b) Observe the VTO before granting Line Clear to a train.
- (c) In case prescribed VTO is not visible; take action as under:-
 - depute fog signalman with detonators to place detonators in situations prescribed under para (E) (ii) at 270 – 280 metres from the first stop signal to inform in advance the location of this signal to the Loco Pilot of the approaching train.
 - Engineering Department will make all efforts to provide fog signalman.
 - No shunting should be carried out on non-isolated lines after granting Line Clear to an approaching train.
- (d) Provisions given as per GR 5.18 to be followed strictly and no train to be advanced beyond the Starter, or beyond Intermediate Starter Signal where these exists, upto the Advance Starter at stations which do not have track circuiting in this zone.

(E) Necessity of Placement of Detonators:-

(i) Where Not Necessary to Place Detonators:-

It is not necessary to place detonators to indicate 'location of a Stop signal' to the Loco Pilot in following circumstances:-

- (a) In sections where a reliable Fog Safe Device has been provided on Locomotives;

- (b) Where adequate pre-warning is provided; i.e. at stations where double distant signals are provided;
- (c) Where maximum speed allowed in the station section is upto 15 kmph even at stations where pre-warning signal is not available, but a Warning Board exists;
- (d) Where speed of the section is less than 50 KMPH (but more than 15 kmph) and the first signal of a Station is not a stop signal;
- (e) In Automatic Signalling territory;
- (f) On Gate Signal;
- (g) On Departure Signal;
- (h) At the site(s) of Temporary Speed Restriction imposed due to maintenance of Track/OHE/Signal.

(ii) **Where it is necessary to Place Detonators:-**

The Detonators should be placed at 270 meters short of the First Stop Signal at stations detailed as under:-

- (a) At 'A' class stations where Warner exists – Detonators to be placed short of Home signal and not the Warner;
- (b) At 'B' class station equipped with Lower Quadrant Signals - Detonators to be placed short of Outer signal.
- (c) In Multiple Aspect Signalling, where single Distant Signal is provided - Detonators to be placed short of Home signal.

Note:-The Fog Signal Posts will be provided only at stations where there may be a requirement for placing detonators. Such post may, therefore, be shifted suitably based on the above mentioned position(s).

(F) **Precautions by Loco Pilot:-**

The Loco Pilot shall take action in regard to speed of the train during fog as under:-

- (i) During fog when the Loco Pilot in his judgment feels that visibility is restricted due to fog, he shall run at a speed at which he can control the train so as to be prepared to stop short of any obstruction; this speed shall in any case not be more than 75 kmph.
- (ii) Loco Pilot to whistle frequently to warn the gateman (where provided) and road users of an approaching train at level crossings.
- (iii) In Absolute Block System the speed should not exceed 75 kmph as detailed at item (i) above.
- (iv) In Automatic Block Territory the speed will be subject to the judgement of the Loco Pilot as mentioned in item (i) above and shall not exceed as under:-

- (a) After passing Automatic stop signal at 'Green', the speed not to exceed 75 Kmph.
- (b) After passing an Automatic stop signal at 'Double Yellow', the speed not to exceed 30 Kmph.
- (c) After passing an Automatic stop signal at 'Yellow', the Loco Pilot to run at a further restricted speed so as to be prepared to stop at the next stop signal.

Note (i) In case fog safe device is not available in locomotives or the device fails enroute the maximum speed of 75 Kmph as indicated above shall be reduced to 60 kmph or less subject to judgement of Loco pilot.


Note (ii) As provided under GR 4.16 (1) (b) a red tail lamp of approved design displaying a flashing red light, during day or night, to indicate last vehicle check device in foggy weather should be provided and lit on the last vehicle.

Note (iii) First Stop Signal location kilometre chart of every station be provided to each Loco Pilot either as an easy to carry Card or in the Working Time Table.

Note (iv) Prevailing Fog situation should be advised to Crew & Guard in lobby during "Sign ON".

Zonal Railways are advised to incorporate these instructions in their Subsidiary Rules to relevant GRs and comply the same accordingly.

Further, Zonal Railways should ensure that the staff be advised and counseled regarding provisions in the G&SRs and these Instructions of the Board before the onset of fog. Each and every crew is to be imparted necessary training for upto two days about the systems of working of trains during fog. This process be completed by 1st December every year positively.


(Ashish Kumar)
Executive Director/Safety-II
Railway Board

New Delhi, dt. 25.10.2019

1. The Chief Commissioner of Railway Safety/Lucknow
2. The Chief Operations Managers, All Indian Railways
3. The Chief Safety Officers, All Indian Railways
4. The Director General, RDSO, Lucknow.
5. The Principal, Railway Staff College, Vadodara.
6. The Director, Indian Railways Institute of Transport Management, Manak Nagar, Lucknow.
7. The Principal, Indian Railways Institute of Civil Engineering, Pune.
8. The Principal, Indian Railways Institute of Mechanical and Electrical Engineering, Jamalpur.
9. The Principal, Indian Railways Institute of Signal, Engineering and Telecom, Secunderabad.
10. The Principals, Zonal Railway Training Institutes, Central Railway, Bhusawal, Eastern Railway, Bhuli, Northern Railway, Chandausi, North Eastern Railway, Muzaffarpur, Northeast Frontier Railway, Alipurduar, North Western Railway, Udaipur, Southern Railway, Tiruchirapalli, South Central Railway, Maula Ali, South Eastern Railway, Sini.
11. The General Secretary, NFIR, 3 Chelmsford Road, New Delhi.
12. The General Secretary, AIRF, 4 State Entry Road, New Delhi
13. The General Secretary, FROA, Room No.256-A, Rail Bhavan, New Delhi.
14. The General Secretary, IRPOF, Room No.268, Rail Bhavan, New Delhi.
15. The Indian Railways Conference Association, DRM's Building, Accounts Building, Chelmsford Road, New Delhi.

Ashish

(Ashish Kumar)
Executive Director/Safety-II
Railway Board

New Delhi, dt. 25.10.2019

AM/CE, AM/L, AM/Mech., AM/Signal and AM/Traffic.

8
Aphids

(Ashish Kumar)
Executive Director/Safety-II
Railway Board

9/c issued P.H.
Finalized.
29-10-19

Ministry of Education
1000 10th Avenue, NW
Ottawa, Ontario K1P 6L5
Canada
Tel: (613) 943-7500
Fax: (613) 943-7501

Q. 1