



ทำ SANDBLAST ทัวผิว ดำเนินการกับชิ้นงานต่างๆ ก่อนติด LINERS.

(Ra 1.6)

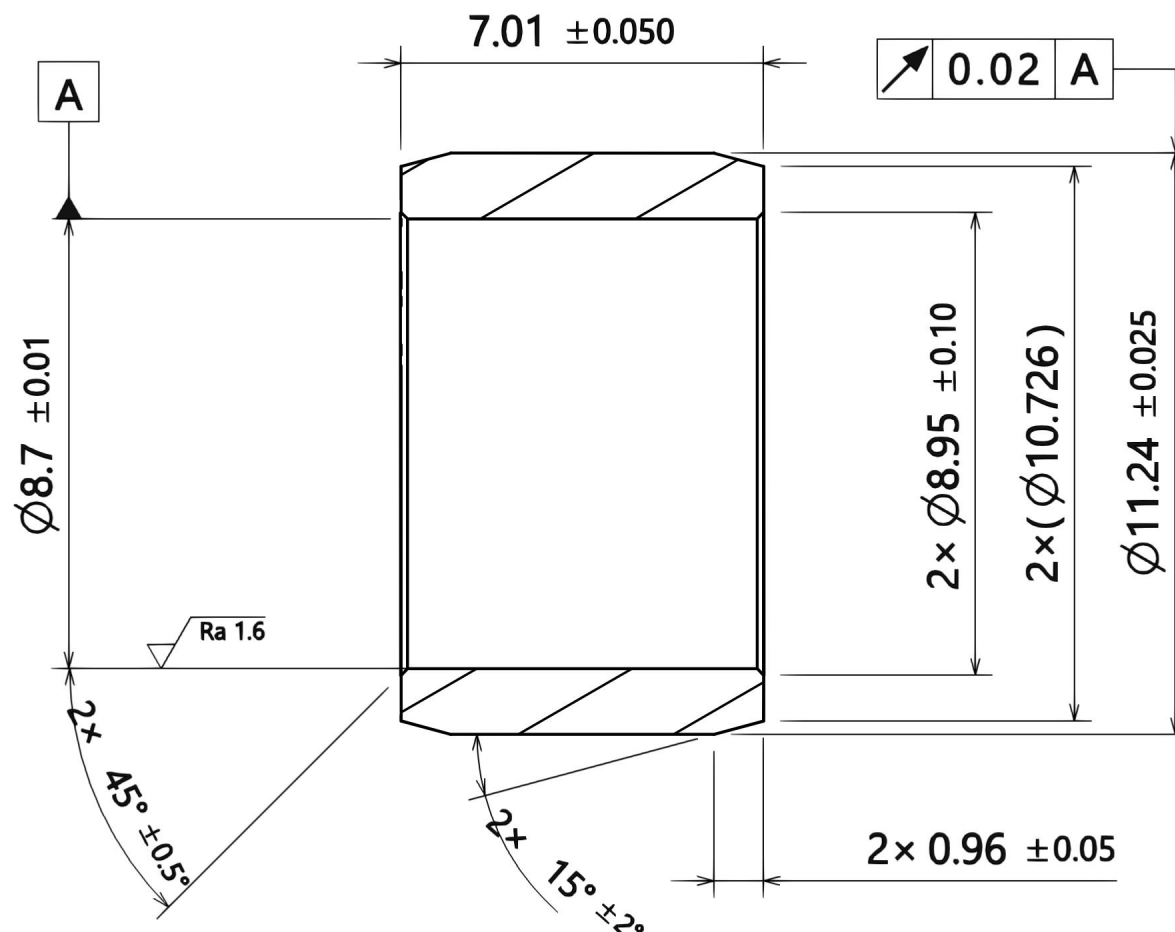

@LEFT SECTION

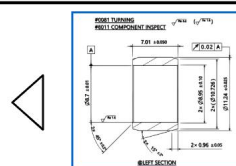


0081 1/1

APPROVED
TEERAPOL K.
2026/06/04

DRAWING NO.	REV.	SEQ. (PAGE)
C63-04165_DRS01	---	PA010 (1/4)


■ #2561 TRIM ■
• PER RE45002
REMOVE EXCESSIVE ADHESIVE AND LINER.
UNRAVELING AND FRAYING IS NOT PERMITTED OUTSIDE
THE SETBACK AREA. LINERS MAY BE RECESSED UP TO
THE MAX ALLOWED SETBACK DISTANCES OR ADHERED
TO THE METAL CHAMFERS.
LINERS OR LOOSE LINER MATERIAL SHALL NOT EXTEND
INTO THE METAL CHAMFER AREA UNLESS THAT LINER
MATERIAL IS ADHERED TO THE METAL CHAMFER.

ต้องกำจัดกาวและ LINER ในส่วนเกินออกให้หมด
ไม่อนุญาตให้มีการคลายตัว หรือการหลุดล่อนของวัสดุนอกพื้นที่ SETBACK
LINER อาจเว้นระยะได้สูงสุดตามที่กำหนด หรือติดเข้ากับรอยลบมุมโลหะก็ได้
LINER หรือ LINER ที่หลุดหลวม ห้ามยื่นเข้าไปในบริเวณรอยลบมุมโลหะ
ยกเว้น ในกรณีที่วัสดุนั้นถูกติดแน่นเข้ากับรอยลบมุมอย่างถูกต้อง

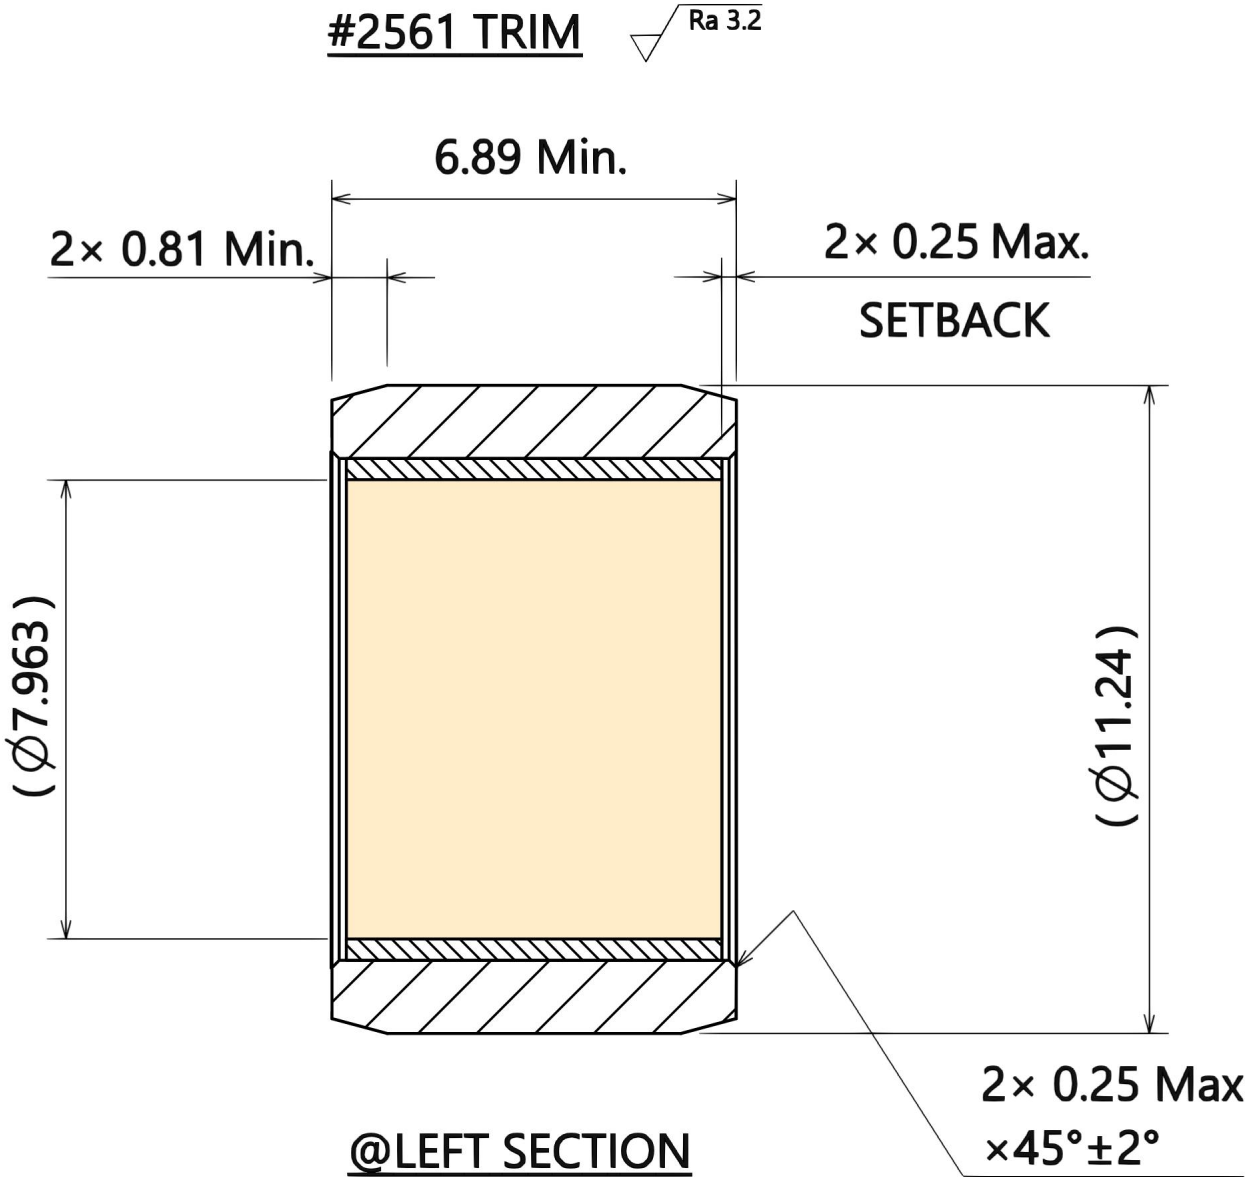

		REV. RECORD ---	NMB Flight Propulsion and Aerostructure Products B/U	
		DRAWN NANTHIWA K. 2026/06/04	PART NAME STRAIGHT SLEEVE	PRODUCT CLASS CODE A
		CHECKED THAPANON P. 2026/06/04	PART NO. 61TAHJ05C009-T	AUTHORITY DATA N/A
		APPROVED TEERAPOL K. 2026/06/04	DRAWING NO. C63-04165_DRS01	REV. --- SEQ. (PAGE) PA030 (3/4)

- #1011 OD GRIND■
- #3531 PASSIVATE■
 - Surface area = 3.4 cm²
- #8012 COMPONENT INSPECT (2) ■
 - PER RQ91222.
 - ตาม PD-DV-QC-750000.
- #8601 STOCK■

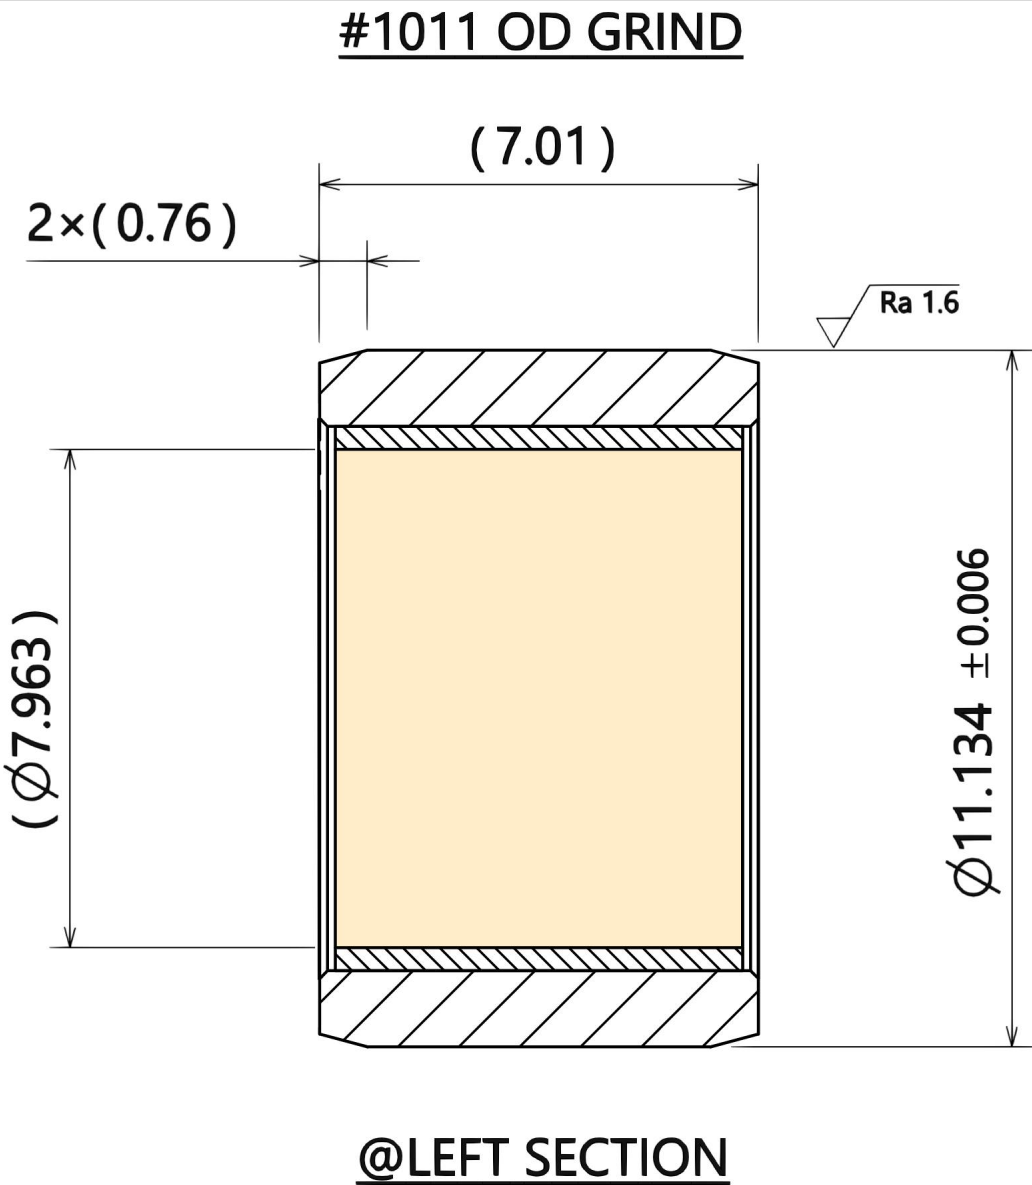

				REV. RECORD ---	NMB Flight Propulsion and Aerostructure Products B/U			
#1011.000 GRIND (7.01) 2±(0.76) Ø11.134 ±0.006 Ø11.134 ±0.								