Synthetic Villa

DB-V

Job number	SYN-001
Company profile	iec-default
Design rules	software defaults, not confirmed by the company's engineers

Company	Project	Job number	Board	Title of page	Rev.
	Synthetic Villa	SYN-001		**Title page**	
Date	Drawn	Checked	Review approved	Page	
				1 of 10	

Page	Title	Board
1	Title page	
3	Main power	DB-V
4	Distribution loads	DB-V
5	Design notes	DB-V
6	Layout	DB-V
7	Terminals	DB-V
8	Cable list	
9	Parts list	

Company	Project	Job number	Board	Title of page	Rev.
	Synthetic Villa	SYN-001		**Table of contents**	
Date	Drawn	Checked	Review approved	Page	
				2 of 10	

Company	Project	Job number	Board	Title of page	Rev.
	Synthetic Villa	SYN-001	DB-V	**Main power**	
Date	**Drawn**	**Checked**	**Review approved**	**Page**	
				3 of 10	

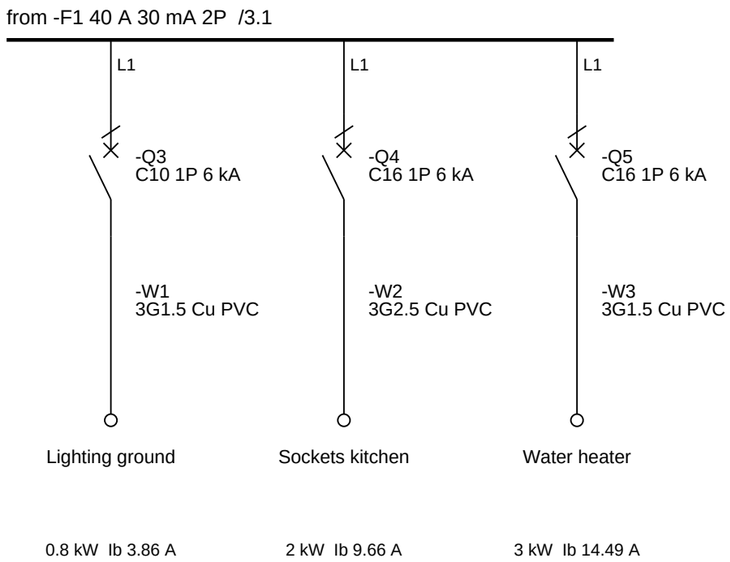

Company	Project	Job number	Board	Title of page	Rev.
	Synthetic Villa	SYN-001	DB-V	**Distribution loads**	
Date	Drawn	Checked	Review approved	Page	
				4 of 10	

No.	Note
1	Incomer raised to 63 A, 1.6 x the 32 A breaker after it, for discrimination.
2	Breakers are rated for at least 6 kA breaking capacity against 6 kA prospective at the board; each RCCB's conditional short-circuit current with the breaker ahead of it must reach it too.
3	Leave 1 spare outgoing ways (20 %).
4	Loads without a power factor were taken at cos phi 0.9.
5	Each breaker is rated at least 1.6 x the largest breaker after it, so they discriminate on overload. On short circuit, miniature breakers discriminate only up to the upstream breaker's instantaneous trip (about 5 x In for curve C); where total selectivity is required, confirm it from the manufacturer's selectivity tables.
6	1 circuit(s) have no cable length given; their voltage drop is not checked.
7	Each cable's withstand k^2S^2 is in the cable list; compare it with the selected breaker's let-through I^2t at 6 kA from its maker's curve (ABB handbook §2.4).
8	Cables sized for method B1, 30 °C, 1 grouped circuit(s), 70 °C insulation.
9	Circuit rules are this software's defaults, not confirmed by the company's engineers.
10	Enclosure: ABB Mini Center compact GDMS332 RX (2CVA250001P0001), 2 rows of 16 modules, H x W x D 498 x 400 x 117 mm, IP41, busbar 200/250 A, 35 kA; 24 modules are left for spare ways (ABB Distribution Boards catalogue (1SKC802027C0201), Mini Center compact, pp. 5, 7). The outgoing terminal strip is not counted.

Company	Project	Job number	Board	Title of page	Rev.
	Synthetic Villa	SYN-001	DB-V	**Design notes**	
Date	**Drawn**	**Checked**	**Review approved**	**Page**	
				5 of 10	

Incomer: 35 mm of rail

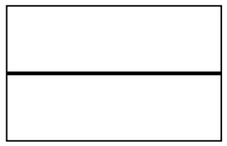

Residual current group: 105 mm of rail

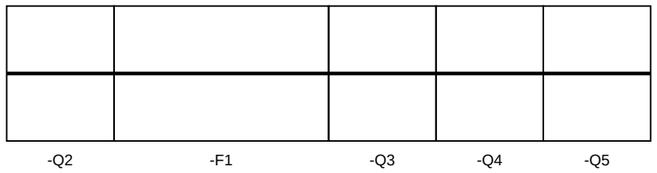

Terminals: 0 mm of rail; 9 without a width

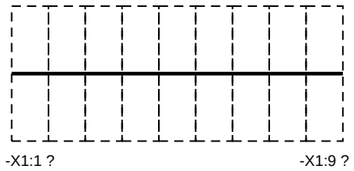

Dashed: no width is given for the device's kind (rail_widths_mm in the company settings).

Company	Project	Job number	Board	Title of page	Rev.
	Synthetic Villa	SYN-001	DB-V	**Layout**	
Date	**Drawn**	**Checked**	**Review approved**	**Page**	
				6 of 10	

Terminal	Conductor	Circuit	Cable	mm²	Article
-X1:1	L1	Lighting ground	-W1	1.5	8WH1000-0AF00
-X1:2	N	Lighting ground	-W1	1.5	8WH1000-0AF00
-X1:3	PE	Lighting ground	-W1	1.5	8WH1000-0CF07
-X1:4	L1	Sockets kitchen	-W2	2.5	8WH1000-0AF00
-X1:5	N	Sockets kitchen	-W2	2.5	8WH1000-0AF00
-X1:6	PE	Sockets kitchen	-W2	2.5	8WH1000-0CF07
-X1:7	L1	Water heater	-W3	1.5	8WH1000-0AF00
-X1:8	N	Water heater	-W3	1.5	8WH1000-0AF00
-X1:9	PE	Water heater	-W3	1.5	8WH1000-0CF07

Company	Project	Job number	Board	Title of page	Rev.
	Synthetic Villa	SYN-001	DB-V	**Terminals**	
Date	Drawn	Checked	Review approved	Page	
				7 of 10	

Cable	From	To	Type	Length
DB-V -W1	DB-V -Q3	Lighting ground	3G1.5 Cu PVC	15 m
DB-V -W2	DB-V -Q4	Sockets kitchen	3G2.5 Cu PVC	12 m
DB-V -W3	DB-V -Q5	Water heater	3G1.5 Cu PVC	

Company	Project	Job number	Board	Title of page	Rev.
	Synthetic Villa	SYN-001		**Cable list**	
Date	Drawn	Checked	Review approved	Page	
				8 of 10	

Qty	Description	Article	Order number	Devices
1	Circuit-breaker C63 2P 6 kA	not selected		-Q1
1	Circuit-breaker C32 1P 6 kA	not selected		-Q2
1	Residual current circuit-breaker 40 A 30 mA 2P	not selected		-F1
1	Circuit-breaker C10 1P 6 kA	not selected		-Q3
2	Circuit-breaker C16 1P 6 kA	not selected		-Q4, -Q5
6	Terminal 8WH1	Siemens 8WH1000-0AF00	8WH1000-0AF00	DB-V -X1
3	PE terminal 8WH1	Siemens 8WH1000-0CF07	8WH1000-0CF07	DB-V -X1

Company	Project	Job number	Board	Title of page	Rev.
	Synthetic Villa	SYN-001		**Parts list**	
Date	Drawn	Checked	Review approved	Page	
				9 of 10	

Findings (0 blocking, 26 warning, 6 info), page 1 of 1 — sheet 10 of 10

[WARNING] DB-V: Loads without a power factor were taken at cos phi 0.9. (default_power_factor; source: policy; engineering confirmation required)
[WARNING] DB-V: 1 circuit(s) have no cable length given; their voltage drop is not checked. (voltage_drop_unchecked; source: policy; engineering confirmation required)
[WARNING] DB-V: Each cable's withstand k²S² is in the cable list; compare it with the selected breaker's let-through I²t at 6 kA from its maker's curve (ABB handbook §2.4). (short_circuit_withstand; source: policy; engineering confirmation required)
[WARNING] DB-V: Circuit rules are this software's defaults, not confirmed by the company's engineers. (rules_unconfirmed; source: policy; engineering confirmation required)
[WARNING] : uses pattern tenant/synth-pe-n-distribution/…, which no qualified engineer has reviewed; it may not be executed (pattern_unreviewed; source: integrity; engineering confirmation required)
[WARNING] DB-V: uses template global/legacy-circuit_breaker/v1, which no qualified engineer has reviewed; it may not be executed (template_unreviewed; source: integrity; engineering confirmation required)
[WARNING] DB-V: uses template global/legacy-circuit_breaker/v1, which no qualified engineer has reviewed; it may not be executed (template_unreviewed; source: integrity; engineering confirmation required)
[WARNING] DB-V: uses template global/legacy-circuit_breaker/v1, which no qualified engineer has reviewed; it may not be executed (template_unreviewed; source: integrity; engineering confirmation required)
[WARNING] DB-V: uses template global/legacy-residual_current_…, which no qualified engineer has reviewed; it may not be executed (template_unreviewed; source: integrity; engineering confirmation required)
[WARNING] DB-V: uses template global/legacy-circuit_breaker/v1, which no qualified engineer has reviewed; it may not be executed (template_unreviewed; source: integrity; engineering confirmation required)
[WARNING] DB-V: uses template global/legacy-circuit_breaker/v1, which no qualified engineer has reviewed; it may not be executed (template_unreviewed; source: integrity; engineering confirmation required)
[WARNING] DB-V: uses template tenant/synth-dist-bar-3way/v1, which no qualified engineer has reviewed; it may not be executed (template_unreviewed; source: integrity; engineering confirmation required)
[WARNING] DB-V: uses template tenant/synth-dist-bar-3way/v1, which no qualified engineer has reviewed; it may not be executed (template_unreviewed; source: integrity; engineering confirmation required)
[WARNING] DB-V: uses template tenant/synth-strip-pen-2level/v1, which no qualified engineer has reviewed; it may not be executed (template_unreviewed; source: integrity; engineering confirmation required)
[WARNING] DB-V: terminal F of component k-7747a191058bb950aee299ef is in no net and its template does not say whether it must be connected; unresolved (terminal_requiredness_unresolved; source: integrity; engineering confirmation required)
[WARNING] DB-V: terminal F of component k-8788af5120e774e426b7c36a is in no net and its template does not say whether it must be connected; unresolved (terminal_requiredness_unresolved; source: integrity; engineering confirmation required)
[WARNING] DB-V: wire w-7a62bb919bb2da2ffd501f41's colour is an assumption (a-75adfff7a8a9439e00df4ad6); confirm it (wire_attribute_assumed; source: integrity; engineering confirmation required)
[WARNING] DB-V: wire w-98ec805f97a0d5d6d6e9b8e1 has no colour; no rule sets it yet (wire_attribute_unset; source: integrity; engineering confirmation required)
[WARNING] DB-V: wire w-b37b5548f57074883c15036f has no colour; no rule sets it yet (wire_attribute_unset; source: integrity; engineering confirmation required)
[WARNING] DB-V: wire w-b5f4095c51b3ff391915bdfe has no colour; no rule sets it yet (wire_attribute_unset; source: integrity; engineering confirmation required)
[WARNING] DB-V: wire w-7a62bb919bb2da2ffd501f41 has no cross_section_mm2; no rule sets it yet (wire_attribute_unset; source: integrity; engineering confirmation required)
[WARNING] DB-V: wire w-98ec805f97a0d5d6d6e9b8e1 has no cross_section_mm2; no rule sets it yet (wire_attribute_unset; source: integrity; engineering confirmation required)
[WARNING] DB-V: wire w-b37b5548f57074883c15036f has no cross_section_mm2; no rule sets it yet (wire_attribute_unset; source: integrity; engineering confirmation required)
[WARNING] DB-V: wire w-98ec805f97a0d5d6d6e9b8e1 has no cross_section_mm2; no rule sets it yet (wire_attribute_unset; source: integrity; engineering confirmation required)
[WARNING] DB-V: wire w-b37b5548f57074883c15036f has no cross_section_mm2; no rule sets it yet (wire_attribute_unset; source: integrity; engineering confirmation required)
[WARNING] DB-V: wire w-b5f4095c51b3ff391915bdfe has no cross_section_mm2; no rule sets it yet (wire_attribute_unset; source: integrity; engineering confirmation required)
[WARNING] DB-V: wire w-7a62bb919bb2da2ffd501f41 has no number; no rule sets it yet (wire_attribute_unset; source: integrity; engineering confirmation required)
[WARNING] DB-V: wire w-b5f4095c51b3ff391915bdfe has no number; no rule sets it yet (wire_attribute_unset; source: integrity; engineering confirmation required)
[INFO] DB-V: Incomer raised to 63 A, 1.6 x the 32 A breaker after it, for discrimination. (discrimination_incomer_raised; source: policy)
[INFO] DB-V: Breakers are rated for at least 6 kA breaking capacity against 6 kA prospective at the board; each RCCB's conditional short-circuit current with the breaker ahead of it must reach it too. (breaking_capacity; source: policy)
[INFO] DB-V: Leave 1 spare outgoing ways (20 %). (spare_ways; source: policy)
[INFO] DB-V: Each breaker is rated at least 1.6 x the largest breaker after it, so they discriminate on overload. On short circuit, miniature breakers discriminate only up to the upstream breaker's instantaneous trip (about 5 x In for curve C); where total selectivity is required, confirm it from the manufacturer's selectivity tables. (discrimination; source: policy)
[INFO] DB-V: Cables sized for method B1, 30 °C, 1 grouped circuit(s), 70 °C insulation. (cable_conditions; source: policy)
[INFO] DB-V: Enclosure: ABB Mini Center compact GDMS332 RX (2CVA250001P0001), 2 rows of 16 modules, H x W x D 498 x 400 x 117 mm, IP41, busbar 200/250 A, 35 kA; 24 modules are left for spare ways (ABB Distribution Boards catalogue (1SKC802027C0201), Mini Center compact, pp. 5, 7). The outgoing terminal strip is not counted. (enclosure_selected; source: policy)