



**CONDITION BASED ASSESSMENT
FULL SCANNING REPORT
SBUM DIAGNOSTIC PAHANG
TNB BAHAGIAN PEMBAHAGIAN PAHANG**

FUNCTIONAL LOCATION (ERMS)	:	CRAU/PCE/J00098
FUNCTIONAL LOCATION (SITE)	:	CRAU/PCE/J00098
SUBSTATION NAME (ERMS)	:	BATU 3
SUBSTATION NAME (SITE)	:	BATU 3
COORDINATE	:	3.826043, 101.839191
SUBSTATION TYPE	:	PCE
AREA	:	RAUB
STATE	:	PAHANG
PO	:	42225439
DATE	:	06 MAR 2026

SCANNED BY	:	
THERMOGRAPHY	:	MUHAMMAD ADAM BIN SAFARUDDIN (2017MY34N004)

EQUIPMENT/TOOLS	:	
THERMOGRAPHY	:	FLIR T640 (SN 55912229) (CALIBRATION DUE DATE: 26 DEC 2026)

PREPARED BY	:	
NAME OF CONTRACTOR	:	EET ENGINEERING SERVICES SDN BHD
ADDRESS	:	NO.38, JALAN SS19/1D,
	:	47500, SUBANG JAYA, SELANGOR.

SUBSTATION SIGNBOARD



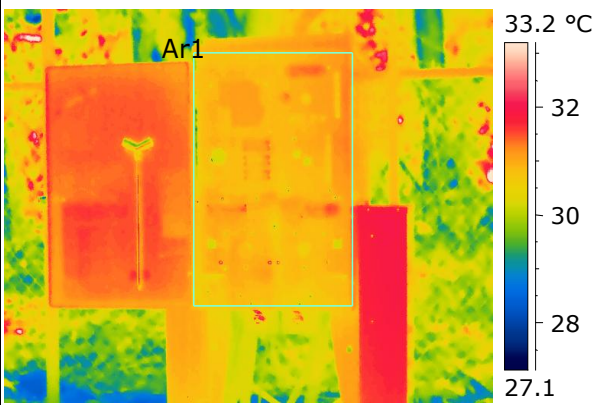
EXECUTIVE SUMMARY

NO.	EQUIPMENT	DEFECT AREA	IR (Abs T/ΔT)	DEFECT
1.	RMU SF6, SSE LUCY	OVERVIEW	-	-
		OVERVIEW BOTTOM	-	-
	PANEL CRB00346 TAMAN AMALINA PERDANA	CABLE COMPARTMENT	-	
		CABLE ENTRY	-	
	PANEL CRB00345 TX 300kVA	CABLE COMPARTMENT	-	
		CABLE ENTRY	-	
	PANEL CRB00702 SSU MUTIARA	CABLE COMPARTMENT	-	
		CABLE ENTRY	-	
2.	TX1 - MTM 300kVA	OVERVIEW	-	-
		OVERVIEW TOP	-	-
		CONSERVATOR TANK	-	
		HV BUSHING	-	
		HV CABLES	-	
		LV BUSHING	-	
		LV CABLES	-	
3.	FP TX1	OVERVIEW	-	-
	OUTGOING F3	INCOMING FUSE CONNECTION/ RED PHASE	93.6 °C	
	OUTGOING F3	OUTGOING FUSE CONNECTION/ YELLOW PHASE	110.6 °C	
	OUTGOING F3	INCOMING FUSE CONNECTION/ BLUE PHASE	64.8 °C	

VISUAL DEFECT SUMMARY

NO.	EQUIPMENT	DEFECT DESCRIPTION	ADDITIONAL REMARKS
1	SUBSTATION	CPR POSTER OLD VERSION	SWG BAY
2	SUBSTATION	ROOF BROKEN	SWG BAY
3	LIGHTING	NOT OPERATED	SWG BAY
4	LTX/DTX	NO CABLE SUPPORT	TX1 - HV SIDE
5	LTX/DTX	CABLE SUPPORT IN POOR CONDITION	TX1 - LV SIDE
6	FP/LVDB	INFO PLATE POOR CONDITION	FP TX1
7	FP/LVDB	NO FEEDER NO./FEEDER NAME	FP TX1 - NOT FOLLOW NEW STANDARD
8	CABLE PILC	CABLE PILC LVDB/FP	FP TX1 / OUTGOING F1

	Substation	BATU 3			Date: 06/03/2026
	Equipment	RMU SF6	Manufacturer	SSE LUCY	Time: 11:16 AM
	Model	VRN2A	Rating	12kV	Humidity: 71%
	Area	OVERVIEW		Panel No.	-
Panel Name	-				

IR IMAGE		VISUAL IMAGE	
			
PARAMETER	VALUE	PARAMETER	VALUE
Spot Temp.1 (Sp1)	-	Serial No.	SFS0003002
Spot Temp. 2 (Sp2)	-	Heater (A)	-
Average Temp. (Ar1)	30.9 °C	CB Position	-
Ambient Temp.	31.7 °C	Busbar Position	-
Delta T (Δ T)	-	Cable Type	-
Load (A)	-		
Defect	-		

Analysis & Recommendations:

Analysis: No Anomaly.

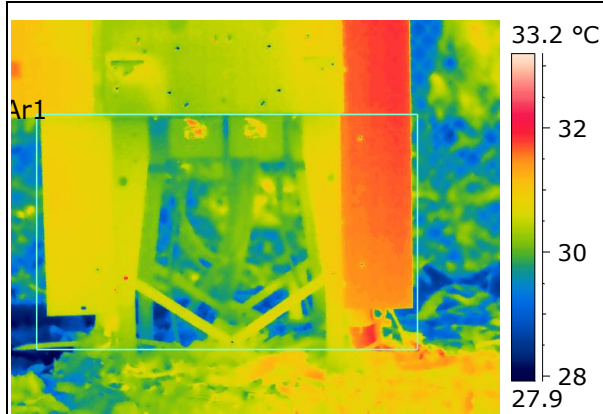
Recommendation: -

	Substation	BATU 3			Date: 06/03/2026
	Equipment	RMU SF6	Manufacturer	SSE LUCY	Time: 11:16 AM
	Model	VRN2A	Rating	12kV	Humidity: 71%
	Area	OVERVIEW BOTTOM		Panel No.	-
Panel Name	-				

Substation	BATU 3			Date: 06/03/2026
Equipment	RMU SF6	Manufacturer	SSE LUCY	Time: 11:16 AM
Model	VRN2A	Rating	12kV	Humidity: 71%
Area	OVERVIEW BOTTOM		Panel No.	-

Panel Name

IR IMAGE



PARAMETER	VALUE
Spot Temp.1 (Sp1)	-
Spot Temp. 2 (Sp2)	-
Average Temp. (Ar1)	30.5 °C
Ambient Temp.	31.7 °C
Delta T (ΔT)	-
Load (A)	-
Defect	-

Analysis & Recommendations:

Recommendation: -

	Substation	BATU 3			Date: 06/03/2026
	Equipment	RMU SF6	Manufacturer	SSE LUCY	Time: 11:16 AM
	Model	VRN2A	Rating	12kV	Humidity: 71%
	Area	CABLE COMPARTMENT		Panel No.	CRB00346
Panel Name	TAMAN AMALINA PERDANA				

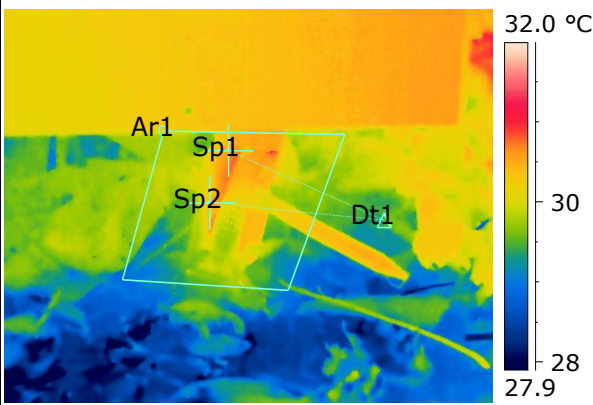
IR IMAGE		VISUAL IMAGE	
PARAMETER	VALUE	PARAMETER	VALUE
Spot Temp.1 (Sp1)	30.7 °C	Serial No.	SFS0003002
Spot Temp. 2 (Sp2)	30.8 °C	Heater (A)	-
Average Temp. (Ar1)	30.7 °C	CB Position	CLOSE
Ambient Temp.	31.7 °C	Busbar Position	-
Delta T (Δ T)	0.1 °C	Cable Type	XLPE
Load (A)	-		
Defect			

Analysis & Recommendations:

Analysis: No Anomaly.

Recommendation: -

	Substation	BATU 3			Date: 06/03/2026
	Equipment	RMU SF6	Manufacturer	SSE LUCY	Time: 11:16 AM
	Model	VRN2A	Rating	12kV	Humidity: 71%
	Area	CABLE ENTRY		Panel No.	CRB00346
Panel Name	TAMAN AMALINA PERDANA				

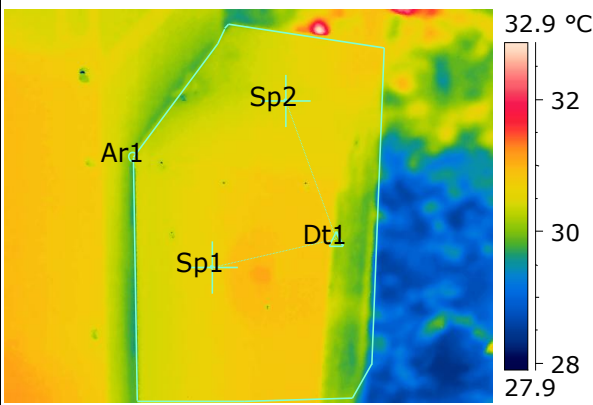
IR IMAGE		VISUAL IMAGE	
			
PARAMETER	VALUE	PARAMETER	VALUE
Spot Temp.1 (Sp1)	30.6 °C	Serial No.	SFS0003002
Spot Temp. 2 (Sp2)	30.4 °C	Heater (A)	-
Average Temp. (Ar1)	29.9 °C	CB Position	CLOSE
Ambient Temp.	31.7 °C	Busbar Position	-
Delta T (Δ T)	0.1 °C	Cable Type	XLPE
Load (A)	-		
Defect			

Analysis & Recommendations:

Analysis: No Anomaly.

Recommendation: -

	Substation	BATU 3			Date: 06/03/2026
	Equipment	RMU SF6	Manufacturer	SSE LUCY	Time: 11:16 AM
	Model	VRN2A	Rating	12kV	Humidity: 71%
	Area	CABLE COMPARTMENT		Panel No.	CRB00345
Panel Name		TX 300kVA			

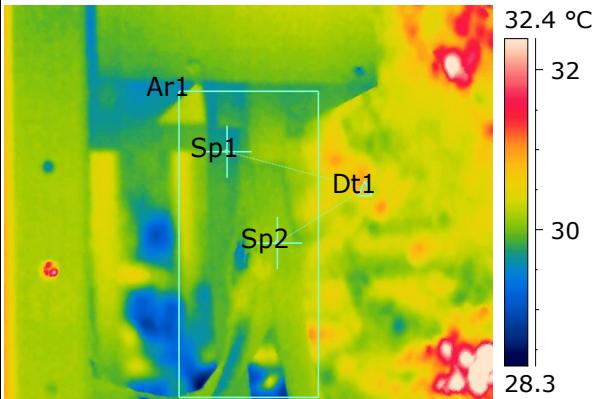
IR IMAGE		VISUAL IMAGE	
			
PARAMETER	VALUE	PARAMETER	VALUE
Spot Temp.1 (Sp1)	30.7 °C	Serial No.	SFS0003002
Spot Temp. 2 (Sp2)	30.5 °C	Heater (A)	-
Average Temp. (Ar1)	30.5 °C	CB Position	CLOSE
Ambient Temp.	31.7 °C	Busbar Position	-
Delta T (Δ T)	0.1 °C	Cable Type	XLPE
Load (A)	-		
Defect			

Analysis & Recommendations:

Analysis: No Anomaly.

Recommendation: -

	Substation	BATU 3			Date: 06/03/2026
	Equipment	RMU SF6	Manufacturer	SSE LUCY	Time: 11:16 AM
	Model	VRN2A	Rating	12kV	Humidity: 71%
	Area	CABLE ENTRY		Panel No.	CRB00345
Panel Name	TX 300kVA				

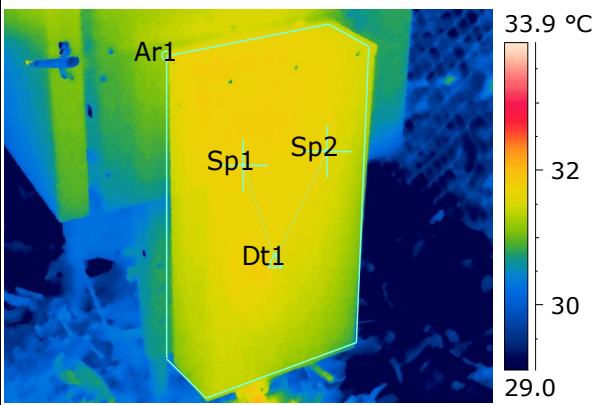
IR IMAGE		VISUAL IMAGE	
			
PARAMETER	VALUE	PARAMETER	VALUE
Spot Temp.1 (Sp1)	29.7 °C	Serial No.	SFS0003002
Spot Temp. 2 (Sp2)	30.2 °C	Heater (A)	-
Average Temp. (Ar1)	30.0 °C	CB Position	CLOSE
Ambient Temp.	31.7 °C	Busbar Position	-
Delta T (Δ T)	0.4 °C	Cable Type	XLPE
Load (A)	-		
Defect			

Analysis & Recommendations:

Analysis: No Anomaly.

Recommendation: -

	Substation	BATU 3			Date: 06/03/2026
	Equipment	RMU SF6	Manufacturer	SSE LUCY	Time: 11:16 AM
	Model	VRN2A	Rating	12kV	Humidity: 71%
	Area	CABLE COMPARTMENT		Panel No.	CRB00702
Panel Name	SSU MUTIARA				

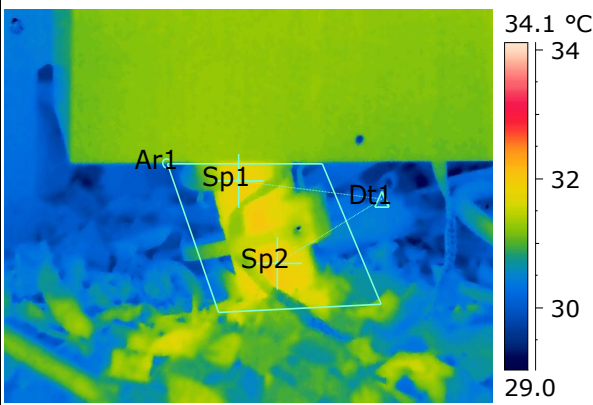
IR IMAGE		VISUAL IMAGE	
			
PARAMETER	VALUE	PARAMETER	VALUE
Spot Temp.1 (Sp1)	31.8 °C	Serial No.	SFS0003002
Spot Temp. 2 (Sp2)	31.6 °C	Heater (A)	-
Average Temp. (Ar1)	31.5 °C	CB Position	CLOSE
Ambient Temp.	31.7 °C	Busbar Position	-
Delta T (Δ T)	0.2 °C	Cable Type	XLPE
Load (A)	-		
Defect			

Analysis & Recommendations:

Analysis: No Anomaly.

Recommendation: -

	Substation	BATU 3			Date: 06/03/2026
	Equipment	RMU SF6	Manufacturer	SSE LUCY	Time: 11:16 AM
	Model	VRN2A	Rating	12kV	Humidity: 71%
	Area	CABLE ENTRY		Panel No.	CRB00702
Panel Name	SSU MUTIARA				

IR IMAGE		VISUAL IMAGE	
			
PARAMETER	VALUE	PARAMETER	VALUE
Spot Temp.1 (Sp1)	31.9 °C	Serial No.	SFS0003002
Spot Temp. 2 (Sp2)	31.9 °C	Heater (A)	-
Average Temp. (Ar1)	31.1 °C	CB Position	CLOSE
Ambient Temp.	31.7 °C	Busbar Position	-
Delta T (ΔT)	0.1 °C	Cable Type	XLPE
Load (A)	-		
Defect			

Analysis & Recommendations:

Analysis: No Anomaly.

Recommendation: -

	Substation	BATU 3			Date: 06/03/2026
	Equipment	TRANSFORMER	Manufacturer	MTM	Time: 11:16 AM
	Model	CONSERVATOR TANK	Rating	300kVA	Humidity: 71%
	Area	OVERVIEW		Tx No.	TX1
Location	-				

IR IMAGE

An infrared (IR) thermal image of a transformer conservator tank. The image displays a color-coded temperature distribution. A color scale on the right indicates temperatures ranging from 29.4 °C (blue) to 40.2 °C (red). Four specific points are labeled: Ar1 (Average Temp.), Sp1 (Spot Temp. 1), Sp2 (Spot Temp. 2), and Dt1 (Delta T). The tank is surrounded by a fence and vegetation.

VISUAL IMAGE

A visual photograph of the transformer conservator tank, showing its green metal structure and surrounding environment. The tank is located outdoors, with a chain-link fence and trees visible in the background.

PARAMETER	VALUE
Spot Temp.1 (Sp1)	38.8 °C
Spot Temp. 2 (Sp2)	36.3 °C
Average Temp. (Ar1)	36.2 °C
Ambient Temp.	31.7 °C
Delta T (ΔT)	2.5 °C
Load (A)	-
Defect	-

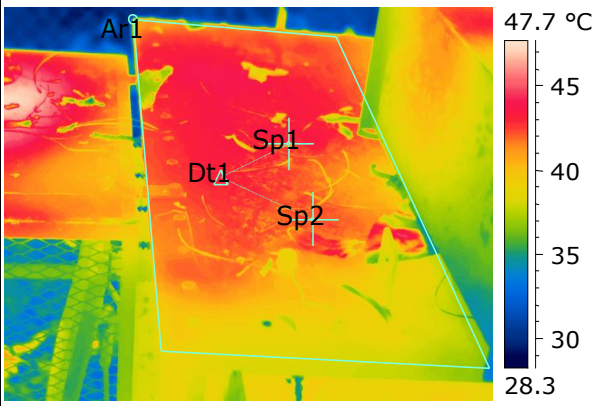
PARAMETER	VALUE
Serial No.	T/66/3107
Heater (A)	-
CB Position	-
Busbar Position	-
Cable Type	-

Analysis & Recommendations:

Analysis: No Anomaly.

Recommendation: -

	Substation	BATU 3			Date: 06/03/2026
	Equipment	TRANSFORMER	Manufacturer	MTM	Time: 11:16 AM
	Model	CONSERVATOR TANK	Rating	300kVA	Humidity: 71%
	Area	OVERVIEW TOP		Tx No.	TX1
Location	-				

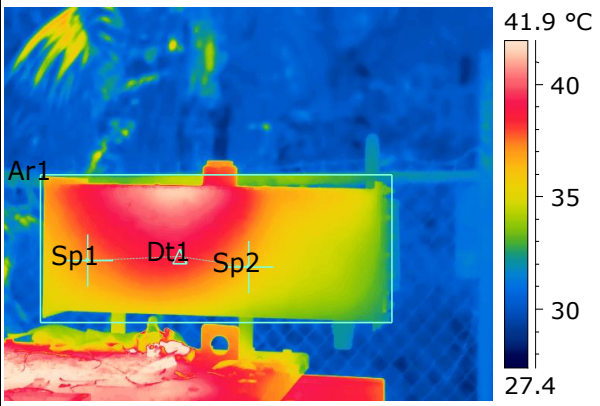
IR IMAGE		VISUAL IMAGE	
			
PARAMETER	VALUE	PARAMETER	VALUE
Spot Temp.1 (Sp1)	42.1 °C	Serial No.	T/66/3107
Spot Temp. 2 (Sp2)	42.1 °C	Heater (A)	-
Average Temp. (Ar1)	40.9 °C	CB Position	-
Ambient Temp.	31.7 °C	Busbar Position	-
Delta T (Δ T)	0.0 °C	Cable Type	-
Load (A)	-		
Defect	-		

Analysis & Recommendations:

Analysis: No Anomaly.

Recommendation: -

	Substation	BATU 3			Date: 06/03/2026
	Equipment	TRANSFORMER	Manufacturer	MTM	Time: 11:16 AM
	Model	CONSERVATOR TANK	Rating	300kVA	Humidity: 71%
	Area	CONSERVATOR TANK		Tx No.	TX1
Location	-				

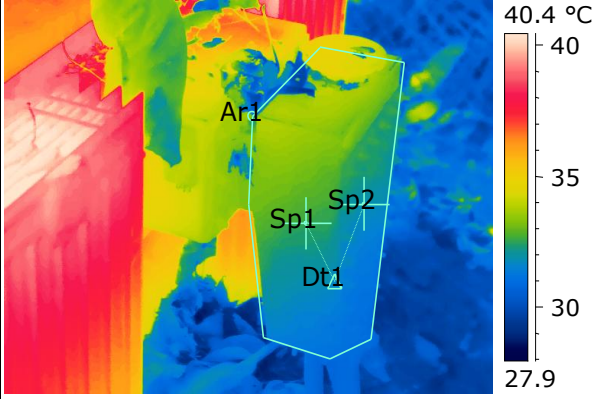
IR IMAGE		VISUAL IMAGE	
			
PARAMETER	VALUE	PARAMETER	VALUE
Spot Temp.1 (Sp1)	37.2 °C	Serial No.	T/66/3107
Spot Temp. 2 (Sp2)	36.3 °C	Heater (A)	-
Average Temp. (Ar1)	36.0 °C	CB Position	-
Ambient Temp.	31.7 °C	Busbar Position	-
Delta T (ΔT)	0.9 °C	Cable Type	-
Load (A)	-		
Defect	-		

Analysis & Recommendations:

Analysis: No Anomaly.

Recommendation: -

	Substation	BATU 3			Date: 06/03/2026
	Equipment	TRANSFORMER	Manufacturer	MTM	Time: 11:16 AM
	Model	CONSERVATOR TANK	Rating	300kVA	Humidity: 71%
	Area	BUSHING		Tx No.	TX1
Location	HV SIDE				

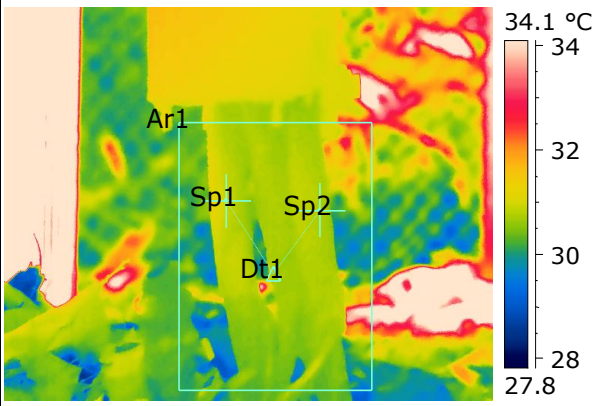
IR IMAGE		VISUAL IMAGE	
			
PARAMETER	VALUE	PARAMETER	VALUE
Spot Temp.1 (Sp1)	32.6 °C	Serial No.	T/66/3107
Spot Temp. 2 (Sp2)	31.8 °C	Heater (A)	-
Average Temp. (Ar1)	32.5 °C	CB Position	-
Ambient Temp.	31.7 °C	Busbar Position	-
Delta T (ΔT)	0.7 °C	Cable Type	XLPE
Load (A)	-		
Defect			

Analysis & Recommendations:

Analysis: No Anomaly.

Recommendation: -

	Substation	BATU 3			Date: 06/03/2026
	Equipment	TRANSFORMER	Manufacturer	MTM	Time: 11:16 AM
	Model	CONSERVATOR TANK	Rating	300kVA	Humidity: 71%
	Area	CABLE		Tx No.	TX1
Location	HV SIDE				

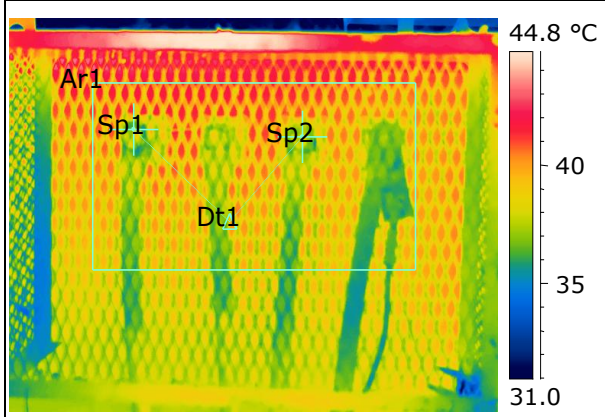
IR IMAGE		VISUAL IMAGE	
			
PARAMETER	VALUE	PARAMETER	VALUE
Spot Temp.1 (Sp1)	30.9 °C	Serial No.	T/66/3107
Spot Temp. 2 (Sp2)	30.7 °C	Heater (A)	-
Average Temp. (Ar1)	30.6 °C	CB Position	-
Ambient Temp.	31.7 °C	Busbar Position	-
Delta T (Δ T)	0.2 °C	Cable Type	XLPE
Load (A)	-		
Defect			

Analysis & Recommendations:

Analysis: No Anomaly.

Recommendation: -

	Substation	BATU 3			Date: 06/03/2026
	Equipment	TRANSFORMER	Manufacturer	MTM	Time: 11:16 AM
	Model	CONSERVATOR TANK	Rating	300kVA	Humidity: 71%
	Area	BUSHING		Tx No.	TX1
Location	LV SIDE				

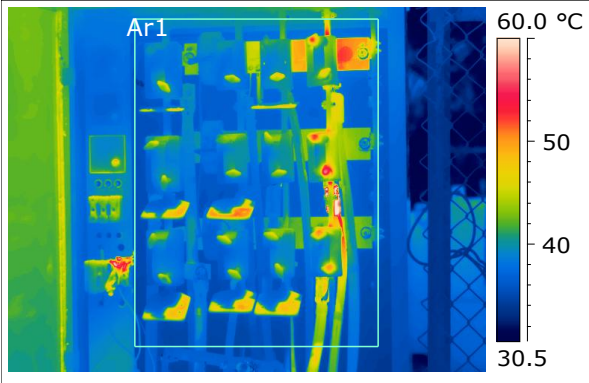
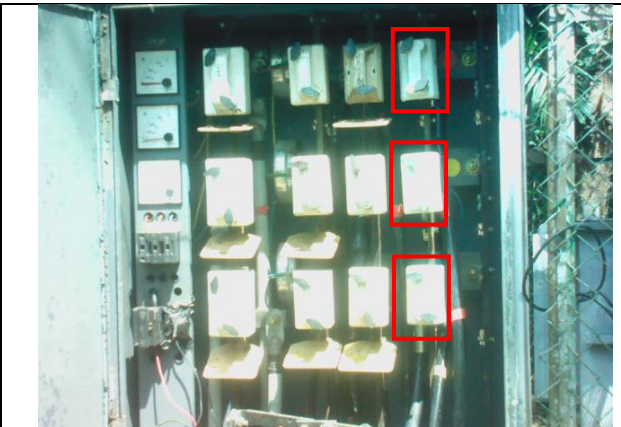
IR IMAGE		VISUAL IMAGE	
			
PARAMETER	VALUE	PARAMETER	VALUE
Spot Temp.1 (Sp1)	38.1 °C	Serial No.	T/66/3107
Spot Temp. 2 (Sp2)	38.6 °C	Heater (A)	-
Average Temp. (Ar1)	38.6 °C	CB Position	-
Ambient Temp.	31.7 °C	Busbar Position	-
Delta T (Δ T)	0.6 °C	Cable Type	XLPE
Load (A)	-		
Defect			

Analysis & Recommendations:

Analysis: No Anomaly.

Recommendation: -

	Substation	BATU 3			Date: 06/03/2026
	Equipment	FP TX1	Manufacturer	-	Time: 11:16 AM
	Model	J-SLOTTED	Rating	-	Humidity: 71%
	Area	OVERVIEW		Feeder No.	-
Feeder Name	-				

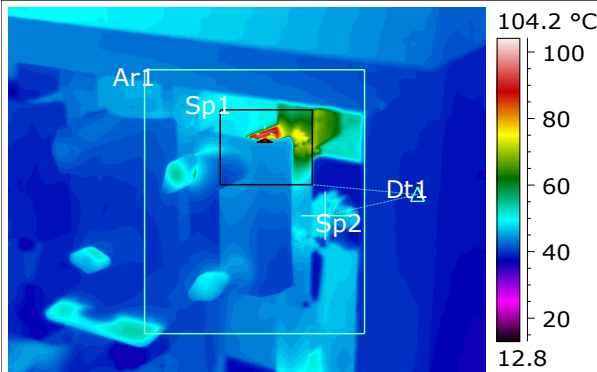
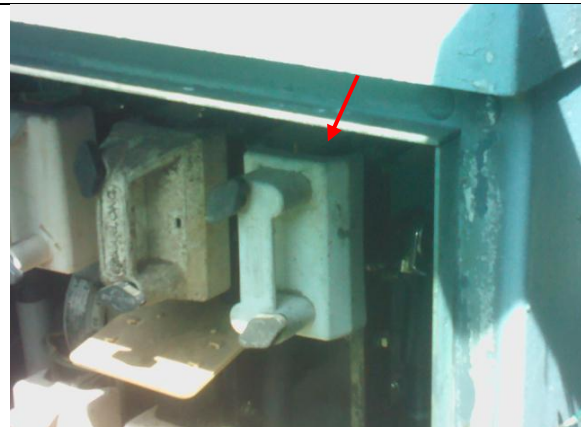
IR IMAGE		VISUAL IMAGE	
			
PARAMETER	VALUE	PARAMETER	VALUE
Spot Temp.1 (Sp1)	-	Serial No.	-
Spot Temp. 2 (Sp2)	-	Heater (A)	-
Average Temp. (Ar1)	39.2 °C	CB Position	-
Ambient Temp.	31.7 °C	Busbar Position	-
Delta T (ΔT)	-	Cable Type	-
Load (A)	-		
Severity	-		

Analysis & Recommendations:

Analysis: Please refer the following page for details defect.

Recommendation: N/A

	Substation	BATU 3			Date: 06/03/2026
	Equipment	FP TX1	Manufacturer	-	Time: 11:16 AM
	Model	J-SLOTTED	Rating	-	Humidity: 71%
	Area	FUSE CONNECTION – RED PHASE		Feeder No.	OUTGOING F3
Feeder Name	-				

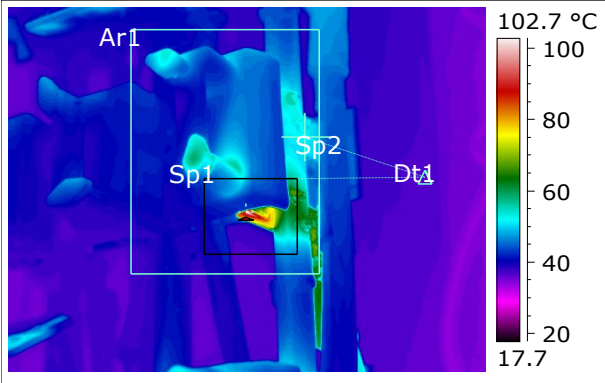
IR IMAGE		VISUAL IMAGE	
			
PARAMETER	VALUE	PARAMETER	VALUE
Spot Temp.1 (Sp1)	93.6 °C	Serial No.	-
Spot Temp. 2 (Sp2)	48.1 °C	Heater (A)	-
Average Temp. (Ar1)	45.0 °C	CB Position	-
Ambient Temp.	31.7 °C	Busbar Position	-
Delta T (ΔT)	45.5 °C	Cable Type	XLPE
Load (A)	-		
Severity			

Analysis & Recommendations:

Analysis: Thermal image above indicates hot spot detected at **INCOMING FUSE CONNECTION**. The anomaly is due to loosen or bad contact at the connection point.

Recommendation: To inspect, clean the contact surface and re-tighten the connection point. Replace defective parts if necessary.

	Substation	BATU 3			Date: 06/03/2026
	Equipment	FP TX1	Manufacturer	-	Time: 11:16 AM
	Model	J-SLOTTED	Rating	-	Humidity: 71%
	Area	FUSE CONNECTION – YELLOW PHASE		Feeder No.	OUTGOING F3
Feeder Name	-				

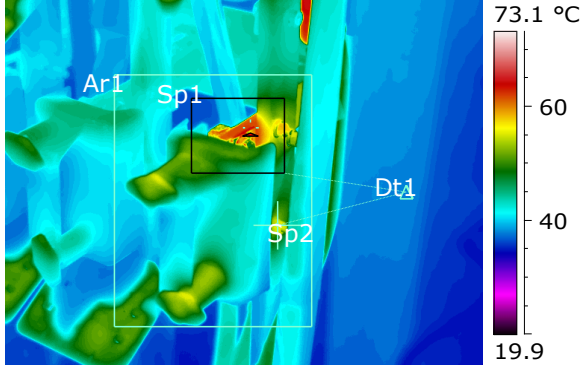
IR IMAGE		VISUAL IMAGE	
			
PARAMETER	VALUE	PARAMETER	VALUE
Spot Temp.1 (Sp1)	110.6 °C	Serial No.	-
Spot Temp. 2 (Sp2)	51.6 °C	Heater (A)	-
Average Temp. (Ar1)	44.8 °C	CB Position	-
Ambient Temp.	31.7 °C	Busbar Position	-
Delta T (Δ T)	59.0 °C	Cable Type	XLPE
Load (A)	-		
Severity			

Analysis & Recommendations:

Analysis: Thermal image above indicates hot spot detected at **OUTGOING FUSE CONNECTION**. The anomaly is due to loosen or bad contact at the connection point.

Recommendation: To inspect, clean the contact surface and re-tighten the connection point. Replace defective parts if necessary.

	Substation	BATU 3			Date: 06/03/2026
	Equipment	FP TX1	Manufacturer	-	Time: 11:16 AM
	Model	J-SLOTTED	Rating	-	Humidity: 71%
	Area	FUSE CONNECTION – BLUE PHASE		Feeder No.	OUTGOING F3
Feeder Name	-				

IR IMAGE		VISUAL IMAGE	
			
PARAMETER	VALUE	PARAMETER	VALUE
Spot Temp.1 (Sp1)	64.8 °C	Serial No.	-
Spot Temp. 2 (Sp2)	55.3 °C	Heater (A)	-
Average Temp. (Ar1)	44.1 °C	CB Position	-
Ambient Temp.	31.7 °C	Busbar Position	-
Delta T (ΔT)	9.5 °C	Cable Type	XLPE
Load (A)	-		
Severity			

Analysis & Recommendations:

Analysis: Thermal image above indicates hot spot detected at **INCOMING FUSE CONNECTION**. The anomaly is due to loosen or bad contact at the connection point.

Recommendation: To inspect, clean the contact surface and re-tighten the connection point. Replace defective parts if necessary.

SUBSTATION CONDITION

SUBSTATION OVERVIEW



SIGNBOARD



SWITCHGEAR



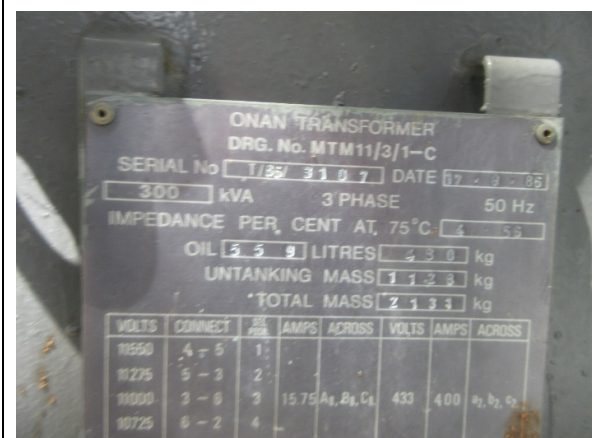
SWITCHGEAR NAMEPLATE



TRANSFORMER



TRANSFORMER NAMEPLATE



SUBSTATION CONDITION

FEEDER PILLAR



FEEDER PILLAR NAMEPLATE



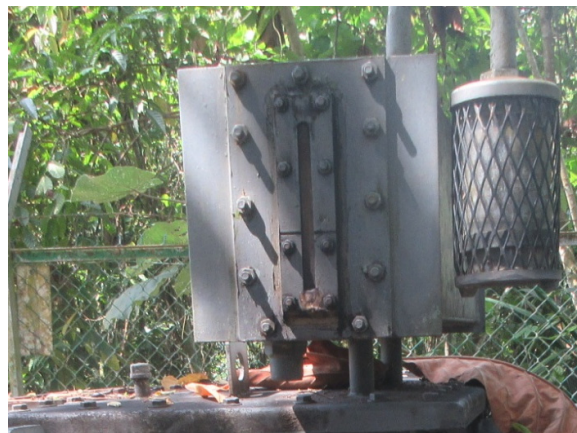
EFI



SF6 INDICATOR



TRANSFORMER OIL LEVEL INDICATOR



VISUAL DEFECT

SUBSTATION



CPR POSTER OLD VERSION – SWG BAY

SUBSTATION



ROOF BROKEN – SWG BAY

LIGHTING



NOT OPERATED – SWG BAY

LTX/DTX



NO CABLE SUPPORT – TX1 - HV SIDE

LTX/DTX



CABLE SUPPORT IN POOR CONDITION – TX1 - LV SIDE

FP/LVDB



INFO PLATE POOR CONDITION – FP TX1

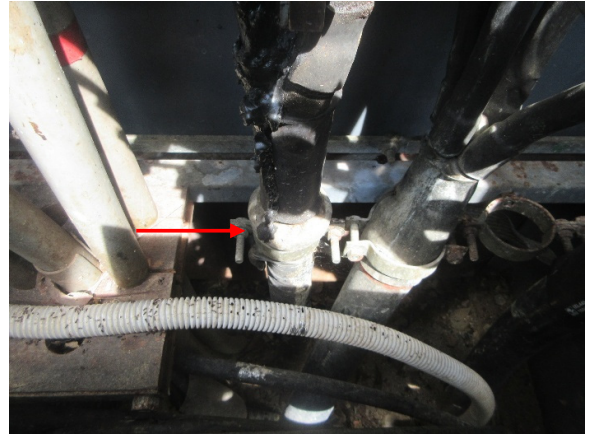
VISUAL DEFECT

FP/LVDB



NO FEEDER NO./FEEDER NAME – FP TX1 - NOT
FOLLOW NEW STANDARD

CABLE PILC



FP TX1 / OUTGOING F1

NORMAL/DEFECT STICKER

NORMAL STICKER

CONDITION ASSESSMENT

DIAGNOSTIC UNIT SUBSTATION

Cycle/Year : 1/2026

Testing Date : 06-03-2026

Defect : IR

Company/Team : EET ENGINEERING

TEV ☒

U/S ☒

IR ☒

DEFECT STICKER FP TX1

DEFECT NOTIFICATION

DIAGNOSTIC UNIT SUBSTATION

LVDB (FP) : FP TX1

Testing Date : 06-03-2026

Defect 1 (AT/Adh.T) : 93.2 °C

Location : 016 F3 R0

Defect 2 (AT/Adh.T) : 109 °C

Location : 016 F3 Y0

Defect 3 (AT/Adh.T) : 64.5 °C

Location : 016 F3 R0

Defect 4 (AT/Adh.T) : °C

Location : °C

Defect 5 (AT/Adh.T) : °C

Location : °C

Defect 6 (AT/Adh.T) : °C

Location : °C

Defect 7 (AT/Adh.T) : °C

Location : °C

Defect 8 (AT/Adh.T) : °C

Location : °C

Company/Team : EET

U/S FORCE

186

AIR

STATE / AREA:		PAHANG / PAU3		DISTRIBUTION SUBSTATION (PCT) CMA TEST SHEET										DATE: 6/3/2026		FUNCTIONAL LOCATION: CRAW / PCE / 30095																																							
PE NAME:		BATU 3		TIME IN / OUT: 11:16 A.M. / 11:33 A.M.										TEV BACK GROUND / HUMIDITY: 71		BACKGROUND TEMP: 31.7																																							
V.I REF. NO:																																																							
DETAIL														TEMPERATURE				ULTRASOUND				TEV		REMARK																															
NO.	FDR. NO	FEEDER NAME	STATUS (TRIP / CLOSE)	LOAD (A)	CABLE TYPE / SIZE	HEATER (A)	SERIAL NO (ONLY BREAKER & OLJ)	COMP	Tmin (°C)	Tmax (°C)	AT	Avg (°C)	FILE	REMARKS	dB	FILE	TYPE CHAR.	dB	PULSE / CYCLE	TYPE CHAR.	REMARK																																		
1	CRB 30346	TAMAN AMALINA PERDANA	TRIP / CLOSE		XLPE / PILC / N/A / NACE			CABLE	30.6	30.6	0.0	30.6	205		-6	-	-	4	0	-																																			
2	CRB 00345	TX 300 KVA	TRIP / CLOSE		XLPE / PILC / N/A / NACE			CABLE	30.7	30.8	0.1	30.7	207		-6	-	-	2	0	-																																			
3	CRB 00702	SSV MUTIARA	TRIP / CLOSE		XLPE / PILC / N/A / NACE			CABLE	31.3	31.6	0.3	31.4	209		-6	-	-	2	0	-																																			
4			TRIP / CLOSE		XLPE / PILC / N/A / NACE			CABLE																																															
OVERVIEW								CABLE				30.8	200																																										
LOCAL TRANSFORMER																																																							
DETAILS				THERMOGRAPHY				ULTRASOUND		DETAILS				THERMOGRAPHY				ULTRASOUND		REMARKS																																			
TX ID	SERIAL NO	CABLE TYPE / SIZE	REMARK	COMP.	Tmin (°C)	Tmax (°C)	AT	Avg (°C)	FILE	dB	TYPE CHAR.	TX ID	SERIAL NO	CABLE TYPE / SIZE	COMP.	Tmin (°C)	Tmax (°C)	AT	Avg (°C)	FILE	dB	TYPE CHAR.	REMARKS																																
TX1	T/66/3107	HT CABLE		HT CABLE	30.4	30.6	0.2	30.5	217	-6	-	TX3		HT CABLE																																									
		HT BUSHING		HT BUSHING	35.8	36.3	0.5	35.9	216	-6																																													
		LV CABLE		LV CABLE	37.2	37.6	0.4	37.5	215																																														
		LV BUSHING		LV BUSHING	37.9	38.2	0.3	38.0	214																																														
TX2		HT CABLE		HT CABLE	33.5	34.5	6.0	36.5	212			TX4		HT CABLE																																									
		HT BUSHING		HT BUSHING																																																			
		LV CABLE		LV CABLE																																																			
		LV BUSHING		LV BUSHING																																																			
LV DISTRIBUTION BOARD / FEEDER PELLAS / OTHERS																																																							
LVDB / PP				INC. 1				INC. 2				INC. 3				F1				F2				F3				F4				F5				F6				F7				F8				F9				F10			
CABLE TYPE / SIZE				XLPE / PILC				XLPE / PILC				XLPE / PILC				XLPE / PILC				XLPE / PILC				XLPE / PILC				XLPE / PILC				XLPE / PILC				XLPE / PILC				XLPE / PILC				XLPE / PILC											
LVDB / PP 2				INC. 1				INC. 2				INC. 3				F1				F2				F3				F4				F5				F6				F7				F8				F9				F10			
CABLE TYPE / SIZE				XLPE / PILC				XLPE / PILC				XLPE / PILC				XLPE / PILC				XLPE / PILC				XLPE / PILC				XLPE / PILC				XLPE / PILC				XLPE / PILC				XLPE / PILC				XLPE / PILC											
NO	LVDB / PP	DEFECTIVE FEEDER NAME	Tmin (°C)	Tmax (°C)	AT	FILE	Avg (°C)	REMARK																LVDB / PP 3																															
	INC 1																							Manufacturer: -																															
	INC 2																							Serial No.: -																															
	F1																							Rating: 1500A / 1000A / 800A																															
	F2																							LVDB / PP 2: 3-SLOTTED / DIN TYPE																															
	F3	48.1	93.6	45.5	224	45.0		INCOMING FUSE CONNECTION																Manufacturer: -																															
	F4	51.6	110.6	59.0	225	44.8		OUTGOING FUSE CONNECTION																Serial No.: -																															
	F5	55.3	64.8	9.5	226	44.1		INCOMING FUSE CONNECTION																Rating: 1500A / 1000A / 800A																															
	F6																																																						
	F7																																																						
	F8																																																						
Battery Bank																																																							
Black Box 1																																																							
Black Box 2																																																							
Lightning Arrester																																																							
Droptout Fuse																																																							
Auto Reducer																																																							
LBS																																																							

Tested by (Name & Signature):

EET ENGINEERING SERVICES SDN BHD
 No. 38-2, 3rd Floor, Jalan SS 19/1D
 47500 Subang Jaya, Selangor.
 Tel: 603-5636 8205 Fax: 603-5636 7205

TIB Supervisor/Engineer (Name & Signature):

MOHD AZZAD BIN OTHMAN (19058230)
 JURUTEKNIK TINGGI
 DIAGNOSTIC SUBSTATION PAHANG
 SBU MAINTENANCE EAST
 DISTRIBUTION NETWORK DIVISION

