
CHAPTER 3

B-3-1. Since the same force transmits the shaft, we have

$$f = b_1(\dot{z} - \dot{x}) = b_2(\dot{y} - \dot{z}) + b_3(\dot{y} - \dot{z})$$
 (1)

where displacement z is defined in the figure below.



In terms of the equivalent viscous friction coefficient, the force f is given by

$$f = b_{xy} (\dot{y} - \dot{x})$$
 (2)

From Equation (1) we have

or

$$\dot{z} = \frac{1}{b_1 + b_2 + b_3} \left[b_1 \dot{z} + (b_2 + b_3) \dot{y} \right]$$
 (3)

By substituting Equation (3) into Equation (1), we have

$$f = b_1(\dot{z} - \dot{x}) = b_1 \left\{ \frac{1}{b_1 + b_2 + b_3} \left[b_1 \dot{x} + (b_2 + b_3) \dot{y} \right] - \dot{x} \right\}$$

$$= b_1 \frac{b_2 + b_3}{b_1 + b_2 + b_3} (\dot{y} - \dot{x})$$
(4)

Hence, by comparing Equations (2) and (4), we obtain

$$beg = b_1 \frac{b_2 + b_3}{b_1 + b_2 + b_3} = \frac{1}{\frac{1}{b_2 + b_3} + \frac{1}{b_1}}$$

B-3-2

$$m\ddot{x} + kx = u$$

$$\frac{\chi(s)}{U(s)} = \frac{1}{ms^2 + k}$$

(b) Define the displacement of a point between springs k_1 and k_2 as y. Then the equations of motion for this system become

$$m\ddot{x} + k_2(x-y) = u$$

$$k_1 \dot{y} = k_2(x-y)$$

From the second equation, we have

or

$$k_1y + k_2y = k_2x$$

$$y = \frac{k_2}{k_1 + k_2} \times$$

Then

$$m\ddot{x} + \frac{k_1k_2}{k_1 + k_2} x = u$$

or

$$\frac{X(s)}{U(s)} = \frac{1}{ms^2 + \frac{\hbar_1 k_2}{k_1 + k_2}}$$

B-3-3.

$$m_1\ddot{y}_1 + b_1(\dot{y}_1 - \dot{y}_2) + k_1y_1 = u_1$$

 $m_2\ddot{y}_2 + b_1(\dot{y}_2 - \dot{y}_1) + k_2y_2 = u_2$

Define

$$\chi_1 = y_1, \ \chi_2 = \dot{y}_1, \ \chi_3 = \dot{y}_2, \ \chi_4 = \dot{y}_2$$

Then

$$m_1 \dot{x}_2 + b_1 (x_2 - x_4) + k_1 x_1 = u_1$$
 $m_2 \dot{x}_4 + b_1 (x_4 - x_2) + k_2 x_3 = u_2$

Hence

$$\dot{\chi}_{1} = \chi_{2}$$

$$\dot{\chi}_{2} = -\frac{1}{m_{1}} \left[b_{1}(\chi_{2} - \chi_{4}) + k_{1} \chi_{1} \right] + \frac{1}{m_{1}} u_{1}$$

$$\dot{\chi}_{3} = \chi_{4}$$

$$\dot{\chi}_{4} = -\frac{1}{m_{2}} \left[b_{1}(\chi_{4} - \chi_{2}) + k_{2} \chi_{3} \right] + \frac{1}{m_{2}} u_{2}$$

^{© 2010} Pearson Education, Inc., Upper Saddle River, NJ. All rights reserved. This publication is protected by Copyright and written permission should be obtained from the publisher prior to any prohibited reproduction, storage in a retrieval system, or transmission in any form or by any means, electronic, mechanical, photocopying, recording, or likewise. For information regarding permissions (s), write to: Rights and Permissions Department, Pearson Education, Inc., Upper Saddle River, NJ 07458.

$$\begin{bmatrix} \dot{x}_{1} \\ \dot{x}_{2} \\ \dot{x}_{3} \\ \dot{x}_{4} \end{bmatrix} = \begin{bmatrix} 0 & 1 & 0 & 0 \\ -\frac{ky}{m_{1}} & -\frac{b_{1}}{m_{1}} & 0 & \frac{b_{1}}{m_{1}} \\ 0 & 0 & 0 & 1 \\ 0 & \frac{b_{1}}{m_{2}} & -\frac{kz}{m_{2}} & -\frac{b_{1}}{m_{2}} \end{bmatrix} \begin{bmatrix} \chi_{1} \\ \chi_{2} \\ \chi_{3} \\ \chi_{4} \end{bmatrix} + \begin{bmatrix} 0 & 0 \\ \frac{1}{m_{1}} & 0 \\ 0 & \frac{1}{m_{2}} \end{bmatrix} \begin{bmatrix} u_{1} \\ u_{2} \end{bmatrix}$$

$$\begin{bmatrix} \chi_1 \\ \chi_2 \end{bmatrix} = \begin{bmatrix} 1 & 0 & 0 & 0 \\ 0 & 0 & 1 & 0 \end{bmatrix} \begin{bmatrix} \chi_1 \\ \chi_2 \\ \chi_3 \\ \chi_4 \end{bmatrix}$$

B-3-4.

where

$$T = -2k\theta\alpha^2 - mglsin\theta$$

$$J = mL^2$$

For small 0,

$$ml^2\theta = -2ka^2\theta - mql\theta$$

or

$$\ddot{\theta} + \left(\frac{2ka^2}{mL^2} + \frac{2}{L}\right)\theta = 0$$

B-3-5. Note that

For x direction:

 $M\ddot{x} + m\ddot{x}_q = u$

 $M\ddot{x} + m \frac{d^2}{dt^2} (x + l \sin \theta) = u$

Since

or

we have

For small θ and small $\dot{\theta}^2$, we have

$$(M+m)\ddot{x}+mL\ddot{\theta}=u \tag{1}$$

For rotational motion:

where

$$J=I+m\ell^2$$
, $I=m\frac{\ell^2}{3}$

Thus,

For small 6, we have

$$(I+ml^2)\ddot{\theta} = mgl\theta - ml\ddot{x} \tag{2}$$

From Equation (2),

$$\ddot{x} = g\theta - \frac{I + m\ell^2}{m\ell} \ddot{\theta}$$

Substituting this last equation into Equation (1), we obtain

$$(M+m)(g\theta - \frac{I+ml^2}{ml}\ddot{\theta}) + ml\ddot{\theta} = u$$

or

$$(M+m)g\theta - \frac{(M+m)I + Mml^2}{ml} \ddot{\theta} = u$$

Thus,

$$\dot{\theta} = \frac{ml (M+m)g}{(M+m)I + Mml^2} \theta - \frac{ml}{(M+m)I + Mml^2} u$$
 (3)

Also, from Equation (1) we have

$$(M+m)\ddot{z} + ml \frac{mql\theta - ml\ddot{z}}{I + ml^2} = u$$

or

$$[MI+m(I+Ml^2)]\ddot{x}+m^2l^2g\theta=u(I+ml^2)$$

from which we get

$$\ddot{x} = -\frac{m^2 l^2 g}{MI + m(I + Ml^2)} \theta + \frac{I + ml^2}{MI + m(I + Ml^2)} u$$
 (4)

Equations (3) and (4) describe the system dynamics in terms of differential equations.

By taking the Laplace transform of Equation (3), we obtain

$$\left[s^{2} - \frac{ml(M+m)g}{(M+m)I + Mml^{2}}\right]\Theta(s) = -\frac{ml}{(M+m)I + Mml^{2}}U(s)$$

or

$$\left\{ \left[MI + m \left(I + Ml^2 \right) \right] S^2 - ml \left(M + m \right) q \right\} \Theta(s) = -ml U(s)$$

Hence

$$\frac{\mathcal{G}(s)}{\mathcal{T}(s)} = -\frac{ml}{\left[MI + m\left(I + Ml^2\right)\right]s^2 - ml\left(M + m\right)g}$$
(5)

By taking the Laplace transform of Equation (4), we get

$$S^{2}X(s) = -\frac{m^{2}l^{2}\theta}{MI + m(I + Ml^{2})}\Theta(s) + \frac{I + ml^{2}}{MI + m(I + Ml^{2})}U(s)$$

Hence

$$\frac{s^2\chi(s)}{U(s)} = -\frac{m^2l^2g}{MI + m(I+Ml^2)}\frac{\mathcal{O}(s)}{U(s)} + \frac{I+ml^2}{MI + m(I+Ml^2)}$$

or

$$\frac{\chi(s)}{T(s)} = \frac{m^2 l^2 g}{[MI + m(I + ml^2)]^{s^2}} \frac{ml}{[MI + m(I + ml^2)]^{s^2} - ml(M + m)g} + \frac{I + ml^2}{[MI + m(I + Ml^2)]^{s^2}}$$
(6)

Equations (5) and (6) define the inverted pendulum control system in terms of transfer functions.

Next, we shall obtain a state-space representation of the system. Define state variables by

$$X_1 = 0$$

$$X_2 = 0$$

$$X_3 = X$$

$$y_1 = \theta = x_1$$

$$y_2 = x = x_3$$

Then, from the definition of state variables and Equations (3) and (4), the state equation and output equation can be written as

$$\begin{vmatrix}
\dot{x}_{1} \\
\dot{x}_{2} \\
\dot{x}_{3} \\
\dot{x}_{4}
\end{vmatrix} = \begin{bmatrix}
0 \\
\frac{mL(M+m)3}{MI+m(I+Ml^{2})} & 0 & 0 & 0 \\
\frac{mL(M+m)3}{MI+m(I+Ml^{2})} & 0 & 0 & 0 \\
0 & 0 & 0 & 0 \\
-\frac{m^{2}L^{2}3}{MI+m(I+Ml^{2})} & 0 & 0 & 0
\end{bmatrix} x_{4} + \begin{bmatrix}
0 \\
\frac{mL}{MI+m(I+Ml^{2})} \\
0 \\
\frac{I+mL^{2}}{MI+m(I+Ml^{2})}
\end{bmatrix} u$$

$$\begin{bmatrix} \chi_1 \\ \chi_2 \end{bmatrix} = \begin{bmatrix} 1 & 0 & 0 & 0 \\ 0 & 0 & 1 & 0 \end{bmatrix} \begin{bmatrix} \chi_1 \\ \chi_2 \\ \chi_3 \\ \chi_4 \end{bmatrix}$$

B-3-6. The equations for the system are

$$m_1\ddot{x}_1 = -k_1\chi_1 - b_1\dot{\chi}_1 - k_3(\chi_1 - \chi_2) + U$$
 $m_2\ddot{\chi}_2 = -k_2\chi_2 - b_2\dot{\chi}_2 - k_3(\chi_2 - \chi_1)$

Rewriting, we have

$$m_1\ddot{x}_1 + b_1\dot{x}_1 + k_1\chi_1 + k_3\chi_1 = k_3\chi_2 + u$$

 $m_2\ddot{x}_2 + b_2\dot{x}_2 + k_2\chi_2 + k_3\chi_2 = k_3\chi_1$

Assuming the zero initial condition and taking the Laplace transforms of these two equations, we obtain

$$(m_1 s^2 + b_1 s + k_1 + k_3) X_1(s) = k_3 X_2(s) + \mathcal{D}(s)$$
 (1)

$$(m_2 s^2 + b_2 s + k_2 + k_3) X_2(s) = k_3 X_1(s)$$
 (2)

By eliminating $X_2(s)$ from Equations (1) and (2), we get

$$\left(m, s^2 + b, s + k, + k_s\right) \chi_1(s) = \frac{k_3}{m_2 s^2 + b_2 s + k_2 + k_3} \chi_1(s) + \overline{U}(s)$$
© 2010 Pearson Education, Inc., Upper Saddle River, NJ. All rights reserved. This publication is protected by Copyright and written permission should be

Hence

$$\frac{\chi_{1(5)}}{U(5)} = \frac{m_2 s^2 + b_2 s + k_2 + k_3}{(m_1 s^2 + b_1 s + k_1 + k_3)(m_2 s^2 + b_2 s + k_2 + k_3) - k_3^2}$$

From Equation (2), we obtain

$$\frac{X_2(s)}{X_1(s)} = \frac{k_3}{m_2 s^2 + b_2 s + k_2 + k_3}$$

Hence

$$\frac{X_2(s)}{T(s)} = \frac{X_2(s)}{X_1(s)} \cdot \frac{X_1(s)}{T(s)} = \frac{k_3}{(m_1 s^2 + b_1 s + k_1 + k_3)(m_2 s^2 + b_2 s + k_2 + k_3) - k_3^2}$$

B-3-7. The equations for the given circuit are as follows:

$$R_{1}i_{1} + L\left(\frac{di_{1}}{dt} - \frac{di_{2}}{dt}\right) = e_{i}$$

$$R_{2}i_{2} + \frac{1}{C}\int_{i_{2}}i_{2}dt + L\left(\frac{di_{2}}{dt} - \frac{di_{1}}{dt}\right) = 0$$

$$\frac{1}{C}\int_{i_{2}}i_{2}dt = e_{0}$$

Taking the Laplace transforms of these three equations, assuming zero initial conditions, gives

$$R, I_{i}(s) + L\left[sI_{i}(s) - sI_{i}(s)\right] = E_{i}(s) \tag{1}$$

$$R_2 I_2(s) + \frac{1}{cs} I_2(s) + L[s I_2(s) - s I_1(s)] = 0$$
 (2)

$$\frac{1}{Cs}I_z(s) = E_s(s) \tag{3}$$

From Equation (2) we obtain

$$\left(R_2 + \frac{1}{C_5} + L_5\right)I_2(s) = L_5I_1(s)$$

or

$$I_2(s) = \frac{LCs^2}{LCs^2 + R_2Cs + 1} I_1(s)$$
 (4)

Substituting Equation (4) into Equation (1), we get

$$\left(R_1 + Ls - Ls \frac{Lcs^2}{Lcs^2 + R_2cs + 1}\right)I_1(s) = E_i(s)$$

or

$$\frac{LC(R_1+R_2)s^2 + (R_1R_2C+L)s + R_1}{LCs^2 + R_2Cs + I}I_1(s) = E_1(s)$$
 (5)

From Equations (3) and (4), we have

^{© 2010} Pearson Education, Inc., Upper Saddle River, N.L. All rights reserved. This publication is projected by Copyright and written permission should be obtained from the publisher prior to any prohibited reproduction, sterage in a retrieval system, or transmission in any form or by any means, electronic, mechanical, photocopying, recording, or likewise. For information regarding permission(s), write to: Rights and Permissions Department, Pearson Education, Inc., Upper Saddle River, NJ 07458.

From Equations (5) and (6), we obtain

$$\frac{E_0(s)}{E_i(s)} = \frac{Ls}{L((R_1+R_2)s^2+(R_1R_2C+L)s+R_1)}$$

B-3-8. Equations for the circuit are

$$\frac{1}{C_{i}} \int_{C_{i}} (\hat{i}_{i} - iz) dt + R_{i} \hat{i}_{i} = e_{i}$$

$$\frac{1}{C_{i}} \int_{C_{i}} (\hat{i}_{2} - iz) dt + R_{2} \hat{i}_{2} + \frac{1}{C_{2}} \int_{C_{2}} \hat{i}_{2} dt = 0$$

$$\frac{1}{C_{2}} \int_{C_{2}} \hat{i}_{2} dt = e_{0}$$

The Laplace transforms of these three equations, with zero initial conditions, are

$$\frac{1}{C_{15}} [I_{1}(5) - I_{2}(5)] + R_{1} I_{1}(5) = E_{2}(5)$$
 (1)

$$\frac{1}{C_{1}s} \left[I_{2}(s) - I_{1}(s) \right] + R_{2} I_{2}(s) + \frac{1}{C_{2}s} I_{2}(s) = 0$$
 (2)

$$\frac{1}{C_2 s} I_2(s) = E_0(s) \tag{3}$$


Equation (1) can be rewritten as


$$C_{1}s[E_{1}(s)-R_{1}I_{1}(s)]=I_{1}(s)-I_{2}(s)$$
 (4)


Equation (4) gives the block diagram shown in Figure (a). Equation (2) can be modified to


$$I_{z}(s) = \frac{c_{z}s}{R_{z}c_{z}s+l} \frac{1}{c_{i}s} \left[I_{i}(s) - I_{z}(s) \right]$$
 (5)


Equation (5) yields the block diagram shown in Figure (b). Also, Equation (3) gives the block diagram shown in Figure (c). Combining the block diagrams of Figures (a), (b), and (c), we obtain Figure (d). This block diagram can be successively modified as shown in Figures (e) through (h). In this way, we can obtain the transfer function $E_{\rm O}(\rm s)/E_{\rm i}(\rm s)$ of the given circuit.






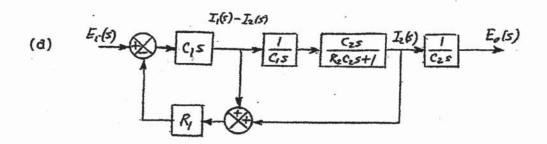

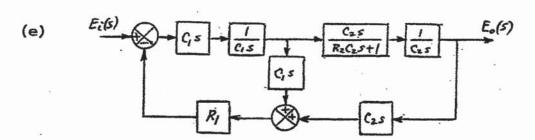

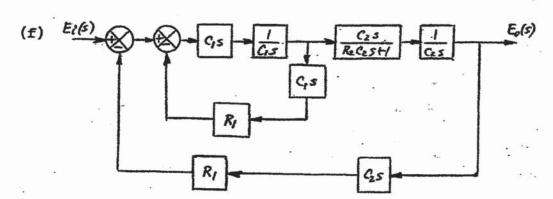



B-3-9. Impedance Z_1 is

$$Z_l = R_l + \frac{l}{C_l s}$$

Impedance Z2 is

$$Z_2 = R_2 + \frac{1}{C_2 s}$$

 $Z_{1} \qquad Z_{2} \qquad Z_{2} \qquad Z_{2}$

Hence

$$\frac{E_o(s)}{E_i(s)} = \frac{Z_2}{Z_1 + Z_2} = \frac{R_2 + \frac{1}{C_2 s}}{R_1 + \frac{1}{C_1 s} + R_2 + \frac{1}{C_2 s}}$$

$$= \frac{R_2C_2s + 1}{(R_1C_2 + R_2C_2)s + 1 + \frac{C_2}{C_1}}$$


If we change R_1 to b_1 , R_2 to b_2 , C_1 to $1/k_1$, C_2 to $1/k_2$, then we obtain

$$\frac{R_2 C_2 S + 1}{(R_1 + R_2) C_2 S + 1 + \frac{C_2}{C_1}} = \frac{b_2 \frac{1}{R_2} S + 1}{(b_1 + b_2) \frac{1}{R_2} S + 1 + \frac{k_1}{R_2}}$$

or

$$\frac{X_0(s)}{X_i(s)} = \frac{b_2 s + k_2}{(b_1 + b_2) s + k_2 + k_1} = \frac{b_2 s + k_2}{(b_1 s + k_1) + (b_2 s + k_2)}$$

The analogous mechanical system is shown below.

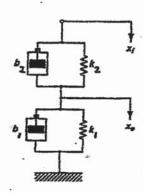

B-3-10 .


$$Z_i = R_i + \frac{1}{cs}$$

$$Z_2 = R_2$$

Then

$$E_i(s) = \left(R_i + \frac{1}{Cs}\right)I(s)$$

$$E_o(s) = -R_2 I(s)$$

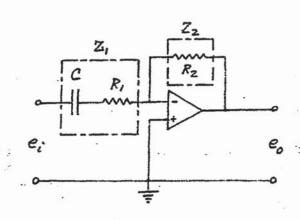

Hence

$$\frac{E_o(s)}{E_l(s)} = -\frac{R_2}{R_l + \frac{l}{Cs}} = -\frac{R_2 Cs}{R_l cs + l}$$

B-3-11. Define the voltage at point A as e_A . Then

$$\frac{E_A(s)}{E_i(s)} = \frac{R_I}{\frac{I}{Cs} + R_I} = \frac{R_I Cs}{R_I Cs + I}$$

Define the voltage at point B as eB. Then

$$E_B(s) = \frac{R_3}{R_2 + R_3} E_o(s)$$

Noting that

$$\left[E_A(s)-E_B(s)\right]K=E_o(s)$$

and $K \gg 1$, we must have

$$E_A(s) = E_B(s)$$

Hence

$$E_A(s) = \frac{R_1 C s}{R_1 C s + 1} E_i(s) = E_B(s) = \frac{R_3}{R_2 + R_3} E_o(s)$$

from which we obtain

$$\frac{E_o(s)}{E_i(s)} = \frac{R_2 + R_3}{R_3} \frac{R_1 C s}{R_1 C s + 1} = \frac{\left(1 + \frac{R_2}{R_3}\right) s}{s + \frac{1}{R_1 C}}$$

B-3-12. For the op-amp circuit shown to the right, we have

$$E_A - E_O = Z_4 I_2$$

 $E_B - O = Z_3 I_1$
 $E_A = E_B$

Hence

$$Z_{4}I_{2}+E_{0}=Z_{3}I_{1}$$

or

$$I_2 = \frac{1}{Z_4} (Z_3 I_1 - E_0)$$
 (1)

e,

e,

Also,

$$E_i - E_0 = (Z_2 + Z_4)I_2 \tag{2}$$

$$E_i = (Z_1 + Z_3)I_1 \tag{3}$$

By substituting Equation (1) into Equation (2), we obtain

$$E_i - E_o = (Z_2 + Z_4) \frac{1}{Z_4} (Z_3 I_1 - E_0)$$

By substituting Equation (3) into this last equation, we get

$$(Z_1 + Z_3)I_1 - E_0 = (\frac{Z_2}{Z_4} + I)Z_3I_1 - (\frac{Z_2}{Z_4} + I)E_0$$

or

$$\left(1 - \frac{Z_2}{Z_4} - 1\right) E_0 = \left(Z_1 + Z_3 - \frac{Z_2 Z_3}{Z_4} - Z_3\right) I_1$$

Hence

$$-Z_2 E_0 = (Z_1 Z_4 - Z_2 Z_3) I_1$$
 (4)

From Equations (3) and (4), we have

$$\frac{E_0}{E_1} = \frac{\frac{Z_2 Z_3 - Z_1 Z_4}{Z_2}}{Z_1 + Z_3} = \frac{Z_2 Z_3 - Z_1 Z_4}{Z_1 Z_2 + Z_2 Z_3}$$

For the current op-amp circuit, we have

$$Z_1 = \frac{1}{Cs}$$
, $Z_2 = R_1$, $Z_3 = R_2$, $Z_4 = R_1$

Hence

$$\frac{E_0(s)}{E_1(s)} = \frac{R_1 R_2 - \frac{1}{Cs} R_1}{\frac{1}{Cs} R_1 + R_1 R_2} = \frac{R_2 - \frac{1}{Cs}}{\frac{1}{Cs} + R_2} = \frac{R_2 Cs - 1}{R_2 Cs + 1}$$

^{© 2010} Pearson Education, Inc., Upper Saddle River, NJ. All rights reserved. This publication is protected by Copyright and written permission should be obtained from the publisher prior to any prohibited reproduction, storage in a retrieval system, or transmission in any form or by any means, electronic, mechanical, photocopying, recording, or likewise. For information regarding permission(s), write to: Rights and Permissions Department, Pearson Education, Inc., Upper Saddle River, NJ 07458.

B-3-13. Define the current in the armature circuit to be ia. Then, we have

$$L\frac{diq}{dt} + Riq + K_b \frac{d\theta_m}{dt} = e_i$$

or

$$(LS+R)I_{\alpha}(s)+K_{\beta}s\Theta_{\alpha}(s)=E_{i}(s) \qquad (1)$$

where Kb is the back emf constant of the motor. We also have

$$J_{m} \ddot{\theta}_{m} + T = T_{m} = K \dot{z}_{a}$$

$$T = \frac{\theta}{\theta_{m}} T_{L} = n T_{L}$$

$$J_{r} \ddot{\theta} = T_{r}$$
(2)

where K is the motor torque constant and i_a is the armature current. Equation (2) can be rewritten as

$$(J_m + n^2 J_L) \ddot{\theta} = n K i_a$$

or

$$\left(J_m + n^2 J_L\right) s^2 \Theta(s) = n K I_A(s) \tag{3}$$

By substituting Equation (3) into Equation (1), we obtain

$$(Ls+R)\frac{(J_m+n^2J_L)s^2}{nK}\Theta(s)+K_ss\frac{\Theta(s)}{n}=E_i(s)$$

or

$$\left[(Ls+R)(J_m+n^2J_L)s^2+KK_bs \right] \Theta(s)=nKE_i(s)$$

Hence

$$\frac{\theta(s)}{E_i(s)} = \frac{nK}{s[(Ls+R)(J_m + n^2J_L)s + KK_b]}$$