
Engine Model(s): PW150

79-31-00

Figure 2 A/C Generator Chip Detector Installation

Figure 2 A/C Generator Chip Detector Installation

Export Classification: ECCN=Contains 10-25% 9E991;ECL=NSR

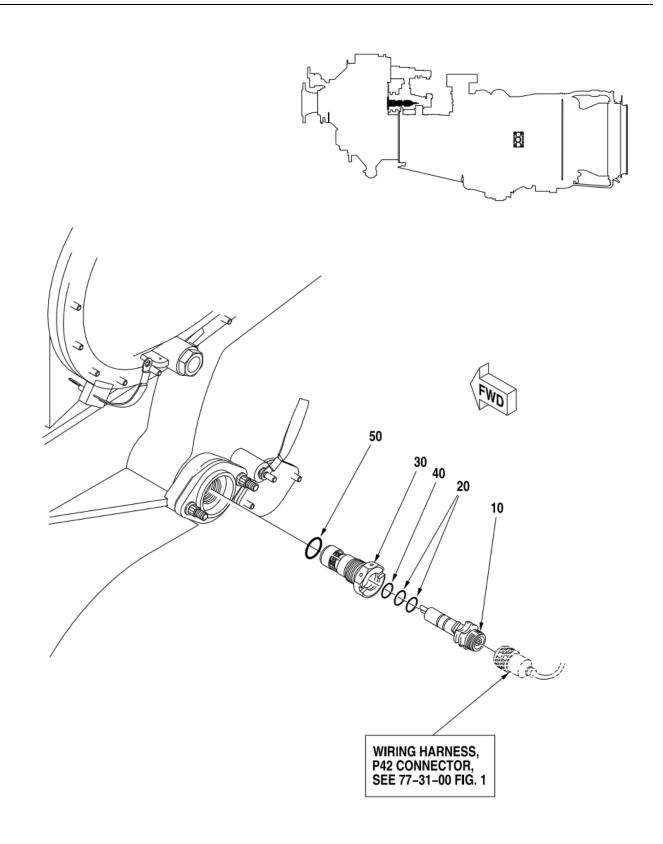

c62170

	Fig. Item	Part No.	Airline Part No.	Nomenclature	Effect Code	Units Per Assy.
_	1			A/C GENERATOR CHIP DETECTOR INSTALLATION SEE 72-00-00 FIG.1 FOR NHA		REF
	10	3049094- 01		■ PLUG, CHIP DETECTOR, MAGNETIC FOR ADDITIONAL INFORMATION REFER TO P&WC ABBREVIATED COMPONENT MAINTENANCE MANUAL P/N 79-31-02 (3053125) (PRC 02): TWO-WAY INTRCHG WITH P/N 3049094-02 PRE-PW150 SPB NO. 2		1
_	10A	3049094- 02		■ PLUG, CHIP DETECTOR, MAGNETIC FOR ADDITIONAL INFORMATION REFER TO P&WC ABBREVIATED COMPONENT MAINTENANCE MANUAL P/N 79-31-02 (3053125) SEE FIG.1 AND 3 FOR ADDITIONAL CHIP DETECTORS POST-PW150 SPB NO. 2		1
	20	AS3209- 011		PACKING, PREFORMED		2
	30	3045930- 01		■ VALVE OPTION (IC) (IC) CONSISTS OF: (PRC 02): TWO-WAY INTRCHG WITH P/N 3045441-02 PRE-SB35236		1
		3038215		■ VALVE, CHIP DETECTOR, SELF CLOSING		REF
		3045441- 01		• VALVE, CHIP DETECTOR, SELF CLOSING		REF
_	30A	3045441- 02		VALVE, CHIP DETECTOR, SELF CLOSING POST-SB35236		1
	40	AS3209- 013		PACKING, PREFORMED		1
	50	AS3208- 08		■ PACKING, PREFORMED		1

[—] ITEM NOT ILLUSTRATED