Engine Model(s): PW150

77-11-00

Figure 2 NL Speed Sensor Installation

Figure 2 NL Speed Sensor Installation

Export Classification: ECCN=Contains 10-25% 9E991;ECL=NSR

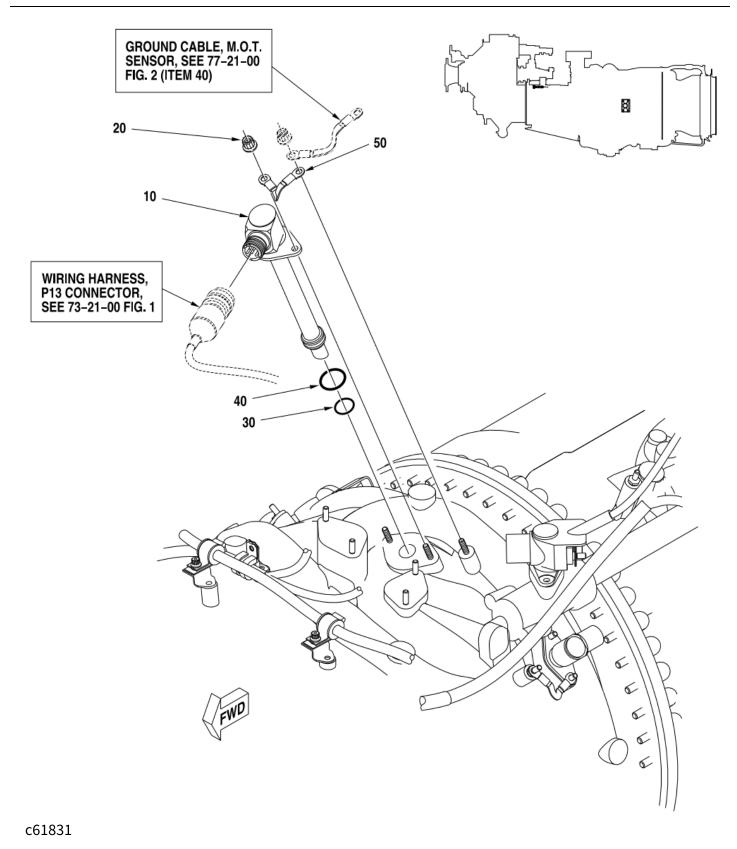


Fig. Item	Part No.	Airline Part No.	Nomenclature	Effect Code	Units Per Assy.
- 1			NL SPEED SENSOR INSTALLATION SEE 72-00-00 FIG.1 FOR NHA		REF
10	3047251-		• SENSOR, SPEED, NL (PRC 02): TWO-WAY INTRCHG WITH P/N 3047251-02 PRE-SB35281		1
— 10A	3047251- 02		• SENSOR, SPEED, NL <u>POST-SB35281</u>		1
20	ST3030- 09		ATTACHING PARTS  • NUT OPTION (IC) SEE NUT OPTION TABLE*		2
30	AS3209- 114		■ PACKING, PREFORMED (PRC 02): TWO-WAY INTRCHG WITH P/N ST6202-114 PRE-SB35178		1
<b>—</b> 30A	ST6202- 114		PACKING, PREFORMED     POST-SB35178		1
40	AS3209- 120		■ PACKING, PREFORMED (PRC 02): TWO-WAY INTRCHG WITH P/N ST6202-120 PRE-SB35178		1
— 40A	ST6202- 120		PACKING, PREFORMED     POST-SB35178		1
50	ST3413- 01		CABLE ASSY, GROUND, BRAIDED		1

<sup>—</sup> ITEM NOT ILLUSTRATED