END OF WELL REPORT

AZADEGAN OIL FIELD

END OF WELL REPORT

AZNS – 12 (NEAR PAD #75)

GADVAN WELL

Drilling Department

MAY 2026

MSA/OEOC			
	Position	**Name**	**Date & Signature**
Prepared by	Drilling Engineering Department	M.H Haji Taleb Asgar Eyvazi	
Approved by	Project Head of Drilling Engineering	Behnam Parvaresh	
	Project Head of Drilling Operation	Piran Farzaneh	
	Project Manager	Rashid Ansari	
PPL			
	Position	**Name**	**Date & Signature**
Check & Approved by	Drilling Operation Manager	Majid Nariman	
	Subsurface Engineering Manager	Mehdi Salim Mehr	
	Project Manager	Soheil Shadizadeh	
	Subsurface Project Manager	Keivan Davoodi Nejad	

TABLE OF CONTENTS

1. General Information *7*
1.1 Field Introduction 7
1.2 AZNS – 12 Well Location Map 8
2. Well History *9*
2.1 Well Informaion 9
2.2 AZNS-12 Well History 10
26" Hole Section 10
17 – 1/2" Hole Section 10
12 – 1/4" Hole Section 10
8 – 1/2" Hole Section 11
Completion 11
2.3 Summary of Workover Operation 12
Workover Summary: 12
De-Completion: 12
Completion Operation Summary: 28
2.4 AZNS-12 Well Sketch 35
2.5 Daily Time Break Down 36
2.6 Activity Breakdown Table 39
2.7 Activity Break Down Chart 40
2.8 Activity Break Down Plot 41
2.9 Bit Record Table 42
2.10 Hole Problem History 43
2.11 Total Time Break-Down of Operation 44
2.12 NPT Break-Down 49
3. Geological & Logging Reports *54*
4. Bottom Hole Assembly *57*
5. Casing Information *68*
.6 Cement Job Report *69*
6.1 Magnesite Report 69
6.2 Pilot Test Report 70
7. Completion Report *71*
7.1 Completion Tubing Information 71
7.2 Completion Tools Specification Checklist 71
7.3 Assembling & Test Report 74
7.4 Completion Operation Check list 79
7.5 Completion Sketch: 82
7.6 Completion Tally: 83
7.7 Completion String Pressure Test 88
8. Wellhead Report *94*
8.1 Final Well Status 94
8.2 Wellhead & X-mass tree Specification 95

8.3 Wellhead Schematic 97
8.4 Tubing Head Spool Specification (Section C) 98
8.5 X – Mass Tree Specification (Section D) 99
8.6 Pressure Test Report of Section D (before & after installation) 100
8.7 Wellhead Related Test Reports 101
9. Drilling Fluid Information 106
9.1 Summary of Fluid 106
9.2 Interval Remark 107
Operation Remark 107
Drilling Fluid Remark 109
9.3 Drilling Fluid type 109
9.4 Material Consumption Analysis 110
9.5 Volume Analysis 112
9.6 Daily volume Breakdown 113
9.7 Loss Distribution 116
9.8 Interval Fluid Properties Recap 119
9.9 Solid Control Disscusion 121
9.10 Inhibited CaCl2 Brine 122
10. Waste Management Service 125
10.1 Waste Management System - Water treatment process. 125
10.2 Operation's Recap 126
11. List of Contractors 134
12. Appendix 135
12.1 DDR Summary 135

LIST OF TABLES

TABLE 2-1: AZNS-12 WORKOVER WELL INFORMATION 9
TABLE 2-2: AZNS-12 WORKOVER INFORMATION 12
TABLE 2-3: AZNS-12 WORKOVER TIME BREAKDOWN 48
TABLE 2-4: AZNS-12 NPT TIME BREAKDOWN (BASED ON CLIENT'S ORDER & INFORMATION) 53
TABLE 3-1: AZNS-12 WELL TRAJECTORY DATA 54
TABLE 3-2: AZNS-12 FORMATION TOPS 55
TABLE 3-3: AZNS-12 PREDICTED PRESSURE & TEMPERATURE & TTZ CONTACT 56
TABLE 3-4: AZNS-12 FORMATION PRESSURE PREDICTION IN BLOK III 56
TABLE 4-1: AZNS-12 BOTTOM HOLE ASSEMBLY 67
TABLE 5-1: AZNS-12 FINAL CASING DATA 68
TABLE 7-1: AZNS-12 TUBING DATA 71
TABLE 8-1: AZNS-12 FINAL WELL STATUS 94
TABLE 8-2: AZNS-12 WELLHEAD & X-MASS TREE EQUIPMENT SPECIFICATION 96
TABLE 8-3: AZNS-12 SECTION "C" SPECIFICATION 98
TABLE 8-4: AZNS-12 SECTION "D" SPECIFICATION 99
TABLE 8-5: AZNS-12 SECTION "D" TEST REPORT BEFOR INSTALLATION 100
TABLE 8-6: AZNS-12 SECTION "D" TEST REPORT AFTER INSTALLATION 100
TABLE 9-1: AZNS-12 FLUID PROPERTIES RECAP TABLE 109
TABLE 9-2: AZNS-12 MATERIAL CONSUMPTION ANALYSIS TABLE 110
TABLE 9-3: AZNS-12 DE-COMPLETION SECTION VOLUME ANALYSIS TABLE 112
TABLE 9-4: AZNS-12 DAILY VOLUME BREAK DOWN TABLE 114
TABLE 9-5: AZNS-12 LOSS DISTRIBUTION 117
TABLE 9-6: AZNS-12 FLUID PROPERTIES RECAP 120
TABLE 9-7: AZNS-12 SOLID CONTROL DESSCUSION 121
TABLE 9-8: AZNS-12 MATERIAL CONCENTRATION 122
TABLE 10-1: AZNS-12 CHEMICAL CONSUMPTION AND WATER TREATMENT VOLUMES BY DATE FOR COMPLETION SECTION 128
TABLE 10-2: AZNS-12 WATER ANALYSI 133
TABLE 11-1: AZNS-12 CONTRACTORS INVOLVED 134
TABLE 12-1: AZNS-12 DAILY DRILLING REPORT SUMMARY 139

LIST OF FIGURES

FIGURE 1-1: AZNS OILFIELD LOCATION MAP 7
FIGURE 1-2: AZNS-12 WELL LOCATION MAP 8
FIGURE 2-1: AZNS-12 WELL SKETCH 35
FIGURE 2-2: AZNS-12 NPT BREAK-DOWN CHART (BASED ON CLIENT'S ORDER & INFORMATION) 49
FIGURE 7-1 MULE SHOE - NOGO CONNECTION 74
FIGURE 7-2 PACKER CONNECTION 75
FIGURE 7-3 SSD CONNECTION 76
FIGURE 7-4 EXP. JOINT CONNECTION 77
FIGURE 7-5 OFFLINE PRESSURE TESTS 78
FIGURE 7-6: AZNS-12 SETTING PACKER, ANNULUS & FINAL COMPLETION STRING PRESSURE TEST 93
FIGURE 8-1: AZNS-12 WELLHEAD SKETCH 97
FIGURE 8-2: AZNS-12 X-MASS TREE BODY PRESSURE TEST GRAPH BEFORE INSTALLATION 102
FIGURE 8-3: AZNS-12 X-MASS TREE BODY PRESSURE TEST GRAPH AFTER INSTALLATION 103
FIGURE 8-4: AZNS-12 WELLHEAD MOM BEFOR INSTALLATION 104
FIGURE 8-5: AZNS-12 WELLHEAD MOM AFTER INSTALLATION 105
FIGURE 9-1: AZNS-12 DE-COMPLETION SECTION MUD CHEMICAL USAGE 111
FIGURE 9-2: AZNS-12 DE-COMPLETION SECTION EFFECTIVE CONCENTRATION 111
FIGURE 9-3: AZNS-12 DE-COMPLETION SECTION VOLUME ANALYSIS CHART 112
FIGURE 9-4: AZNS-12 DAILY VOLUME BREAK DOWN CHART 115
FIGURE 9-5: AZNS-12 LOSS ANALYSIS 118
FIGURE 9-6: AZNS-12 COMPLETION SECTION MUD CHEMICAL USAGE 123
FIGURE 9-7: AZNS-12 COMPLETION SECTION INHIBITED $CaCl_2$ BRINE 123
FIGURE 10-1: DEWATERING/WATER TREATMENT SYSTEM 128

1. General Information

1.1 Field Introduction

Azadegan South Oil Field is situated in West Karoun, Khuzestan province on a large long – axis anticline with N – S trending with approximate dimensions about 20km width and 60km length near to Iran – Iraq border, It is located in The Northwest of The YADAVARAN Field and in The West of JUFEYR Field. The Average Monthly Temperature is 45ºc in summer and Highest Temperature is 52ºc. The Lowest Temperature is -4.4ºc in winter. Maximum Rainfall is 78mm in February, Winter Season.

The trap area of the south Azadegan is limited to 43.2x17.2km. The Azadegan Oil field was discovered in 1999, when Well AZN-1 was drilled vertically down to the Cretaceous Fahliyan Formation with total depth of 4,643m. The results of this well, revealed the reservoir characteristics of the field. Following to the result of the well no. AZN-1, another 5 exploration wells was drilled in different parts of this huge field down to Fahliyan Formation. In the later stage the well No.10 assumed as exploration well for evaluation of deeper formations. This well was drilled in 2008, down to the depth of 5340^{m} (Neyriz Fm.), mainly to evaluate the Jurassic formations.

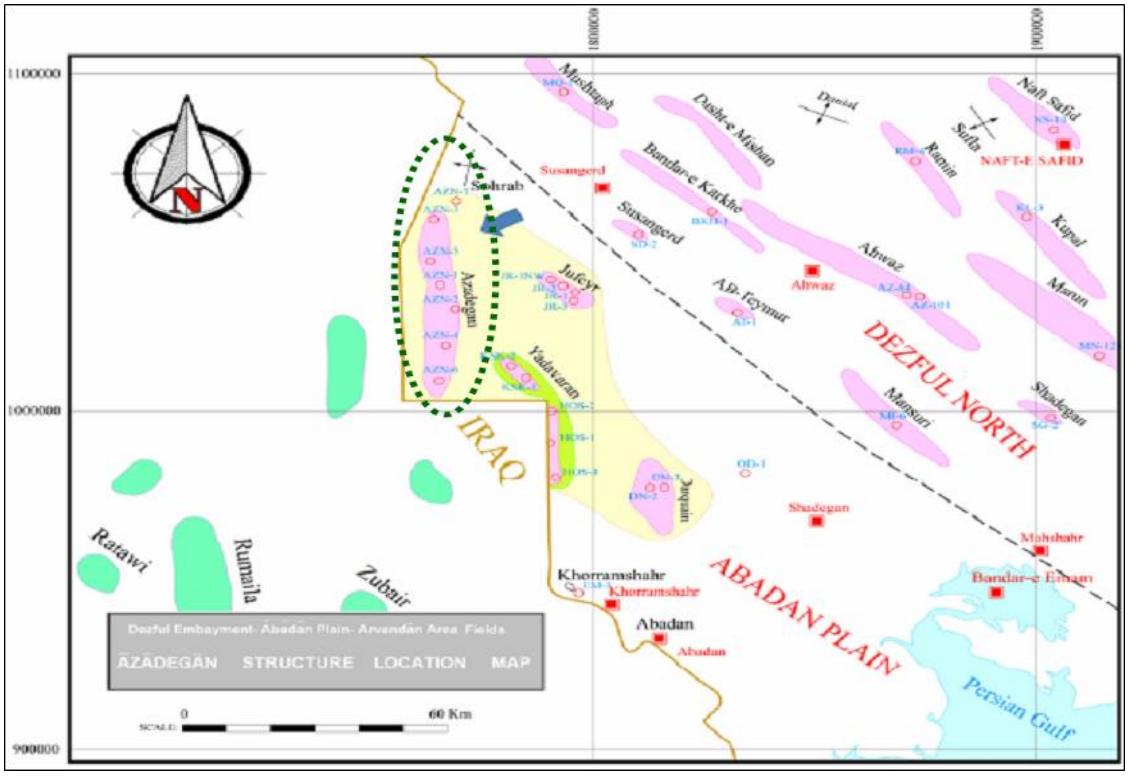


Figure 1-1: AZNS Oilfield Location Map

1.2 AZNS – 12 Well Location Map

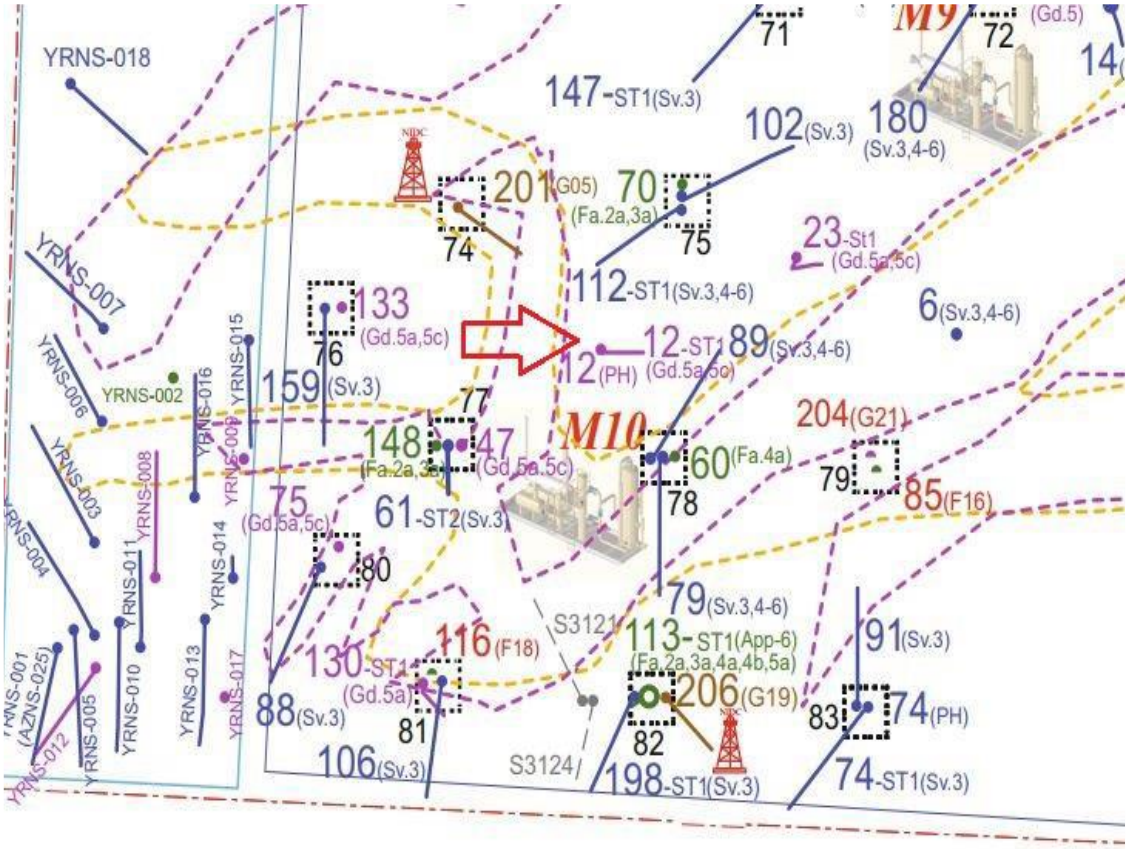


Figure 1-2: AZNS-12 Well Location Map

2. Well History

2.1 Well Informaion

Rig name	OEOC 208	**Client**	PEDEC/PPL
Rig type	Land Rig 2000HP	**Contractor**	MSA/OEOC
Well Name	AZNS – 12	**Management Contractor**	MSA
Well Type	Gadvan well Phase I	**Field**	South Azadegan
Completion Type	4-1/2" * 3-1/2" 7.5K	**RTE**	14.45m
Actual TD (mMD)	3945m	**GLE**	3.95
Surface Coordinate		E: 189,014.48 N: 3,437,769.78	
TD Coordinate		E: 189,019.38 E: 3,437,748.34	
Operation Date			
Spud Date	13 – Apr – 2025		
Released Date	24 – Jun – 2025		
Rig Days Plan	91.9	**Rig Days Actual**	72.25

Size (in)	Shoe Depth (mMD)	Specification
20	154	J – 55, 133#, BTC
13 – 3/8	1259	C – 95, 72#, BTC
9 – 5/8	3448	L – 80,47# & 53#, VAM & N. VAM
7	3285 – 3846	C – 75, 29#, N. VAM
5	3779 – 3945	L – 80, 18#, VFJ, HTS

Table 2-1: AZNS-12 Workover Well Information

2.2 AZNS-12 Well History

26" Hole Section

Spud the rig FATH 64 on 1387.04.15 at 12:00 o'clock.

Commenced drilling 26" hole section from 14m to 155.5m. Run 20" casing (J-55m 133#, BTC) to 154m, perform cemented 20" casing (S.W:115 pcf), got CMT in return. Install 20" 3K C.H.H (type ABB).

17 – 1/2" Hole Section

Drilling of 17-1/2" hole section started on 1387/05/20 from 154^{m} to 1259^{m} with No Loss- No Gain. Perform condition trip. Run CDR/GR log.

R/U 13-3/8" casing running equipment, held PJSM and run 13-3/8" casing with 13-3/8" float shoe (Nasr Mobtakeran) + 2 Jt 13 3/8" CSG + 13-3/8" float Collar (Nasr Mobtakeran) + 106 Jts 13 3/8" CSG (C-95, 72#, BTC to 1259 m. perform Cement 13-3/8" casing (883^{bbl} head CMT, S.W: 90^{pcf}, 135^{bbl} tail CMT S.W:115^{pcf}). Install DSA 20" 3K X* 16 ¾" 5k & 16 ¾" 5K (MCEVOY) X 13 5/8" 5K (ABB).

12 – 1/4" Hole Section

Drilling of 12-1/4" hole section started on 1387/06/10 from 1259^{m} to 1585^{m}, Obs. complete loss, cure the loss by pumping LCM, Cont. Drlg to 1600^{m}. Obs. No return. POOH to surface, RIH with C.Cut bit, spot 120^{bbl} 94^{pcf} CMT, POOH to surface, RIH with bit, Cont. Drlg formation to 1860 m with heavy loss (cure the loss using LCM pill), @ 1860^{m}, Obs. 500^{psi} pressure drop, POOH to surface, Obs. 12 ¼" bit + bit sub + 2 Jts 8 ½" D. Collar left in hole. Retrieve the fish, RIH with open end drill pipes, pump 150^{bbl} CMT 94^{pcf} in 2 stage, D/O CMT, Cont. Drlg to 2130^{m}, 50-80 BPHL. stuck string, work on stuck, free the pipe, POOH to surface, obs. String twist off from Jar mandrel. Retrieve the fish. RIH W/ BIT & Cont. Drlg formation to 2245^{m}, Obs. Pressure drop, Obs. 92.26^{m} fish left in hole. Retrieve the fish. RIH with bit & Cont. Drlg formation to 3792^{m} (section TD). Perform condition Trip, run BHC/HRLA/TLD/HGNS/GPIT/HNGS log, POOH to surface, run MDT log. Perform 230^{bbl} balance CMT plug in 2 stage. RIH with D/O BHA, D/O CMT & to 3450^{m} (9 5/8" CSG point), POOH to surface.

R/U CSG running equipment, held PJSM and run 9 5/8" casing with 9 5/8" float shoe (IDC) + 2 Jt 9 5/8" CSG (L-80, 53.5#, NEW VAM) + 9 5/8" float Collar (IDC) + 98 Jts 9 5/8" CSG (L-80, 53.5#, NEW VAM) + 185 Jts 9 5/8" CSG (L-80, 47#, VAM) + 2 Jts 9 5/8" CSG (L-80, 53.5#, VAM) to 3448^{m}. drop ball & apply pressure to 4500^{psi} & try to Circ. No Success. Set CSG slips,

install DSA 12” 5K * 3K, T.H.S 12” 3K 10” 5k (Toloo Khoozestan), RIH with ounching tools & punch 9 5/8” CSG F/ 3419 to 3420^{m}. try to perform Circ. No success.

RIH with punching tools & punch 9 5/8” CSG F/ 3408.5 to 3410.5^{m}. Perform Circ., OK. RIH with RTTS PKR, perform CMT job, unset PKR & POOH to surface.

8 – 1/2" Hole Section

RIH with bit, D/O CMT to 3468^{m} (KOP). POOH to surface. RIH with Dir. Drlg BHA to 3468^{m}. Start Dir. Drlg F/3468 to 3735^{m}. left fish in hole, retrieve fish, RIH with bit & unable to pass 3660^{m} in several times. Displace the well with O.B.M, Cont. Drlg to 3846^{m}. Perform condition trip, POOH to surface.

R/U 7” LNR running equipment. M/U 7” F. Shoe + 1 Jt 7” LNR + 7” F. Collar + 2 Jt 7” LNR + 7” LDC + 19 Jts 7” LNR (C-75, 29 #, N.VAM) & RIH to 3846^{m}, perform CMT job.

6 1/8" Hole section

RIH with Dir. Drlg BHA, Drlg formation to 3945^{m} (section TD), perform condition trip. Perform logging operation (AIT/BHC/LDT/CNT/GR)

R/U LNR running equipment, M/U 5” F.Shoe + 29.5 5” Blank LNR (L-80, 18#, HTS) + 47.8^{m} 5” LNR perforated + X.O.S + 1 Jt 5” LNR 18# VFJ + LDC + 6 Jts VFJ LNR + 5” LNR HGR & RIH to 3945^{m}. Set HGR, POOH to surface, RIH with 4 1/8” E. Mill & clean out BHA to 3945^{m}. Displace the well with $CaCl_2$, POOH to surface.

Completion

Run completion string with 9 Jts 4 ½” TBG + 291 Jts 7” (L-80,29#, N.Vam TBG + 3SV + 5 No. fluted adapter + 5 Jts 7” TBG + fluted swage + TBG HGR (10” X 7” X 9 5/8” neck) set PKR @ 3334^{m}.

2.3 Summary of Workover Operation

The AZNS-12 workover well was De-Complete by rig OEOC – 208 from "13 – Apr – 2025" to "24 – Jun – 2025 " as described in the following:

Workover Summary:

Date	25 – January – 2024
WorkOver Depth	3945^{m}
Formation	Gadvan
Mud Weight	83^{pcf}

Table 2-2: AZNS-12 WorkOver Information

De-Completion:

Check Mud Tanks, Function Test Disilter, Degasser & all Equip. & Line, Function Test Diesel Generators (#1, #2, #3 & #4), Check SCR Room & VFD, Function Test Drawworks (Low Clutch, High Clutch, Test Crown - Omatic, Electrical Brake & Emergency Brake, Function Test TDS (TQ. Rot (200 RPM), Trq. Wrench, Link Tilt Counter Balance), Align Mast, Body Press Test Stand Pipe w/ 3000^{psi} & Middle Valve, Function Test Mud Pumps (#1, #2 & #3). Press test Lower & Upper I BOP w/ 2500^{psi}; OK. Prepare rig to Spud.

Held PJSM. Spud the rig @ 13 – Apr – 2025, 18:00. Check Section C: Press Test Between Lower P-Seal, Ring Gasket & 9-5/8" CSG Slips w/ 3000^{psi}; "OK". Press Test Upper P-Seal w/ max 600^{psi}; "OK" & Try to inject plastic packing; "No-Succ". Check 7" * 9 5/8" Ann Press; Zero. Install 7-1/16" 5k Companion flange on 2SV. Open all valve & Monitor Press; Zero.

Press test 7-1/16" 5K Top master valve w/ 3000^{psi}; "OK" & Check all ann. Press., Bleed off to zero.

Ensure that there is no TWCV/BPV in TBG HGR. N/D 7-1/16" Companion Flange. Install 7-1/16" 5K Sweep bend on 2SV. Close TMV. Press test XMT; "OK". Connect Hand Pump to 1/4" C/L & Try to Open 3SV w/ Gradually to Max 4500^{psi} Press. several times "No-Succ" No indication to open 3SV. Inject Plastic Packing to BMV P-Seals. L/U f/ mud pump to Sweep bend. F/U String. L/U f/ Ann to C/M.

Stop operation Due to Align TDS Rail meanwhile OEOC inspection &maintenance crew work on TDS. Stop operation Due to Bad Weather (High win speed & dust storm) Cont. Align TDS Rail meanwhile OEOC inspection & maintenance crew work on TDS.

P/U 6 Jts 5" DP Jt By Jt, Make & R/B 2 Stds to Derrick Stop operation Due to Bad Weather (High win speed & dust storm).

Stop operation Due to Bad Weather (High win speed & dust storm). P/U 24 Jts 5" DP Jt By Jt, Make & R/B 8 Stds to Derrick. Meanwhile prepare to L/U. L/U f/ Pump truck to sweep bend & C/M. Press test surface line w/ 3000^{psi}; "Ok". Apply 4500^{psi} Press to 1/4" CL & 1000^{psi} Press to string. (Obs. indication of opening 3SV f/1000 to 1500^{psi} on CL P.Gauge). Also check connection between string & Ann w/ 1000^{psi} Press; Negative. P/U 9 Jts 5" DP Jt By Jt, Make & R/B 3 Stds to Derrick. Hold 4500^{psi} Press in 1/4" C/L. R/U Slick line Equip, Lubricator & BOP Stack. Press Test same w/ 3000^{psi}; " Ok". Run Gauge Ring to 3SV Depth, POOH To surface. RIH w/ 5.200" M.Pulling to Retrieve 3SV. Try to retrieve several times; "Unable to retrieve 3SV". POOH to surface. Run 2.5" Gauge Ring to 2798^{m} (Probable TOF). Drop Tension, POOH to surface. Close TMV. L/D SL Lubricator & BOP's. L/D Slick Line Equip.

Install 7 1/16" 5K Riser on XMT Cap & Install CTU BOP on Riser. L/U Pump Truck & Flush The CTU. M/U 1"Roll on Connector on 1-1/2"CT Pipe & Perform Pull Test to Max 20^{klbs}; "Ok" Wait on OEOC due to Rec. Crain to R/U CT Injetcor head.

Rec. 50 ton crane. M/U 1-1/2"Roll on Connector on 1-1/2"CT Pipe & Perform Pull Test to Max 12^{klbs}, Ok. Install CT BOP on 7-1/16" Riser. R/U CT Injector Head & Install on BOP. Perform Press test w/ 3500^{psi}; "Ok". RIH w/ 1-1/2"C.TBG to to 2798^{m} (TOF), Meanwhile Slow Circ. Mud thru CT. Try to Pass this Point (2798^{m}) w/ Apply Max. 2000^{lb} Wt.; "No-Succ.

Displace the string w/ 200^{bbl} 84^{pcf} $CaCO_3$ Poly Mud. Meanwhile POOH to 2780^{m}. (CT BHA Component: 1-1/2"Roll on Connector, 1-13/16"Double Flapper Check Valve, 1-13/16" Wash Nozzle (w/ 5 * 11/32" Port Size))

Cont. Displace the string w/ totally 350^{bbl} 84^{pcf} $CaCO_3$ Poly Mud. Got 10^{bbl} contaminate mud. Cont. Over Circ. Mud to uniform MW in/out. L/U 7" * 9-5/8" Ann to C/M & Monitor Press; "Zero". Flow check the well; "Static" Resume POOH 1-1/2" CT f/ 2780^{m} to to surface, Meanwhile Circ. Mud thru CT. Flush CT w/ F.Water R/D CTU Injector head, Quad BOP & Hydraulic hoses. L/D 7" Raiser. Disconnect & R/D CMT Line. L/D 7-1/16" Sweep bend & 2SV. Install 6-5/16" 5K TWCV & Press. Test same w/ 4000^{psi}

for 15min; "OK". N/D 7-1/16" 5K Top Master valve & BTM Master valve of XMT. N/D TBG Headadapter of XMT w/ Difficulty Release f/ TBG HGR Neck. Open & Check Tie-Down Screw. Check 7" Vam Thread L.Jt & 7" * 4-1/2" X.O.S on Tubing Hanger Neck. Plug 1/8" CL Port on TBG HGR Neck.

Install 11" 5k * 13-5/8"-10k DSA + 13-5/8" 10k Spacer Spool on 11" 5K THS. Tighten nuts. N/U Single BTM Rams.

N/U 13-5/8" 10K Drlg Spool (SOVs have already been installed), Double rams (Top Rams 4-1/2" * 7" VBR & Middle Rams Shear/Blind), 13-5/8" 5K Annular Preventer. Connect 2" & 4" choke line f/ BOP Stack to C/M & 2" Kill Lines to BOP Stack. Connect Hydraulic hoses f/ accumulator system to Rams & Bell Nipple. Perform BOP Press test as NIOC Policy: Press test Ann Preventer to 500/3500^{psi}, 4-1/2" * 7" VBR Top ram, Shear/Blind Ram, All manual/HCR side outlet valve & C/M valves to 500/4500^{psi} for 5/10 min; "Ok". Meanwhile rectify several leakages. Press test burning line & related valve to 500/1000^{psi} for 10 min; "Ok". Function test accumulator system, driller & auxiliary remote panels; "Ok". Due to unable to establish circulation through the string and discrepancies between in/out mud weight values. In order to well safety before unlatch the anchor seal from the PKR and addressing trapped pressure below the 7" PKR, Wait on daylight to proceed with punching the string from 2800^{m}. Make & R/B totally 51 Stds 5" DP to Derrick.

Due to unable to establish circulation through the string and discrepancies between in/out mud weight values. In order to well safety before unlatch the anchor seal from the PKR and addressing trapped pressure below the 7" PKR, Wait on daylight to proceed with punching the string from 2800^{m}. Retrieve 6-5/16" 5K TWCV. P/U & Screw 7" Vam Thread L/J on TBG HGR. M/U 7" Vam * 4-1/2" IF + 4-1/2" IF * 7" Vam (c/w 2" 1502 side entry). R/U Wireline logging Equip. (Sealand Co.). Install Wire Line BOP on 7" XOS. Press. Test same w/ 1000^{psi}; "Ok". L/U f/ 7" * 9 5/8" Ann. to C/M.

Held PJSM. Load & Armed 5 No. HMX Bullet on carrier. RIH w/L Punch Assy (Cable head, CCL, Wt. bar, Carrier, BTM Nose: Max OD: 1-11/16", Tot Len: 4.35^{m}) to 2794^{m}, Meanwhile perform depth correlation. Stop at shoot interval. Fire the bullet. Obs. Shooting indication. Punch Interval f/ 2793.6 to 2792.4^{m}. Established Circ. Thru string & Got Ann Returns contamination f/ 55 to 77^{pcf}. POOH W/L tools to 100^{m} While Slow Circ. thru completion string. Wait on daylight due to explosive material safety regulation. Cont. Slow Circ. thru completion string. w/ Max 1 BPM, 500^{psi} Press. (Totally Pump 140^{bbl} Mud 84^{pcf}).

Cont. Wait on daylight due to explosive material safety regulation. Slow Circ. thru completion string. w/ Max 1 BPM, 500^{psi} Press. After Totally Pump 230^{bbl} 84^{pcf} $CaCO_3$ Poly Mud. Got 10^{bbl} contaminate mud. Cont. Over Circ. Mud to uniform MW in/out. Cont. Wait on daylight due to explosive material safety regulation POOH to surface, L/D Sealand Punch ass. & check all bullet is Fired, B/O & L/D Wire line BOP & Equip. & X.O.S - f/u tools. M/U 5" DP on 7" vam thread L.j & connected to TDS, Check return from ann., work and try to pull out & retrieve Tubing Hanger in T.H.S w/ Max. 500^{klbs} overpull "No succ." Prepare & M/U New 7" * 4-1/2" N.vam X.O.S on Tubing Hanger w/ 6-1/2" Fishing Jar, 1 jt 6-1/2" D.C, 1 jt 5" DP Aabove it. Work on Pull out Tubing Hanger On T.H.S "No action Jar & Failure to achieve the result, try to pull out string W/Max 200^{klbs} over pull "No Succ." B/O 7" X.O.S from Tubing Hanger, pull out string & L/D jar. M/up 2 JTs 5" DPs (S-Grade) on 7" * 4-1/2" N.vam X.O.S & Engage w/ Tubing Hanger that Has been Installed On T.H.S. Try To Pull out Tubing Hanger w/Max. 510^{klbs} Overpull "No succ", Decided to Warm up T.H.S body and Work on retrieve Tubing Hanger.

Cont. Work on Pull out Tubing Hanger in THS, OBS Stuck Tubing Hanger in Tubing Head Spool, Apply 500^{psi} in Ann. while Pull out string w/ Max. 530^{klbs}, OBS. Dec. Hookload to 470^{klbs} Got return mud & Movment 20^{cm} Tubing hanger from THS seating area, Cont. Reverse Circ. Mud to clean & flush the same area. Try to open the traveling JT & Stuck Mandrel w/Max 530^{klbs} Several times, No Movment. B/O 7" X.O.S from Tubing Hanger, pull out & L/D 2 jts 5" DPs (S-Grade), P/up 7" N.vam thread L.J and M/up 7" * 4-1/2" N.vam X.O.S + 5" DP (S-Grade) Pup Jt, Try to Pull out Traveling Jt w/Max. 530^{klbs} over pull OBS. 1.5^{m} Movment, try To Movment w/ Max. 550^{klbs} OBS. Drop string WT to 370^{klbs} Suddenly & String Got free. (Comp. strg. Weight to pkr).

POOH & OBS Tubing Hanger (Baker Type) to Surf. , Connected TDS and Circ. Mud Thru string Till BTMs up & uniform MW in/out meanwhile R/U OEOC CSG Running Equip.

Cont. Circ. Mud Thru string Till uniform MW in/out Checked Return Mud Noticed Cut the MW and OBS. Oil gas in return (Totally 350^{bbl}). Disconnect TDS, L/D 7" N.vam L.J + 7" * 4-1/2" N.vam X.O.S + 5" DP (S-Grade) Pup Jt. POOH Ret. Completion string as: B/O & L/D Tubing Hanger & fluted Adapter + 5 JTs 7" Tubing 29#, L-80 N.vam + 5 No. 7" Fluted Swage 29#, L-80 N.vam + 7" baker type 3SV w/ Long (20$^{ft.}$) + Short (6$^{ft.}$) Flow Coupling & Totally 97 Jts 7" Tubing 29#, L-80 N.vam While Circ. Mud C.W.H w/ 4-6 BPHL. Cont. POOH Completion string To Surface and OBS. Cutted off

Comp. String from Box of Expan. JT $20^{ft.}$ stroke N.vam (fully open position) While C.W.H w/ 4-6 BPHL.

Pulled out Comp. string Description: Tubing Hanger & fluted Adapter + 5 JTs 7" Tubing 29#, L-80 N.vam + 5 No. 7" Fluted Swage 29#, L-80 N.vam + 7" baker type 3SV w/ Long ($20^{ft.}$) + Short ($6^{ft.}$) Flow Coupling + 266 Jts 7" Tubing 29#, L-80 N.vam + 7" * 4-1/2" N.vam X.O.S + 6 JTs 4-1/2" Tubing 13.5#, L-80 N.vam. Remain Comp. String from TOF to Comp. PKR : Expan. JT $20^{ft.}$ stroke N.vam + 1jt 4-1/2" Tubing 13.5#, L-80 N.vam + 4-1/2" SSD N.vam + 1jt 4-1/2" Tubing 13.5#, L-80 N.vam + 4-1/2" Anchor Seal N.vam (Length:32^{m}). Fish Description: TOF Depht: 3302^{m}, OD: 5-3/8", ID: 4-3/8", TOF to BTM Comp. string: 47^{m}. During POOH OBS. Obstruction by slick line @ jt#229 (2795^{m}) , #242(2944^{m}), #248 (3001^{m}) also OBS. Plugged 7" * 4-1/2" N.vam X.O.S with debris of asphaltene and sand. Due to OBS. High TQ Conn. Used Rig tongs to B/O same.

R/D CSG Running Equip.(OEOC) meanwhile Wash & Clean Rig Floor, Circ. Mud C.W.H w/ 2-4 BPHL. In Order to Stand back Required 4-3/4" DCs + 3-1/2" HWDP & 3-1/2" DPs in Derrick, P/U & RIH W/ 18JTs 4-3/4" DCs + 60JTs 3-1/2" DPs jt by jt To 730^{m} While Washed, Hammerd, Measured and Pass 2" Drift thru all of them, Break Circ. Mud thru string @ 730^{m} W/ 2-4BPHL. POOH String to surface while R/B totally 6STDs 4-3/4" DCs + 20STDs 3-1/2" DPs in Derrick. P/U & RIH W/ 3-1/2" Spear + 2STDs 4-3/4" DCs + 6STDs 3-1/2" HWDPs to 200^{m} while P/U 3-1/2" HWDPs jt by jt, Circ. Mud C.W.H w/ 2-4 BPHL.

Cont. POOH W/ 3-1/2" Spear as chain out F/2550^{m} to Surface & Recoverd about 100-150^{m} Slick line, L/D 3-1/2" Spear while Circ. Mud C.W.H w/ 0-1 BPHL. Static Flow check @ two stage (2500^{m} & 900^{m}): "NL-NG". P/U & M/U 2" * 4" Taper tap & RIH W/ Fishing BHA#02 To 3290^{m} while Circ. Mud C.W.H w/ NL-NG.

Fishing BHA Description: 2" * 4" Taper tap + 4-3/4" Bit sub + 1jt 4-3/4" DC + 4-3/4" F.Jar + 1jt 4-3/4" DC + 2STDs 3-1/2" HWDPs + 20STDs 3-1/2" DPs + X.O.S. P/U 21JTs 5" DPs (S-Grade) jt by jt.

Cont. RIH W/ 2" * 4" Taper tap & Fishing BHA#02 F/ 3290 To 3305^{m} (2^{m} above Fish Depth), Record Upward & Downward WT W/ Pumping & W/O Pumping Clean TOF & Tag same @ 3307^{m}, RIH W/ Min. rpm & Slow circ mud, Engage w/ Fish & OBS. Press indication, Tap inside Fish, Keep string in Tension (10^{klbs}) and Rotate same 30 rounds Clockwise, In Order to Confirm catching the fish, Estab. Circ. Mud Check the press. & String Upward WT (were more than before). Fishing BHA Description: 2" * 4" Taper

tap + 4-3/4" Bit sub + 1jt 4-3/4" DC + 4-3/4" F.Jar + 1jt 4-3/4" DC + 2STDs 3-1/2" HWDPs + 20STDs 3-1/2" DPs + X.O.S.

POOH W/ 2" * 4" Taper tap & Fishing BHA#02 as chain out F/3307^{m} to Surface, Recoverd Fish Completely as below: Expan. JT 20ft stroke N.vam + 1jt 4-1/2" Tubing 13.5#, L-80 N.vam + 4-1/2" SSD N.vam + 1jt 4-1/2" Tubing 13.5#, L-80 N.vam + 4-1/2" Anchor Seal N.vam (Length:32^{m}). L/D Fish, Wash & Clean Rig Floor While Circ. C.W.H w/ NL-NG.

Wash and Clean Flow line, shale shakers, Divider box, Ditch lines, Change TDS elevator & Prepare 6JTs 4-3/4" DCs as required meanwhile change Top rams from 4-1/2" * 7" to 2-7/8" * 5" VBR and Perform Body Press. test same "OK", Circ. C.W.H w/ NL-NG. P/U & M/U 6" M.M J.Mill (T.S.E.K.H, New, S/N: 421, 5Blades, 5* 12/32" Port) & RIH w/ Clean out BHA#03 to 300^{m} While Circ. C.W.H w/ NL-NG. Clean out BHA#03 Description: 6" M.M J.Mill + 4-3/4" Bit sub (Float valve in) + 8STDs 4-3/4" DC + 2STDs 3-1/2" HWDPs + 20STDs 3-1/2" DPs + XOS. P/U 6JTs 4-3/4" DCs jt by jt while Washed, Hammerd and Measured and Pass Proper Drift thru same.

M/U Swage on (3-1/2" DPs) to F/U Strg., OBS. Shoot up SPP and Noticed Plugged Strg., Connected TDS and try to Estab. Circ. Mud While Jerk Strg. Several times "Succ.". Cont. RIH W/ 6" M.M J.Mill & C/O BHA#03 to 854^{m} Follow by 5" DPs to 3337^{m} (7" PKR Depth), String Took WT, Circ. BTMs Up while reciprocate String W/ 0-1 BPHL F/U & Break Circ. Mud each 10STDs.

Comm. Milling f/ 3337 to 3337.9^{m} (90^{cm}), OBS. Press Drop Suddenly and Noticed "No return", After Pump 43BBLs Mud "Got Return" While Monitor Mud Pit Level " Static". Cont. Milling f/ 3337.9 to 3338^{m} (10^{cm}), OBS. WOB Drop, Cont. RIH as R/D f/ 3338 to 3376^{m} W/ NL-NG. Milling Parameters: F.R:120-250gpm, SPP:300-1300psi, WOB:18-22klbs, TQ: 3-5klbs.ft, Rotation: 35-60rpm.

Cont. RIH as R/D f/3338 to 3454^{m}, OBS. Conn. Gas & Pit Gain (4 BPHG). Closed the well @ 3454^{m}, Circ. Mud to Kill the Well Thru C/M While weight Up Active Sys. mud To 83pcf Meanwhile OBS. Cut Return MW @ BTMs Up f/ 81 to 69^{pcf} Gradually. Over Circ. Mud Thru C/M by 83^{pcf} Mud while apply max. 300-400^{psi} back press. For one Hole vol. and Stop Circ. Due to shortage of 83^{pcf} Mud @ surface and unable to weight up same. Closed C/M and Monitor the Ann. press. while Prepared 82^{pcf} Mud (totally: 1200^{bbl} Pumpable). Start Circ. Mud thru C/M by 82^{pcf} Mud and apply Back Press., After pumping Totally 984^{bbl} 82-84^{pcf}, Got 84^{pcf} mud @ Return (min. Cut MW @ Return was 56^{pcf}) W/ NL-NG. Open the well and Check Pit Levels as Dynamic & Static "NL-NG".

Cont. RIH W/ 6" M.M J.Mill F/ 3454 to 3520^{m}, String Took WT, Connected TDS, try To Pass this Point as R/D with W/ F.R: 230gpm,WOB: 10klbs,Rotation: 5-10rpm

OBS. TQ Fluctuation (2-5$^{klbs.ft}$), Try To Wash & Push same W/ F.R: 240gpm & Apply max. 25^{klbs} three Times "No movment", Circ. BTM's Up @ 3520^{m} W/ 0-2 BPHL. P/U 6Jts 5" DPs jt by jt.

POOH W/ 6" M.M J.Mill F/ 3520^{m} to Surface While Circ. C.W.H W/ 0-2 BPHL. B/O & L/D 6" M.M J.Mill (15%Used) OBS. About 1^{m} Slick line on Wear Pads. Flow Check the Well @ (3260^{m} & 850^{m} On BHA) as Dynamic & Static "NL-NG".

P/U & M/U 2" * 4" Taper tap (New, Cylindersazi, S/N: CS7569) & RIH W/ Fishing BHA#04 To 100^{m} while Circ. Mud C.W.H w/ NL-NG. Fishing BHA Description: 2" * 4" Taper tap + 4-3/4" Bit sub + 1jt 4-3/4" DC + 4-3/4" F.Jar + 10STDs 3-1/2" HWDPs + 20STDs 3-1/2" DPs + X.O.S (Length: 870^{m}) Stopped Operation @ 100^{m} Due to Bad Weather situation (Dust storm) While slow Circ. Mud thru string w/ NL-NG.

Cont. RIH W/ 2" * 4" Taper tap & Fishing BHA#04 F/ 100 To 250^{m} while Circ. Mud C.W.H w/ NL-NG.

Cont. RIH W/ 2" * 4" Taper tap (New, Cylindersazi, S/N: CS7569) & Fishing BHA#04 F/ 250 To 3516^{m} (4^{m} above Fish) Record Upward & Downward WT W/ Pumping & W/O Pumping Clean TOF, RIH W/ Min. rpm & Slow Circ. mud, Engage with Fish, Try to Tapping "No succ.", Check String (3-4^{klbs} over weight), Chase the Fish w/ Soft R/D by 6-10^{klbs} Drag to 3641^{m} String Took WT @ 3641^{m}, Tap inside the Fish W/ Max. 30^{klbs} WT & 5$^{klbs.ft}$ TQ "OK". Check String Upward WT (Was more than before). In Order to Check 2" * 4" Taper tap For any Probably fish caugh, POOH W/ 2" * 4" Taper tap & Fishing BHA#04 as chain out F/3641 to 2500^{m} While Circ. Mud C.W.H w/ 0-1BPHL.

Cont. POOH W/ 2" * 4" Taper tap & Fishing BHA#04 as chain out F/2500^{m} to Surface While Circ. Mud C.W.H w/ 0-1BPHL. Check and L/D 2"*4" Taper tap While OBS. Engage Marked with 2" to 3-7/8" Out side Diameter and junk (slick line) mark on it. Stopped Operation Due to work on HYD. System of TDS (Severe Oil Leakage) and Fix same "OK" While Circ. Mud C.W.H w/ 0-1BPHL. P/U & M/U another 2" * 4" Taper tap (Used, Cylindersazi) & RIH W/ Last Fishing BHA#05 To 950^{m} while Circ. Mud C.W.H w/ 0-1BPHL. Stopped Operation @ 950^{m} Due to Bad Weather situation (Dust storm) While slow Circ. Mud thru string w/ 0-1BPHL. Cont. RIH W/ 2" * 4" Taper tap & Fishing BHA#05 f/ 950 to 2050^{m} while Circ. Mud C.W.H w/ 0-1BPHL. Break Circ.

Mud Thru string Each 15STDs. Stopped RIH @ 2050^{m} Due to Bad Weather situation (Severe wind) While slow Circ. Mud thru string w/ 0-1BPHL.

Cont. RIH W/ 2"- 4" Taper tap & Fishing BHA#05 f/ 2050 to 3474^{m} (4^{m} below KOP), String Took WT Max. 15^{klbs} Record Upward & Downward WT W/ Pumping & W/O Pumping Circ. Mud to Clean TOF, Try to Engage with Fish as per Procedure "No succ." Due to Dropped WT and Release the fish During Tapping Opreration, Chase the Fish to 3637^{m} String Took WT, Work on Fish as Procedure "Succ." POOH to 3593^{m} with 4-20^{klbs} Over Pull Suddenly OBS. Release the Fish @ 3593^{m}, Run Back to 3595^{m}, Took weight, Work on Fish by 2"- 4" Taper tap To Max. 25-35^{klbs} WT & 7$^{klb.ft}$ TQ "Succ." Check Press. Indication "OK". POOH with Normal drag to f/ 3595 to 2700^{m} While Circ. C.W.H w/ 0-1 BPHL. Connect TDS and Check string press. Each 500^{m} "OK". Stopped Operation @ 2700^{m} Due to Bad Weather situation (Dust storm) While Circ. C.W.H w/ 0-1 BPHL.

Cont. Wait on bad weather (Dust storm) @ 2700^{m}. Resume POOH chain out w/ 2" x 4" Taper tap f/ 2700^{m} to surface, While Circ. CWH; 0-1 BPHL. Obs. Packer & Tail retrieved successfully. L/D completion packer & Tail Jt by Jt (A piece of 7" PKR + 5" Mill out extension + 5" XOS N.Vam Box X 4-1/2" N.Vam Pin + 1 Jt 4-1/2" Tubing 13.5#, L-80 N.Vam + XOS 4-1/2" N.Vam Box * 3-1/2" HSC Pin + 3-1/2" NO-GO HSC + 3-1/2" Mule Shoe HSC) Length: 15^{m}. Meanwhile Obs. retrieve almost 15^{m} slick line wire inside fish. P/U & M/U 3-1/2" Cable spear below 1 Std 4-3/4" DC & RIH w/ 10 Stds 3-1/2" HWDP + 20 Stds 3-1/2" DP and Followed by 5" DPs to 900^{m}. Cont. RIH w/ 3-1/2" Cable spear f/ 900 to 2980^{m}; 0-1 BPHL. Slip & Cut 101 ft 1-1/2" Drlg line. Meanwhile Circ. Mud thru string; 0-1 BPHL. Resume RIH w/ 3-1/2" Cable spear to 3647^{m} (Took Wt.) Meanwhile wash down last 2 Stds & Recorded parameters @ three point inside 7"LNR (Before KOP, after KOP, After turn point) Work on 3.5" Cable spear as per procedure & try to engage w/ fish. Cont. RIH to 3725^{m} (Totally:78^{m}) w/ this parameters: Wt.: 2-6 Klbs, Rot:5-6 RPM, TQ: 2-4 Klbs-ft, Meanwhile check upward string Wt. @ progressive intervals; "OK". Stop operation. In order to check tools and string; POOH w/ Cable spear f/3725 to 2500^{m}, meanwhile F/U the well; 0-1BPHL.

Cont. POOH w/ Cable spear f/2500^{m} to surface, meanwhile F/U the well; 0-1BPHL. Check & B/O 3.5" Spear; Obs. Recovered approximately 7-8^{m} of slick line wire. P/U & M/U 3-1/2" Cable Spear & RIH by 2 Stds 3-1/2" HWDP to 56^{m}. Stop operation due to high wind speed. Resume RIH w/ 3-1/2" Cable Spear + 10 Stds 3-1/2" HWDP + 20 Stds 3-1/2" DP + XOS & Followed by 5" DPs to 3200^{m}. 0-1 BPH Losses.

Cont. RIH w/ 3-1/2" Cable Spear f/ 3200 to 3725^{m}, while W/D last 2 Stds. Cont. RIH to 3770^{m}, Meanwhile work on 3.5" Cable spear as per procedure & rotate string @ progressive intervals to change orientation.

POOH w/ Cable spear f/3770^{m} to surface, meanwhile F/U the well; 0-1BPHL. Check & B/O 3.5" Spear; Obs. Recovered approximately 40cm of slick line wire. RIH w/ 5-7/16" Wire grab & Previous BHA to 3200^{m}, 0-1 BPHL.

Cont. RIH w/ 5-7/16" Wire grab f/ 3200 to 3770^{m}. Cont. RIH to 3778^{m}, Meanwhile work on wire grab as per procedure and Try to engage w/ fish in several times and rotate string to change orientation. Decided to POOH to surface & Check string. POOH w/ Wire grab f/3778^{m} to surface, meanwhile F/U the well; 0-8 BPHL. No recovered Junk or wire. P/U & M/U 6" M.M Junk Mill + 4-3/4 Bit Sub (Float valve in) & RIH w/ 1 Std 4-3/4" DC + 10 Stds 3-1/2" HWDP + 20 Stds 3-1/2" DP & Followed by 5" DPs to 1300^{m}, F/U the string & Break Circ. Every 15 Stds; 6-8 BPH Losses.

Cont. RIH w/ 6" M.M J.Mill f/ 1300 to 3778^{m} (5" L.Lap), F/U the string & Break Circ. Every 15 Stds; 8-2 BPH Losses. Meanwhile wash Dn last 2 Std & Confirm 5" L.Lap. Circ. BTM's Up & Uniform MW to 85^{pcf}; 2 BPH Losses. Perform static flow check; 1 BPH Losses. POOH w/ 6" M.M J.Mill f/ 3778 to 850^{m}, F/U the well; 0-1 BPHL. Install G Board

Cont. POOH w/ 6" M.M J.Mill f/ 850^{m} to surface, F/U the well; 0-1 BPHL. L/D Mill. Change elevator. P/U & M/U 14 Jts 3-1/8" DC (Jt by Jt) & RIH to 220^{m}. Meanwhile wash & Pass drift thru all tubulars. Establish Circ.; Ok. POOH to surface and R/B to derrick.

P/U & M/U 3-1/2" M.M.J.Mill + 3-1/4" Bit Sub & RIH w/ 5 Stds 3-1/8" DC + 3Stds 2-7/8" DP + 2Stds 3-1/2"HWDP + 4-3/4" Fishing Jar + 8 Stds 3-1/2" HWDP + 20 Stds 3-1/2" DP & Followed By 5" DPs to 3770^{m}, Circ. Mud every 10 Stds; 0-1 BPHL.

Cont. RIH w/ 3-1/2" M.M J.Mill f/ 3770 to 3777.65^{m}. Took Wt. Commence milling & Clean out f/ 3777.65 to 3778^{m}; 0-1 BPHL. Clean out Parameters: WOB: 2-3 Klbs, Rot: 15-20 RPM, TQ: 2.5-2.8 Klbs-ft, FR: 90-50 GPM, SPP: 1300-500 psi. POOH w/ 3-1/2" M.M J.Mill f/ 3778 to 200^{m}, F/U the well; 0-1 BPHL.

Cont. POOH w/ 3-1/2" M.M J.Mill f/ 200^{m} to surface, F/U the well; 0-1 BPHL. L/D Mill (10% Used). Obs. wire indication on Mill. RIH w/ 2-7/8" Cable Spear + 29 Jts 3-1/2" HWDP + 20 Stds 3-1/2" DP + XOS & Followed by 5" DPs to 3778^{m} (TOF). Took Wt.

Work on Spear to 3780.5[m] & Try to Catch Fish. P/U string to 3777[m]; Obs. Overpull & Catched fish. Run back to 3780.5[m] & Catch again fish. POOH w/ 2-7/8" Cable Spear w/ 20-25Klbs Overpull f/ 3778 to 3470[m] (KOP), Cont. POOH w/ 15[klbs] Overpull f/ KOP to 3285[m] (7" L.Lap), Cont. POOH w/ normal drag to 1400[m] F/U the well; 0-1 BPHL.

Cont. POOH w/ 2-7/8" Cable Spear f/ 1400m to surface, F/U the well; 0-1 BPHL. Obs. Recovered approximately 70[cm] wire. RIH w/ 2-7/8" Cable Spear + 29 Jts 3-1/2" HWDP + 20 Stds 3-1/2" DP + XOS & Followed by 5" DPs to 3295[m] (10m inside 7" LNR). Held up string & Took 10[klbs] Wt. Cont. RIH & Push Fish w/ 10-20[klb]s Wt to 3780[m]. Work on Spear to 3783[m] & Try to Catch Fish. P/U string, Obs. Overpull & Catched fish. POOH w/ 2-7/8" Cable Spear w/ 5-25[klb]s Overpull f/ 3783 to 3285[m] (7" L.Lap), Cont. POOH w/ normal drag to 2900[m], F/U the well; 0-1 BPHL.

Cont. POOH w/ 2-7/8" Cable Spear f/ 2900[m] to surface, F/U the well; 0-1 BPHL. Obs. Recovered approximately 39[m] Slickline wire. Packer slips segments. RIH w/ 2-7/8" Cable Spear 14 Jts 3-1/8" DC + 3Stds 2-7/8" DP + XOS + 1 Std 3-1/2" HWDP + 4-3/4" Jar + 9 Stds 3-1/2" HWDP + 20 Stds 3-1/2" DP + XOS & Followed by 5" DPs to 1100[m]. Slip & Cut 110[ft.] 1-1/2" Drlg Line, Circ. Mud thru string; 0-1 BPHL. Work on TDS, Circ. Mud thru string; 0-1 BPHL. Resume RIH w/ 2-7/8" Cable Spear to 2750[m]; 0-1 BPHL.

Cont. RIH w/ 2-7/8" Cable Spear f/ 2750 to 3783[m]. Meanwhile wash down last 2 Stds & Record S/O, P/U & Off-BTM TQ @ Top of 7" L.Lap , Before KOP & Top of 5" L.Lap. Work on 2-7/8" Cable spear & try to catch fish w/ 5-6[klbs] Wt. in several times. Pass this point (3783[m]). Cont. W/D & Push the fish f/ 3783 to 3807[m]; 0-1 BPHL. Due to change Disc break suddenly failure of the brake system in the drawworks; Apply 80[klbs] Wt. on spear to Push the fish to 3809[m] & Stuck string. Work on stuck string upward & Jarring up; String got Free.

In order to check string & Tools; POOH w/ 2-7/8" Cable Spear to 550[m], F/u the well; 0-1 BPHL.

Cont. POOH w/ 2-7/8" Cable Spear f/ 550[m] to surface, F/U the well; 0-1BPHL. No recovered wire. P/U & M/U 3-1/2" M.M.J.Mill (Cylander Sazi, 3 Blade, 3cm metal muncher cutters, 3*11/32" Port size, SN: CS6822) + 3-1/4" Bit Sub & RIH w/ 3 Stds 3-1/8" DC to 80[m]. Stop Operation due to work on drawworks low clutch chain. Resume RIH w/ 8 Jts 3-1/8" DC + XOS + 1 Std 3-1/2"HWDP to 186[m], 1 BPHL. Stop operation, due to High Wind Speed. Resume RIH w/ 4-3/4" Fishing Jar + 9 Stds 3-1/2" HWDP +

20 Stds 3-1/2" DP + 10 Stds 3-1/2" HWDP & Followed by 5" DPs to 3783^{m}, while W/D last 2 stds; 0-1 BPHL.

Soft wash & Ream Dn f/ 3784 to 3807^{m}. Milling & push down fish f/ 3807 to 3827.5^{m}. Push & Ream Dn fish to 3887.5^{m}; 0-1 BPHL. Obs. Suddenly no return. Got return after pump totally 40^{bbl}.

Milling & Push Down to 3898^{m}. Cont. Milling w/ low progress to 3898.5^{m} till M.N. Meanwhile decrease MW to 84^{pcf} & Work on mud rheology ; 4-5 BPHL. Milling Parameters: WOB: 2-4 Klbs, Rot: 15-25 RPM, TQ: 2.5-3.5 Klbs-ft, FR: 80-85 GPM, SPP: 1000-1100 psi.

Cont. Milling w/ low progress f/ 3898.5 to 3900^{m}, Meanwhile Balanced MW in/out to 84^{pcf} w/1-2 BPHL. Milling Parameters: WOB: 1-3 Klbs, Rot: 15-25 RPM, TQ: 2.5-3.5 Klbs-ft, FR: 50-90 GPM, SPP: 500-1000 psi.

Stop Milling Operation @ 3900^{m} Due to Low Progress Decided to POOH and check the Mill, POOH W/ 3-1/2" M.M.J.Mill & C/O BHA f/ 3900 to 150^{m} while C.C.W.H w/ 0-2 BPHL. Static Flow check @ 3780^{m}, 1800^{m} & 250^{m} "1 BPHL".

Cont. POOH W/ 3-1/2" M.M.J.Mill & C/O BHA f/ 150^{m} To Surface, OBS. 3-1/2" M.M.J.Mill & 3-1/4" Bit sub Cutted off from pin of first jt of 3-1/8" DC and left in Hole w/ 0-2 BPHL. Fish Length: 1.18^{m}.

P/U & M/U 5-7/8" MT.Bit (Used, King dream, 217, Open) + 4-3/4" Bit sub (Float in) + 10STDs 3-1/2" HWDPs + 5STDs 3-1/2" DPs + 5STDs 5" DPs to 560^{m} as kill strg and Slow circ. Mud thru strg. w/ 1 BPHL. POOH w/ 5-7/8" MT.Bit to Surface, L/D the Bit, M/U 4" New M.M.J.Mill (1/16" UG), Check 3-1/4" Bit Sub Conn."Not Ok".While Wait on Rec. New Bit Sub from OEOC, Circ. C.W.H w/ 1 BPHL. P/U & M/U 4" New M.M.J.Mill (1/16" UG) & C/O BHA Followed By 5" DPs to 2100^{m} w/ 1 BPHL. Clean Out BHA Description: 4" New M.M.J.Mill + 3-1/8" Bit sub + 14Jts 3-1/8" DC + X.O.S + 1STDs 3-1/2" HWDPs + 4-3/4" Fishing jar + 9STDs 3-1/2" HWDPs + 20STDs 3-1/2" DPs + X.O.S. Break Circ. Mud thru strg Each 700^{m}.

Cont. RIH w/ 4" New M.M.J.Mill & C/O BHA F/ 2100^{m} to 3779^{m} (5" L.Lap), Try to Pass This point W/Pumping "No Succ.", Hard to Med Wash & Ream Down & Cleance 5" LNR to 3888.6^{m} (10^{m} above TOF) Push Down & Milling to 3888.7^{m} w/Low Parameters "No Progress" Try to Pass The Obstacle, OBS. Stall String Frequently & Very Low Progress, Decided to POOH and check Mill Condition w/ 1 BPHL. Record

Parameters (HL, SPP, TQ) Before 7" L.Lap, KOP & 5" L.Lap. Milling Parameters: WOB: 1.5-3 klbs, Rot: 15-20 rpm, TQ: 3-3.3 klbs-ft, FR: 70 gpm, SPP: 780 psi.

POOH w/ 4" M.M.J.Mill & C/O BHA F/ 3888.7 to 1000^{m} While C.C.W.H w/ 0-1 BPHL. Cont. POOH w/ 4" M.M.J.Mill & C/O BHA F/ 1000^{m} to Surface, L/D 4" M.M.J.Mill (5% Used) While C.C.W.H w/ 0-1 BPHL. OBS. Ring Mark (3-7/8") on Nose of 4" Mill. P/U & M/U 3-15/16" Used M.M.J.Mill & C/O BHA Followed By 5" DPs to 3779^{m} (5" L.Lap), Cont. RIH as Med. to Soft Wash Down & Cleance 5" LNR to 3870^{m} w/ 0-1 BPHL. Clean Out BHA Description: 3-15/16" Used M.M.J.Mill + 3-1/8" Bit sub + 5STDs 3-1/8" DC + X.O.S + 1STDs 3-1/2" HWDPs + 4-3/4" Fishing jar + 9STDs 3-1/2" HWDPs + 20STDs 3-1/2" DPs + X.O.S. Record Parameters (HL, SPP, TQ) Before 7" L.Lap, KOP & 5" L.Lap. Break Circ. Mud thru strg Each 700^{m}.

Cont. RIH w/ 3-15/16" Used M.M.J.Mill & C/O BHA as Med. to Soft Wash Down f/ 3870 to 3888.7^{m}, Strig Took WT, Try to Pass W/Pumping "No Succ.", Resume Milling w/ Low Parameters f/ 3888.7 to 3888.8^{m} (10^{cm}) While Stall String Several times, Try to Pass Obstruction Point @ 3888.8^{m} "No Succ.", Stop Milling Operation Due to "No Progress" and Decided to POOH. Milling Parameters: WOB: 1-2 klbs, Rot: 15-25 rpm, TQ: 3-3.5 klbs-ft, FR: 85 gpm, SPP: 930psi.

In Order to change BHA, POOH w/ 3-15/16" Used M.M.J.Mill f/ 3888.8^{m} to Surface, L/D 3-15/16" Used M.M.J.Mill (20% Used) While C.C.W.H w/ 0-1 BPHL. OBS. Ring Mark on Nose of 3-15/16" Mill.

P/U & M/U 3-1/2" Used M.M J.Mill & RIH w/ Clean Out BHA to 200^{m} w/ 0-1 BPHL. Meanwhile RIH Change 5jts 3-1/8" DCs with 5jts 2-7/8" DPs. Clean Out BHA Description: 3-1/2" M.M.J.Mill (Used, Cylinder Sazi, 3 Blade, 3*11/32" Port size, SN: CS6823) + 3-1/8" Bit sub + 10Jts 3-1/8" DC + 5Jts 2-7/8" DPs + X.O.S + 1STDs 3-1/2" HWDPs + 4-3/4" Fishing jar + 9STDs 3-1/2" HWDPs + 20STDs 3-1/2" DPs + X.O.S.

Cont. RIH w/ 3-1/2" Used M.M J.Mill & C/O BHA f/ 200 to 3779^{m} (5" L.Lap), Cont. RIH as Med. to Soft R/D to 3899^{m}, String Took WT @ This Point w/ 0-1 BPHL. Clean Out BHA Description: 3-1/2" M.M.J.Mill (Used, Cylinder Sazi, 3 Blade, 3*11/32" Port size, SN: CS6823) + 3-1/8" Bit sub + 10Jts 3-1/8" DC + 5Jts 2-7/8" DPs + X.O.S + 1STDs 3-1/2" HWDPs + 4-3/4" Fishing jar + 9STDs 3-1/2" HWDPs + 20STDs 3-1/2" DPs + X.O.S. Break Circ. Mud thru strg Each 700^{m}. Try to Resume Milling & Push the Obstacle W/ Low Parameters @ 3899^{m} "No Progress", (Confirmed TOF), Stop Milling Operation and Decided to POOH w/ 0-1 BPHL. Milling & Push Parameters: WOB: 1-2 klbs, Rot: 10 rpm, TQ: 2-3 klbs-ft, FR: 50 gpm, SPP: 400psi.

In Order to Perform Fishing job, POOH w/ 3-1/2" Used M.M.J.Mill & C/O BHA f/ 3899^{m} to 600^{m} While C.C.W.H w/ 0-1 BPHL. Cont. POOH w/ 3-1/2" Used M.M.J.Mill f/ 600^{m} to Surface, L/D 3-1/2" Used M.M.J.Mill (30% Used) While C.C.W.H w/ 0-1 BPHL.

P/U & M/U 4-1/16" Overshot & RIH w/ Fishing BHA to 450^{m} w/ 0-1 BPHL. Fishing BHA Description: 4-1/16" Overshot (Dressed w/ 3-1/8" Spiral Grapple + 3-1/8" Control & Top PKR) + 2STDs 2-7/8" DPs + 3STDs 3-1/8" DC + X.O.S + 1STDs 3-1/2" HWDPs + 4-3/4" Fishing jar + 9STDs 3-1/2" HWDPs + 20STDs 3-1/2" DPs + X.O.S.

Slip & Cut Drlling Line (100$^{ft.}$) While Slow Circ. Mud thru string @ 450^{m} w/ 0-1 BPHL. RIH w/ 4-1/16" Overshot & Fishing BHA f/ 450 to 2100^{m} w/ 0-1 BPHL. Stopped Operation @ 2100^{m} Due to Bad Weather situation (Severe Wind) While slow Circ. Mud thru string w/ 0-1BPHL. Cont. RIH w/ 4-1/16" Overshot & Fishing BHA f/ 2100 to 3730^{m} w/ 0-1 BPHL.

Cont. RIH w/ 4-1/16" Overshot & Fishing BHA f/ 3730 to 3760^{m}, String Took WT, Cont. RIH as W/D f/ 3760 to 3899^{m} (TOF) While Roatet string @ several spot, Circ. Mud to Clean TOF, Work on Fish as Procedure, Try to Guide the Fish and Engage with same, Check Indicate OBS. abnormal Drag & Over pull, Stop Fishing Operation, Decided to POOH and Check String w/ 0-1 BPHL. Fishing BHA Description: 4-1/16" Overshot (Dressed w/ 3-1/8" Spiral Grapple + 3-1/8" Control & Top PKR) + 2STDs 2-7/8" DPs + 3STDs 3-1/8" DC + X.O.S + 1STDs 3-1/2" HWDPs + 4-3/4" Fishing jar + 9STDs 3-1/2" HWDPs + 20STDs 3-1/2" DPs + X.O.S. Fish Description: 3-1/2" M.M.J.Mill + 3-1/8" Bit sub (Length: 1.18^{m}). W/D Parameters: F.R: 50-70gpm, SPP: 300-520psi. Record Parameters (HL, SPP, TQ) Before 7" L.Lap, KOP & 5" L.Lap.

POOH as Pump Out w/ abnormal Over Pull f/ 3899 to 3779^{m} (5" L.Lap), Cont. POOH f/ 3779 to 600^{m} on elevator while Circ. C.W.H w/ 0-1 BPHL. Pump Out Prameters: F.R: 55-95gpm, SPP: 200-720psi.

Cont. POOH w/ 4-1/16" Overshot & Fishing BHA f/ 600^{m} to Surface, L/D 4-1/16" Overshot while Circ. C.W.H w/ 0-1 BPHL. No indication of Fish Engagement was observed inside the Overshot.

In Order to Perform Magneset Plug Job, P/U & RIH w/ 5-7/8" C.Cut + 20Stds 3-1/2" DPs Followed by 5" DPs to 3270^{m} (15^{m} Above 7" L.Lap), Circ. Mud till Uniform MW in/out meanwhile Prepare Magneset solution W/ 0-1 BPHL.

Perform Magneset Balance Plug Job As: Held PJSM, Pump F.Water as Spacer Ahead, Mix & Pump 25^{bbl} Magneset Slurry (100^{pcf}, 8 MT) Pump F.Water as Spacer Behind, Displaced Magneset Slurry With 167^{bbl} Mud, POOH f/3270 to 2900^{m} (12STDs), Flush the string and C.B.U w/ NL-NG. Cont. POOH f/2900 to 500^{m} While Circ. C.W.H w/ NL-NG.

Cont. POOH w/ 5-7/8" C.Cut f/500^{m} to Surface, L/D same While Circ. C.W.H w/ NL-NG. RIH w/ 1STDs 6-1/2" DC + 11STDs 5" DPs + 9-5/8" RTTS PKR + 6-1/2" Circulating Valve + 1jts 5" DPs + 5" Safety Valve (in Close Position) + 1STDs 5" DPs to 385^{m}, Set RTTS PKR @ 40^{m} as Per RTTS Specialist Procedure , Press. Test RTTS PKR against Top Rams "OK", Unscrew Last STDs 5" DP from 5" Safety Valve & R/D same. Tail string Below the 9-5/8" RTTS PKR: 1STDs 6-1/2" DC + 11STDs 5" DPs.

Hang Up 13-5/8"-10K BOP Stack, N/D 11" 5K * 13-5/8" 10K DSA Pack off + 13-5/8" 3K * 11" 5K T.H.S, Rough Cut 9-5/8" CSG Neck Dress and Bevel same, Install New 11" 5K TOP * 13-5/8" 5K BTM (MSP Co.) on 13-5/8" 5K TOP * 20-3/4" 3K BTM C.H.S. "OK", Inject Plastic Packing & Energized P-Seals, Press. Test P-Seals (1&2) w/ 4500^{psi} Each one for 15min "OK" (Confirmed by Client), SET 13-5/8"-10K BOP Stack In Progerss. Offline Job: Assembel Section "C" Wellhead and Press. test (Body & Inflow) Side Valves w/ 4500^{psi} "OK". P-Seal#1: Cavity Between (9-5/8" CSG Neck + CSG Hanger + Ring Gasket + 13-5/8" 5K T.H.S Body). P-Seal#2: Cavity Between (9 5/8" CSG Neck + 13-5/8" 5K T.H.S Body + P-SEAL 1).

Cont. N/U 13-5/8"-10K BOP Stack (Shaffer Type): N/U 11" 5k * 13-5/8"-10k DSA + 13-5/8" 10k Spacer Spool on 11" 5K THS. Tighten nuts. N/U Single BTM Rams. 13-5/8" 10K Drlg Spool (SOVs have already been installed), Double rams (Top Rams 2-7/8" * 5" VBR & Middle Rams Shear/Blind), 13-5/8" 5K Annular Preventer. Connect 2" & 4" choke line & 2" Kill Lines to BOP Stack. Connect Hydraulic hoses to Rams. N/U Bell Nipple. Perform BOP Press test as NIOC Policy: Press test Ann Preventer to 500/3500^{psi}, 2-7/8" * 5" VBR Top ram, Shear/Blind Ram, 5" Fix, All manual/HCR side outlet valve & C/M valves to 500/4200^{psi} for 5/10 min; "Ok". Meanwhile rectify several leakages. Press test burning line & related valve to 500/1000^{psi} for 10 min; "Ok". Function test accumulator system, driller & auxiliary remote panels; "Ok". Ret. 11" plug tester. RIH w/ 1 std 5" DP to 27^{m} and Screw on the 5" FOSV. Unset 9-5/8" RTTS. POOH w/ 5" RTTS PKR Assy to surface & L/D same. Cont. POOH & R/B RTTS tail. Install 11" Wear bushing. P/U & M/U 8-3/8" TCI Bit (Kingdream, Used, 537,3*16/32" NZLs) + 6-1/2" Bit Sub (Float valve in) and RIH with 1 Std 6-1/2" DC to 27m, P/U & RIH w/

2 Stds 5" HWDP Jt by Jt & followed by 5" DPs to 1400^{m}, F/U string & Break Circ. Every 15 stds; NL-NG.

Cont. RIH w/ 8-3/8" TCI Bit & D/O BHA (#22) f/ 1400 to 3160^{m} (TOC), Meanwhile W/D last 3stds. F/U string & Break Circ. Every 15 stds; NL-NG. While P/U & RIH w/ 24 Jts 5" DP (Jt by Jt). Cont. W/D to 3180^{m}. D/O Soft to Med Magneset plug f/ 3180 to 3270^{m} (BTM of the plug). Cont. Wash down to 3285^{m} (7"L.lap). Pump and Circ. Out 40^{bbl} Hi-Vis Pill. Over Circ. mud till clean shakers. Commence POOH w/ 8-3/8" TCI Bit & D/O BHA f/ 3285 to 2950^{m}, F/U the well; NL-NG. Stop operation due to high wind speed.

Resume POOH w/ 8-3/8" TCI Bit & D/O BHA to 800^{m}, F/U the well; NL-NG. Wash & Clean mud tanks to prepare Comp. fluid. Prepare 100^{bbl} 84^{pcf} $CaCl_2$ brine.

Cont. POOH w/ 8-3/8" TCI Bit & D/O BHA f/ 800^{m} to surface, F/U the well; NL-NG. L/D Bit. (Bit Dull: 1-1-WT-A-E-I-PN-BHA) P/U & M/U 5-7/8" MT Bit (Kingdream, Used, 217,3*Open NZLs) + 7" Full circle CSG Scraper + 4-3/4" Bit Sub and RIH 2 Stds 4-3/4" DC + 3 Stds 3-1/2" HWDP + 38 Jts 3-1/2" DP + XOS +D.Pin + 9-5/8" Full circle CSG Scraper + 6-1/2" Bit Sub + 2 Stds 5" HWDP & followed by 5" DPs to 3779^{m} (5" L.Lap). Meanwhile scrape inside 7" LNR & 9-5/8" CSG; NL-NG. Pump & Circ. Out 40^{bbl} Hi-Vis Pill & Reciprocate string till clean shakers; NL-NG.

Commence POOH w/ 5-7/8" MT Bit & 7" * 9-5/8" Tandem scrapers f/ 3779 to 1600^{m}, F/U the well; NL-NG. Cont. POOH w/ 5-7/8" MT Bit & 7" * 9-5/8" Tandem scrapers f/ 1600^{m} to surface, F/U the well; NL-NG. Meanwhile L/D 9-5/8" & 7" Scrapers & 5-7/8" Bit. Bit Dull: 2-2-BT-A-E-I-LT-Log. R/U Wireline Equipment & Assemble SeaLand Co. CCL/GR/SBT/VDL Logging tools. Meanwhile Ret. 11" Wear bushing, L/D mouse hole & Set 7" shooting nipple. Install logging BOP. RIH w/ W/L logging tools (CCL/GR/SBT/VDL: Max OD: 3.62", Total Len: 16.32^{m}, Total Wt.: 379^{kg}) f/ surface to 3760^{m}. Obs. Leakage and failure in tools . Pull out tools to surf. Replace logging tools w/ back up tools. RIH w/ W/L logging tools (CCL/GR/SBT/VDL for 7" LNR) to 3774^{m}. Power on SBT tools, Log up f/ 3774 (5^{m} above 5"L.Lap) to 3260^{m}. Meanwhile perform repeat log f/ 3700 to 3610^{m}. Power off tools, POOH W/L Logging tools to surface.

L/D SeaLand Co. CCL/GR/SBT/VDL Logging tools & Equip. Assemble TTRM/CCL/GR/CDR/CBIL Logging tools for 7" LNR. RIH w/ W/L Logging tools (Max OD: 4.25", Total Len: 19.97^{m}, Total Wt.: 513.6 ^{kg}) to 3700^{m}

RIH w/ W/L Logging tools f/ 3700 to 3760^{m}. Held up. Try to pass this point; No-Succ. Power on CBIL tools, Log up f/ 3760 (19^{m} above 5"L.Lap) to 3285^{m}. Meanwhile perform repeat log f/ 3500 to 3400^{m}. Power off tools, POOH W/L Logging tools to surface. Change Previous TTRM/CCL/GR/CDR/CBIL Logging tools over body for 9-5/8" CSG. RIH w/ W/L Logging tools to 3285^{m} (Top of 7" L.Lap). Power on CBIL tools, Log up f/ 3281 to 50^{m}. Meanwhile perform repeat log f/ 150 to 50^{m}. L/D SeaLand Co. CBIL Logging tools & R/D Logging Equip. Set 11" Wear busing in THS. While wait on client (PPL/PEDEC) to make decision, RIH w/ 8-3/8" TCI Bit + 6-1/2" Bit Sub + 2 Stds 5" HWDP & 5" DPs to 300^{m}. Established slow Circ. Thru string; NL-NG.

Slow Circ. Thru string; NL-NG. POOH w/ 8-3/8" TCI Bit to surface. L/D Bit. P/U & M/U 7-5/16" Polish Mill (PPA, 4 X 16/32" Port Size, SN: PPA-052), RIH w/ 1 Std 6-1/2" DC + 2 Stds 5" HWDP & Followed by 5" DPs to 900^{m} till M.N. NL-NG.

Cont. RIH w/ 7-5/16" Polish mill f/ 900 to 3289^{m} (7"L.Lap), While W/D Last Std. Dress, Polish & Clean inside 7" TBS several times. Tag LG @ 3291^{m} & Try to take LG mark by apply max 12^{klbs} Wt & 15-30 RPM as per PPA CO. instruction by HGR Man. CBU; NL-NG POOH w/ 7-5/16" Polish Mill f/ 3285 (7"L.Lap) to 3170^{m}. Stop operation due to high wind speed, Meanwhile slow Circ. Thru string; NL-NG. Resume POOH w/ 7-5/16" Polish Mill f/ 3170 to 100^{m}, F/U the well; NL-NG.

Cont. POOH w/ 7-5/16" Polish Mill f/ 100^{m} to surface, F/U the well; NL-NG. L/D 7-5/16" Polish mill; Obs. 6-7/8" Mark of LG on same. P/U & M/U 7" SN Packer Assy included: 7" Seal Nipple (PPA Co, 29#, L-80, Dressed w/ 4 set V-Packing, Length: 95^{cm}, ID:6-1/8", OD:7-1/4"), LG c/w PKR & Slips (PPA Co, 29#, L-80, ACME), Tie back sleeve (PPA Co, 29#, L-80, Length: 1.80^{m}, ID:7-3/8", OD:8-1/4") Check running tools rotating function f/ LG; OK. RIH w/ 1 Std 6-1/2"DCs & 2 Stds 5" HWDP & followed by 5" DPs to 3289^{m}; NL-NG. Sting in previous TBS; Obs. Hold 200^{psi}. Pump off, Sting in fully in previous Tie back sleeve while Obs. seals drag. Apply 25 ^{klb} on packer to set slips; Obs shearing indication of the shear pins on M/D, Apply 45^{klb} more (Totally 70^{klb}) on packer & keep for 10 min. P/U string to max 20^{klbs} overpull & Pull test; "Ok". S/O 10^{klbs} on PKR & Rotate string 17 forward turn & released running tools. P/U String without overpull. (New 7" L.Lap@ 3286.5^{m}) POOH w/ SN Packer running tools f/ 3286.5 to 2300^{m}, F/U the well; NL-NG. Slip & Cut 97 ft 1-1/2" Drlg line, Meanwhile slow Circ. Thru string; NL-NG. Resume POOH w/ SN Packer running tools to 950^{m}, F/U the well; NL-NG.

Cont. POOH w/ SN Packer running tools f/ 950[m] to surface, F/U the well; NL-NG. Obs. Running tools; Ok. L/D same. L/D 1 Std 6-1/2" (Jt by Jt). RIH w/ 8 Stds 4-3/4" DC & 10 Stds 3-1/2" DP (Excess tubular) to 500[m], POOH & L/D 30 Jts 3-1/2" DP, 24 Jts 4-3/4" DC (Jt by /Jt); NL-NG. RIH w/ OEDPs (3 Stds 3-1/8" DC, 3 Stds 2-7/8" DP, XOS, 10 Stds 3-1/2" HWDP, 10 Stds 3-1/2" DP) & Followed by 5" DPs to 3898[m] (BTM); NL-NG.

Completion Operation Summary:

Spot 60[bbl] Non-Solid brine in 5" LNR & 7" LNR as balance. POOH to 3515[m]. Displace the well w/ 800[bbl] 84[pcf] Non-Solid brine. Meanwhile add 1% Vol Corrosion Inhibitor, 0.5 % Vol H_2S Scavenger & O_2 Scavenger to Non-Solid brine. Got 60[bbl] contaminated w/mud on return. Perform flow check; " Static". Resume POOH w/ OEDPs to 2430[m] & L/D Totally 162 Jts 5" DP till M.N, F/U the well; NL-NG. Meanwhile Flow check @ 3000[m]; Static. Stop operation. M/U 5" FOSV.

Resume POOH w/ OEDPs f/ 2430 to 1670[m] & L/D 79 Jts 5" DP, F/U the well; NL-NG. Stop operation due to high wind speed. Meanwhile monitor pit level; NL-NG. Resume POOH w/ OEDPs to 1300[m] & L/D 39 Jts 5" DP (Totally 280 Jts), F/U the well; NL-NG.

Cont. POOH w/ OEDPs f/ 1300 to 370[m] & L/D 53 Jts 5" DP, 6 Jts 5" HWDP, 30 Jts 3-1/2" DP & 8 Jts 3-1/2" HWDP, F/U the well; NL-NG. Stop operation due to high wind speed. Meanwhile monitor pit level; NL-NG. Resume POOH w/ OEDPs to 300[m] & L/D 7 Jts 3-1/2" HWDP, F/U the well; NL-NG. Stop operation due to high wind speed. Meanwhile monitor pit level; NL-NG. Resume POOH w/ OEDPs to surface & L/D 9 Jts 2-7/8" DP, 9 Jts 3-1/8" DC, F/U the well; NL-NG. Ret. 11" Wear bushing & L/D 3 Jts 5" DP.

R/U NDCo. Completion string running equipment. Held PJSM. P/U & M/U 2 Jts 3-1/2" TBG & Check Jam system; "Ok". L/D TBGs. P/U & M/U 3-1/2" Wireline Re-Entry Guide Shoe (10.2#, ID: 2.922") + 3-1/2" BTM No-Go L/N (10.2#, Seal Bore: 2.75", XN Profile) + 3-1/2" Pup Jt, RIH w/ 1 Jt 3-1/2" TBG + 3-1/2" Pup Jt + 7" Hydraulic set retrievable production packer (Min ID: 2.922", Suitable for 29 PPF CSG) (Check shear pins quantity & Visual check PKR element) + 3-1/2" Pup Jt + 1 Jt 3-1/2" TBG to 25[m]. R/U Slick line equipment. Run 2.8" Gauge Ring to No-Go depth & check all connections; OK. Resume RIH w/ 3-1/2" Pup Jt + 3-1/2" SSD (Seal Bore: 2.75", X profile, Close position, Downward open) + 3-1/2" Pup Jt + 1 Jt 3-1/2" TBG + 3-1/2" Pup Jt + 3-1/2" Traveling Jt (full open position, Dressed w/ 4 No. Shear Pin, Splined Type) + 3 1/2" Pup Jt + 12 Jts 3-1/2" TBG. P/U & M/U XOS 3-1/2" * 4-1/2" HSM3. Cont. RIH

w/ 1 Jts 4-1/2" TBG to 175m. R/U Slick line equipment. Run 2.8" Gauge Ring to SSD depth & check all connections; OK.

Line up surface test Line to string. Perform Press test completion string against SSD Check valve w/ 5000^{psi} for 15min; "Ok". Resume run 3-1/2" * 4-1/2" Completion string to 1115^{m}. Line up surface test Line to string. Try to perform Press test completion string; "No-Succ". Leakage from CMT line & Failure in Press. Recorder. Perform Press test completion string against SSD Check valve w/ 5000^{psi} for 15min; "Ok". Resume run 3-1/2" * 4-1/2" Completion string to 1330^{m}.

Cont. Run 3-1/2" * 4-1/2" Completion string to 2200^{m}. All te time monitor pit level; NL-NG. Totally Run 15 Jts 3-1/2" TBG (10.2#, HSM3, L-80 Type-1) & 224 Jts 4-1/2" TBG (18.9#, HSM3, L-80 Type-1).

Line up surface test Line to string. Perform Press test completion string against SSD Check valve @ 2200^{m} w/ 5000^{psi} for 15min; "Ok". Cont. Run 3-1/2" * 4-1/2" Completion string f/2200 to 3280^{m} (7^{m} above 7" l.lap). All te time monitor pit level; NL-NG. Totally Run 15 Jts 3-1/2" TBG (10.2#, HSM3, L-80 Type-1) & 337 Jts 4-1/2" TBG (18.9#, HSM3, L-80 Type-1). Line up surface test Line to string. Perform Press test completion string against SSD Check valve @ 3280^{m} w/ 5000^{psi} for 15min; "Ok".

P/U & M/U TR3SV Assy on string. Connect control line and Press test to 5000^{psi} for 15min; "OK". Bleed of Press. to 3000^{psi}, M/U 1 Jt 4-1/2" TBG and RIH to 3295^{m}. Line up surface test Line to string. Perform Press. test completion string & TR3SV Assy against SSD Check valve w/ 4500^{psi} for 15min; "Ok".

Bleed of control line Press to Zero. And try to OprateTR3SV flapper after several times finally "Ok". Monitor for any Press build up as inflow test of flapper "ok". Check & Test Equalizing Function of TR3SV; "OK". M/U & RIH 5Jts 4-1/2" TBG to 3335^{m}, M/U 4-1/2" Fluted Swage (18.9# TPCQ-EX Pin Up * HSM3 Pin Down) & TBG HGR (MSP, 11" Bowl * 4 1/2" ACME Box up * 4 1/2" TPCQ-EX Box Down, 2 Set O-Ring on Body & 2 Set O-Ring on Extended neck) on Strg. Pass C/L through Fluted Swage Slots, Check the Seals on Hanger Body, Clean threads on feed through Control Line Prior to RIH, Apply Light oil on the Seals body of tubing Hanger, Check Press. in 1/4" CL. Release CL Pressure & Cut CL approx 15^{m} or enough to Reach to the rig floor on spool & turns around fluted Swage Below tubing Hanger, Feed all lines through tubing Hanger, Install 1/4" Fitting on C/L. Pressure test of CL w/4500^{psi} for 15min "Ok" Release Press. to 3000^{psi}. Press. Test completion string against Tubing Hanger @ 3345^{m} w/ 4600^{psi} for 15min; "Ok".

M/U 4-1/2" Landing Joint (assembled with TBG HGR Running Tools, 5" Acme pin *4-1/2" TPCQ EX Connection Box) & Screw to Hanger, Touch with Hanger inside the bowl of TBG HD Spool, Pull 1.5^{m} Space Out Mark Strg., Secure control line on landing joint body in straight Shape, Mark control line position & Orientation on landing Joint. Make Sure Tubing Spool is Cleaned Prior to Setting TBG HGR, Open T.H.S side outlet valves to Drain and make Sure all Tie-Down Screw is open, try to Landing Tubing Hanger inside Tubing Head Spool to Confirm & Mark Slot of ESP Orientation indicator on Tubing Hanger "No succ". Work on Tie Down Screw to Check Landing Tubing Hanger inside Tubing Head Spool to Confirm & Mark Slot of ESP Orientation indicator on Tubing Hanger till M.N. All the time Monitor pit level; "NL-NG".

While Work on Tie Down Screw & try to remove it to Check Landing port of Tubing Hanger Inside Tubing head spool & try to regulate Mark slot of ESP Orientation indicator on Tubing Hanger against Tubing Head spool Tie-down POOH to change 5K TR3SV f/3346 to 3270^{m}, B/O & L/D them. (12 HRs MSA Co. Man NPT).

While Work on Tie Down Screw & try to remove it to Check Landing port of Tubing Hanger Inside Tubing head spool P/U & M/U 7.5K TR3SV Assy on string. Connect control line and Press test to 5000^{psi} for 15min; "OK". Bleed of Press. to 3000^{psi}, M/U 1 Jt 4-1/2" TBG and RIH to 3300^{m}, Line up surface test Line to string. Perform Press. test completion string & TR3SV Assy against SSD Check valve w/ 5000^{psi} for 15min; "Ok", Bleed of control line Press to Zero, Oprate TR3SV flapper after several times finally "Ok". Monitor for any Press build up as inflow test of flapper "ok". Check & Test Equalizing Function of TR3SV; "OK".

While Work on Tie Down Screw M/U & RIH 4Jts 4-1/2" TBG to 3335m, M/U 4-1/2" Fluted Swage (18.9# TPCQ-EX Pin Up * HSM3 Pin Down) & TBG HGR (MSP, 11" Bowl * 4 1/2" ACME Box up * 4 1/2" TPCQ-EX Box Down, 2 Set O-Ring on Body & 2 Set O-Ring on Extended neck) on Strg. Pass C/L through Fluted Swage Slots, Check the Seals on Hanger Body, Clean threads on feed through Control Line Prior to RIH, Apply Light oil on the Seals body of tubing Hanger, Check Press. in 1/4" CL. Release CL Pressure & Cut CL approx 15^{m} or enough to Reach to the rig floor on spool & turns around fluted Swage Below tubing Hanger, Feed all lines through tubing Hanger, Install 1/4" Fitting on C/L. Pressure test of CL w/4500^{psi} for 15min "Ok" Release Press. to 3000^{psi}.

M/U 4-1/2" Landing Joint (assembled with TBG HGR Running Tools, 5" Acme pin *4-1/2" TPCQ EX Connection Box) & Screw to Hanger, Touch with Hanger inside the

bowl of TBG HD Spool, Pull 1.5^{m} Space Out Mark Strg., Secure control line on landing joint body in straight Shape, Mark control line position & Orientation on landing Joint. Make Sure Tubing Spool is Cleaned Prior to Setting TBG HGR, Open T.H.S side outlet valves to Drain and make Sure all Tie-Down Screw is open, try to Landing Tubing Hanger inside Tubing Head Spool to Confirm & Mark Slot of ESP Orientation indicator on Tubing Hanger "No succ".

Press. Test completion string against Tubing Hanger @ 3345^{m} w/ 5000^{psi} for 15min; "Ok". Work on Tie Down Screw to Check Landing Tubing Hanger inside Tubing Head Spool to Confirm & Mark Slot of ESP Orientation indicator on Tubing Hanger "ok". Install Golpa. Flange & 4-1/16" Gate Valve on Completion string. R/U slick line equipment. Wait on Arrive OEOC Slick Line Supervisor.

RIH W/ 3.437" Protection sleeve to 50m (11m above TR3SV), Took WT, Try to Pass this point "No succ.", POOH to Surf. Change Protection sleeve with another one 3.437" Protection sleeve, Run Back W/ Same to 50m and Took WT again, POOH and RIH w/ 3.430" Gauge Ring to 59^{m} (2^{m} above TR3SV) "Ok", POOH to Surf. and RIH w/ 3.5" GS Pulling to same Point (50^{m}), Try to Pass "No succ.". Decided to POOH and Check string. L/D 4-1/2" Landing Joint, POOH Compl. String to 3326^{m} while B/O & L/D 4-1/2" Fluted Swage & TBG HGR + 5jt 4-1/2" TBG, R/U Slick Line Equip., RIH w/ 3.437" Protection sleeve to TR3SV and Checked same in Position "Ok", Retrieve 3.437" Protection sleeve, R/D Slick Line Equip. OBS. Debris & Coating inside first 4-1/2" TBG above TR3SV. Change 5jts 4-1/2" TBG above TR3SV , M/U 5jts New 4-1/2" TBG and Run Back W/ Compl. String to 3335^{m}, M/U 4-1/2" Fluted Swage (18.9# TPCQ-EX Pin Up * HSM3 Pin Down) & TBG HGR (MSP, 11" Bowl * 4 1/2" ACME Box up * 4 1/2" TPCQ-EX Box Down, 2 Set O-Ring on Body & 2 Set O-Ring on Extended neck) on Strg. Pass C/L through Fluted Swage Slots, Check the Seals on Hanger Body, Clean threads on feed through Control Line Prior to RIH, Apply Light oil on the Seals body of tubing Hanger, Check Press. in 1/4" CL. Release CL Pressure & Cut CL approx 15^{m} or enough to Reach to the rig floor on spool & turns around fluted Swage Below tubing Hanger, Feed all lines through tubing Hanger, Install 1/4" Fitting on C/L. Pressure test of CL w/4500^{psi} for 15min "Ok" Release Press. to 3000^{psi}.

Line up surface test Line to string. Perform Press. test completion string & TR3SV Assy against SSD Check valve w/ 5000^{psi} for 15min; "Ok". M/U 4-1/2" Landing Joint (assembled with TBG HGR Running Tools, 5" Acme pin * 4-1/2" TPCQ EX Connection Box) & Screw to Hanger, Touch with Hanger inside the bowl of TBG HD Spool, Pull 1.5^{m} Space Out Mark Strg., Secure control line on landing joint body in straight Shape,

Mark control line position & Orientation on landing Joint. Make Sure Tubing Spool is Cleaned Prior to Setting TBG HGR, Open T.H.S side outlet valves to Drain and make Sure all Tie-Down Screw is open, Landing Tubing Hanger inside Tubing Head Spool to Confirm & Mark Slot of ESP Orientation indicator on Tubing Hanger "OK". All the time Monitor pit level; "NL-NG". Line up surface test Line to string. Perform Press test completion string, TBG HGR & L/J against SSD Check valve w/ 5000^{psi} for 15min; "Ok".

Install Golpa. Flange & 4-1/16" Gate Valve on Completion string. R/U slick line equipment.

RIH & Set 3.437" Protection sleeve in TR3SV, RIH w/ 3" SB Pulling, try to Engage & Retrieve 2.75" WFB Check valve from SSD "No Succ." POOH to Surf. Change 3" SB Pulling and Run Back to Work on Retrieve 2.75" WFB Check valve, Stopped Operation Due to Slick Line Truck Hydraulic Sys. Failure. While Wait on OEOC Slick Line Service Due to Hydraulic Sys. Failure, Work On it and fix same "Ok". Cont. RIH w/ 3" SB Pulling and try to Engage & Retrieve 2.75" WFB Check valve from SSD Several times "No Succ.", POOH to Surf.

M/U Slick Line BOP & Lubricator above Golpa. Flange on string, Closed Hydrill and L/U to Ann., Try to Perform Reverse Circ. "No Succ." OBS. Build up SPP To max. 150^{psi} and "No return from string," Checked Surface Lines "Ok". While Work on Retrieve 2.75" WFB Check valve from SSD, RIH w/ 1.87" Bailers to SSD Depth (3317^{m}) and Clean settled debris on top of 2.75" WFB Check valve @ three Run, RIH w/ 3" SB Pulling, try to Engage & Retrieve 2.75" WFB Check valve from SSD "No Succ."

Cont. Work on Retrieve 2.75" WFB Check valve from SSD, RIH w/ 1.87" Bailers to SSD Depth, Work on same to Clean settled debris on top of 2.75" WFB Check valve @ Five Run till Clean inside Bailers, RIH w/ 3" SB Pulling, try to Engage & Retrieve 2.75" WFB Check valve from SSD "No Succ.", POOH to Surf. RIH w/ 2.3" LIB to SSD Depth (3317^{m}), Work on LIB, POOH and checked same "No indication of Engage with 2.75" WFB Check valve" RIH w/ 1.87" Bailers again to SSD Depth, Recover 4^{cm} debris from bailers.

Cont. Work on Retrieve 2.75" WFB Check valve from SSD, RIH w/ 1.87" Bailers again to SSD Depth, Work on same to Clean settled debris on top of 2.75" WFB Check valve @ Several times, L/D SL BOP & Lubricator, R/D Slick Line Equip.

R/U OEOC CT, M/U CT BOP & Injector Head above Golp. Flange, Try To Press test same Several times "OBS. Leakage" Work on same and Perform Press Test Finally "Ok", Flush the CT. (CT BHA Component: 1-1/2" Roll on Connector, 1.8" Double Flapper Check Valve, 1.8" Wash Nozzle (w/ 5 * 11/32" Port Size). Meanwhile Prepare and filtrate 70^{bbl} $CaCl_2$ (84^{pcf}).

RIH as Wash Down w/ 1-1/2" C.TBG to 3316^{m}, Took WT (1^{m} above SSD), Cont. Wash Down w/ max. Pumping rate to 3317^{m} & Confirmed SSD Depth, Cont. Circ. BTM's Up while reciprocate CT above SSD till Clean settled & debris around 2.75" WFB Check valve, POOH to surface, R/D CT Injector Head. (CT BHA Component: 1-1/2" Roll on Connector, 1.8" Double Flapper Check Valve, 1.8" Wash Nozzle (w/ 5 * 11/32" Port Size). Pumping rate: (Max.: 1.5 BPM, Press.: 3000psi.)

R/U Slick Line, M/U SL BOP & Lubricator above Golpa. Flange on string Meanwhile Closed Hydrill and L/U to Ann., Perform Reverse Circ. (Vol: 10^{bbl} w/Max. 150^{psi}.) "OK", RIH w/ 3" SB Pulling Engage with 2.75" WFB Check valve and Catch same, Try to Retrieve from SSD Several times " No succ.", POOH to Surf. R/D Slick Line. R/U OEOC CT, M/U CT BOP & Injector Head above Golp. Flange, Perform Press Test "Ok", RIH as Wash Down w/ 3" JDC Pulling to 61^{m}, Took WT (TR3SV Depth), try to Pass this point Several times w/ Pumping & w/o Pumping "No Succ." POOH to Surf., Modify 3" JDC Pulling, Cut approx 8^{m} 1-1/2" CT, RIH w/ 3" JDC Pulling again and Took WT @ Previous Depth (61^{m}) Work on Same in Progress.

POOH W/ 3" JDC Pulling to Surface, Checked 3" JDC Nose & Body "OK", Run Back w/ 1-1/2" CT & same 3" JDC Pulling again and work on to Pass TR3SV Depth (61^{m}) "No Succ.", POOH to Surf., Change 3" JDC Pulling with 3" SB Pulling, Meanwhile Closed Hydrill and L/U to Ann., Perform Reverse Circ. (Vol: 15^{bbl} w/Max. 150^{psi}.) "OK" RIH w/ 3" SB Pulling + Knuckle Jt to 61^{m}, Pass this poit w/o any drag, Cont. RIH to 3295^{m} (Traveling JT Depth), Took WT, Try to Pass " No Succ.", POOH to surface, L/D CT BOP & Injector Head, R/D OEOC CT. R/U Slick line, M/U SL BOP & Lubricator above Golpa. Flange on string, RIH w/ 3" SB Pulling Engage with 2.75" WFB Check valve and Catch same, Try to Retrieve from SSD Several times " No succ.", POOH to Surf. Run Back w/ 3" SB Pulling to 3317^{m} (SSD Depth) Meanwhile Closed Hydrill and L/U to Ann., Perform Reverse Circ. (Vol: 15^{bbl} w/Max. 150-200^{psi}.) Engage & Retrieve 2.75" WFB Check valve from SSD "Successfully". RIH w/ 2.75" Plug to 3345^{m} (No-Go depth), Set Plug in No-Go L/N. POOH to surface. RIH w/ 2" prong to 3345^{m} (No-Go depth) & Set in No-Go L/N. POOH to surface. RIH w/ 2.8" B Shifting tools to 3317^{m}

(SSD Depth) Check SSD is full close & drift string. POOH to surface. R/D Slick line equipment.

L/D SL BOP, Lubricator & Golpa Flange, Change TDS Link & Elevator, Line up surface test Line, Try to Press test same "No Succ.", Work on Leakage and Perform Press. Test Finally "Ok", L/U surface test Line to string. Set PKR as per procedure and increase Press Gradually to 3500^{psi} (Obs. Set PKR indication). Increase Press to 4500^{psi} as completion string Press test; "Ok". Release Press. Perform pull test w/15^{klbs} overpull; "OK". S/O 35^{klbs} Wt. and Obs. Back flow from string after expansion joint pins sheared. Land TBG hanger in THS. Tighten all Tie- Down Screws. Close Hy-drill and Press 'test Tie-Downs to 1000^{psi}, "OK". Line up surface test line to string. Perform Press test completion string to 4500^{psi} for 15 min as final completion string test; "OK", L/U to 9-5/8" Ann. try to Perform Press test several times "Not OK", OBS Leakage From Surface Line.

Work on Surface Line Leakage "Ok", Perform 9-5/8" Ann. Press test to 2000^{psi} Finally "OK". R/U Slick line & Retrieve 3.437" Protection Sleeve of TR3SV "OK". Bleed off CL Press to zero & Close TR3SV, Back off L/J & TBG HGR Running tools f/ TBG HGR. B/O & L/D same. Install 4" 10k TWCV. Pass 1/4" Plugged CL f/ BOP Stack while L/D Mouse hole. Press test 4" 10K TWCV against SBR to 4500^{psi}; "OK".

N/D 13-5/8" BOP Stack; 5K Ann Preventer, 10K 2-7/8" * 5" VBR Top Rams + 10K SBR Middle Rams, Drlg Spool,10K 5" Fix BTM Rams & Spacer Spool. Disconnect all hydraulic hoses, Choke lines & Kill lines. N/U & Install 11" * 4 1/16"-5K BTM master valve, Tighten BMV Bolts. In order to energize & Press test FS Seal of TBG HGR. L/U pump truck to BMV. Press test FS Seal of THG HGR w/4500^{psi} for 15/5 min; "Ok".

Tighten All nuts. Connect CL to C/L Exit block cap. Press test CL connection to bottom section & U-Ring to 4500^{psi} for 15min; "OK", Press test between 2 O-Ring of TBG HGR neck to 4500^{psi} for 15 min; "OK". Cavity Press test between S-Seal, THS & TBG Head Adapter Ring gasket, 2nd TBG HGR O-Ring, Tie-Dn Screws to 4500^{psi} for 15 min; "OK". N/U 4-1/16"-5K X-mass tree Solid block (MSP - Drilex) & Install same on BMV. Tighten all bolts. Perform body test to 4500^{psi}; "OK". Ret. 4" TWCV Close All XMT Valve except BMV & Secure the well. Released the rig.

Release the Rig @ 24 – June – 2025 (1404. 04. 03), 06:00 O'clock.

2.4 AZNS-12 Well Sketch

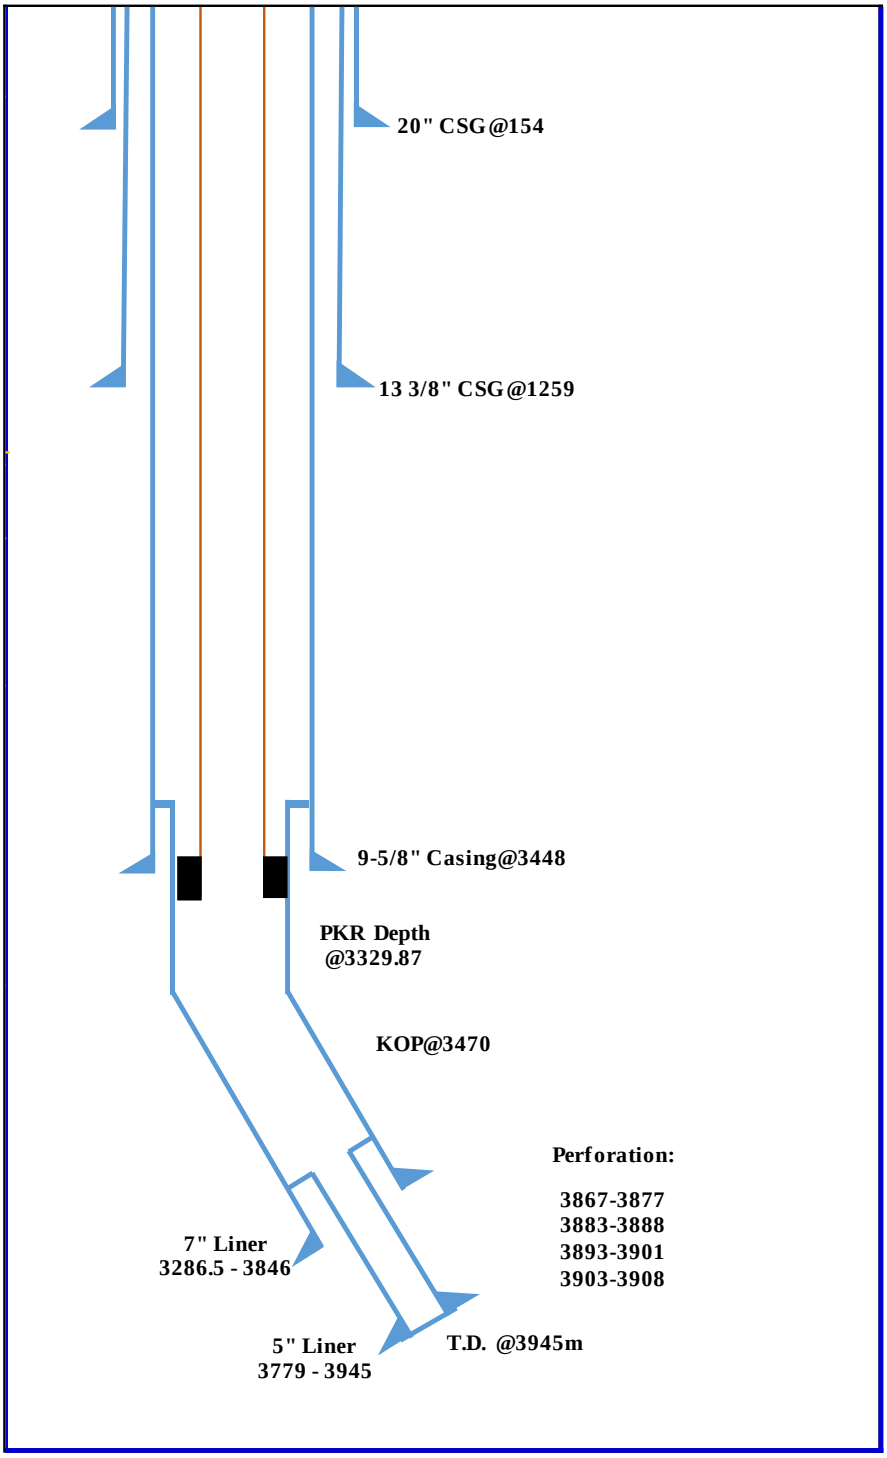


Figure 2-1: AZNS-12 Well Sketch

2.5 Daily Time Break Down

Well Name: AZNS-012, S.T-1		Apr-25																	
CODE	Operation	13	14	15	16	17	18	19	20	21	22	23	24	25	26	27	28	29	30
1	Rig Up/Tear Down/Move																		
2	Drilling																		
3	Reaming																		
4	Coring																		
5	Circulate & Condition						9.50		1.50						2				
6	Trips		1	3										20.5	2				
7	Service/ Maintain Rig																		
8	Repair Rig																		
9	Replacing Drill Line																		
10	Deviation Survey																		
11	Logging								12.50	2.50									
12	Run Casing/ Liner																		
13	Cementing													3					
14	Wait on Cement																		
15	Rig Up/Down BOP						4.00	20.00											
16	Test BOP																		
17	Drill Stem Test											4.00							
18	Fishing									15.50	24.00			0.50	20.00	24.00	24.00	24	3
19	Specialized Directional Work																		
20	Operation Status (Waiting)		14	9	24	17		4.00	10.00	6.00									
21	Safety																		
22	Perforating																		
23	Completion\ XMT			8		7	9.50					20.00	24.00						
24	Treating																		
25	Swabbing																		
26	Surface Testing																		
27	Well Control						1.00												21
28	Other	6	9	4															
29	Subsea Operation																		
	Total	6.00	24.00	24.00	24.00	24.00	24.00	24.00	24.00	24.00	24.00	24.00	24.00	24.00	24.00	24.00	24.00	24.00	24.00


Well Name: AZNS-012, ST-1		May-25																													
CODE	Operation	1	2	3	4	5	6	7	8	9	10	11	12	13	14	15	16	17	18	19	20	21	22	23	24	25	26	27	28	29	30	31
1	Rig Up/Tear Down/Move																															
2	Drilling																															
3	Reaming																	0.5												0.5	11.5	
4	Coring																															
5	Circulate & Condition										2																				1.5	2.5
6	Trips									5.5	13.5	24	14	1.5	12			11.5													7	21.5
7	Service/Maintain Rig																															
8	Repair Rig															1		2.5														
9	Replacing Drill Line						1.5									2										2						
10	Deviation Survey																															
11	Logging																															
12	Run Casing/Liner																															
13	Cementing																											21	2			
14	Wait on Cement																															
15	Rig Up/Down BOP																												22	17.5		
16	Test BOP																													6		
17	Drill Stem Test																															
18	Fishing	22	24	20.5	22	21	22.5	16.5	22	18.5			10	22.5	12	21	24	4.5	22	24	19	24	24	24	24	13	24	3				
19	Specialized Directional Work																									9						
20	Operation Status (Waiting)	2		3.5	2	3		7.5	2									5	2		5										4	
21	Safety																															
22	Perforating																															
23	Completion\ XMT																															
24	Treating																															
25	Swabbing																															
26	Surface Testing																															
27	Well Control										0.5																					
28	Other										8																					
29	Subsea Operation																															
	Total	24.00	24.00	24.00	24.00	24.00	24.00	24.00	24.00	24.00	24.00	24.00	24.00	24.00	24.00	24.00	24.00	24.00	24.00	24.00	24.00	24.00	24.00	24.00	24.00	24.00	24.00	24.00	24.00	24.00	24.00	24.00

Well Name: AZNS-012, S.T-1		Jun-25																					
CODE	Operation	1	2	3	4	5	6	7	8	9	10	11	12	13	14	15	16	17	18	19	20	21	22
1	Rig Up/Tear Down/Move																						
2	Drilling																						
3	Reaming																						
4	Coring																						
5	Circulate & Condition				2			8.00															
6	Trips	5.5		2	13	1	21.50	15.00		12.00	17.00												
7	Service/ Maintain Rig																						
8	Repair Rig																						
9	Replacing Drill Line					1.5																	
10	Deviation Survey																						
11	Logging	16.5	17																				
12	Run Casing/ Liner					21.5	2.5																
13	Cementing																						
14	Wait on Cement																						
15	Rig Up/Down BOP																						
16	Test BOP																						
17	Drill Stem Test																						
18	Fishing																						
19	Specialized Directional Work																						
20	Operation Status (Waiting)	2	7	22	9				24.00	12.00	5.50	4.00				4.5		1.50					
21	Safety																						
22	Perforating																						
23	Completion\ XMT										1.50	20.00	24.00	24.00	24.00	19.5	24.00	22.5	24.00	24.00	24.00	24.00	24.00
24	Treating																						
25	Swabbing																						
26	Surface Testing																						
27	Well Control							1.00															
28	Other																						
29	Subsea Operation																						
	Total	24.00	24.00	24.00	24.00	24.00	24.00	24.00	24.00	24.00	24.00	24.00	24.00	24.00	24.00	24.00	24.00	24.00	24.00	24.00	24.00	24.00	24.00


2.6 Activity Breakdown Table

CODE	OPERATIONS	Actual Hours	Percentage
1	Rig Up/Tear Down/Move	0.00	0.00%
2	Drilling	0.00	0.00%
3	Reaming	12.50	0.74%
4	Coring	0.00	0.00%
5	Circulate & Condition	29.00	1.72%
6	Trips	248.00	13.29%
7	Service/Maintain Rig	0.00	0.00%
8	Repair Rig	3.50	0.21%
9	Replacing Drill Line	7.00	0.42%
10	Deviation Survey	0.00	0.00%
11	Logging	48.50	2.88%
12	Run Casing/Liner	24.00	1.42%
13	Cementing	26.00	1.54%
14	Wait on Cement	0.00	0.00%
15	Rig Up/Down BOP	63.50	3.77%
16	Test BOP	6.00	0.36%
17	Drill Stem Test	4.00	0.24%
18	Fishing	619.00	36.71%
19	Specialized Directional Work	9.00	0.53%
20	Operation Status (Waiting)	211.50	12.54%
21	Safety	0.00	0.00%
22	Perforating	0.00	0.00%
23	Completion\ XMT	354.00	20.64%
24	Treating	0.00	0.00%
25	Swabbing	0.00	0.00%
26	Surface Testing	0.00	0.00%
27	Well Control	23.50	1.39%
28	Other	27.00	1.60%
29	Subsea Operation	0.00	0.00%
	Total	1716.00	100.00%

2.7 Activity Break Down Chart

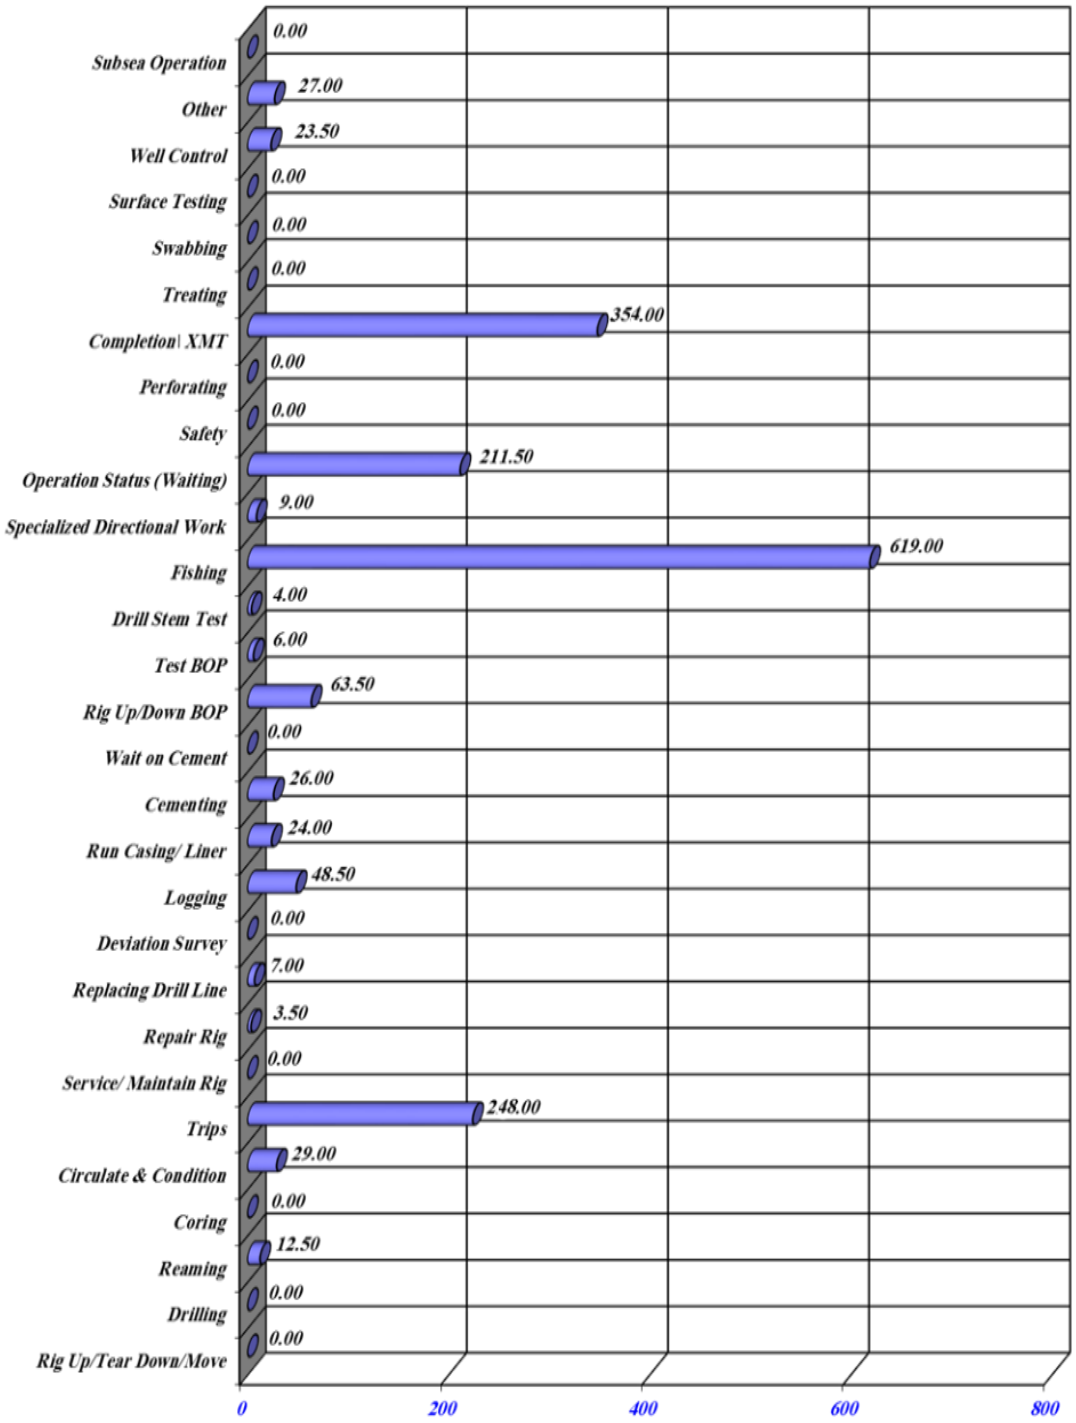

2.8 Activity Break Down Plot

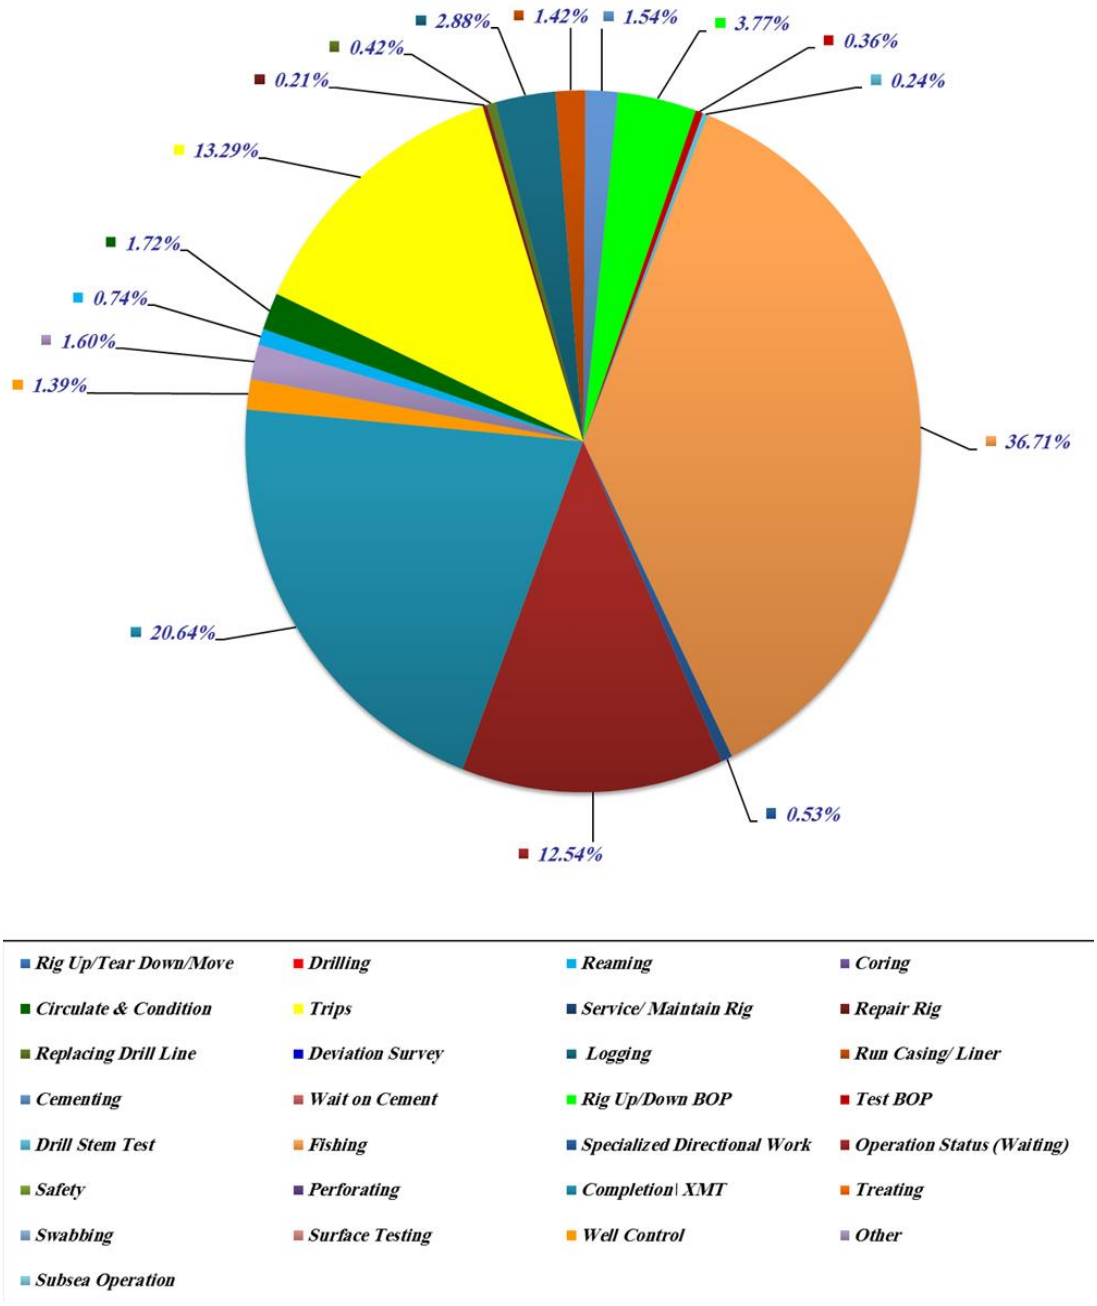

2.9 Bit Record Table

								BIT PERFORMANCE BY FORMATION				DRILLING PARAMETERS							HYDRAULICS						Dull Grading								Remarks
Bit No	Size	Bit Manufacture	Type	IADC Code	Jets			CMT	Depth		Metres	Hrs	ROP	WOB (Klb)	Surf RPM		Krev (For all run)	Pump Press	GPM		Mud Weight pcf		TFA	Bit Press Loss	Bit HHP	Bit H.S.I	IR	OR	DC	Loc	BIS	GV6	OC	R Pulled	
					No	x	Size		In	Out																								
1	5-7/8"	Kingdream	MT. bit	217	Open			NO	-	-	-	-	-	-	-	-	-	-	-	-	84	84	Open	-	-	-	-	-	-	-	-	-	-	Run as killing string & Circ.
2	8-3/8"	Kingdream	Tri-Cone Bit	537	3	x	16	Yes	3180	3270	90	3.5	-	3 - 5	15	20	115	1700 - 2500	300	470	84	84	0.589	659.7745588	180.9182897	#VALUE!	1	1	WT	A	E	I	PN	BHA	CMT D/O
1.RR1	5-7/8"	Kingdream	MT. bit	217	Open			NO	-	-	-	-	-	-	-	-	-	-	-	-	84	84	Open	-	-	-	2	2	BT	A	E	I	LT	LOG	Run as Scraper trip.

2.10 Hole Problem History

Not Applicable.

2.11 Total Time Break-Down of Operation

Work-Over Operation TBD of Well: AZNS-12 Work-over (Gadvan Producer)	IADC Code	Interval (meters)	Formation	Depth (meters)	ROP	Time Duration (Hours)	Time Duration (Days)	Total Duration (Days)	Contingency (%) 10	Time Duration w/ contingency (Hours)	Time Duration w/ contingency (Days)	Total Duration w/ contingency (Days)
Work-over												
Held PJSM. Spud the Rig. Stand Back required 5" & 3-1/2" DPs, 5" HWDPs and 6-1/2" DC.	Spud		Ga.	3945		0	0.00	0.0	0.0	0.0	0.00	0.0
Check the wellhead for any damage or leakage. Record well head pressures; check all annulus pressure, Bleed off any annulus pressure to Zero.	Wellhead		Ga.	3945		24	1.00	1.0	1.1	26.4	1.10	1.1
Close XMT valves. Remove 7 1/16" XMT cap. R/U Well Test lines from XMT to burning pit. And connect f/ 7"-9 5/8" annulusside out let valv e to Pump Truck/mud pumps.	Well Test		Ga.	3945		12	0.50	1.5	0.6	13.2	0.55	1.7
Release well pressure through Burning Line in Safe Mode to Burning Pit & Also Monitor W.H.Pressure.	Well Test		Ga.	3945		12	0.50	2.0	0.6	13.2	0.55	2.2
R/UP Slick Line & Test Lubricator,Retrieve sub surface safety valve, install dummy safety valve. Note:Suitable Dummy Safety Valve Shall be Provided by Client. Note:if Retreiving 3SV is not Possible follow contingency plan#01	De-Completion		Ga.	3945		12	0.50	2.5	0.6	13.2	0.55	2.8
R/U SL, RIH w/ Gauge Cutter To TOF @ 2800 m.	De-Completion		Ga.	3945		12	0.50	3.0	0.6	13.2	0.55	3.3
R/U CT. RIH and tag top of the fish @ 2800m.Note: Chemical wash may be needed while RIH with CT .	De-Completion		Ga.	3945		36	1.50	4.5	1.7	39.6	1.65	5.0
Displace the well with heavy mud to make the well overbalanced.Observe the annulus, POOH. R/D CT.Note: If wellhead pressure is not zero, follow contingency plan #2.	De-Completion		Ga.	3945		18	0.75	5.3	0.8	19.8	0.83	5.8

Install TWCV in Tubing Hanger. Note:Suitable BPV Shall be Provided by Client.Note:if Unable to Set BPV Due to Damaged Profile,Follow Contingency Plan#3	De-Completion		Ga.	3945		12	0.50	5.8	0.6	13.2	0.55	6.3
N/D X.M.T tree, N/U BOP and perform BOP pressure test.retrieve TWCV	De-Completion		Ga.	3945		48	2.00	7.8	2.2	52.8	2.20	8.5
R/U & RIH W/Colliding Tools & Collide Completion String from 2800m ,POOH & L/D, displace and overbalance the well to get in & out uniform MW.Observe the annulus,	De-Completion		Ga.	3945		168	7.00	14.8	7.7	184.8	7.70	16.2
RIH with TBG hanger retrieving tool and engage with TBG hanger. Note:if Tubing Hanger Thread damaged follow Contingency Plan#04	De-Completion		Ga.	3945		12	0.50	15.3	0.6	13.2	0.55	16.8
Unlatch, Displace completion fluid & oil in hole with proper kill mud and pull completion string recautionary due to probable trapped pressure below fish. While POOH monitor the wells and annulus to make sure the well is safe and over balance. (from 3333.85m). Note:if unable to unlatch completion string due to string pack off with huge amount of debries follow contingency plan#05 Note:if while trying to unlatch completion, string was part due to string wash out follow contingency plan#06	De-Completion		Ga.	3945		160	6.67	21.9	7.3	176.0	7.33	24.1
RIH with proper size Spear to TOF, Try to catch & Retrieve fish in several attempts then POOH.	Trip		Ga.	3945		120	5.00	26.9	5.5	132.0	5.50	29.6
RIH with 8 ½" Mill and clean out BHA (mill remaining fish if Not Retrieved in previus Step) to 7" L.LAP (3285m), CBU, POOH.	Trip		Ga.	3945		310	12.92	39.8	14.2	341.0	14.21	43.8
RIH with Mill to 3333.85m (P/U required DP jt by jt), Mill permanent packer, chase the packer to Top of 5" Liner Lap @ 3779m (or where ever PKR stopped), CBU, POOH.	Trip		Ga.	3945		192	8.00	47.8	8.8	211.2	8.80	52.6
RIH with Taper Tap and catch the packer, recover completion packer.POOH To Surface. Note:if string stuck while Recovering Completion Packer follow contingency plan#07	Trip		Ga.	3945		96	4.00	51.8	4.4	105.6	4.40	57.0
RIH with 6" or 5-7/8 bit and clean out BHA to 5" Liner lap (3779m), CBU shakers clean, POOH.	Trip		Ga.	3945		60	2.50	54.3	2.8	66.0	2.75	59.8
RIH with 4 1/8" Mill and clean out BHA to bottom (TD: 3945m), take care inside pre-perforation interval (3867m - 3908m), CBU till hole clean, POOH to surface.	Trip		Ga.	3945		60	2.50	56.8	2.8	66.0	2.75	62.5
M/U Tandem scraper BHA, RIH with tandem scrapers including 9-5/8" casing scraper & 7" liner scraper to top of 5" liner (3779m). Scrap 9-5/8" casing and 7" liner and L/D same.	Trip		Ga.	3945		72	3.00	59.8	3.3	79.2	3.30	65.8

RIH & Perform TLC Logging (SBT/CBL/VDL) Inside 7" Liner,POOH to Surafce.	Log		Ga.	3945		72	3.00	62.8	3.3	79.2	3.30	69.1
RIH & Perform TLC Logging (Corrosion Logging) Inside 7" Liner,POOH to Surafce.	Log		Ga.	3945		72	3.00	65.8	3.3	79.2	3.30	72.4
RIH & Perform WL Logging (Corrosion Logging) Inside 9-5/8" Liner,POOH to Surafce. Note: for Change THS follow contingency plan#8	Log		Ga.	3945		41	1.71	67.5	1.9	45.1	1.88	74.3
RIH and set RTTS in 9 5/8" CSG (3270m) as a barrier.	Wellhead		Ga.	3945		0	0.00	67.5	0.0	0.0	0.00	74.3
N/D BOP, Change DSA pack off to new one. Perform pressure test P-seals. N/U BOP and pressure test.Note:DSA pack off Shall be Provided by Client.	Wellhead		Ga.	3945		0	0.00	67.5	0.0	0.0	0.00	74.3
RIH with DP and retrieve RTTS, POOH to surface.	Wellhead		Ga.	3945		0	0.00	67.5	0.0	0.0	0.00	74.3
RIH w/ DP's and DC's, POOH & L/D same.	Trip		Ga.	3945		0	0.00	67.5	0.0	0.0	0.00	74.3
RIH scraper and scrape 7" production packer setting area, displace the well with Calcium Chloride (CaCl2) as completion fluid, POOH to surface.	Trip		Ga.	3945		68	2.83	70.4	3.1	74.8	3.12	77.4
Run 7.5K completion string as per program.	Completion		Ga.	3945		168	7.00	77.4	7.7	184.8	7.70	85.1
Set BPV inside TBH, N/D BOP's & install new XMT.	Completion		Ga.	3945		58	2.42	79.8	2.7	63.8	2.66	87.8
Retrive BPV, install TWCV and Pressure test the XMT.	Completion		Ga.	3945		18	0.75	80.5	0.8	19.8	0.83	88.6
Secure the well by set BPV in TBG Hanger, close all X-mas Tree valves except BMV, and Release the Rig.	Completion		Ga.	3945		8	0.33	80.9	0.4	8.8	0.37	89.0

Retrieve TWCV,R/U Slick Line, Set protection sleeve, retrieve plug & prong from NO GO landing nipple, POOH.	Completion		Ga.	3945		Rig Less	0.00	80.9	0.0	0.0	0.00	89.0
RIH with CT to bottom, displace the well with diesel or nitrogen & observ well, POOH.	Completion		Ga.	3945		Rig Less	0.00	80.9	0.0	0.0	0.00	89.0
R/U SL, RIH & retrieve protection sleeve, POOH, R/D SL.	Completion		Ga.	3945		Rig Less	0.00	80.9	0.0	0.0	0.00	89.0
Flow the well as pre-acid clean up till acceptable BSW & reading stable flow rate on 2 different choke size for 72 hrs.	Completion		Ga.	3945		Rig Less	0.00	80.9	0.0	0.0	0.00	89.0
R/U & RIH S.L, Set protection sleeve, POOH & R/D S.L RIH with C/T & perform acid wash as per program, POOH to surface. RIH w/SL and retrieve protection sleeve	Completion		Ga.	3945		Rig Less	0.00	80.9	0.0	0.0	0.00	89.0
Flow the well as post-acid clean-up till acceptable BSW & reading stable flow rate on 2 different choke size for min 96 hrs. Note 1: The time is only for flowing duration (R/U, R/D & preparation time is excluded). Note 2: Acidizing & post-acid clean-up maybe perform as rig less job upon contractor request & client approval but in case of any failure in well integrity the contractor should provide drilling rig & required services in own responsibility & fix the problem.	Completion		Ga.	3945		Rig Less	0.00	80.9	0.0	0.0	0.00	89.0
RIH with S/L, set protection Sleeve, POOH & R/D SL.	Completion		Ga.	3945		Rig Less	0.00	80.9	0.0	0.0	0.00	89.0
RIH with C/T to bottom & displace the well with diesel, POOH.	Completion		Ga.	3945		Rig Less	0.00	80.9	0.0	0.0	0.00	89.0
RIH with S/L, install plug & prong into NO GO landing nipple, POOH.	Completion		Ga.	3945		Rig Less	0.00	80.9	0.0	0.0	0.00	89.0
RIH with S/L, retrieve protection sleeve.	Completion		Ga.	3945		Rig Less	0.00	80.9	0.0	0.0	0.00	89.0
Secure the well by set BPV in TBG Hanger, close all X-mas Tree valves except BMV.	Completion		Ga.	3945		Rig Less	0.00	80.9	0.0	0.0	0.00	89.0
Total Duration of 6-1/8" Hole Section:							***80.9***	***80.9***			***89.0***	***89.0***
NOTE:												
Total Duration for Cut & Slip DL in all hole section.	Cut & Slip			3763		20	0.83	81.7	0.9	22.0	0.92	89.9
Total Duration for Rig Service (Consider 0.5hr per day) in all hole section.	Rig Service			3763		44	1.85	83.6	2.0	48.9	2.04	91.9
Total Duration of AZNS-12 Work-over Well:								**83.6**				**91.9**

Contingency Plans TBD of Well: AZNS-12 Work-over	IADC Code	Interval (meters)	Formation	Depth (meters)	ROP	Time Duration (Hours)	Time Duration (Days)	Total Duration (Days)	Contingency (%) 10	Time Duration w/ contingency (Hours)	Time Duration w/ contingency (Days)	Total Duration w/ contingency (Days)
Based on operation situation in each step, the following contingency plans might be followed												
Contingency Plan#01 R/U CT RIH & Wash 3SV by Chemical wash & Try to Retrive 3SV by CT if no Success Remedial Plan will be Prepared in advance by Operator & Will be Follow After Client approval.	De-Completion		Ga.	3945		480	20.00	20.00	22.0	528.0	22.00	22.0
Contingency Plan#02 R/U & RIH W/Coliding Tools & Colide Completion String from Proper Depth,POOH & L/D, Displace well with heavy mud and try to kill the well,Circulate & Balance MW.	De-Completion		Ga.	3945		360	15.00	35.00	16.5	396.0	16.50	38.5
Contingency Plan#3 Install 3SV Blanking plug or 7 inch Wire Line Bridge Plug	De-Completion		Ga.	3945		60	2.50	37.50	2.8	66.0	2.75	41.3
Contingency Plan#04 RIH w/Spear & Try to engage w/Tubing Hanger	De-Completion		Ga.	3945		48	2.00	39.50	2.2	52.8	2.20	43.5
Contingency Plan#05 R/U & RIH with FPIT tools to check string free point,POOH to Surface & L/D.R/U & RIH W/Coliding Tools & Colide Completion String from Proper Depth,POOH & L/D.POOH Completion String from Coliding Depths in Several Runs.	Completion		Ga.	3945		408	17.00	56.50	18.7	448.8	18.70	62.2
Contingency Plan#06 Pull Completion String untill string will be part from weaked point then POOH & L/D String in Several attempt. It is assumed to part from 4- 1/2" expansion joint as weak point. Mill the remainder of fish & packer. Follow the rest of main plan.	Completion		Ga.	3945		728	30.33	86.83	33.4	800.8	33.37	95.5
contingency plan#07 RIH w/5-7/8" or 6" Mill & Mill the Packer & Tail in Several Runs, POOH to Surafce & L/D mill.	Trip		Ga.	3945		288	12.00	98.83	13.2	316.8	13.20	108.7
contingency plan#08 RIH and set RTTS in 9 5/8" CSG as a barrier. N/D BOP, Change DSA pack off to new one. N/U BOP and pressure test.Stand Back required 5" & 3-1/2" DPs, 5" HWDPs and 6-1/2" DC. Note:DSA pack off Shall be Provided by Client.	Trip		Ga.	3945		600	25.00	123.83	27.5	660.0	27.50	136.2
Total Duration of Contingency Plan AZNS-12 Work-over Well:								98.8				136.2

Table 2-3: AZNS-12 WorkOver Time Breakdown

2.12 NPT Break-Down

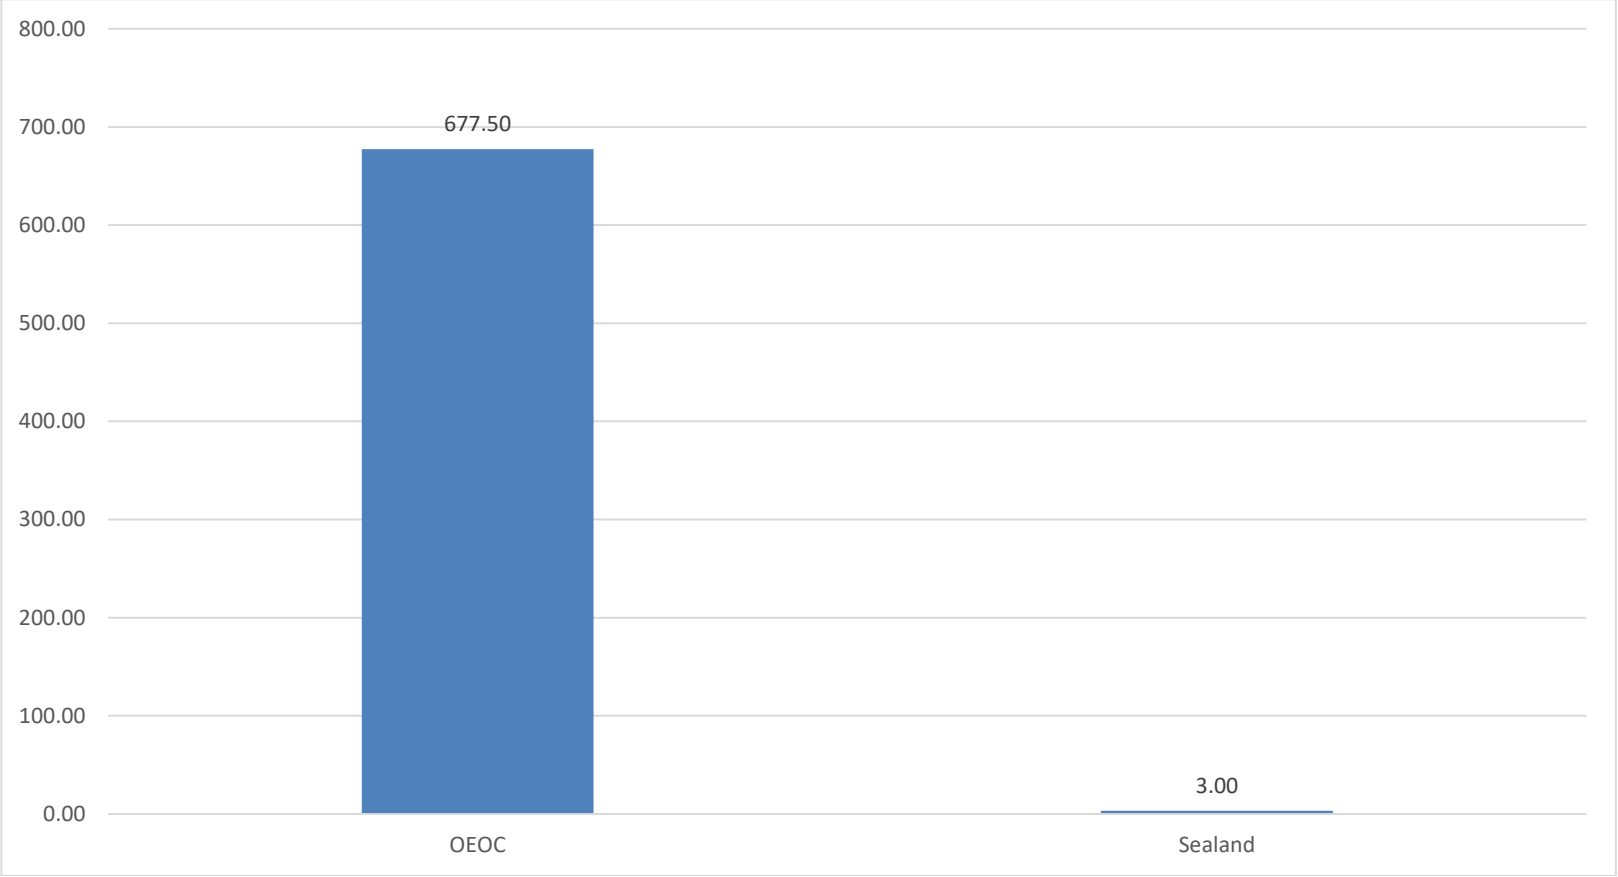


Figure 2-2: AZNS-12 NPT Break-Down Chart (Based on Client's Order & Information)

Section	Date	NPT (hr)	DESCRIPTION	Company	Operation	Total NPT (hrs)
De - Completion & Completion	1404.01.25	15.0	15HRS / WORK ON TDS RAIL TO ALIGN (4HRS), STOP OPERATION DUE TO BAD WEATHER (10HRS), MAKE 5" DPs & R/B TO DERRICK (1HR-OUT OF PROGRAM)	OEOC	PRESS TEST WELL HEAD, WAITING FOR BAD WEATHER, M/U REQUIRED PIPE & R/B	15.00
	1404.01.26	2.0	10HRS / STOP OPERATION DUE TO BAD WEATHER (2HRS), MAKE 5" DPs & R/B TO DERRICK (3HR-OUT OF PROGRAM), NOT REC. CRANE TO R/U CTU INJETCOR HEAD (5HRS)	OEOC	WAITING FOR BAD WEATHER, M/U REQUIRED PIPE & R/B, NOT SUPPLY CRANE TO R/U CTU INJETCOR HEAD	17.00
		2.0				19.00
		1.0				20.00
		5.0				25.00
	1404.01.27	24.0	24HRS / NOT REC. SUITABLE CRANE TO R/U CTU INJETCOR HEAD	OEOC	NOT SUPPLY CRANE TO R/U CTU INJETCOR HEAD	49.00
	1404.01.28	17.0	17HRS / NOT REC. SUITABLE CRANE TO R/U CTU INJETCOR HEAD	OEOC	NOT SUPPLY CRANE TO R/U CTU INJETCOR HEAD	66.00
	1404.01.30	4.0	4HRS / WAIT ON DAYLIGHT & NOT REC. WIRELINE CREW TO PUNCH THE STRING FROM 2800M	OEOC	NOT REC. WIRELINE CREW TO PUNCH THE COMPLETION STRING	70.00
	1404.01.31	6.0	15HRS / WAIT ON DAYLIGHT & NOT REC. WIRELINE CREW TO PUNCH THE STRING FROM 2800M (6HRS) , WAIT ON REC. WIRELINE CREW (7HRS), WAIT ON DAYLIGHT DUE TO EXPLOSIVE MATERIAL SAFETY REGULATION (2HRS)	OEOC	NOT REC. WIRELINE CREW TO PUNCH THE COMPLETION STRING, WAIT ON DAYLIGHT DUE TO EXPLOSIVE MATERIAL SAFETY REGULATION	76.00
		7.0				83.00
		2.0				85.00
	1404.02.01	6.0	WAIT ON DAYLIGHT DUE TO EXPLOSIVE	OEOC	WAIT ON DAYLIGHT	91.00

		MATERIAL SAFETY REGULATION			
	16.0	DUE TO TRY & WORK ON PULL OUT TBG HGR FROM THS, NO SUCC	OEOC	DE-COMPLETION	107.00
1404.02.02	24.0	DUE TO TRY & WORK ON PULL OUT TBG HGR FROM THS	OEOC	DE-COMPLETION	131.00
1404.02.05	19.0	MAKE & R/B REQUIRED PIPES TO DERRICK (OUT OF PROGRAM)	OEOC	MAKE UP & R/B	150.00
1404.02.11	2.0	STOP OPERATION DUE TO BAD WEATHER CONDITION (DUST STORM)	OEOC	FISHING TRIP	152.00
1404.02.13	1.5	WAIT ON NEXT DECISION	OEOC	WAITING	153.50
	1.0	WORK ON TDS	OEOC	REPAIR	154.50
	2.0	STOP OPERATION DUE TO BAD WEATHER CONDITION (DUST STORM)	OEOC	RIH 2" * 4" TAPER TAP	156.50
1404.02.14	2.0	STOP OPERATION DUE TO BAD WEATHER CONDITION (DUST STORM)	OEOC	POOH 2" * 4" TAPER TAP	158.50
1404.02.15	3.0	STOP OPERATION DUE TO BAD WEATHER CONDITION (DUST STORM)	OEOC	POOH 2" * 4" TAPER TAP	161.50
1404.02.16	7.5	7.5 HRS NPT DUE TO DELAY IN OPERATION	OEOC	RIH 2" * 4" TAPER TAP	169.00
1404.02.20	3.0	3HRS'NPT DUE TO DELAY IN OPERATION	OEOC	POOH	172.00
1404.02.27	6.0	6HRS NPT DUE TO DRAWWORKS FAILURE	OEOC	RIH	178.00
1404.02.29	15.0	DUE TO MILLING LOW PROGRESS, POOH, LEFT IN HOLE	OEOC	TRIP	193.00
1404.02.30	24.0	LEFT IN HOLE, FISHING	OEOC	TRIP	217.00

1404.02.31	24.0	LEFT IN HOLE, FISHING	OEOC	FISHING TRIP, MILLING & PUSH THE FISH	241.00
1404.03.01	24.0	LEFT IN HOLE, FISHING	OEOC	FISHING TRIP, MILLING & PUSH THE FISH	265.00
1404.03.02	24.0	LEFT IN HOLE, FISHING	OEOC	FISHING TRIP, MILLING & PUSH THE FISH	289.00
1404.03.03	24.0	LEFT IN HOLE, FISHING	OEOC	FISHING TRIP, MILLING & PUSH THE FISH	313.00
1404.03.04	24.0	LEFT IN HOLE, FISHING	OEOC	TRIP TO FISHING	337.00
1404.03.05	24.0	LEFT IN HOLE, FISHING	OEOC	FISHING	361.00
1404.03.06	3.0	LEFT IN HOLE, FISHING	OEOC	FISHING	364.00
1404.03.09	3.5	STOP OPERATION DUE TO HIGH WIND SPEED	OEOC	TRIP	367.50
1404.03.11	3.0	FAILURE LOGGING TOOLS	SEALAND / THE THIRD PARTY	SBT LOGGING	370.50
1404.03.12	7.0	WAIT ON NEXT DECISION	OEOC	WAITING	377.50
1404.03.13	22.0	WAIT ON NEXT DECISION	OEOC	WAITING	399.50
1404.03.14	10.0	DELAY IN OPERATION	OEOC	POOH	409.50
1404.03.18	24.0	WAIT ON OEOC TO MAKE DECISION	OEOC	POOH	433.50
1404.03.19	12.0	WAIT ON OEOC TO MAKE DECISION	OEOC	POOH	445.50
1404.03.20	12.0	DELAY IN OPERATION	OEOC	POOH	457.50
1404.03.24	24.0	DELAY IN OPERATION	OEOC	RUN COMP STRG	481.50
1404.03.25	24.0	DELAY IN OPERATION	OEOC	RUN COMP STRG	505.50
1404.03.26	24.0	DELAY IN OPERATION	OEOC	RUN COMP STRG	529.50

1404.03.27	24.0	DELAY IN OPERATION	OEOC	RUN COMP STRG	553.50
1404.03.28	24.0	DELAY IN OPERATION	OEOC	RUN COMP STRG	577.50
1404.03.29	24.0	DELAY IN OPERATION	OEOC	RUN COMP STRG	601.50
1404.03.30	24.0	DELAY IN OPERATION	OEOC	RUN COMP STRG	625.50
1404.03.31	24.0	DELAY IN OPERATION	OEOC	RUN COMP STRG	649.50
1404.04.01	24.0	DELAY IN OPERATION	OEOC	RUN COMP STRG	673.50
1404.04.02	7.0	DELAY IN OPERATION	OEOC	RUN COMP STRG	680.50

Table 2-4: AZNS-12 NPT Time BreakDown (Based on Client's Order & Information)

3. Geological & Logging Reports

X (m)	Y (m)	Z (m)	MD (m)	Incl (deg)	Az (deg)	DX(m)	DY(m)	TVD (m)	DLS (deg/30m)
189014.5	3437767.8	15.0	0.0	0.0	0.0	0.0	0.0	0.0	0.0
189015.4	3437767.3	-85.0	100.0	0.3	118.5	1.0	-0.5	100.0	0.0
189015.7	3437767.1	-185.0	200.0	0.2	118.5	1.2	-0.7	200.0	0.3
189015.9	3437767.0	-285.0	300.0	0.1	175.0	1.4	-0.8	300.0	0.0
189015.8	3437766.7	-385.0	400.0	0.1	268.6	1.3	-1.1	400.0	0.0
189015.5	3437766.6	-485.0	500.0	0.4	272.9	1.1	-1.2	500.0	0.9
189015.4	3437766.8	-585.0	600.0	0.1	45.0	0.9	-0.9	600.0	0.5
189015.1	3437767.0	-685.0	700.0	0.1	263.8	0.6	-0.7	700.0	0.0
189014.7	3437766.9	-785.0	800.0	0.4	274.4	0.2	-0.8	800.0	0.3
189013.9	3437766.8	-885.0	900.0	0.4	258.4	-0.6	-1.0	900.0	0.9
189013.1	3437766.8	-985.0	1000.0	0.6	275.6	-1.4	-1.0	1000.0	0.3
189012.3	3437766.8	-1085.0	1100.0	0.7	277.9	-2.2	-1.0	1100.0	0.9
189011.4	3437766.7	-1185.0	1200.0	0.2	241.5	-3.1	-1.1	1200.0	0.8
189010.8	3437766.9	-1285.0	1300.0	0.5	289.4	-3.7	-0.9	1300.0	0.3
189010.4	3437767.3	-1385.0	1400.0	0.5	334.3	-4.1	-0.5	1400.0	0.3
189010.2	3437767.7	-1485.0	1500.0	0.2	316.7	-4.3	0.0	1500.0	0.1
189009.9	3437767.9	-1585.0	1600.0	0.2	316.1	-4.6	0.1	1600.0	0.1
189009.8	3437767.3	-1685.0	1700.0	0.7	176.3	-4.6	-0.5	1700.0	0.1
189010.3	3437765.9	-1785.0	1800.0	1.0	158.5	-4.1	-1.9	1800.0	0.1
189011.3	3437764.1	-1884.9	1900.0	1.2	148.8	-3.2	-3.7	1899.9	0.0
189012.7	3437762.5	-1984.9	2000.0	1.3	140.6	-1.8	-5.3	1999.9	0.1
189014.6	3437760.8	-2084.9	2100.0	1.5	121.3	0.1	-7.0	2099.9	0.0
189016.7	3437759.7	-2184.8	2200.0	1.3	106.8	2.2	-8.1	2199.8	0.8
189018.4	3437758.9	-2284.8	2300.0	0.9	108.9	3.9	-8.9	2299.8	0.5
189019.6	3437757.8	-2384.8	2400.0	0.9	153.0	5.1	-10.0	2399.8	0.3
189020.1	3437756.6	-2484.8	2500.0	0.5	145.9	5.7	-11.1	2499.8	0.5
189020.5	3437755.9	-2584.8	2600.0	0.5	148.0	6.0	-11.9	2599.8	0.4
189020.9	3437755.4	-2684.8	2700.0	0.3	159.2	6.4	-12.4	2699.8	0.4
189021.1	3437754.9	-2784.8	2800.0	0.2	233.8	6.6	-12.9	2799.8	0.8
189021.0	3437754.3	-2884.8	2900.0	0.4	193.3	6.5	-13.5	2899.8	0.3
189020.8	3437753.6	-2984.8	3000.0	0.4	196.7	6.3	-14.1	2999.8	0.2
189020.3	3437753.1	-3084.8	3100.0	0.5	223.3	5.8	-14.7	3099.8	0.3
189019.9	3437752.4	-3184.8	3200.0	0.4	215.4	5.4	-15.4	3199.8	0.6
189019.6	3437751.8	-3284.8	3300.0	0.4	215.1	5.1	-15.9	3299.8	0.1
189019.4	3437751.2	-3384.8	3400.0	0.6	183.5	4.9	-16.6	3399.8	0.3
189024.5	3437750.9	-3484.3	3500.0	16.6	85.2	10.0	-16.9	3499.3	14.5
189084.3	3437750.9	-3562.0	3600.0	54.8	90.2	69.8	-16.9	3577.0	9.3
189172.4	3437751.3	-3609.3	3700.0	62.7	89.2	158.0	-16.5	3624.3	1.0
189261.7	3437752.5	-3654.5	3800.0	62.7	89.0	247.2	-15.3	3669.5	0.9

Table 3-1: AZNS-12 Well Trajectory Data

Formation	TVDss (m)	MD (m)	Thickness (TVDm)
Aghajari	4	11	
Gachsaran	-945	961	306
Asmari	-1252	1267	193
Pabdeh or Pa/Ja	-1445	1460	522
U – Gurpi	-1967	1982	305
Gurpi _ Tarbur Mb.	-2272	2287	91
L – Gurpi	-2363	2379	142
Ilam	-2505	2520	65
Laffan	-2570	2586	7
Sar – 1	-2577	2592	19
Sar – 2	-2596	2612	9
Sar – 3	-2605	2620	31
Sar 4 – 6	-2636	2652	83
Sar – 7	-2719	2748	17
Sar – 9	-2802	2852	35
Sar – 10	-2837	2883	20
Sar – 11	-2857	2893	38
Sar – 12	-2895	2940	72
Sar – Intra	-2967	2991	256
Kaz – top	-3223	3369	130
Kaz – 1 shale	-3353	3369	16
Kaz – 2 sand	-3369	3384	15
Kaz – 3 shale	-3384	3399	6
Kaz – 4 sand	-3390	3406	21
Kaz – 5 shale	-3411	3427	13
Dariyan	-3424	3439	157
KOP	3470		
Gad – 1	-3582	3597	11
Gad – 2u	-3593	3608	54
Khalij	-3647	3784.39	9
Gad – 2I	-3656	3803.54	4
Gad – 3	-3660	3812.3	5
Gad – 4	-3665	3822.19	17
Gad – 5a	-3681	3857.65	10
Gad – 5b	-3691	3879.36	2
Gad – 5c	-3694	3884.54	13
Gad – 6	-3707	3913.1	14
TD	-3721	3945	

Table 3-2: AZNS-12 Formation Tops

Reservoir	Sub Layer	Mid. Of Sub-Layer (mss)	Temp. (°F)	Temp. Gradiant (°F/100ft.)	Current Reservoir Pressure (psia)	Basis for Reservoir Pressure
Gadvan	Gad – 5a	-3690.7	244.3	1.32	4864	Dynamic Model
	Gad – 5c	-3703.7	244.9		4874	

Table 3-3: AZNS-12 Predicted Pressure & Temperature & TTZ Contact

Formation / mbr.	Interval (mMD)	Pore Pr. (sg)	Collapse Pr. (sg)	Fracture Pr. (sg)
Aghajari	0 ~ 974	0.98 ~ 1.18	0.06 ~ 1.39	1.01 ~ 1.89
Gachsaran	974 ~ 1281	1.13 ~ 1.31	0.78 ~ 1.36	1.89 ~ 2.01
Asmari	1280 ~ 1474	1.14 ~ 1.26	0.6 ~ 1.28	1.43 ~ 1.79
Pabdeh / Jahrum	1474 ~ 2124	1.20 ~ 1.26	0.82 ~ 1.36	1.40 ~ 1.78
Gurpi	2124 ~ 2539	1.21 ~ 1.26	0.66 ~ 1.02	1.40 ~ 1.76
Ilam	2539 ~ 2613	1.18 ~ 1.24	0.20 ~ 0.9	1.41 ~ 1.72
Laffan mbr.	2613 ~ 2620	1.13 ~ 1.18	0.24 ~ 1.11	1.41 ~ 1.72
Sarvak	2620 ~ 3261	1.14 ~ 1.26	0.24 ~ 1.23	1.44 ~ 1.81
Kazhdumi	3261~ 3465	1.10 ~ 1.14	0.46 ~ 0.96	1.93 ~ 2.06
Dariyan	3465 ~ 3627	1.18 ~ 1.25	0.55 ~ 1.10	1.96 ~ 2.06
Gadvan	3627 ~ 3932	1.10 ~ 1.25	0.55 ~ 1.44	1.97 ~ 2.11

Table 3-4: AZNS-12 Formation Pressure Prediction in Blok III

4. Bottom Hole Assembly

BHA No.				
Itme	Type	OD (in)	Length (m)	Cum. Length (m)
No. #1				
1	3-1/2" Spear	3.5	4.7	4.7
2	4-3/4" DC	4.75	54.89	59.59
3	3-1/2" HWDP	3.5	248.61	308.2
4	3-1/2" DP	3.5	579.01	887.21
5	X.O.S	6.438	1.02	888.23
6	5" DP	5	2435.93	3324.16

BHA No.				
Itme	Type	OD (in)	Length (m)	Cum. Length (m)
No. #2				
1	Rotary Taper Tap	4.25	0.965	0.965
2	4-3/4" Bit Sub	4.75	1.05	2.015
3	4-3/4" DC	4.75	8.93	10.945
4	Fishing Jar	4.764	2.3	13.245
5	4-3/4" DC	4.75	9.05	22.295
6	3-1/2" HWDP	3.5	54.765	77.06
7	3-1/2" DP	3.5	579.295	656.355
8	X.O.S	6.438	1.02	657.375
9	5" DP	5	2436.09	3093.465

BHA No.				
Itme	Type	OD (in)	Length (m)	Cum. Length (m)
No. #3				
1	Rotary Taper Tap	4	0.965	0.965
2	4-3/4" Bit Sub	4.75	1.05	2.015
3	4-3/4" DC	4.75	9.13	11.145
4	Fishing Jar	4.764	2.3	13.445
5	3-1/2" HWDP	3.5	276.56	290.005
6	3-1/2" DP	3.5	579.295	869.3
7	X.O.S	6.438	1.02	870.32
8	5" DP	5	2722.04	3592.36

BHA No.				
Itme	Type	OD (in)	Length (m)	Cum. Length (m)
No. #4				
1	3-1/2" Spear	3.5	4.7	4.7
2	4-3/4" DC	4.75	27.48	32.18
3	3-1/2" HWDP	3.5	276.56	308.74
4	3-1/2" DP	3.5	579.295	888.035
5	X.O.S	6.438	1.02	889.055
6	5" DP	5	2951.22	3840.275

BHA No.				
Itme	Type	OD (in)	Length (m)	Cum. Length (m)
No. #5				
1	3-1/2" Spear	305	4.7	4.7
2	3-1/2" HWDP	3.5	276.56	281.26
3	3-1/2" DP	3.5	579.295	860.555
4	X.O.S	6.438	1.02	861.575
5	5" DP	5	2979.98	3841.555

BHA No.				
Itme	Type	OD (in)	Length (m)	Cum. Length (m)
No. #6				
1	5-1/2" Spear	5.5	7.15	7.15
2	3-1/2" HWDP	3.5	276.56	283.71
3	3-1/2" DP	3.5	579.295	863.005
4	X.O.S	6.438	1.02	864.025
5	5" DP	5	2979.98	3844.005

BHA No.				
Itme	Type	OD (in)	Length (m)	Cum. Length (m)
No. #7				
1	6" Mill	6	0.93	0.93
2	4-3/4" Bit Sub	4.75	1.15	2.08
3	4-3/4" DC	4.75	27.48	29.56
4	3-1/2" HWDP	3.5	276.56	306.12
5	3-1/2" DP	3.5	576.995	883.115
6	X.O.S	6.438	1.02	884.135
7	5" DP	5	2982.28	3866.415

BHA No.				
Itme	Type	OD (in)	Length (m)	Cum. Length (m)
No. #8				
1	3-1/5" Mill	3.5	0.43	0.43
2	3-1/4" Bit Sub	3.25	0.76	1.19
3	3-1/8" DC	3.125	139.43	140.62
4	2-7/8" DP	2.875	85.4	226.02
5	X.O.S	4.75	1.16	227.18
6	3-1/2" HWDP	3.5	280.53	507.71
7	3-1/2" DP	3.5	579.295	1087.005
8	X.O.S	5	1.02	1088.025
9	5" DP	5	2979.98	4068.005

BHA No.				
Itme	Type	OD (in)	Length (m)	Cum. Length (m)
No. #9				
1	2-7/8" Spear	2.875	5.73	5.73
2	3-1/2" HWDP	3.5	267.125	272.855
3	3-1/2" DP	3.5	579.295	852.15
4	X.O.S	4.75	1.02	853.17
5	5" DP	5	2979.98	3833.15

BHA No.				
Itme	Type	OD (in)	Length (m)	Cum. Length (m)
No. #10				
1	2-7/8" Spear	2.875	4.54	4.54
2	3-1/8" DC	3.125	130.07	134.61
3	2-7/8" DP	2.875	85.4	220.01
4	X.O.S	4.75	1.16	221.17
5	3-1/2" HWDP	3.5	27.95	249.12
6	Fishing Jar	4.764	3.97	253.09
7	3-1/2" HWDP	3.5	248.61	501.7
8	3-1/2" DP	3.5	579.295	1080.995
9	X.O.S	4.75	1.02	1082.015
10	5" DP	5	2980.03	4062.045

BHA No.				
Itme	Type	OD (in)	Length (m)	Cum. Length (m)
No. #11				
1	3-1/2" Mill	3.5	0.43	0.43
2	3-1/4" Bit Sub	3.25	0.76	1.19
3	3-1/2" DC	3.125	158.07	159.26
4	X.O.S	4.75	1.16	160.42
5	3-1/2" HWDP	3.5	27.95	188.37
6	Fishing Jar	4.764	3.97	192.34
7	3-1/2" HWDP	3.5	248.61	440.95
8	3-1/2" DP	3.5	579.295	1020.245
9	X.O.S	4.75	1.02	1021.265
10	5" DP	5	2980.03	4001.295

BHA No.				
Itme	Type	OD (in)	Length (m)	Cum. Length (m)
No. #12				
1	4" Mill	4	0.87	0.87
2	3-1/8" Bit Sub	3.125	0.8	1.67
3	3-1/2" DC	3.125	130.28	131.95
4	X.O.S	4.75	1.16	133.11
5	3-1/2" HWDP	3.5	27.95	161.06
6	Fishing Jar	4.764	3.97	165.03
7	3-1/2" HWDP	3.5	248.61	413.64
8	3-1/2" DP	3.5	579.295	992.935
9	X.O.S	4.75	1.02	993.955
10	5" DP	5	2980.03	3973.985

BHA No.				
Itme	Type	OD (in)	Length (m)	Cum. Length (m)
No. #13				
1	4" Mill	4	0.87	0.87
2	3-1/8" Bit Sub	3.125	0.8	1.67
3	3-1/2" DC	3.125	139.5	141.17
4	X.O.S	4.75	1.16	142.33
5	3-1/2" HWDP	3.5	27.95	170.28
6	Fishing Jar	4.764	3.97	174.25
7	3-1/2" HWDP	3.5	248.61	422.86
8	3-1/2" DP	3.5	579.295	1002.155
9	X.O.S	4.75	1.02	1003.175
10	5" DP	5	2980.03	3983.205

BHA No.				
Itme	Type	OD (in)	Length (m)	Cum. Length (m)
No. #14				
1	3-1/2" Mill	3.5	0.415	0.415
2	3-1/8" Bit Sub	3.125	0.98	1.395
3	3-1/2" DC	3.125	93.03	94.425
4	2-7/8" DP	2.875	47.59	142.015
5	X.O.S	4.75	1.16	143.175
6	3-1/2" HWDP	3.5	27.95	171.125
7	Fishing Jar	4.764	3.97	175.095
8	3-1/2" HWDP	3.5	248.61	423.705
9	3-1/2" DP	3.5	579.75	1003.455
10	X.O.S	4.75	1.02	1004.475
11	5" DP	5	2989.72	3994.195

BHA No.				
Itme	Type	OD (in)	Length (m)	Cum. Length (m)
No. #15				
1	4-1/16" Overshot	4.063	1.34	1.34
2	2-7/8" DP	2.875	57.03	58.37
3	3-1/2" DC	3.125	83.61	141.98
4	X.O.S	4.75	1.16	143.14
5	3-1/2" HWDP	3.5	27.95	171.09
6	Fishing Jar	4.764	3.97	175.06
7	3-1/2" HWDP	3.5	248.61	423.67
8	3-1/2" DP	3.5	579.75	1003.42
9	X.O.S	4.75	1.02	1004.44
10	5" DP	5	2989.72	3994.16

BHA No.				
Itme	Type	OD (in)	Length (m)	Cum. Length (m)
No. #16				
1	5-7/8" C.C Bit	5.875	0.1	0.1
2	4-3/4" Bit Sub	4.75	1.22	1.32
3	3-1/2" DP	3.5	579.295	580.615
4	X.O.S	4.75	1.02	581.635
5	5" DP	5	2980.03	3561.665

BHA No.				
Itme	**Type**	**OD (in)**	**Length (m)**	**Cum. Length (m)**
No. #17				
1	8-3/8" Bottom Bit	8.375	0.35	0.35
2	6-1/2" Bit Sub	6.5	1.12	1.47
3	6-1/2" DC	6.5	27.19	28.66
4	5" HWDP	5	55.53	84.19
5	5" DP	5	2980.03	3064.22

BHA No.				
Itme	**Type**	**OD (in)**	**Length (m)**	**Cum. Length (m)**
No. #18				
1	8-3/8" Bottom Bit	8.375	0.35	0.35
2	6-1/2" Bit Sub	6.5	1.12	1.47
3	6-1/2" DC	6.5	27.19	28.66
4	5" HWDP	5	55.53	84.19
5	5" DP	5	2980.03	3064.22

BHA No.				
Itme	Type	OD (in)	Length (m)	Cum. Length (m)
No. #19				
1	5-7/8" Rock Bit	5.875	0.17	0.17
2	7" Scraper	7	1.01	1.18
3	4-3/4" Bit Sub	4.75	1.22	2.4
4	4-3/4" DC	4.75	54.89	57.29
5	3-1/2" HWDP	3.5	82.715	140.005
6	3-1/2" DP	3.5	366.64	506.645
7	4-1/2" IF box* 3-1/2" IF pin X.O.S	5	0.96	507.605
8	6-1/2" D. pin	6.5	0.31	507.915
9	9-5/8" Scraper	9.625	1.38	509.295
10	6-1/2" Bit Sub	6.5	1.12	510.415
11	5" HWDP	5	55.53	565.945
12	5" DP	5	3209.64	3775.585

BHA No.				
Itme	Type	OD (in)	Length (m)	Cum. Length (m)
No. #20				
1	7-5/16" Polish Mill	7.312	0.51	0.51
2	6-1/2" DC	6.5	27.19	27.7
3	5" HWDP	5	55.53	83.23
4	5" DP	5	3209.64	3292.87

BHA No.				
Itme	Type	OD (in)	Length (m)	Cum. Length (m)
No. #21				
1	8-1/4" Packer	8.25	3.55	3.55
2	5" DP Pup Joint	5	1.73	5.28
3	6-1/2" DC	6.5	27.19	32.47
4	5" HWDP	5	55.53	88
5	5" DP	5	3209.64	3297.64

BHA No.				
Itme	Type	OD (in)	Length (m)	Cum. Length (m)
No. #22				
1	3-1/8" DC	3.125	83.77	83.77
2	2-7/8" DP	2.875	85.4	169.17
3	X.O.S	4.75	1.16	170.33
4	3-1/2" HWDP	3.5	276.56	446.89
5	3-1/2" DP	3.5	289.92	736.81
6	X.O.S	4.75	1.02	737.83
7	5" HWDP	5	55.53	793.36
8	5" DP	5	3219.33	4012.69

Table 4-1: AZNS-12 Bottom Hole Assembly

5. Casing Information

Casing Spec.	20"	J – 55, 133#, BTC	154^{m}
	13 – 3/8"	C – 95, 72#, BTC	1259^{m}
	9 – 5/8"	L – 80,47 & 53#, VAM & N. VAM	3448^{m}
	7"	C – 75, 29#, N. VAM	$3285 – 3846^{m}$
	5”	L – 80, 18#, VFJ, HTS	$3779 – 3945^{m}$

Table 5-1: AZNS-12 Final Casing Data

6. Cement Job Report

6.1 Magnesite Report

DanaEnergy	Dept. Name: Engineering			BU: WS	
	Doc Name: Cement Lab Report (Magnesite Test Report)			Page 1 of 2	
	Doc No.: DOS-MS-0092	Creation Date: 04/21/2018	Revision Date: 10/09/2023	Scope of Use: Ex	
	Record Doc Class #: E4	Record No.: 00	Record date: 05/14/2025	Rev. No.: 02	

Magnesite Test Report

Project No.:	DOS-25-DE-0159			**Well:**	AZNS-012			**Date:**	14-May-25
Company:	Mahan Sanat Arya							**Field:**	South Azadegan
Well Depth:	**(TVD):**	3736	**m**	12258	**ft**	**MD:**	3945 **m**	**Job Type :**	Magnesite Plug
Job Purpose:	Plug							**Rig:**	OEOC 208

Additives:	**QC Code**	**Conc.**	
Fresh Water	---	42.0	**gal/bbl**
Magnesite Thinner	D-THR-07	1.5	**lb/bbl**
Magnesite Retarder	D-MR-08	30	**lb/bbl**
DF-DA 3	D-DF3-34	0.1	**gal/bbl**
Low Temp. Magnesite Cement	Mahan Sanat Arya Supplied	496.45	**lb/bbl**

Magnesite and Mixing Water:

Mix Water Source: Fresh Water

Slurry Density: 100 **PCF** 1.60 **S.G**

Yield: 1.56 **bbl of slurry/bbl of water**

Magnesite Slurry =	25.0	**bbl**	**& Dead Volume:**	10.0	**bbl**
Fresh Water		22.38	**bbl**	22.38	**bbl**
Magnesite Thinner		33.57	**lb**	0.6	**Sacks**
Magnesite Retarder		671.43	**lb**	12.2	**Sacks**
DF-DA 3		2.24	**gal**	0.4	**Can**
Low Temp. Magnesite Cement		5.0	**MT**	5.0	**JB**

Temperature **BHST:** 117 °C **BHCT:** 93 °C

Temperature **BHST:** 242 °F **BHCT:** 200 °F **Temperature Gradient:** 1.32 °F / 100 ft

API Schedule: **Heat up time:** min **Final Pressure :** psi

API Free Fluid: 1 cc 0.4 % **Free Fluid @ 45° :** cc %

API Fluid Loss: cc/30 min @ °F and 1000 Psi

Temp.	**Rheology Data Fan Readings (RPM)**						**Gel lb/100ft²**		**PV**	**YP**
°F	**600**	**300**	**200**	**100**	**6**	**3**	**10 sec**	**10 min**	**CP**	**lb/100ft²**
80	Ramp Up	25	20	15	11	10			15.75	9.25
80	Ramp Down	25	19	14	10	9				
195	Ramp Up	27	18	17	10	8			15.75	11.25
195	Ramp Down	27	18	16	9	7				

Pumping Time: **30(BC):** 03:55 **Hrs:Min** **50(BC):** 04:10 **Hrs:Min** **70(BC) :** 04:18 **Hrs:Min**

Compressive Strength: ~302 **Psi** in 24 **Hrs @** 242 **°F**

Water Analysis: **Chlorides:** <1000 **mg/liter**

P.H: Prehydrated **D.B:** Dry Blended **% bwoc:** % by weight of cement **% bwow:** % by weight of water

Note: **Calc. based on 1 bbl of Fresh Water**

Remarks:

Lab Engineer: *Babak Sheikhzadeh / Amir Kokabi / Sajjad Ansari / Hamid Asghari*

Head of Engineering: *Nima Ramezani*

* Standards in this lab are traceable to national and international standards.

6.2 Pilot Test Report

DanaEnergy	Dept. Name: Engineering			BU: WS	
	Doc Name: Cement Lab Report (Pilot Test)			Page 2 of 2	
	Doc No.: DOS-MS-0092	Creation Date: 04/21/2018	Revision Date: 09/10/2023	Scope of Use: Ex	
	Record Doc Class #: E4	Record No.: 00	Record date: 05/14/2025	Rev. No.: 02	

Pilot Test

Project No.:	DOS-25-DE-0159			**Well:**	AZNS-012	**Date:**	14-May-25
Company:	Mahan Sanat Arya					**Field:**	South Azadegan
Well Depth:	**(TVD):**	3736 **m**	12258 **ft**	**MD:**	3945 **m**	**Job Type :**	Magnesite Plug
Job Purpose:	Plug					**Rig:**	OEOC 208

Magnesite Cement:

QC Code	Additives	Conc.		Qty		Mixing Time
	Fresh Water	**42.00**	**gal/bbl**	**255.78**	**ml**	
D-THR-07	**Magnesite Thinner**	**1.50**	**lb/bbl**	**1.09**	**gr**	**1 min**
D-MR-08	**Magnesite Retarder**	**30.00**	**lb/bbl**	**21.89**	**gr**	**1 min**
D-DF3-34	**DF-DA 3**	**0.10**	**gal/bbl**	**0.61**	**ml**	**10 s**
Mahan Sanat Arya Supplied	**Low Temp. Magnesite Cement**	**496.45**	**lb/bbl**	**362.29**	**gr**	**3 min**

Slurry Volume: **400** **ml**

Slurry Density: **100.0** PCF

Slurry Yield: **1.56** **bbl of slurry/bbl of water**

Calc. based on 1 bbl of Fresh Water

Lab Engineer: *Babak Sheikhzadeh / Amir Kokabi / Sajjad Ansari / Hamid Asghari*

Head of Engineering: *Nima Ramezani*

* Standards in this lab are traceable to national and international standards.

Timing Schedule				
Stage	**Rate** (bbl/min)	**Volume** (bbl)	**Time** (min)	**Total Time** (min)
Batch Mixing Time	--		40.0	40
Spacer Ahead	5.0	5.0	1.0	41
Magnesite Slurry	5.0	25.0	5.0	46
Spacer Behind	5.0	6.90	1.4	47
Displacement	5.0	214.28	42.9	90
POOH Drill Pipe From Top of Magnesite	--		70.0	160
Flush String	--		30.0	**190**

7. Completion Report

7.1 Completion Tubing Information

Tubing Size (in)	Weight (ppf)	Grade	Ultimate Strengths	Connection	Collapse Pressure (psi)	Burst Pressure (psi)	Interval (m)
4 – 1/2	18.9	L – 80	233 klb	HSM3	13830	13380	0 – 3180.87
3 – 1/2	10.2	L – 80	440 klb	HSM3	12120	11560	3180.87 – 3346.2

Table 7-1: AZNS-12 Tubing Data

7.2 Completion Tools Specification Checklist

Item	Equipment Description	
1	**CONTROL LINE "WEIQIXIN":**	
	THINKNESS:	0.065"
	WORK PRESSURE:	150,00 PSI
	O.D.:	0.25"
	TYPE:	SEAMLESS
	MATERIAL:	INC 825
	LENGTH:	120 m/Roll
2	**UPPER FLOW COUPLING " WEIQIXIN" :**	
	OD:	5.5"
	ID:	3.640"
	THREADS:	4 – 1/2" 18.9 PPF, HSM3
	WORKING PRESSURE:	7,500 PSI
	LENGTH:	6 FT
	MATERIAL:	9Cr1MO
	LOWER FLOW COUPLING " WEIQIXIN" :	
	OD:	5.550"
	ID:	3.640"
	THREADS:	4 – 1/2" 18.9 PPF, HSM3
	WORKING PRESSURE:	7,500 PSI
	LENGTH:	4 FT
	MATERIAL:	9Cr1MO
3	**TUBING RETRIEVABL SAFETY VALVE " WEIQIXIN" :**	
	SETTING DEPTH:	62.796^{m}
	WORKING PRESSURE:	7,500 PSI
	TEMPERATURE:	325 DEG F
	MAX O.D.:	7.5"

Item	Equipment Description	
	MIN. I.D.:	3.437"
	PROFILE:	AF
	SELF-EQUALIZING FEATURE	HYDRAULIC CONTROL
	MATERIAL:	9Cr1MO
	THREADS:	4 – 1/2" 18.9 PPF HSM3
	PROTECTION SLEEVE	
	PROFILE	AF
	MIN ID	2.9"
4	**TRAVELING JOINT " WEIQIXIN" :**	
	STROKE LENGTH	10 FT
	SHEAR PIN SET:	20,000LB
	ELASTOMER:	AFLAS
	WORKING PRESSURE:	7,500 psi
	TEMPERATURE:	300 DEG F
	TOOL OD:	5.315"
	TOOL ID:	2.922"
	THREADS:	3 – 1/2" 10.20 PPF HSM3 B*P
	MATERIAL:	9Cr1MO
	TRANSFER TORQUE FEATURE	YES
5	**SLIDING SIDE DOOR " WEIQIXIN" :**	
	PROFILE:	X
	MAX.OD:	4.551"
	MIN ID:	2.750"
	PRESSURE RATING:	7,500 PSI
	TEMPERATURE:	300 DEG F
	THREADS:	3 – 1/2" 10.20 PPF HSM3 B*P
	MATERIAL:	9Cr1MO
	OPEN METHOD	DOWNWARD OPEN
6	**COMPLETION PACKER " WEIQIXIN" :**	
	TYPE:	RETRIEVABLE
	CASING :	7" 29 PPF
	OD:	5.689"
	ID:	2.922"
	WORKING PRESSURE:	7,500 PSI
	TEMPERATURE:	300 DEG F
	THREADS:	3 – 1/2" 10.20 PPF HSM3 B*P
	MATERIAL:	9Cr1MO
	ELEMENT MATERIAL:	AFLAS
7	**LANDING NIPPLE " WEIQIXIN" :**	
	PROFILE TYPE:	XN
	WORKING PRESSURE:	7,500 PSI
	MAX O.D.:	4.5"
	SEAL BORE:	2.750”
	MIN ID:	2.441"
	THREADS:	3 – 1/2" 10.20 PPF HSM3 B*P


Item	Equipment Description	
	TEMPERATURE:	300 DEG F
	MATERIAL:	9Cr1MO
8	**RE-ENTRY GUIDE SHOE " WEIQIXIN" :**	
	OD:	4.5"
	MIN ID:	2.922"
	TOP CONNECTION	3 – 1/2" 10.20 PPF HSM3 BOX
	MATERIAL:	9Cr1MO

Item	Name	Description
1	**Tubing Hanger**	11" BOWL x 4-1/2" 18.9 7.5K PPF BOX TPCQ-EX CONNECTION BOTTOM & 4-1/2" 4-2G ACME BOX TOP WITH 4-1/2" EXTENDED NECK, WITH ONE CONTINUOUS 1/4" NPT C. LINE EXIT FOR SSSV, ONE 1/4" LINE EXIT FOR DHPG, INSTALLATION COMPLETE WITH RELATED FITTINGS AND PLUGS, C/W ALIGNMENT PREPATION FOR ESP. BPV: 4" TYPE H THREAD PREPARATION, THREE FS SEAL TO PACK OFF THE UPPER NECK AND TWO S SEAL TO PACK OFF THE BODY OF HANGER, MATERIAL: 410SS. M.C: FF-0.5 T.C: U PSL:3G PR:2 COMPANY: MSP
2	**Fluted Adaptor**	4 – 1/2" 18.9 PPF, L – 80 HSM3 PIN * TPCQ EX PIN, OD: 5.5'' ID: 3.64'' SLOTS: 6 * 1 INCH WIDTH

7.3 Assembling & Test Report

NOTE: Assembling & offline pressure tests of completion tools have been done on rig site in presence of client's representative.

Torque-Time Graph:

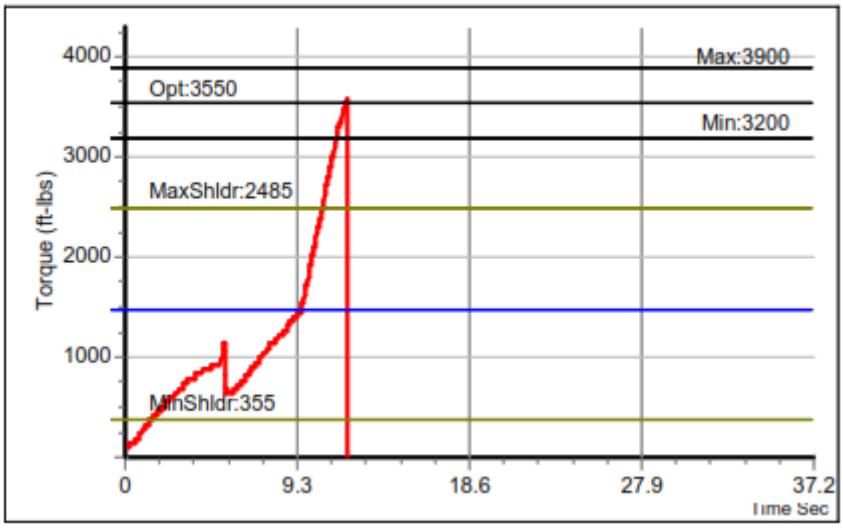

Torque-Time Graph:


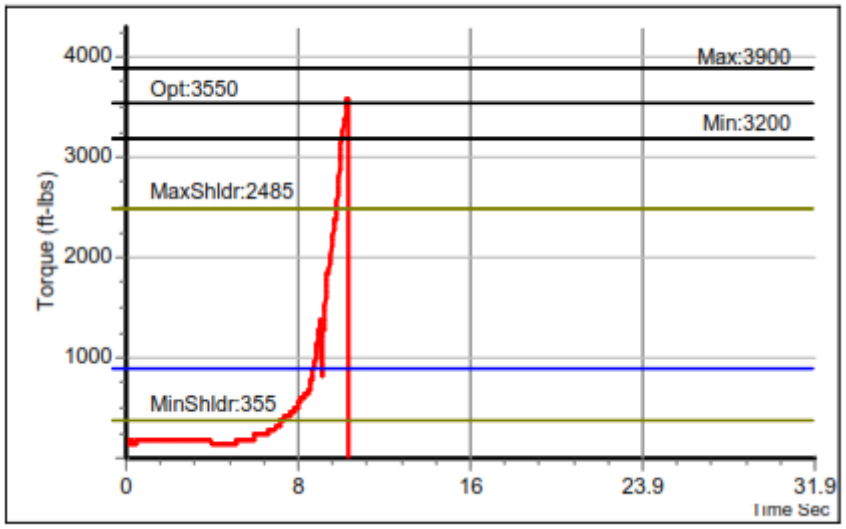


Figure 7-1 Mule Shoe - NoGo Connection

Torque-Time Graph:

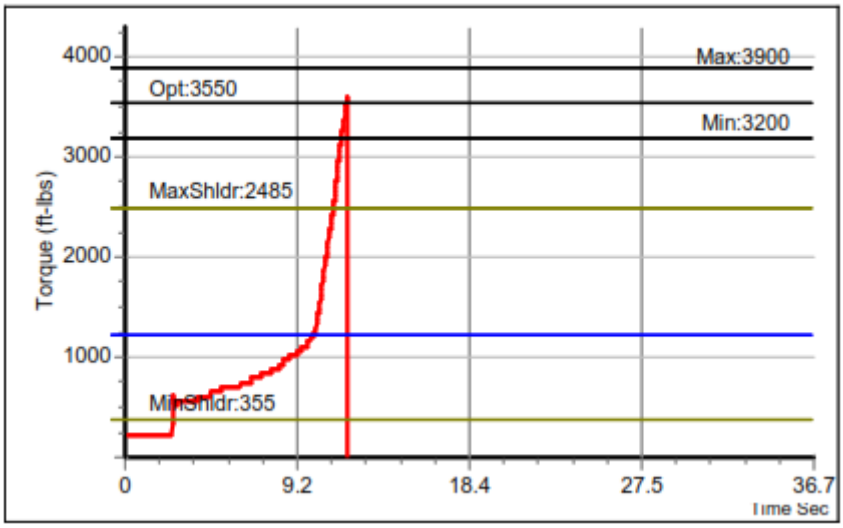

Torque-Time Graph:


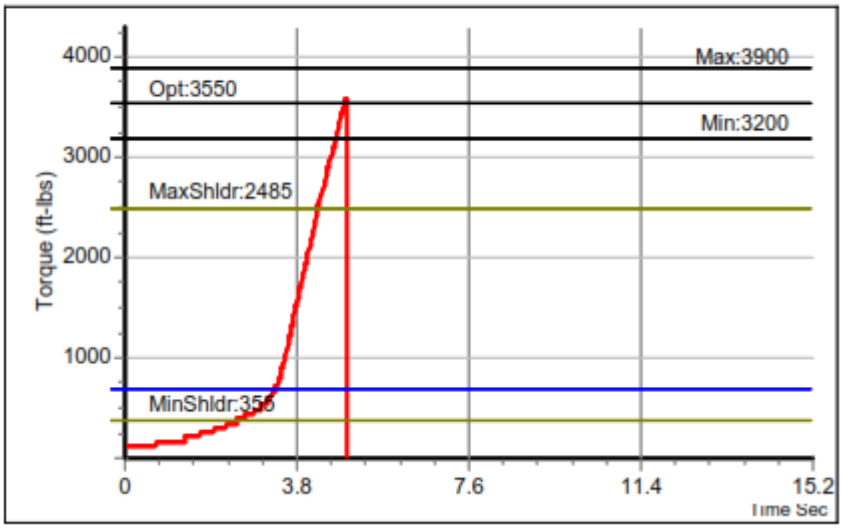


Figure 7-2 Packer Connection

Torque-Time Graph:

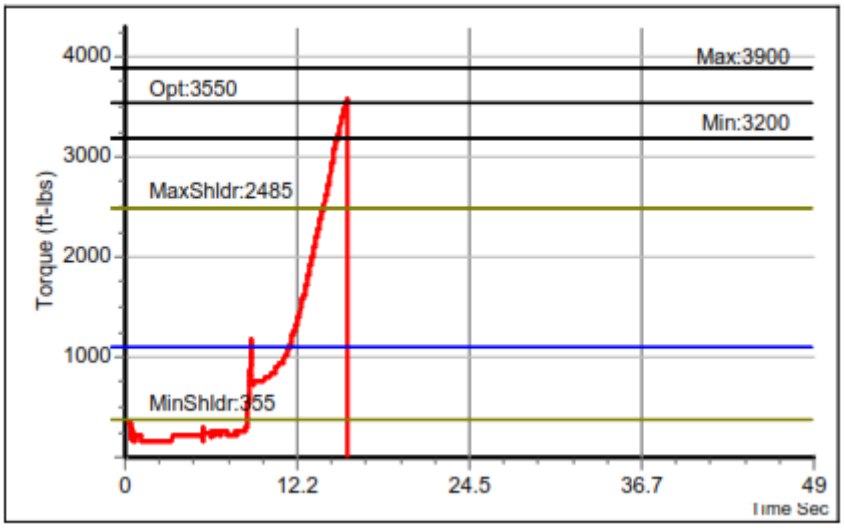

Torque-Time Graph:


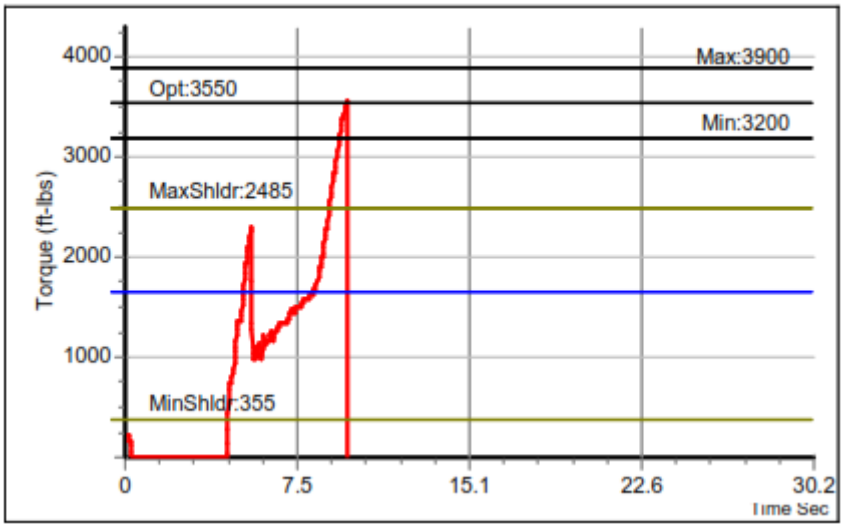


Figure 7-3 SSD Connection

Torque-Time Graph:

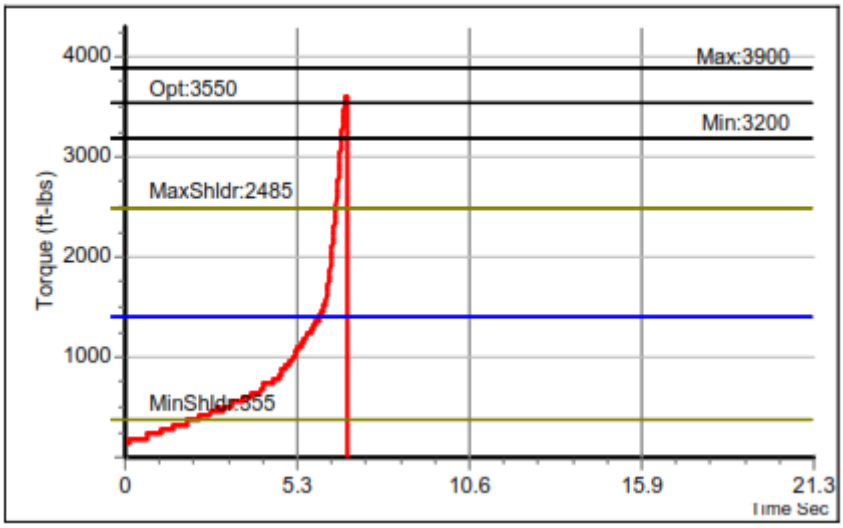

Torque-Time Graph:

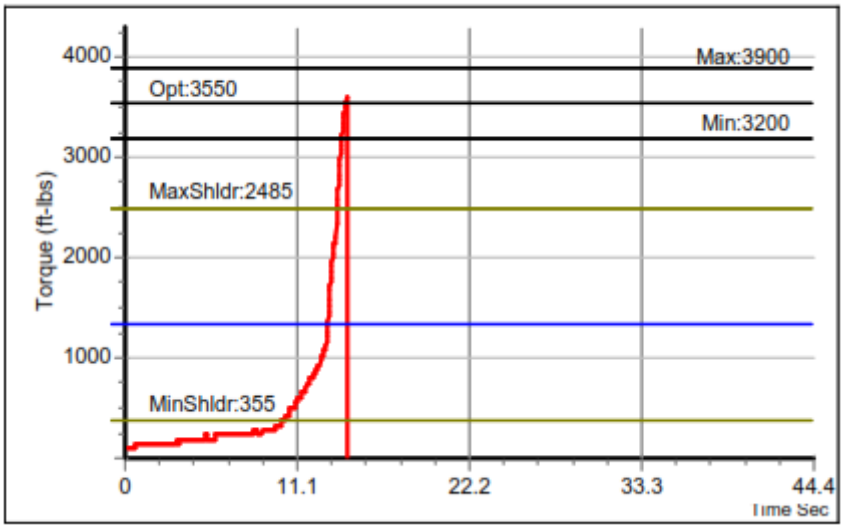


Figure 7-4 EXP. Joint Connection

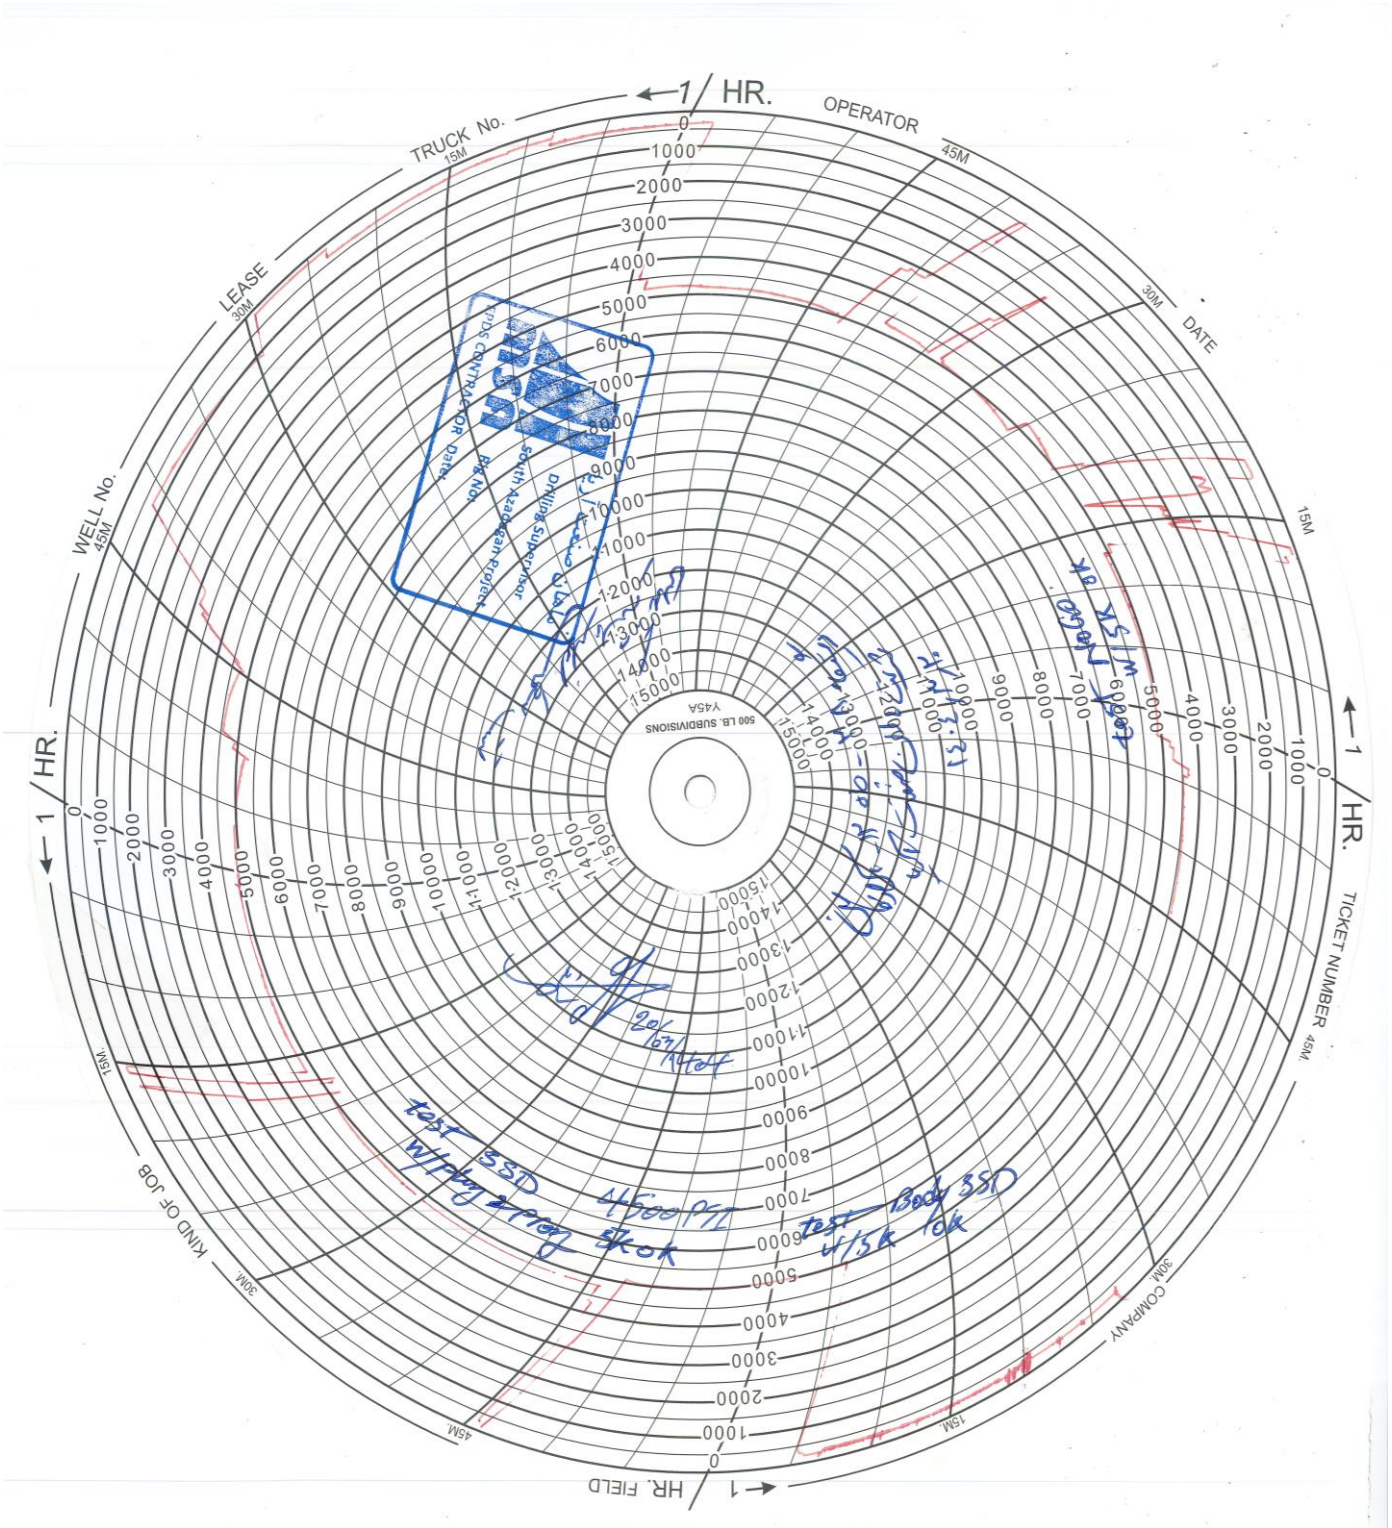


Figure 7-5 Offline Pressure Tests

7.4 Completion Operation Check list

Item	Operation Name	Remark	Check Mark
1	Scraper Trip	Packer depth should be scraped	√
2	Pre-job preparation	Pre-connection All Down Hole Equipment With Upper & Lower Pup Joints On Confirmed Thread-makeup at Workshop, And Pressure Test Prior To Being Transported To Well Site.	X
		Retrieve Wear Bushing, M/U Jet Sub And Flush Bop Stack & Well Head With Fresh Water.	√
		All Crossovers, Pup Joints For Space Out Measured Put In Right Place.	√
		Lift Control Line And Protectors On Rig Floor.	√
		Hold A Pre-Job Safety Meeting For Running Upper Completion String.	√
3	Assembling and RIH	M/U 3-1/2" Re-entry Guide Shoe And 3-1/2" BTM No Go Landing Nipple	√
		Check The Conditions Landing Nipple To Make Sure There Is No Damage, Observe There Is No Any Trash Trapped Inside.	√
		Assemble Landing Nipple.	√
		RIH 1 Joint Tubing As Per Tally	√
		P/U And M/U Hydraulic-Set PERMANENT Production Packer.	√
		Much More Care Should Be Taken When Packer Is Passing Well Head And Liner Hanger While RIH,	√
		Slack Off Packer Assembly, Double Check The Quantity Of Shear Pins, Remove The Tape On The Element, Check If Any Damages On It.	√
		RIH 1 Joint Tubing As Per Tally	√
		M/U Pup Joint And SSD (close Position) To Tubing String With check	√

		valve Inside.	
		Pressure Test Tubing String 4500psi/15min Every 100 JTs.	√
		RIH Completion String and M/U traveling joint as per running tally.	√
		Cont. Running Tubing as per Tally.	-
		M/U TRSSSV	√
		Install control line to TRSSSV and pressure test control line 6000psi x 15mins. And then keep 3000psi pressure while running to ensure TRSSSV open. Install TRSSSV protector for the 1/4" control line. Continue to run 4-1/2" tubing as per running tally.	√
4	M/U and Space out Tubing Hanger	Pick up & M/U tubing hanger with double pin crossover. M/U landing joint. Check string weight upward and downward.	√
		Roughly cut control line about 2 meters above tubing hanger, wrap 2-3 turns and then feed through Tubing Hanger.	√
		Check string weight upward and downward and Space out Tubing Hanger 1.5 m (Half stroke) above tubing head spool	√
Item	**Operation Name**	**Remark**	**Check Mark**
5	Set production packer	R/Up Slick Line. Remove Check valve inside SSD	√
		RIH and Set check valve in Landing Nipple. POOH to surface.	√
		Pressurize inside tubing to 500psi to ensure traveling joint is full open. Increase Pressure gradually to SET PACKER. Increase pressure to 4500 Psi to Test String.	√
6	Land Tubing hanger	Move down completion string and apply required weight to shear traveling joint load pins and Land Tubing hanger in T.H.S. Slack off completely & Record the weight.	√


		Drain the BOP stack through the gate valves of tubing head before landing hanger in THS. Leave the valves open.	√
		Tie Down Screws on THS should be fully open before Operation	√
7	N/D BOP & N/U X-mas tree	Tighten tie down screws.	√
		Test inside string w/ 4500 psi, 15 min.	√
		R/Up Slick Line. RIH with slick line and Ret. Check valve from Landing Nipple. POOH to surface.	√
		Test Annulus w/ 1000 Psi 15min.	√
		Close BOP ram and test above tubing hanger (annulus between BOP and landing joint) to 1000psi.	√
		B/O & L/D landing joint.	√
		Set 4” 2Way in TBG Hanger & Test it, Back off and L/D Running Tool.	√
		N/D BOP.	√
		Feed control line, through head bonnet.	√
		Check hanger for any damage and pressure test control line to 4500psi	√
		Pressure test chemical injection line & rapture the disc after installing Bonnet.	-
		N/U x-mass tree as program.(Bottom Master)	√
		Perform required tests for X-mass tree. (Bottom Master)	√
		Connect from X-mass tree kill valve to the pump unit and test X-Mas tree body to 1000/4500 psi for 15 min against TWCV.	√
		Remove 4" two way, install 4" one way	√
		Close TRSSSV	√
		Release the rig. Clean the well site.	√

7.5 Completion Sketch:

AZNS-12 Completion Sketch

Contractor	MSA / OEOC	Liner & Tubing Data					Client	PEDEC / PPL
Field	AZADEGAN	Description	5"Liner	7"Liner	4 1/2" Tubing	3 1/2" Tubing	7'' Liner Lap:	3286.5
Well Number:	AZNS-12	OD[in]	5.00	7.00	4.50	3.50	7'' Liner Shoe:	3846
Rig :	208-OEOC	Nominal weight [lb/ft]	18.00	29.00	18.90	10.20	5'' Liner Lap:	3779
RTE-GLE	14.45	Grade	L-80	C-75	L-80	L-80	5'' Liner Shoe:	3945
RTE-THF	11.10	Thread	VFJ	N.Vam	HSM3	HSM3	Total Depth:	3945
Rig Spudded Date :		Inside diameter [in]	4.276	6.184	3.640	2.922	X-mass Tree:	MSP
End of Operation		API Drift Diameter	4.151	6.059	3.515	2.797	Size & Rating:	4-1/16" 5K

Schematic

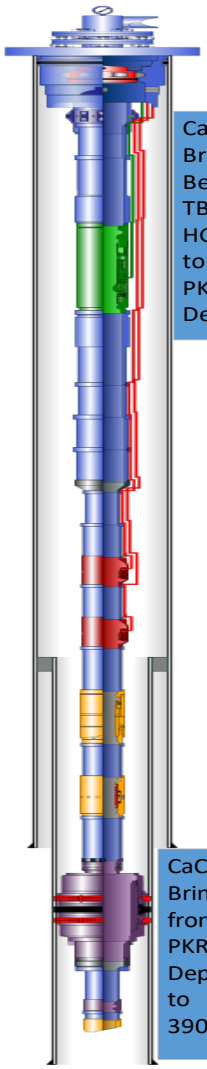

	Description	Max OD	Min ID	Length(m)	BTM(m)	TOP(m)
1	Elevation (Floor - TBG Head Flange)	4.5		11.235	10.345	-0.89
	TBG HGR Running Tools	5		0.230	10.575	10.345
2	TBG HANGER MSP/Drilex, 7.5K, 11" X 4 1/2'' ACME Box up X 4 1/2'' TPCQ-EX Box Down L-80 18.9#, M/C: FF-0.5 T/C: UPSL: 3G PR: 2, 4" Type ''H'' Two Way (Min Bore: 3.68")	5.118	3.64	0.537	11.112	10.575
3	4-1/2" Fluted swage adapter D/P, 18.9# TPCQ-EX Pin on top X HSM3 Pin on down, 9CR1MO, WEIQIXIN Co	6.1	3.64	1.016	12.128	11.112
4	5 JOINTs TUBING 4 1/2",HSM3 ,18.9#, L-80, Type-1	5.118	3.64	47.320	59.448	12.128
5	PUP JOINT 4 1/2",HSM3 ,18.9#, L-80, Type-1	5.118	3.64	1.622	61.070	59.448
6	4-1/2" Flow Coupling,18.9#, 9CR1MO, HSM3, 6' ft, WEIQIXIN Co	5.5	3.64	1.726	62.796	61.070
7	4 1/2" TRSSV Tubing Retrievable Saftey Valve, 18.9# w/ 3.437" Seal bore, HSM3, 9CR1MO, 7.5K WP w/ AF Profile, Flapper Type, WEIQIXIN Co	7.5	3.437	1.784	64.580	62.796
8	4-1/2" Flow Coupling, 18.9#, 9CR1MO, HSM3, 4' ft, WEIQIXIN Co	5.5	3.64	1.119	65.699	64.580
9	PUP JOINT 4 1/2",HSM3 ,18.9#, L-80, Type-1	5.118	3.64	1.625	67.324	65.699
10	328 JOINTs TUBING 4-1/2"HSM3 18.9#, L-80	5.118	3.64	3113.547	3180.871	67.324
11	X-over 4-1/2"HSM3, 18.9# BOX * 3-1/2"HSM3 , 10.2# PIN,	5.118	2.922	1.100	3181.971	3180.871
12	12 JOINTs TUBING 3-1/2"HSM3 , 10.2#, L-80.Type-1	4.25	2.922	113.148	3295.119	3181.971
21	3-1/2" PUP JOINT,HSM3 , 10.2#, L-80, Type-1	4.25	2.922	1.822	3296.941	3295.119
22	3-1/2" EXP. Jt,HSM3 , 9CR1MO, 10' STK (Half Open) Splind Rotational Lock System Any Position, Shear Pin Set 20 Klbs, WEIQIXIN Co	5.135	2.922	5.811	3302.752	3296.941
23	3-1/2" PUP JOINT,HSM3 , 10.2#, L-80, Type-1	4.25	2.922	2.001	3304.753	3302.752
24	1 JOINT TUBING 3-1/2"HSM3 , 10.2#, L-80.Type-1	4.25	2.922	9.443	3314.196	3304.753
25	3-1/2" PUP JOINT,HSM3 , 10.2#, L-80, Type-1	4.25	2.922	1.817	3316.013	3314.196
26	3-1/2" Non-Elastomeric Sliding Side Door, 9CR1MO, HSM3 w/ Type X Selective profile (Profile: 2.750" X, Downward open), 7.5K	4.551	2.75	1.195	3317.208	3316.013
27	3-1/2" PUP JOINT,HSM3 , 10.2#, L-80, Type-1	4.25	2.922	1.597	3318.805	3317.208
28	1 JOINT TUBING 3-1/2"HSM3 , 10.2#, L-80.Type-1	4.25	2.922	9.449	3328.254	3318.805
29	3-1/2" PUP JOINT,HSM3 , 10.2#, L-80, Type-1	4.25	2.922	1.620	3329.874	3328.254
31	7" 29# CSG Hydraulic set retrievable production packer to be run in 7.00" 29 PPF CSG, WEIQIXIN Co	5//689	2.922	2.652	3332.526	3329.874
33	3-1/2" PUP JOINT,HSM3 , 10.2#, L-80, Type-1	4.250	2.922	1.795	3334.321	3332.526
34	1 JOINT TUBING 3-1/2"HSM3 , 10.2#, L-80.Type-1	4.25	2.922	9.446	3343.767	3334.321
35	3-1/2" PUP JOINT,HSM3 , 10.2#, L-80, Type-1	4.25	2.922	1.822	3345.589	3343.767
36	3-1/2" BTM No-Go LND Nipple, HSM3, 10.2#, 9CR1MO, Seal Bore 2.750" TYPE XN, WEIQIXIN Co, 7.5K	4.5	2.562	0.372	3345.961	3345.589
37	3-1/2" Wireline Re-Entry Guide, 10.2 #, HSM3, 9CR1MO, WEIQIXIN Co	4.25	2.922	0.239	3346.200	3345.961
	END OF COMPLETION STRING					3346.200

	BTM(m)	TOP(m)
Tubing Retrievable Saftey Valve	64.580	62.796
Traveling Joint	3302.752	3296.941
SSD	3317.208	3316.013
7'' HYDRAULIC SET PERMANENT PRODUCTION PACKER	3332.526	3329.874
NO-GO Landing Nipple	3345.961	3345.589
Entry Guide	3346.200	3345.961

7.6 Completion Tally:

MSA / OEOC

Field :	Azadegan	Well NO:	AZNS12	Rig NO:	OEOC208	Drlg CO:	OEOC
PEDEC, PPL		Completion String					

Grade	ID "	Drift "	Weight lb/ft	Burst psi	Collaspse psi	Yield klbs	Coupling "	TQ ft x lb	Nominal Dia. OD
L-80	2.922	2.8	10.2	11,560.0	12,120.0	233	3.962	3200-3550-3900	3-1/2"
L-80	3.640	3.5	18.9	13,380.0	13,820.0	440	5.137	7920-8800-9680	4-1/2"

BTM NO GO Depth:	3345.59	Formation Name :	Gadvan	Hook Weight :	58 k lb
BTM of String	3346.20	Formation Top :	3627	VOLUME (TOTAL)	138.86
Packer Depth :	3329.87			Mud Weight (pcf) :	84
Rig Floor to THS:	10.7				

Number on jt	Grade	Run In No.	Jt Length (m)	Cum Length (m)	Dist to RT (m)	M/D weight (Klbs)	VOL(BBL)	Remarks	
								joint no	IN / OUT
					3346.200	58.00			
3-1/2" Wireline Re-Entry Guide, 10.2 #, HSM3, 9CR1MO, WEIQIXIN Co	3-1/2" Mule Shoe		0.239	0.24	3345.961	58.01	0.01		
3-1/2" BTM No-Go LND Nipple, HSM3, 10.2#, 9CR1MO, Seal Bore 2.750" TYPE XN, WEIQIXIN Co, 7.5K	3-1/2" BTM NO GO		0.372	0.61	3345.589	58.02	0.02		
3-1/2" Pup Jt, HSM3, 10.2#, L-80, Type-1	3-1/2" Pup Jt, 10.2#,HSM3		1.822	2.43	3343.767	58.07	0.07		
1	3-1/2" TBG, 10.2#, L-80,HSM3	1	9.446	11.88	3334.321	58.33	0.32	1	
3-1/2" Pup Jt, HSM3, 10.2#, L-80, Type-1	3-1/2" Pup Jt, 10.2#,HSM3		1.795	13.67	3332.526	58.38	0.37		
7" 29# CSG Hydraulic set retrievable production packer to be run in 7.00" 29 PPF CSG, WEIQIXIN Co	PKR		2.652	16.33	3329.874	58.45	0.44		
3-1/2" Pup Jt, HSM3, 10.2#, L-80, Type-1	3-1/2" Pup Jt, 10.2#,HSM3		1.620	17.95	3328.254	58.50	0.49		
2	3-1/2" TBG, 10.2#, L-80,HSM3	2	9.449	27.40	3318.805	58.76	0.75	2	G.ring
3-1/2" Pup Jt, HSM3, 10.2#, L-80, Type-1	3-1/2" Pup Jt, 10.2#,HSM3		1.597	28.99	3317.208	58.80	0.79		
3-1/2" Non-Elastomeric Sliding Side Door, 9CR1MO, HSM3 w/ Type X Selective profile (Profile: 2.750" X, Downward open), 7.5K	SSD		1.195	30.19	3316.013	58.84	0.82		
3-1/2" Pup Jt, HSM3, 10.2#, L-80, Type-1	3-1/2" Pup Jt, 10.2#,HSM3		1.817	32.00	3314.196	58.89	0.87		
3	3-1/2" TBG, 10.2#, L-80,HSM3	3	9.443	41.45	3304.753	59.15	1.13	3	
3-1/2" Pup Jt, HSM3, 10.2#, L-80, Type-1	3-1/2" Pup Jt, 10.2#,HSM3		2.001	43.45	3302.752	59.20	1.18		
3-1/2" EXP. Jt,HSM3 , 9CR1MO, 10' STK (Half Open) Splind Rotational Lock System Any Position, Shear Pin Set 20 Klbs, WEIQIXIN Co	Traveling Jt		5.811	49.26	3296.941	59.37	1.34		
3-1/2" Pup Jt, HSM3, 10.2#, L-80, Type-1	3-1/2" Pup Jt, 10.2#,HSM3		1.822	51.08	3295.119	59.42	1.39		
4	3-1/2" TBG, 10.2#, L-80,HSM3	4	9.318	60.40	3285.801	59.67	1.64	4	
5	3-1/2" TBG, 10.2#, L-80,HSM3	5	9.448	69.85	3276.353	59.94	1.90	5	
6	3-1/2" TBG, 10.2#, L-80,HSM3	6	9.452	79.30	3266.901	60.20	2.16	6	
7	3-1/2" TBG, 10.2#, L-80,HSM3	7	9.448	88.75	3257.453	60.46	2.42	7	
8	3-1/2" TBG, 10.2#, L-80,HSM3	8	9.441	98.19	3248.012	60.72	2.67	8	
9	3-1/2" TBG, 10.2#, L-80,HSM3	9	9.315	107.50	3238.697	60.98	2.93	9	
10	3-1/2" TBG, 10.2#, L-80,HSM3	10	9.440	116.94	3229.257	61.24	3.18	10	
11	3-1/2" TBG, 10.2#, L-80,HSM3	11	9.443	126.39	3219.814	61.50	3.44	11	
12	3-1/2" TBG, 10.2#, L-80,HSM3	12	9.448	135.83	3210.366	61.76	3.70	12	
13	3-1/2" TBG, 10.2#, L-80,HSM3	13	9.451	145.29	3200.915	62.03	3.95	13	
14	3-1/2" TBG, 10.2#, L-80,HSM3	14	9.444	154.73	3191.471	62.29	4.21	14	
15	3-1/2" TBG, 10.2#, L-80,HSM3	15	9.500	164.23	3181.971	62.55	4.47	15	
16	3-1/2" TBG, 10.2#, L-80,HSM3	-	9.404	164.23	OUT	62.55	4.47	15	out
17	3-1/2" TBG, 10.2#, L-80,HSM3	-	9.490	164.23	OUT	62.55	4.47	15	out
18	3-1/2" TBG, 10.2#, L-80,HSM3	-	9.418	164.23	OUT	62.55	4.47	15	out
19	3-1/2" TBG, 10.2#, L-80,HSM3	-	9.494	164.23	OUT	62.55	4.47	15	out
20	3-1/2" TBG, 10.2#, L-80,HSM3	-	9.495	164.23	OUT	62.55	4.47	15	out
21	3-1/2" TBG, 10.2#, L-80,HSM3	-	9.402	164.23	OUT	62.55	4.47	15	out
22	3-1/2" TBG, 10.2#, L-80,HSM3	-	9.495	164.23	OUT	62.55	4.47	15	out
23	3-1/2" TBG, 10.2#, L-80,HSM3	-	8.972	164.23	OUT	62.55	4.47	15	out
24	3-1/2" TBG, 10.2#, L-80,HSM3	-	9.501	164.23	OUT	62.55	4.47	15	out
25	3-1/2" TBG, 10.2#, L-80,HSM3	-	9.421	164.23	OUT	62.55	4.47	15	out
26	3-1/2" TBG, 10.2#, L-80,HSM3	-	9.430	164.23	OUT	62.55	4.47	15	out
27	3-1/2" TBG, 10.2#, L-80,HSM3	-	8.928	164.23	OUT	62.55	4.47	15	out
X-over 4-1/2"HSM3, 18.9# BOX * 3-1/2"HSM3 , 10.2# PIN	XOS 4-1/2", HSM3 B X 3-1/2" HSM3, P	0	1.100	165.33	3180.871	62.61	4.50		


X-over 4-1/2"HSM3, 18.9# BOX * 3-1/2"HSM3 , 10.2# PIN	XOS 4-1/2", HSM3 B X 3-1/2" HSM3, P	0	1.100	165.33	3180.871	62.61	4.50		
1	4-1/2" TBG, 18.9#, L-80,HSM3	16	9.528	174.86	3171.343	63.10	4.90	16	
2	4-1/2" TBG, 18.9#, L-80,HSM3	17	9.527	184.38	3161.816	63.59	5.30	17	
3	4-1/2" TBG, 18.9#, L-80,HSM3	18	9.527	193.91	3152.289	64.08	5.71	18	
4	4-1/2" TBG, 18.9#, L-80,HSM3	19	9.531	203.44	3142.758	64.57	6.11	19	
5	4-1/2" TBG, 18.9#, L-80,HSM3	20	9.530	212.97	3133.228	65.06	6.51	20	
6	4-1/2" TBG, 18.9#, L-80,HSM3	21	9.523	222.50	3123.705	65.54	6.91	21	
7	4-1/2" TBG, 18.9#, L-80,HSM3	22	9.530	232.03	3114.175	66.03	7.32	22	
8	4-1/2" TBG, 18.9#, L-80,HSM3	23	9.528	241.55	3104.647	66.52	7.72	23	
9	4-1/2" TBG, 18.9#, L-80,HSM3	24	9.533	251.09	3095.114	67.01	8.12	24	
10	4-1/2" TBG, 18.9#, L-80,HSM3	25	9.424	260.51	3085.690	67.50	8.52	25	
11	4-1/2" TBG, 18.9#, L-80,HSM3	-	9.541	260.51	OUT	67.50	8.52	25	out
12	4-1/2" TBG, 18.9#, L-80,HSM3	26	9.539	270.05	3076.151	67.99	8.92	26	
13	4-1/2" TBG, 18.9#, L-80,HSM3	27	9.528	279.58	3066.623	68.48	9.32	27	
14	4-1/2" TBG, 18.9#, L-80,HSM3	28	9.528	289.11	3057.095	68.97	9.73	28	
15	4-1/2" TBG, 18.9#, L-80,HSM3	29	9.528	298.63	3047.567	69.45	10.13	29	
16	4-1/2" TBG, 18.9#, L-80,HSM3	30	9.529	308.16	3038.038	69.94	10.53	30	
17	4-1/2" TBG, 18.9#, L-80,HSM3	-	9.528	308.16	OUT	69.94	10.53	30	out
18	4-1/2" TBG, 18.9#, L-80,HSM3	31	9.529	317.69	3028.509	70.43	10.93	31	
19	4-1/2" TBG, 18.9#, L-80,HSM3	-	9.527	317.69	OUT	70.43	10.93	31	out
20	4-1/2" TBG, 18.9#, L-80,HSM3	-	9.538	317.69	OUT	70.43	10.93	31	out
21	4-1/2" TBG, 18.9#, L-80,HSM3	32	9.530	327.22	3018.979	70.92	11.34	32	
22	4-1/2" TBG, 18.9#, L-80,HSM3	33	9.532	336.75	3009.447	71.41	11.74	33	
23	4-1/2" TBG, 18.9#, L-80,HSM3	34	9.383	346.14	3000.064	71.89	12.13	34	
24	4-1/2" TBG, 18.9#, L-80,HSM3	35	9.528	355.66	2990.536	72.38	12.54	35	
25	4-1/2" TBG, 18.9#, L-80,HSM3	-	9.528	355.66	OUT	72.38	12.54	35	out
26	4-1/2" TBG, 18.9#, L-80,HSM3	36	9.563	365.23	2980.973	72.88	12.94	36	
27	4-1/2" TBG, 18.9#, L-80,HSM3	37	9.530	374.76	2971.443	73.36	13.34	37	
28	4-1/2" TBG, 18.9#, L-80,HSM3	38	9.548	384.31	2961.895	73.85	13.75	38	
29	4-1/2" TBG, 18.9#, L-80,HSM3	39	9.544	393.85	2952.351	74.34	14.15	39	
30	4-1/2" TBG, 18.9#, L-80,HSM3	40	9.533	403.38	2942.818	74.83	14.55	40	
31	4-1/2" TBG, 18.9#, L-80,HSM3	41	9.525	412.91	2933.293	75.32	14.95	41	
32	4-1/2" TBG, 18.9#, L-80,HSM3	42	9.530	422.44	2923.763	75.81	15.36	42	
33	4-1/2" TBG, 18.9#, L-80,HSM3	43	9.578	432.02	2914.185	76.31	15.76	43	
34	4-1/2" TBG, 18.9#, L-80,HSM3	44	9.403	441.42	2904.782	76.79	16.16	44	
35	4-1/2" TBG, 18.9#, L-80,HSM3	45	9.408	450.83	2895.374	77.27	16.56	45	
36	4-1/2" TBG, 18.9#, L-80,HSM3	46	9.413	460.24	2885.961	77.75	16.95	46	
37	4-1/2" TBG, 18.9#, L-80,HSM3	47	9.414	469.65	2876.547	78.24	17.35	47	
38	4-1/2" TBG, 18.9#, L-80,HSM3	48	9.533	479.19	2867.014	78.73	17.75	48	
39	4-1/2" TBG, 18.9#, L-80,HSM3	49	9.305	488.49	2857.709	79.21	18.15	49	
40	4-1/2" TBG, 18.9#, L-80,HSM3	50	9.415	497.91	2848.294	79.69	18.54	50	
41	4-1/2" TBG, 18.9#, L-80,HSM3	51	9.532	507.44	2838.762	80.18	18.95	51	
42	4-1/2" TBG, 18.9#, L-80,HSM3	52	9.528	516.97	2829.234	80.67	19.35	52	
43	4-1/2" TBG, 18.9#, L-80,HSM3	53	9.532	526.50	2819.702	81.16	19.75	53	
44	4-1/2" TBG, 18.9#, L-80,HSM3	54	9.530	536.03	2810.172	81.65	20.15	54	
45	4-1/2" TBG, 18.9#, L-80,HSM3	55	9.531	545.56	2800.641	82.14	20.56	55	
46	4-1/2" TBG, 18.9#, L-80,HSM3	56	9.530	555.09	2791.111	82.63	20.96	56	
47	4-1/2" TBG, 18.9#, L-80,HSM3	57	9.531	564.62	2781.580	83.12	21.36	57	
48	4-1/2" TBG, 18.9#, L-80,HSM3	58	9.528	574.15	2772.052	83.60	21.76	58	
49	4-1/2" TBG, 18.9#, L-80,HSM3	59	9.530	583.68	2762.522	84.09	22.17	59	
50	4-1/2" TBG, 18.9#, L-80,HSM3	60	9.440	593.12	2753.082	84.58	22.56	60	
51	4-1/2" TBG, 18.9#, L-80,HSM3	61	9.532	602.65	2743.550	85.07	22.97	61	
52	4-1/2" TBG, 18.9#, L-80,HSM3	62	9.394	612.04	2734.156	85.55	23.36	62	
53	4-1/2" TBG, 18.9#, L-80,HSM3	63	9.393	621.44	2724.763	86.03	23.76	63	
54	4-1/2" TBG, 18.9#, L-80,HSM3	64	9.531	630.97	2715.232	86.52	24.16	64	
55	4-1/2" TBG, 18.9#, L-80,HSM3	65	9.524	640.49	2705.708	87.01	24.57	65	
56	4-1/2" TBG, 18.9#, L-80,HSM3	66	9.530	650.02	2696.178	87.50	24.97	66	
57	4-1/2" TBG, 18.9#, L-80,HSM3	67	9.532	659.55	2686.646	87.99	25.37	67	
58	4-1/2" TBG, 18.9#, L-80,HSM3	68	9.523	669.08	2677.123	88.48	25.77	68	
59	4-1/2" TBG, 18.9#, L-80,HSM3	69	9.543	678.62	2667.580	88.97	26.18	69	
60	4-1/2" TBG, 18.9#, L-80,HSM3	70	9.532	688.15	2658.048	89.46	26.58	70	
61	4-1/2" TBG, 18.9#, L-80,HSM3	71	9.532	697.68	2648.516	89.95	26.98	71	
62	4-1/2" TBG, 18.9#, L-80,HSM3	72	9.408	707.09	2639.108	90.43	27.38	72	
63	4-1/2" TBG, 18.9#, L-80,HSM3	73	9.531	716.62	2629.577	90.92	27.78	73	
64	4-1/2" TBG, 18.9#, L-80,HSM3	74	9.533	726.16	2620.044	91.41	28.18	74	
65	4-1/2" TBG, 18.9#, L-80,HSM3	75	9.531	735.69	2610.513	91.90	28.59	75	
66	4-1/2" TBG, 18.9#, L-80,HSM3	76	9.533	745.22	2600.980	92.39	28.99	76	
67	4-1/2" TBG, 18.9#, L-80,HSM3	77	9.417	754.64	2591.563	92.87	29.39	77	
68	4-1/2" TBG, 18.9#, L-80,HSM3	78	9.526	764.16	2582.037	93.36	29.79	78	
69	4-1/2" TBG, 18.9#, L-80,HSM3	79	9.301	773.46	2572.736	93.84	30.18	79	
70	4-1/2" TBG, 18.9#, L-80,HSM3	80	9.536	783.00	2563.200	94.33	30.58	80	
71	4-1/2" TBG, 18.9#, L-80,HSM3	81	9.407	792.41	2553.793	94.81	30.98	81	
72	4-1/2" TBG, 18.9#, L-80,HSM3	82	9.408	801.82	2544.385	95.30	31.38	82	
73	4-1/2" TBG, 18.9#, L-80,HSM3	83	9.168	810.98	2535.217	95.77	31.77	83	
74	4-1/2" TBG, 18.9#, L-80,HSM3	84	9.533	820.52	2525.684	96.26	32.17	84	
75	4-1/2" TBG, 18.9#, L-80,HSM3	85	9.527	830.04	2516.157	96.75	32.57	85	
76	4-1/2" TBG, 18.9#, L-80,HSM3	86	9.550	839.59	2506.607	97.24	32.97	86	
77	4-1/2" TBG, 18.9#, L-80,HSM3	87	9.535	849.13	2497.072	97.73	33.38	87	
78	4-1/2" TBG, 18.9#, L-80,HSM3	88	9.536	858.66	2487.536	98.22	33.78	88	
79	4-1/2" TBG, 18.9#, L-80,HSM3	89	9.463	868.13	2478.073	98.70	34.18	89	
80	4-1/2" TBG, 18.9#, L-80,HSM3	90	9.543	877.67	2468.530	99.19	34.58	90	
81	4-1/2" TBG, 18.9#, L-80,HSM3	91	9.432	887.10	2459.098	99.68	34.98	91	
82	4-1/2" TBG, 18.9#, L-80,HSM3	92	9.468	896.57	2449.630	100.16	35.38	92	
83	4-1/2" TBG, 18.9#, L-80,HSM3	93	9.603	906.17	2440.027	100.66	35.78	93	
84	4-1/2" TBG, 18.9#, L-80,HSM3	94	9.539	915.71	2430.488	101.15	36.19	94	
85	4-1/2" TBG, 18.9#, L-80,HSM3	95	9.537	925.25	2420.951	101.64	36.59	95	
86	4-1/2" TBG, 18.9#, L-80,HSM3	96	9.536	934.79	2411.415	102.13	36.99	96	
87	4-1/2" TBG, 18.9#, L-80,HSM3	97	9.536	944.32	2401.879	102.62	37.40	97	
88	4-1/2" TBG, 18.9#, L-80,HSM3	98	9.537	953.86	2392.342	103.11	37.80	98	
89	4-1/2" TBG, 18.9#, L-80,HSM3	99	9.540	963.40	2382.802	103.60	38.20	99	


90	4-1/2" TBG, 18.9#, L-80,HSM3	100	9.534	972.93	2373.268	104.09	38.60	100	
91	4-1/2" TBG, 18.9#, L-80,HSM3	101	9.530	982.46	2363.738	104.58	39.01	101	
92	4-1/2" TBG, 18.9#, L-80,HSM3	102	9.531	991.99	2354.207	105.06	39.41	102	
93	4-1/2" TBG, 18.9#, L-80,HSM3	103	9.530	1001.52	2344.677	105.55	39.81	103	
94	4-1/2" TBG, 18.9#, L-80,HSM3	104	9.528	1011.05	2335.149	106.04	40.21	104	
95	4-1/2" TBG, 18.9#, L-80,HSM3	105	9.528	1020.58	2325.621	106.53	40.62	105	
96	4-1/2" TBG, 18.9#, L-80,HSM3	106	9.533	1030.11	2316.088	107.02	41.02	106	
97	4-1/2" TBG, 18.9#, L-80,HSM3	107	9.526	1039.64	2306.562	107.51	41.42	107	
98	4-1/2" TBG, 18.9#, L-80,HSM3	108	9.525	1049.16	2297.037	108.00	41.82	108	
99	4-1/2" TBG, 18.9#, L-80,HSM3	109	9.526	1058.69	2287.511	108.49	42.23	109	
100	4-1/2" TBG, 18.9#, L-80,HSM3	110	9.523	1068.21	2277.988	108.98	42.63	110	
101	4-1/2" TBG, 18.9#, L-80,HSM3	111	9.529	1077.74	2268.459	109.47	43.03	111	
102	4-1/2" TBG, 18.9#, L-80,HSM3	112	9.529	1087.27	2258.930	109.96	43.43	112	
103	4-1/2" TBG, 18.9#, L-80,HSM3	113	9.189	1096.46	2249.741	110.43	43.82	113	
104	4-1/2" TBG, 18.9#, L-80,HSM3	114	9.528	1105.99	2240.213	110.92	44.22	114	
105	4-1/2" TBG, 18.9#, L-80,HSM3	115	9.527	1115.51	2230.686	111.41	44.63	115	Test
106	4-1/2" TBG, 18.9#, L-80,HSM3	116	9.186	1124.70	2221.500	111.88	45.01	116	
107	4-1/2" TBG, 18.9#, L-80,HSM3	117	9.529	1134.23	2211.971	112.37	45.42	117	
108	4-1/2" TBG, 18.9#, L-80,HSM3	118	9.528	1143.76	2202.443	112.86	45.82	118	
109	4-1/2" TBG, 18.9#, L-80,HSM3	119	9.522	1153.28	2192.921	113.35	46.22	119	
110	4-1/2" TBG, 18.9#, L-80,HSM3	120	9.258	1162.54	2183.663	113.82	46.61	120	
111	4-1/2" TBG, 18.9#, L-80,HSM3	121	9.530	1172.07	2174.133	114.31	47.01	121	
112	4-1/2" TBG, 18.9#, L-80,HSM3	122	9.533	1181.60	2164.600	114.80	47.42	122	
113	4-1/2" TBG, 18.9#, L-80,HSM3	123	9.530	1191.13	2155.070	115.29	47.82	123	
114	4-1/2" TBG, 18.9#, L-80,HSM3	124	9.529	1200.66	2145.541	115.78	48.22	124	
115	4-1/2" TBG, 18.9#, L-80,HSM3	125	9.529	1210.19	2136.012	116.27	48.62	125	
116	4-1/2" TBG, 18.9#, L-80,HSM3	126	9.522	1219.71	2126.490	116.76	49.03	126	
117	4-1/2" TBG, 18.9#, L-80,HSM3	127	9.526	1229.24	2116.964	117.25	49.43	127	
118	4-1/2" TBG, 18.9#, L-80,HSM3	128	9.529	1238.77	2107.435	117.74	49.83	128	
119	4-1/2" TBG, 18.9#, L-80,HSM3	129	9.525	1248.29	2097.910	118.23	50.23	129	
120	4-1/2" TBG, 18.9#, L-80,HSM3	130	9.530	1257.82	2088.380	118.72	50.63	130	
121	4-1/2" TBG, 18.9#, L-80,HSM3	131	9.525	1267.35	2078.855	119.21	51.04	131	
122	4-1/2" TBG, 18.9#, L-80,HSM3	132	9.530	1276.88	2069.325	119.70	51.44	132	
123	4-1/2" TBG, 18.9#, L-80,HSM3	133	9.522	1286.40	2059.803	120.19	51.84	133	
124	4-1/2" TBG, 18.9#, L-80,HSM3	134	9.528	1295.93	2050.275	120.67	52.24	134	
125	4-1/2" TBG, 18.9#, L-80,HSM3	135	9.561	1305.49	2040.714	121.17	52.65	135	
126	4-1/2" TBG, 18.9#, L-80,HSM3	136	9.568	1315.05	2031.146	121.66	53.05	136	
127	4-1/2" TBG, 18.9#, L-80,HSM3	137	9.568	1324.62	2021.578	122.15	53.46	137	
128	4-1/2" TBG, 18.9#, L-80,HSM3	138	9.543	1334.17	2012.035	122.64	53.86	138	
129	4-1/2" TBG, 18.9#, L-80,HSM3	139	9.547	1343.71	2002.488	123.13	54.26	139	
130	4-1/2" TBG, 18.9#, L-80,HSM3	140	9.563	1353.28	1992.925	123.62	54.67	140	
131	4-1/2" TBG, 18.9#, L-80,HSM3	141	9.558	1362.83	1983.367	124.11	55.07	141	
132	4-1/2" TBG, 18.9#, L-80,HSM3	142	9.528	1372.36	1973.839	124.60	55.47	142	
133	4-1/2" TBG, 18.9#, L-80,HSM3	143	9.521	1381.88	1964.318	125.09	55.87	143	
134	4-1/2" TBG, 18.9#, L-80,HSM3	144	9.523	1391.41	1954.795	125.58	56.28	144	
135	4-1/2" TBG, 18.9#, L-80,HSM3	145	9.524	1400.93	1945.271	126.07	56.68	145	
136	4-1/2" TBG, 18.9#, L-80,HSM3	146	9.525	1410.45	1935.746	126.56	57.08	146	
137	4-1/2" TBG, 18.9#, L-80,HSM3	147	9.190	1419.64	1926.556	127.03	57.47	147	
138	4-1/2" TBG, 18.9#, L-80,HSM3	148	9.524	1429.17	1917.032	127.52	57.87	148	
139	4-1/2" TBG, 18.9#, L-80,HSM3	-	9.530	1429.17	OUT	127.52	57.87	148	Out
140	4-1/2" TBG, 18.9#, L-80,HSM3	149	9.258	1438.43	1907.774	127.99	58.26	149	
141	4-1/2" TBG, 18.9#, L-80,HSM3	150	9.528	1447.95	1898.246	128.48	58.66	150	
142	4-1/2" TBG, 18.9#, L-80,HSM3	151	9.528	1457.48	1888.718	128.97	59.07	151	
143	4-1/2" TBG, 18.9#, L-80,HSM3	152	9.528	1467.01	1879.190	129.46	59.47	152	
144	4-1/2" TBG, 18.9#, L-80,HSM3	153	9.530	1476.54	1869.660	129.95	59.87	153	
145	4-1/2" TBG, 18.9#, L-80,HSM3	154	9.528	1486.07	1860.132	130.44	60.27	154	
146	4-1/2" TBG, 18.9#, L-80,HSM3	155	9.537	1495.61	1850.595	130.93	60.68	155	
147	4-1/2" TBG, 18.9#, L-80,HSM3	156	9.060	1504.67	1841.535	131.40	61.06	156	
148	4-1/2" TBG, 18.9#, L-80,HSM3	157	9.533	1514.20	1832.002	131.88	61.46	157	
149	4-1/2" TBG, 18.9#, L-80,HSM3	158	9.526	1523.72	1822.476	132.37	61.86	158	
150	4-1/2" TBG, 18.9#, L-80,HSM3	159	9.530	1533.25	1812.946	132.86	62.27	159	
151	4-1/2" TBG, 18.9#, L-80,HSM3	160	9.428	1542.68	1803.518	133.35	62.66	160	
152	4-1/2" TBG, 18.9#, L-80,HSM3	161	9.537	1552.22	1793.981	133.84	63.07	161	
153	4-1/2" TBG, 18.9#, L-80,HSM3	162	9.532	1561.75	1784.449	134.33	63.47	162	
154	4-1/2" TBG, 18.9#, L-80,HSM3	163	9.533	1571.28	1774.916	134.82	63.87	163	
155	4-1/2" TBG, 18.9#, L-80,HSM3	164	9.534	1580.82	1765.382	135.31	64.28	164	
156	4-1/2" TBG, 18.9#, L-80,HSM3	165	9.533	1590.35	1755.849	135.80	64.68	165	
157	4-1/2" TBG, 18.9#, L-80,HSM3	166	9.535	1599.89	1746.314	136.29	65.08	166	
158	4-1/2" TBG, 18.9#, L-80,HSM3	167	9.528	1609.41	1736.786	136.77	65.48	167	
159	4-1/2" TBG, 18.9#, L-80,HSM3	168	9.537	1618.95	1727.249	137.26	65.89	168	
160	4-1/2" TBG, 18.9#, L-80,HSM3	169	9.527	1628.48	1717.722	137.75	66.29	169	
161	4-1/2" TBG, 18.9#, L-80,HSM3	170	9.196	1637.67	1708.526	138.23	66.68	170	
162	4-1/2" TBG, 18.9#, L-80,HSM3	171	9.533	1647.21	1698.993	138.72	67.08	171	
163	4-1/2" TBG, 18.9#, L-80,HSM3	172	9.527	1656.73	1689.466	139.21	67.48	172	
164	4-1/2" TBG, 18.9#, L-80,HSM3	173	9.522	1666.26	1679.944	139.69	67.88	173	
165	4-1/2" TBG, 18.9#, L-80,HSM3	174	9.528	1675.78	1670.416	140.18	68.29	174	
166	4-1/2" TBG, 18.9#, L-80,HSM3	175	9.525	1685.31	1660.891	140.67	68.69	175	
167	4-1/2" TBG, 18.9#, L-80,HSM3	176	9.258	1694.57	1651.633	141.15	69.08	176	
168	4-1/2" TBG, 18.9#, L-80,HSM3	177	9.518	1704.09	1642.115	141.64	69.48	177	
169	4-1/2" TBG, 18.9#, L-80,HSM3	178	9.523	1713.61	1632.592	142.13	69.88	178	
170	4-1/2" TBG, 18.9#, L-80,HSM3	179	9.531	1723.14	1623.061	142.62	70.29	179	
171	4-1/2" TBG, 18.9#, L-80,HSM3	180	9.550	1732.69	1613.511	143.11	70.69	180	
172	4-1/2" TBG, 18.9#, L-80,HSM3	181	9.542	1742.23	1603.969	143.60	71.09	181	
173	4-1/2" TBG, 18.9#, L-80,HSM3	182	9.537	1751.77	1594.432	144.09	71.49	182	
174	4-1/2" TBG, 18.9#, L-80,HSM3	183	9.552	1761.32	1584.880	144.58	71.90	183	
175	4-1/2" TBG, 18.9#, L-80,HSM3	184	9.547	1770.87	1575.333	145.07	72.30	184	
176	4-1/2" TBG, 18.9#, L-80,HSM3	185	9.550	1780.42	1565.783	145.56	72.70	185	
177	4-1/2" TBG, 18.9#, L-80,HSM3	186	9.540	1789.96	1556.243	146.05	73.11	186	
178	4-1/2" TBG, 18.9#, L-80,HSM3	187	9.416	1799.37	1546.827	146.53	73.50	187	
179	4-1/2" TBG, 18.9#, L-80,HSM3	188	9.100	1808.47	1537.727	147.00	73.89	188	


	180	4-1/2" TBG, 18.9#, L-80,HSM3	189	9.554	1818.03	1528.173	147.49	74.29	189	
	181	4-1/2" TBG, 18.9#, L-80,HSM3	190	9.553	1827.58	1518.620	147.98	74.70	190	
	182	4-1/2" TBG, 18.9#, L-80,HSM3	191	9.159	1836.74	1509.461	148.45	75.08	191	
	183	4-1/2" TBG, 18.9#, L-80,HSM3	192	9.552	1846.29	1499.909	148.94	75.49	192	
	184	4-1/2" TBG, 18.9#, L-80,HSM3	193	9.153	1855.44	1490.756	149.41	75.87	193	
	185	4-1/2" TBG, 18.9#, L-80,HSM3	194	9.538	1864.98	1481.218	149.90	76.28	194	
	186	4-1/2" TBG, 18.9#, L-80,HSM3	195	9.453	1874.44	1471.765	150.39	76.67	195	
	187	4-1/2" TBG, 18.9#, L-80,HSM3	196	9.558	1883.99	1462.207	150.88	77.08	196	
	188	4-1/2" TBG, 18.9#, L-80,HSM3	197	9.454	1893.45	1452.753	151.36	77.48	197	
	189	4-1/2" TBG, 18.9#, L-80,HSM3	198	9.433	1902.88	1443.320	151.85	77.88	198	
	190	4-1/2" TBG, 18.9#, L-80,HSM3	199	9.143	1912.02	1434.177	152.32	78.26	199	
	191	4-1/2" TBG, 18.9#, L-80,HSM3	200	9.548	1921.57	1424.629	152.81	78.67	200	
	192	4-1/2" TBG, 18.9#, L-80,HSM3	201	9.532	1931.10	1415.097	153.30	79.07	201	
	193	4-1/2" TBG, 18.9#, L-80,HSM3	202	9.530	1940.63	1405.567	153.79	79.47	202	
	194	4-1/2" TBG, 18.9#, L-80,HSM3	203	9.558	1950.19	1396.009	154.28	79.87	203	
	195	4-1/2" TBG, 18.9#, L-80,HSM3	204	9.547	1959.74	1386.462	154.77	80.28	204	
	196	4-1/2" TBG, 18.9#, L-80,HSM3	205	9.528	1969.27	1376.934	155.26	80.68	205	
	197	4-1/2" TBG, 18.9#, L-80,HSM3	206	9.530	1978.80	1367.404	155.75	81.08	206	
	198	4-1/2" TBG, 18.9#, L-80,HSM3	207	9.196	1987.99	1358.208	156.22	81.47	207	
	199	4-1/2" TBG, 18.9#, L-80,HSM3	208	9.538	1997.53	1348.670	156.71	81.87	208	
	200	4-1/2" TBG, 18.9#, L-80,HSM3	209	9.538	2007.07	1339.132	157.20	82.28	209	
	201	4-1/2" TBG, 18.9#, L-80,HSM3	210	9.529	2016.60	1329.603	157.69	82.68	210	
	202	4-1/2" TBG, 18.9#, L-80,HSM3	211	9.536	2026.13	1320.067	158.18	83.08	211	
	203	4-1/2" TBG, 18.9#, L-80,HSM3	212	9.532	2035.67	1310.535	158.67	83.48	212	
	204	4-1/2" TBG, 18.9#, L-80,HSM3	213	9.562	2045.23	1300.973	159.16	83.89	213	
	205	4-1/2" TBG, 18.9#, L-80,HSM3	214	9.538	2054.77	1291.435	159.65	84.29	214	
	206	4-1/2" TBG, 18.9#, L-80,HSM3	215	9.532	2064.30	1281.903	160.14	84.69	215	
	207	4-1/2" TBG, 18.9#, L-80,HSM3	216	9.280	2073.58	1272.623	160.61	85.08	216	
	208	4-1/2" TBG, 18.9#, L-80,HSM3	-	9.519	2073.58	OUT	160.61	85.08	216	Out
	209	4-1/2" TBG, 18.9#, L-80,HSM3	217	9.530	2083.11	1263.093	161.10	85.49	217	
	210	4-1/2" TBG, 18.9#, L-80,HSM3	218	9.214	2092.32	1253.879	161.58	85.88	218	
	211	4-1/2" TBG, 18.9#, L-80,HSM3	219	9.530	2101.85	1244.349	162.07	86.28	219	
	212	4-1/2" TBG, 18.9#, L-80,HSM3	220	9.530	2111.38	1234.819	162.56	86.68	220	
	213	4-1/2" TBG, 18.9#, L-80,HSM3	221	9.533	2120.91	1225.286	163.04	87.08	221	
	214	4-1/2" TBG, 18.9#, L-80,HSM3	222	9.532	2130.45	1215.754	163.53	87.49	222	
	215	4-1/2" TBG, 18.9#, L-80,HSM3	223	9.528	2139.97	1206.226	164.02	87.89	223	
	216	4-1/2" TBG, 18.9#, L-80,HSM3	224	9.534	2149.51	1196.692	164.51	88.29	224	
	217	4-1/2" TBG, 18.9#, L-80,HSM3	225	9.544	2159.05	1187.148	165.00	88.69	225	
	218	4-1/2" TBG, 18.9#, L-80,HSM3	226	9.426	2168.48	1177.722	165.49	89.09	226	
	219	4-1/2" TBG, 18.9#, L-80,HSM3	227	9.533	2178.01	1168.189	165.98	89.49	227	
	220	4-1/2" TBG, 18.9#, L-80,HSM3	228	9.518	2187.53	1158.671	166.47	89.90	228	
	221	4-1/2" TBG, 18.9#, L-80,HSM3	229	9.416	2196.95	1149.255	166.95	90.29	229	
	222	4-1/2" TBG, 18.9#, L-80,HSM3	230	9.526	2206.47	1139.729	167.44	90.70	230	
	223	4-1/2" TBG, 18.9#, L-80,HSM3	231	9.536	2216.01	1130.193	167.93	91.10	231	
	224	4-1/2" TBG, 18.9#, L-80,HSM3	232	9.531	2225.54	1120.662	168.42	91.50	232	
	225	4-1/2" TBG, 18.9#, L-80,HSM3	233	9.526	2235.06	1111.136	168.91	91.90	233	
	226	4-1/2" TBG, 18.9#, L-80,HSM3	234	9.433	2244.50	1101.703	169.39	92.30	234	Test
	227	4-1/2" TBG, 18.9#, L-80,HSM3	235	9.556	2254.05	1092.147	169.88	92.71	235	
	228	4-1/2" TBG, 18.9#, L-80,HSM3	236	9.538	2263.59	1082.609	170.37	93.11	236	
	229	4-1/2" TBG, 18.9#, L-80,HSM3	237	9.542	2273.13	1073.067	170.86	93.51	237	
	230	4-1/2" TBG, 18.9#, L-80,HSM3	238	9.530	2282.66	1063.537	171.35	93.91	238	
	231	4-1/2" TBG, 18.9#, L-80,HSM3	239	9.533	2292.20	1054.004	171.84	94.32	239	
	232	4-1/2" TBG, 18.9#, L-80,HSM3	240	9.529	2301.73	1044.475	172.33	94.72	240	
	233	4-1/2" TBG, 18.9#, L-80,HSM3	241	9.530	2311.26	1034.945	172.82	95.12	241	
	234	4-1/2" TBG, 18.9#, L-80,HSM3	242	9.536	2320.79	1025.409	173.31	95.52	242	
	235	4-1/2" TBG, 18.9#, L-80,HSM3	243	9.529	2330.32	1015.880	173.80	95.93	243	
	236	4-1/2" TBG, 18.9#, L-80,HSM3	244	9.527	2339.85	1006.353	174.29	96.33	244	
	237	4-1/2" TBG, 18.9#, L-80,HSM3	245	9.178	2349.03	997.175	174.76	96.72	245	
	238	4-1/2" TBG, 18.9#, L-80,HSM3	246	9.531	2358.56	987.644	175.25	97.12	246	
	239	4-1/2" TBG, 18.9#, L-80,HSM3	247	9.521	2368.08	978.123	175.74	97.52	247	
	240	4-1/2" TBG, 18.9#, L-80,HSM3	248	9.436	2377.51	968.687	176.22	97.92	248	
	241	4-1/2" TBG, 18.9#, L-80,HSM3	249	9.521	2387.03	959.166	176.71	98.32	249	
	242	4-1/2" TBG, 18.9#, L-80,HSM3	250	9.535	2396.57	949.631	177.20	98.72	250	
	243	4-1/2" TBG, 18.9#, L-80,HSM3	251	9.530	2406.10	940.101	177.69	99.13	251	
	244	4-1/2" TBG, 18.9#, L-80,HSM3	252	9.528	2415.63	930.573	178.18	99.53	252	
	245	4-1/2" TBG, 18.9#, L-80,HSM3	253	9.526	2425.15	921.047	178.67	99.93	253	
	246	4-1/2" TBG, 18.9#, L-80,HSM3	254	9.534	2434.69	911.513	179.16	100.33	254	
	247	4-1/2" TBG, 18.9#, L-80,HSM3	255	9.527	2444.21	901.986	179.65	100.74	255	
	248	4-1/2" TBG, 18.9#, L-80,HSM3	256	9.532	2453.75	892.454	180.14	101.14	256	
	249	4-1/2" TBG, 18.9#, L-80,HSM3	-	9.552	2453.75	OUT	180.14	101.14	256	Out
	250	4-1/2" TBG, 18.9#, L-80,HSM3	257	9.533	2463.28	882.921	180.63	101.54	257	
	251	4-1/2" TBG, 18.9#, L-80,HSM3	258	9.448	2472.73	873.473	181.11	101.94	258	
	252	4-1/2" TBG, 18.9#, L-80,HSM3	259	9.535	2482.26	863.938	181.60	102.34	259	
	253	4-1/2" TBG, 18.9#, L-80,HSM3	-	9.528	2482.26	OUT	181.60	102.34	259	Out
	254	4-1/2" TBG, 18.9#, L-80,HSM3	260	9.531	2491.79	854.407	182.09	102.75	260	
	255	4-1/2" TBG, 18.9#, L-80,HSM3	261	9.543	2501.34	844.864	182.58	103.15	261	
	256	4-1/2" TBG, 18.9#, L-80,HSM3	262	9.524	2510.86	835.340	183.07	103.55	262	
	257	4-1/2" TBG, 18.9#, L-80,HSM3	263	9.532	2520.39	825.808	183.56	103.95	263	
	258	4-1/2" TBG, 18.9#, L-80,HSM3	264	9.529	2529.92	816.279	184.05	104.36	264	
	259	4-1/2" TBG, 18.9#, L-80,HSM3	265	9.535	2539.46	806.744	184.54	104.76	265	
	260	4-1/2" TBG, 18.9#, L-80,HSM3	266	9.533	2548.99	797.211	185.03	105.16	266	
	261	4-1/2" TBG, 18.9#, L-80,HSM3	267	9.529	2558.52	787.682	185.52	105.56	267	
	262	4-1/2" TBG, 18.9#, L-80,HSM3	268	9.529	2568.05	778.153	186.01	105.97	268	
	263	4-1/2" TBG, 18.9#, L-80,HSM3	269	9.525	2577.57	768.628	186.50	106.37	269	
	264	4-1/2" TBG, 18.9#, L-80,HSM3	270	9.531	2587.10	759.097	186.99	106.77	270	
	265	4-1/2" TBG, 18.9#, L-80,HSM3	271	9.438	2596.54	749.659	187.47	107.17	271	
	266	4-1/2" TBG, 18.9#, L-80,HSM3	272	9.534	2606.08	740.125	187.96	107.57	272	
	267	4-1/2" TBG, 18.9#, L-80,HSM3	273	9.106	2615.18	731.019	188.43	107.96	273	
	268	4-1/2" TBG, 18.9#, L-80,HSM3	274	9.533	2624.71	721.486	188.92	108.36	274	
	269	4-1/2" TBG, 18.9#, L-80,HSM3	275	9.429	2634.14	712.057	189.40	108.76	275	


270	4-1/2" TBG, 18.9#, L-80,HSM3	276	9.578	2643.72	702.479	189.90	109.16	276
271	4-1/2" TBG, 18.9#, L-80,HSM3	277	9.533	2653.25	692.946	190.39	109.56	277
272	4-1/2" TBG, 18.9#, L-80,HSM3	278	9.419	2662.67	683.527	190.87	109.96	278
273	4-1/2" TBG, 18.9#, L-80,HSM3	279	9.550	2672.22	673.977	191.36	110.37	279
274	4-1/2" TBG, 18.9#, L-80,HSM3	280	9.530	2681.75	664.447	191.85	110.77	280
275	4-1/2" TBG, 18.9#, L-80,HSM3	281	9.532	2691.29	654.915	192.34	111.17	281
276	4-1/2" TBG, 18.9#, L-80,HSM3	282	9.529	2700.81	645.386	192.83	111.57	282
277	4-1/2" TBG, 18.9#, L-80,HSM3	283	9.523	2710.34	635.863	193.32	111.97	283
278	4-1/2" TBG, 18.9#, L-80,HSM3	284	9.462	2719.80	626.401	193.80	112.37	284
279	4-1/2" TBG, 18.9#, L-80,HSM3	285	9.406	2729.21	616.995	194.29	112.77	285
280	4-1/2" TBG, 18.9#, L-80,HSM3	286	9.588	2738.79	607.407	194.78	113.18	286
281	4-1/2" TBG, 18.9#, L-80,HSM3	287	9.533	2748.33	597.874	195.27	113.58	287
282	4-1/2" TBG, 18.9#, L-80,HSM3	288	9.568	2757.89	588.306	195.76	113.98	288
283	4-1/2" TBG, 18.9#, L-80,HSM3	289	9.528	2767.42	578.778	196.25	114.39	289
284	4-1/2" TBG, 18.9#, L-80,HSM3	290	9.530	2776.95	569.248	196.74	114.79	290
285	4-1/2" TBG, 18.9#, L-80,HSM3	291	9.530	2786.48	559.718	197.23	115.19	291
286	4-1/2" TBG, 18.9#, L-80,HSM3	292	9.531	2796.01	550.187	197.72	115.59	292
287	4-1/2" TBG, 18.9#, L-80,HSM3	293	9.548	2805.56	540.639	198.21	116.00	293
288	4-1/2" TBG, 18.9#, L-80,HSM3	294	9.186	2814.75	531.453	198.68	116.38	294
289	4-1/2" TBG, 18.9#, L-80,HSM3	295	9.531	2824.28	521.922	199.17	116.79	295
290	4-1/2" TBG, 18.9#, L-80,HSM3	296	9.188	2833.47	512.734	199.64	117.17	296
291	4-1/2" TBG, 18.9#, L-80,HSM3	297	9.525	2842.99	503.209	200.13	117.58	297
292	4-1/2" TBG, 18.9#, L-80,HSM3	298	9.218	2852.21	493.991	200.60	117.97	298
293	4-1/2" TBG, 18.9#, L-80,HSM3	299	9.526	2861.74	484.465	201.09	118.37	299
294	4-1/2" TBG, 18.9#, L-80,HSM3	300	9.531	2871.27	474.934	201.58	118.77	300
295	4-1/2" TBG, 18.9#, L-80,HSM3	301	9.574	2880.84	465.360	202.07	119.18	301
296	4-1/2" TBG, 18.9#, L-80,HSM3	302	9.526	2890.37	455.834	202.56	119.58	302
297	4-1/2" TBG, 18.9#, L-80,HSM3	303	9.209	2899.58	446.625	203.04	119.97	303
298	4-1/2" TBG, 18.9#, L-80,HSM3	304	9.528	2909.10	437.097	203.53	120.37	304
299	4-1/2" TBG, 18.9#, L-80,HSM3	305	9.394	2918.50	427.703	204.01	120.77	305
300	4-1/2" TBG, 18.9#, L-80,HSM3	306	9.529	2928.03	418.174	204.50	121.17	306
301	4-1/2" TBG, 18.9#, L-80,HSM3	307	9.527	2937.55	408.647	204.99	121.57	307
302	4-1/2" TBG, 18.9#, L-80,HSM3	308	9.534	2947.09	399.113	205.48	121.97	308
303	4-1/2" TBG, 18.9#, L-80,HSM3	309	9.577	2956.66	389.536	205.97	122.38	309
304	4-1/2" TBG, 18.9#, L-80,HSM3	310	9.539	2966.20	379.997	206.46	122.78	310
305	4-1/2" TBG, 18.9#, L-80,HSM3	311	9.528	2975.73	370.469	206.95	123.18	311
306	4-1/2" TBG, 18.9#, L-80,HSM3	312	9.571	2985.30	360.898	207.44	123.59	312
307	4-1/2" TBG, 18.9#, L-80,HSM3	313	9.526	2994.83	351.372	207.93	123.99	313
308	4-1/2" TBG, 18.9#, L-80,HSM3	314	9.523	3004.35	341.849	208.42	124.39	314
309	4-1/2" TBG, 18.9#, L-80,HSM3	315	9.578	3013.93	332.271	208.91	124.80	315
310	4-1/2" TBG, 18.9#, L-80,HSM3	316	9.190	3023.12	323.081	209.38	125.18	316
311	4-1/2" TBG, 18.9#, L-80,HSM3	317	9.531	3032.65	313.550	209.87	125.59	317
312	4-1/2" TBG, 18.9#, L-80,HSM3	318	9.531	3042.18	304.019	210.36	125.99	318
313	4-1/2" TBG, 18.9#, L-80,HSM3	319	9.538	3051.72	294.481	210.85	126.39	319
314	4-1/2" TBG, 18.9#, L-80,HSM3	320	9.534	3061.25	284.947	211.34	126.79	320
315	4-1/2" TBG, 18.9#, L-80,HSM3	321	9.186	3070.44	275.761	211.81	127.18	321
316	4-1/2" TBG, 18.9#, L-80,HSM3	322	9.188	3079.63	266.573	212.28	127.57	322
317	4-1/2" TBG, 18.9#, L-80,HSM3	323	8.935	3088.56	257.638	212.74	127.95	323
318	4-1/2" TBG, 18.9#, L-80,HSM3	324	9.530	3098.09	248.108	213.23	128.35	324
319	4-1/2" TBG, 18.9#, L-80,HSM3	325	9.528	3107.62	238.580	213.72	128.75	325
320	4-1/2" TBG, 18.9#, L-80,HSM3	326	9.526	3117.15	229.054	214.21	129.15	326
321	4-1/2" TBG, 18.9#, L-80,HSM3	327	9.528	3126.67	219.526	214.70	129.56	327
322	4-1/2" TBG, 18.9#, L-80,HSM3	328	9.539	3136.21	209.987	215.19	129.96	328
323	4-1/2" TBG, 18.9#, L-80,HSM3	329	9.530	3145.74	200.457	215.68	130.36	329
324	4-1/2" TBG, 18.9#, L-80,HSM3	330	9.528	3155.27	190.929	216.17	130.76	330
325	4-1/2" TBG, 18.9#, L-80,HSM3	331	9.526	3164.80	181.403	216.66	131.17	331
326	4-1/2" TBG, 18.9#, L-80,HSM3	332	9.528	3174.33	171.875	217.15	131.57	332
327	4-1/2" TBG, 18.9#, L-80,HSM3	333	9.531	3183.86	162.344	217.64	131.97	333
328	4-1/2" TBG, 18.9#, L-80,HSM3	334	9.542	3193.40	152.802	218.13	132.37	334
329	4-1/2" TBG, 18.9#, L-80,HSM3	335	9.529	3202.93	143.273	218.62	132.78	335
330	4-1/2" TBG, 18.9#, L-80,HSM3	336	9.520	3212.45	133.753	219.10	133.18	336
331	4-1/2" TBG, 18.9#, L-80,HSM3	337	9.189	3221.64	124.564	219.58	133.57	337
332	4-1/2" TBG, 18.9#, L-80,HSM3	338	9.532	3231.17	115.032	220.07	133.97	338
333	4-1/2" TBG, 18.9#, L-80,HSM3	339	9.531	3240.70	105.501	220.56	134.37	339
334	4-1/2" TBG, 18.9#, L-80,HSM3	340	9.578	3250.28	95.923	221.05	134.78	340
335	4-1/2" TBG, 18.9#, L-80,HSM3	341	9.528	3259.81	86.395	221.54	135.18	341
336	4-1/2" TBG, 18.9#, L-80,HSM3	342	9.541	3269.35	76.854	222.03	135.58	342
337	4-1/2" TBG, 18.9#, L-80,HSM3	343	9.530	3278.88	67.324	222.52	135.98	343


7.7 Completion String Pressure Test

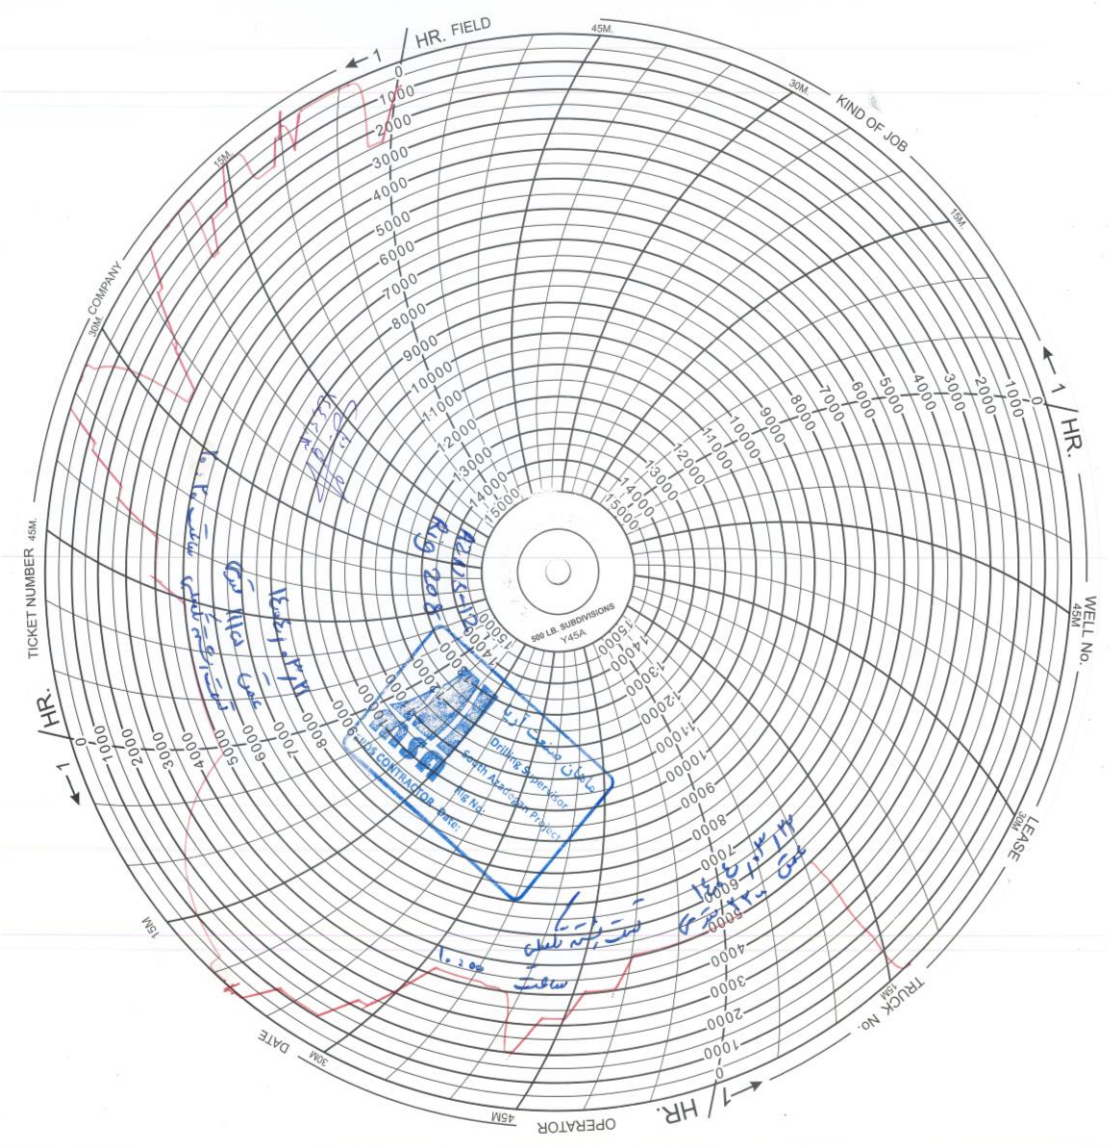

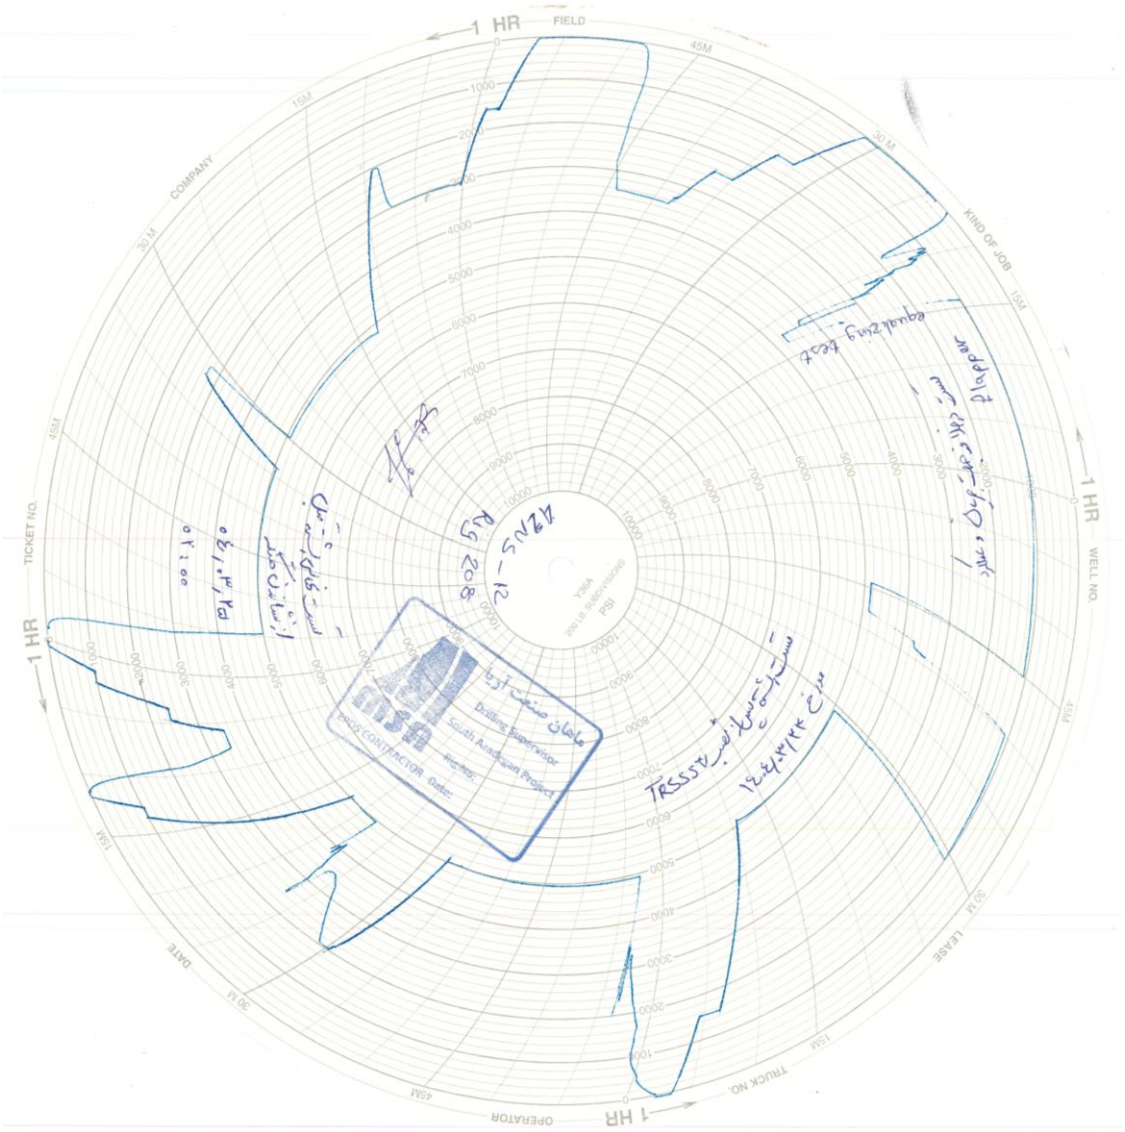
1 HR
FIELD
COMPANY
KIND OF JOB
TICKET NO.
WELL NO.
DATE
LEASE
TRUCK NO.
OPERATOR
AZNS - 12
Drilling Supervisor
South Azadegan Project

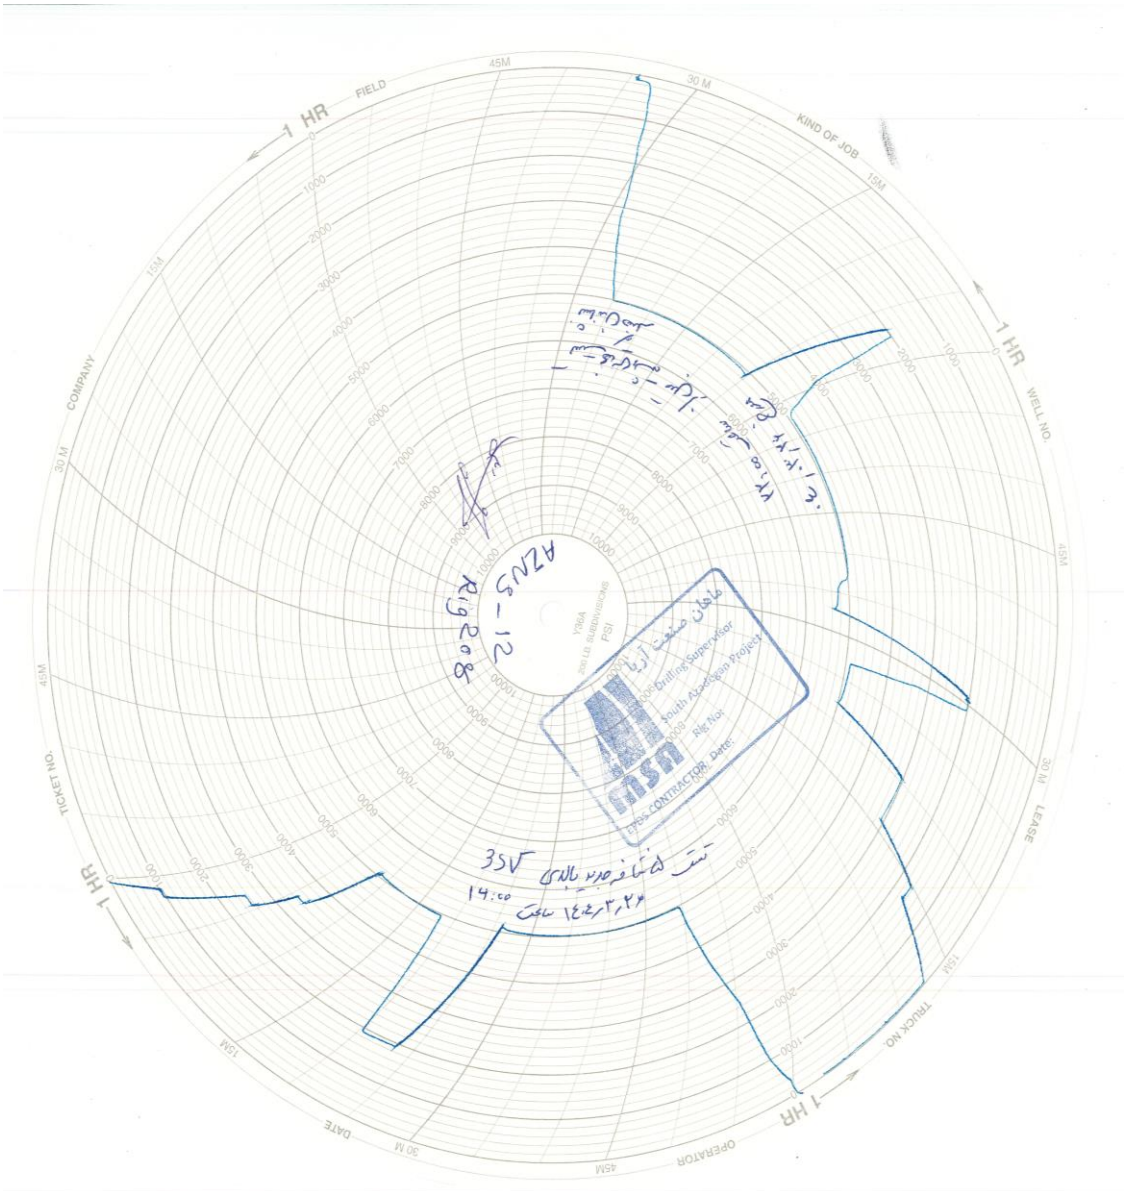
1 HR
FIELD
KIND OF JOB
COMPANY
WELL NO.
LEASE
TRUCK NO
OPERATOR
DATE
TICKET NO.
AZNS - 12
Rig 208
South Azadegan Project
Drilling Supervisor
Rig No:
Date:
CONTRACTOR

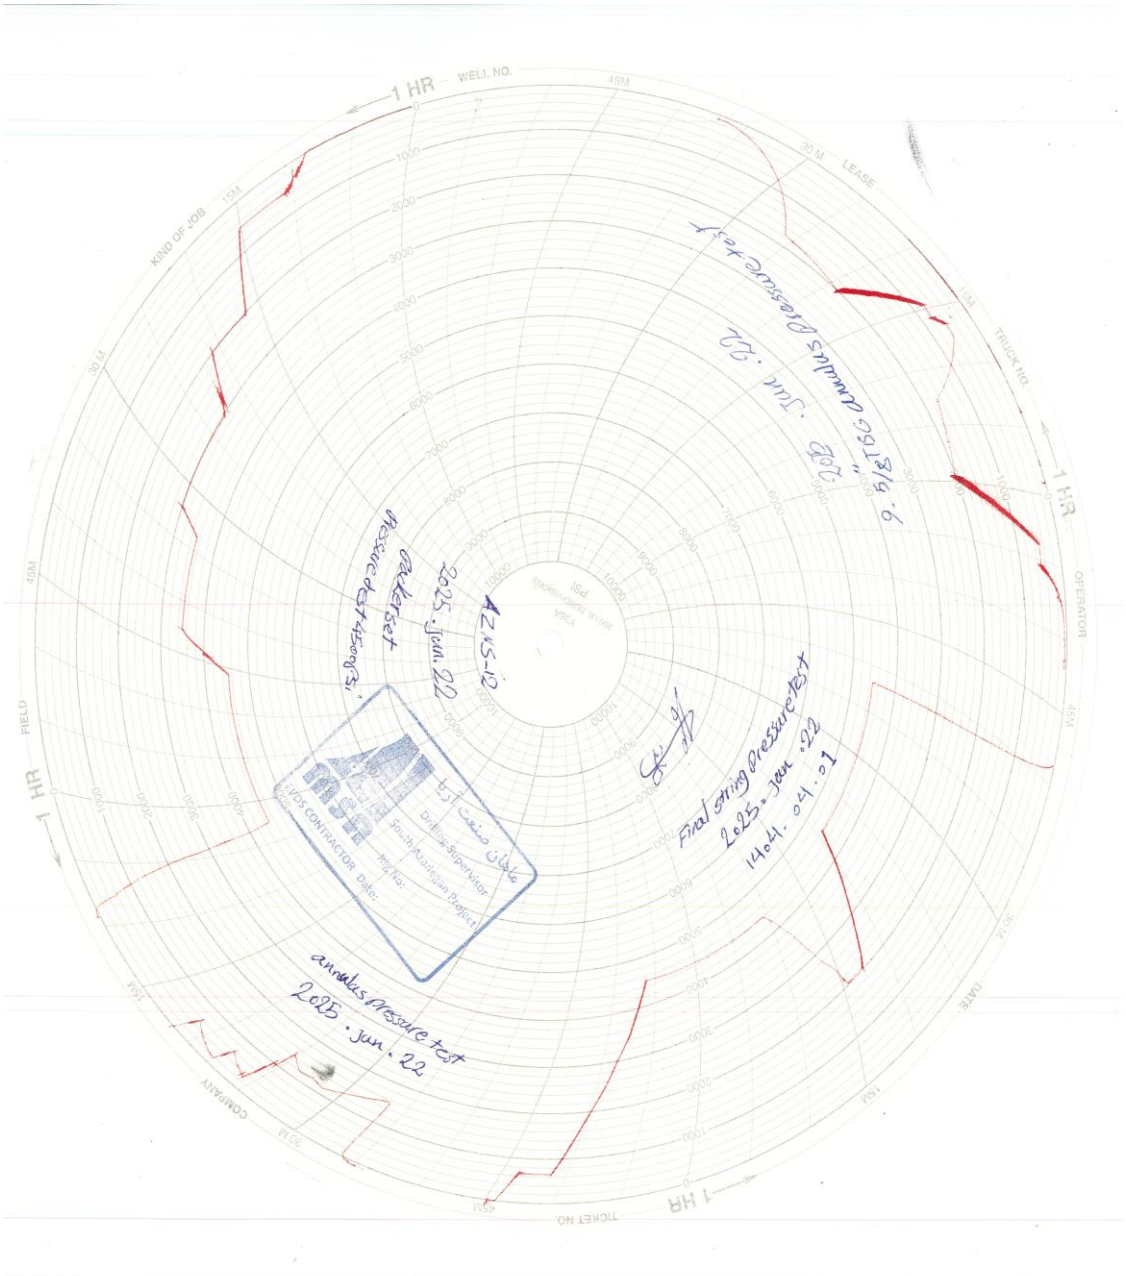
1 HR
WELL NO.
LEASE
TRUCK NO.
OPERATOR
DATE
TICKET NO.
COMPANY
FIELD
KIND OF JOB
AZNS-12
2025. Jun. 22
Pressured Test
Final string Pressure test
2025. Jun. 22
14:41. 01
annulus pressure test
2025. Jun. 22

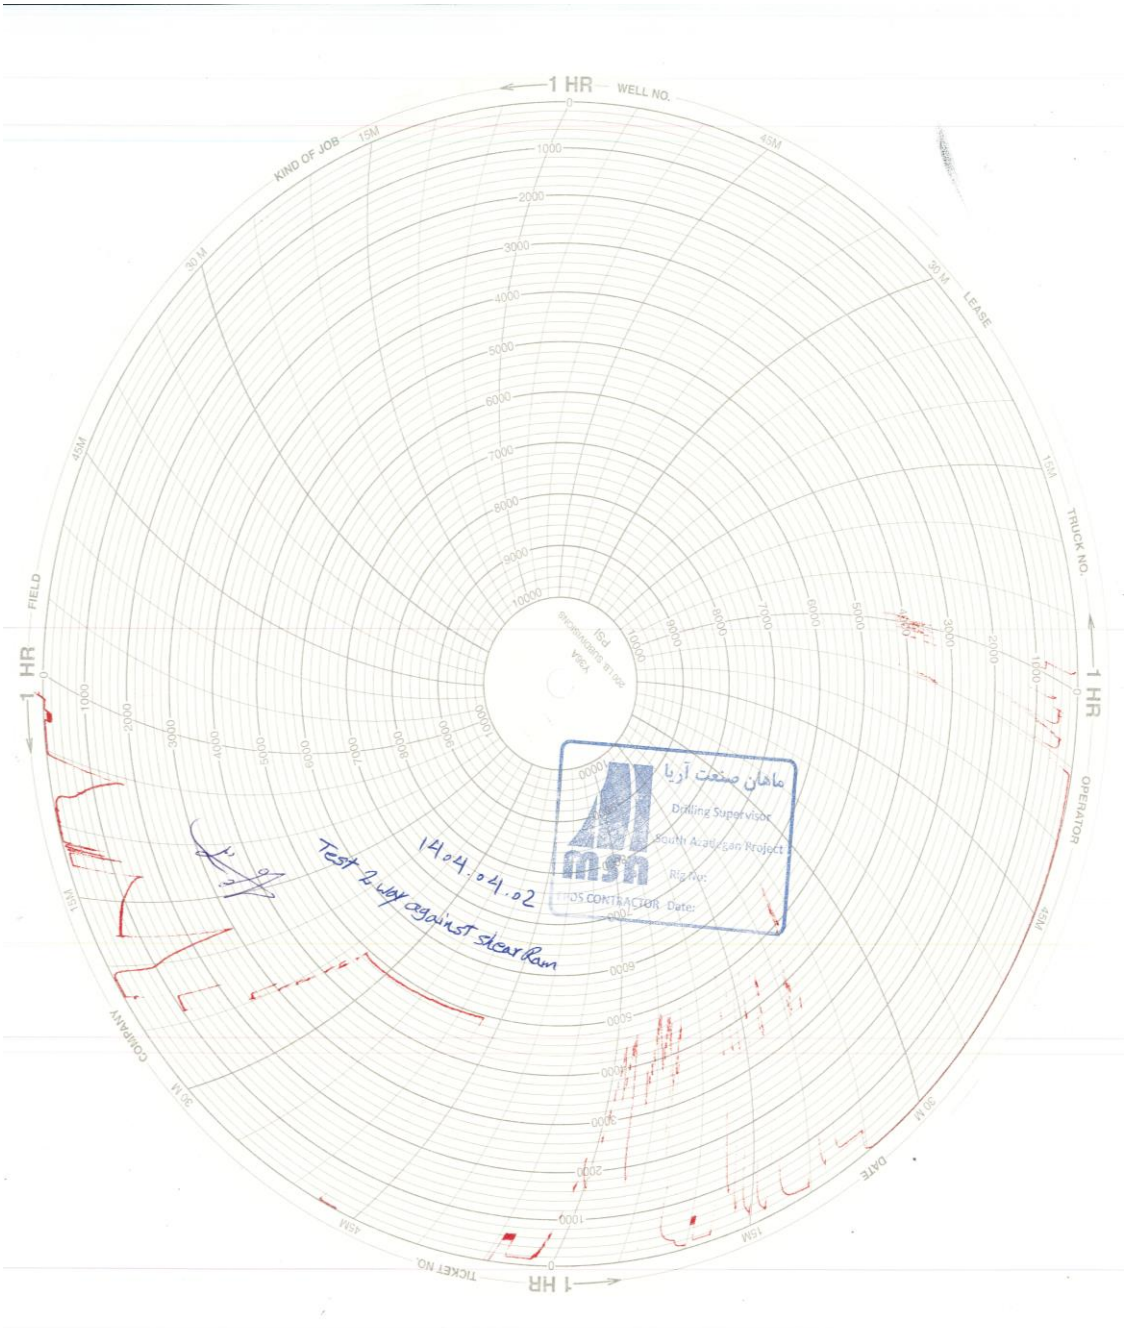
1 HR
WELL NO.
KIND OF JOB
LEASE
TRUCK NO.
OPERATOR
DATE
TICKET NO.
COMPANY
FIELD
14:04:04:02
Test 2 way against stear Ram
ماهان صنعت آریا
Drilling Supervisor
South Azadegan Project
Rig No:
MSA
OILFIELD SERVICES CONTRACTOR Date:

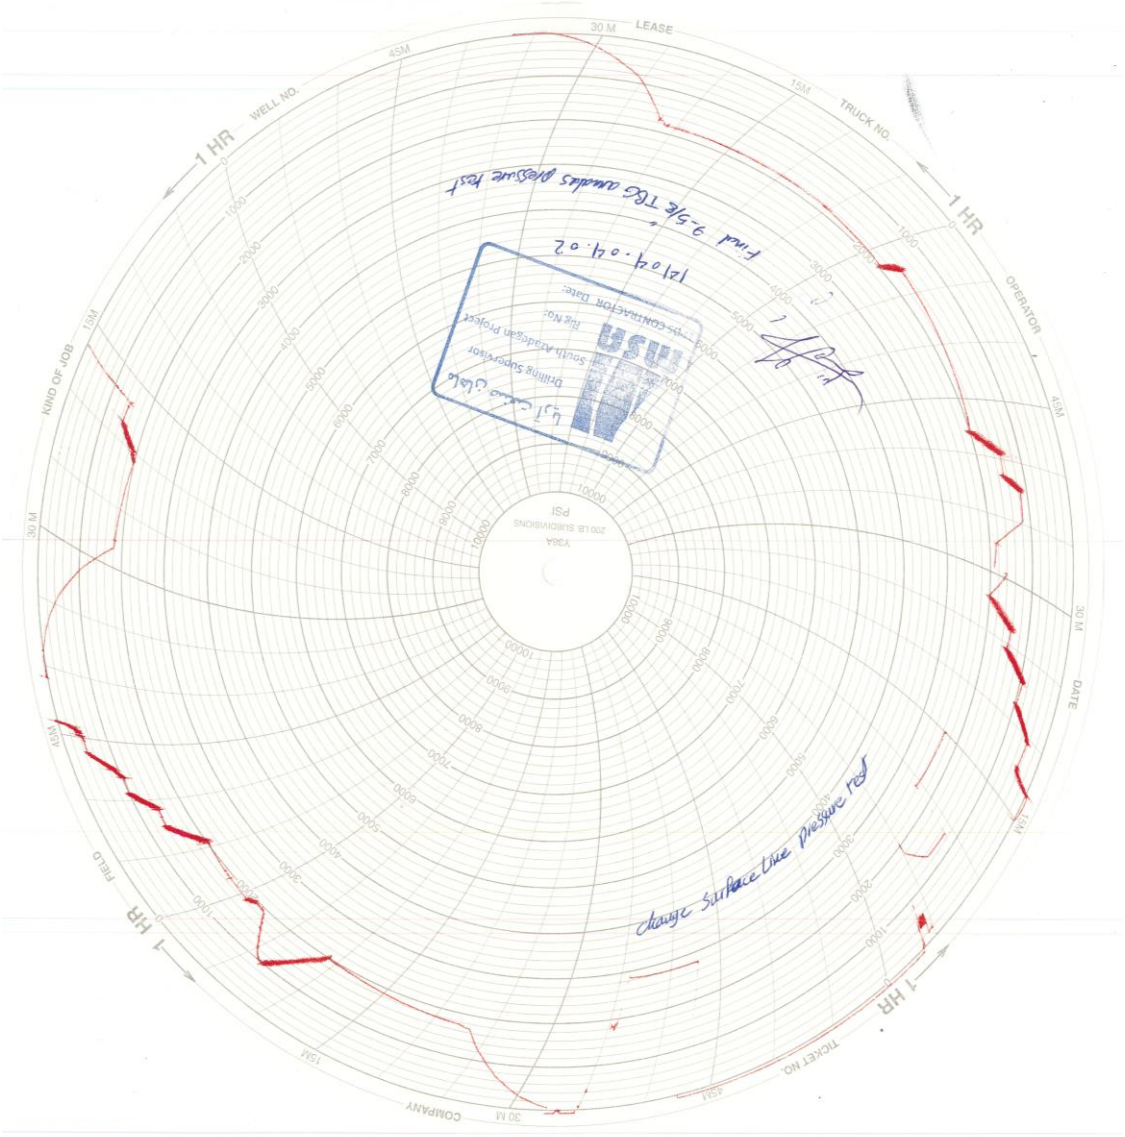


Figure 7-6: AZNS-12 Setting Packer, Annulus & Final Completion String Pressure Test

8. Wellhead Report

8.1 Final Well Status

Well Head

Item	Specification (size, pressure rating, M/C)	Test Pressure	Test Duration
C.H.H (N/A)	20 – 3/4'' 3K, DD – 0.5 PSL1, PR1	Already installed	-
C.H.S (ABB – PEIC IRAN)	20 – 3/4'' 3K * 13 – 5/8'' 5K , DD – 0.5, PSL1, PR1	Already installed	
T.H.S. (MSP Drilex)	13 – 5/8'' 5K * 11'' 5K, FF – 0.5, PSL3, PR2	4500 psi	15 MIN
X-MASS TREE (BTM) (MSP Drilex)	4 – 1/16'' 5K, FF – 0.5, PSL3G, PR2	4500 psi	15 MIN

Wellbore Completion Fluids

Well bore	Fluid Type	Weight (pcf)
Cased Hole	$CaCL_2$	84

Well Head Pressure Record

Annulus	Pressure (psi)	Date / Time
Wellhead	0	1404. 04. 01
Tubing- 9 5/8"	0	1404. 04. 01
9 5/8" – 13 3/8"	0	1404. 04. 01
13 3/8" – 20"	0	1404. 04. 01

Barriers

Barrier Type	Depth	Pressure Test	Date Tested
Close TRSSSV	62.796m	500 psi (inflow test after finish flow the well)	1404. 03. 23

Temporary Installed Equipment:

Table 8-1: AZNS-12 Final Well Status

8.2 Wellhead & X-mass tree Specification

Well Type	Specification	Check and Remark
MSP Co. Well Head 5,000 Psi for Gadvan Wells	**TUBING HEAD ADAPTOR** BOTTOM STUDDED FLANGE 11", 5000 PSI, BX160 TOP STUDDED FLANGE 4-1/16" 5000 PSI BX155 FULL BORE PREPARED WITH TWO S-SEAL AND ONE METAL TO METAL SEAL TO PACK TOP NECK OF TUBING HANGER C/W RELATED TEST AND INJECTION PORTS PREPARTION. C/W TWO CONTINUOUS FEED THROUGH TYPE 1/4" NPT CONTROL LINE EXITS PREPARTION (ONE FOR 1/4" TRSSSV CL AND ONE FOR 1/4" DOWNHOLE PRESSURE GAUGE) C/WITH ONE 4-1/16", 5K WP FULL BORE MANUAL GATE VALVE FORGED BODY AND BONNET, ALLOY STAINLESS STEEL 410SS GATE & SEAT AISI 410 COATED WITH TUNGSTEN CARBIDE USING HVOF METHOD STEM: INCONEL 718 WITH BACK SEAT CAPABILITY, NON RISING STEM METAL TO METAL SEAL BETWEEN SEAT AND GATE C/W HAND WHEEL FORGED BODY ALLOY STEEL AISI 410 MAXIMUM HEIGHT: 800MM M/C: FF-0.5 T/C: U PSL:3G PR:2 CROSS T-TYPE SOLID BLOCK CROSS T-TYPE SOLID BLOCK, BOTTOM FLANGED 4-1/16" API 5000 PSI WP TOP FLANGED STUDDED 4-1/16" API 5000 PSI WP FOR TREE CAP WITH TWO STUDDED SIDE OUTLETS 4-1/16" 5000PSI WP ELEVATED AT 900 DEG AND TWO 4-1/16", 5000 PSI MANUAL GATE VALVE AT THE TOP AND BOTTOM AND ONE 4-1/16", 5000 PSI WP SAFETY VALVE EQUIPPED WITH HYDRAULIC WIRE CUT ACTUATOR AS UPPER MASTER VALVE MATERIAL OF BODY, BONNET: AISI 410 SEAT, GATE: AISI 410SS HARD FACED WITH TUNGSTEN CARBIDE UASING HVOP METHOD MATERIAL OF STEM: INCONEL 718 M/C: FF-0.5 T/C: U PSL:3G PR:2G. MANUAL GATE VALVE API 4-1/16" 5000 PSI WP. FLANGED ENDS AND FULL BORE METAL TO METAL SEAL BETWEEN BODY/SEAT/GATE WITH BACK SEAT CAPABILITY, NON RISING STEM C/W HANDWHEELS MATERIAL OF BODY,	

Well Type	Specification	Check and Remark
	BONNET, SEAT, GATE: AISI 410SS MATERIAL OF STEM: INCONEL 718 GATE&SEAT HARD FACED WITH TUNGSTEN CARBIDE BY HOVF METHOD M/C: FF-0.5 T/C: U PSL:3G PR:2 X-MAS TREE CAP 4-1/16" API 500 PSI WP, FLANGED BOTTOM (4-1/16", BORE) 8-3/8"-4ACME-2G THREAD TOP, BLANKING PLUG TAPPED WITH 1/2" NPT THREAD, FORGED BODY, MATERIAL: STAINLESS STEEL 410 M/C: FF-0.5 T/C: U PSL:3G PR:2	

Table 8-2: AZNS-12 Wellhead & X-Mass Tree Equipment Specification

8.3 Wellhead Schematic



Figure 8-1: AZNS-12 Wellhead Sketch

8.4 Tubing Head Spool Specification (Section C)

Item	Equipment	M/C	T/C	PSL	Qty
1	Tubing Head Spool 13 – 5/8” 5k * 11” 5k	FF-0.5	U	3	1
2	Manual Gate Valve 2 – 1/16” 5k	FF-0.5	U	3	1
3	Tubing Hanger 11” Bowl * 4 – 1/2” ACME 5k	FF-0.5	U	3G	1

Table 8-3: AZNS-12 Section "C" Specification

8.5 X – Mass Tree Specification (Section D)

Item	Equipment	M/C	T/C	PSL	Qty
1	BTM Master Valve 11” * 4 – 1/16” 5K	FF-0.5	U	3G	1
2	TOP Master Valve 4 – 1/16” 5K	FF-0.5	U	3G	1
3	Surface Safety Valve 4 – 1/16” 5K	FF-0.5	U	3G	1
4	Deeping Valve 4 – 1/16” 5K	FF-0.5	U	3G	1
5	Wing gate valve – 1 (Kill Valve) 4 – 1/16" 5K	FF-0.5	U	3G	1
6	Wing gate valve – 2 (production valve) 5K	FF-0.5	U	3G	1
7	4 – 1/16" Choke valve 4 – 1/16" 5K	FF-0.5	U	3G	1
8	Christ Mas Tree	FF-0.5	U	3G	1

Table 8-4: AZNS-12 Section "D" Specification

8.6 Pressure Test Report of Section D (before & after installation)


Item	Test	Check Mark and Result
1	Pressure test for the kill Valve W/ 1000 & 4500 Psi / 15 min	OK
2	Pressure test for the SSV W/ 1000 & 4500 Psi / 15 min	OK
3	Pressure test for the top master valve W/ 1000 & 4500 Psi / 15 min	OK
4	Pressure test for Swab valve W/ 1000 & 4500 Psi / 15 min	OK
5	Pressure test for the Production valve W/ 1000 & 4500 Psi / 15 min	OK

Table 8-5: AZNS-12 Section "D" Test Report Befor Installation

Item	Test	Check mark and Result
1	Pressure test X-MAS TREE solid block and bottom section W/1000 &4500 psi for 15min	OK
2	Pressure test for the SSV Exit block W/ 4500 Psi / 15 min	OK
3	Pressure test neck of tubing hanger metal seal W/1000 &4500 psi for 15min	OK
4	Pressure test for Swab valve W/ 4500 Psi / 15 min	-
5	Pressure test for Production valve W/4500 Psi / 15 min	-
6	Pressure test cavity of FS.seal and Ring Gasket W 4500 Psi / 15 min	OK

Table 8-6: AZNS-12 Section "D" Test Report After Installation

8.7 Wellhead Related Test Reports

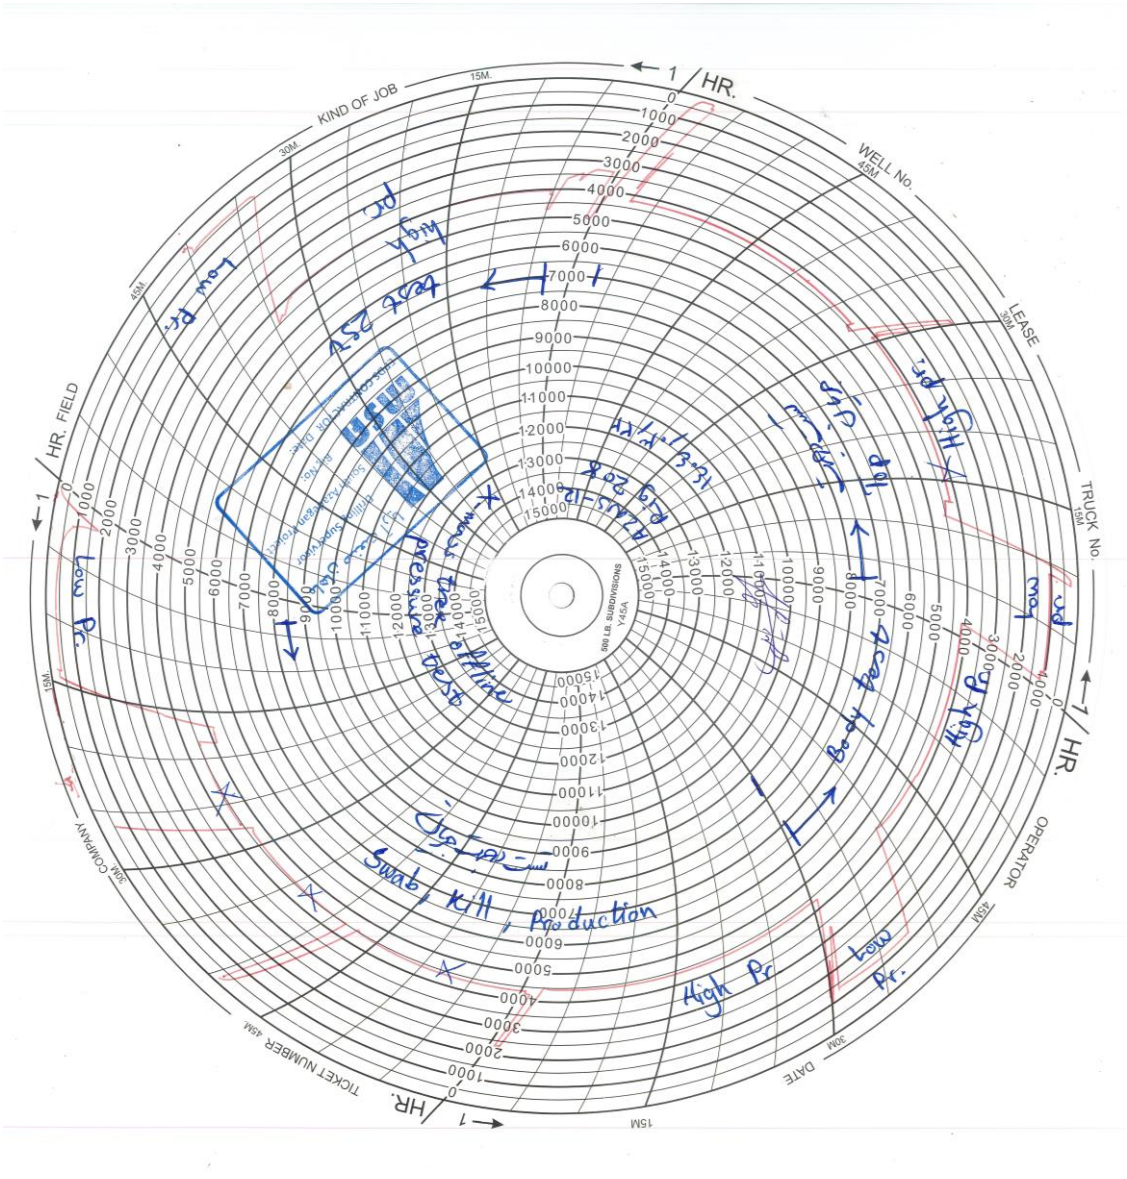

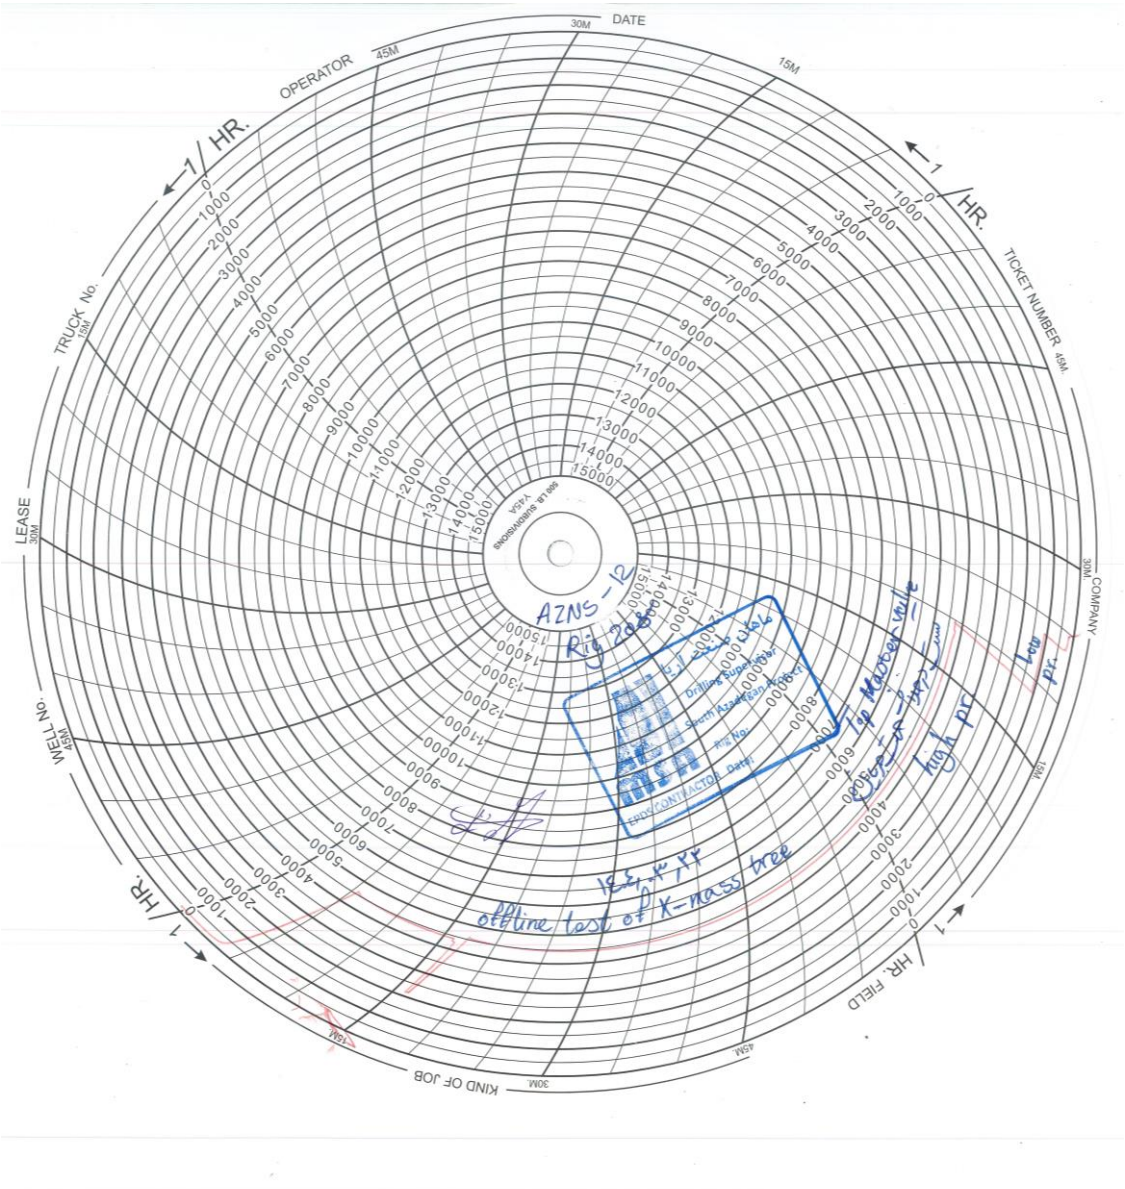


Figure 8-2: AZNS-12 X-Mass Tree Body Pressure Test Graph Before Installation

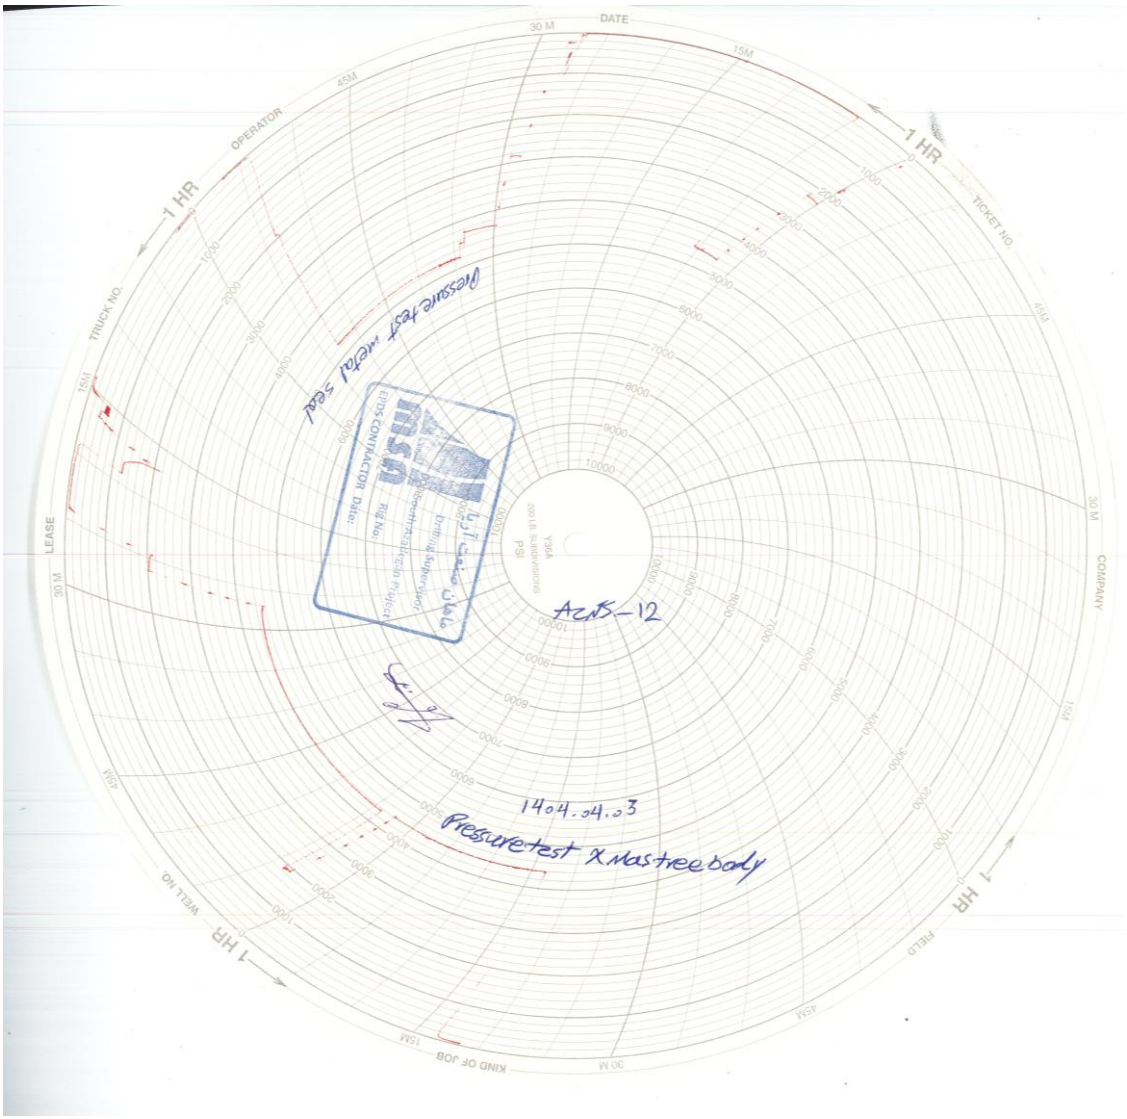


Figure 8-3: AZNS-12 X-Mass Tree Body Pressure Test Graph After Installation



تاریخ: 1404/03/22
پیوست: دارد

بسمه تعالی

موضوع: صورتجلسه تست سطحی تاج چاه 12 آزادگان جنوبی، قبل از نصب در دکل 208 عملیات اکتشاف نفت

بدینوسیله در مورخه 1404/03/22 تست‌های سطحی تاج چاه X-Mass Tree Solid Block "T" Type 4 – 1/16" 5k, مرتبط به چاه شماره 12 آزادگان جنوبی با حضور نماینده محترم کارفرما (پتروپارس) در محل دستگاه 208 MSP DRILEX عملیات اکتشاف نفت، قبل از نصب بر روی تاج چاه به شرح ذیل انجام پذیرفت:


- Body Pressure Test of X – Mass Tree Solid Block w/ 1000psi, 5min & 4500psi, 15min "OK" S/N: CT2302 A/0 N180006
- Inflow Pressure Test of 4 – 1/16" Production (WING) Valve w/ 1000psi, 5min & 4500psi, 15min "OK". S/N: 002928-NL N180063
- Inflow Pressure Test of 4 – 1/16" Dipping (SWAB) Valve w/ 1000psi, 5min & 4500psi, 15min "OK". S/N: 008928H N80006
- Inflow Pressure Test of 4 – 1/16" Kill Valve w/ 1000psi, 5min & 4500psi, 15min "OK" S/N: 002928-NL N180075
- Inflow Pressure Test of 4 – 1/16" Surface Safety Valve w/ 1000psi, 5min & 4500psi, 15min "OK". S/N: 0269166-NL N180006
- Inflow & Out Flow Pressure Test of 4 – 1/16" Top Master Valve w/ 1000psi, 5min & 4500psi, 15min "OK". S/N: 008928G N180006
- Pressure Test of 2SV Actuator w/ 2000psi, 15min "OK".

– گراف مربوط به تست فشار پیوست صورتجلسه گردید.

ناظر عملیات حفاری
شرکت ماهان صنعت آریا
ماهان صنعت آریا
Drilling Supervisor
Eyvazi
South Azadegan Project
Rig No: OEOC 208
EPDS CONTRACTOR Date: ۱۴۰۴/۰۳/۲۲

نماینده محترم تکمیل چاه کارفرما
شرکت مشاوران انرژی تهران

Figure 8-4: AZNS-12 Wellhead MOM Befor Installation

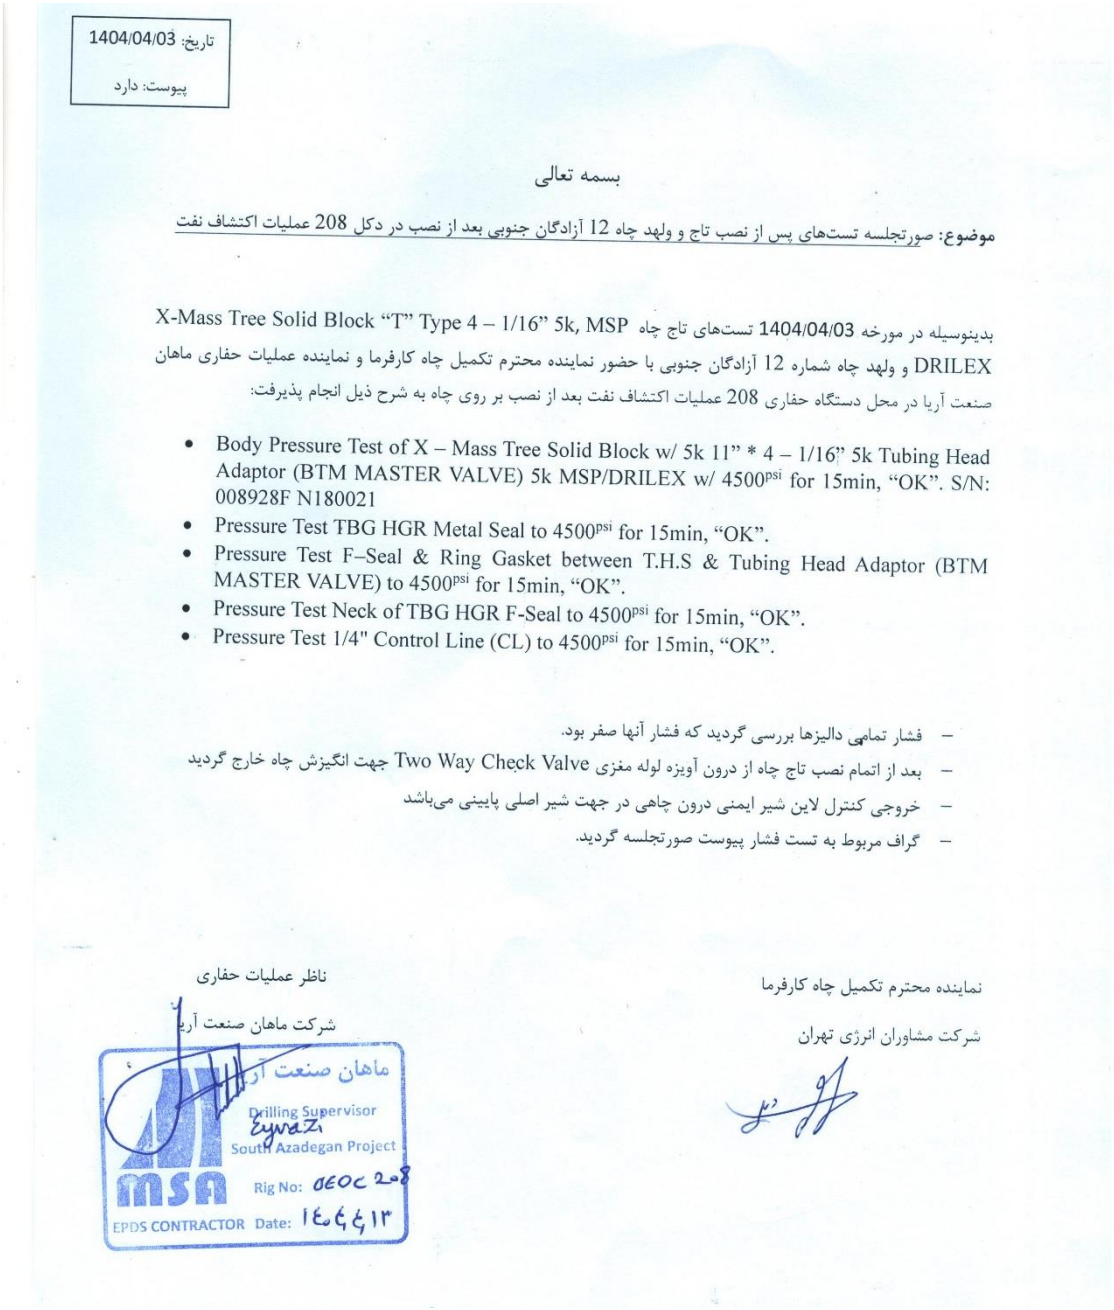

تاریخ: 1404/04/03
پیوست: دارد

بسمه تعالی

موضوع: صورتجلسه تست‌های پس از نصب تاج و ولهد چاه 12 آزادگان جنوبی بعد از نصب در دکل 208 عملیات اکتشاف نفت

بدینوسیله در مورخه 1404/04/03 تست‌های تاج چاه X-Mass Tree Solid Block "T" Type 4 – 1/16" 5k, MSP و ولهد چاه شماره 12 آزادگان جنوبی با حضور نماینده محترم تکمیل چاه کارفرما و نماینده عملیات حفاری ماهان DRILEX صنعت آریا در محل دستگاه حفاری 208 عملیات اکتشاف نفت بعد از نصب بر روی چاه به شرح ذیل انجام پذیرفت:

- Body Pressure Test of X – Mass Tree Solid Block w/ 5k 11" * 4 – 1/16" 5k Tubing Head Adaptor (BTM MASTER VALVE) 5k MSP/DRILEX w/ 4500^{psi} for 15min, "OK". S/N: 008928F N180021
- Pressure Test TBG HGR Metal Seal to 4500^{psi} for 15min, "OK".
- Pressure Test F–Seal & Ring Gasket between T.H.S & Tubing Head Adaptor (BTM MASTER VALVE) to 4500^{psi} for 15min, "OK".
- Pressure Test Neck of TBG HGR F-Seal to 4500^{psi} for 15min, "OK".
- Pressure Test 1/4" Control Line (CL) to 4500^{psi} for 15min, "OK".

– فشار تمامی دالیزها بررسی گردید که فشار آنها صفر بود.
– بعد از اتمام نصب تاج چاه از درون آویزه لوله مغزی Two Way Check Valve جهت انگیزش چاه خارج گردید
– خروجی کنترل لاین شیر ایمنی درون چاهی در جهت شیر اصلی پایینی می‌باشد
– گراف مربوط به تست فشار پیوست صورتجلسه گردید.

نماینده محترم تکمیل چاه کارفرما
شرکت مشاوران انرژی تهران

ناظر عملیات حفاری
شرکت ماهان صنعت آریا

ماهان صنعت آریا
Drilling Supervisor
Eynazi
South Azadegan Project
MSA
Rig No: OEOC 208
EPDS CONTRACTOR Date: ۱۴۰۴/۰۴/۱۳

Figure 8-5: AZNS-12 Wellhead MOM After Installation

9. Drilling Fluid Information

9.1 Summary of Fluid

Hole size (in)	Casing size (in)	CSG Depth (m MD)	Drilling Fluid system	Mud Properties
26"	20"	154 M	Already has been drilled.	
17 ½"	13 3/8"	1259 M	Already has been drilled.	
12 ¼"	9 5/8"	3448 M	Already has been drilled.	
8 ½"	7"Liner	3285 to 3846 M	Already has been drilled.	
6 1/8"	5" Liner	3779 To 3945 m	Already has been drilled.	

9.2 Interval Remark

Operation Remark

Spud the rig & 13 – Apr – 2025 on AZN – 12. R/U CT EQP & RIH with CT to 2798^{m}, Displaced inside string with 84^{pcf} Salt Poly Mud. Performed BOP test, Retrieve TWCV, Screw 7" L/J on TBG Hanger, RIH with punch assy to 2794^{m}, punched string & POOH to Surface.

Work On to Pull out TBG Hanger & Try to open the traveling jts, String got free, POOH completion string to surface.

RIH with 3 – 1/2" spear & fishing BHA to 3307^{m}, confirmed TOF, work on fishing & try to catch same, POOH to surface, recovered 100 – 150^{m} slick line.

RIH with 2" * 4" taper tap to 3305^{m}, engage with fish & tap inside fish then POOH to surface, recovered fish.

RIH with clean out BHA to 3337^{m} (7" Packer Depth), Commenced milling to 3337.9^{m}. suddenly noticed no return, after pumped 43^{bbl} got return, cont. milling to 3338^{m}, RIH to 3454^{m}, OBS, Conn. Gas and 4 BPHG, increased MW to 84^{pcf} with NL-NG, RIH to 3520^{m}, string rook weight, try to pass this point with "NO SUCC", POOH to surface.

RIH with 2" * 4" taper tap to 3516^{m}, engage fish, chase same to 3641^{m}, tap inside fish, POOH as chain out to surface, engage marked with 2" to 3 7/8" outside diameter.

RIH with another taper tap 3474^{m}, took weight, try to engage fish with "NO SUCC", chase the fish to 3637^{m}, took weight, work on fish "SUCC", POOH to surface, packer & tail retrieved successfully.

RIH with cable spear BHA to 3725^{m} and POOH to surface.

RIH with cable spear BHA to 3770^{m} while perform fishing, POOH to surface.

RIH with wire grab to 3778^{m}, POOH to surface.

RIH with 6" J. MILL to 3778^{m} then POOH to surface.

RIH with 3 – 1/2" MILL & clean out BHA to 3777.65^{m}, commenced milling to 3778^{m}, POOH to surface.

RIH with 2 7/8" cable spear 3778^{m}, catch fish and POOH to surface.

RIH with 2 7/8" cable spear 3783^{m}, catch fish and POOH to surface, recovered 39^{m} wire.

RIH with 2 7/8" cable spear 3807^{m}, catch fish and POOH to surface.

RIH with 3 ½" MILL & clean out BHA & milling & push fish to 3900^{m} then POOH to surface, OBS 3 – 1/2" Mill & 3 – 1/4" bit sub left in hole.

RIH with 4" MILL to 3779^{m}, milling & push down fish to 3888.7^{m} with no progress then POOH to surface with 1 BPHL.

RIH with 3 15/16" MILL to 3888.7^{m}, milling with low parameters to 3888.8^{m}, POOH to surface.

RIH with 3 1/2" MILL to 3899^{m}, try to resume milling with "NO PROGRESS" (confirmed TOF), POOH to surface.

RIH with 4 1/16" overshot to 3899^{m}, work on fish as per plan then POOH to surface.

RIH with 5 7/8' C.CUT 3270^{m}, performed magnesite balance plug as program and POOH to surface.

Set RTTS packer & Changed T.H.S with new one.

Unset RTTS packer & RIH with 8 3/8" TCI bit & drill out BHA to 3180^{m}, drill out soft to med magnesite plug to 3270^{m} and POOH to surface,

RIH with 5 7/8" MT bit and tandem scraper to 3779^{m}, pumped hi-vis pill and clean the well then POOH to surface.

Performed logging job.

RIH with 7 5/16" polish mill to 7" L.LAP, polish inside then POOH to surface.

RIH with SN packer assay to 3289^{m}, set packer and POOH to surface.

Drilling Fluid Remark

Based on program 81 – 85^{pcf} Salt/Polymer mud was used for commencing this interval.

The MW increased up to by adding Limestone Powder to 85^{pcf} at end of this interval.

Treated frequently with essential chemical such as lime as Alkalinity controller to adjust pH, Starch LV for control FL, Soda Ash for control hardness & Xanthan gum as Viscosifier.

9.3 Drilling Fluid type

FLUID PROPERTIES RECAP					
KCL Pol Mud		Drilling start	Range		Drilling End
MW (min)	pcf	81	81	85	84
Funnel Viscosity	sec/qt	41	40	48	44
PV	cps	15	11	16	13
YP	lb/100sq.ft	11	10	15	12
pH		9.5	8.2	9.6	9.2
Cl (NaCl)	mg/L	165,000	160000	180000	168,000
Total Hardness	mg/L	920	880	1880	1,880
Ca Hardness	mg/L	800	760	1680	1,680

Table 9-1: AZNS-12 Fluid Properties Recap Table

9.4 Material Consumption Analysis

Products	Units Used	Unit wt lbs	Total wt	Effective Concentration
Bentonite	1	2,200	2,200 lbs	0.55 ppb
Caustic Soda	30	55	1,650 lbs	0.41 ppb
Limestone	236	2,200	519,200 lbs	129.52 gpb
Lime	174	55	9,570 lbs	2.39 ppb
Magnesite	8	2,200	17,600 lbs	308.77 ppb
Salt (NaCl)	148	2,200	325,600 lbs	81.22 ppb
Starch LV	362	55	19,910 lbs	4.97 ppb
Soda ASH	33	55	1,815 lbs	0.45 ppb
Xanthan Gum	45	55	2,475 lbs	0.62 ppb

Initial Volume	0.0 bbl
Total Volume Built	4,008.7 bbl
Volume received	0.0 bbl
Volume Returned	0.0 bbl
Total Volume Consumed	2,768 bbl
Volume Transfer to Next Section	1,240.7 bbl
Meter Drilled	0 m

Table 9-2: AZNS-12 Material Consumption Analysis Table

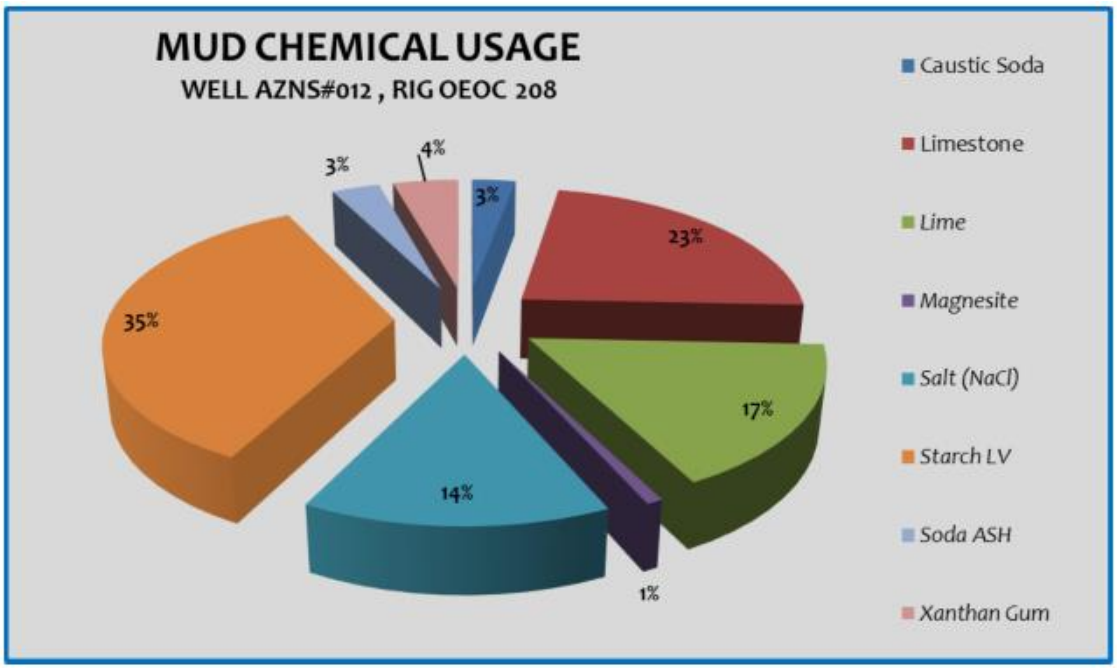


Figure 9-1: AZNS-12 De-Completion Section Mud Chemical Usage

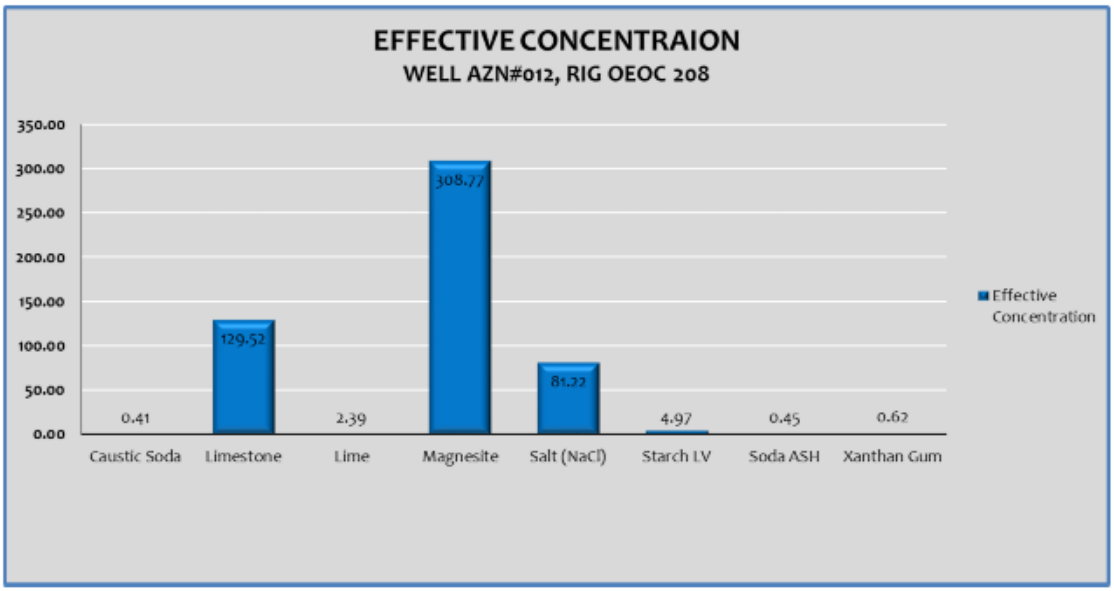


Figure 9-2: AZNS-12 De-Completion Section Effective Concentration

9.5 Volume Analysis

WELL AZN#12, RIG OEOC 208 VOLUME ANALYSIS		
Initial Volume	bbls	0.0
Received Volume	bbls	0.0
Volume Return	bbls	0.0
Volume Built	bbls	4,008.7
Surface Losses/Dumped	bbls	1,806.0
Formation Losses	bbls	962.0
Total Losses	bbls	2,768.0
Volume Transfer Out	bbls	1,240.7

Table 9-3: AZNS-12 De-Completion Section Volume Analysis Table

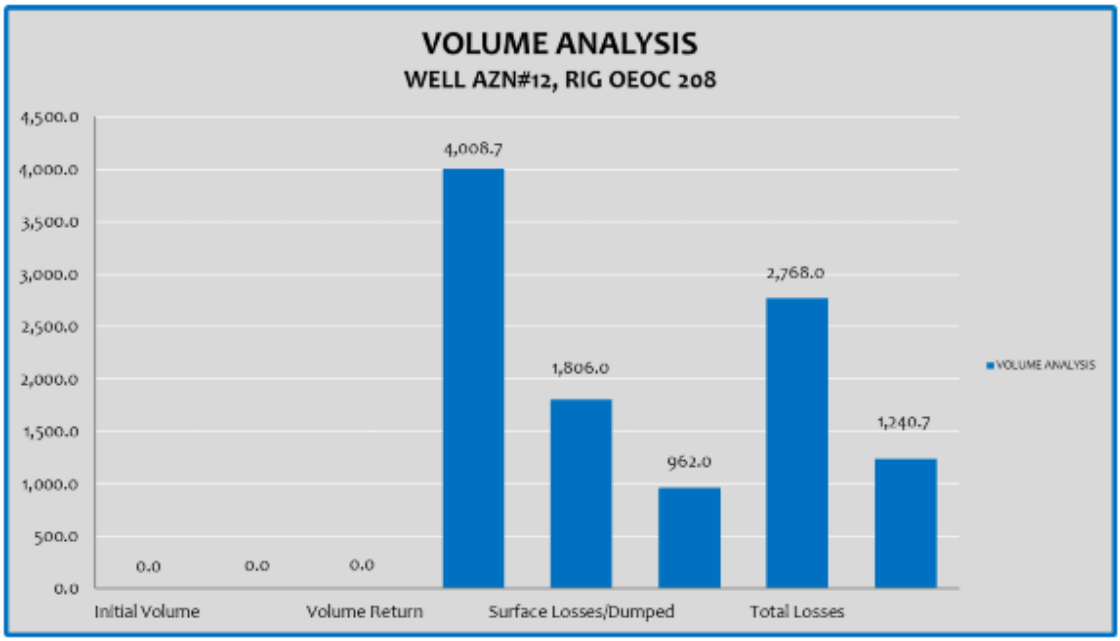


Figure 9-3: AZNS-12 De-Completion Section Volume Analysis Chart

9.6 Daily volume Breakdown

Date/DMR.N		Volume of Built	Surface Losses	Formation Losses
13-Apr-25	01	300.2	0	0
14-Apr-25	02	929.7	0	0
15-Apr-25	03	32.6	0	0
16-Apr-25	04	0.0	0	0
17-Apr-25	05	0.5	0	0
18-Apr-25	06	380.9	10	0
19-Apr-25	07	0.0	0	0
20-Apr-25	08	4.8	5	0
21-Apr-25	09	4.9	20	0
22-Apr-25	10	0.3	0	0
23-Apr-25	11	504.9	360	0
24-Apr-25	12	138.4	10	130
25-Apr-25	13	0.1	0	110
26-Apr-25	14	264.9	0	70
27-Apr-25	15	0.0	0	0
28-Apr-25	16	0.0	40	0
29-Apr-25	17	0.6	15	50
30-Apr-25	18	748.7	200	0
1-May-25	19	23.9	155	27
2-May-25	20	21.2	5	15
3-May-25	21	0.0	17	18
4-May-25	22	0.0	29	18
5-May-25	23	0.6	74	18
6-May-25	24	0.3	12	12
7-May-25	25	0.0	0	8
8-May-25	26	0.0	41	20
9-May-25	27	113.6	11	72
10-May-25	28	186.7	10	36
11-May-25	29	0.0	21	24
12-May-25	30	0.3	13	24
13-May-25	31	0.0	7	12
14-May-25	32	0.1	34	12
15-May-25	33	0.0	26	12
16-May-25	34	4.8	18	12
17-May-25	35	40.6	4	12

18-May-25	36	224.5	36	110
19-May-25	37	0.4	14	24
20-May-25	38	0.0	7	24
21-May-25	39	0.2	14	12
22-May-25	40	0.2	10	24
23-May-25	41	7.3	14	12
24-May-25	42	0.0	9	12
25-May-25	43	0.3	17	12
26-May-25	44	0.1	13	12
27-May-25	45	57.6	47	8
28-May-25	46	0.0	6	0
29-May-25	47	0.0	94	0
30-May-25	48	0.0	42	0
31-May-25	49	14.5	67	0
1-Jun-25	50	0.0	24	0
2-Jun-25	51	0.0	31	0
3-Jun-25	52	0.0	13	0
4-Jun-25	53	0.0	27	0
5-Jun-25	54	0.0	153	0
6-Jun-25	55	0.0	31	0
Total (bbl)		Volume of Built	Surface Losses	Formation Losses
		4,008.7	1,806	962

Table 9-4: AZNS-12 Daily Volume Break Down Table

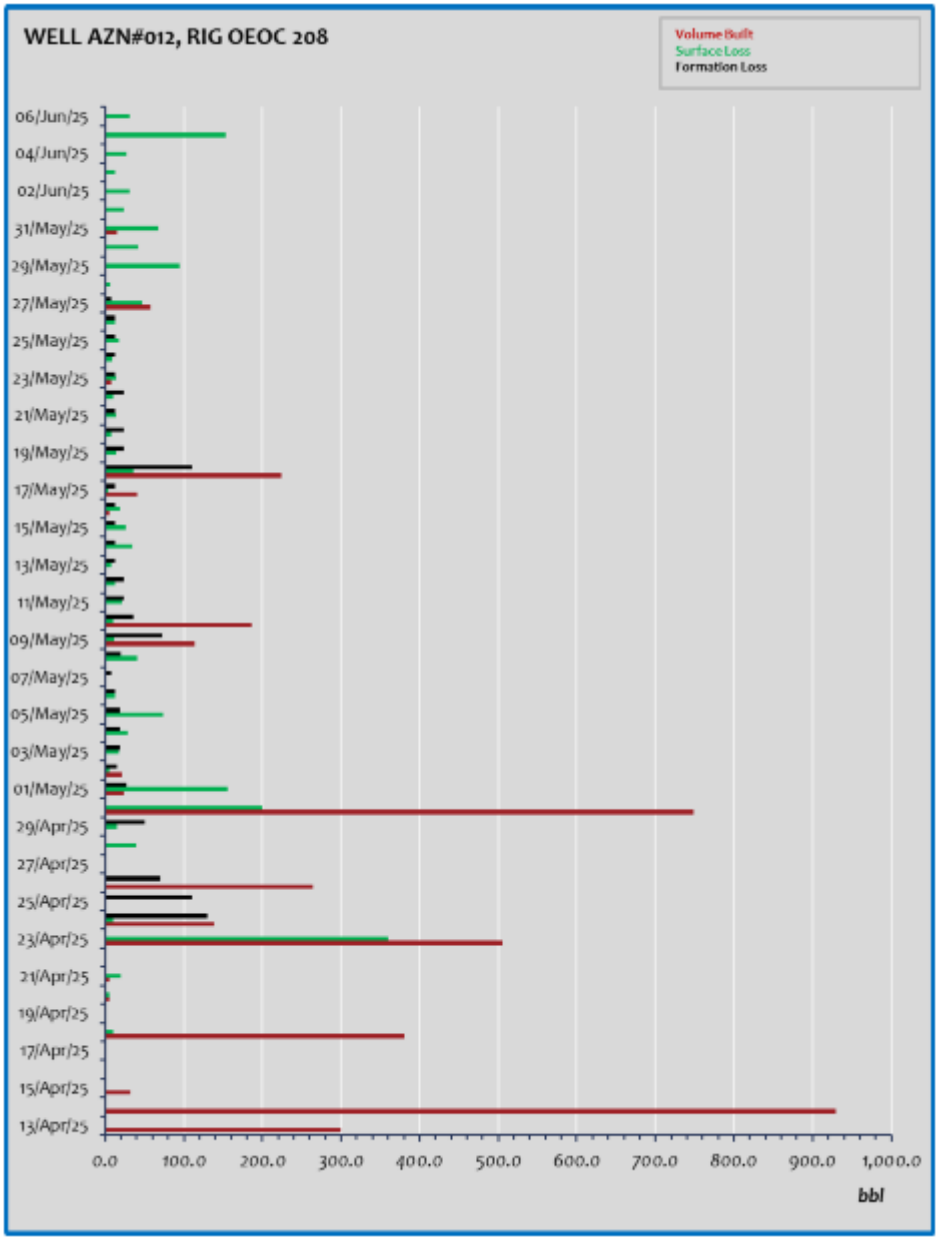


Figure 9-4: AZNS-12 Daily Volume Break Down Chart

9.7 Loss Distribution

Date/DMR.N		Volume of Built	Dump/Contamination	Shakers	Evaporation	Centrifuge	Trip	Mud cleaner	Pit Cleaning	Formation	Other
13-Apr-25	01	300.2	0	0	0	0	0	0	0	0	0
14-Apr-25	02	929.7	0	0	0	0	0	0	0	0	0
15-Apr-25	03	32.6	0	0	0	0	0	0	0	0	0
16-Apr-25	04	0.0	0	0	0	0	0	0	0	0	0
17-Apr-25	05	0.5	0	0	0	0	0	0	0	0	0
18-Apr-25	06	380.9	10	0	0	0	0	0	0	0	0
19-Apr-25	07	0.0	0	0	0	0	0	0	0	0	0
20-Apr-25	08	4.8	0	0	0	0	0	0	0	0	5
21-Apr-25	09	4.9	20	0	0	0	0	0	0	0	0
22-Apr-25	10	0.3	0	0	0	0	0	0	0	0	0
23-Apr-25	11	504.9	200	0	0	0	80	0	80	0	0
24-Apr-25	12	138.4	0	0	0	0	0	0	0	130	10
25-Apr-25	13	0.1	0	0	0	0	0	0	0	110	0
26-Apr-25	14	204.9	0	0	0	0	0	0	0	70	0
27-Apr-25	15	0.0	0	0	0	0	0	0	0	0	0
28-Apr-25	16	0.0	0	0	0	0	40	0	0	0	0
29-Apr-25	17	0.6	0	0	0	0	0	0	15	50	0
30-Apr-25	18	748.7	200	0	0	0	0	0	0	0	0
1-May-25	19	23.9	147	0	0	0	8	0	0	27	0
2-May-25	20	21.2	0	0	0	0	5	0	0	15	0
3-May-25	21	0.0	8	0	0	0	9	0	0	18	0
4-May-25	22	0.0	0	0	0	0	29	0	0	18	0
5-May-25	23	0.6	0	0	0	0	74	0	0	18	0
6-May-25	24	0.3	0	0	0	0	6	0	0	12	6
7-May-25	25	0.0	0	0	0	0	0	0	0	8	0
8-May-25	26	0.0	0	0	6	0	5	0	25	20	5
9-May-25	27	113.6	0	0	6	0	0	0	0	72	5
10-May-25	28	180.7	0	0	5	0	5	0	0	36	0
11-May-25	29	0.0	0	0	5	0	6	0	10	24	0
12-May-25	30	0.3	0	0	5	0	0	0	0	24	8
13-May-25	31	0.0	0	0	4	0	3	0	0	12	0
14-May-25	32	0.1	0	0	6	0	28	0	0	12	0
15-May-25	33	0.0	0	0	6	0	0	0	20	12	0
16-May-25	34	4.8	0	0	5	0	7	0	6	12	0
17-May-25	35	40.6	0	0	4	0	0	0	0	12	0

18-May-25	36	224.5	0	0	5	0	0	0	25	110	0
19-May-25	37	0.4	0	0	6	0	8	0	0	24	0
20-May-25	38	0.0	0	0	7	0	0	0	0	24	0
21-May-25	39	0.2	0	0	6	0	3	0	0	12	5
22-May-25	40	0.2	0	0	6	0	0	0	0	24	4
23-May-25	41	7.3	0	0	6	0	5	0	0	12	3
24-May-25	42	0.0	0	0	6	0	0	0	0	12	3
25-May-25	43	0.3	0	0	6	0	11	0	0	12	0
26-May-25	44	0.1	0	0	6	0	7	0	0	12	0
27-May-25	45	57.6	25	0	6	0	10	0	6	8	0
28-May-25	46	0.0	0	0	6	0	0	0	0	0	0
29-May-25	47	0.0	61	0	6	0	0	0	27	0	0
30-May-25	48	0.0	0	10	8	0	14	0	10	0	0
31-May-25	49	14.5	36	0	8	0	13	0	10	0	0
1-Jun-25	50	0.0	7	0	13	0	0	0	4	0	0
2-Jun-25	51	0.0	0	0	10	0	0	0	0	0	21
3-Jun-25	52	0.0	0	0	10	0	0	0	0	0	3
4-Jun-25	53	0.0	3	8	8	0	8	0	0	0	0
5-Jun-25	54	0.0	92	0	8	0	20	0	33	0	0
6-Jun-25	55	0.0	0	0	8	0	23	0	0	0	0
Total (bbl)		Volume of Built	Dump/Contaminate	Shakers	Evaporation	Centrifuge	Trip	Mud cleaner	Pit Cleaning	Formation	Other
		4,008.7	809	18	197	0	427	0	271	962	84.0

Note: Prepared 1172.4 Cacl2 brine & Completion fluid inhibitor (DMR#48,49,52,53,54) that is consider in next section.

Table 9-5: AZNS-12 Loss Distribution

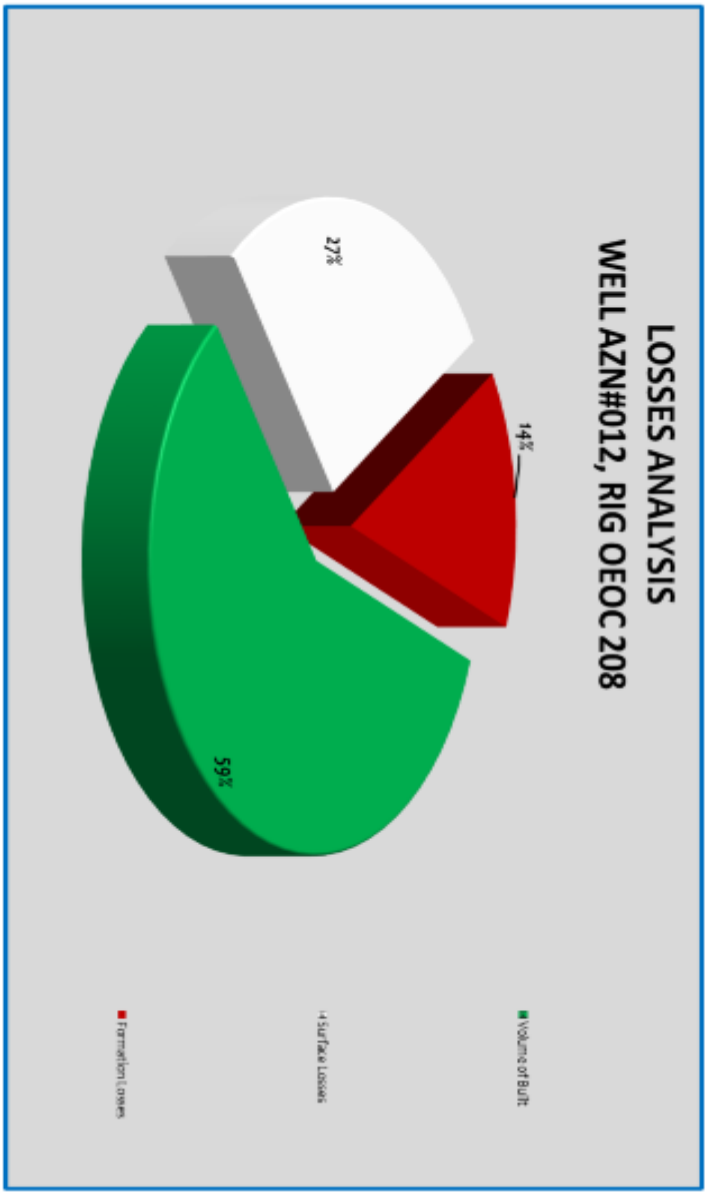


Figure 9-5: AZNS-12 Loss Analysis

9.8 Interval Fluid Properties Recap

Date	DEPTH	Density	VIS	PV	YP	Water Loss	pH	Chloride	Calcium	Total Hardness	Mud Type
13-Apr-25	3945	81	41	15	11	15	9.5	165,000	800	920	Salt/Poly Mud
14-Apr-25	3945	81	40	14	11	12	9.5	170,000	760	880	Salt/Poly Mud
15-Apr-25	3945	81	40	14	11	12	9.4	175,000	760	880	Salt/Poly Mud
16-Apr-25	3945	81	40	14	11	12	9.4	175,000	760	880	Salt/Poly Mud
17-Apr-25	3945	84	40	14	11	12	9.5	175,000	760	880	Salt/Poly Mud
18-Apr-25	3945	84	40	14	11	12	9.5	175,000	760	880	Salt/Poly Mud
19-Apr-25	3945	84	40	14	11	12	9.4	175,000	960	1080	Salt/Poly Mud
20-Apr-25	3945	84	40	14	11	12	9.3	175,000	960	1080	Salt/Poly Mud
21-Apr-25	3945	84	40	14	11	12	9	175,000	960	1080	Salt/Poly Mud
22-Apr-25	3945	84	40	14	11	12	9	175,000	960	1080	Salt/Poly Mud
23-Apr-25	3945	81	40	12	10	12	9	180,000	1600	1840	Salt/Poly Mud
24-Apr-25	3945	81	40	12	10	12	9	180,000	1400	1600	Salt/Poly Mud
25-Apr-25	3945	81	40	12	10	12	9	180,000	1400	1600	Salt/Poly Mud
26-Apr-25	3945	81	40	12	10	12	9	180,000	1400	1600	Salt/Poly Mud
27-Apr-25	3945	81	40	12	10	12	9	180,000	1400	1600	Salt/Poly Mud
28-Apr-25	3945	81	40	12	10	12	9	180,000	1400	1600	Salt/Poly Mud
29-Apr-25	3945	81	40	12	10	12	9	180,000	1400	1600	Salt/Poly Mud
30-Apr-25	3945	84	40	12	10	N.C	9	180,000	1400	1600	Salt/Poly Mud
1-May-25	3945	85	40	11	12	N.C	8.2	180,000	1400	1600	Salt/Poly Mud
2-May-25	3945	85	42	11	12	N.C	9.5	178,000	1400	1600	Salt/Poly Mud
3-May-25	3945	85	45	11	13	18	9.6	178,000	1400	1600	Salt/Poly Mud
4-May-25	3945	85	45	11	13	18	9.6	178,000	1400	1600	Salt/Poly Mud
5-May-25	3945	85	42	12	12	18	9.1	178,000	1400	1600	Salt/Poly Mud
6-May-25	3945	85	42	12	12	16	9.3	178,000	1400	1600	Salt/Poly Mud
7-May-25	3945	85	43	13	12	16	9.2	178,000	1400	1600	Salt/Poly Mud
8-May-25	3945	85	43	13	12	16	9.3	178,000	1400	1600	Salt/Poly Mud
9-May-25	3945	85	43	13	12	15	9.3	178,000	1480	1640	Salt/Poly Mud
10-May-25	3945	85	48	16	15	12	9.3	175,000	1480	1640	Salt/Poly Mud
11-May-25	3945	85	47	15	13	12	9.4	176,000	1480	1640	Salt/Poly Mud
12-May-25	3945	85	46	14	13	12	9.5	176,000	1480	1640	Salt/Poly Mud
13-May-25	3945	85	45	13	12	12	9.3	176,000	1480	1640	Salt/Poly Mud
14-May-25	3945	85	45	13	12	12	9.5	176,000	1480	1640	Salt/Poly Mud
15-May-25	3945	85	45	13	12	12	9.5	176,000	1480	1640	Salt/Poly Mud
16-May-25	3945	85	45	13	12	18	9.2	176,000	1640	1800	Salt/Poly Mud
17-May-25	3945	85	45	13	12	18	9.1	176,000	1640	1800	Salt/Poly Mud

18-May-25	3945	84	43	11	10	20	9	170,000	1680	1840	Salt/Poly Mud
19-May-25	3945	84	43	13	12	18	9.2	171,000	1680	1840	Salt/Poly Mud
20-May-25	3945	84	43	13	12	18	9.1	171,000	1680	1840	Salt/Poly Mud
21-May-25	3945	84	43	13	12	18	9.3	170,000	1680	1840	Salt/Poly Mud
22-May-25	3945	84	43	13	11	18	9.4	170,000	1680	1840	Salt/Poly Mud
23-May-25	3945	84	43	13	11	15	9.3	170,000	1680	1840	Salt/Poly Mud
24-May-25	3945	84	44	13	12	15	9.2	168,000	1680	1880	Salt/Poly Mud
25-May-25	3945	84	44	13	12	15	9.2	168,000	1680	1880	Salt/Poly Mud
26-May-25	3945	84	44	13	12	15	9.2	168,000	1680	1880	Salt/Poly Mud
27-May-25	3945	84	44	13	12	15	9.2	168,000	1680	1880	Salt/Poly Mud
28-May-25	3945	84	44	13	12	15	9.2	168,000	1680	1880	Salt/Poly Mud
29-May-25	3945	84	44	13	12	15	9.2	168,000	1680	1880	Salt/Poly Mud
30-May-25	3945	84	44	13	12	15	9.2	168,000	1680	1880	Salt/Poly Mud
31-May-25	3945	84	44	13	12	15	9.2	168,000	1680	1880	Salt/Poly Mud
1-Jun-25	3945	84	44	13	12	15	9.2	168,000	1680	1880	Salt/Poly Mud
2-Jun-25	3945	84	44	13	12	15	9.2	168,000	1680	1880	Salt/Poly Mud
3-Jun-25	3945	84	44	13	12	15	9.2	168,000	1680	1880	Salt/Poly Mud
4-Jun-25	3945	84	44	13	12	15	9.2	168,000	1680	1880	Salt/Poly Mud
5-Jun-25	3945	84	44	13	12	15	9.2	168,000	1680	1880	Salt/Poly Mud
Drilling Start											
Drilling End											

Table 9-6: AZNS-12 Fluid Properties Recap

9.9 Solid Control Disscusion

Rig OEOC 201 has 3 shale shakers were dressed with:

Shaker#1: 120 – 140 Mesh Screen

Shaker#2: 120 – 140 Mesh Screen

Shaker#3: 120 – 140 Mesh Screen

WELL AZN#012, RIG OEOC 208	
Solid Control Equipment Working Hr.s	
Shaker # 01	93
Shaker # 02	153
Shaker # 03	95

Table 9-7: AZNS-12 Solid Control Desscusion

9.10 Inhibited CaCl2 Brine

This fluid is recommended to make from fresh water or is solutions made with water and the addition of one or more electrolytes. These fluids do not contain either suspended particles or viscosifiers, which mean neither filtration control or viscosity control, are provided.

Products	Units Used	Unit wt lbs	Total wt		Effective Concentration	
Lime	87	55	4,785	lbs	3.9	ppb
Corrosion Inhibitor	8	55	440	gals	0.4	gpb
H_2S Scavenger	4	55	220	gals	0.2	gpb
O_2 Scavenger	4	55	220	gals	0.2	gpb
Cacl2	122	2,200	268,400	lbs	216.7	ppb

Corrosion Inhibitor 0.4 gpb	= 1%vol
H_2S Scavenger 0.2 gpb	= 0.5%vol
O_2 Scavenger 0.2 gpb	= 0.5%vol

Received	0 bbl
Total Volume Built (Completion Fluid)	1,238.7 bbl

Table 9-8: AZNS-12 Material Concentration

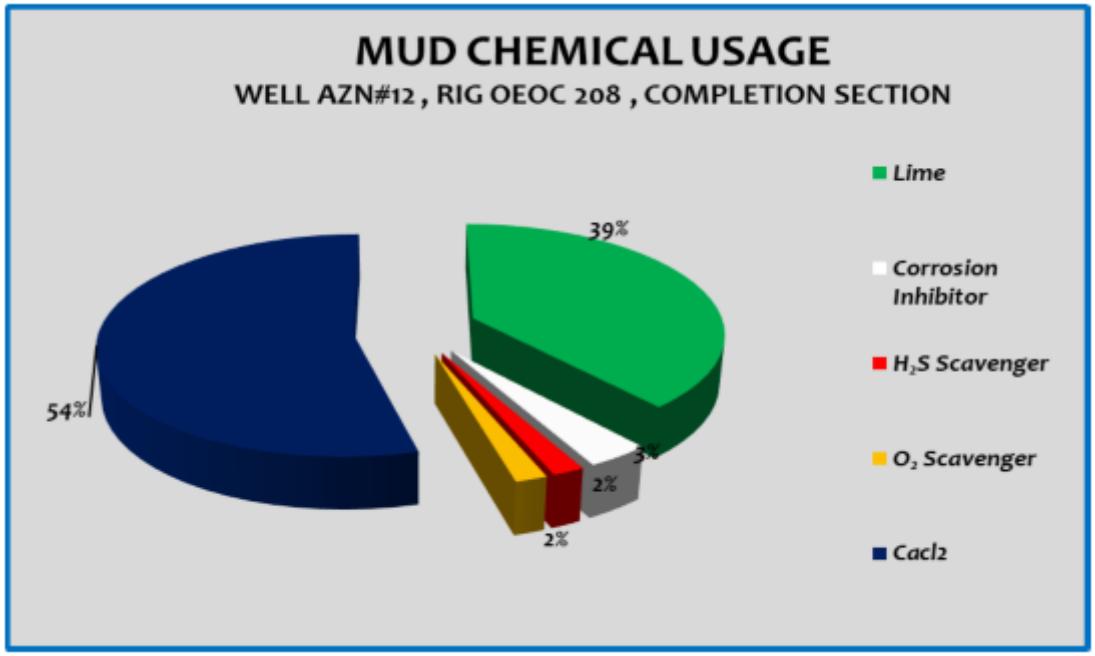


Figure 9-6: AZNS-12 Completion Section Mud Chemical Usage

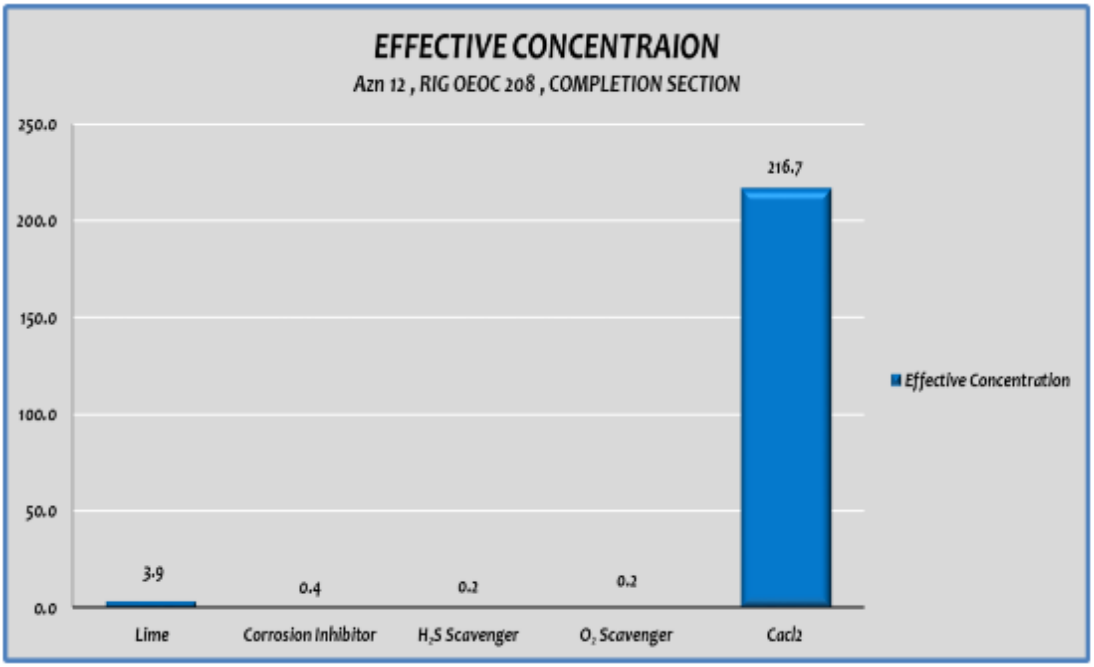


Figure 9-7: AZNS-12 Completion Section Inhibited $CaCl_2$ Brine

10. Waste Management Service

10.1 Waste Management System - Water treatment process.

Dewatering system was run totally for 90 hrs. Processing 920 m^3 fluid by using 0 kg Poly Aluminum Chloride (PAC), 0 kg Poly Electrolyte (Polymer) 0 kg Lime & 0 kg Soda, 0 kg Caustic during the interval.

10.2 Operation's Recap

Date	Treated water (M³)	Cum. Treated Water (M3)	PAC (Kg)	POLYMER (Kg)	LIME (Kg)	CAUSTIC (Kg)	SODA ASH (Kg)
17-Apr-2025	0	0	0	0	0	0	0
18-Apr-2025	0	0	0	0	0	0	0
19-Apr-2025	0	0	0	0	0	0	0
20-Apr-2025	0	0	0	0	0	0	0
21-Apr-2025	0	0	0	0	0	0	0
22-Apr-2025	70	70	0	0	0	0	0
23-Apr-2025	0	70	0	0	0	0	0
24-Apr-2025	0	70	0	0	0	0	0
25-Apr-2025	0	70	0	0	0	0	0
26-Apr-2025	0	70	0	0	0	0	0
27-Apr-2025	0	70	0	0	0	0	0
28-Apr-2025	0	70	0	0	0	0	0
29-Apr-2025	40	110	0	0	0	0	0
30-Apr-2025	0	110	0	0	0	0	0
01-May-2025	0	110	0	0	0	0	0
02-May-2025	0	110	0	0	0	0	0
03-May-2025	50	160	0	0	0	0	0
04-May-2025	0	160	0	0	0	0	0
05-May-2025	0	160	0	0	0	0	0
06-May-2025	0	160	0	0	0	0	0
07-May-2025	0	160	0	0	0	0	0
08-May-2025	0	160	0	0	0	0	0
09-May-2025	20	180	0	0	0	0	0
10-May-2025	0	180	0	0	0	0	0

11-May-2025	40	220	0	0	0	0	0
12-May-2025	40	260	0	0	0	0	0
13-May-2025	30	290	0	0	0	0	0
14-May-2025	20	310	0	0	0	0	0
15-May-2025	30	340	0	0	0	0	0
16-May-2025	40	380	0	0	0	0	0
17-May-2025	30	410	0	0	0	0	0
18-May-2025	40	450	0	0	0	0	0
19-May-2025	50	500	0	0	0	0	0
20-May-2025	0	500	0	0	0	0	0
21-May-2025	30	530	0	0	0	0	0
22-May-2025	0	530	0	0	0	0	0
23-May-2025	40	570	0	0	0	0	0
24-May-2025	30	600	0	0	0	0	0
25-May-2025	0	6000	0	0	0	0	0
26-May-2025	0	600	0	0	0	0	0
27-May-2025	40	640	0	0	0	0	0
28-May-2025	0	640	0	0	0	0	0
29-May-2025	40	680	0	0	0	0	0
30-May-2025	0	680	0	0	0	0	0
31-May-2025	40	720	0	0	0	0	0
01-Jun-2025	0	720	0	0	0	0	0
02-Jun-2025	0	720	0	0	0	0	0
03-Jun-2025	0	720	0	0	0	0	0
04-Jun-2025	70	790	0	0	0	0	0
05-Jun-2025	0	790	0	0	0	0	0
06-Jun-2025	0	790	0	0	0	0	0
07-Jun-2025	0	790	0	0	0	0	0
08-Jun-2025	0	790	0	0	0	0	0
09-Jun-2025	0	790	0	0	0	0	0
10-Jun-2025	0	790	0	0	0	0	0
11-Jun-2025	0	790	0	0	0	0	0
12-Jun-2025	30	820	0	0	0	0	0
13-Jun-2025	20	840	0	0	0	0	0

14-Jun-2025	0	840	0	0	0	0	0
15-Jun-2025	0	840	0	0	0	0	0
16-Jun-2025	0	840	0	0	0	0	0
17-Jun-2025	0	840	0	0	0	0	0
18-Jun-2025	20	860	0	0	0	0	0
19-Jun-2025	30	890	0	0	0	0	0
20-Jun-2025	0	890	0	0	0	0	0
21-Jun-2025	0	890	0	0	0	0	0
22-Jun-2025	30	920	0	0	0	0	0
23-Jun-2025	0	920	0	0	0	0	0
24-Jun-2025	0	920	0	0	0	0	0

Table 10-1: AZNS-12 chemical consumption and water treatment volumes by date for Completion section

Dewatering/Water Treatment System	
PROCESSED VOLUME (m3)	920
D-WATERING RUNNING Hrs.	90
COAGULANT (PAC) (kg)	0
FLOCCULANT (POLYMER) (kg)	0
LIME (kg)	0
SODA ASH (kg)	0
CAUSTIC	0

Figure 10-1: Dewatering/Water Treatment System

REP	Date		Water Properties				
	Unit		pH 7 - 9	Total Hardness Mg/Lit	Calcium Mg/Lit	TSS Mg/lit	Turbidity mg/Lit
1	17-Apr-25	Received	7	600	400	Over range	Over range
		Send					
2	18-Apr-25	Received	7	600	400	Over range	Over range
		Send					
3	19-Apr-25	Received	7	600	400	Over range	Over range

		Send					
4	20-Apr-25	Received	7	600	400	Over range	Over range
		Send					
5	21-Apr-25	Received	7	600	400	Over range	Over range
		Send					
6	22-Apr-25	Received	7	600	400	Over range	Over range
		Send					
7	23-Apr-25	Received	7	600	400	Over range	Over range
		Send					
8	24-Apr-25	Received	7	600	400	Over range	Over range
		Send					
9	25-Apr-25	Received	7	600	400	Over range	Over range
		Send					
10	26-Apr-25	Received	7	600	400	Over range	Over range
		Send					
11	27-Apr-25	Received	7	600	400	Over range	Over range
		Send					
12	28-Apr-25	Received	7	600	400	Over range	Over range
		Send					
13	29-Apr-25	Received	7	600	400	Over range	Over range
		Send					
14	30-Apr-25	Received	7	600	400	Over range	Over range
		Send					
15	31-Apr-25	Received	7	600	400	Over range	Over range
		Send					
16	01-May-25	Received	7	600	400	Over range	Over range
		Send					
17	02-May-25	Received	7	600	400	Over range	Over range
		Send					
18	03-May-25	Received	7	600	400	Over range	Over range
		Send					
19	04-May-25	Received	7	600	400	Over range	Over range
		Send					
20	05-May-25	Received	7	600	400	Over range	Over range
		Send					
21	06-May-25	Received	7	600	400	Over range	Over range
		Send					
21	07-May-25	Received	7	600	400	Over range	Over range
		Send					
22	08-May-25	Received	7	600	400	Over range	Over range
		Send					

23	09-May-25	Received	7	600	400	Over range	Over range
		Send	7	600	400	80	50
24	10-May-25	Received	8.5	680	440	Over range	Over range
		Send					
25	11-May-25	Received	8.5	680	440	Over range	Over range
		Send	8.5	680	440	80	50
26	12-May-25	Received	8.5	680	440	Over range	Over range
		Send	8.5	680	440	80	50
27	13-May-25	Received	8.5	680	440	Over range	Over range
		Send	8.5	680	440	80	50
28	14-May-25	Received	8.5	680	440	Over range	Over range
		Send	8.5	680	440	80	50
29	15-May-25	Received	8.5	680	440	Over range	Over range
		Send	8.5	680	440	80	50
30	16-May-25	Received	7.5	680	440	Over range	Over range
		Send	7.5	680	440	80	50
31	17-May-25	Received	7	680	440	Over range	Over range
		Send	7	680	440	80	50
32	18-May-25	Received	7	680	440	Over range	Over range
		Send	7	680	440	80	50
33	19-May-25	Received	7	680	440	Over range	Over range
		Send	7	680	440	80	50
34	20-May-25	Received	7	680	440	Over range	Over range
35	21-May-25	Received	7	680	440	Over range	Over range
		Send	7	680	440	80	50
36	22-May-25	Received	7	680	440	Over range	Over range
		Send	7	680	440	80	50
37	23-May-25	Received	7	680	440	Over range	Over range
		Send	7.3	680	440	80	50
38	24-May-25	Received	7	680	440	Over range	Over range
		Send	7.3	680	440	80	50
39	25-May-25	Received	7	680	440	Over range	Over range
		Send	7	680	440	80	50
40	26-May-25	Received	7	680	440	Over range	Over range
		Send	7	680	440	80	50
41	27-May-25	Received	7	680	440	Over range	Over range
		Send	7	680	440	80	50
42	28-May-25	Received	7	680	440	Over range	Over range
		Send	7	680	440	80	50
43	29-May-25	Received	7	680	440	Over range	Over range

		Send	7	680	440	80	50
44	30-May-25	Received	7.8	680	440	Over range	Over range
		Send	7.8	680	440	80	50
45	31-May-25	Received	7.8	680	440	Over range	Over range
		Send	7.8	680	440	80	50
46	01-Jun-25	Received	7.8	680	440	Over range	Over range
		Send	7.8	680	440	80	50
47	02-Jun-25	Received	7.8	680	440	Over range	Over range
		Send	7.8	680	440	80	50
48	03-Jun-25	Received	7.8	680	440	Over range	Over range
		Send	7.8	680	440	80	50
49	04-Jun-25	Received	7.4	640	240	Over range	Over range
		Send	7.4	640	240	65	38
50	05-Jun-25	Received	7.4	640	240	Over range	Over range
		Send	7.4	640	240	65	38
51	06-Jun-25	Received	7.4	640	240	Over range	Over range
		Send	7.4	640	240	65	38
52	07-Jun-25	Received	7.4	640	240	Over range	Over range
		Send	7.4	640	240	65	38
53	08-Jun-25	Received	7.4	640	240	Over range	Over range
		Send	7.4	640	240	65	38
54	09-Jun-25	Received	7.4	640	240	Over range	Over range
		Send	7.4	640	240	65	38
55	10-Jun-25	Received	7.4	640	240	Over range	Over range
		Send	7.4	640	240	65	38
56	11-Jun-25	Received	7.4	640	240	Over range	Over range
		Send	7.4	640	240	65	38
57	12-Jun-25	Received	7.4	640	240	Over range	Over range
		Send	7.4	640	240	65	38
58	13-Jun-25	Received	7.4	640	240	Over range	Over range
		Send	7.4	640	240	65	38
59	14-Jun-25	Received	7.4	640	240	Over range	Over range
		Send	7.4	640	240	65	38
60	15-Jun-25	Received	7.4	640	240	Over range	Over range
		Send	7.4	640	240	65	38
61	16-Jun-25	Received	7.4	640	240	Over range	Over range
		Send	7.4	640	240	65	38
62	17-Jun-25	Received	7.4	640	240	Over range	Over range
		Send					

63	18-Jun-25	Received	7.4	640	240	Over range	Over range
		Send	7.4	640	240	65	38
64	19-Jun-25	Received	7.4	640	240	Over range	Over range
		Send	7.4	640	240	65	38
65	20-Jun-25	Received	7.4	640	240	Over range	Over range
		Send					
66	21-Jun-25	Received	7.4	640	240	Over range	Over range
		Send					
67	22-Jun-25	Received	7.4	640	240	Over range	Over range
		Send					
68	23-Jun-25	Received	7.4	640	240	Over range	Over range
		Send					
69	24-Jun-25	Received	7.4	640	240	Over range	Over range
		Send					

Table 10-2: AZNS-12 Water Analysi

11. List of Contractors

Item	Service Item	Contractor
1	Drilling Rig, Mobilization and Demobilization the Rig, Rig Move Between Well Pads	OEOC
2	Drilling Fluids and Completion Fluids	VIRA
3	Waste Management	Behsan
4	Electrical Logging and Perforation	Sealand
5	Mud Logging	Pars Geo Data
6	Directional Drilling (MWD)	-
7	H2S Monitoring and Control	BONYAN IMEN
8	Casing and Tubing Running	OEOC
9	Cementing	Dana
10	Dry Test, DST and RTTS	OEOC
11	Slick Line	OEOC
12	Stimulation (Coiled Tubing and Acidizing and Nitrogen Lifting)	OEOC
13	Surface Well Testing	OEOC
14	Liner Hanger	-
15	Well Head	OEOC

Table 11-1: AZNS-12 Contractors Involved

12. Appendix

12.1 DDR Summary

Item	Date	Remark
1	13-Apr-25	Fuction test rig equipment, Check section C, Completion String & Ann Press. Press test TMV.
2	14-Apr-25	Install sweep bend, Try to open 3SV, Align TDS Rail, Stop operation Due to Bad Weather, R/B 2 Stds 5" DP.
3	15-Apr-25	Stop operation Due to Bad Weather, R/B 9 Stds 5" DP, Open 3SV, check connection between string & Ann, Run Gauge Ring to 3SV Depth, Try to retrieve 3SV, Run 2.5" Gauge Ring to 2798m, R/U CT Riser & BOP, Wait on Rec. Crain to R/U CTU.
4	16-Apr-25	Wait on R/U CTU. OEOC Refuse to R/U CT Injector head. So 24 Hrs NPT Applied for OEOC Rig & Services.
5	17-Apr-25	Wait on R/U CTU. OEOC Refuses to R/U CT Injector head, R/U CT, P/T, RIH to 2798m, Displace the string.
6	18-Apr-25	Displace string, Flow check, POOH CT to surface, R/D CTU Equip, Install TWCV & P/T, N/D XMT, N/U BOP Stack.
7	19-Apr-25	N/U 13-5/8" BOP Stack, Perform BOP test as NIOC Policy, Wait on daylight to punch the string.
8	20-Apr-25	Wait on daylight, Retrieve TWCV, Screw 7" L/J on TBG HGR, M/U XOS, R/U W/L Equip, RIH w/ Punch Assy to 2794m, Punch string, POOH to 100m, Wait on daylight, Slow Circ. Thru string.
9	21-Apr-25	Wait on daylight While Circ. Mud to uniform MW in/out, POOH to surface, L/D Sealand Equip. , Work on pull out Tubing Hanger Several times "No Succ", Wait on OEOC.
10	22-Apr-25	Cont. Work on stuck Tubing Hanger in THS & Try to open the traveling JTs Several times, Pull out w/ Max. 550klbs Finally was "Succ.", String Got free, Circ. Thru strg. Till BTMs up & uniform MW in/out.
11	23-Apr-25	Circ. Mud Thru string Till uniform MW in/out, POOH Completion string Totally 97Jts 7" Tubing 29#, L-80 N.vam.
12	24-Apr-25	Cont. POOH Completion string To Surface.
13	25-Apr-25	R/D CSG Running Equip., P/U & RIH W/ 18JTs 4-3/4" DCs + 60JTs 3-1/2" DPs jt by jt To 730m, POOH to surface, RIH W/ 3-1/2" Spear to 200m while Circ. Mud C.W.H w/ 2-4 BPHL.
14	26-Apr-25	RIH W/ 3-1/2" Spear & Fishing BHA F/330 to 3285m (7"L.lap), Circ. BTM's up, Cont. RIH to 3307m, Confirmed TOF Work on Fishing and Try to catch same, POOH as chain out F/3307 to 2550m while Circ. Mud C.W.H w/ 0-1 BPHL.
15	27-Apr-25	Cont. POOH F/2550 to Surface & Recoverd about 100-150m Slick line, RIH W/ 2" * 4" Taper tap & Fishing BHA#02 To 3290m while Circ. Mud C.W.H w/ 0-1 BPHL.

Item	Date	Remark
16	28-Apr-25	Cont. RIH W/ 2" * 4" Taper tap & Fishing BHA#02 F/ 3290 To 3305m Engage w/ Fish & Tap inside Fish, POOH W/ 2" * 4" Taper tap & Fishing BHA#02 as chain out F/3307 to Surface, Recoverd Fish Completely While Circ. C.W.H w/ NL-NG.
17	29-Apr-25	change Top rams Perform Body Press. test same "OK", P/U & M/U 6" M.M J.Mill & RIH w/ Clean out BHA#03 to 3337m (7" PKR Depth) Circ. BTMs Up, Comm. Milling f/3337 to 3337.9m, OBS. Press Drop Suddenly and Noticed "No return", after Pump 43BBLs Mud "Got Return" While Monitor Mud Pit Level " Static". Cont. Milling 3338m (10cm) OBS. WOB Drop, Cont. RIH as R/D f/ 3338 to 3376m W/ NL-NG.
18	30-Apr-25	Cont. RIH to 3454m, OBS. Conn. Gas & Pit Gain (4 BPHG).Closed the well, Prepared 82pcf Mud, Start Circ. Mud thru C/M by 82pcf Mud and apply Back Press., Got 84pcf mud @ Return, Open the well and Check Pit Levels as Dynamic & Static "NL-NG".
19	1-May-25	Cont. RIH W/ 6" M.M J.Mill F/ 3454 to 3520m, String Took WT, Try To Wash & Push same three Times "No movment", Circ. BTM's Up, POOH to Surface, RIH w/ 2" * 4" Taper tap & Fishing BHA#04 To 100m Stopped Operation Due to Bad Weather, Cont. RIH To 250 while Circ. Mud C.W.H w/ NL-NG.
20	2-May-25	Cont. RIH W/ 2" * 4" Taper tap & Fishing BHA#04 F/ 3290 To 3516m Engage w/ Fish, Chase same to 3641m, Tap inside Fish, POOH as chain out F/3641 to 2500 While Circ. C.W.H w/ 0-1 BPHL.
21	3-May-25	POOH W/ 2" * 4" Taper tap to Surface OBS. Engage Marked with 2" to 3-7/8" Out side Diameter, RIH W/ another 2" * 4" Taper tap to 2050m while Circ. Mud C.W.H w/ 0-1BPHL.
22	4-May-25	Cont. RIH W/ 2"-4" Taper tap to 3474m, String Took WT Max. 15klbs, Try to Engage with Fish "No succ.", Chase the Fish to 3637m String Took WT, Work on Fish "Succ." POOH with Normal drag to 2700m, Stopped Operation Due to Bad Weather situation While Circ. C.W.H w/ 0-1 BPHL.
23	5-May-25	Cont. Wait on bad weather, POOH w/ 2" x 4" Taper tap f/ 2700m to surface, Obs. Packer & Tail retrieved successfully, RIH w/ cable spear BHA to 900m.
24	6-May-25	Cont. RIH w/ 3-1/2" Cable spear f/ 900 to 3725m, while slip & Cut Drlg line @ 2980m, POOH to 2500m.
25	7-May-25	Cont. POOH w/ Cable spear f/ 2500m to surface, RIH w/ 3-1/2" Cable Spear to 3200m, while stop operation due to high wind speed.
26	8-May-25	Cont. RIH w/ 3-1/2" Cable Spear to 3770m, while perform fishing, POOH to surface, RIH w/ Wire grab to 3200m.

Item	Date	Remark
27	9-May-25	Cont. RIH w/ 5-7/16" Wire grab f/ 3200 to 3778m, POOH to surface, RIH w/ 6" J.Mill to 1300m.
28	10-May-25	Cont. RIH w/ 6" J.Mill to 3778m, CBU, Flow Check, POOH to 850m, Install G Board.
29	11-May-25	Cont. POOH w/ 6" Mill f/ 850m to surface, Make & R/B 5 Stds 3-1/8" DC, 3 Stds 2-7/8" DP, RIH w/ 3-1/2" Mill & Clean out BHA to 3770m.
30	12-May-25	Cont. RIH w/ 3-1/2" J.Mill to 3777.65m. Commence milling & Clean out f/ 3777.65 to 3778m, POOH to 200m.
31	13-May-25	Cont. POOH w/ 3-1/2" Mill f/ 200m to surface, RIH w/ 2-7/8" Cable Spear to 3778m, Catch fish, POOH to 1400m.
32	14-May-25	Cont. POOH w/ 2-7/8" Cable spear to surface, RIH w/ 2-7/8" Cable Spear to 3783m, Catch fish, POOH to 2900m.
33	15-May-25	Cont. POOH w/ 2-7/8" Cable spear to surface & Recover 39m wire, RIH w/ 2-7/8" New Cable Spear to 2750m, while slip & cut @ 1100m & Work on TDS.
34	16-May-25	Cont. RIH w/ 2-7/8" Cable Spear to 3807 & Catch fish, POOH to 550m.
35	17-May-25	Cont. POOH w/ 2-7/8" Cable spear to surface. RIH w/ 3-1/2" Mill & Clean out BHA to 3784m, Meanwhile work on DWS & Stop operation due to wind speed.
36	18-May-25	Milling & push down fish to 3898.5m.
37	19-May-25	Cont. Milling to 3900m, POOH W/ 3-1/2" M.M.J.Mill f/ 3900 to 150m while C.C.W.H w/ 0-2 BPHL.
38	20-May-25	POOH W/ 3-1/2" M.M.J.Mill To Surface, OBS. 3-1/2" M.M.J.Mill & 3-1/4" Bit sub left in Hole, RIH w/ 5-7/8" MT.Bit to 560m as kill strg, POOH to Surface, L/D the Bit, RIH w/ 4" New M.M.J.Mill to 2100m w/ 1 BPHL.
39	21-May-25	Cont. RIH w/ 4" New M.M.J.Mill to 3779m, Push Down & Milling to 3888.7m w/Low Parameters "No Progress"POOH w/ 4" M.M.J.Mill to 1000m w/ 1 BPHL.
40	22-May-25	Cont. POOH w/ 4" M.M.J.Mill to Surface, L/D 4" M.M.J.Mill (5% Used), RIH w/ 3-15/16" Used M.M.J.Mill to 3870m w/ 0-1 BPHL.
41	23-May-25	Cont. RIH w/ 3-15/16" Used M.M.J.Mill to 3888.7m, Milling w/ Low Parameters to 3888.8m (10cm), Stop Milling Operation Due to "No Progress", POOH to Surface, RIH w/ 3-1/2" Used M.M J.Mill to 200m w/ 0-1 BPHL.
42	24-May-25	Cont. RIH w/ 3-1/2" Used M.M J.Mill to 3899m, Try to Resume Milling "No Progress", (Confirmed TOF), POOH w/ 3-1/2" Used M.M.J.Mill f/ 3899m to 600m While C.C.W.H w/ 0-1 BPHL.
43	25-May-25	Cont. POOH w/ 3-1/2" Used M.M.J.Mill to Surface, RIH w/ 4-1/16" Overshot to 3730m w/ 0-1 BPHL..

Item	Date	Remark
44	26-May-25	Cont. RIH w/ 4-1/16" Overshot & Fishing BHA f/ 3730 to 3899m (TOF) Work on Fish as Procedure, POOH f/ 3899 to 600m while Circ. C.W.H w/ 0-1 BPHL.
45	27-May-25	Cont. POOH w/ 4-1/16" Overshot & Fishing BHA to Surface, RIH w/ 5-7/8" C.Cut to 3270m (15M Above 7" L.Lap), Perform Magneset Balance Plug Job as Program, POOH to 500m While Circ. C.W.H w/ 0-1 BPHL.
46	28-May-25	POOH w/ 5-7/8" C.Cut to Surface, Set RTTS PKR @ 40m, N/D 13-5/8"-10K BOP Stack, Change T.H.S with new one SET 13-5/8"-10K BOP Stack In Progerss Till M.N.
47	29-May-25	Cont. N/U 13-5/8"-10K BOP Stack, Perform P/T as NIOC Policy, Unset 9-5/8" RTTS & POOH to surface, RIH w/ 8-3/8" TCI Bit & D/O BHA to 1400m.
48	30-May-25	Cont. RIH w/ 8-3/8" TCI Bit to 3180m, D/O Soft to Med Magneset plug to 3270m, Cont. RIH to 3285m, CBU, POOH to 800m, meanwhile stop operation @ 2950m due to bad weather.
49	31-May-25	Cont. POOH w/ 8-3/8" TCI Bit & D/O BHA f/ 800m to surface,RIH w/ 5-7/8" MT Bit & 7" X 9-5/8" tandem scrapers to 3779, Circ. Out Hi-Vis Pill, POOH w/ 5-7/8" MT Bit & 7" X 9-5/8" tandem scrapers to 1600m.
50	1-Jun-25	POOH w/ 5-7/8" MT Bit & 7" X 9-5/8" Tandem scrapers to surface, Run SBT Logging to 3760m, Obs. Failure, Run back up SBT for 7" LNR, Run CBIL tools to 3700m.
51	2-Jun-25	Run CBIL Logging tools for 7" LNR & 9-5/8" CSG, Set 11" W.Bushing, While wait on client (PPL/PEDEC) to make decision, RIH w/ 8-3/8" TCI Bit to 300m.
52	3-Jun-25	Cont. wait on client (PPL/PEDEC) to make decision, POOH w/ 8-3/8" TCI Bit to surface, RIH w/ 7-5/16" Polish Mill to 900m.
53	4-Jun-25	Cont. RIH w/ 7-5/16" Polish mill to 7" L.Lap, Polish inside 7" TBS, POOH w/ 7-5/16" Polish mill to 100m, while stop operation @ 3170m.
54	5-Jun-25	Cont. POOH w/ 7-5/16" Polish Mill to surface, Obs. Mark of LG on same, RIH w/ SN Packer Assy to 3289m, Sting in & Set PKR, POOH w/ SN PKR Running tools to 950m, meanwhile slip & cut Drlg line @ 2300m.
55	6-Jun-25	Cont. POOH w/ SN Packer running tools f/ 950m to surface, L/D 30 Jts 3-1/2" DP & 24 Jts 4-3/4" DC (Jt by /Jt), RIH w/ OEDPs to 3898m.
56	7-Jun-25	Spot 60 bbl Non-Solid brine in 5" LNR & 7" LNR. POOH to 3515m, Displace the well w/ 84pcf Non-Solid Brine. POOH & L/D 162 Jts 5" DP.
57	8-Jun-25	Wait on client to make decision.
58	9-Jun-25	Wait on client to make decision. Decision has been made by client (PPL/PEDEC) to run completion & complete the well. Resume

Item	Date	Remark
		POOH w/ OEDPs f/ 2430 to 1300m, Stop operation due to high wind speed @ 1670m.
59	10-Jun-25	Cont. POOH w/ OEDPs f/ 1300m to surface, L/D All tubular, meanwhile stop operation @ 2 Stage due to high wind speed, R/U Completion running equip.
60	11-Jun-25	Run 5K 3-1/2" X 4-1/2" Completion as per program to 1330m, While run 2.8" Gauge Ring @ 25 & 175m. Meanwhile P/T @ 175 & 1115m; OK.
61	12-Jun-25	Cont. Run 3-1/2" x 4-1/2" Completion string to 3280m, Test completion strg. @ 2200 & 3280m w/5000psi, "ok".
62	13-Jun-25	Cont. Run 3-1/2" x 4-1/2" Completion string to 3346m, Work on Landing Tubing Hanger inside Tubing Head Spool.
63	14-Jun-25	Cont.Work on Tie Down Screw to Check Landing Tubing Hanger inside Tubing Head Spool While change 5K TR3SV with 7.5K TR3SV,
64	15-Jun-25	Landing Tubing Hanger inside Tubing Head Spool "ok" R/U slick line equipment.
65	16-Jun-25	RIH W/ 3.437" Protection sleeve try to set @ TR3SV "No succ." POOH and Change 5jts 4-1/2" TBG Below TBG HGR, Run Back and R/U Slick Line.
66	17-Jun-25	RIH & Set 3.437" Protection sleeve in TR3SV, try to Retrieve 2.75" WFB Check valve from SSD "No Succ." Work on Retrieve 2.75" WFB Check valve from SSD
67	18-Jun-25	Cont. Work on Retrieve 2.75" WFB Check valve from SSD
68	19-Jun-25	Cont. Work on Retrieve 2.75" WFB Check valve from SSD, R/U OEOC CT
69	20-Jun-25	Cont. Work on Retrieve 2.75" WFB Check valve from SSD, RIH w/ 1/2"C.TBG to 3316m, Circ. BTM's Up till Clean around Check valve, RIH w/ 3" JDC Pulling to 61m, Took WT (TR3SV Depth), try to Pass this point
70	21-Jun-25	Work on Retrieve 2.75" WFB Check valve from SSD "Successfully" Set Plug & Prong in No-Go L/N, R/D Slick line equipment.
71	22-Jun-25	Set PKR as per procedure, Perform pull test w/15 klbs overpull; "OK". Close Hy-drill and Press test Tie-Downs to 1000 psi, "OK". Line up surface test line to string. Perform Press test completion string to 4500 psi for 15 min as final completion string test; "OK", L/U to 9-5/8" Ann. try to Perform Press test several times "Not OK", OBS Leakage From Surface Line.
72	23-Jun-25	N/D BOP Stack, Install XMT.

Table 12-1: AZNS-12 Daily Drilling Report Summary