END OF WELL REPORT

AZADEGAN OIL FIELD

END OF WELL REPORT

AZNS – 127 ST #2 (PAD #54), TYPE: IIF

Drilling Department

DECEBER 2024

MSA/OEOC			
	Position	**Name**	**Date & Signature**
Prepared by	Drilling Engineering Department	Asgar Eyvazi Mohammad Hossein Haji Taleb	
Approved by	Project Head of Drilling Engineering		
	Project Head of Drilling Operation		
	Project Manager		
PPL			
	Position	**Name**	**Date & Signature**
Check & Approved by	Drilling Operation Manager		
	Subsurface Engineering Manager		
	Head of Drilling Enginering		
	Subsurface Project Manager		

TABLE OF CONTENTS

1. General Information *10*
1.1 Field Introduction 10
1.2 AZNS – 127 Well Location Map 11
2. Well History *12*
2.1 Well Informaion 12
2.2 AZNS – 127 Well History 12
2.3 AZNS – 127 ROP Chart 56
2.4 Bit Record Table 57
2.5 Bit Parameters Plot 58
3. Time Analysis Report *59*
3.1 Time vs. Depth Chart 59
3.2 Total Time Break-Down of Operation 60
WorkOver Section 60
Side Track Section 61
Completion Section 61
3.3 NPT Break-Down 62
4. Geological & Logging Reports *64*
4.1 Logging and Testing Reports 64
5. Bottom Hole Assembly Record *65*
6. Casing Information *90*
.7 Cement Job Report *91*
7.1 7” Liner Cementing Operation Information 91
7.2 Engineering Data 95
7.3 Execution of Operation 96
7.4 Operation Ticket ..... Error! Bookmark not defined.
7.5 Job Log & Summary ..... Error! Bookmark not defined.
7.6 Job Graph ..... Error! Bookmark not defined.
7.7 Operation Instructions 97
Pre – Job Preparation 97
Pre – Job Preparation 97
7.8 Pumping Schedule 97
7.9 Amount of Material & Used in Operation 98
7.10 4 – 1/2” Liner Cementing Operation Information 99
7.11 Engineering Data 103
7.12 Execution of Operation 104
7.13 Operation Ticket ..... Error! Bookmark not defined.
7.14 Job Log & Summary ..... Error! Bookmark not defined.
7.15 Job Graph 105
7.16 Operation Instructions 106

Pre – Job Preparation 106
Pre – Job Preparation 106
7.17 Pumping Schedule 108
7.18 Amount of Material & Used in Operation 108
8. Completion Report 117
8.1 Completion Tubing Information 117
8.2 Completion Tools Specification Checklist 117
8.3 Assembling Test Report 121
8.4 Completion Operation Checklist 132
8.5 Completion Sketch & Tally 137
8.6 Completion String Pressure Test 148
9. Wellhead Report 151
9.1 Final Well Status 151
9.2 Wellhead & X-mass tree Specification 152
9.3 Wellhead Schematic 154
9.4 X-mass Tree Specification (Section D) 156
9.5 X-mass Tree Pressure Test Report (Section D – befor install) 157
9.6 X-mass Tree Pressure Test Report (Section D – after install) 157
9.7 Wellhead Related Test Reports 159
10. Drilling Fluid Information 163
10.1 Summary 163
10.2 Interval Remark 164
WorkOver Section 164
8 – 1/2" Hole Section 164
6 – 1/8" Hole Section 164
10.3 Drilling Fluid type 165
10.4 Material Consumption Analysis 165
10.5 Volume Analysis 168
10.6 Daily volume Breakdown 170
10.7 Loss Distribution 173
10.8 Interval Fluid Properties Recap 177
10.9 Solid Control Disscusion 179
10.10 8 – 1/2" Hole Section Drilling Fluid Types 180
10.11 8 1/2" Interval Material Consumption Analysis 181
10.12 8 1/2" Interval Volume Analysis 183
10.13 8 1/2" Interval Daily Volume Breakdown 185
10.14 8 – 1/2" Interval Loss Distribution 190
10.15 8 – 1/2" Interval Fluid Properties Recap 193
10.16 Solid Control Disscusion 198
10.17 6 – 1/8" Hole Section Drilling Fluid Types 199
10.18 6-1/8" Interval Material Consumption Analysis 200

10.19 6-1/8" Interval Volume Analysis 201
10.20 6-1/8" Interval Daily Volume Breakdown 204
10.21 6-1/8" Interval Loss Distribution 210
10.22 6-1/8" Interval Fluid Properties Recap 214
10.23 6-1/8" Interval Solid Control Disscusion 221
10.24 Interval Completion Section 222
11. List of Contractors 224
12. Appendix 225
12.1 DDR Summary 225
13. Comments & Revision 238

LIST OF TABLES

TABLE 2-1: AZNS-85 WORKOVER WELL INFORMATION 12
TABLE 2-2: AZNS-127 CASING HISTORY 14
TABLE 2-3: AZNS-127 BIT RECORD TABLE 57
TABLE 3-1: AZNS-127 WORKOVER TIME BREAKDOWN 60
TABLE 3-2: AZNS-127 SIDE TRACK TIME BREAKDOWN 61
TABLE 3-3: AZNS-127 COMPLETION TIME BREAKDOWN 61
TABLE 3-4: AZNS-127 NPT TIME BREAKDOWN 63
TABLE 4-1: AZNS-127 LOGGING INFORMATION 64
TABLE 6-1: AZNS-127 FINAL CASING DATA 90
TABLE 7-1: AZNS-127 ENGINEERING DATA 95
TABLE 7-2: AZNS-127 EQUIPMENT USED 96
TABLE 7-3: AZNS-127 OPERATION CREW 96
TABLE 7-4: AZNS-127 PUMPING SCHEDULE 98
TABLE 7-5: AZNS-127 MATERIAL USED TABLE 98
TABLE 7-6: AZNS-127 ENGINEERING DATA 103
TABLE 7-7: AZNS-127 EQUIPMENT USED 104
TABLE 7-8: AZNS-127 OPERATION CREW 104
TABLE 7-9: AZNS-127 PUMPING SCHEDULE 108
TABLE 7-10: AZNS-127 MATERIAL USED TABLE 108
TABLE 8-1: AZNS-85 TUBING DATA 117
TABLE 8-2: AZNS-127 EQUIPMENT CHECKLIST 119
TABLE 8-3: AZNS-127 EQUIPMENT CHECKLIST 119
TABLE 8-4: AZNS-127 OPERATION CHECKLIST 132
TABLE 9-1: AZNS-127 FINAL WELL STATUS 151
TABLE 9-2: AZNS-127 EQUIPMENT SPECIFICATION 152
TABLE 9-3: AZNS-127 SECTION "D" SPECIFICATION 156
TABLE 9-4: AZNS-127 SECTION "D" TEST REPORT BEFOR INSTALLATION 157
TABLE 9-5: AZNS-127 SECTION "D" TEST REPORT AFTER INSTALLATION 157
TABLE 10-1: AZNS-127 SUMMARY OF FLUID 163
TABLE 10-2: AZNS-127 FLUID PROPERTIES RECAP TABLE 165
TABLE 10-3: AZNS-127 MATERIAL CONSUMPTION ANALYSIS TABLE 166
TABLE 10-4: AZNS-127 VOLUME ANALYSIS TABLE 168
TABLE 10-5: AZNS-127 DAILY VOLUME BREAK DOWN TABLE 173
TABLE 10-6: AZNS-127 LOSS DISTRIBUTION 175
TABLE 10-7: AZNS-127 FLUID PROPERTIES RECAP 178
TABLE 10-8: AZNS-127 SOLID CONTROL DESSCUSION 179
TABLE 10-9: AZNS-127 8-1/2" FLUID PROPERTIES RECAP TABLE 180
TABLE 10-10: AZNS-127 8-1/2" INTERVAL MATERIAL CONSUMPTION ANALYSIS 181
TABLE 10-11: AZNS-127 8-1/2" INTERVAL VOLUME ANALYSIS 183
TABLE 10-12: AZNS-127 8-1/2" INTERVAL DAILY VOLUME BREAKDOWN 187
TABLE 10-13: AZNS-127 8-1/2" INTERVAL LOSS DISTRIBUTION 190
TABLE 10-14: AZNS-127 8-1/2" INTERVAL FLUID PROPERTIES 193
TABLE 10-15: AZNS-127 8-1/2" SOLID CONTROL DESSCUSION 198
TABLE 10-16: AZNS-127 6-1/8" FLUID PROPERTIES RECAP TABLE 199
TABLE 10-17: AZNS-127 6-1/8" INTERVAL MATERIAL CONSUMPTION ANALYSIS 200
TABLE 10-18: AZNS-127 6-1/8" INTERVAL VOLUME ANALYSIS 202
TABLE 10-19: AZNS-127 6-1/8" INTERVAL DAILY VOLUME BREAKDOWN 207
TABLE 10-20: AZNS-127 6-1/8" INTERVAL LOSS DISTRIBUTION 211
TABLE 10-21: AZNS-127 6-1/8" INTERVAL FLUID PROPERTIES 215
TABLE 10-22: AZNS-127 6-1/8" SOLID CONTROL DESSCUSION 221

TABLE 10-23: AZNS-127 COMPLETION SECTION 222
TABLE 11-1: AZNS-127 CONTRACTORS INVOLVED 224
TABLE 12-1: AZNS-127 DAILY DRILLING REPORT SUMMARY 237

LIST OF FIGURES

FIGURE 1-1: AZNS OILFIELD LOCATION MAP 10
FIGURE 1-2: AZNS-127 WELL LOCATION MAP 11
FIGURE 2-1: AZNS-127 WELL SKETCH 55
FIGURE 2-2: AZNS-127 ROP CHART 56
FIGURE 2-3: AZNS-127 BIT PARAMETERS PLOT 58
FIGURE 3-1: AZNS-127 WORKOVER WELL TIME VS. DEPTH AFTER SIDE TRACK 59
FIGURE 3-2: AZNS-127 NPT BREAK-DOWN CHART 62
FIGURE 7-1: AZNS-127 7" LINER JOB GRAPH ..... ERROR! BOOKMARK NOT DEFINED.
FIGURE 7-2: AZNS-127 4 – 1/2" LINER JOB GRAPH 106
FIGURE 8-1: AZNS-127 TRSSSV TEST REPORT ..... ERROR! BOOKMARK NOT DEFINED.
FIGURE 8-2: AZNS-127 TRSSSV CONNECTIONS & BODY PRESSURE TEST GRAPH ..... ERROR! BOOKMARK NOT DEFINED.
FIGURE 8-3: AZNS-127 PERMANENT PACKER TEST REPORT ..... ERROR! BOOKMARK NOT DEFINED.
FIGURE 8-4: AZNS-127 ANCHOR TUBING SEAL TEST REPORT ..... ERROR! BOOKMARK NOT DEFINED.
FIGURE 8-5: AZNS-127 PERMANENT PACKER CONNECTIONS & BODY PRESSURE TEST GRAPH ERROR! BOOKMARK NOT DEFINED.
FIGURE 8-6: AZNS-127 SSD TEST REPORT ..... ERROR! BOOKMARK NOT DEFINED.
FIGURE 8-7: AZNS-127 SSD CONNECTIONS & BODY PRESSURE TEST GRAPH ..... ERROR! BOOKMARK NOT DEFINED.
FIGURE 8-8: AZNS-127 EX JT TEST REPORT ..... ERROR! BOOKMARK NOT DEFINED.
FIGURE 8-9: AZNS-127 EX JT CONNECTIONS & BODY PRESSURE TEST GRAPH ..... ERROR! BOOKMARK NOT DEFINED.
FIGURE 8-10: AZNS-127 LANDING NIPPLE TEST REPORT ..... ERROR! BOOKMARK NOT DEFINED.
FIGURE 8-11: AZNS-127 LANDING NIPPLE CONNECTIONS & BODY PRESSURE TEST GRAPH .... ERROR! BOOKMARK NOT DEFINED.
FIGURE 8-12: AZNS-127 FIRST CIV TEST REPORT ..... ERROR! BOOKMARK NOT DEFINED.
FIGURE 8-13: AZNS-127 FIRST CIM TEST REPORT ..... ERROR! BOOKMARK NOT DEFINED.
FIGURE 8-14: AZNS-127 FIRST CIM CONNECTIONS & BODY PRESSURE TEST GRAPH. ERROR! BOOKMARK NOT DEFINED.
FIGURE 8-15: AZNS-127 SECOND CIV TEST REPORT ..... ERROR! BOOKMARK NOT DEFINED.
FIGURE 8-16: AZNS-127 SECOND CIM TEST REPORT ..... ERROR! BOOKMARK NOT DEFINED.
FIGURE 8-17: AZNS-127 SECOND CIM CONNECTIONS & BODY PRESSURE TEST GRAPH ..... ERROR! BOOKMARK NOT DEFINED.
FIGURE 8-18: AZNS-127 COMPLETION SKETCH 137
FIGURE 8-19: AZNS-127 COMPLETION TALLY 147
FIGURE 8-20: AZNS-127 COMPLETION STRING & TRSSSV PRESSURE TEST GRAPH ... ERROR! BOOKMARK NOT DEFINED.
FIGURE 8-21: AZNS-127 SETTING PACKER, ANNULUS & FINAL COMPLETION STRING PRESSURE TEST ..... ERROR! BOOKMARK NOT DEFINED.
FIGURE 9-1: AZNS-127 WELLHEAD SKETCH 155
FIGURE 9-2: AZNS-127 X-MASS TREE BODY PRESSURE TEST GRAPH BEFORE INSTALLATION 159
FIGURE 9-3: AZNS-127 X-MASS TREE BODY PRESSURE TEST GRAPH AFTER INSTALLATION 160
FIGURE 9-4: AZNS-127 WELLHEAD MOM BEFOR INSTALLATION 161
FIGURE 9-5: AZNS-127 WELLHEAD MOM AFTER INSTALLATION 162
FIGURE 10-1: AZNS-127 MUD CHEMICAL USAGE 167
FIGURE 10-2: AZNS-127 EFFECTIVE CONCENTRATION 167
FIGURE 10-3: AZNS-127 VOLUME ANALYSIS CHART 169
FIGURE 10-4: AZNS-127 DAILY VOLUME BREAK DOWN CHART 173
FIGURE 10-5: AZNS-127 LOSS ANALYSIS 176
FIGURE 10-6: AZNS-127 8 -1/2" EFFECTIVE CONCENTRATION 182
FIGURE 10-7: AZNS-127 8-1/2" MUD CHEMICAL USAGE 182
FIGURE 10-8: AZNS-127 8-1/2" INTERVAL VOLUME ANALYSIS 184
FIGURE 10-9: AZNS-127 8-1/2" INTERVAL DAILY VOLUME BREAKDOWN 187
FIGURE 10-10: AZNS-127 8-1/2" LOSSES ANALYSIS 189
FIGURE 10-11: AZNS-127 8-1/2" LOSSES ANALYSIS 192
FIGURE 10-12: AZNS-127 8-1/2" DENSITY GRAPH 194
FIGURE 10-13: AZNS-127 8-1/2" VISCOSITY GRAPH 194
FIGURE 10-14: AZNS-127 8-1/2" PV & YP GRAPH 195
FIGURE 10-15: AZNS-127 8-1/2" PH GRAPH 195
FIGURE 10-16: AZNS-127 8-1/2" CALCIUM GRAPH 196

FIGURE 10-17: AZNS-127 8-1/2" TOTAL HARDNESS GRAPH 196
FIGURE 10-18: AZNS-127 8-1/2" SOLID% GRAPH 197
FIGURE 10-19: AZNS-127 8-1/2" CHLORIDE GRAPH 197
FIGURE 10-20: AZNS-127 8-1/2" KCL % WT GRAPH 198
FIGURE 10-21: AZNS-127 6-1/8" EFFECTIVE CONCENTRATION 201
FIGURE 10-22: AZNS-127 6-1/8" MUD CHEMICAL USAGE 201
FIGURE 10-23: AZNS-127 6-1/8" INTERVAL VOLUME ANALYSIS 203
FIGURE 10-24: AZNS-127 6-1/8" INTERVAL DAILY VOLUME BREAKDOWN 207
FIGURE 10-25: AZNS-127 6-1/8" LOSSES ANALYSIS 209
FIGURE 10-26: AZNS-127 6-1/8" LOSSES ANALYSIS 213
FIGURE 10-27: AZNS-127 6-1/8" DENSITY GRAPH 216
FIGURE 10-28: AZNS-127 6-1/8" VISCOSITY GRAPH 216
FIGURE 10-29: AZNS-127 6-1/8" PV & YP GRAPH 217
FIGURE 10-30: AZNS-127 6-1/8" PH GRAPH 217
FIGURE 10-31: AZNS-127 6-1/8" CALCIUM GRAPH 218
FIGURE 10-32: AZNS-127 6-1/8" TOTAL HARDNESS GRAPH 218
FIGURE 10-33: AZNS-127 6-1/8" WATER LOSS% GRAPH 219
FIGURE 10-34: AZNS-127 6-1/8" CHLORIDE GRAPH 219
FIGURE 10-35: AZNS-127 6-1/8" KCL % WT GRAPH 220

1. General Information

1.1 Field Introduction

Azadegan South Oil Field is situated in West Karoun, Khuzestan province on a large long – axis anticline with N – S trending with approximate dimensions about 20^{km} width and 60^{km} length near to Iran – Iraq border, It is located in The Northwest of The YADAVARAN Field and in The West of JUFEYR Field. The Average Monthly Temperature is 45$^{°c}$ in summer and Highest Temperature is 52$^{°c}$. The Lowest Temperature is -4.4$^{°c}$ in winter. Maximum Rainfall is 78^{mm} in February, Winter Season.

The trap area of the south Azadegan is limited to 43.2x17.2km. The Azadegan Oil field was discovered in 1999, when Well AZN-1 was drilled vertically down to the Cretaceous Fahliyan Formation with total depth of 4,643m. The results of this well, revealed the reservoir characteristics of the field. Following to the result of the well no. AZN-1, another 5 exploration wells was drilled in different parts of this huge field down to Fahliyan Formation. In the later stage the well No.10 assumed as exploration well for evaluation of deeper formations. This well was drilled in 2008, down to the depth of 5340m (Neyriz Fm.), mainly to evaluate the Jurassic formations.

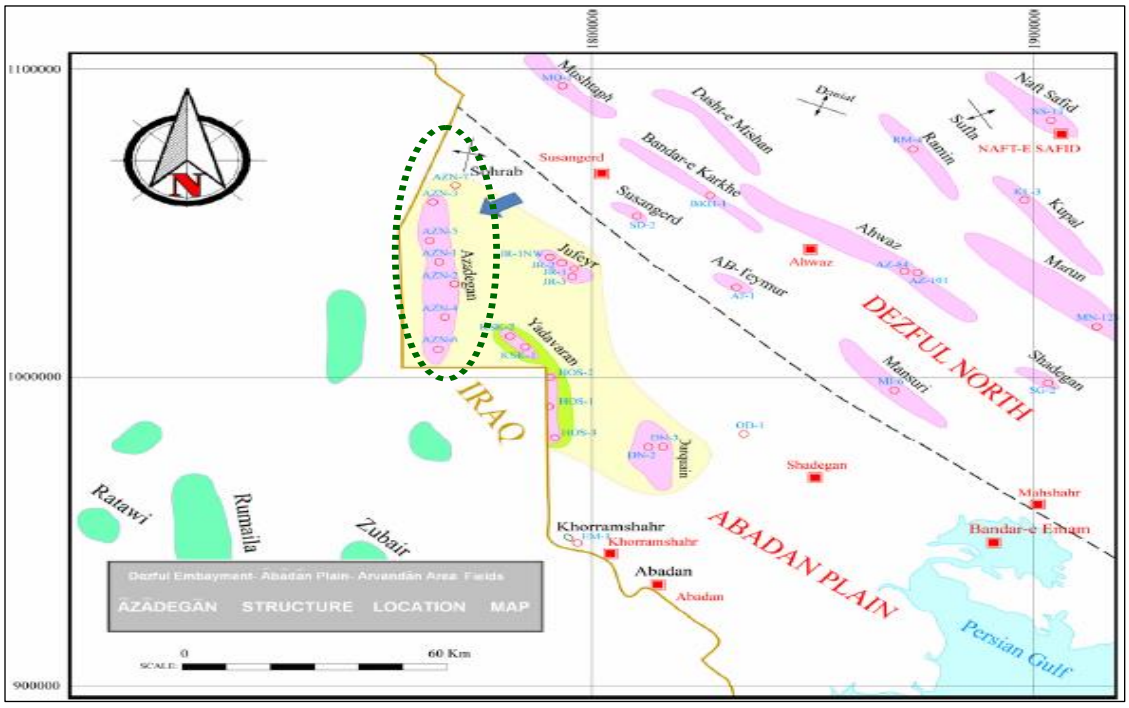


Figure 1-1: AZNS Oilfield Location Map

1.2 AZNS – 127 Well Location Map

This well is located on "Pad – 54" of South Azadegan Oil field in Block – II.

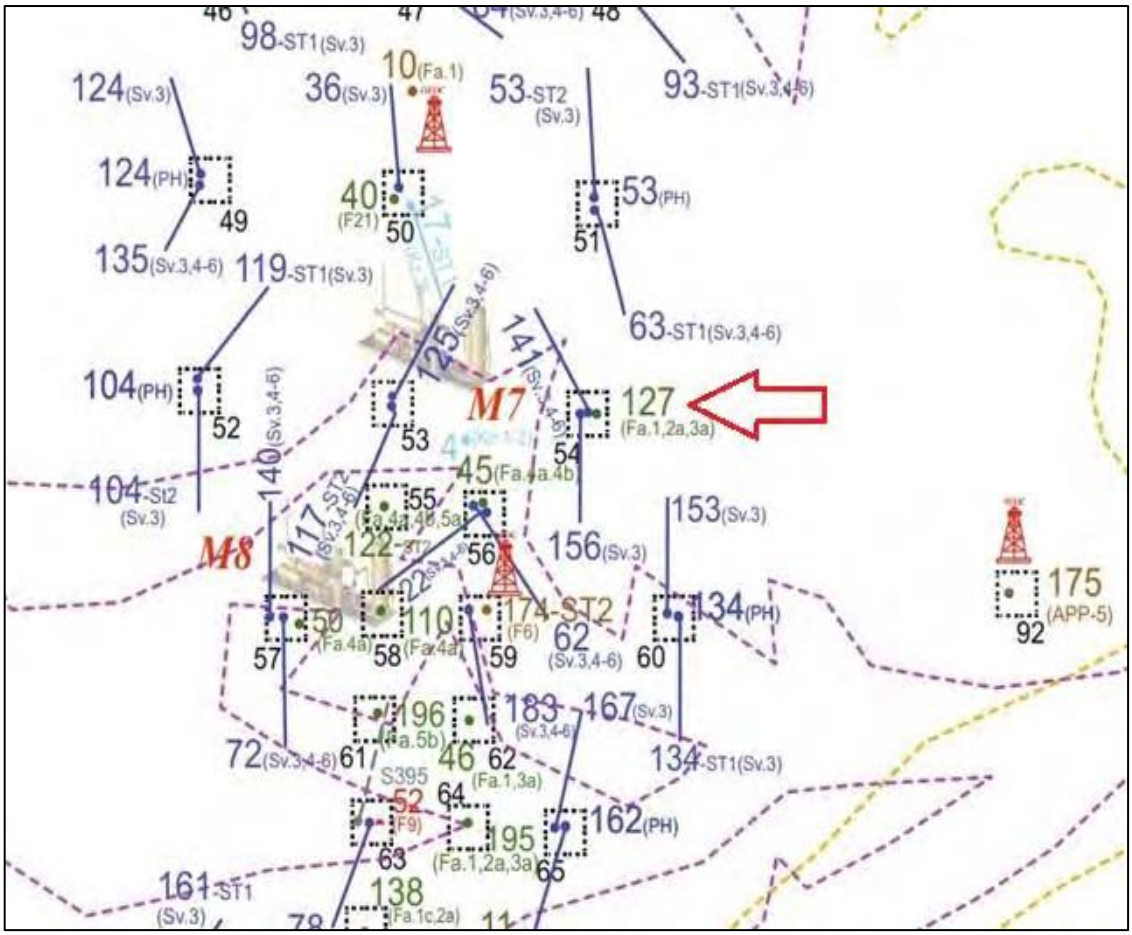


Figure 1-2: AZNS-127 Well Location Map

2. Well History

2.1 Well Informaion

Rig name	201	**Owner**	PEDEC/PPL
Rig type	Land Rig 2000HP	**Contractor**	MSA/OEOC
Well Name	AZNS – 127 ST#2	**Management Contractor**	MSA
Well Type	Vertical IIF	**Field**	South Azadegan
Completion Type	4-1/2" * 3-1/2" 10K	**RTE**	12.95
Actual TD	4226^{m}	**GLE**	3.95
Surface Coordinate		N: 3,448,561 – E: 196,167	
Target Coordinate		N: 3,448,564.68 – E: 196,158.87	
Spud Date			
WO #2	25-Dec-2025	**ST #2**	3-Apr-2026
Released Date			
WO #2	20-Mar-2026	**ST #2**	17-Jul-2026
Rig Days Plan / Actual	115.4 + 6 (Contingency)		

Table 2-1: AZNS-85 Workover Well Information

2.2 AZNS – 127 Well History

The AZNS – 127 well was drilled & completed by TDDC on date 1395.10.08 at 12:00 as describe below:

- 26" hole size drilled to 150^{m} w/ Mw 66 – 68^{pcf} & 20" casing ran to 146^{m} & cemented as program by 170^{bbl} cement.
- 17 – 1/2" hole size drilled to 1441^{m}, while increased Mw from 68 to 90^{pcf}, 13 – 3/8" casing ran & cemented to 1441^{m} by 780^{bb} cement.
- 12 – 1/4" hole size drilled to 3910^{m} w/ performance drlg & 3 – 15BPH loss. At depth 2354^{m} suddenly pressure dropped f/ 2850 to 1950^{psi} & string twist off from float sub & 9.18^{m} fish left in hole. Fish recovered by overshot 10 – 1/8". At depth 3117^{m}due to pressure dropped f/ 2560 to 2320^{psi} POOH string but string got stuck at 3040^{m} & free by applied 50^{klbs} overpull, POOH to surface & observed wash

out on float sub above 8" PDM. Took MSFL/DLL/SONIC/CALIPER/GR/CDR & ZDL/CNC/DSL/WTS/TTRM logs, 9 – 5/8" casing ran & cemented to 3909^{m} with 1133^{bbl} cement.

- 8 – 1/2" hole size drilled to 4226^{m} with no major problem, took VDL/SBT/CCL/GR logs, string held up at 3905^{m}, tried to pass this point several times with no success, logged up from this pont to 100^{m} above 13 – 3/8" casing shoe. Due to tight hole Mw increased f/ 104 to 105^{pcf}. Took first full suite log as DLL/SONIC/MSFL/CDR from TD to 3810^{m} & second full suite log as CNT/LDT/NGS/GR from 3910^{m} to TD. 7" liner ran to 4226^{m}. Due to first dry test results, decided was made to tie back 7" liner to 3777^{m}. The well suspended with cement plug & completion string & rig released @1396.06.27.
- Re – entry the well at 1396.11.03 by retrieving completion string & ran new completion & rig released at 24:00 on 1396.12.23
- Rig less operation was performed on date 17.05.1398. tried to RIH with coiled tubing to unload the well. There was an obstruction in the well at depth 3918^{m}. Unable to pass the depth. Several runs were performed by coiled tubing and mill to remove the obstruction.
- Rig less operation for unloading and well flowing was performed on date 30.01.1400.
- Pressure monitoring was performed on tubing head spool vent port, it was 4,000^{psi}. Metal seal of tubing hanger is damaged.
- Try to run coiled tubing to TD and wash the wellbore with xylene. Run CCL/GR/MFC logging BHA in the well. It was observed 7" liner ID has been decreased to about 3inches in interval 3889 – 3911^{m}.
- Flow the well, an abnormal annulus pressure was observed.
- The other Rig less monitoring well annulus pressure on date 18.09.1400. It was annulus pressure is 5,300^{psi}. Sampling was performed from annulus fluid. It was contained with gas and hydrocarbon.

Casing Spec.		
Size (in)	**Shoe Depth (mMD)**	**Specification**
20	146	K – 55, 94^{ppf}, BTC
13 – 3/8	1441	N – 80, 68^{ppf}, BTC
9 – 5/8	3909	(0-2732.64m), T – 95, 53.5^{PPF}, TSH BLUE (2732.64-3909m), T – 95, 53.5^{PPF}, TPCQ
7"	2883.5-3890	L-80, 29^{PPF}, TPCQ

7” (Tie-Back #1)	2883.5-2826.8	L-80, 29^{PPF}, TPCQ
	2826.8-2793	P-110, 32^{PPF}, TPCQ
	2793-1284	L-80, 29^{PPF}, TPCQ
7” (Tie-Back #2)	1284-128.4	L-80, 29^{PPF}, TPCQ
5”	3763.5- 4150	L-80, 18^{PPF}, HSG3_FJ

Table 2-2: AZNS-127 ST#2 Casing History

Summary of Workover Operation #1

The AZNS – 127 workover well was De-Complete by rig OEOC – 208 on Pad 54, from "08 – May – 2024" to "18 – March – 2024" as described in the following:

De – Completion Summary:

Installed 8" poor boy degasser flare. Pressure test SP & function test TDS, MPs; Ok. Checked section B: P-Seals & ring gasket; Ok. Checked section C: BTM P-Seal; Ok. Top P-Seal & ring gasket; Not Ok. Disconnected adjustable choke of production line. L/U pump truck to XMT kill line & annulus. L/U choke manifold to production line & annulus, meanwhile preparing 200^{bbl} 106^{pcf} mud. Pressure test all line after rectify several leakages. Open Ann & monitor Press; 4700 psi. Bleed off Press to 3000 psi, Build up to3800 psi in 1 Min. Increase Press f/ 3800 to 3900 psi in 5 Min.

P/U 60 Jts 5" DP Jt by Jt, made & R/B 20 Stds to derrick. Monitored annulus pressure build up to 4800^{psi} after 6 hrs. Opened the annulus thru choke manifold to oil storage; after 6min. decreased pressure to 980^{psi}. Decreased pressure gradually to 500^{psi} in 20min. Closed the annulus; Shut in pressure 500^{psi}. Built up to 1000^{psi} in 15min. Opened the annulus, suddenly dropped to zero. After 6min closed the annulus. Opened the 2SV, top master valve & production valve. Tightened XMT cap. Connected hand pump to exit block, tried to open TR3SV. Monitored tubing pressure 3400^{psi}. Opened the well f/ TBG to oil storage tank; dropped pressure to zero in 2min. Closed the well. Built up to 3700^{psi} in 2min. L/U annulus to choke manifold. Obs. annulus pressure built up to 4300^{psi} in 3 hrs. Opened the well & pressure decreased to 600^{psi}. Closed the annulus. Pressure rapidly built up to 3300^{psi}. Opened the well again. Pressure suddenly dropped to zero. Flew the well for 10min. Closed the well, built up to 3300^{psi}. Monitored the well for1 hrs. Pressure built up to 4300^{psi}.

Due to jammed stem of inside SOV of THS in close position, installed pressure gauge on annulus to choke manifold line & pressure test same to 7000^{psi}, Ok. R/U slickline equipment. Installed slickline BOP & lubricator on XMT cap. Tried to pressure test, Obs. leakage between lubricator & BOP. Changed lubricator O-ring & tried to pressure test; No-Success. L/D previous BOP. Installed another slickline BOP & Lubricator on XMT cap. Pressure test slickline BOP & lubricator w/ 7000^{psi} to 15min; Ok. RIH w/ 3.4" gauge cutter to TBG HGR, tried to pass this depth; No-Success. Pulled out to surface & R/D slickline BOP & lubricator.

Installed 4 – 1/16" 10k lubricator on XMT. Pressure test to 7000^{psi} for 15min; Ok. RIH w/ BPV retrieving tools to TBG HGR & retrieved 4" BPV f/ TBG HGR. L/D 4 – 1/16" 10k lubricator. Due to unable to open TR3SV, decided M/U 5" DPs. R/D slickline equipment.

R/U slickline equipment. Pressure test; Ok. Fixed CL port exit block. Ran 3.4" gauge cutter to 206[ft], RIH w/ 3.437" protection sleeve to 190[ft], opened TR3SV while holding pressure to 1200[psi]. Applied 7500[psi] pressure in CL & opened TR3SV. Cont. running tools to 200[ft], took weight, tried to set protection sleeve by jarring several times; No-Success. Flew the well with 1/4" choke size & Cont. work on set protection sleeve; No-Success. Pulled out tools to 191[ft]. Obs. stuck tools. Worked on stuck to max. 60[lb] over-pull; No-Success. Finally flew the well by annulus & tubing. Tools got free. Cont. pulled out tools to 50[ft] & stuck tools again. R/D lubricator. Obs. cut the slickline wire from 50[ft] & left in hole about 3[m] tools & 13[m] wire. RIH w/ 2.5" LIB to 157[ft], POOH to surface; Obs. wire mark on same.

While wait on OEOC slickline service, RIH w/ 2.8" spear to TOF. Worked on fish & retrieved 2.45[m] of wire after 3 attempts. RIH w/ 2.8" LIB to 157[ft], POOH to surface. Obs. rope socket marked on same. RIH w/ 2.8" blind box, POOH to surface. Rope socket marked on same. Welded 3.2" skirt on 2.2" JDC, RIH w/ JDC to TOF. Engaged w/ same. Tried to pull out, Obs. indication of shear JDC Shear pin. POOH to surface. Obs. sheared JDC Shear pin. Redressed w/ steel shear pin. RIH w/ JDC to TOF again. Engaged & worked on fish, Pulled to surface. Obs. retrieved 10[ft] stem of fish. RIH w/ 2.8" LIB to TOF, POOH to surface. Obs. slickline mechanical jar on the same. RIH w/ JDC to engage w/ jar. Worked on fish, jarring up. Pulling out fish 20[ft]. Cont. worked on stuck. RIH w/ blind box & knock on TOF, without progress. POOH to surface. RIH w/ JDC to engage w/ Jar. Worked on fish, jarring up. POOH to surface. R/D slickline equipment.

In order to work on fish w/ coiled tubing, wait on receive coiled tubing unit. While waiting on OEOC slickline service, R/U CT & M/U 2 – 1/8" dimple connector on 1 – 1/2" CT pipe & performed pull test to max 20[klb]. Obs. failure in dimple connector, disconnected same. M/U 1 – 11/16" roll on connector on 1 – 1/2" CT pipe & performed pull test to max 20[klb], Ok. Installed CT riser on XMT & CT BOP. Close CT blind rams & tried to perform pressure test; No-Success. Tightened between two risers flange & tried to perform pressure test; No-Success. P/U riser & BOP; Tried to perform pressure test; No-Success. Changed 1 Jt CT riser & performed pressure test CT BOP & risers, Ok. RIH CT BHA to 48[m] & engaged w/ the fish; Obs. stuck the fish. Worked on stuck to max 18[klb] over-pull; No-Success. While shearing JDC Shear pin @ 2 times & POOH to surface & redressed w/ brass shear pin.

In the 3[rd] attempt, caught the fish & worked on same upward to 18[klb] over-pull while bleeding off annulus pressure f/ 4800 to 2000[psi]. Obs. fish got free, jumped same & sheared the JDC Shear Pin. POOH to surface. Cut 12[m] 1 – 1/2" CT pipe & changed roll on connector. Performed pull test to 20[klb]; Ok. RIH w/ 1 – 1/2" CT & 3.2" JDC to 48[m]. Worked on fish & POOH to surface. In the last attempt caught, engaged the fish & bleed off annulus pressure f/ 4800 to 2000[psi]. Pulled out f/ 48 to 10[m] w/ 2 – 3[klb] drag. Obs. took

over-pull. Worked on stuck upward to max 18^{klb}; No-Success. Then Obs. CT got free & POOH to surface. Closed swab valve & unable close TMV. Obs. sheared JDC Shear pin & TOF located in TMV. Installed 1 No 4 – 1/16" 10k gate valve on XMT. Redressed JDC shear pin to steel & M/U on CT BHA. Tightened all bolts. Performed pressure test to 6000^{psi} for 10min; Ok.

Due to refused work on fish & stopped operation from OEOC CT service, wait on CT Service to make a decision. Changed JDC shear pin to brass. RIH w/ 1 – 1/2" CT & 3.2" JDC to 11^{m} & engaged w/ the fish. Worked on stuck upward to max 18^{klb} over-pull; No-Success. Slack off 6^{klb} weight on JDC & sheared JDC Shear Pin. POOH to surface. R/D CT injector head. R/U slickline equipment & worked on fish w/ JDC jarring up several times; No-Success.

Performed injectivity test & monitored the well & checked communication between string & annulus; Ok. Pumped & direct Circ. 30^{bbl} fresh water by applying back pressure in order to check communication between string & annulus; Ok. Commenced killing the well by W&W method, "pumping pressure f/ 5500 to 3600^{psi}, annulus pressure f/5500 to 2400^{psi}". Meanwhile R/D slickline equipment & CT raiser.

In order to work on fish closed 3SV & released above pressure, M/U & RIH with 3 – 1/2" handmade JDC & tried to engage with fish several times, in the last attempt successfully engaged with fish & recovered w/ max 10^{klb} over-pull. Operate 3SV; Ok. Monitored the well pressure, observed wellhead pressure decreased f/ 500 to 300^{psi}. Bleed off to zero & remained constant. Annulus pressure decreased f/ 2800 to 2000^{psi}, bleed off to 1800^{psi} & remained constant. Performed cavity pressure test to 4000psi for 15min; Ok. Pumped & direct Circ. 125^{bbl} 137^{pcf} mud, "pumping pressure f/ 1300 – 2800^{psi} to 1700^{psi} & annulus pressure 2400^{psi}". Got 78 to 85^{pcf} gas cut mud in return. Stopped pumping.

Bleed off pressure f/ 2200^{psi} to zero step by step & monitored the pressure for any build up in each step; Negative. Wellhead pressure decreased to zero & remained constant. Pumped & direct Circ. 125^{bbl} 145^{pcf} mud. Stopped pumping. Bleed off pressure f/ 700^{psi} to zero step by step & remained constant. Pumped 20^{bbl} 135^{pcf} mud to annulus. Obs. wellhead & annulus pressure decreased to zero. Opened cap of 3/8" CIL & monitored for 1 hr. Ok. Cut the CIL. Closed 3SV & removed XMT cap. Installed TWCV in TBG HGR & test same to 5000^{psi} for 15min; Ok. N/D XMT while passing CIL thru BTM section.

N/D XMT & N/U 13 – 5/8" 10k BOP stack. Connected hydraulic, choke & kill lines. L/U cement line to BOP & performed BOP pressure test as NIOC policy; Ok. Passed CL f/ BOP stack to rig floor. Installed bell nipple. Changed annulus to C/M line, tested same; Ok. P/U & M/U 5" DP, XOS (4 – 1/2" IF * 4 – 1/2" TPCQ), 4 – 1/2" TBG HGR running tools. Retrieved TWCV. Screw TBG HGR running tools + X.O.S (4 – 1/2"

TPCQ * 4 – 1/2" IF) + 1 Jt 5" DP + 1 No. Pup Jt on TBG HGR. Performed pressure test of running tool O-ring to 1000^{psi}, Ok. F/U string, opened 3SV & monitored the well, Ok. Back off running tools & R/D same. Close 3SV. R/U Golpa flange, BOP & lubricator of slickline (OEOC Co.), performed pressure test same w/ 1000^{psi}. Obs. leakage between Golpa flange & 4 – 1/16"gate valve. R/D 4 – 1/16" gate valve, changed ring gasket, pressure tested same again to 1000^{psi}, Ok. Ran 3.4" gauge ring to 61^{m} (3SV depth), Obs. drag @59^{m}, pulled out to surface. Ran spear to 61^{m} (3SV depth) to catch possible cable in the well, pulled out to surface, Obs. No cable. Ran w/ protection sleeve to 61^{m} (3SVdepth), held 7500^{psi} pressure inside CL, set protection sleeve inside 3SV, retrieved protection sleeve & pulled out to surface. B/O slickline BOP. R/U 4 – 1/16" gate valve on Golpa flange, M/U slickline BOP & lubricator & performed pressure test same w/1000^{psi}, Ok.

Ran w/ protection sleeve to 61^{m}, held 7500^{psi} pressure inside CL, set protection sleeve inside 3SV & pulled out to surface. Ran w/ 2.230" gauge cutter to 61^{m} (3SV depth), took weight, tried to pull out, Obs. slickline string stuck, tried to pass this point for several times, No Success. Pumped 5^{bbl} 138^{pcf} mud wile working on stuck, No success. Increased CL pressure to 10,000^{psi} step by step, Obs. slickline string got free. Pulled out gauge cutter to surface & L/D same. Ran with GS pulling tools of protection sleeve & retrieved same. Pulled out protection sleeve to surface. Ran back in hole w/ protection sleeve to 61^{m} (3SV depth) & tried to set protection sleeve for several times, No Success. POOH separation sleeve to surface. Decided to extend protection sleeve, RIH w/ new protection sleeve to 61^{m}, set protection sleeve inside 3SV. RIH w/ 1 – 7/8" stem to 80^{m}, checked opening of 3SV flapper, Ok, POOH stem to surface. RIH w/ 2.230" gauge ring to 3788^{m} (first CIV depth), due to limitation of slickline cable tension decided to POOH to surface. B/O & L/D same.

R/D slickline BOP, lubricator, upper & lower sheaves. Installed X.O.S (4 – 1/16" flange * 4 – 1/2" IF box) on gate valve, pressure tested same w/ 1000^{psi}, Ok. R/D mouse hole, R/U wireline equipment, P/U & M/U CCL & sinker bar. Pumped 100^{bbl} 137^{pcf} mud in string while applying 600 – 700^{psi} pressure, back pressure in annulus. Obs. the well, Ok. B/O X.O.S (4 – 1/16" flange * 4 – 1/2" IF box) & cut box connection, welded 7" new Vam box connection on top of 4 – 1/16" flange & installed same on 4 – 1/16" gate valve. Installed wireline BOP & pressure tested same w/ 1000^{psi}, Ok. Closed Hydrill, unscrew T.H.S tie down, P/U string, recorded string weight, applied allowable over pull to 298^{klb}, got back on 211^{klb}, according to limitation, applied 4$^{klb.ft}$ torque & tried to unlatch, No Success. RIH with CCL & sinker bar to 3850^{m} (5^{m} below PKR depth), POOH CCL & Sinker bar to surface & L/D same.

Held PJSM Assembled & armed colliding tools, RIH to 3850^{m}, spaced out to 3845^{m}, performed colliding, POOH colliding tools to surface, Obs. running tools of colliding

tools & CCL left in hole. Pumped 115^{bbl} 137^{pcf} mud, Cont. pumping 685^{bbl} 106^{pcf} mud while dumping return mud, after pumping totally 800^{bbl} mud, get 88^{pcf} mud in return, divert return to poor boy degasser, Cont. pumping 106^{pcf} mud, after pumped totally 850^{bbl} mud, got 97^{pcf} mud in return, all the time applied 700 – 1000^{psi} back pressure in annulus. Opened T.H.S tie down screw, closed Hydrill, pressure tested tie down in open position w/ 1000^{psi}, Ok. B/O & R/D 4 – 1/16" gate valve, Gol. Flang, landing Jt & TBG HGR running tools. P/U & M/U TBG HGR running tools, X.O.S (4 – 1/2" TPCQ * 4 – 1/2" IF) & 2 Jts DP as landing Jt, screw running tools on TBGHGR, tried to release anchor seal with maximum 120^{klb} overpull & applied 5$^{klb.ft}$ torque as forward for several times, No Success. B/O & L/D 2 Jts DP, X.O.S (4 – 1/2" TPCQ * 4 – 1/2" IF) & TBG HGR running tools.

P/U & M/U TBG HGR running tools, landing Jt, Gol. Flange, 4 – 1/16" G.Flange & X.O.S (4 – 1/16" flange * 7" N. Vam), performed break Circ., NL-NG. Obs. the well, Static. R/U wireline equipment (Sealand Co.) & performed pressure test of wireline BOP w/ 1000^{psi}, Ok. RIH w/ CCL & sinker bar to 3786^{m}, took weight, tried to pass this point for several times, No Success. POOH to surface, changed CCL, RIH w/ 1 – 7/8" CCL & sinker bar to 3786^{m}, took weight, tried to pass this point for several times, No Success. POOH to surface. L/D wireline equipment. L/D 4 – 1/16" X.O.S (4 – 1/16" flange * 7" N. Vam), 4 – 1/16" gate valve, Gol. Flange, landing Jt & TBG HGR running tools, closed shear rams & performed break circulation, NL-NG. M/U TBG HGR running tools, X.O.S (4 – 1/12" TPCQ * 4 – 1/2" IF), 2 Jts 5" DP as landing Jt & screw on TBG HGR, at the beginning of P/U string, Obs. 270^{klb} on weight indicator, while pulling the string, indication of EXP.Jt movement not observed (expansion joint is in full open position). Due to condition of EXP.Jt unable to follow releasing mechanism of Anchor seal due to TBG HGR is inside of THS unable to rotate.

P/U string 30^{cm} to be sure TBG HGR is not inside THS (weight: 290^{klb}), set torque limit on 7$^{klb.ft}$, rotated & reciprocated string between 290 – 300^{klb} weight on weight indicator to transfer TQ for several times, No Success. Released the TQ, P/U string to 400^{klb} on weight indicator, to release Anchor seal, No success. Established circulation, Obs. gas cut mud in return, dumped 200^{bbl} 50 – 55^{pcf} cut mud, after 200^{bbl}, Obs. 90^{pcf} mud in return, divert return to poor boy degasser. Cont. circulation while getting 90 – 80^{pcf} cut mud in return & applied 400 – 1400^{psi} back pressure. Stopped operation due to poor performance of transfer pump of middle, degasser, desander, desilter tank & also hopper #1 & #2 causing unable to transfer mud to suction tank. Worked on same to rectify problem while holding 1200^{psi} back pressure. Resumed Circ. while applying 1200 – 1400^{psi} back pressure, got 106^{pcf} mud in return. Stopped pumping, Obs. the well, Static. Worked on collided point to get string free with Max. 120^{klb} overpull & applying 6$^{klb.ft}$ TQ as forward, string got free, string weight on weight indicator: 195^{klb}. R/D wireline,

R/U CSG running equipment, POOH completion string while L/D landing Jt, TBG HGR, fluted swage, 3SV w/ long & short flow coupling (Obs. protection sleeve was not set in profile) & totally 35 Jts 4 – 1/2" TBG, meanwhile Circ. across wellhead, NL-NG. Cont. POOH completion string while L/D 94 Jts 4 – 1/2" TBG (totally 294 Jts), while using safety clamps & Circ. across wellhead; NL-NG. Obs. last Jt of string w/ underneath coupling washout, worn & torn in coupling area. Also Obs. 5 No. of cross coupling protectors left in hole & 9 No. of cross coupling protectors parted because of eroded condition. After Jt No. 35 some of cross couplings had been lost, eroded & parted. Obs. some of asphaltene on cross coupling protectors of injection line & slips area of 4 – 1/2" TBGs so need to be washed with steam, which lead delay in POOH completion string.
P/U & M/U 7 – 7/8" Over shot (w/ 4 – 3/4" Basket Grapple Mill Control, 4 – 1/2" Basket Grapple) & Fishing BHA & RIH to 1880^{m}, NL-NG. Estimated TOF: 2706^{m}. Took weight @ 1880^{m}, tried to pass several times; No Success. Established Circ. & pass gently. Cont. wash down to 2660^{m} while trying to pass several intervals w/o wash down; No Success (Asphaltene precipitation indication); NL-NG. Meanwhile got 150^{bbl} 50^{pcf} gas cut mud & dumped same @ 2020^{m}. Established Circ. to uniform Mw in/out on 106^{pcf}, got 300^{bbl} 75 – 95^{pcf} gas cut mud w/ NL-NG. Obs. huge amount of asphaltene precipitation on shakers. Resumed wash down to 2731^{m} while took weight several depth & pass same. Confirmed top of fish @2731^{m}. Tried to catch the fish several times; No Success. Commenced POOH w/ 7 – 7/8" over shot & fishing BHA f/2731^{m} to surface. Circ. CWH; NL-NG. Obs. some scratches on outer body & edge of over shot guide.
R/U slickline equipment & ran 3.8" magnet to 2731^{m}, held up. POOH to surface. 1^{lb} junk recovered (mixed with asphaltene). R/D slickline equipment while waiting on receive 8 – 3/8" Mill. P/U & M/U 12 Jts 6 – 1/2" DC, 3 Jts 5" HWDP & RIH OEDPs to 1250^{m} Jt by Jt. Circ. CWH; NL-NG. POOH string to surface & L/D same. RIH OEDPs by 12 Jts 4 – 3/4" DC & 12 Jts 3 – 1/2" DP. POOH OEDPs to surface & R/B. While Circ. CWH; NL-NG. Difficulty B/O & L/D 1 Jt 5" Pup Jt, 5" FOSV & Circ. swage due to over torque. Tried to B/O 11" plug tester from 1 Jt 5" DP w/ 48$^{klb.ft}$ TQ several times; No Success. Set 11" wear bushing in THS.
P/U & M/U 8 – 3/8" M.M J.Mill, 1 No. 6 – 5/8" Junk Sub, 1 No. 7" Junk Sub, 6 – 1/2" D.Pin, 6 – 1/2" Bit Sub & RIH w/ 4 Stds to 2729.5^{m} & took weight on this depth. Recorded off BTM parameters. Commenced milling obstruction f/ 2729.5 to 2736^{m}; NL-NG. While got 100^{bbl} 80 – 90^{pcf} gas cut mud @ BTM's up. Cont. milling f/ 2736 to 2739^{m}; NL-NG. Circ. BTM's up, over Circ. till clean shakers w/ Hi-Rate; NL-NG. Obs. metal wool on ditch magnet & also CIL cover on shakers. Worked on junk sub several times. Commenced POOH w/ 8 – 3/8" M.M J.Mill & milling BHA f/ 2739 (TOF) to surface. Circ. CWH; NL-NG. Mill Condition: 80% used. Obs. mark of TBG as top of

fish on mill. Both junk subs full of junk including pieces of CIL, cross coupling & metal wool. Recovered 19[lbs] junk with 2 junk subs.

P/U & M/U 7 – 7/8" overshot, dressed with 4 – 1/2" Basket Grapple & 4 – 3/4" mill control & RIH to 2739[m]. Worked on Fish & tried to catch & engage with fish several times. Obs. 20 – 50[klbs] excess weight on M/D & suddenly drop excess weight. Commence POOH w/ 7 – 7/8" overshot & fishing BHA f/ 2739[m] (TOF) to surface, Circ. CWH; NL-NG. Obs. mark of TOF on 3 wickers of basket grapple & also mark of junk on outer body of guide. P/U & M/U 7 – 5/8" overshot (dressed w/ 4 – 1/2" Basket Grapple, 4 – 1/2" Mill Control & Extension sub) & RIH to 2739[m]. While W/D last 2 Stds, tried to catch & engage with fish. P/U string Obs. caught & engaged w/ fish. Worked on fish w/ 280 to 450[klbs] on M/D several times; No Success. Commence POOH overshot to surface. Obs. fishing jar mandrel packing was failed. R/U tubing running equipment, Obs. top of CILs were collapsed, cut same & bleed of pressure. Released overshot & L/D 6-1/2" DC 7-7/8" overshot. Obs. washed out TOF, 4-1/2" basket grapple, 4-1/2" mill control, inside 7-7/8" bowl & broken 1 No. basket grapple wicker.

POOH completion string totally L/D 37 jts 4-1/2" tubing. Obs. twist off string f/ tubing coupling & recovered all cross couplings & CILs. TOF depth at 3078[m]. Performed static flow check. P/U & M/U 8-3/8" M.M.J.mill used & RIH to 1170[m], performed static flow check. Closed annulus preventer & Cir. Thru C/M & uniform Mw in/out on 106[pcf], got 30[bbl] 50 – 90[pcf] gas cut mud while monitored pit level w/ NL.NG. Opened the well & performed static flow check, Ok. Resumed RIH 8-3/8" mill & milling BHA to 3078[m]. Commence milling f/ 3078.2 to 3079.3[m] while Obs. metal wool on magnet. Performed static flow check, Ok. Commenced POOH milling BHA to surface.

P/U & M/U 7-5/8" overshot & RIH to 3079.3[m]. Established Cir. & CBU w/ hi – rate, huge amount of asphaltene observed on shakers & got 20[bbl] 102[pcf] gas cut mud. Tried to catch & engaged with fish. P/U string & Obs. the fish was caught. Worked on fish w/ maximum 390[klbs] on M/D. H/L dropped to 245[klbs]. Commenced POOH fishing BHA to surface w/ NL.NG. Changed TDS elevator & POOH completion string & L/D 8 jts 4-1/2" tubing. Obs. twist of string f/ tubing coupling & also Obs. tubing couplings was worm & eroded. TOF at 3152.5[m].

P/U & M/U 7-7/8" overshot & RIH to TOF at 3152.5[m]. Caught the fish after several attempts, worked on fish w/ maximum 480[klbs] on M/D. Applied different parameters several times, Obs. H/L dropped to 245[klbs]. Commenced POOH string & fishing BHA to surface. Obs. 1 joint 4-1/2" tubing retrieved & twist of tubing coupling. Released overshot f/ 4-1/2" tubing.

P/U & M/U 8-3/8" M.M.J.mill used & RIH to 3159[m]. Took weight at this point, tried to wash down several times, no progress. Wash & ream down to 3161.2[m]. commenced milling from 3161.2 to 3162.6[m] while got 100[bbl] 90 – 100[pcf] gas cut mud w/ NL.NG.

Obs. metal wool on ditch magnet & Asphaltene on shakers. Recovered 20[lbs] metal from magnet. Worked on junk sub several times & commenced POOH milling BHA to surface. 5[lbs] metal, debris & Asphaltene f/ 2 junk subs.
P/U & M/U 7-5/8" overshot & RIH to 3162[m]. washed down last stand & CBU w/ NL.NG. tried to catch the fish. Obs. catch & engage w/ fish. Worked on fish w/ max 400[klbs] on M/D, assembled 2-1/8" CCL, 2-1/8" weight bar & 1-11/16" Wt. bar. R/U wireline equipment, installed top sheave on monkey board & installed BTM sheave to mouse hole. M/U -1/8" CCL, 2-1/8" weight bar & 1-11/16" Wt. bar on rope socket & passed same thru string. RIH CCL & Wt. Bar as dummy run to 3170[m]. took weight, tried to pass this point several times, No success. POOH to surface & R/G equipment. R/U CT & M/U 1 roll on connector & XOS & Golpa flange. M/U XOS on string & CT BOP & performed pressure test. RIH CT to 3610[m] while Obs. drag at 3158[m] & 3213[m], cleared same. Took weight at 3610[m], tried to pass this point several times w/ applying max. 2000[lb] weight, No success. POOH CT to surface.
R/U Sealand wireline equipment. RIH wireline 2-1/8" CCL & 2 No. 2-1/8" weight bar as dummy run to 3222[m], Obs. drop tension. Passed this point & RIH to 3226[m], Obs. drop tension. Tried to pass this point several times, No success. POOH to surface & L/D assembly. Ran back wireline w/ 1-11/16" CCL & 3No. 1-11/16" weight bar as dummy run to 3612[m], took weight & tried to pass several times, No success. POOH & L/D assemblies. Assembled & RIH wireline w/ 1-3/8" FPIT & CCL tools to 3600[m] meanwhile checked the string w/ applied 170[klbs] overpull. POOH wireline assey. to surface & L/D same. FPIT results as bellow:

- 1000 & 2000 & 3100[m]: 100% free
- 3200 & 330[m]: 50% free
- 3400[m]: 25% free
- 3420[m]: 10% free
- 3440 & 3450[m]: 5% free
- 3460, 3470, 3490, 3500 & 3600[m]: 0% free

Assembled & RIH w/ 1-7/8" colliding & CCL tools to 3612[m]. Obs. drop tension. POOH to 3594[m] & correlated depth w/ CCL, applied 180[klbs] overpull on string. Shot the colliding, checked & worked on string, No success. POOH wireline to surface. Again assembled & RIH w/ 1-7/8" colliding & CCL tools as run #2 to 3398[m] while correlating depth. Applied 180[klbs] overpull on string & shot the colliding. No indication Obs. worked on string, No success. POOH wireline to 3275[m], wireline got stuck, worked on stuck several times to get free. Continued POOH to surface & L/D colliding Assy. Worked on string upward w/ max. 180[klbs] at neutral point several times, No success. Assembled &

RIH wireline w/ 2-1/8" CCL & 1 No. 2-1/8" weight bar as dummy run to 3272^{m}, Obs. drop tension, tried to pass this point, No success. POOH to surface.
RIH w / 2-1/8" colliding & CCL tools as run #3 to 3290^{m}, Obs. drop tension, POOH to 3140^{m} & ran back to 3281^{m}, correlated depth & applied 200^{klbs} overpull on string, shot colliding. Obs. indication of shot, POOH wireline to surface & L/D wireline equipment. Worked on string upward w/ max. 160^{klbs} overpull f/ neutral point to max. 50^{klbs} overpull in several times, No success. RIH wireline w/ 2-1/8" colliding & CCL tools as run #4 to 3185^{m}, correlated depth & applied 200^{klbs} overpull on string, shot the colliding & Obs. indicator. POOH to surface & L/D equipment & R/D unit. Worked on string w/ max. 160^{klbs} overpull upward & downward several times, string got free. POOH string f/ 10^{m} while Obs. 80^{klbs} overpull & abnormal high pressure. CBU & balanced Mw in/out, Obs. huge amount of debris & tubular coating & Asphaltene on shakers, got 300^{bbl} cut mud min 92^{pcf}. POOH to surface, Obs. 7-5/8" overshot & retrieved 21.1^{m} of 4-1/2" tubing f/ collided point & L/D same. Estimated TOF at 3183.1^{m}.
P/U & M/U new 8-3/8" M.M.J. mill & RIH milling BHA to 3182.5^{m}. Tagged TOF. Commenced milling the fish f/ 3182.5 to 3185.8^{m}. worked on junk sub several times, pumped 60^{bbl} hi vis pill & CBU till cleaned up shakers. POOH milling BHA to surface. P/U & M/U 7-7/8" overshot & RIH to tag the fish at 3185.8^{m}, CBU (pick – up weight: 246^{klbs}, Slack weight: 242^{klbs}). Tried to engage with fish, Obs. overpull. Worked on string by applying different parameters several times, string got free. Commenced POOH the string & fishing assembly to surface. Obs. 7-7/8" overshot with 4-1/2" tubing fish neck + 8 Jts 4-1/2" tubing + 73.318 + 9.268^{m} of 4-1/2" tubing w/ CIV control line protector & L/D same. (TOF at 3270.77^{m})
P/U & M/U 8-3/8" M.M.J. mill & RIH to 3203^{m}, took weight, tried to pass this point several times, No success. W & R/D to 3269.5^{m} while CBU, Obs. 65^{pcf} cut mud w/ NL.NG. Tagged TOF & commenced milling the fish f/ 3269.5 to 3274^{m}. worked on junk sub several times, pumped hi-vis pill & CBU w/ NL.NG. POOH Milling BHA to surface & L/D same.
P/U & M/U 7-7/8" overshot & RIH to TOF at 3274^{m}. Engaged with fish & applied different parameters till string got free. POOH overshot to surface. Obs. 4-1/2" tubing fish neck, 6.7^{m} + 2 Jts 4-1/2" tubing (18.58^{m}) + cut coupling 4-1/2" tubing (0.14^{m}) w/ CIV control line protector & L/D same. P/U & M/U 8-3/8" used M.M.J mill & RIH to 3297.5^{m}. Took weight, tried to pass this point several times, NO success. Tag the fish at 3297.5^{m} & commenced milling the fish to 3298.8^{m}. POOH milling BHA to surface & L/D same. Retrieved 6^{lb} junk while Circ. cross wellhead. P/U & M/U 7-5/8" overshot & RIH to TOF. Caught the fish & worked on string by applying different parameters several times.

R/U Sealand wireline unit & RIH w/ 2-1/8" CCL & 1 No. 2-1/8" weight bar & 1 No. 1-11/16" weight bar as dummy run to 3318, 3333 & 3385^{m}. Obs. drop tension at same depths. Several tries to pass depth 3386^{m} without any succeed, POOH wireline to surface & L/D Assy. Ran wireline 2-1/8" colliding & 1-11/16" CCL to 3385^{m}, Obs. drop tension, correlated the depth & applied 180^{klbs} overpull on string. Fired the colliding shots. POOH to surface & L/d equipment. Worked on string to get free. POOH 60^{m} of string w/ 7-5/8" overshot to surface & L/D same.
P/U & M/U used 8-3/8" M.M.J mill & RIH to 3260^{m}. Washed down to 3300^{m}, hard wash down to 3306^{m} while string stall several times. Continued medium wash & ream down to 3384^{m} & hard wash & ream down to 3390^{m} while got 240^{bbl} gas cut mud & huge amount of Asphaltene & CIL cover on shakers. Commenced milling obstructions f/ 3390 to 3391^{m} w/ NL.NG. POOH the milling BHA to surface & L/D.
P/U & M/U 7-5/8" overshot & RIH to 3391^{m} to TOF, tried to engage with fish several times, No success. Commenced POOH the string & fishing BHA to surface. P/U & M/U used 8-3/8" M.M.J. mill& RIH to BTM. Took weight at 3390.7^{m}, commenced milling f/ 3390.7 to 3391.9^{m}, POOH 8-3/8" milling BHA to surface & L/D same. P/U & M/U 7-5/8" overshot & RIH to tag the fish at 3391.9^{m}. Due to tubing & casing annulus filled with junk & Asphaltene, unable to guide overshot into the fish. Commenced POOH overshot & fishing BHA to surface. P/U & M/U used 8-3/8" M.M.J. mill & RIH to 3391.9^{m}. Commenced milling the fish to 3392.7^{m}, worked on junk several times & POOH milling BHA to surface. P/U & M/U 8-3/8" M.M.J. mill & 9-5/8" scraper & RIH to 3350^{m}. POOH milling BHA & scraper to surface. R/U wireline equipment & assembled 3-5/8" CCL-GR-CAST. RIH logging equipment to 3350^{m} & logged up to 35^{m}. POOH to surface while logging f/ 3300 to 3150^{m}, R/D wireline equipment & RIH w/ OEDP to 3390^{m} while L/U CMT line & prepare for CMT job.

Side Track 8 – 1/2" Hole Size Summary:

L/U CMT line to string. Pumped 8^{bbl} 75^{pcf} brine as spacer ahead. Mixed & pumped 105^{sxs} (SV: 25.4^{bbl}, SW: 118^{pcf}) CMT "G" Delijan, pumped 1^{bbl} 75^{pcf} brine as spacer behind, displaced w/ 170^{bbl} 108^{pcf} mud. WOC to get hard, performed static flow check. POOH w/ OEDPs. P/U & M/U 8-1/2" TCI bit & RIH to 3130^{m}. Took weight, W & R/D f/ 3130 to 3170^{m} & W/D to 3310^{m}, CBU, Obs. CMT slurry on shakers. Continued W/D to 3347^{m}, took weight. D/O hard CMT to 3350^{m}. Performed positive pressure test by applying 1000^{psi} for 15min. Ok. Commenced POOH 8-1/2" TCI bit & D/O BHA to surface. (bit dull grade: 1-1-WT-A-E-X-NO-BHA).

P/U & M/U used 8-1/2" TCI bit & 9-5/8" scraper & RIH to TOC at 3350^{m}. scrap f/ 3130 to 3350^{m}, 3 times each stand. Pumped & Circ. out 50^{bbl} hi-vis pill till shakers clean.

POOH 8-1/2" TCI bit & 9-5/8" scraper to surface & L/D. (bit dull grade: 1-1-WT-A-E-X-No-BHA)

P/U 1 joint 5" DP & M/& 9-5/8" hydraulic whipstock Assy. & ran to 20^{m}, M/U UBHO & align to whipface. Continued run whipstock Assy. to 3340^{m} while F/U string w/ fresh mud & passed drift thru all tubulars. R/U wireline logging equipment & RIH w/ gyro tools 3317^{m} (UBHO depth). Oriented whipface on 90 deg. POOH gyro tools to surface & R/D wireline equipment. L/U CMT line to string & performed pressure test to 3500^{psi}, Ok. Set whipstock packer at 3339.08^{m} (bottom of whipstock Assy. at 3340^{m}) w/ 3500^{psi} stepwise. Bleed off pressure & performed 75^{klbs} overpull to shear the screws on the rugby mill, L/D CMT line. (top of whipface: 3333^{m}, Btm of Whipface: 3337^{m}). Applied 2000^{psi} pressure through the string for breaking 2 No. of nozzles plug, Ok.

Commenced milling as side track #1 with controlled parameter f/ 3333.3 to 3337.2^{m} w/ NL.NG. Continued milling to 3341.3^{m}. Confirmed KOP at 3338.6^{m} by geologist. B/R & R/D window interval f/ 3333.3 to 3341.3^{m} several times to smooth. Pumped 30^{bbl} hi-vis pill & CBU till shakers clean. Commenced POOH w/ 8-1/2" TCI bit & L/D same.

P/U new DHM Lang Fang, adjusted AKO 1.5 deg. P/U & M/U used 8-1/2" PDC bit, 6-1/8" UBHO & 6-1/2" NMDC, performed shallow test of tools, Ok. RIH to 1500^{m}, while fill up string every 10 STDs, w/ NL-NG. Performed shallow test (w/ GPM: 385, SPP: 1170^{psi}) & took signal, Ok. Cont. RIH to 3337.4^{m} (BTM of Whipface @ 3337.6^{m}), Took weight, POOH to 3332^{m} (Top of Whipface @ 3333.3^{m}), Turned string 90 Deg to right, ran back to 3339.5^{m}, took weight, POOH to 3338.5^{m}, pumped 20^{bbl} Hi-Vis Pill, RIH w/ pumping (GPM: 450, SPP: 2030^{psi}) & rotation (RPM: 20) to 3339.5^{m}, took weight, W&R to 3341.30^{m}, w/ NL-NG. Commenced directional drlg as rotation mode f/ 3341.3 to 3383.5^{m}. Due to Obs. drop inclination, decision was made to POOH, stopped drilling, POOH to 18^{m}, while Circ. cross wellhead, w/ NL-NG. Performed pressure test of 6-3/4" D.H.M & MWD tools w/ 8-1/2" PDC Bit (GPM: 400, SPP: 800^{psi}), Obs. No Signal of MWD. L/D MWD tools, POOH to surface. L/D 8-1/2"PDC Bit, dull bit grading: (1-2-BT-C-X-I-WT/HC-BHA).

P/U & M/U used 8-1/2" B.Bit #02 RR3 & RIH w/ last 6-3/4" D.H.M, P/U new 6-3/4" MWD tools & RIH to 18^{m}, align tools, P/U 6-3/4" Gyro Sub, align tools, performed shallow test (GPM: 400, SPP: 800^{psi} & GPM: 500, SPP: 1200^{psi}), Ok, Cont. RIH directional BHA w/ gyro sub to 3379^{m}. took weight, W/D to BTM at 3383.5^{m} while took survey at 3354.3^{m} (Inc.: 1.1 deg, Az.: 161.4 deg) & 3369.7^{m} (Inc.: 0.9 deg, Azi.: 145.9 deg). POOH to 3377.5^{m}, about 6^{m} off bottom. R/U logging equipment, RIH gyro tools

as wireline to 3358[m] (gyro sub depth), adjust tools face of DHM. POOH wireline to surface & R/D logging equipment. RIH to BTM, resumed drlg as slide mode f/ 3383.5 to 3390.7[m]. Continued drlg as slide mode & rotation to 3415.5[m]. CBU till shakers clean. Commenced POOH on elevator to 3330[m], with good hole condition. Cont. POOH to surface. L/D jar & gyro sub & directional BHA.

P/U new 6-3/4" DHM, adjusted AKO 1.5 deg. P/U & M/U used 8-1/2" PDC bit, M/U 6-3/4" float sub + 6-1/2" UBHO +6-1/2" NMDC, performed shallow test of BHA, Ok. Performed drlg assembly offset. RIH to 3415.5[m] while W/D last stand & filled up every 10 stds. Commenced drlg as rotation & slide mode f/ 3415.5 to 3454[m] while W & R/d every last drilled std before connections. Continued drlg as rotation & slide mode to 3522[m]. POOH with B/R to as wiper trip to 3400[m] with good hole condition. W & R/D to BTM. In order to drop inclination commenced drlg as slide mode f/ 3522 to 3524.5[m] w/ NL.NG. Continued drlg as rotation as slide mode to 3666.5[m]. While drlg string got stall & stuck several times in sliding mode drlg. POOH with B/R as wiper trip to 3530[m] & RIH back to BTM with good hole condition. Pumped & spotted 70[bbl] inhibited hi-vis pill & POOH on elevator to surface while Circ. cross wellhead w/ NL.NG & L/D BHA.

M/U used 8-1/2" PDC bit & drlg BHA w/ 8-1/2" stabilizer & RIH to 3445[m]. Took weight at this depth. RIH with R/D to 3448[m], string got stuck, worked on stuck by jarring up w/ max. 150[klbs] overpull to get free. Continued RIH with hard R/D to 3666.5[m] w/ NL.NG. commenced drlg to 3781[m] w/ NL.NG. String got stuck while B/R last drilled stand. Worked on stuck by applying torque & jerk down to get it free. Stopped drlg due to fault in TDS (frequent rotation loss while drlg). RIH back to BTM & resumed drlg f/ 3781 to 3835[m] w/ NL.NG. Commenced POOH drlg BHA to surface while CBU cross wellhead w/ NL.NG. L/D same. (bit dull grading: 2-5-BT-N-X-1/32"-CT-PR)

P/U & M/U new 8-1/2" PDC bit & RIH with drlg BHA to 3750[m] with good hole condition. Washed & R/D to BTM at 3835[m] & clear tight spots. Commenced drlg with low parameters to 3891[m]. CBU in order to take last sample while B/R last drilled stand w/ NL.NG. TD confirmed at 3891[m]. Soft B/R as wiper trip f/ TD to 3840[m], soft R/D to BTM. Circulated out 40[bbl] hi-vis pill to clean shakers. Spotted 130[bbl] inhibited hi-vis pill w/ NL.NG. Commenced POOH 8-1/2" drlg BHA on elevator to surface with good hole condition & L/D same. (bit dull grading: 1-1-BT-N-X-I-NO-TD)

7" Liner Operation Summary:

Closed SBR & VBR top rams, retrieved wear bushing, set plug tester & performed BOP test as NIOC policy, Ok. R/U 7" liner running equipment. P/U & M/U 7" liner equipment & RIH to 49^{m} while M/U swage & break Circ. to confirm float function for flow passing thru, Ok. Continued RIH to 746^{m} w/ NL.NG. Install 7" * 8-1/2" spiralizer. P/U & M/U rotational hydraulic 7" liner hanger Assy., while installing wiper plug on slick joint f/ LG, Ok. M/U circulating swage & established Circ., check POB sealing, Ok. Filled up tie back sleeve w/ oil & grease. M/U TDS on setting tools neck & continued RIH to 3890.5^{m}. Recorded P/U & S/O string weight on M/D (320 / 290^{klbs}). Dropped ball, chased the ball to seat in LDC & increased pressure to 1800^{psi}. held pressure & set 7" liner hanger at 3890.5^{m} by applying 70^{klbs} weight & applied totally 100^{klbs} weight.

L/U CMT line, M/U CMT head on string. L/U CMT line to CMT head, P/U string, increased pressure to 3100^{psi}, Obs. shear ball seat & got returned. Released setting tools, P/U string 0.8^{m} performed pull test & confirmed string is free, M/U CMT head on string. L/U CMT line to CMT head, P/U the string & established circulate thru CMT head manifold by rig pump up to 900^{psi}, while preparing CMT solution. Performed pressure test on CMT line & pump truck & batch mixer, Ok. CBU w/ NL.NG. Pumped 10^{bbl} spacer ahead by rig pump, pumped 10^{bbl} chemical wash, mixed & prepared 397^{sxs} (SV: 95^{bbl}, SW: 118^{pcf}) CMT "G" delijan, pumped 95^{bbl} CMT slurry 118^{pcf}. Displaced CMT with totally 260^{bbl} mud. Obs. shearing after pumped 177^{bbl} mud & 2600^{psi}. Obs. bumping at 3000^{psi} w/ NL.NG. Held pressure as integrity test for 10 min. Ok. Released pressure & check back flow, No return. B/O CMT line & P/U string for 1^{m}, slack off 30^{klbs} on tie back sleeve& set liner hanger top packer. L/D CMT head & check string weight, Ok.

POOH 12 stds to 2788^{m}, flushed the string. Continued POOH 5 more stds. CBU w/ NL.NG. Performed static flow check, resumed POOH w/ 7" liner hanger setting tools to surface. Filled up the well, L/D liner hanger setting tools. Set 11" wear bushing in T.H.S, P/U & M/U 8-1/2" TCI bit Kingdream & RIH to 3127^{m}, took weight at this depth, washed down w/ 320 GPM to 3129^{m}, tried to wash down w/ 10^{klbs} weight without any succeed. Commenced D/O soft to medium CMT f/ 3129 to 3139^{m}, Cont. D/O medium

to hard CMT to 3149.5[m], confirmed 7" liner lap at this depth. Pumped 50[bbl] Hi-Vis Pill & CBU till the hole got clean w/ NL-NG. POOH 8-1/2" TCI bit & D/O BHA to surface & L/D same w/ NL-NG. Bit dull grade 1-1-WT-A-E-I-No-BHA.

P/U & M/U & RIH 6-1/8" MT bit new Kingdream & C/O BHA to 3150.5[m] w/ NL-NG. while washed down, pass 7" liner lap & D/O hard CMT & 7" POB f/ 3150 to 3152.5[m], dressed & smoothed POB interval without rotation several times. Continued RIH to 3784[m], while washed & reamed down to 3840[m], D/O POB, D/O hard CMT to LDC depth at 3853.5[m]. Pumped 30[bbl] Hi-Vis Pill & CBU till the hole got clean. Commenced POOH 6-1/8" MT bit & C/O BHA to surface & L/D w/ NL-NG. Bit dull grade 7-2-BT-(N, M)-E-I-ER-BHA.

P/U & M/U 6-1/8" used Kingdream w/ scraper & RIH to BTM at 3853.5[m] while scraped inside 9-5/8" CSG & 7" liner several times. POOH to surface, B/O & L/D bit & scraping BHA.

R/U & assembled Sealand Co. CCL/GR/SBT/VDL logging tools. RIH wireline logging tools to 3145[m] & logged down to 3852[m]. Logged up f/ 3845 to 3050[m]. Ran back to 3450[m] to repeat the log. Logged up f/ 3450 to 3050[m]. Powered off tools & POOH to surface, R/D Sealand logging tools & equipment.

Dry Test Summary:

P/U & M/U OEOC 9-5/8" dry test tools for 7" liner lap & RIH to 30[m] above liner lap at 3120[m]. Used 62.4[pcf] water as cushion to 2627[m]. R/U dry test surface equipment & L/U to CMT line. Recorded P/U & S/O string weight 230/225[klbs], rotated string 6 rounds forward, S/O 25[klbs] & set 9-5/8" dry test packer at 3119[m]. Obs. hydro-spring tester valve opening indication on M/D. Monitored open period 3hrs. Obs. no bubble & annulus level was static. S/O weight & rotated string 11 rounds forward closed DCIP valve. Recorded close period for 6hrs. & Obs. no bubble. Established reverse circulate & got water cushion as same as F/U volume. Continued reverse circulation till Mw uniformed in &

out to 88^{pcf} & secured the well. After test Obs. pressure increase to 213 psi. Unset 9-5/8" dry test packer w/ normal P/U weight. B/O & L/D dry test surface equipment, meanwhile M/U 5" circulation swage & established circulate w/ NL-NG. Performed static flow check for half an hour, Static. Commenced POOH 9-5/8" dry test assy. to surface, B/O & L/D tools.

6 – 1/8" Hole Size Summary:

Changed BOP top VBR, pressure tested same to 7500^{psi} for 10min. Ok. Set 11" wear bushing in T.H.S. P/U & M/U 6" M.M.J.mill & RIH to 3853^{m}. Commenced D/O LDC & hard CMT f/ 3853 to 3891.5^{m}. Commenced drlg formation w/ 6" M.M.J.mill 3893.5^{m}. Smoothed 7" liner shoe several times. Performed flow check, Static. POOH milling BHA to surface & L/D same w/ NL-NG.

P/U & M/U 6-1/8" new PDC bit Beste & RIH to 3871^{m}, connected TDS & established circulation & displaced the well with fresh 100^{pcf} KCl-Poly-$CaCO_3$ mud until Mw uniformed on 100^{pcf} w/ NL-NG. L/U CMT unit to circulation swage, closed top rams & performed FIT by applying pressure thru string to 7500^{psi} step by step. Monitored & Recorded pressure on choke manifold. FIT @3871^{m}, EMW: 108^{pcf}

Time	03:35	03:40	03:50	03:55	04:10
Rate (bbl/min)	0.5	0.5	0.5	0.5	0.5
Volume (bbl)	1	2	2.2	2.2	2.2
Pressure (psi)	200	400	500	600	700

Resumed RIH to BTM, pumped Hi-Vis Pill & commenced drlg formation f/ 3893.5 to 4003m while B/R & R/D last drilled stand. Obs. gas cut mud & max 82% total gas. Stopped drlg & decision was made to increase Mw to 104pcf by added kill mud to system. Resumed drlg formation f/ 4003 to 4035m w/ NL-NG. POOH w/ hard B/R to 4014m. string got stuck at 4022m & made it free by applying different parameters.

Continued POOH w/ hard B/R to 3870m w/ NL-NG. RIH back while R/D & B/R every stand & checked intervals without RPM to TD. Resumed drlg formation f/ 4035 to 4140m as TD.

Pumped 30bbl Hi-Vis Pill & circulated same out. POOH as condition trip with B/R to 3891m (7" liner shoe) & performed static flow check, Static. RIH back on elevator to BTM with good hole condition. Pumped & circulated out 30bbl Hi-Vis Pill. Pumped & spotted inhibited Hi-Vis & Hi-Dens fresh mud at BTM. POOH to surface & L/D 6-1/8" bit & BHA, bit dull grade: 0-0-NO-A-X-I-NO-TD.

P/U & M/U 4-1/2" liner assy. included float shoe, liner joints, float collar, LDC & RIH to 62m. F/U string & continued RIH to 353m. P/U & M/U PPA rotational hydraulic set/Mechanical release liner hanger assy. included tie back sleeve, LG & top packer, POB & rotational hydraulic hanger. Recorded P/U & S/O hook load 12/12^{klbs}, F/U tie back sleeve w/ oil & grease & Cont RIH 4-1/2" liner on 3-1/2" & 5"DP to 4140m (btm) Set hanger. M/U CMT Head on string. L/U CMT Line to CMT Head, L/U CMT Line to CMT Head. Perform cmt job as per plan. POOH to surf. M/U 6" MMJ Mill RIH w/ 6" MMJ Mill and RIH to 3480m, W/D to 3720m. D/O cmt to 3780.5m. Circ. Btm's up. POOH to 200mwhile L/D excess tubulars till, Cont. POOH f/ 200m to Surf. L/D excess tubulars in derrick. RIH w/ 3-1/2" J.Mill on 3-1/8" DC & 2-7/8" DP Jt by Jt to 254m, Cont. RIH w/ 3-1/2" J.Mill on 3-1/8" to 3780.5m (4-1/2" L.Lap). commence D/O med. Cmt f/ 3780.5 to 3784m, 'D/O POB, Cont. wash and ream & Clean out inside 4-1/2" LNR to 4030m, Cont. wash and ream & Clean out inside 4-1/2" LNR to 4085m. D/O Med to Hard CMT f/ 4085 to 4102m. Tag LDC @ 4102m. Pump & Circ. Out Hi-Vis Pill. POOH w/ 3-1/2" M.M J.Mill & Clean out BHA f/ 4102 to 1150m, 'Cont. POOH w/ 3-1/2" M.M J.Mill & Clean out BHA f/ 1150m to surface, RIH w/ open end string & 7" Scraper BHA to 917m, Due to change in plan from client side, POOH w/ OEDPs to surface, RIH w/ Clean out BHA to 450m, Cont. RIH w/ Clean out BHA to 4100m, Cont. Wash & Ream Dn to 4102m, D/O Pump Dn Plug, Wiper Plug & 4-1/2" LNR LDC. 'Cont. D/O Hard CMT to 4134m, Circ. Out Hi-Vis Pill, Spot 20 bbl Non-Solid Brine, POOH to 3100m, Cont. POOH w/ 3-1/2" M.M J.Mill & Clean out BHA f/ 3100m to

surface, Change top rams to 4-1/2" x 7" VBR, Press test same, Run CCL/GR/RBT Wireline logging tools to 4120m, POOH to 1900m, Cont. POOH w/ CCL/GR/RBT Wireline logging tools to surface. Run CCL/ 2-7/8" Gun as dummy run to 4120m. RIH w/ 3-1/2" Mill & Clean Out BHA to 2550m, String plug, work on same & Unplug, RIH w/ clean out BHA to 4134m, Circ. Out tandem pill, Spot Non-Solid Brine, POOH to 3350m, Cont. POOH w/ 3-1/2" M.M. J.Mill & Clean out BHA f/ 3350m to surface. Run CCL & 2-7/8" Blank Gun as dummy run to 4134m. RIH w/ 2-7/8" WCP HSD Gun Assy as Run #1 to 4124.7m. Fire the gun. POOH to 100m. Wait on daylight. Perform 2nd run of perforation f/ 4120.7 - 4117.7m to & f/ 4092 to 4088.2 m, Wait on daylight, RIH w/ 2-7/8" WCP HSD Gun Assy as Run # 4 to 3587m, Try to pass this depth, RIH w/ Clean out BHA to 1600m, Meanwhile Slip & Cut Drlg line @ 450m, Cont. RIH w/ Clean out BHA f/ 1600 to 4128m, CBU, Spot Non-Solid Brine, POOH to 1750m, Cont. POOH w/ 3-1/2" M.M J.Mill f/ 1750m to surface, Run dummy run to 4080.2m, RIH w/ 2-7/8" WCP HSD Gun Assy as Run #4 to 4080.2m. Fire the gun. POOH to 100m. Wait on daylight, Cont. wait on daylight. Resume POOH W/L w/ WCP HSD gun assembly f/100m to surface, Run dummy run to 4075m, RIH w/ 2-7/8" WCP HSD Gun Assy as Run #5 & #6 as per plan. Fire the gun. POOH to Run #6 to 100m. Wait on daylight, 'Cont wait on daylight. Resume POOH W/L w/ WCP HSD gun assembly f/100m to surface, Run dummy run to 4060m, RIH w/ 2-7/8" WCP HSD Gun Assy as Run #7 & #8 as per plan. Fire the gun. POOH to Run #8 to 100m. Wait on daylight. 'Cont wait on daylight. Resume POOH W/L w/ WCP HSD gun assembly f/100m to surface, Run dummy run to 4060m, RIH w/ 2-7/8" WCP HSD Gun Assy as Run # 9 & # 10 as per plan. Fire the gun. POOH to Run # 10 to 100m. Wait on daylight. 'Cont wait on daylight. Resume POOH W/L w/ WCP HSD gun assembly f/100m to surface, Run dummy run to 4060m, RIH w/ 2-7/8" WCP HSD Gun Assy as Run # 11 & # 12 as per plan. Fire the gun. POOH to Run # 12 to 100m. Wait on daylight. 'Cont wait on daylight. Resume POOH W/L w/ WCP HSD gun assembly f/100m to surface, Run dummy run to 3989.65m, RIH w/ 2-7/8" WCP HSD Gun Assy as Run # 13. Fire the gun. POOH to surface. R/D WL unit. Press. Test BOP. P/U and M/U 3-1/2" J.Mill and RIH to 4050m

Cont. RIH w/ 3-1/2" M.M.J.Mill and RIH to 4134m (btm) Circ. Btm's up. Spud 25 bbl Comp. fluid @ btm. POOH to 2300m,Cont. POOH f/2300m to surface while L/D exceess tubulars. Perform CCL logging. RIH & L/D 6 Jts 3-1/2" DP & 15 Jts 4-3/4" DC, 'RIH w/ 7" Scrapper to 3286m. Scrap PKR interval 3286 to 3325m. Cont RIH to 3777m. Pump Hi-Vis. Circ. Btm's up, Pump Hi-Vis. Circ. Btm's up. Pump 60 bbl Hi-Vis pill (104pcf, Ferobar free) + 20 bbl Hi-Vis pill (82 pcf brine) followed by Synthetic Completion Fluid and displace the well, Obs. The well, static. POOH and L/D DPs jt by jt to 2700m, 'Cont. POOH w/ 7" scrapper while L/D Jt by Jt f/ 2700 to 770m, Cont. POOH w/ 7" f/ 770m to surface, R/U slick line & TBG running equip. Start RIH 3-1/2" X 4-1/2" comp string to 73m, Cont. RIH 3-1/2" X 4-1/2" comp string to 406m. Run 2.8" gauge ring. Work on rectify lakages of pump truck lines, Cont. RIH 3-1/2" X 4-1/2" comp string to 1470m. While press. Test string @ 406 & 1224m; OK, Cont. RIH w/ Totally 284 Jts 4-1/2" TBG (18.9#, L-80, HSM-3) & 22 Jts 3-1/2" TBG (10.2#, L-80, HSM-3) to 2932m. While Press test completion string @ 2010 & 2932m; "OK". 'Run completion string to 3257m, M/U TR3SV Assy & Perform P/T TR3SV, RIH to 3274m, Perform P/T Completion string & inflow test of flapper, Cont. Run to 3325m, Perform P/T completion string, 'Change L/J, P/T Completion string; OK. Set Protection Sleeve. Ret. check valve f/ SSD. Set Plug in No-Go. Due to Client Request, Decided to repeat string Press test. Ret. Plug f/ No-Go. Set Check valve in SSD. P/T Completion string; OK. Ret. check valve f/ SSD. RIH w/ Plug to top of SSD. In order to record upward Wt.; Obs. Suddenly drop tension. POOH to surface; Obs. About 830m Slick line wire, rope socket, 12 ft stem, 6 ft Mech. Jar, Running tools & 2.75" Plug left in hole. Due to lack of stem; wait on Rec. stem. 'Run LIB, Run 2.8" Wire grab w/o no catch wire, Ret. P.Sleeve, Run 3.2" Wire grab; Recover 2 ft wire, Run 3.2" 3 leg wire grab; Recover fish w/o plug, Set P.Sleeve, Run 2.8" Wire grab. 'Ret. Plug, Run Gauge ring to 3330m, Set Plug & Prong in No-Go, Run Shifting tool to SSD, Set PKR, Perform Pull test, Land TBG HGR, P/T String to 5000 psi, 'P/T tie downs, Ann, Ret. P.Sleeve, Back off & L/D L.J, Install TWCV & P/T same against SBR, N/D BOP Stack, N/U BMV & Related P/T,

N/U XMT, P/T same, Ret. TWCV, Set P.Sleeve, Ret. Prong & Plug, Ret. P.Sleeve, Install BPV, Close All XMT Valve except BMV & Secure the well. Released the rig.

Summary of Workover Operation #2

The AZNS – 127 workover well was De-Complete by rig OEOC – 201 on Pad 54 from 2025-Dec-29 to 2026-Mar-06, as described in the following:
Spud the rig 201 OEOC as per spud check list, Operations remain suspended pending the client. Spud the Rig 201 @ 00:00 - 1404.10.18, Start Operation; Prepare & L/D 5" DPs; M/U stands and rack back in derrick jt by jt (Totally 72 Stds 5" DP), While Hammer, Wash and Pass Drift Thru. All Jts; Prepare S.Poly.CaCo3 Mud (960bbl Drlg Mud 104pcf on hand); Meanwhile Check & Record Annulus pressures of all Wellhead sections as follows: Comp. Strg Press. : 1850psi; Ann. Pressure: [Section C: 4900psi, Section B: 0 psi; Section A:0 psi]; All wellhead sections, but Section C, confirmed pressure-free and stable. Cont. Prepare & L/D Tubular; M/U stands and rack back in derrick jt by jt (Totally 116 Stds Tubular [44 Stds 5" DP G grade; 60 Stds 5" DP S grade; 1 Std 6-1/2" DP; 3 Stds 4-3/4" DC; 8 Stds 3-1/2" DPs]), While Hammer, Wash and Pass Drift Thru. All Jts ; Meanwhile Prepare S.Poly.CaCo3 Mud (Totally 1095bbl Drlg Mud 104pcf; 355 bbl Drlg Mud 100pcf). Cont. Prepare & L/D Tubular; M/U stands and rack back in derrick jt by jt (Totally 133 Stds Tubular [44 Stds 5" DP G grade; 60 Stds 5" DP S grade; 1 Std 6-1/2" DC; 3 Stds 4-3/4" DC; 25 Stds 3-1/2" DPs]), While Hammer, Wash and Pass Drift Thru. All Jts; Meanwhile Prepare S.Poly.CaCo3 Mud (Totally 1440bbl Drlg Mud 106pcf on hand); Prepare Location to set up CT & Pump Truck; Set the same Eqps. ; M/U 4-1/16" 10k Comp. FLG C/W 1502 on X-Mas Tree Kill Valve; M/U 2-1/16" 10k Comp. FLG on T.H.S in progress. L/U Chiksan pipes to X-Mas Tree & T.H.S, Press. Test lines W/ 6000psi, Ok; Attempt to Drop & Release Ann. Pressure Thru. Choke manifold & Burning line F/ 4900 psi To 2000psi Sev. Times step by step, After every step, Monitor the Ann. Press. Thru. Choke manifold, Obs. Pressure up Ann. To 4400psi; P/U & M/U Wellhead Lubricator and Press. Test, Ok, Ret. TWCV, L/D Wellhead Lubricator and X-Mas Tree Cap; R/U Slick Line BOP Press. Test Slick Line BOP & Lubricator W/ 6000psi / 15min, Ok; RIH W/ 3.400" Ring Gauge Tool Strg To TR3SV Depth, Ok. RIH w/ 3.437" Protection Sleeve Tool Strg, Obs. Leak. on choke manifold valve; POOH Protection Tool String; Change Choke manifold valve; RIH w/ 3.437" Protection Sleeve Tool Strg & Set in position; RIH w/ 2.5" Ring Gauge Tool Strg To 406m, Try to Start POOH Slickline Tool Strg to Surface, Obs. Tool String is stuck, work on stuck and make it free; POOH Slick line Tool String To Surface; R/U Coiled Tubing Facilities; M/U C.T BHA and Press. Test the same; Change Choke manifold valve; Cont. RIH W/ 1-11/16" C.T BHA To 2500m. Cont. RIH W/ 1-11/16" C.T BHA

2500 To 3980m, While Circ. Thru. Choke Manifold @ 0.2BPM F.R & 3500psi Back Pressure; Disp. The Well W/ 1-11/16" C.T BHA @ 3980m Thru. Choke Manifold @ 0.5-0.7BPM F.R w/ Max. Pumping Press. 4000psi & 3500psi Back Pressure; POOH 1-11/16" C.T BHA F/ 3980 To 3000m; Divert & L/U to X-Mas Tree Kill Valve; Cont. Disp. The Well @ 3000m Thru. Choke Manifold @ 3BPM F.R w/ Max. Pumping Press. 2600psi & 2100psi Back Pressure; POOH 1-11/16" C.T BHA To Surface; Kill The Well using W&W Method. Cont. Kill The Well using W&W Method Confirm Stable Return & Gradually Replace Well Fluid W/ 112pcf Mud; At mud return MW of 105pcf, Divert Return To Active Pit; Confirm Well Dead, Bleed off Press. To 0psi; CBU Thru. Comp. Strg & Choke Manifold; Confirm Uniform 112 pcf In / Out MW; Obs. Well for 1Hr. ; NL-NG; R/U Slickline Surface Tools, R/U Slick Line BOP and install on X-Mas Tree Head; P/U & Assemble 2.75" Check Valve Tool String and RIH To 3294m (Top of SSD) . Cont. RIH w/ 2.75" Check Valve Tool Strg to 3294m (Top of SSD) to set in NO-GO, Tool String is stuck @ 3294m, work on stuck and make Tool Strg free; Cont. RIH W/ the same Tool String To 3303m; Obs. Slickline Cable Tension Drop @ 3303m, POOH 2.75" Check Valve Tool Strg to Surface; B/O & L/D Slickline Tool Strg; Ret. Protection Sleeve; Set TWCV, Pressure Test TWCV @ 7500psi, Ok; N/D X-Mas Tree; While N/D, Obs. Reservoir fluid Leakage on CIL; Secure both CILs; N/U X-Mas Tree; Ret. TWCV; CBU; R/U Slickline Surface Tools in progress. R/U Slickline Tools; Press. Test Eqps. ; RIH w/ Protection Sleeve, Set in position; POOH Running Tools to surfac; RIH w/ 2.75" Check Valve Tool String to set in SSD and RIH To 3226m; Obs. Slickline Cable Tension Drop @ 3226m, Attempt to pass the same Depth Sev. Times, No Success; POOH 2.75" Check Valve Tool Strg to Surface; B/O & L/D Tool Strg; 4" GS Pulling Tool String and RIH w/ same to Ret. Protection Sleeve; POOH the same Tool Strg to surfac, Set TWCV in TBG HGR; Pressure Test TWCV @ 7000psi, Ok; N/D X-Mas Tree; N/U BOP in progress. Cont. N/U 13-5/8" 10k BOP Stack; Press. Test Annular W/ 3000psi, Ok; Attempt to perform Press. Test of Top & BTM Rams Sev. Times, No Success due to BOP Stack leakages; Work on fixing BOP leakages . Fix BOP Stack leakages, Cont. BOP Test; Ret. 4" TWCV; Attempt to Unlatch Comp. Strg F/ Anchor seal w/ Apply 310klbf pull, No Success, while Obs. No movement in Traveling joint; L/U Rig pumps to T.H.S outlets, Apply 600psi Thru. T.H.S outlets to wrest TBG HGR F/ T.H.S Bowl, Ok; Attempt to unlatch Comp. Strg w/ Apply 350klbf pull & Tq. 5klbf.ft, while rotating 16 turns of Comp. Strg, No Success, and Obs. No movement in Traveling joint; CBU Thru. Comp. Strg to Uniform 112 pcf In / Out MW, NL-NG, . Cont. CBU Thru. Comp. Strg, Confirm Uniform 112 pcf In / Out MW, NL-NG; Attempt to Unlatch Comp. Strg F/ Anchor seal w/ Apply Tq. 4klbf.ft, No Success; While wait on Client to make decision, Cont. CBU Thru. Comp. Strg, Confirm Uniform 112 pcf In / Out MW, NL-NG; Meanwhile, at 2Hrs. Intervals, Attempt to Unlatch Comp. Strg w/ Apply Max.

310klbf pull & Tq. 4klbf.ft, while rotating 4 turns of Comp. Strg, No Success, and Obs. No movement in Traveling joint, NL-NG. While wait on Client, Cont. CBU Thru. Comp. Str, NL-NG; Meanwhile, at 2Hrs. Intervals, Attempt to Unlatch Comp. Strg, No Success, and Obs. No movement in Traveling joint; Set TWCV, Press. Test, Ok; Hand up BOP; Extend CL to surf. , , Press. Test, Ok; N/U BOP on T.H.S, Press. Test w/ 2500psi, Ok; Ret. 4" TWCV; P/U & M/U Runing Tools HGR and Screw on TBG HGR; M/U S/L Tools, Press. Test, Ok; Run Sleeve and set; RIH w/ 2.8 G.Ring to 3090m, POOH to Surf. ; RIH w/ 2.75 Check Valve to 3090, POH to Surf. ; RIH w/ 2.5 G.Ring to 3124; POH To Surf. P/U & Assemble 2.7" Gauge Ring Tool String and RIH To 3099m; Obs. Slickline Cable Tension Drop @ 3099m, Attempt to pass the point, No Success; POOH the same Tool Strg to 3050, Circ. Thru. Stg for half an hour; RIH w/ same Slickline Tool Strg to 3099m; Again Obs. Slickline Cable Tension Drop @ 3099m, Attempt to pass the point, No Success, POOH to surface; CBU Thru. Comp. Strg; R/D S/L Tools; R/U C.T Facilities; Press. Test the same, Ok; RIH W/ 1-11/16" C.T BHA To 120m, While Circ. @ F.R: 0.3BPM & Pump unit Press. : 1500psi, NL-NG. RIH W/ 1-11/16" C.T BHA To 3324m (NO-GO Depth), wash & clean this interval, POOH To Surf., L/D C.T BHA, P/U & assemble 2.75" SB Running + check valve to set in NO-GO, RIH To 1547m, took weight, try To Pass this point Sev. Times, No Succ. POOH To surf. L/D Tool Strg. P/U C.T 2-1/8" wash nozzle BHA & RIH To 800m while wash down to 800m; NL-NG . RIH w/ 2-1/8" C.T BHA to 3324m (NO-GO depth), as recirocate C.T at the same intervals Sev. Times, B/O & L/D C.T Surf. Equip. R/U slick line Equip. M/U & assemble 2.75" SB running tools + check valve to 3089m took weight, try to pass this point Sev.Times, No Succ. POOH to Surf, L/D Check valve, Circ. BTM's up thru Strg; NL-NG . M/U & assemble 2.75" plug & check valve for SSD at 2 stage, RIH to 3089m, took weight, try to pass this point Sev. Times, No Succ. POOH to Surf. L/D them. M/U & assemble 2.75" plug for NO-GO, RIH to 3089m, took weight, try to pass this point Sev.Times, No Succ. POOH to Surf. L/D 2.75" plug, Circ. Thru Comp. strg, NL-NG. . M/U & assemble 2.75" plug & check valve for SSD @ 2 stage, RIH to 3089m, took weight, try to pass this point Sev. Times, No Succ. POOH to Surf. L/D them. M/U & assemble 2.75" plug for SSD & NO-GO @ 2 stage RIH to 3089m, took weight, try to pass this point Sev. Times, No Succ. POOH to Surf. L/D them. try to unlatch Comp. Strg. from anchor seal w/ different parameters, Sev. Times, No Succ. . M/U & assemble 2.75" plug & check valve for SSD @ 2 stage, RIH to 3089m, took weight, try to pass this point Sev. Times, No Succ. POOH to Surf. L/D them. M/U & assemble 2.75" plug for SSD & NO-GO @ 2 stage RIH to 3089m, took weight, try to pass this point Sev. Times, No Succ. POOH to Surf. L/D them. try to unlatch Comp. Strg. from anchor seal w/ different parameters, Sev. Times, No Succ. . M/U & assemble 2.75" plug & check valve for SSD @ 2 stage, RIH to 3089m, took weight, try to pass this point Sev. Times,

No Succ. POOH to Surf. L/D them. M/U & assemble 2.75" plug for SSD & NO-GO @ 2 stage RIH to 3089m, took weight, try to pass this point Sev. Times, No Succ. POOH to Surf. L/D them. try to unlatch Comp. Strg. from anchor seal w/ different parameters, Sev. Times, No Succ. . R/U wireline Equip., run 2-1/8" dummy run to 3320m, POOH to Surf. M/U & assemble 2-1/8" Colliding w/ CCL tools RIH 3304m (colliding depth, 1no. pup joint top of anchor seal) , Correlate the Depth, String fire the colliding shot. Obs. Not indicate of shot. POOH to Surf. assemble same 2-1/8" colliding w/ CCL Tools as Run# 02 to 3303.75m, (same pup joint), Correlate depth, Fire the Colliding shot, POOH wireline to Surf., Obs. Shot "succ.", L/D Wire line equip., POOH & Check comp. strg. To got free, colliding Succ.Circ. Thru Strg., NL-NG While Circ. BTMs up R/U Casing running Equip. B/O & L/D TBG HGR, FLUTED SWAGE ADAPTER. POOH completion string while L/D 82Jts 4-1/2" TBG meanwhile Circ. Across wellhead, NL-NG. . POOH completion string while L/D 233Jts 4-1/2" TBG to 1072m. POOH Completion string while L/D 323 Jts 4-1/2" TBG & 16 Jts 3-1/2" TBG to surface, The parting from depth 3203m, R/D CSG Running Equip. Totally 183 Jts severe corrosion was Observed from 1800m on the body of Jts #157. P/U & M/U 5-5/8" Overshot & RIH to 185m, NL-NG . RIH with 5-5/8" Overshot to 3237m, Try to Cont. wash & Ream down with Sev. Parameters, No Succ. POOH to 1900m, C.W.H; NL-NG. Cont. POOH w/5-5/8" overshot to surface. L/D them. P/U & M/U 6" M.M.J.Mill to 3236.5m, wash down to 3238m. Cont. Wash & Ream down f/ 3238 to 3245m, Milling 30 cm as tubing , pump 60 bbl Hi-vis pill @ 3 stage, POOH 6" M.MJ.Mill & BHA to surface, L/D them. RIH w/ 5-5/8" O.Shot & Fishing BHA to TOF @ 3245m, Tag TOF. Work on catch to fish. POOH to 2450m. Cont. POOH 5-5/8" Fishing BHA F/ 2450m To Surface, (Obs. 14m of Fish recovered; Severe corrosion and washout were observed on the retrieved Fish); B/O & Release recovered Fish F/ 5-5/8" Over Shot; BOP Test as Per NIOC Policy; P/U & M/U 6" Milling BHA and RIH To 1210m, while F/U Strg & Break Circ. At 15 Stds interval, NL-NG. Cont. RIH W/ 6" Milling BHA F/ 1210 To 3147m(7" L.Lap Depth) On Elevator; Cont. RIH W/ 6" Milling BHA F/ 3147 To 3254m W/ Wash Dn, Hold up Strg Wt. @ 3254m; Cont. RIH F/ 3254 To 3258m W/ Wash & Ream Dn, Hold up Strg Wt. @ 3258m (TOF Depth); Start Milling Op. F/ 3258m and Mill 60cm of Fish while pump and Circ. Out 60bbl Hi-vis. Pill at two stage and Check Ditch Magnet (Take 6.5lbs Debris & Milling swarf); POOH 6" Milling BHA To 2880m; Slip & Cut 100ft Drill Line @ 2880, While Slow Circ. Thru. Strg; Cont. POOH 6" Milling BHA F/ 2880 To 1330m, NL-NG. Cont. POOH 6" Milling BHA To Surface; P/U & M/U Fishing BHA & Overshot and RIH To Engage W/ Fish W/ 30klbs, Pull out Strg W/ 60klbs Overpull (320klbs on Wt. Indicator), Ok; Lower Strg to 20klbs Overpull, Cont. Work on Fish W/ Apply Rotation on Strg, Suddenly Obs. Strg is released at 5th Turn of Strg Rotation at 5.5klbs.ft); POOH Strg & Check Strg Wt. W/ about 0.5klbs Over Wt. ; Check two more

times W/ Same parameters, Obs. No Engagement W/ Fish; Decide POOH to Surface Check Strg; POOH 5-5/8" Fishing BHA To 3144m, NL-NG. Cont. POOH 5-5/8" Fishing BHA To Surface To Check Strg; confirm engagement indications on Overshot; P/U & M/U 5-5/8" Fishing BHA; Cont. RIH W/ 5-5/8" Fishing BHA F/ 148 To 3147m On Elevator, While Pass Drift Thru. all Stds & Break Circ. at 30-Std interval; Conn. TDS and Attempt To Cont. RIH W/ 5-5/8" Fishing BHA F/ 3147 (7" L.Lap Depth) To 3258m W/ Wash Dn; Cont. RIH To 3258.6m; Guide Fish inside Overshot, Then to Engage W/ Fish, S/O Strg Wt. W/ 25Klbs, Pull Strg W/ 70Klbs Overpull; Prepare to POOH to Surface in progress. POOH 5-5/8" Fishing BHA F/ 3258m To Surface On Elevator; B/O & Check 5-5/8" Overshot, confirm engagement indications on Guide, Mill Control and Basket Grapple; P/U & M/U 5-1/4" Fishing BHA, Cont. RIH W/ 5-1/4" Fishing BHA F/ 148 To 3147m; Conn. TDS and Attempt To Cont. RIH W/ 5-1/4" Fishing BHA F/ 3147 (7" L.Lap Depth) To 3162m W/ Wash Dn, NL-NG. Cont. RIH W/ 5-1/4" Fishing BHA F/ 3162 To 3258m W/ Wash Dn; Perform Fishing Operation; POOH 5-1/4" Fishing BHA to surface; B/O & Release recovered 3-1/2" Pup Jt & CIV#2 F/ Overshot; B/O & L/D Fishing BHA, Recovered Comp. Strg (44m of Fish was recovered), Then All Pup Jts of Retrieved Comp. Strg, While Circ. C.W.H, NL-NG . Cont. B/O & L/D All Pup Jts of Retrieved Comp. Strg; P/U & M/U 6" Milling BHA RIH To 419m, F/U BHA and Break Circ. , Ok; Cont. RIH W/ 6" Milling BHA F/ 419 To 3081m On Elevator; Conn. TDS and Cont. RIH W/ 6" Milling BHA F/ 3081 To 3254m W/ Wash Dn; Cont. RIH F/ 3254 To 3300m W/ Soft Wash & Ream Dn, Hold up Strg Wt. @ 3300m (TOF Depth); Record Up & Dn ward Strg Wt. W/ & W/O Rotation; Perform Milling Op. F/ 3300m To 3301.4m, NL-NG. Cont. Milling Op. F/ 3301.4m To 3301.7m; Strg got stuck Sev. Times @ 3301.7m, work on Strg and free it; Attempt to Cont. Milling Op. W/ Different parameters, Unsuccessful due to high torque and Strg getting stuck; POOH F/ 3301.7 To 3151m W/ Pump out & Rotation; Obs. Strg is stuck @ 3151m, work on Stuck and free it; Cont. POOH F/ 3151 To 3130m W/ Pump out & Rotation; Work on Strg to release any potentially stuck junk on it; RIH back To 3301.7m W/ Wash Dn; Resume Milling Op. F/ 3301.7m To 3302.5m; Decide to POOH due to lack of progress in Milling Op. POOH 6" Milling BHA F/ 3301 To surface; Change Mill and Cont. RIH W/ 6" Milling BHA to 3147m, While F/U Strg & Break Circ. at 15-Std interval, NL-NG. 'Cont. RIH to 3302.5m to resume Milling Op. , Cont. Milling Op. F/ 3302.5 To 3303.1m. Meanwhile Dec. MW F/ 112 to 110pcf using Centrifuge, NL-NG. 'Cont. Milling Op. F/ 3302.5 To 3303.6m; Due to lack of progress, Decide To POOH Milling BHA to Change Mill; POOH 6" Milling BHA F/ 419m To Surf. On Elevator, L/D 6" M.M.J.Mil (15% used) & Rest of BHA; P/U & M/U 6" Milling BHA . 'Cont. RIH W/ 6" Milling BHA To 3147m; Conn. TDS and Cont. RIH W/ 6" Milling BHA F/ 3147 To 3303.52m W/ Wash Dn; Cont. Milling Op. F/ 3303.52 To 3303.55m, while

apply different parameters & procedures, and Reciprocate Strg to avoid Sticking, NL-NG. 'Cont. Milling Op. F/ 3303.55 To 3303.57m; Obs. WOB on Fish (PKR) fully gave way and got 0 Klbs & applied TQ got back to off-BTM Torque; Cont. RIH W/ 6" Milling BHA W/ Wash Dn F/ 3303.57 To 3480m, while check properties of return Mud and that Strg is free; Pump Hi-Vis Pill, Then CBU @ 3480m to Condition & Treat Mud; POOH 6" Milling BHA F/ 3480 To 1850m On Elevator; P/U & M/U Extra 5 Stds 5" DP Jt by Jt; POOH 6" Milling BHA F/ 1850m To surface On Elevator, L/D 6" Mill (40% Used) & rest of BHA; Prepare To RIH W/ 2" × 4" Taper Tap, NL-NG. 'P/U and M/U 4" Fishing BHA and RIH to 728m, Break Circ., Ok; Cont. RIH W/ 2" × 4" Taper Tap & Fishing BHA F/ 728 To 3101m (7" L.Lap); Conn. TDS and Cont. RIH W/ 2" × 4" Taper Tap & Fishing BHA F/ 3101 To 3763.5m W/ Wash Dn, Hold up Strg Wt. @ 3763.5m; Record Up & Dn ward Strg Wt. W/ & W/O Flow Rate & Rotation; Record Up & Dn ward Strg Wt. W/ & W/O Flow Rate & Rotation; Lower Strg & Engage W/ Fish & perform Tap Op. , Confirm Fish is caught; Try to POOH, Fish got released and Hook Load Wt. back to recorded data; Try second time and perform Tap Op. , Confirm Fish is caught; Attempt to POOH W/ Overpull, No Success; Try to POOH Fish , NL-NG. 'Work on fish , POOH w/ 2" * 4" Taper tap to surface, Ret. All PKR tail. 'RIH w/ 9-5/8" x 7" Tandem scraper to 3780.4m, confirm 4-1/2" L.Lap. 'Cut MW to 104pcf @ two stages while work on mud properties, OBS Well static, POOH to 670m. 'POOH w/ tandem scraper f/ 670m to surface. RIH w/ 6" J.Mill and 2 No J.Sub to 2460m, Obs plug string, Work on same, No Succ., POOH w/ 6" J.Mill to 350m. 'POOH w/ 6" J.Mill and 2 No J.Sub to surface. B/O & L/D Same them. Change top rams, Perform BOP test as NIOC policy. RIH w/ 4-1/2" CBL, CDR, GR, CCL to 3560m drop tension due to well trajectory, Commence log up f/ 3560 to 3147m, NL-NG. RIH w/ 4-1/2" CBIL, CDR, GR, CCL log @ 2 Stage for 7" LNR & 9-5/8" CSG. L/D Wireline Equip., P/U & M/U 5-7/8" J.Mill RIH to 550m. NL-NG. RIH w/ 4-1/2" CBIL, CDR, GR, CCL log @ 2 Stage for 7" LNR & 9-5/8" CSG. L/D Wireline Equip., P/U & M/U 5-7/8" J.Mill RIH to 550m. NL-NG. 'POOH w/ 5-7/8" J.Mill f/ 3780.4m (4-1/2" L.Lap) to surface. Slip & Cut 97 ft drilling line. RIH w/ 3-1/2" J.Mill & Clean out BHA to 140m. 'Cont. RIH w/ 3-1/2" J.Mill & Clean out BHA To 3700m. 'Cont. RIH w/ 3-1/2" J.Mill & Clean out BHA to 4134m. Pump Hi-Vis Pill. POOH f/ 4134 to 250m. While B/O & L/D 10 Jts 2-7/8" DP. 'Cont. POOH w/ 3-1/2" J.Mill & Clean out BHA to surface. While B/O & L/D 2-7/8" DP & 3-1/8" DC. RIH w/ open end BHA to 3780m. Cont. Circ. Thru string; NL-NG. Cont. Circ. Thru string; NL-NG. L/U CMT Line to string & Prepare CMT Slurry solution. 'Perform 2 CMT Balance Plug Job as per program, POOH to 2700m, Circ. Thru string. 'Perform 2 CMT Balance Plug Job as per program, POOH to 2700m, Circ. Thru string. Since 28-Feb-2026 Wait on client for next plan ; Suspended the well as per client instruction with CMT Balance plug @ 2 stage (Due to war & unplan well condition).

Summary of Sidetrack Operation #2

The AZNS – 127 workover well was Sidetrack by rig OEOC – 201 on Pad 54 form 2026-Apr-03 to 2026-Jul-17, as described in the following:
Open the Well Thru. Choke Manifold & Record Well Press. For a while, Confirm Well Static; Set 11" Plug Tester in T.H.S Bowl; Perform BOP Test as per NIOC Policy; P/U & M/U Tubular Stds & Rack back in Derrick Jt by Jt, While Hammer, Wash and Pass Drift Thru. All Jts is in progress @ M.N. Cont. P/U & M/U Tubular Stds & Rack back in Derrick Jt by Jt (Totally 14 Stds [6 Stds 6-1/2" D.C; 8 Stds 5" H.W.D.C]); P/U & M/U 6-1/8" BHA [6-1/8" C.C Bit + 4-3/4" Bit Sub + 33 Stds 3-1/2" DP (8 Stds Jt by Jt)] To 965m; Cont. RIH w/ Same BHA F/ 956 To 2980m On Elevator Followed by 5" DPs; Conn. TDS and Cont. RIH w/ Same BHA F/ 2987 To 3017m, NL-NG. Cont. RIH w/ Wash Dn w/ Same 6-1/8" BHA F/ 3017 To 3102m, Obs. Hold up Strg Wt. and Tag TOC @ 3102m, Confrim TOC w/ Apply WOB: 3klbs; CBU and Disp. In-hole Driling Mud w/ 104pcf Fresh Mud @ 3098m and uniform In/Out Mud MW; Perform CMT Balance plug; B/O Chiksan Pipes, POOH 6-1/8" BHA F/ 3100 To 2928m, Flush String, Cont. POOH 6-1/8" BHA F/ 2928 To 2757m; CBU @ 2757m; Cont. POOH 6-1/8" BHA F/ 2757 To 1300m, While Circ. C.W.H, NL-NG. Cont. POOH 6-1/8" BHA F/ 1300m To Surface; B/O & L/D C.C Bit & Rest of BHA; P/U & M/U 8-1/2" D/O BHA and RIH To 2880m; Conn. TDS and RIH w/ 8-1/2" D/O BHA w/ Pump out F/ 2880 To 3015m, Hold up Strg Wt. @ 3015m; Cont. RIH w/ Wash Dn F/ 3015 To 3023m, Hold up Strg Wt. & Tag TOC @ 3023m; D/O Hard CMT W/ 8-1/2" D/O BHA F/ 3023 To 3044m , NL-NG. Cont. D/O Hard CMT W/ 8-1/2" D/O BHA F/ 3044 To 3062m; Pump Hi-Vis Pill, CBU @ 3062m to sweep the well; P/U & M/U 9-5/8" Scraper BHA and RIH To 256m, F/U BHA & Break Circ. , Ok; Cont. RIH W/ 9-5/8" Scraper BHA F/ 256 To 1225m Followed by 5" DPs, While F/U Strg & Break Circ. At 10-Std Intervals, NL-NG. Cont. RIH W/ 9-5/8" Scraper BHA F/ 1225 To 3020m; Conn. TDS & Scrape Interval 3020 to 3062m Sev. Times, Setting Depth Area of 9-5/8" Hyd. Whipstock Sys. PKR; CBU @ 3062m till clean Sh.Shakers; Pump 70bbl 80pcf Hi-Vis Pill and Disp. In-hole Mud 103pcf w/ 80 pcf Fresh Mud; Static Flow Check for 0.5Hr. , Confirm the Well is static; Pump 60bbl Hi-Vis Pill and CBU till uniform In/Out Rheological properties and clean Sh.Shakers, while reciprocate Strg periodically; POOH 9-5/8" Scraper BHA F/ 3062 To 2140m, NL-NG. Cont. POOH 9-5/8" Scraper BHA F/ 2140m To Surface; P/U & M/U 9-5/8" Cased-Hole Sidetrack BHA To 46m; F/U 6-1/2" DC w/ Fresh Hi-Vis Pill; Cont. RIH W/ 9-5/8" Cased-Hole Sidetrack BHA F/ 46 To 2097m w/ Speed Control, While Drift all Tubular & F/U Strg w/ F/U Hose at 10-std interval and Monitor the Well, NL-NG. Cont. RIH W/ 9-5/8" Cased-Hole Sidetrack BHA F/ 2097 To 3060.5m; P/U & Assemble Wireline Tools as Gyro Tool String and RIH To 3041m, Set Whipface orientation to planned

Azimuth (Az. :340deg) based on Gyro Data reading, POOH 1.8" Gyro Tool String to surface, L/D Wireline Tools; Set Whipstock PKR @ 3059.25m, Push/Pull Test at 25klbf, Shear 8-1/2" Rugby Mill shear screw, Rotate Strg at 20RPM to break knock-off plugs; CBU @ 3052m to Shear In/Out Mud; Start Window Milling W/ 8-1/2" Cased-hole sidetrack BHA F/ 3053.35 To 3054.6m, NL-NG. Cont. Window Milling w/ 8-1/2" Cased-hole Sidetrack BHA F/ 3054.6 To 3055.6m; POOH 8-1/2" Cased-hole Sidetrack BHA F/ 3055.6 To 900m; At 900m, Slip & Cut 110ft Drill Line, while Slow Circ. & Monitor the Well; Cont. POOH 8-1/2" Cased-hole Sidetrack BHA F/ 900m To Surface; P/U & M/U 8-1/2" Cased-hole Sidetrack BHA and RIH To 236m, F/U BHA & Break Circ. , Cont. RIH w/ 8-1/2" Cased-Hole Sidetrack BHA F/ 236 To 951m On Elevator, While F/U Strg & Break Circ. At 15-Std Intervals; Due to Windy Weather, at 951m stop RIH Op. , while Slow Circ. , NL-NG. Cont. RIH w/ 8-1/2" Cased-Hole Sidetrack BHA F/ 951 To 3042m On Elevator; Conn. TDS & Cont. RIH w/ 8-1/2" Cased-Hole Sidetrack BHA w/ pump out F/ 3042 To 3054m, Hold up Strg Wt. @ 3054m; Cont. Window Milling w/ 8-1/2" Cased-hole Sidetrack BHA F/ 3054 To 3056.4m, While Dress & Smooth the interval milled by Rugby Mill run w/ previous 8-1/2" Cased-Hole Sidetrack BHA, Pump Hi-Vis Pill periodically & check Ditch magnet, Sh.Shakers samples, Mud Treatment to optimize Rheological properties, and Monitor the Well, POOH To 2322m, NL-NG. Cont. POOH 8-1/2" Cased-hole Sidetrack BHA F/ 2322 To 1000m; Obs. The Well & Static Flow Check @ 1000m for 1Hr. ; CBU for a while and monitor the Well, Confirm Well Static; Cont. POOH 8-1/2" Cased-hole Sidetrack BHA F/ 1000m To Suface; ; Obs. Strg is twisted off B/O Remain part of 8-1/2" Tri-Mill & rest of BHA; Perform BOP Test as per NIOC Policy; P/U and M/U 4-3/4" Fishing BHA and RIH Followed by 5" DPs On Elevator, While F/U Strg & Break Circ. At 15-Std Intervals, NL-NG. Cont. RIH w/ 1-9/16" × 2-11/16" Taper Tap & 4-3/4" Fishing BHA F/ 2730 To 3044m; Conn. TDS and Cont. RIH w/ Same BHA F/ 3044 To 3052.9m w/ Wash Dn, Hold up Strg Wt. @ 3052.9m; Record Up & Dn ward Strg Wt. W/ & W/O Flow Rate & Rotation; Lower Strg & Engage W/ Fish & perform Tap Op. ; POOH 1-9/16" × 2-11/16" Taper Tap & 4-3/4" Fishing BHA To Surface On Elevator to check string, Fish Recovered; Work on Drawworks; RIH w/ 8-1/2" Cased-Hole Sidetrack BHA To 1950m ,While F/U Strg & Break Circ. At 10-Std Intervals, NL-NG. Cont. RIH w/ 8-1/2" Cased-Hole Sidetrack BHA F/ 1950 To 3042m On Elevator; CBU & Take SCR @ 3042; Conn. TDS & Cont. RIH w/ 8-1/2" Cased-Hole Sidetrack BHA w/ pump out To 3056m, Hold up Strg Wt. @ 3056m; Attempt to Cont. Window Milling w/ 8-1/2" Cased-hole Sidetrack BHA F/ 3056 To 3060m, While Dress & Smooth the interval milled & drilled by 8-1/2" previous & in-hole Tri-Mill run 8-1/2" Cased-Hole Sidetrack BHA & Sev. Times @ 3060m, Pump Hi-Vis Pill periodically & check Ditch magnet; Pump Hi-Vis Pill, CBU @ 3060m, and Monitor the Well, NL-NG. POOH w/ 8-1/2" Tri mill f/ 3060m

to surface. L/D Same. RIH 8-1/2" TCI Bit & 6-3/4"D.H.M (Ako: 1.5 Deg) & MWD Tool to 1800m. Cont. RIH Directional BHA (6-3/4"D.H.M & MWD Tools) w/ Gyro Sub & Followed by 5"DPs f / 1800 to 3060m (BTM), Resume D.Drlg as Rotation to 3062m, POOH to 3061.5m, R/U Logging Equip., Run Gyro Tools to 3052m, Adjust Tool Face of D.H.M, POOH & R/D Logging Equip., Resume D.DRLG as Slide Mode to 3065.7m. Cont. D.Drlg as Slide & Rotation mode f/ 3065.6 to 3090.3m. Cont. D.Drlg as rotation mode to 3093.5m. POOH Directional BHA f/ 3093.5 to surface. P/U & M/U New DHM, MWD tools & 8-1/2" PDC Bit, RIH to 2600m. Cont. Directional Drlg f/ 3093.3 to 3141m. Cont. Directional Drlg f/ 3141 to 3212m. Cont. D.Drlg f/ 3212 to 3270m. Cont. D.Drlg as Slide & Rotation Mode f/ 3270 to 3324m, Circ. Btm's up. POOH to 3115m. Cont. POOH to surface, Change BHA, M/U 8-1/2" PDC Bit & 6-3/4" D.DRLG BHA to 2138m. Cont. RIH w/ 8-1/2" PDC Bit & 6-3/4" D.DRLG BHA to 3324m (BTM). Resume Performance Drlg 8-1/2" H.S f/ 3324 to 3410m. Cont. Performance Drlg 8-1/2" H.S f 3410 to 3490m. Cont. Performance Drlg 8-1/2" H.S f 3490 to 3571.5m. Cont. Drlg 8-1/2" H.S f/ 3571.5 to 3634.22m. POOH In order to change Bit, f/ 3634 to 3053m. Cont. POOH to surface. While Slip & Cut 100ft Drlg line, Change BHA , RIH To 1500m. Cont. RIH W/ 8-1/2" Dir. Drlg BHA F/ 1500 To 3055m (KOP Depth - Cased Hole); Cont. RIH W/ 8-1/2" Dir. Drlg BHA F/ 3055 To 3500m (Open Hole) On Elevator W/ Good Hole Condition; Hold Up Strg Wt. @ 3500m; Conn. TDS & F/U Strg; Take SCR @ 3500m; Adjust Gamma Sensor & Check MWD Signal, Ok; Cont. RIH W/ 8-1/2" Dir. Drlg W/ Wash & Ream Dn F/ 3500 To 3634m; Cont. Dir. Drlg 8-1/2" Hole Section As Rotating Mode F/ 3634 to 3657.6m; Take Survey @ 3658.3m; Cont. Dir. Drlg 8-1/2" Hole Section As Rotating Mode F/ 3657.6 to 3684.8m; Take Survey @ 3680m, 1-3BPH Loss. Cont. 8-1/2" hole Drlg from 3684.8 to 3738m. At 3738m, obs. gradual decrease in SPP by ~150 psi; completed successful surface equipment Press. Test and Verified reduction against SCR; To check for potential washout, POOH 8-1/2" BHA from 3738m to 1625m W/ Pump out & soft B/R. Visually inspected all Stds for washout while monitoring well & Circ. C.W.H; 1-3BPH loss. POOH 8-1/2" BHA to 660m for inspection; observed drill string washout at 3078m (Std #15); Replaced 5" DP Jt (G-Grade) and performed MWD/DHM Functional Tests (Ok); RIH back W/ 8-1/2" Dir. Drlg BHA F/ 660 To 3055m (KOP Depth - Cased Hole) On Elevator; Cont. RIH W/ 8-1/2" Dir. Drlg BHA F/ 3055 To 3656m (Open Hole) On Elevator W/ Good Hole Condition; Conn. TDS & F/U Strg, then Cont. RIH W/ 8-1/2" Dir. Drlg W/ Wash & Soft Ream Dn F/ 3656 To 3738.3m; Cont. Dir. Drlg 8-1/2" Hole Section As Rotating Mode F/ 3738.3 to 3762m; 0-1BPH Loss. Cont. Dir. Drlg 8-1/2" hole section in rotating mode from 3762.3m to 3788.9m; Stop Drlg due to TDS Gooseneck Leakage, To Fix Goosneck Leakage, POOH 8-1/2" Dir. Drlg BHA F/ 3768 To 3685m, W/ Soft B/R & Pump out, Work on Goosneck Leakage, While Circ. at 3685m Thru. Strg, Fix TDS Gooseneck

Leakage and RIH W/ 8-1/2" Dir. Drlg W/ Wash & Soft Ream Dn F/ 3685 To 3768m; Adjust Gamma Sensor & Check MWD Signal, Ok; Resume Dir. Drlg 8-1/2" Hole Section As Rotating Mode F/ 3768 to 3788.9m; Stop Drlg due to TDS Gooseneck Leakage, To Fix Goosneck Leakage, POOH 8-1/2" Dir. Drlg BHA F/ 3788.9 To 3743.5m, Work on Goosneck Leakage, While Circ. at 3743.5m Thru. Strg; 2-3BPH Loss. Cont. Work on Goosneck Leakage, While Circ. at 3743.5m Thru. Strg; Fix TDS Gooseneck Leakage and RIH W/ 8-1/2" Dir. Drlg W/ Wash & Soft Ream Dn F/ 3743 To 3788.9m; Take SCR; Adjust Gamma Sensor & Check MWD Signal, Ok; Resume Dir. Drlg 8-1/2" Hole Section As Rotating Mode F/ 3788.9 to 3791m; At 3791m, Obs. gradual decrease in SPP during Drlg; Surface equipment Press. Test completed successfully, Ok; Verified against SCR to confirm SPP, Ok; Confirm DHM Diff. Press. and MWD pulse are gone, Decide To POOH to check DHM & MWD; POOH 8-1/2" Dir. Drlg BHA F/ 3791 To 3428m W/ Pump out & Soft B/R W/ Good Hole condition; POOH 8-1/2" Dir. Drlg BHA F/ 3428m To Surface On Elevator, B/O DHM & rest of BHA is in progress, 2-3BPH Loss. Cont. B/O & L/D 8-1/2" PDC Bit (Dull Grade: 1-1-WT-A-X-IG-NO-DMF), DHM & rest of BHA; P/U 6-3/4" DHM, Shallow Test W/ 450gpm got 230psi Pressure (M.L), then M/U 8-1/2" PDC Bit , Shallow Test W/ 450gpm, got 400psi Pressure (M.L), P/U & M/U Rest of BHA; Cont. RIH w/ 8-1/2" Dir. Drlg BHA F/ 249 To 3060m (KOP Depth - Cased Hole) Followed by 5" DPs On Elevator; Cont. RIH W/ 8-1/2" Dir. Drlg BHA F/ 3060 To 3761m (Open Hole) Followed by 5"DPs On Elevator W/ Good Hole Condition; Conn. TDS Cont. RIH W/ 8-1/2" Dir. Drlg W/ Wash & Soft Ream Dn F/ 3761 To 3791m, Hold up Strg Wt. @ 3791m; Cont. Dir. Drlg 8-1/2" Hole Section As Rotating Mode F/ 3791 To 3810.3m; 2-3BPH Loss. While Dir. Drlg at 3810.3m, Obs. gradual decrease in SPP during Drlg by approximately 200 psi; To check for potential washout or DHM failure; POOH 8-1/2" Dir. Drlg F/ 3810.3 To 3350m (Open Hole) W/ Pump out & Soft B/R; Cont. POOH 8-1/2" Dir. Drlg BHA F/ 3350 To 3050 (Open Hole); Cont. POOH 8-1/2" Dir. Drlg BHA F/ 3350 To 250m (Cased Hole); Cont. POOH 8-1/2" Dir. Drlg BHA F/ 250m To Surface, B/O & L/D 8-1/2" PDC Bit, DHM & rest of BHA; Obs. Fluid bypassing Thru. DHM & Bit Nozzles W/O inducing Flow Rate; Change Top Ram F/ VBR 2-7/8" - 5" To 4-1/2" - 7"; Prepare To BOP Test as per NIOC Policy is in progress, 2-3BPH Loss. Cont. BOP Test as per NIOC Policy; P/U & M/U 8-1/2" Rotary BHA and RIH To 279m, F/U BHA & Break Circ. ; Cont. RIH W/ 8-1/2" Rotary BHA F/ 279 To 3060m (Cased hole) On Elevator; Cont. RIH W/ 8-1/2" Rotary BHA F/ 3060 To 3503m (Open hole) On Elevator, Hold up Strg Wt. @ 3503m; Conn. TDS & Cont. RIH W/ 8-1/2" Rotary BHA F/ 3503 To 3810.3m (Open hole) W/ Wash & Ream Dn, Hold up Strg Wt. @ 3810.3m; Cont. Drlg 8-1/2" Hole Section F/ 3810.3 To 3823m, 1-2BPH Loss. Cont. Drlg 8-1/2" Hole Section To 3890m; Pump 30bbl Hi-Vis Pill @ 3890m, Hi-Rate CBU & Shaker out the

pumped Hi-Vis pill, Confirm Sh.Shakers are clean; POOH 8-1/2" Rotary BHA F/ 3890 To 3860m W/ Pump out & B/R As Condition Trip, 1-3BPH Loss. Cont. POOH 8-1/2" Rotary BHA F/ 3860 To 3620m W/ Pump out & B/R As Condition Trip; Strg got Stuck @ 3860m; worked off Stuck pipe and successfully freed; Observed and smoothed Tight Hole Intervals during B/R Sev. Times; RIH Back W/ 8-1/2" Rotary BHA F/ 3620 To 3890m W/ Wash & Ream Dn As Condition Trip; Pump 30bbl Hi-Vis Pill @ 3890m, Hi-Rate CBU; Then Spot 200bbl 86pcf Hi-Vis Pill @ 3890m, While Reciprocate Strg periodically; POOH 8-1/2" Rotary BHA F/ 3890 To 3060m (Open hole) On Elevator W/ Good Hole Condtion; Cont. POOH 8-1/2" Rotary BHA F/ 3060 To 279m (KOP - Cased hole) On Elevator; Cont. POOH 8-1/2" Rotary BHA F/ 279m To Surface, While B/O 8-1/2" W/ Same Condition & Rest of BHA, While Circ. C.W.H, 1-3BPH Loss. R/U CSG Running Eqp. ; Held PJSM; P/U & M/U 7" LNR Assembly; Cont. RIH W/ 7" LNR Assy. F/ 45 To 1002m Followed by 85Jts 7" LNR (29#, TPCQ,L-80) [Totally : 89 Jts); P/U 8-1/2" Rotational Hyd. HGR & Setting Tools W/ Top PKR; Shear-Pin 6-5/8" LWP to Slick Joint Slot; Lubricate Setting Tools W/ Grease and Oil; M/U same Assy. on LNR Strg; Check Setting Tools and all other connections, OK; Function test Running Tool Rotation, OK; RIH To 1010m; Record Strg Wt. in Both Upward & Dnward Directions; Cont. RIH W/ 7" LNR Assy. F/ 1002 To 2866m (KOP - Cased hole), While pass Drift Thru. all DPs, 1-3BPH Loss. Cont. RIH W/ 7" LNR Assy. F/ 2866 To 3050m (Cased hole) Followed by 5" DPs; Conn. TDS & CBU @ 3050m Shear the Mud; Record Strg Wt. in Both Upward & Dnward Directions; Cont. RIH W/ 7" LNR Assy. F/ 3050 To 3890m (Open hole) Followed by 5" DPs, While pass Drift Thru. all DPs; CBU @ 3888m; Hanger Setting Ops: Set 8-1/2" Hyd. LNR Hanger @ 1900 psi (Verified via Push Test); Sheared Ball Seat @ 2900 psi. Released Tool W/ 27 RH turns (Verified via 1m Sting-out); Cementing: Pump Chemical Wash (Vol. : 20 bbl, Wt. : 62.4 pcf), Spacer Wash (Vol. : 60 bbl, Wt. : 88 pcf) and CMT Slurry (Vol. : 155 bbl, Wt. : 118 pcf), Disp. Slurry W/ Mud (T.Vol: 277 bbl, Wt: 81 pcf), Confirmed Latching/Shearing @ 2400 psi & Plug Bump @ 2500 psi; LNR Integrity: LIT performed (15 min/OK); Set Top Packer via S/O weight (Confirmed by positive Shear on Wt. Indicator), POOH Setting Tool to 1460m, NL-NG. Cont. POOH W/ Setting Tools 1460m To Surface, B/O & L/D Setting Tools; L/D CMT Chiksan Pipes; Set Wear Bushing; P/U & M/U 8-1/2" D/O BHA and RIH to 142m, F/U BHA & Break Circ. ; Cont. RIH W/ 8-1/2" D/O BHA F/ 142 To 1230m On Elevator Followed by 5" DPs, Slip & Cut Drlg Line @ 1230m; Cont. RIH W/ 8-1/2" D/O BHA F/ 1230 To 2600m On Elevator Followed by 5" DPs; Conn. TDS and Cont. RIH W/ 8-1/2" D/O BHA F/ 2600 To 2860m W/ Wash Dn, Tag TOC @ 2860m; D/O Medium CMT W/ 8-1/2" D/O BHA F/ 2860 To 2883.5m (7" L.Lap) - Note 7" L.Lap confirmed @ 2883.5m; Pump 40bbl Hi-Vis Pill and CBU @ 2882m till Shakering out the pumped Hi-Vis Pill, Confirm Sh.Shakers cleaning; POOH 8-1/2" D/O BHA F/ 2882

To 1921m On Elevator, While Circ. C.W.H, NL-NG. Cont. POOH 8-1/2" D/O BHA F/ 1921 To 961m On Elevator; Cont. POOH 8-1/2" D/O BHA F/ 961 To 140m On Elevator, While B/O & L/D Extra 5" Stds (Totally B/O & L/D 29Stds 5" DP G-Grade & 1 Std 5" DP S-Grade) Jt by Jt; Cont. POOH 8-1/2" D/O BHA F/ 140m To Surface, L/D 8-1/2" Tri-Cone Bit W/ Same Condition; P/U & M/U 6-1/8" D/O BHA and RIH to 1175m, While Wash, Hammer, Drift 10 Stds 3-1/2" DP Jt by Jt, and F/U BHA & Break Circ. ; Cont. RIH W/ 6-1/8" D/O BHA F/ 1175 To 1375m On Elevator; Stop RIH @ 1375m, While Slow Circ. Thru. Strg; Cont. RIH W/ 6-1/8" D/O BHA F/ 1375 To 2745m On Elevator Followed by 5" DPs, While F/U Strg & Break Circ. Every 15 Stds, NL-NG. Cont. RIH W/ 6-1/8" TCI Bit and clean out BHA to 2887m. D/O & Clean out inside 7" liner to 3842.5m, Circ. Btm's up. POOH f/ 3842.5m to surface. B/O & L/D 6-1/8" TCI Bit. RIH w/ 9-5/8" Scraper to 2800m while scrap dry test PKR Setting depth, CBU, POOH To Surface. Run 9-5/8" Dry test tools for 7" L.Lap to 300m. Cont. Run 9-5/8" Dry test tools for 7" L.Lap to 2850m, Set 9-5/8" Dry test PKR at 2850 m, Monitor Open period for 3Hrs; "No-Bubble". Close DCIP Valve. Record Close Period for 0.5 Hr is in progress till M.N Record Close Period for totally 6 Hrs, Rev. Circ. To uniform MW, Unset the 9-5/8" Dry Test PKR, Change TDS link & CBU, Static flow check, POOH 9-5/8" Dry test Assy to surface. Perform BOP Test as NIOC Policy. Cont. BOP Test as NIOC Policy. RIH w/ 6-1/8" TCI Bit to 400m. Cont. Slow Circ. Thru string and wait on client. Cont. Slow Circ. Thru string and wait on client. Resume RIH w/ 6-1/8" TCI Bit & C/O BHA f/ 400 to 2650m. Perform integrity test; OK. Resume RIH to 3800m. Cont. D/O F.Collar, Hard CMT, F.shoe to 3890m, Commence Drlg formation to 3893m, Circ. Btm's up. Cont. POOH w/ 6-1/8" TCI Bit & D/O BHA f/ 3885 to Surface. RIH w/ 6-1/8" TCI Bit & Clean out BHA to 3889m , Pump Hi-Vis Pill. C.B.U Till Clean Shaker. Cont. POOH w/ 6-1/8" TCI Bit & 7" Scraper to surface, Run W/L logging tools (RBT/VDL/GR/CCL), RIH w/ 6-1/8" PDC Bit & Rotary BHA to 20m. Cont. RIH w/ 6-1/8" PDC Bit to 3893m (BTM Hole) , Cont. Drlg 6-1/8" H.S f/ 3893 to 3902m while slip & Cut DRLG line @ 1600m and gradually Inc. MW During DRLG Operation as per plan. Cont. Drlg 6-1/8" H.S to 3956m. Cont. Drlg 6-1/8" H.S to 4010m while work on mud rheology to normal parameters and uniform MW to 104.5pcf, NL-NG. Cont. Drlg 6-1/8" H.S to 4094m while back ream & Ream down last std. Cont. Drlg 6-1/8" Hole Section F/ 4094 To 4150m (TD), While Reciprocate the Drilled Interval (B/R & R/D) W/ Good Hole Condition and Pump Hi-Vis Pill before M/U Next Std, NL-NG; POOH 6-1/8" Rotary BHA F/ 4150 To 3890m (7" LNR Shoe Depth) W/ Pump out & B/R RIH Back W/ 6-1/8" Rotary BHA F/ 3890 To 4150m On Elevator As Condition Trip W/ Good Hole Condition; Hi-Rate CBU W/ MW & Drlg Mud Props. Check, BTMs Up Ok; Pump 20bbl Hi-Vis Pill @ 4150m, Then Hi-Rate CBU To Disp. & Shaker out the pumped Hi-Vis pill, Confirm Sh.Shakers are clean; While CBU, Obs. Gas-Cut Mud

(Total Gas 5%) On Shakers @ 101pcf, Decide to Weight Up In-Hole Mud; MW W/U F/ 104+ to 105+ pcf in progress; NL-NG. MW W/U from 104+ to 105+ pcf W/ uniform In/Out MW achieved; Mud conditioned & 50 bbl Hi-Vis Pill spotted at 4150m; POOH 6-1/8" Rotary BHA to surface and L/D PDC Bit (Dull Grade: 2-1-WT-G-X-I-NO-TD); Prepare Rig Floor to perform Wire Line Logging Op. ; Ret. 11" Wear Bushing; R/D Mouse Hole; Change 13-5/8" 10K Top Rams VBR, R/U and Set 7" Shooting Nipple, P/U & M/U Wireline BOP on Shooting Nipple, Wireline BOP & Top Rams Press. Test, OK; PJSM; R/U Paniz Co. Wire Line Eqp. ; Paniz Co. Wireline Eqps. R/U; assembled Full Suite Tool String Run#1 (DLL-MSFL-GR: INSU, MSFL, GR, TELC, TPMS_B, BRIDLE; 16.28m, 400 kg, 4.22" OD) and RIH to 900m, While Record Normal Tension / position Every 500m, and Circ. C.W.H & Monitor the Well, NL-NG. Cont. RIH W/ Wireline Tool String (Run#1 for Full Suite Logging) F/ 900 To 3950m; RIH Op. encounter insufficient Wireline Cable Length (Single Wrap remaining on Reel); Decide To POOH Wireline Tool String; POOH Wireline Tool String F/ 3950m To Surface; L/D Wireline Tool Strg & Surface Tools, and 7" Shooting Nipple; Change 13-5/8" 10K Top Rams VBR, Press. Test the changed Rams, Ok; R/U& Mouse Hole; Set 11" Wear Bushing in T.H.S Bowl; Prepare Rig Floor to RIH 6-1/8" Condition BHA; P/U & M/U 6-1/8" Condition BHA and RIH to 300m, F/U BHA & Break Circ. ; Cont. RIH W/ 6-1/8" Condition BHA F/ 300 To 3890m (Cased Hole - 7" LNR Shoe Depth) On Elevator Followed by 3-1/2" & 5" DPs, While F/U Strg & Break Circ. Every 10Stds, NL-NG. Cont. RIH W/ 6-1/8" Condition BHA F/ 3890 To 4090m (Open Hole) W/ Good Hole Condition On Elevator; Conn. TDS & Cont. RIH W/ 6-1/8" Condition BHA F/ 4090 To 4150m (Open Hole) W/ Good Hole Condition W/ Wash Dn, Obs. Some Tight Interval, Smooth via Applying parameters, CBU @ 4150m To Uniform In/Out MW, Simultaneously Condition & Optimize Drlg Mud; POOH 6-1/8" Condition BHA F/ 4150 Tob1384m On Elevator W/ Good Hole Condition in Open Hole; Static Flow Check @ 1384m, Confirm Well Static; Cont. POOH 6-1/8" Condition BHA F/ 1384 To 227m On Elevator; Cont. POOH 6-1/8" Condition BHA F/ 227m To Surface On Elevator, L/D Bit W/ Same Condition & Rest of BHA, While Circ. C.W.H, NL-NG. Rig floor prepared for Wireline Operations; 13-5/8" Top Rams changed to 4-1/2"x7" VBR and Wireline BOP installed/Tested, Ok; Complete two Logging Runs: Run #1 (DLL-MSFL-GR) RIH to 4142m and Logged up to 3820m; Run #2 (CNT-DAS-GR) RIH to 4127m and Logged up to 3840m; Following POOH and LD of tools, Top Tams reverted to 2-7/8"x5" VBR; Full BOP Press. Test conducted per NIOC policy (Annular, BTM, Top, and Shear Rams, and all Choke Manifold valves) W/ all results OK; Currently preparing to RIH with 6-1/8" Condition BHA, While Circ. C.W.H & Monitor the Well, NL-NG. Cont. P/U & M/U 6-1/8" Condition BHA and RIH to 300m; F/U BHA & Break Circ. ; Conn. TDS & Cont. RIH W/ 6-1/8" Condition BHA F/ 4090 To 4150m (Open Hole) W/ Good Hole

Condition W/ Wash Dn; CBU @ 4150m To Uniform In/Out MW; POOH 6-1/8" Condition BHA F/ 4150 To 4036m & RIH Back To 4150m As Condition Trip On Elevator W/ Good Hole Condition; CBU @ 4150m To Uniform In/Out MW, Simultaneously Optimize Drlg Mud; POOH 6-1/8" Condition BHA F/ 4150 To 1227m On Elevator W/ Good Hole Condition, While Circ. C.W.H, NL-NG. Cont. POOH 6-1/8" Condition BHA F/ 1227m To Surface; R/U CSG Running Eqp. ; Held PJSM; P/U & M/U 5" LNR Assembly; Cont. RIH W/ 5" LNR Assy. F/ 36.7 To 381.6m Followed by 29Jts 5" LNR (18#, HSG3, L-80, FJ THD) [Totally : 32 Jts); P/U 5-3/4" Rotational Hyd. HGR & Setting Tools W/ Top PKR; Shear-Pin 4-1/2" LWP to Slick Joint Slot; Lubricate Setting Tools W/ Grease and Oil; M/U same Assy. on LNR Strg; Check Setting Tools and all other connections, OK; Function test Running Tool Rotation, OK; RIH To 386m; Record Strg Wt. in Both Upward & Dnward Directions; Cont. RIH W/ 5" LNR Assy. F/ 386 To 2545m (KOP - Cased hole), While pass Drift Thru. all DPs, and F/U Strg Break Circ. Every 10 Jts, NL-NG. Cont. RIH W/ 5" LNR Assy. F/ 2545 To 3860m Followed by 5" DPs; Conn. TDS & CBU @ 3860m Shear the Mud; Record Strg Wt. in Both Upward & Dnward Directions; Cont. RIH W/ 5" LNR Assy. F/ 3860 To 4150m Followed by 5" DPs, While pass Drift Thru. all DPs; CBU @ 4148m; Hanger Setting Ops: Set 5" Hyd. LNR Hanger @ 1700 psi (Verified via Push Test); Sheared Ball Seat @ 3000 psi. Released Tool W/ 26 RH turns (Verified via 1m Sting-out); CMT Op. : Pump Chemical Wash (Vol. : 20 bbl, Wt. : 62.4 pcf), Spacer Wash (Vol. : 50 bbl, Wt. : 110 pcf) and CMT Slurry (Vol. : 47 bbl, Wt. : 118 pcf), Disp. Slurry W/ Mud (T.Vol: 188 bbl, Wt: 105+ pcf), Confirmed Latching/Shearing & Plug Bump; LNR Integrity: LIT performed (15 min/OK); Set Top Packer via S/O weight (Confirmed by positive Shear on Wt. Indicator), POOH Setting Tool to 3400m; CBU & Flush Strg is in progress, NL-NG. CBU @ 3400m To uniform In/Out MW; Cont. POOH W/ Setting Tools 3400m To Surface, B/O & L/D Setting Tools; P/U & M/U 6-1/8" D/O BHA and RIH to 138m, F/U BHA & Break Circ. , Cont. RIH W/ 6-1/8" D/O BHA F/ 138 To 744m On Elevator Followed by 3-1/2" & 5" DPs; Due to Windy Weather, Stop RIH Op. at the request of OEOC HSE Officer @ 744m, While Slow Circ. ; Cont. RIH W/ 6-1/8" D/O BHA F/ 744 To 3430m On Elevator Followed 3-1/2" (Totally 21Stds) & 5" DPs, While F/U Strg & Break Circ. Every 15 Stds; Conn. TDS and Cont. RIH W/ 6-1/8" D/O BHA F/ 3430 To 3460m W/ Wash & Ream Dn, NL-NG. Cont. RIH W/ 6-1/8" D/O BHA F/ 3460 To 3582m W/ Wash & Ream Dn, While D/O CMT Bridges via Apply Parameters; D/O CMT W/ 6-1/8" D/O BHA F/ 3582 To 3763.5m (5" L.Lap Depth); Pump 40bbl Hi-Vis Pill and CBU @ 3762m till Shakering out the pumped Hi-Vis Pill, Confirm Sh.Shakers cleaning; Cont. POOH 6-1/8" D/O BHA F/ 3762 To 1030m On Elevator; In order to B/O & L/D Extra Stds, RIH W/ 6-1/8" D/O BHA F/ 1030 To 1150m Followed by 3Stds 6-1/2" DC + 1Std 5" DPs [Drift is stuck]), While Circ. C.W.H, NL-NG is in

progress @ M.N. B/O & L/D Extra Stds; Slip & Cut Drlg Line; Cont. POOH 6-1/8" Clean out BHA To Surface; RIH W/ 3-3/4" D/O BHA To 2580mTo D/O inside 5" LNR, While F/U Strg & Break Circ. Every 10Stds, NL-NG. Cont. RIH W/ 3-3/4" D/O BHA F/ 2550 To 3717m Followed by 5" DPs On Elevator; Conn. TDS & Cont. RIH W/ 3-3/4" D/O BHA F/ 3717 To 3763.5m W/ Wash Dn; Record Strg Wt. W/ & W/O Rotation and Flow Rate; Cont. RIH W/ 3-3/4" D/O BHA and Pass Tie-back Sleeve Gently W/O any Drag, D/O Pack Of Bushing, While Smooth & Dress 8-1/2" PBR & P.O.B intervals Sev. Times; Cont. RIH W/ 3-3/4" D/O BHA To 3935m W/ Wash Dn; Cont. RIH W/ 3-3/4" D/O BHA F/ 3935 To 3983m W/ Wash & Ream Dn, While Reciprocate the last Std Before Each Connection, NL-NG. Cont. RIH W/ 3-3/4" D/O BHA F/ 3983 To 4052m W/ Wash & Ream Dn, While Reciprocate the last Std Before Each Connection, NL-NG. Cont. RIH W/ 3-3/4" D/O BHA F/ 4052 To 4072m W/ Wash & Ream Dn, While Reciprocate the last Std Before Each Connection; Stop RIH Op. due to Wash pipe Leakage; POOH 3-3/4" D/O BHA F/ 4072 To 4040m; Change Wash pipe, While Circ. Thru. Strg; Cont. RIH back To 4072m W/ Wash; Resume RIH W/ 3-3/4" D/O BHA F/ 4072 To 4118m W/ Wash & Ream Dn, While Reciprocate the last Std Before Each Connection, NL-NG. Cont. RIH W/ 3-3/4" D/O BHA to 4126.5m W/ Wash Dn, Hold up Strg Wt. Try D/O DPWP, LWP & LDC. High Torque Observed, Circ. BTM's Up, Hole Cleaned. POOH F/ 4126.5m to surface. RIH W/ 7-5/16" Polish BHA to 166m. Cont. RIH w/ 7-5/8" Polish mill to 2883.5m (7" L.Lap), While W/D Last Std. Dress, Polish & Clean inside 7" TBS Several times. Tag LG @ 2886m & Try to take L.G mark. CBU. POOH w/ 7-5/16" Polish BHA to surface, R/U OEOC CSG Running equipment, Run 7" Tie - Back as per program to 56m Cont. RIH w/ 7" LNR Tie-Back Assy to 2877m. Wait on Rec. Pump truck, while slow Circ. Thru string. Cont. Wait on Rec. Pump truck, While slow Circ. Thru string. Resume RIH w/ 7" LNR Tie-Back Assy on 5" DPs to 2883.5m, Sting in previous Tie-Back sleeve, P/U String & Bleed off press., M/U CMT Head manifold Perform CMT Job as per program, Sting in SN Fully in TBS , Release running tools, POOH 15 Stds. Flash string & CBU, Cont. POOH to surface, RIH w/ 8-1/2" TCI to New 7" L.Lap, CBU, POOH to 640m, While B/O & L/D Extra Stds POOH w/ 8-1/2" D/O BHA to surface. While B/O & L/D 22 Stds. 5" DPs. Jt by Jt. RIH w/ 5-7/8" TCI Bit & D/O BHA While P/U totally 81 Jts 3-1/2" DPs to 1285.2m, Tag POB @ 1285.2m, Commence D/O POB W/ Different Parameters. Cont. D/O POB w/ 5-7/8" TCI Bit W/ Different Parameters, While smooth & Dress POB intervals Sev.Times. Cont. RIH f/ 1285.2 to 2848.6m. Commence D/O P.O.B Debris, Plugs, LDC & CMT to 2888m, While work on mud properties Cont. RIH w/ 5-7/8" TCI Bit & D/O BHA to 3763.5m (5" L.Lap), While pump 20 bbl Hi-Vis Pill @ Two stage. POOH w/ 5-7/8" TCI Bit & D/O BHA F/ 3763.5 to surface. While M/U 5 Stds. 3-1/2" DPs. RIH w/ 4-1/8" Junk Mill & D/O BHA to 460m. Cont. RIH W/ 4-1/8" J.Mill & D/O BHA F/ 460

to 3763.5m. Hard Wash & Ream Down & Clerance inside 5" LNR to 3998m, NL-NG. Cont. RIH w/ 4-1/8" J.Mill & D/O BHA F/ 3998 to 4126.5m w / Wash down. Try to D/O Inside 5" LNR W/ Different parameters, NO Progress & Observed High torque, Stall Strg. Several Times. POOH to 3830m. Cont. POOH to surf. L/D 4-1/8"J.Mill , M/up & RIH W/7-5/16" Polish Mill to 1284m(7"L.Lap), Take LG Mark. POOH to 980m . Cont. POOH W/ 7-5/16" Polish mill F/ 980 to surface. R/U OEOC CSG Running equipment, Run 7" Tie-Back as per program to 1284m. Perform CMT Job as per program, Sting in SN Fully in TBS , Release running tools, POOH to surface. Slip & Cut 103 ft drilling line. RIH w/ 8-1/2" TCI to New 7" L.Lap, C.B.U, POOH to surface, While B/O & L/D 3 Std. 5" HWDP (Jt by Jt). RIH w/ 6-1/8" TCI Bit & D/O BHA to 130m. Tag P.O.B @ 130m. Commence D/O P.O.B W/ Different parameters. Cont. RIH to 250m. Cont. RIH w/ 6-1/8" TCI Bit & D/O BHA to 1235m. D/O Plugs, LDC & Hard CMT to 1280m. Cont. D/O Hard CMT W/ 6-1/8" D/O BHA F/ 1280 to 1286m; Cont. RIH W/ 6-1/8" D/O BHA F/ 1286 To 1450m W/ Wash & Ream Dn, While D/O CMT Bridges; Pump 20bbl Hi-Vis Pill @ 1450m, Then Hi-Rate CBU To Disp. & Shaker out the pumped Hi-Vis pill, Confirm Sh.Shakers are clean; To P/U & M/U required Tubulars, including 7 Stds 3-1/2" DP Jt by Jt, Cont. RIH W/ 6-1/8" D/O BHA F/ 1450 To 1670m On Elevator; POOH 6-1/8" D/O BHA F/ 1670m To Surface (BHA) On Elevator, L/D 6-1/8" TCI Bit [D.G: 1-2-BT-A-E-1/16"- WT-BHA] and Rest of BHA; BOP Test as per NIOC Policy; P/U & M/U 4-1/8" Clean out BHA and RIH To 1012m On Elevator Followed by 3-1/2" DPs, While F/U Strg & Break Circ. Every 10Stds, NL-NG. Cont. RIH W/ 4-1/8" Clean out BHA F/ 1012 To 3763m On Elevator Followed by 3-1/2" & 5" DPs; Conn. TDS and Cont. RIH W/ 4-1/8" Clean out BHA F/ 3763 To 4126.5m W/ Wash Dn; Tag LDC, LWP, and DPWP @ 4126.5m; Attempt to Start D/O F/ 4126.5m, While Reciprocate Strg & Apply various Drlg Parameters; however, due to High Torque, Strg repeatedly Stalled & no Progress was achieved; NL-NG. Attempt to Start D/O W/ 4-1/8" Clean out BHA F/ 4126.5m, While Reciprocate Strg & Apply various Drlg Parameters; however, due to High Torque, Strg repeatedly Stalled and no Progress was achieved; Procced to check Strg Torque; POOH 4-1/8" Clean out BHA F/ 4126.5 To 3640m (above 5" L.Lap Depth) On Elevator, Conn. TDS and Check Strg Tq. via Apply F.Rate, and Rotation 30RPM, Got Torque 2300-2500 lbf.ft, Confirm observation of normal Tq. ; RIH back W/ 4-1/8" Clean out BHA F/ 3640 To 4047m Followed by 3-1/2" DPs On Elevator; Conn. TDS and Cont. RIH W/ 4-1/8" Clean out BHA F/ 4047 To 4126.5m Followed by 5" DPs W/ Wash Dn; Circ. For a while @ 4126.5m; Spot 25bbl 105pcf CaBr2 in Perforation Intervals; POOH 4-1/8" Clean out BHA F/ 4126.5 To 3840m On Elevator, While Circ C.W.H, NL-NG. Cont. POOH 4-1/8" Clean out BHA F/ 3840 To 403m On Elevator; Cont. POOH 4-1/8" Clean out BHA F/ 403m To Surface (BHA) On Elevator, B/O & L/D 4-1/8" J.Mill (5% Used) & BHA;

P/U & Assemble Wireline Tool String for Cement Bond Evaluation of 5" LNR (RBT-VDL-GR-CCL), RIH W/ Wireline Tool String (for Cement Bond Evaluation of 5" LNR)To 3900m, Hold up Wireline Cable Tension @ 3900m, Procced To POOH; POOH Wireline Logging Tool Strg To Surface, B/O & L/D Wireline Logging Tool Strg; P/U & Assemble Wireline Tool String as Dummy Run, While Circ. C.W.H & Monitor the Well, NL-NG. Cont. RIH W/ Wireline Tool String as Dummy Run To 3920m, Hold up Wireline Cable Tension @ 3920m, Attempt to pass the same Depth Sev. Times, No Success; Procced To POOH; POOH Wireline Logging Tool Strg To Surface; B/O & L/D Wireline Logging Tool Strg, Surface Tools, Wireline BOP, and 7" Shooting Nipple, Change 13-5/8" 10K Top Rams VBR, Press. Test the changed Rams, Ok; R/U Mouse Hole; Set 11" Wear Bushing in T.H.S Bowl; M/U 3-1/8" Open End BHA and RIH To 4126.5m, NL-NG. Circ. @ 4126.5m to Sweep the Well (2 Cycle Direct Circulation & 1 Cycle Reverse Circulation), While simultaneously optimize Mud Properties & Rheology W/ Max F.Rate & SPP; Spot 25bbl 105pcf CaBr2 in Perforation Intervals; POOH 3-1/8" Open End BHA F/ 4126.5 To 1125m On Elevator, While Circ C.W.H, NL-NG. Cont. POOH 3-1/8" Open End BHA F/ 1125m To Surface; R/U W/L Logging Eqps. , Assemble W/L Tool String for Cement Bond Evaluation of 5" LNR and RIH to 7.2m; Cont. RIH W/ the same W/L Tool String F/ 7.2 To 3800m, Hold up W/L Cable Tension @ 3800m, Attempt to pass the same Depth Sev. Times, No Success; POOH W/L Logging Tool Strg To Surface; B/O & L/D W/L Logging Tool Strg; P/U & Assemble W/L Tool String as Dummy Run, Cont. RIH W/ W/L Tool String as Dummy Run To 4123m, Hold up W/L Cable Tension @ Sev. Depths, Work on the Choke points and Pass the same; Cont. RIH & Obs. Hold up W/L Cable Tension @ 4123m, Attempt to pass the same Depth Sev. Times, No Success; POOH W/L Logging Tool Strg To Surface; B/O & L/D W/L Logging Tool Strg, P/U & Assemble W/L Tool String for Cement Bond Evaluation of 5" LNR and RIH to 7.2m, While Circ. C.W.H, NL-NG. Cont. RIH W/ Wireline Logging Tool String (for Cement Bond Evaluation of 5" LNR) F/ 7.2 To 4123m; Commence Data Acquisition Logging Up F/ 4123 To 3750m; POOH Wireline Logging Tool String To Surface; P/U & Assemble Wireline Tool String as Dummy Run To 4126.5m Normally; POOH Wireline Tool Strg To Surface; B/O & L/D Wireline Logging Tool Strg; P/U & Assemble Wireline Tool String as Perforation Run#1 and RIH To 4122m, Correlate the Depth, Fire the Gun & Shoot the Bullets at Interval 4115.78 To 4121.78m, Obs. Electrical & Tension Cable Indications; POOH Wire Line Tools and L/D Wire Line Tools, Obs. all Bullets were Shot successfully, All Done by Supervision of Client Witness; Wait on Day Light, While Circ. C.W.H and Monitor the Well, NL-NG. Cont. Wait on Day Light; P/U & Assemble Wireline Tool String as Dummy Run To 4089m Normally; POOH Wireline Tool Strg To Surface; B/O & L/D Wireline Logging Tool Strg; P/U & Assemble Wireline Tool String as Perforation

Run#2 and RIH To 4101m, Correlate the Depth, Fire the Gun & Shoot the Bullets at Interval 4094.4 To 4100.4m, Obs. Electrical & Tension Cable Indications; POOH Wire Line Tools and L/D Wire Line Tools, Obs. all Bullets were Shot ; P/U & Assemble Wireline Tool String as Perforation Run#3 and RIH To 4095m, Correlate the Depth, Fire the Gun & Shoot the Bullets at Interval 4088.9 To 4094.4m, Obs. Electrical & Tension Cable Indications; POOH Wire Line Tools and L/D Wire Line Tools, Obs. all Bullets were Shot ;Wait on Day Light, While Circ. C.W.H and Monitor the Well, NL-NG. Cont. Wait on Day Light; P/U & Assemble W/L Tool Strg as Dummy Run To 4081m Normally; POOH W/L Tool Strg To Surface; B/O & L/D W/L Logging Tool Strg; P/U & Assemble W/L Tool String as Perforation Run#4 and RIH To 4081m, Correlate the Depth, Fire the Gun & Shoot the Bullets at Interval 4074 To 4080m, Obs. Electrical & Tension Cable Indications; POH W/L Tools and L/D W/L Tools, Obs. all Bullets were Shot ; P/U & Assemble W/L Tool Strg as Perforation Run#5 and RIH To 4072m, 4072m, Hold up W/L Cable Tension @ 4072m, Attempt to pass, No Success; POH W/L Tools and L/D Wireline Tools; P/U & Assemble W/L Tool Strg as Dummy Run To 4073m, Attempt to pass, No Success, POH To Surf. ; P/U & Assemble W/L Tool Strg as Dummy Run To 4074m, Attempt to pass, No Success, POH To Surf. , While Circ. C.W.H and Monitor the Well, NL-NG. Cont. Wait on Day Light; P/U & Assemble W/L Tool Strg as Dummy Run To 4072m, Attempt to pass, No Success; POOH Wireline Tool Strg To Surface; B/O & L/D Wireline Tool Strg, Surface Tools, Wireline BOP, and 7" Shooting Nipple, Change 13-5/8" 10K Top Rams VBR, Press. Test the changed Rams, Ok; R/U Mouse Hole; Set 11" Wear Bushing in T.H.S Bowl; P/U & M/U 3-1/2" Clean out BHA and RIH To 3572m On Elevator Followed by 3-1/2" DPs, While F/U Strg & Break Circ. Every 15Stds, NL-NG. Cont. RIH W/ 3-1/2" Clean out BHA F/ 3571 To 3760m On Elevator, Circ. for a while @ 5" L.Lap; Cont. RIH W/ 3-1/2" Clean out BHA F/ 3760 To 4035m On Elevator, Change Handling Eqps. & Elevator; Conn. TDS & Cont. RIH W/ 3-1/2" Clean out BHA F/ 4035 To 4088m W/ Wash Dn, While soft Wash & Ream Dn Choke Points and pass Perforated intervals gently; POOH 3-1/2" Clean out BHA F/ 4088 To 4070m W/ Pump out; Pump 90bbl Fresh Mud & Circ. @ 4070m to Sweep the Well, While simultaneously optimize Mud Properties & Rheology W/ Max F.Rate & SPP; Spot 25bbl CaBr2 @ 4074m; POOH 3-1/2" Clean out BHA F/ 4074m To Surface On Elevator, While Circ. C.W.H; NL-NG. Prepare Rig to perform W/L Perforation Op. ;P/U & Assemble W/L Tool Strg as Dummy Run To 4075m Normally; POOH W/L Tool Strg To Surface; B/O & L/D W/L Tool Strg; P/U & Assemble W/L Tool Strg as Perforation Run#5 and RIH To 4075m, Correlate the Depth, Fire the Gun & Shoot the Bullets at Interval 4071 To 4074m; POOH W/L Tools and L/D W/L Tools, Obs. all Bullets were Shot ; P/U & Assemble W/L Tool Strg as Perforation Run#6 and RIH To 4067m, Correlate the Depth, Fire the Gun & Shoot the Bullets at Interval 4060.6 To

4066m; POOH W/L Tools and L/D W/L Tools, Obs. all Bullets were Shot ; P/U & Assemble W/L Tool Strg as Perforation Run#7 and RIH To 4059m, Correlate the Depth, Fire the Gun & Shoot the Bullets at Interval 4052 To 4058m; POOH W/Tools and L/D W/L Tools, Obs. all Bullets were Shot ;Wait on Day Light, While Circ. C.W.H and Monitor the Well, NL-NG. Prepare Rig to perform W/L Perforation Op. ;P/U & Assemble W/L Tool Strg as Dummy Run To 4075m Normally; POOH W/L Tool Strg To Surface; B/O & L/D W/L Tool Strg; P/U & Assemble W/L Tool Strg as Perforation Run#8 and RIH To 4053m, Correlate the Depth, Fire the Gun & Shoot the Bullets at Interval 4047.4 To 4052m; POOH W/L Tools and L/D W/L Tools, Obs. all Bullets were Shot ; P/U & Assemble W/L Tool Strg as Perforation Run#9 and RIH To 4030m, Correlate the Depth, Fire the Gun & Shoot the Bullets at Interval 4023.2 To 4028.9m; POOH W/L Tools and L/D W/L Tools, Obs. all Bullets were Shot ; P/U & Assemble W/L Tool Strg as Perforation Run#10 and RIH To 4007m, Correlate the Depth, Fire the Gun & Shoot the Bullets at Interval 4000 To 4006m; POOH W/Tools and L/D W/L Tools, Obs. all Bullets were Shot ;Wait on Day Light, While Circ. C.W.H and Monitor the Well, NL-NG. Wait on daylight, Perform 3 Runs of perforation, Change Top rams, Perform BOP test. Cont. BOP Test as NIOC Policy. B/O & L/D Extra Stds. RIH w/ 5-7/8" TCI Bit & 7" Scraper to 1100m. Cont. RIH w/ 5-7/8" TCI Bit & 7" Scraper to 3763m (0.5m Above 5" L.Lap). C.B.U, L/U CMT Line to string, Press. Test Same; OK, Displace well w/ Non-Solid Completion fluid, POOH to 2770m. Cont. POOH to 57m & L/D All Tubulars. Cont. POOH to surface & L/D All tubulars. R/U Completion string running equipment, Run completion as per program to 520m. Meanwhile perform P/T@ 68m & 520m, Run gauge ring @ 30m, 68m & 520m Cont. Run completion as per program to 1780m. Meanwhile perform P/T @ 995m, 1780m. Run gauge ring @ 995, 1450, 1780m. Cont. Run completion as per program to 2760m. Meanwhile perform P/T @ 2760m. Run Gauge ring @ 2248, 2270m. Cont. Run completion as per program to 2811.9m. P/T, Set P.Sleeve, Set Check valve in No-Go, Set PKR, P/T, Land TBG HGR & P/T, P/T PKR f/ Ann. As per program. N/D BOP Stack, Install XMT & P/T, Ret. TWCV, Release the rig.

Liner Lap Dry Test Report

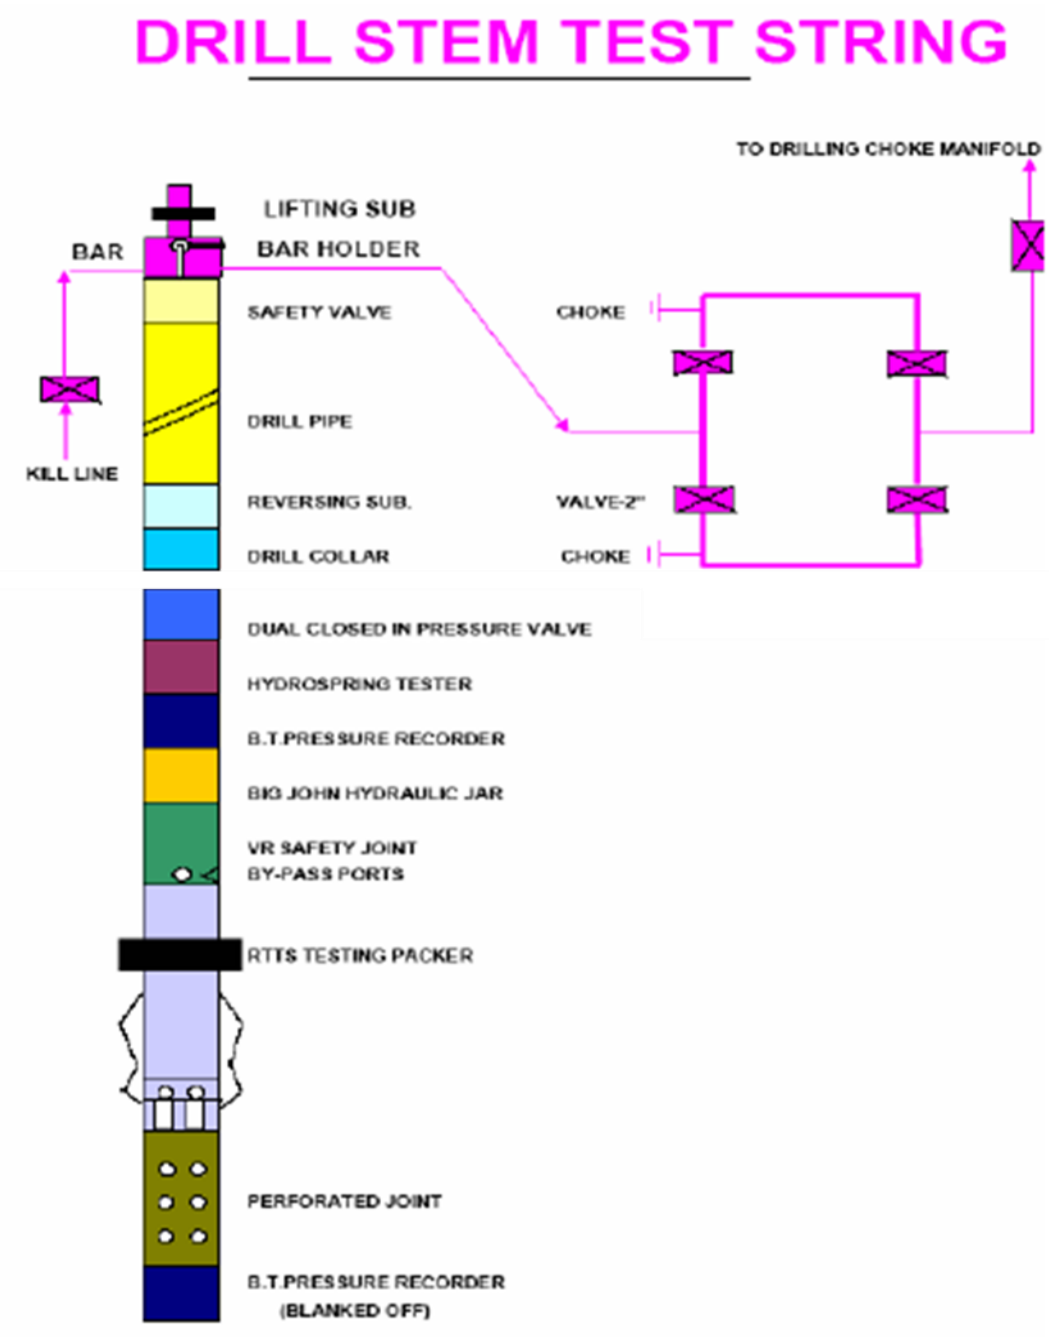


Figure 2-1: AZNS-2 07 Dry Test Event

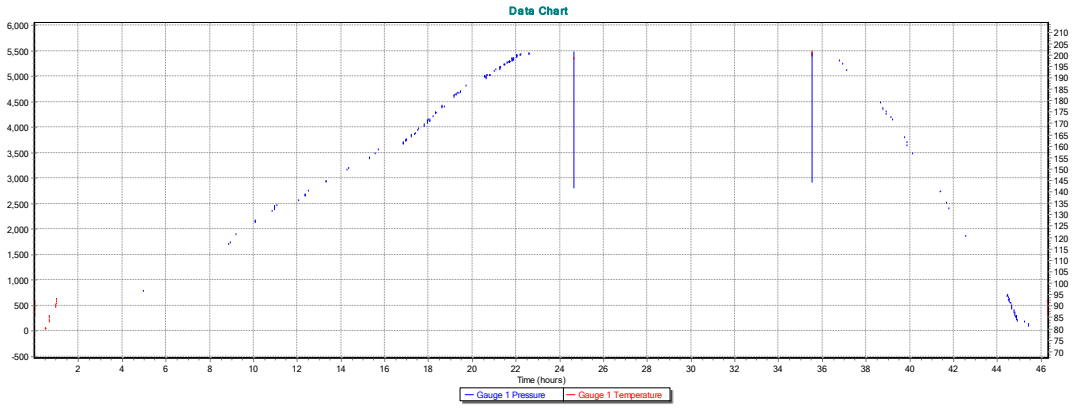


Figure 2-2: AZNS-207 Bottom BT Chart

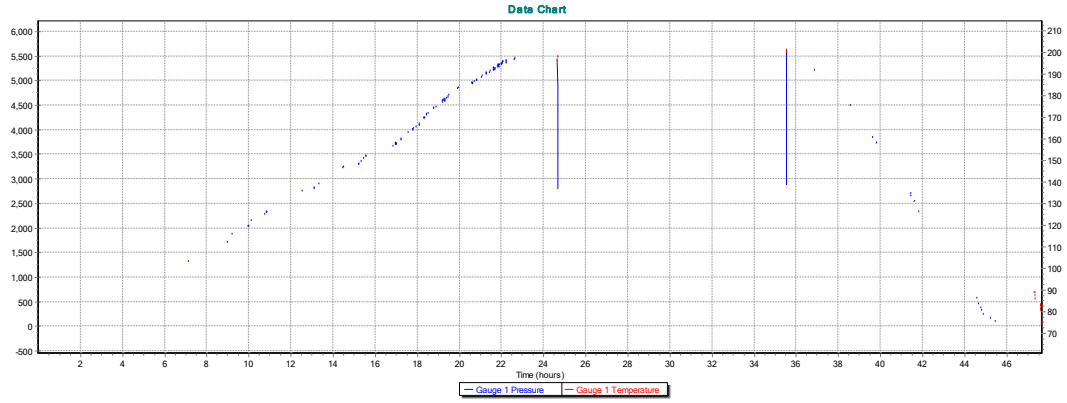


Figure 2-3: AZNS-207 Middle BT Chart

Row	Description	Time	Bottom Bt.	Middle Bt.
1	Initial Mud Static Pr. (psi)	1405/02/26 20:32	5472	5475
2	Open Well Pr. (psi)	1405/02/26 20:33	2793	2796
		1405/02/26 23:33	2794	2798
3	Close Well Pr. (psi)	1405/02/26 23:33	2795	2799
		1405/02/27 05:33	2900	2903
4	Final Hydrostatic Pr. (psi)	1405/02/27 07:14	5428	5430

Table 2-3: AZNS-207 Downhole Test Result Data

AZNS – 127 ST#2 Well Sketch

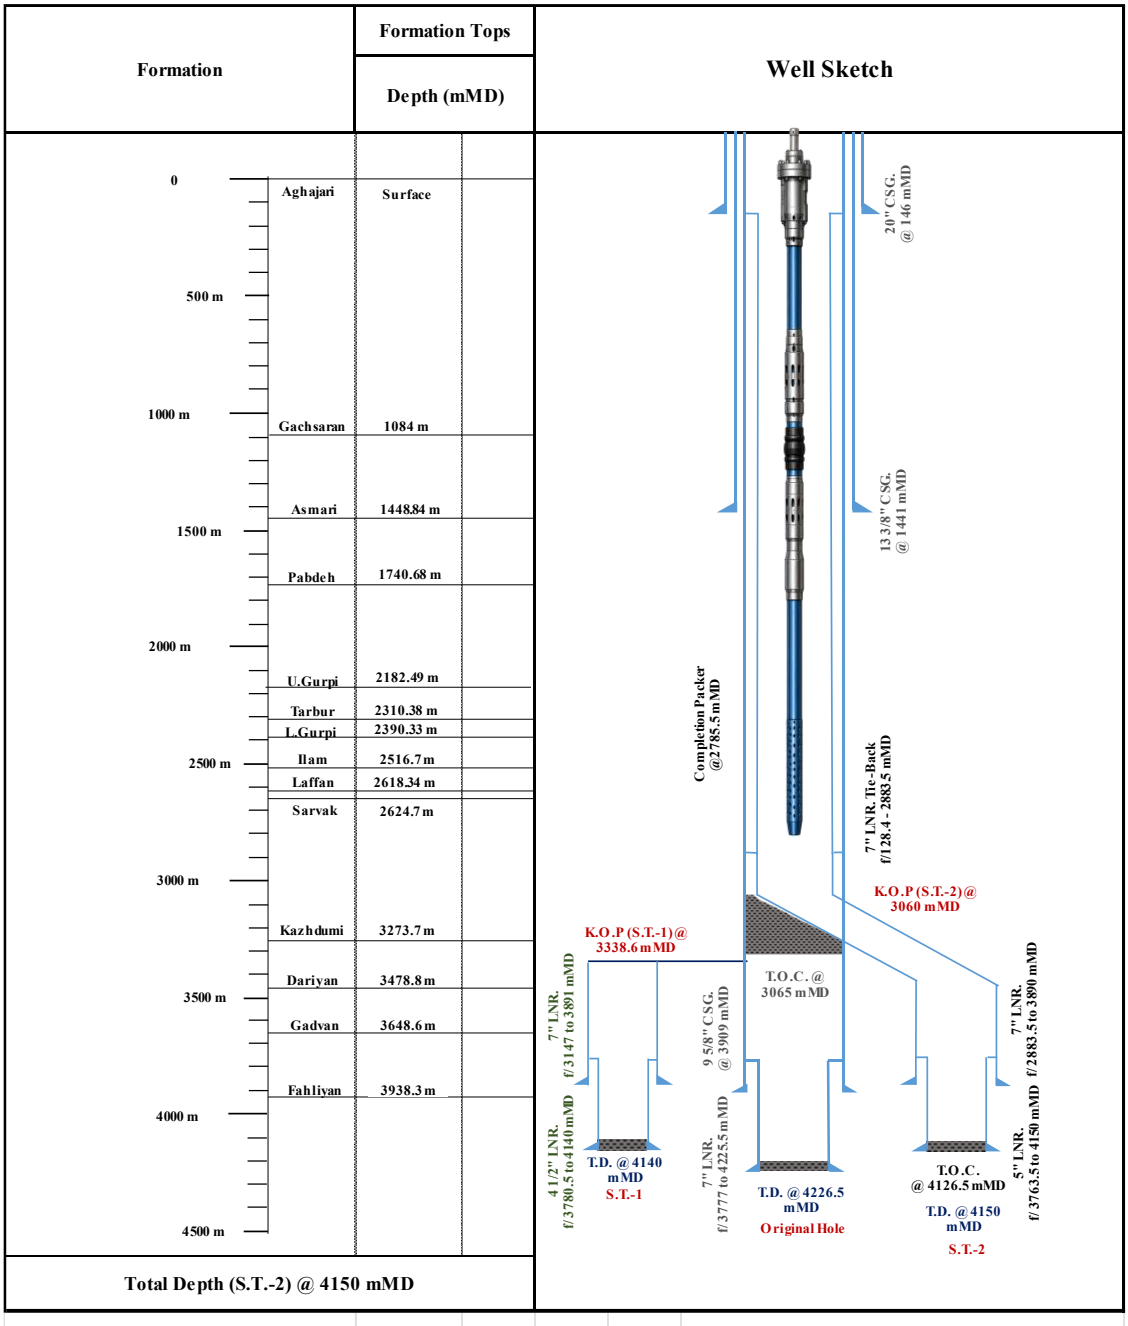


Figure 2-4: AZNS-127 ST2 Well Sketch

2.3 AZNS – 127 ROP Chart

Figure 2-5: AZNS-127 ROP Chart

2.4 Bit Record Table

Table 2-4: AZNS-127 Bit Record Table

2.5 Bit Parameters Plot

Figure 2-6: AZNS-127 Bit Parameters Plot

3. Time Analysis Report

3.1 Time vs. Depth Chart

Figure 3-1: AZNS-127 Workover Well Time vs. Depth After Side Track

3.2 Total Time Break-Down of Operation

WorkOver Section

Table 3-1: AZNS-127 WorkOver Time Breakdown

Side Track Section

Table 3-2: AZNS-127 Side Track Time Breakdown

Completion Section

Table 3-3: AZNS-127 Completion Time Breakdown

3.3 NPT Break-Down

Figure 3-2: AZNS-127 NPT Break-Down Chart

4. Geological & Logging Reports

4.1 Logging and Testing Reports

Log	Company	Hole Size (inch)	Run No.	Depth Interval (m)	Date
RBT/CCL/VDL/GR	Paniz Energy	7" L. (Cased Hole)	1	2865 - 3888.5	23-May-2026
Sonic/Resistivity/Nuclear/CDR/GR	Paniz Energy	6 1/8" (Open Hole)	1	3890 - 4136	1-Jun-2026
RBT/CCL/VDL/GR	Paniz Energy	5" L. (Cased Hole)	1	3753 - 4133	2-Jul-2026

Table 4-1: AZNS-127 #2 Logging Information

5. Bottom Hole Assembly Record

WorkOver Section

Date : 31.01.2026

7" Liner Shoe @ 3891m ; ID: 6.184" ; Weight : 29lb/ft

Phase Diameter : 6 ⅛"

BHA # 1	Length	Cum Lgth
5 ⅝" Overshot	2.15	2.15
4 ¾" DC	9.13	11.28
4 ¾" Fishing Jar	2.00	13.28
3 × 4 ¾" DC	26.56	39.84
15 × 3 ½" DP	145.49	185.33
XOS	1.120	186.45
TOTAL BHA		186.45

Bit Data

Bit #	--
Size	5 ⅝"
Type	Overshot
Mfgr	--
Serial No.	--
Nozzles	--
IADC Code	--
Depth In	4140
Depth Out	4140
Metrage	--
Hours Run	--
Av. ROP	--
Condition	--

Performance Record :

Total Revolution On Bit : -- krev

This Run (m) : -- hrs

Cumulative Bit Life (m) : -- hrs

Drilling & Mud Parameters :

WOB (klb)	--
RPM (rpm)	--
TOR (lbf.ft)	--
SPP (psi)	--
FLOW (gpm)	--
MW (pcf)	112
FV (sec)	56
PV / YP	33/14
Gel 0 / 10	4/6
Alk. / HPHT	9.5
FLT °C	--

Reason for POOH :

POOH due to change BHA.

PUMP DATA

Pump 1: 6.299" Q = 4.616 gal/stk (95%)

Pump 2: 6.299" Q = 4.616 gal/stk (95%)

Pump 3: 6.299" Q = 4.616 gal/stk (95%)

Date : 02.02.2026

7" Liner Shoe @ 3891m ; ID: 6.184" ; Weight : 29lb/ft

Phase Diameter : 6 ⅛"

BHA # 2	Length	Cum Lgth
6" Junk Mill	0.93	0.93
3 1/16" Bit sub	1.23	2.16
30 × 4 ¾" DC	272.56	274.72
9 × 3 ½" DP	87.25	361.97
XOS	1.12	363.09
TOTAL BHA		363.09

Bit Data

Bit #	--
Size	6"
Type	Junk Mill
Mfgr	--
Serial No.	417
Nozzles	5 × 16
IADC Code	--
Depth In	4140
Depth Out	4140
Metrage	--
Hours Run	--
Av. ROP	--
Condition	10% Used

Performance Record :

Total Revolution On Bit : -- krev

This Run (m) : -- hrs

Cumulative Bit Life (m) : -- hrs

Drilling & Mud Parameters :

WOB (klb)	10-20
RPM (rpm)	50-60
TOR (lbf.ft)	4.5-5
SPP (psi)	1100-2300
FLOW (gpm)	200-320
MW (pcf)	112
FV (sec)	56
PV / YP	33/14
Gel 0 / 10	4/6
Alk. / HPHT	9.5
FLT °C	--

Reason for POOH :

POOH due to change BHA.

PUMP DATA

Pump 1: 6.299" Q = 4.616 gal/stk (95%)

Pump 2: 6.299" Q = 4.616 gal/stk (95%)

Pump 3: 6.299" Q = 4.616 gal/stk (95%)

Date : 04.02.2026

7" Liner Shoe @ 3891m ; ID: 6.184" ; Weight : 29lb/ft

Phase Diameter : 6 ⅛"

BHA # 3	Length	Cum Lgth
5 ⅝" Overshot	2.15	2.15
4 ¾" DC	9.15	11.30
4 ¾" Fishing Jar	2.00	13.30
3 × 4 ¾" DC	26.56	39.86
15 × 3 ½" DP	145.49	185.35
XOS	1.120	186.47
TOTAL BHA		186.47

Performance Record :

Total Revolution On Bit : -- krev

This Run (m) : -- hrs

Cumulative Bit Life (m) : -- hrs

Bit Data

Bit #	--
Size	5 ⅝"
Type	Overshot
Mfgr	--
Serial No.	--
Nozzles	--
IADC Code	--
Depth In	4140
Depth Out	4140
Metrage	--
Hours Run	--
Av. ROP	--
Condition	--

Drilling & Mud Parameters :

WOB (klb)	--
RPM (rpm)	--
TOR (lbf.ft)	--
SPP (psi)	--
FLOW (gpm)	--
MW (pcf)	112
FV (sec)	56
PV / YP	33/14
Gel 0 / 10	4/6
Alk. / HPHT	9.5
FLT °C	--

Reason for POOH :

POOH due to change BHA.

PUMP DATA

Pump 1: 6.299" Q = 4.616 gal/stk (95%)

Pump 2: 6.299" Q = 4.616 gal/stk (95%)

Pump 3: 6.299" Q = 4.616 gal/stk (95%)

Date : 05.02.2026

7" Liner Shoe @ 3891m ; ID: 6.184" ; Weight : 29lb/ft

Phase Diameter : 6 ⅛"

BHA # 4	Length	Cum Lgth
6" Junk Mill	0.93	0.93
3 1/16" Bit sub	1.23	2.16
30 × 4 ¾" DC	272.56	274.72
15 × 3 ½" DP	145.49	420.21
XOS	1.12	421.33
TOTAL BHA		421.33

Performance Record :

Total Revolution On Bit : -- krev

This Run (m) : -- hrs

Cumulative Bit Life (m) : -- hrs

Bit Data

Bit #	--
Size	6"
Type	6" Junk Mill
Mfgr	--
Serial No.	423
Nozzles	5 × 16
IADC Code	--
Depth In	4140
Depth Out	4140
Metrage	--
Hours Run	--
Av. ROP	--
Condition	5% Used

Drilling & Mud Parameters :

WOB (klb)	6-14
RPM (rpm)	50
TOR (lbf.ft)	2-4
SPP (psi)	2300-2350
FLOW (gpm)	320
MW (pcf)	112
FV (sec)	53
PV / YP	33/13
Gel 0 / 10	4/6
Alk. / HPHT	9.5
FLT °C	--

Reason for POOH :

POOH due to change BHA.

PUMP DATA

Pump 1: 6.299" Q = 4.616 gal/stk (95%)

Pump 2: 6.299" Q = 4.616 gal/stk (95%)

Pump 3: 6.299" Q = 4.616 gal/stk (95%)

Date : 07.02.2026

7" Liner Shoe @ 3891m ; ID: 6.184" ; Weight : 29lb/ft

Phase Diameter : 6 ⅛"

BHA # 5	Length	Cum Lgth
5 ⅝" Overshot	2.15	2.15
4 ¾" DC	9.15	11.30
4 ¾" Fishing Jar	2.00	13.30
3 × 4 ¾" DC	26.56	39.86
15 × 3 ½" DP	145.49	185.35
XOS	1.120	186.47
TOTAL BHA		**186.47**

Bit Data

Bit #	--
Size	5 ⅝"
Type	Overshot
Mfgr	--
Serial No.	--
Nozzles	--
IADC Code	--
Depth In	4140
Depth Out	4140
Metrage	--
Hours Run	--
Av. ROP	--
Condition	--

Performance Record :

Total Revolution On Bit : -- krev

This Run (m) : -- hrs

Cumulative Bit Life (m) : -- hrs

Drilling & Mud Parameters :

WOB (klb)	--
RPM (rpm)	--
TOR (lbf.ft)	--
SPP (psi)	--
FLOW (gpm)	--
MW (pcf)	112
FV (sec)	56
PV / YP	33/14
Gel 0 / 10	4/6
Alk. / HPHT	9.5
FLT °C	--

Reason for POOH :

POOH due to change BHA.

PUMP DATA

Pump 1: 6.299" Q = 4.616 gal/stk (95%)

Pump 2: 6.299" Q = 4.616 gal/stk (95%)

Pump 3: 6.299" Q = 4.616 gal/stk (95%)

Date : 08.02.2026

7" Liner Shoe @ 3891m ; ID: 6.184" ; Weight : 29lb/ft

Phase Diameter : 6 ⅛"

BHA # 6	Length	Cum Lgth
5 ⅝" Overshot	2.15	2.15
4 ¾" DC	9.15	11.30
4 ¾" Fishing Jar	2.00	13.30
3 × 4 ¾" DC	26.56	39.86
15 × 3 ½" DP	145.49	185.35
XOS	1.120	186.47
TOTAL BHA		**186.47**

Bit Data

Bit #	--
Size	5 ⅝"
Type	Overshot
Mfgr	--
Serial No.	--
Nozzles	--
IADC Code	--
Depth In	4140
Depth Out	4140
Metrage	--
Hours Run	--
Av. ROP	--
Condition	--

Performance Record :

Total Revolution On Bit : -- krev

This Run (m) : -- hrs

Cumulative Bit Life (m) : -- hrs

Drilling & Mud Parameters :

WOB (klb)	--
RPM (rpm)	--
TOR (lbf.ft)	--
SPP (psi)	--
FLOW (gpm)	--
MW (pcf)	112
FV (sec)	56
PV / YP	33/14
Gel 0 / 10	4/6
Alk. / HPHT	9.5
FLT °C	--

Reason for POOH :

POOH due to change BHA.

PUMP DATA

Pump 1: 6.299" Q = 4.616 gal/stk (95%)

Pump 2: 6.299" Q = 4.616 gal/stk (95%)

Pump 3: 6.299" Q = 4.616 gal/stk (95%)

Date : 09.02.2026

7" Liner Shoe @ 3891m ; ID: 6.184" ; Weight : 29lb/ft

Phase Diameter : 6 ⅛"

BHA # 7	Length	Cum Lgth
5 ¼" Overshot	2.06	2.06
4 ¾" DC	9.15	11.21
4 ¾" Fishing Jar	2.00	13.21
3 × 4 ¾" DC	26.56	39.77
15 × 3 ½" DP	145.49	185.26
XOS	1.120	186.38
TOTAL BHA		**186.38**

Bit Data

Bit #	--
Size	5 ¼"
Type	Overshot
Mfgr	--
Serial No.	--
Nozzles	--
IADC Code	--
Depth In	4140
Depth Out	4140
Metrage	--
Hours Run	--
Av. ROP	--
Condition	--

Performance Record :

Total Revolution On Bit : -- krev

This Run (m) : -- hrs

Cumulative Bit Life (m) : -- hrs

Drilling & Mud Parameters :

WOB (klb)	--
RPM (rpm)	--
TOR (lbf.ft)	--
SPP (psi)	--
FLOW (gpm)	--
MW (pcf)	112
FV (sec)	56
PV / YP	33/14
Gel 0 / 10	4/6
Alk. / HPHT	9.5
FLT °C	--

Reason for POOH :

POOH due to change BHA.

PUMP DATA

Pump 1: 6.299" Q = 4.616 gal/stk (95%)

Pump 2: 6.299" Q = 4.616 gal/stk (95%)

Pump 3: 6.299" Q = 4.616 gal/stk (95%)

Date : 11.02.2026

7" Liner Shoe @ 3891m ; ID: 6.184" ; Weight : 29lb/ft

Phase Diameter : 6 ⅛"

BHA # 8	Length	Cum Lgth
6" Junk Mill	0.93	0.93
4 3/4" Bit sub	1.23	2.16
30 × 4 ¾" DC	272.56	274.72
15 × 3 ½" DP	145.49	420.21
XOS	1.12	421.33
TOTAL BHA		**421.33**

Bit Data

Bit #	--
Size	6"
Type	6" Junk Mill
Mfgr	--
Serial No.	423
Nozzles	5 × 16
IADC Code	--
Depth In	4140
Depth Out	4140
Metrage	--
Hours Run	--
Av. ROP	--
Condition	50 % Used

Performance Record :

Total Revolution On Bit : -- krev

This Run (m) : -- hrs

Cumulative Bit Life (m) : -- hrs

Drilling & Mud Parameters :

WOB (klb)	--
RPM (rpm)	--
TOR (lbf.ft)	--
SPP (psi)	--
FLOW (gpm)	--
MW (pcf)	112
FV (sec)	56
PV / YP	33/14
Gel 0 / 10	4/6
Alk. / HPHT	9.5
FLT °C	--

Reason for POOH :

POOH due to change BHA.

PUMP DATA

Pump 1: 6.299" Q = 4.616 gal/stk (95%)

Pump 2: 6.299" Q = 4.616 gal/stk (95%)

Pump 3: 6.299" Q = 4.616 gal/stk (95%)

Date : 13.02.2026

7" Liner Shoe @ 3891m ; ID: 6.184" ; Weight : 29lb/ft

Phase Diameter : 6 ⅛"

BHA # 9	Length	Cum Lgth
6" Junk Mill	0.93	0.93
4 3/4" Bit sub	1.23	2.16
30 × 4 ¾" DC	272.56	274.72
15 × 3 ½" DP	145.49	420.21
XOS	1.12	421.33
TOTAL BHA		**421.33**

Bit Data

Bit #	--
Size	6"
Type	6" Junk Mill
Mfgr	--
Serial No.	420
Nozzles	5 × 10
IADC Code	--
Depth In	4140
Depth Out	4140
Metrage	--
Hours Run	--
Av. ROP	--
Condition	15% Used

Performance Record :

Total Revolution On Bit : -- krev

This Run (m) : -- hrs

Cumulative Bit Life (m) : -- hrs

Drilling & Mud Parameters :

WOB (klb)	10-30
RPM (rpm)	20-70
TOR (lbf.ft)	3-5
SPP (psi)	600-2300
FLOW (gpm)	--
MW (pcf)	112
FV (sec)	53
PV / YP	32/13
Gel 0 / 10	4/6
Alk. / HPHT	9.5
FLT °C	--

Reason for POOH :

POOH due to change BHA.

PUMP DATA

Pump 1: 6.299" Q = 4.616 gal/stk (95%)

Pump 2: 6.299" Q = 4.616 gal/stk (95%)

Pump 3: 6.299" Q = 4.616 gal/stk (95%)

Date : 15.02.2026

7" Liner Shoe @ 3891m ; ID: 6.184" ; Weight : 29lb/ft

Phase Diameter : 6 ⅛"

BHA # 10	Length	Cum Lgth
6" Junk Mill	0.93	0.93
4 3/4" Bit sub	1.23	2.16
30 × 4 ¾" DC	272.56	274.72
15 × 3 ½" DP	145.49	420.21
XOS	1.12	421.33
TOTAL BHA		**421.33**

Bit Data

Bit #	--
Size	6"
Type	6" Junk Mill
Mfgr	--
Serial No.	503
Nozzles	5 × 10
IADC Code	--
Depth In	4140
Depth Out	4140
Metrage	--
Hours Run	--
Av. ROP	--
Condition	10% Used

Performance Record :

Total Revolution On Bit : -- krev

This Run (m) : -- hrs

Cumulative Bit Life (m) : -- hrs

Drilling & Mud Parameters :

WOB (klb)	10-30
RPM (rpm)	20-70
TOR (lbf.ft)	3-5
SPP (psi)	600-2300
FLOW (gpm)	150-600
MW (pcf)	110
FV (sec)	52
PV / YP	12
Gel 0 / 10	3/5
Alk. / HPHT	9.6
FLT °C	--

Reason for POOH :

POOH due to change BHA.

PUMP DATA

Pump 1: 6.299" Q = 4.616 gal/stk (95%)

Pump 2: 6.299" Q = 4.616 gal/stk (95%)

Pump 3: 6.299" Q = 4.616 gal/stk (95%)

Date : 18.02.2026

7" Liner Shoe @ 3891m ; ID: 6.184" ; Weight : 29lb/ft

Phase Diameter : 6 ⅛"

BHA # 11	Length	Cum Lgth
2" × 4" Taper Tap	0.97	0.97
3 1/16" Bit sub	1.23	2.20
1 × 4 ¾" DC	9.15	11.35
4 ¾" Fishing Jar	2.00	13.35
15 × 4 ¾" DC	135.44	148.79
60 × 3 ½" DP	578.90	727.69
XOS	1.12	728.81
TOTAL BHA		**728.81**

Bit Data

Bit #	--
Size	2" × 4"
Type	Taper Tap
Mfgr	--
Serial No.	CS7745
Nozzles	3×16/32" + 1× 24/32
IADC Code	--
Depth In	4140
Depth Out	4140
Metrage	--
Hours Run	--
Av. ROP	--
Condition	--

Performance Record :

Total Revolution On Bit : -- krev

This Run (m) : -- hrs

Cumulative Bit Life (m) : -- hrs

Drilling & Mud Parameters :

WOB (klb)	--
RPM (rpm)	--
TOR (lbf.ft)	--
SPP (psi)	--
FLOW (gpm)	--
MW (pcf)	110
FV (sec)	52
PV / YP	27/13
Gel 0 / 10	3/5
Alk. / HPHT	9.5
FLT °C	--

Reason for POOH :

POOH due to change BHA.

PUMP DATA

Pump 1: 6.299" Q = 4.616 gal/stk (95%)

Pump 2: 6.299" Q = 4.616 gal/stk (95%)

Pump 3: 6.299" Q = 4.616 gal/stk (95%)

Date : 20.02.2026

7" Liner Shoe @ 3891m ; ID: 6.184" ; Weight : 29lb/ft

Phase Diameter : 6 ⅛"

BHA # 12	Length	Cum Lgth
6" M.MJ.Mill	0.93	0.93
7" Scraper	1.01	1.94
Bit Sub	1.22	3.16
9 × 4 ¾" DC	81.00	84.16
58 × 3 ½" DP	559.89	644.05
XOS	1.12	645.17
D.Pin	0.44	645.61
9 5/8" Scraper	1.63	647.24
Bit Sub	0.95	648.19
TOTAL BHA		648.19

Bit Data

Bit #	--
Size	6"
Type	6" Junk Mill
Mfgr	--
Serial No.	503
Nozzles	5×10/32"
IADC Code	--
Depth In	4140
Depth Out	4140
Metrage	--
Hours Run	--
Av. ROP	--
Condition	

Performance Record :

Total Revolution On Bit : -- krev

This Run (m) : -- hrs

Cumulative Bit Life (m) : -- hrs

Drilling & Mud Parameters :

WOB (klb)	--
RPM (rpm)	--
TOR (lbf.ft)	--
SPP (psi)	--
FLOW (gpm)	--
MW (pcf)	104
FV (sec)	48
PV / YP	22/12
Gel 0 / 10	3/5
Alk. / HPHT	9.5
FLT °C	--

Reason for POOH :

POOH due to change BHA.

PUMP DATA

Pump 1: 6.299" Q = 4.616 gal/stk (95%)

Pump 2: 6.299" Q = 4.616 gal/stk (95%)

Pump 3: 6.299" Q = 4.616 gal/stk (95%)

Date : 22.02.2026

7" Liner Shoe @ 3891m ; ID: 6.184" ; Weight : 29lb/ft

Phase Diameter : 6 ⅛"

BHA # 13	Length	Cum Lgth
5 ⅞" M.M.J.Mill	0.93	0.93
4 ¼" Junk Sub	0.92	1.85
D.Pin	1.02	2.87
4 ¼" Junk Sub	0.66	3.53
Bit Sub	1.22.	4.75
18 × 4 ¾" DC	162.71	167.46
57 × 3 ½" DP	550.19	717.65
XOS	1.12	718.77
TOTAL BHA		718.77

Bit Data

Bit #	--
Size	5 ⅞"
Type	5 ⅞" Junk Mill
Mfgr	--
Serial No.	--
Nozzles	5×18/32"
IADC Code	--
Depth In	4140
Depth Out	4140
Metrage	--
Hours Run	--
Av. ROP	--
Condition	--

Performance Record :

Total Revolution On Bit : -- krev

This Run (m) : -- hrs

Cumulative Bit Life (m) : -- hrs

Drilling & Mud Parameters :

WOB (klb)	--
RPM (rpm)	--
TOR (lbf.ft)	--
SPP (psi)	--
FLOW (gpm)	--
MW (pcf)	104
FV (sec)	48
PV / YP	23/12
Gel 0 / 10	3/5
Alk. / HPHT	9.5
FLT °C	--

Reason for POOH :

POOH due to change BHA.

PUMP DATA

Pump 1: 6.299" Q = 4.616 gal/stk (95%)

Pump 2: 6.299" Q = 4.616 gal/stk (95%)

Pump 3: 6.299" Q = 4.616 gal/stk (95%)

Date : 24.02.2026

7" Liner Shoe @ 3891m ; ID: 6.184" ; Weight : 29lb/ft

Phase Diameter : 6 ⅛"

BHA # 14	Length	Cum Lgth
5 ⅞" M.M.J.Mill	0.93	0.93
4 ¼" Junk Sub	0.92	1.85
D.Pin	1.02	2.87
4 ¼" Junk Sub	0.66	3.53
Bit Sub	1.22.	4.75
9 × 4 ¾" DC	81.93	88.68
66 × 3 ½" DP	636.92	723.60
XOS	1.12	724.72
TOTAL BHA		724.72

Bit Data

Bit #	--
Size	5 ⅞"
Type	5 ⅞" Junk Mill
Mfgr	--
Serial No.	--
Nozzles	5×18/32"
IADC Code	--
Depth In	4140
Depth Out	4140
Metrage	--
Hours Run	--
Av. ROP	--
Condition	--

Performance Record :

Total Revolution On Bit : -- krev

This Run (m) : -- hrs

Cumulative Bit Life (m) : -- hrs

Drilling & Mud Parameters :

WOB (klb)	--
RPM (rpm)	--
TOR (lbf.ft)	--
SPP (psi)	--
FLOW (gpm)	--
MW (pcf)	104
FV (sec)	48
PV / YP	25/12
Gel 0 / 10	2/3
Alk. / HPHT	9.5
FLT °C	--

Reason for POOH :

POOH due to change BHA.

PUMP DATA

Pump 1: 6.299" Q = 4.616 gal/stk (95%)

Pump 2: 6.299" Q = 4.616 gal/stk (95%)

Pump 3: 6.299" Q = 4.616 gal/stk (95%)

Date : 26.02.2026

7" Liner Shoe @ 3891m ; ID: 6.184" ; Weight : 29lb/ft

Phase Diameter : 6 ⅛"

BHA # 15	Length	Cum Lgth
3 ½" J.Mill	0.83	0.83
3 ⅛ Bit Sub	1.12	1.95
24 ×3 ⅛" DC	225.19	224.14
15 × 2 ⅞" DP	141.75	365.89
4 3/4" XOS	0.67	366.56
1 ×3 ½" DP	9.70	376.26
D.PIN	1.02	377.28
4 ¼" Junk Sub	0.92	378.20
D.PIN	1.02	379.22
4 ¾" Junk Sub	0.66	379.88
4 ¾" Bit Sub	1.22	381.10
66 × 3 ½" DP	636.92	1018.02
4 ½" XOS	1.12	1019.14
TOTAL BHA		1019.14

Performance Record :

Total Revolution On Bit : -- krev

This Run (m) : -- hrs

Cumulative Bit Life (m) : -- hrs

Reason for POOH :

POOH due to change BHA.

Bit Data

Bit #	--
Size	3 ½"
Type	3 ½" Junk Mill
Mfgr	--
Serial No.	--
Nozzles	5×20/32"
IADC Code	--
Depth In	4140
Depth Out	4140
Metrage	--
Hours Run	--
Av. ROP	--
Condition	--

Drilling & Mud Parameters :

WOB (klb)	--
RPM (rpm)	--
TOR (lbf.ft)	--
SPP (psi)	--
FLOW (gpm)	--
MW (pcf)	104
FV (sec)	54
PV / YP	31/16
Gel 0 / 10	6/4
Alk. / HPHT	9.5
FLT °C	--

PUMP DATA

Pump 1: 6.299" Q = 4.616 gal/stk (95%)

Pump 2: 6.299" Q = 4.616 gal/stk (95%)

Pump 3: 6.299" Q = 4.616 gal/stk (95%)

Sidetrack Section

Date : 04.04.2026

9 ⅝" CSG Shoe @ 3909m ; ID: 8.835" ; Weight : 47lb/ft

Phase Diameter : 8 ½"

BHA # 1	Length	Cum Lgth
6 ⅛" C.C.Bit	0.2	0.20
4 ¾" Bit Sub	0.99	1.19
99 × 3 ½" DP	955.34	956.53
4 ½" XOS	1.12	957.65
TOTAL BHA		957.65

Bit Data

Bit #	C.C.Bit
Size	6 ⅛"
Type	--
Mfgr	--
Serial No.	--
Nozzles	--
IADC Code	--
Depth In	4140
Depth Out	4140
Metrage	--
Hours Run	--
Av. ROP	--
Condition	--

Performance Record :

Total Revolution On Bit : -- krev

This Run (m) : -- hrs

Cumulative Bit Life (m) : -- hrs

Drilling & Mud Parameters :

WOB (klb)	--
RPM (rpm)	--
TOR (lbf.ft)	--
SPP (psi)	--
FLOW (gpm)	--
MW (pcf)	104
FV (sec)	54
PV / YP	31/16
Gel 0 / 10	6/4
Alk. / HPHT	9.5
FLT °C	--

Reason for POOH :

POOH due to change BHA.

PUMP DATA

Pump 1: 6.299" Q = 4.616 gal/stk (95%)

Pump 2: 6.299" Q = 4.616 gal/stk (95%)

Pump 3: 6.299" Q = 4.616 gal/stk (95%)

Date : 06.04.2026

9 ⅝" CSG Shoe @ 3909m ; ID: 8.835" ; Weight : 47lb/ft

Phase Diameter : 8 ½"

BHA # 2	Length	Cum Lgth
8 ½" B.Bit	0.24	0.24
6 ½" Bit Sub	0.95	1.19
9 × 6 ½" DC	81.95	83.14
24 × 5" HWDP	223.06	306.20
TOTAL BHA		306.20

Bit Data

Bit #	1
Size	8 ½"
Type	--
Mfgr	K.Dream
Serial No.	22003238JH
Nozzles	Open
IADC Code	517
Depth In	4140
Depth Out	4140
Metrage	--
Hours Run	--
Av. ROP	--
Condition	--

Performance Record :

Total Revolution On Bit : -- krev

This Run (m) : -- hrs

Cumulative Bit Life (m) : -- hrs

Drilling & Mud Parameters :

WOB (klb)	--
RPM (rpm)	--
TOR (lbf.ft)	--
SPP (psi)	--
FLOW (gpm)	--
MW (pcf)	104
FV (sec)	54
PV / YP	31/16
Gel 0 / 10	6/4
Alk. / HPHT	9.5
FLT °C	--

Reason for POOH :

POOH due to change BHA.

PUMP DATA

Pump 1: 6.299" Q = 4.616 gal/stk (95%)

Pump 2: 6.299" Q = 4.616 gal/stk (95%)

Pump 3: 6.299" Q = 4.616 gal/stk (95%)

Date : 07.04.2026

9 ⅝" CSG Shoe @ 3909m ; ID: 8.835" ; Weight : 47lb/ft

Phase Diameter : 8 ½"

BHA # 3	Length	Cum Lgth
8 ½" B.Bit	0.24	0.24
6 ½" Bit Sub	0.95	1.19
9 ⅝" Scraper	1.39	2.58
24 × 5" HWDP	223.06	225.64
TOTAL BHA		225.64

Bit Data

Bit #	1 Run#2
Size	8 ½"
Type	--
Mfgr	K.Dream
Serial No.	22003238JH
Nozzles	Open
IADC Code	517
Depth In	4140
Depth Out	4140
Metrage	--
Hours Run	--
Av. ROP	--
Condition	--

Performance Record :

Total Revolution On Bit : -- krev

This Run (m) : -- hrs

Cumulative Bit Life (m) : -- hrs

Drilling & Mud Parameters :

WOB (klb)	--
RPM (rpm)	--
TOR (lbf.ft)	--
SPP (psi)	--
FLOW (gpm)	--
MW (pcf)	104
FV (sec)	54
PV / YP	31/16
Gel 0 / 10	6/4
Alk. / HPHT	9.5
FLT °C	--

Reason for POOH :

POOH due to change BHA.

PUMP DATA

Pump 1: 6.299" Q = 4.616 gal/stk (95%)

Pump 2: 6.299" Q = 4.616 gal/stk (95%)

Pump 3: 6.299" Q = 4.616 gal/stk (95%)

Date : 09.04.2026

9 ⅝" CSG Shoe @ 3909m ; ID: 8.835" ; Weight : 47lb/ft

Phase Diameter : 8 ½"

BHA # 4	Length	Cum Lgth
9 ⅝" Whipstock	7.13	7.13
8 ½" Rugby Mill	0.83	7.96
6 ½" Running tools	1.34	9.30
1 × 5" DP	9.60	18.90
6 ¾" Gyro sub	0.40	19.30
9 × 6 ½" DC	81.95	101.25
15 × 5" HWDP	139.60	240.85
TOTAL BHA		240.85

Bit Data

Bit #	--
Size	9 ⅝"
Type	--
Mfgr	--
Serial No.	--
Nozzles	--
IADC Code	--
Depth In	4140
Depth Out	4140
Metrage	--
Hours Run	--
Av. ROP	--
Condition	--

Performance Record :

Total Revolution On Bit : -- krev

This Run (m) : -- hrs

Cumulative Bit Life (m) : -- hrs

Drilling & Mud Parameters :

WOB (klb)	--
RPM (rpm)	--
TOR (lbf.ft)	--
SPP (psi)	--
FLOW (gpm)	--
MW (pcf)	80
FV (sec)	42
PV / YP	13/8
Gel 0 / 10	2/3
Alk. / HPHT	9
FLT °C	--

Reason for POOH :

POOH due to change BHA.

PUMP DATA

Pump 1: 6.299" Q = 4.616 gal/stk (95%)

Pump 2: 6.299" Q = 4.616 gal/stk (95%)

Pump 3: 6.299" Q = 4.616 gal/stk (95%)

Date : 11.04.2026

9 ⅝" CSG Shoe @ 3909m ; ID: 8.835" ; Weight : 47lb/ft

Phase Diameter : 8 ½"

BHA # 5	Length	Cum Lgth
8 ½" Tricon Mill	4.29	4.29
6 ½" Running tools	1.34	5.63
1 × 5" DP	9.52	15.15
9 × 6 ½" DC	81.95	97.10
15 × 5" HWDP	139.60	236.70
TOTAL BHA		236.70

Bit Data

Bit #	--
Size	8 ½"
Type	Tricon Mill
Mfgr	--
Serial No.	--
Nozzles	--
IADC Code	--
Depth In	4140
Depth Out	4140
Metrage	--
Hours Run	--
Av. ROP	--
Condition	--

Performance Record :

Total Revolution On Bit : -- krev

This Run (m) : -- hrs

Cumulative Bit Life (m) : -- hrs

Drilling & Mud Parameters :

WOB (klb)	--
RPM (rpm)	--
TOR (lbf.ft)	--
SPP (psi)	--
FLOW (gpm)	--
MW (pcf)	80
FV (sec)	42
PV / YP	13/8
Gel 0 / 10	2/3
Alk. / HPHT	9
FLT °C	--

Reason for POOH :

POOH due to LIH.

PUMP DATA

Pump 1: 6.299" Q = 4.616 gal/stk (95%)

Pump 2: 6.299" Q = 4.616 gal/stk (95%)

Pump 3: 6.299" Q = 4.616 gal/stk (95%)

Date : 13.04.2026

9 ⅝" CSG Shoe @ 3909m ; ID: 8.835" ; Weight : 47lb/ft

Phase Diameter : 8 ½"

BHA # 6	Length	Cum Lgth
4 ¾" Taper tap	0.82	0.82
1 × 3 ½" HWDP	9.35	10.17
4 ¾"Jar	2.29	12.46
1 × 3 ½" HWDP	82.72	95.18
4 ¾" X.O.S	1.12	96.30
TOTAL BHA		96.30

Bit Data

Bit #	--
Size	4 ¾"
Type	Taper tap
Mfgr	--
Serial No.	--
Nozzles	--
IADC Code	--
Depth In	4140
Depth Out	4140
Metrage	--
Hours Run	--
Av. ROP	--
Condition	--

Performance Record :

Total Revolution On Bit : -- krev

This Run (m) : -- hrs

Cumulative Bit Life (m) : -- hrs

Drilling & Mud Parameters :

WOB (klb)	--
RPM (rpm)	--
TOR (lbf.ft)	--
SPP (psi)	--
FLOW (gpm)	--
MW (pcf)	80
FV (sec)	42
PV / YP	13/8
Gel 0 / 10	2/3
Alk. / HPHT	9
FLT °C	--

Reason for POOH :

POOH due to change BHA.

PUMP DATA

Pump 1: 6.299" Q = 4.616 gal/stk (95%)

Pump 2: 6.299" Q = 4.616 gal/stk (95%)

Pump 3: 6.299" Q = 4.616 gal/stk (95%)

Date : 14.04.2026

9 ⅝" CSG Shoe @ 3909m ; ID: 8.835" ; Weight : 47lb/ft

Phase Diameter : 8 ½"

BHA # 7	Length	Cum Lgth
8 ½" Tricon Mill	4.25	4.25
6 ½" Running tools	1.34	5.59
1 × 5" DP	9.53	15.120
9 × 6 ½" DC	81.89	97.010
15 × 5" HWDP	139.60	236.605
TOTAL BHA		236.605

Bit Data

Bit #	--
Size	8 ½"
Type	Tricon Mill
Mfgr	--
Serial No.	--
Nozzles	--
IADC Code	--
Depth In	4140
Depth Out	4140
Metrage	--
Hours Run	--
Av. ROP	--
Condition	--

Performance Record :

Total Revolution On Bit : -- krev

This Run (m) : -- hrs

Cumulative Bit Life (m) : -- hrs

Drilling & Mud Parameters :

WOB (klb)	--
RPM (rpm)	--
TOR (lbf.ft)	--
SPP (psi)	--
FLOW (gpm)	--
MW (pcf)	80
FV (sec)	42
PV / YP	13/8
Gel 0 / 10	2/3
Alk. / HPHT	9
FLT °C	--

Reason for POOH :

POOH due to change BHA.

PUMP DATA

Pump 1: 6.299" Q = 4.616 gal/stk (95%)

Pump 2: 6.299" Q = 4.616 gal/stk (95%)

Pump 3: 6.299" Q = 4.616 gal/stk (95%)

Date : 16.04.2026

9 ⅝" CSG Shoe @ 3909m ; ID: 8.835" ; Weight : 47lb/ft

Phase Diameter : 8 ½"

BHA # 8	Length	Cum Lgth
8 ½" Tci Bit	0.24	0.24
6 ¾" PDM	8.42	8.66
6 7/16" UBHO Sub	0.89	9.550
6 ¾" NMFDC	8.96	18.510
6 ¾" Gyro sub	0.40	18.910
21 × 5" HWDP	195.41	214.320
Flex Joint	2.39	216.710
6 ½" Jar	6.43	223.140
3 × 5" HWDP	27.65	250.790
TOTAL BHA		250.790

Bit Data

Bit #	2
Size	8 ½"
Type	Tci Bit
Mfgr	K.Dream
Serial No.	2408590JH
Nozzles	5 × 20/32"
IADC Code	HJT517G
Depth In	3060
Depth Out	3093.5
Metrage	33.5
Hours Run	29.39
Av. ROP	1.36
Condition	1-1-WT-A-E-I-NO-BHA

Performance Record :

Total Revolution On Bit : *317.41* krev

This Run (33.5m) : *29.39* hrs

Cumulative Bit Life (33.5m) : *29.39* hrs

Drilling & Mud Parameters :

WOB (klb)	10-15
RPM (rpm)	30 Surface + 150 Motor
TOR (lbf.ft)	2
SPP (psi)	2000-2050
FLOW (gpm)	450
MW (pcf)	80
FV (sec)	42
PV / YP	13/8
Gel 0 / 10	2/3
Alk. / HPHT	9
FLT °C	--

Reason for POOH :

POOH due to change BHA.

PUMP DATA

Pump 1: 6.299" Q = 4.616 gal/stk (95%)

Pump 2: 6.299" Q = 4.616 gal/stk (95%)

Pump 3: 6.299" Q = 4.616 gal/stk (95%)

Date : 19.04.2026

9 ⅝" CSG Shoe @ 3909m ; ID: 8.835" ; Weight : 47lb/ft

Phase Diameter : 8 ½"

BHA # 9	Length	Cum Lgth
8 ½" PDC Bit	0.28	0.28
6 ¾" PDM	8.42	8.70
6 7/16" UBHO Sub	0.89	9.590
6 ¾" NMFDC	8.96	18.550
21 × 5" HWDP	195.41	213.960
Flex Joint	2.39	216.350
6 ½" Jar	6.43	222.780
3 × 5" HWDP	27.65	250.430
TOTAL BHA		250.430

Bit Data

Bit #	3
Size	8 ½"
Type	PDC
Mfgr	Beste
Serial No.	255717
Nozzles	6 × 14/32"
IADC Code	M1665
Depth In	3093.5
Depth Out	3324
Metrage	230.7
Hours Run	62
Av. ROP	3.8
Condition	1-1-BT-N-X-I-NO-BHA

Performance Record :

Total Revolution On Bit : 688.20 krev

This Run (230.7m) : 62.00 hrs

Cumulative Bit Life (230.7m) : 62.00 hrs

Drilling & Mud Parameters :

WOB (klb)	2-10
RPM (rpm)	50 Surface + 130-140 Motor
TOR (lbf.ft)	2-5
SPP (psi)	2150-2200
FLOW (gpm)	450-470
MW (pcf)	80
FV (sec)	40-42
PV / YP	8-13/8-12
Gel 0 / 10	3/5
Alk. / HPHT	9-9.5
FLT °C	--

Reason for POOH :

POOH due to change BHA.

PUMP DATA

Pump 1: 6.299" Q = 4.616 gal/stk (95%)

Pump 2: 6.299" Q = 4.616 gal/stk (95%)

Pump 3: 6.299" Q = 4.616 gal/stk (95%)

Date : 24.04.2026

9 ⅝" CSG Shoe @ 3909m ; ID: 8.835" ; Weight : 47lb/ft

Phase Diameter : 8 ½"

BHA # 10	Length	Cum Lgth
8 ½" PDC Bit	0.28	0.28
6 ¾" PDM	8.44	8.72
6 7/16" UBHO Sub	0.89	9.610
6 ¾" NMFDC	8.96	18.570
8 ½" S.Stab	1.50	20.070
21 × 5" HWDP	195.41	215.480
Flex Joint	2.39	217.870
6 ½" Jar	6.40	224.270
3 × 5" HWDP	27.65	251.920
TOTAL BHA		251.920

Bit Data

Bit #	3 Run#2
Size	8 ½"
Type	PDC
Mfgr	Beste
Serial No.	255717
Nozzles	6 × 14/32"
IADC Code	M1665
Depth In	3324
Depth Out	3634.22
Metrage	310.22
Hours Run	69.5
Av. ROP	4.5
Condition	2-3-BT-A-X-I-WT-PR

Performance Record :

Total Revolution On Bit : 813.15 krev

This Run (310.22m) : 69.50 hrs

Cumulative Bit Life (540.92m) : 131.50 hrs

Drilling & Mud Parameters :

WOB (klb)	5-20
RPM (rpm)	50-60 Surface + 135-145 Motor
TOR (lbf.ft)	3-5
SPP (psi)	2350-2450
FLOW (gpm)	460-470
MW (pcf)	80
FV (sec)	43
PV / YP	13/15
Gel 0 / 10	3/5
Alk. / HPHT	9.5
FLT °C	--

Reason for POOH :

POOH due to penetration rate.

PUMP DATA

Pump 1: 6.299" Q = 4.616 gal/stk (95%)

Pump 2: 6.299" Q = 4.616 gal/stk (95%)

Pump 3: 6.299" Q = 4.616 gal/stk (95%)

Date : 29.04.2026

9 ⅝" CSG Shoe @ 3060m ; ID: 8.835" ; Weight : 47lb/ft

Phase Diameter : 8 ½"

BHA # 11	Length	Cum Lgth
8 ½" PDC Bit	0.3	0.30
6 ¾" PDM	8.44	8.74
6 7/16" UBHO Sub	0.89	9.630
6 ¾" NMFDC	8.63	18.260
8 ½" S.Stab	1.50	19.760
21 × 5" HWDP	195.41	215.170
Flex Joint	2.39	217.560
6 ½" Jar	6.40	223.960
3 × 5" HWDP	27.65	251.610
TOTAL BHA		251.610

Bit Data

Bit #	4
Size	8 ½"
Type	PDC
Mfgr	K.Dream
Serial No.	2404152
Nozzles	6 × 14/32"
IADC Code	M1662
Depth In	3634.22
Depth Out	3791
Metrage	156.78
Hours Run	38.71
Av. ROP	4.05
Condition	1-1-WT-A-X-IG-NO-DMF

Performance Record :

Total Revolution On Bit : 243.87 krev

This Run (156.78m) : 38.71 hrs

Cumulative Bit Life (156.78m) : 38.71 hrs

Drilling & Mud Parameters :

WOB (klb)	2-20
RPM (rpm)	43-65 Surface + 135-145 Motor
TOR (lbf.ft)	3-5
SPP (psi)	2115-2700
FLOW (gpm)	425-514
MW (pcf)	80-81
FV (sec)	45
PV / YP	13/15
Gel 0 / 10	3/5
Alk. / HPHT	9.5
FLT °C	--

Reason for POOH :

POOH due to DHM failed

PUMP DATA

Pump 1: 6.299" Q = 4.616 gal/stk (95%)

Pump 2: 6.299" Q = 4.616 gal/stk (95%)

Pump 3: 6.299" Q = 4.616 gal/stk (95%)

Date : 05.05.2026

9 ⅝" CSG Shoe @ 3060m ; ID: 8.835" ; Weight : 47lb/ft

Phase Diameter : 8 ½"

BHA # 12	Length	Cum Lgth
8 ½" PDC Bit	0.3	0.30
6 ¾" PDM	8.43	8.73
1 × 6 ½" DC	8.79	17.520
8 ½" S.Stab	1.50	19.020
21 × 5" HWDP	195.41	214.430
Flex Joint	2.39	216.820
6 ½" Jar	6.40	223.220
3 × 5" HWDP	27.65	250.870
		250.870
TOTAL BHA		250.870

Bit Data

Bit #	4 Run#2
Size	8 ½"
Type	PDC
Mfgr	K.Dream
Serial No.	2404152
Nozzles	6 × 14/32"
IADC Code	M1662
Depth In	3791
Depth Out	3811
Metrage	20.00
Hours Run	4.7
Av. ROP	4.26
Condition	1-1-WT-A-X-IG-NO-DMF

Performance Record :

Total Revolution On Bit : 29.61 krev

This Run (20m) : 4.70 hrs

Cumulative Bit Life (176.78m) : 43.41 hrs

Drilling & Mud Parameters :

WOB (klb)	7-10
RPM (rpm)	45-50 Surface + 130-140 Motor
TOR (lbf.ft)	3.5-4.5
SPP (psi)	2500-2600
FLOW (gpm)	480-500
MW (pcf)	81
FV (sec)	42
PV / YP	13/14
Gel 0 / 10	3/5
Alk. / HPHT	9.5
FLT °C	--

Reason for POOH :

POOH due to DHM failed

PUMP DATA

Pump 1: 6.299" Q = 4.616 gal/stk (95%)

Pump 2: 6.299" Q = 4.616 gal/stk (95%)

Pump 3: 6.299" Q = 4.616 gal/stk (95%)

Date : 07.05.2026

9 ⅝" CSG Shoe @ 3060m ; ID: 8.835" ; Weight : 47lb/ft

Phase Diameter : 8 ½"

BHA # 13	Length	Cum Lgth
8 ½" PDC Bit	0.3	0.30
6 ½" Bit sub	1.17	1.47
2 × 6 ½" DC	17.58	19.050
8 ½" S.Stab	1.50	20.550
2 × 6 ½" DC	27.32	47.870
24 × 5" HWDP	223.06	270.930
		270.930
		270.930
		270.930
TOTAL BHA		270.930

Bit Data

Bit #	4 Run#3
Size	8 ½"
Type	PDC
Mfgr	K.Dream
Serial No.	2404152
Nozzles	6 × 14/32"
IADC Code	M1662
Depth In	3811
Depth Out	3890
Metrage	79.00
Hours Run	22.4
Av. ROP	3.53
Condition	1-1-WT-A-X-IG-NO-TD

Performance Record :

Total Revolution On Bit : *168.00* krev

This Run (79m) : *22.40* hrs

Cumulative Bit Life (225.78m) : *65.81* hrs

Drilling & Mud Parameters :

WOB (klb)	10-15
RPM (rpm)	120-130
TOR (lbf.ft)	4-5
SPP (psi)	2500-2800
FLOW (gpm)	500-530
MW (pcf)	81
FV (sec)	42
PV / YP	13/14
Gel 0 / 10	3/5
Alk. / HPHT	9.5
FLT °C	--

Reason for POOH :

POOH due to TD

PUMP DATA

Pump 1: 6.299" Q = 4.616 gal/stk (95%)

Pump 2: 6.299" Q = 4.616 gal/stk (95%)

Pump 3: 6.299" Q = 4.616 gal/stk (95%)

Date : 12.05.2026

9 ⅝" SCG Shoe @ 3060m ; ID: 8.835" ; Weight : 47lb/ft

Phase Diameter : 8 ½"

BHA # 14	Length	Cum Lgth
8 ½" Tci Bit	0.24	0.24
6 ½" Bit sub	1.17	1.41
6 × 6 ½" DC	54.65	56.060
9 × 5" HWDP	84.08	140.140
TOTAL BHA		140.140

Bit Data

Bit #	2 Run#2
Size	8 ½"
Type	Tci Bit
Mfgr	K.Dream
Serial No.	2408590JH
Nozzles	3 × 20/32"
IADC Code	HJT517G
Depth In	3890
Depth Out	3890
Metrage	--
Hours Run	--
Av. ROP	--
Condition	1-2-WT-A-E-I-NO-BHA

Performance Record :

Total Revolution On Bit : -- krev

This Run (m) : -- hrs

Cumulative Bit Life (m) : -- hrs

Drilling & Mud Parameters :

WOB (klb)	--
RPM (rpm)	--
TOR (lbf.ft)	--
SPP (psi)	--
FLOW (gpm)	--
MW (pcf)	82
FV (sec)	42
PV / YP	17/11
Gel 0 / 10	3/5
Alk. / HPHT	10.7
FLT °C	--

Reason for POOH :

POOH due to change BHA.

PUMP DATA

Pump 1: 6.299" Q = 4.616 gal/stk (95%)

Pump 2: 6.299" Q = 4.616 gal/stk (95%)

Pump 3: 6.299" Q = 4.616 gal/stk (95%)

Date : 13.05.2026

9 ⅝" CSG Shoe @ 3060m ; ID: 8.835" ; Weight : 47lb/ft

Phase Diameter : 8 ½"

BHA # 15	Length	Cum Lgth
6 ⅛" Tci Bit	0.19	0.19
4 ¾" Bit Sub	1.00	1.19
15 × 4 ¾" DC	135.62	136.805
6 × 3 ½" HWDP	54.99	191.795
102 × 3 ½" DP	984.02	1175.815
X.O.S	1.12	1176.935
TOTAL BHA		1176.935

Bit Data

Bit #	5
Size	6 ⅛"
Type	Tci Bit
Mfgr	K.Dream
Serial No.	2408585JH
Nozzles	3 × 16/32"
IADC Code	517
Depth In	3890
Depth Out	3890
Metrage	--
Hours Run	--
Av. ROP	--
Condition	1-1-WT-A-E-I-NO-BHA

Performance Record :

Total Revolution On Bit : -- krev

This Run (m) : -- hrs

Cumulative Bit Life (m) : -- hrs

Drilling & Mud Parameters :

WOB (klb)	--
RPM (rpm)	--
TOR (lbf.ft)	--
SPP (psi)	--
FLOW (gpm)	--
MW (pcf)	82
FV (sec)	42
PV / YP	17/11
Gel 0 / 10	3/5
Alk. / HPHT	10.5
FLT °C	--

Reason for POOH :

POOH due to change BHA.

PUMP DATA

Pump 1: 6.299" Q = 4.616 gal/stk (95%)

Pump 2: 6.299" Q = 4.616 gal/stk (95%)

Pump 3: 6.299" Q = 4.616 gal/stk (95%)

Date : 14.05.2026

9 ⅝" CSG Shoe @ 3060m ; ID: 8.835" ; Weight : 47lb/ft

Phase Diameter : 8 ½"

BHA # 16	Length	Cum Lgth
8 ½" Tci Bit	0.24	0.24
9 ⅝" Scraper	1.39	1.63
6 ½" Bit sub	1.17	2.800
9 × 5" HWDP	84.08	86.880
TOTAL BHA		86.880

Bit Data

Bit #	2 Run#3
Size	8 ½"
Type	Tci Bit
Mfgr	K.Dream
Serial No.	2408590JH
Nozzles	3 × 20/32"
IADC Code	HJT517G
Depth In	3890
Depth Out	3890
Metrage	--
Hours Run	--
Av. ROP	--
Condition	1-2-WT-A-E-I-NO-BHA

Performance Record :

Total Revolution On Bit : -- krev

This Run (m) : -- hrs

Cumulative Bit Life (m) : -- hrs

Drilling & Mud Parameters :

WOB (klb)	--
RPM (rpm)	--
TOR (lbf.ft)	--
SPP (psi)	--
FLOW (gpm)	--
MW (pcf)	82
FV (sec)	40
PV / YP	14/9
Gel 0 / 10	2/4
Alk. / HPHT	10.6
FLT °C	--

Reason for POOH :

POOH due to change BHA.

PUMP DATA

Pump 1: 6.299" Q = 4.616 gal/stk (95%)

Pump 2: 6.299" Q = 4.616 gal/stk (95%)

Pump 3: 6.299" Q = 4.616 gal/stk (95%)

Date : 15.05.2026

9 ⅝" CSG Shoe @ 3060m ; ID: 8.835" ; Weight : 47lb/ft

Phase Diameter : 8 ½"

BHA # 17	Length	Cum Lgth
Bottom B.T	1.26	1.26
Anchor Pipe	1.53	2.79
X-Over 3 ½"	0.40	3.190
Middle Packer	1.33	4.520
Above Packer 9 ⅝	0.76	5.280
X-Over 3 ½"	0.40	5.680
X-Over 3 ½"	0.40	6.080
RH Release Safty Joint	0.73	6.810
Hydraulic JAR	1.00	7.810
Middle B.T	1.25	9.060
Hydrospring	1.56	10.620
D.C.I.P	1.64	12.260
X-Over 4 ½"	0.25	12.510
1 × 5" DP	9.45	21.960
Revers Sub	0.60	22.560
9 × 6 ½" DC	81.89	104.450
TOTAL BHA		104.450

Bit Data

Bit #	Dry Test
Size	9 ⅝"
Type	--
Mfgr	--
Serial No.	--
Nozzles	--
IADC Code	--
Depth In	3890
Depth Out	3890
Metrage	--
Hours Run	--
Av. ROP	--
Condition	--

Performance Record :

Total Revolution On Bit : -- krev

This Run (m) : -- hrs

Cumulative Bit Life (m) : -- hrs

Drilling & Mud Parameters :

WOB (klb)	--
RPM (rpm)	--
TOR (lbf.ft)	--
SPP (psi)	--
FLOW (gpm)	--
MW (pcf)	82
FV (sec)	40
PV / YP	14/9
Gel 0 / 10	2/4
Alk. / HPHT	10.8
FLT °C	--

Reason for POOH :

POOH due to change BHA.

PUMP DATA

Pump 1: 6.299" Q = 4.616 gal/stk (95%)

Pump 2: 6.299" Q = 4.616 gal/stk (95%)

Pump 3: 6.299" Q = 4.616 gal/stk (95%)

Date : 17.05.2026

7" Liner Shoe @ 3890m ; ID: 6.184" ; Weight : 29lb/ft

Phase Diameter : 8 ½"

BHA # 18	Length	Cum Lgth
6 ⅛" Tci Bit	0.19	0.19
4 ¾" Bit Sub	1.00	1.19
18 × 4 ¾" DC	190.82	192.010
6 × 3 ½" HWDP	54.99	247.000
102 × 3 ½" DP	897.095	1144.095
X.O.S	1.12	1145.215
TOTAL BHA		1145.215

Bit Data

Bit #	5 Run#2
Size	6 ⅛"
Type	Tci Bit
Mfgr	K.Dream
Serial No.	2408585JH
Nozzles	3 × 16/32"
IADC Code	517
Depth In	3890
Depth Out	3893
Metrage	3
Hours Run	2.16
Av. ROP	2.2
Condition	1-1-WT-A-E-I-NO-BHA

Performance Record :

Total Revolution On Bit : *9.70* krev

This Run (3m) : *2.16* hrs

Cumulative Bit Life (3m) : *2.16* hrs

Drilling & Mud Parameters :

WOB (klb)	10-15
RPM (rpm)	70
TOR (lbf.ft)	2-3
SPP (psi)	2050-2100
FLOW (gpm)	250-283
MW (pcf)	82
FV (sec)	40
PV / YP	14/9
Gel 0 / 10	2/4
Alk. / HPHT	10.6
FLT °C	--

Reason for POOH :

POOH due to change BHA.

PUMP DATA

Pump 1: 6.299" Q = 4.616 gal/stk (95%)

Pump 2: 6.299" Q = 4.616 gal/stk (95%)

Pump 3: 6.299" Q = 4.616 gal/stk (95%)

Date : 22.05.2026

7" Liner Shoe @ 3890m ; ID: 6.184" ; Weight : 29lb/ft

Phase Diameter : 8 ½"

BHA # 19	Length	Cum Lgth
6 ⅛" Tci Bit	0.19	0.19
7" Scraper	0.99	1.18
4 ¾" Bit Sub	1.00	2.180
9 × 4 ¾" DC	81.93	84.110
105 × 3 ½" DP	1013.215	1097.325
X.O.S	1.12	1098.445
TOTAL BHA		1098.445

Bit Data

Bit #	5 Run#3
Size	6 ⅛"
Type	Tci Bit
Mfgr	K.Dream
Serial No.	2408585JH
Nozzles	3 × 16/32"
IADC Code	517
Depth In	3893
Depth Out	3893
Metrage	--
Hours Run	--
Av. ROP	--
Condition	1-1-BT-A-E-1/16"-WT-LOG

Performance Record :

Total Revolution On Bit : *9.70* krev

This Run (3m) : *2.16* hrs

Cumulative Bit Life (3m) : *2.16* hrs

Drilling & Mud Parameters :

WOB (klb)	--
RPM (rpm)	--
TOR (lbf.ft)	--
SPP (psi)	--
FLOW (gpm)	--
MW (pcf)	82
FV (sec)	40
PV / YP	14/9
Gel 0 / 10	2/4
Alk. / HPHT	10.9
FLT °C	--

Reason for POOH :

POOH due to LOG

PUMP DATA

Pump 1: 6.299" Q = 4.616 gal/stk (95%)

Pump 2: 6.299" Q = 4.616 gal/stk (95%)

Pump 3: 6.299" Q = 4.616 gal/stk (95%)

Date : 23.05.2026

7" Liner Shoe @ 3890m ; ID: 6.184" ; Weight : 29lb/ft

Phase Diameter : 8 ½"

BHA # 20	Length	Cum Lgth
6 ⅛" PDC Bit	0.19	0.19
4 ¾" Bit Sub	1.00	1.19
2 × 4 ¾" DC	18.35	19.540
5 ⅞" S.Stab	1.39	20.930
21 × 4 ¾" DC	190.620	211.550
6 × 3 ½" HWDP	54.99	266.540
114 × 3 ½" DP	1099.61	1366.150
X.O.S	1.12	1367.270
TOTAL BHA		1367.270

Bit Data

Bit #	6
Size	6 ⅛"
Type	PDC Bit
Mfgr	Beste
Serial No.	255421
Nozzles	3 × 16/32"
IADC Code	M1665
Depth In	3893
Depth Out	4150
Metrage	257.00
Hours Run	71.3
Av. ROP	3.60
Condition	2-1-WT-G-X-I-NO-TD

Performance Record :

Total Revolution On Bit : *470.58* krev

This Run (257m) : *71.3* hrs

Cumulative Bit Life (257m) : *71.3* hrs

Drilling & Mud Parameters :

WOB (klb)	4-17
RPM (rpm)	60-160
TOR (lbf.ft)	2-7
SPP (psi)	2300-2670
FLOW (gpm)	200-460
MW (pcf)	82-105
FV (sec)	40-52
PV / YP	14-29/9-12
Gel 0 / 10	2-3/4-5
Alk. / HPHT	9.5-10.9
FLT °C	--

Reason for POOH :

POOH due to TD

PUMP DATA

Pump 1: 6.299" Q = 4.616 gal/stk (95%)

Pump 2: 6.299" Q = 4.616 gal/stk (95%)

Pump 3: 6.299" Q = 4.616 gal/stk (95%)

Date : 30.05.2026

7" Liner Shoe @ 3890m ; ID: 6.184" ; Weight : 29lb/ft

Phase Diameter : 8 ½"

BHA # 21	Length	Cum Lgth
6 ⅛" PDC Bit	0.19	0.19
4 ¾" Bit Sub	1.00	1.19
2 × 4 ¾" DC	18.35	19.540
5 ⅞" S.Stab	1.39	20.930
21 × 4 ¾" DC	190.620	211.550
6 × 3 ½" HWDP	54.99	266.540
114 × 3 ½" DP	1099.61	1366.150
X.O.S	1.12	1367.270
TOTAL BHA		1367.270

Bit Data

Bit #	6 Run#2
Size	6 ⅛"
Type	PDC Bit
Mfgr	Beste
Serial No.	255421
Nozzles	3 × 16/32"
IADC Code	M1665
Depth In	4150
Depth Out	4150
Metrage	0.00
Hours Run	--
Av. ROP	--
Condition	2-1-WT-G-X-I-NO-TD

Performance Record :

Total Revolution On Bit : 470.58 krev

This Run (0m) : 0.0 hrs

Cumulative Bit Life (257m) : 71.3 hrs

Drilling & Mud Parameters :

WOB (klb)	--
RPM (rpm)	--
TOR (lbf.ft)	--
SPP (psi)	--
FLOW (gpm)	--
MW (pcf)	105
FV (sec)	52
PV / YP	9-12
Gel 0 / 10	3-5
Alk. / HPHT	9.5
FLT °C	--

Reason for POOH :

POOH due to TD

PUMP DATA

Pump 1: 6.299" Q = 4.616 gal/stk (95%)

Pump 2: 6.299" Q = 4.616 gal/stk (95%)

Pump 3: 6.299" Q = 4.616 gal/stk (95%)

Date : 01.06.2026

7" Liner Shoe @ 3890m ; ID: 6.184" ; Weight : 29lb/ft

Phase Diameter : 8 ½"

BHA # 22	Length	Cum Lgth
6 ⅛" PDC Bit	0.19	0.19
4 ¾" Bit Sub	1.00	1.19
2 × 4 ¾" DC	18.35	19.540
5 ⅞" S.Stab	1.39	20.930
21 × 4 ¾" DC	190.620	211.550
6 × 3 ½" HWDP	54.99	266.540
114 × 3 ½" DP	1099.61	1366.150
X.O.S	1.12	1367.270
TOTAL BHA		1367.270

Bit Data

Bit #	6 Run#2
Size	6 ⅛"
Type	PDC Bit
Mfgr	Beste
Serial No.	255421
Nozzles	3 × 16/32"
IADC Code	M1665
Depth In	4150
Depth Out	4150
Metrage	0.00
Hours Run	--
Av. ROP	--
Condition	2-1-WT-G-X-I-NO-TD

Performance Record :

Total Revolution On Bit : 470.58 krev

This Run (0m) : 0.0 hrs

Cumulative Bit Life (257m) : 71.3 hrs

Drilling & Mud Parameters :

WOB (klb)	--
RPM (rpm)	--
TOR (lbf.ft)	--
SPP (psi)	--
FLOW (gpm)	--
MW (pcf)	105
FV (sec)	52
PV / YP	9-12
Gel 0 / 10	3-5
Alk. / HPHT	9.5
FLT °C	--

Reason for POOH :

POOH due to TD

PUMP DATA

Pump 1: 6.299" Q = 4.616 gal/stk (95%)

Pump 2: 6.299" Q = 4.616 gal/stk (95%)

Pump 3: 6.299" Q = 4.616 gal/stk (95%)

Date : 05.06.2026

5" Liner Shoe @ 4150m ; ID: 4.276" ; Weight : 18lb/ft

Phase Diameter : 6 ⅛"

BHA # 23	Length	Cum Lgth
6 ⅛" TCI Bit	0.19	0.19
4 ¾" Bit Sub	1.00	1.19
9 × 4 ¾" DC	81.93	83.120
6 × 3 ½" HWDP	54.99	138.110
90 × 3 ½" DP	967.915	1106.025
X.O.S	1.12	1107.145
TOTAL BHA		1107.145

Bit Data

Bit #	5 Run#4
Size	6 ⅛"
Type	Tci Bit
Mfgr	K.Dream
Serial No.	2408585JH
Nozzles	3 × 16/32"
IADC Code	517
Depth In	4150
Depth Out	4150
Metrage	0.00
Hours Run	--
Av. ROP	--
Condition	1-1-WT-A-E-I-NO-BHA

Performance Record :

Total Revolution On Bit : -- krev

This Run (m) : -- hrs

Cumulative Bit Life (m) : -- hrs

Drilling & Mud Parameters :

WOB (klb)	--
RPM (rpm)	--
TOR (lbf.ft)	--
SPP (psi)	--
FLOW (gpm)	--
MW (pcf)	105
FV (sec)	52
PV / YP	29-12
Gel 0 / 10	3-5
Alk. / HPHT	9.5
FLT °C	--

Reason for POOH :

POOH due to change BHA

PUMP DATA

Pump 1: 6.299" Q = 4.616 gal/stk (95%)

Pump 2: 6.299" Q = 4.616 gal/stk (95%)

Pump 3: 6.299" Q = 4.616 gal/stk (95%)

Date : 07.06.2026

5" Liner Shoe @ 4150m ; ID: 4.276" ; Weight : 18lb/ft

Phase Diameter : 6 ⅛"

BHA # 24	Length	Cum Lgth
3 ¾" Junk Mill	0.865	0.87
3 ⅛" Bit Sub	0.73	1.60
18 × 3 ⅛" DC	166.74	168.335
30 × 2 ⅜" DP	283.44	451.775
X.O.S	1.170	452.945
96 × 3 ½" DP	925.92	1378.865
X.O.S	1.12	1379.985
TOTAL BHA		1379.985

Bit Data

Bit #	--
Size	3 ¾"
Type	Junk Mill
Mfgr	TSEK
Serial No.	101
Nozzles	5 × 10/32"
IADC Code	--
Depth In	4150
Depth Out	4150
Metrage	--
Hours Run	--
Av. ROP	--
Condition	--

Performance Record :

Total Revolution On Bit : -- krev

This Run (m) : -- hrs

Cumulative Bit Life (m) : -- hrs

Drilling & Mud Parameters :

WOB (klb)	--
RPM (rpm)	--
TOR (lbf.ft)	--
SPP (psi)	--
FLOW (gpm)	--
MW (pcf)	105
FV (sec)	52
PV / YP	29-12
Gel 0 / 10	3-5
Alk. / HPHT	9.5-10.3
FLT °C	--

Reason for POOH :

POOH due to change BHA

PUMP DATA

Pump 1: 6.299" Q = 4.616 gal/stk (95%)

Pump 2: 6.299" Q = 4.616 gal/stk (95%)

Pump 3: 6.299" Q = 4.616 gal/stk (95%)

Date : 11.06.2026

5" Liner Shoe @ 4150m ; ID: 4.276" ; Weight : 18lb/ft

Phase Diameter : 6 ⅛"

BHA # 25	Length	Cum Lgth
7 5/16" Polish Mill	0.495	0.50
15 × 5" HWDP	139.60	140.09
TOTAL BHA		140.090

Performance Record :

Total Revolution On Bit : -- krev

This Run (m) : -- hrs

Cumulative Bit Life (m) : -- hrs

Bit Data

Bit #	--
Size	7 5/16"
Type	Polish Mill
Mfgr	--
Serial No.	--
Nozzles	--
IADC Code	--
Depth In	4150
Depth Out	4150
Metrage	--
Hours Run	--
Av. ROP	--
Condition	--

Drilling & Mud Parameters :

WOB (klb)	--
RPM (rpm)	--
TOR (lbf.ft)	--
SPP (psi)	--
FLOW (gpm)	--
MW (pcf)	105
FV (sec)	52
PV / YP	29-12
Gel 0 / 10	3-5
Alk. / HPHT	9.5-10.3
FLT °C	--

Reason for POOH :

POOH due to Run 7" Tie Back#1 Liner.

PUMP DATA

Pump 1: 6.299" Q = 4.616 gal/stk (95%)

Pump 2: 6.299" Q = 4.616 gal/stk (95%)

Pump 3: 6.299" Q = 4.616 gal/stk (95%)

Date : 15.06.2026

5" Liner Shoe @ 4150m ; ID: 4.276" ; Weight : 18lb/ft

Phase Diameter : 6 ⅛"

BHA # 26	Length	Cum Lgth
8 ½" Tci Bit	0.24	0.24
6 ½" Bit sub	1.17	1.41
15 × 5" HWDP	139.595	141.005
TOTAL BHA		141.005

Performance Record :

Total Revolution On Bit : -- krev

This Run (m) : -- hrs

Cumulative Bit Life (m) : -- hrs

Bit Data

Bit #	2 Run#4
Size	8 ½"
Type	Tci Bit
Mfgr	K.Dream
Serial No.	2408590JH
Nozzles	3 × 20/32"
IADC Code	HJT517G
Depth In	4150
Depth Out	4150
Metrage	--
Hours Run	--
Av. ROP	--
Condition	1-1-WT-A-E-I-NO-BHA

Drilling & Mud Parameters :

WOB (klb)	--
RPM (rpm)	--
TOR (lbf.ft)	--
SPP (psi)	--
FLOW (gpm)	--
MW (pcf)	105
FV (sec)	52
PV / YP	29-8
Gel 0 / 10	2-3
Alk. / HPHT	10
FLT °C	--

Reason for POOH :

POOH due to change BHA

PUMP DATA

Pump 1: 6.299" Q = 4.616 gal/stk (95%)

Pump 2: 6.299" Q = 4.616 gal/stk (95%)

Pump 3: 6.299" Q = 4.616 gal/stk (95%)

Date : 16.06.2026

5" Liner Shoe @ 4150m ; ID: 4.276" ; Weight : 18lb/ft

Phase Diameter : 6 ⅛"

BHA # 27	Length	Cum Lgth
5 ⅞" Tci Bit	0.18	0.18
4 ¾" Bit Sub	1.00	1.18
21 × 4 ¾" DC	191.115	192.295
6 × 3 ½" HWDP	54.99	247.285
243 × 3 ½" DP	2342.075	2589.360
X.O.S	1.12	2590.480
TOTAL BHA		2590.480

Bit Data

Bit #	7
Size	5 ⅞"
Type	Tci Bit
Mfgr	K.Dream
Serial No.	2401822JH
Nozzles	3 × 18/32"
IADC Code	HJT537GK
Depth In	4150
Depth Out	4150
Metrage	--
Hours Run	--
Av. ROP	--
Condition	1-2-BT-N-E-I-NO-BHA

Performance Record :

Total Revolution On Bit : -- krev

This Run (m) : -- hrs

Cumulative Bit Life (m) : -- hrs

Drilling & Mud Parameters :

WOB (klb)	--
RPM (rpm)	--
TOR (lbf.ft)	--
SPP (psi)	--
FLOW (gpm)	--
MW (pcf)	105
FV (sec)	52
PV / YP	29-8
Gel 0 / 10	2-3
Alk. / HPHT	10
FLT °C	--

Reason for POOH :

POOH due to change BHA

PUMP DATA

Pump 1: 6.299" Q = 4.616 gal/stk (95%)

Pump 2: 6.299" Q = 4.616 gal/stk (95%)

Pump 3: 6.299" Q = 4.616 gal/stk (95%)

Date : 18.06.2026

5" Liner Shoe @ 4150m ; ID: 4.276" ; Weight : 18lb/ft

Phase Diameter : 6 ⅛"

BHA # 28	Length	Cum Lgth
4 ⅛" Junk Mill	0.865	0.87
3 ⅛" Bit Sub	0.73	1.595
19 × 3 ⅛" DC	176.060	177.655
30 × 2 ⅝" DP	283.44	461.095
X.O.S	1.170	462.265
258 × 3 ½" DP	2486.97	2949.230
X.O.S	1.12	2950.350
TOTAL BHA		2950.350

Bit Data

Bit #	--
Size	4 ⅛"
Type	Junk Mill
Mfgr	TSEK
Serial No.	944
Nozzles	5 × 16/32"
IADC Code	--
Depth In	4150
Depth Out	4150
Metrage	--
Hours Run	--
Av. ROP	--
Condition	--

Performance Record :

Total Revolution On Bit : -- krev

This Run (m) : -- hrs

Cumulative Bit Life (m) : -- hrs

Drilling & Mud Parameters :

WOB (klb)	--
RPM (rpm)	--
TOR (lbf.ft)	--
SPP (psi)	--
FLOW (gpm)	--
MW (pcf)	105
FV (sec)	52
PV / YP	29-8
Gel 0 / 10	2-3
Alk. / HPHT	10
FLT °C	--

Reason for POOH :

POOH due to change BHA

PUMP DATA

Pump 1: 6.299" Q = 4.616 gal/stk (95%)

Pump 2: 6.299" Q = 4.616 gal/stk (95%)

Pump 3: 6.299" Q = 4.616 gal/stk (95%)

Date : 21.06.2026

5" Liner Shoe @ 4150m ; ID: 4.276" ; Weight : 18lb/ft

Phase Diameter : 6 ⅛"

BHA # 29	Length	Cum Lgth
7 5/16" Polish mill	0.495	0.50
15 × 5" HWDP	139.60	140.090
TOTAL BHA		140.090

Performance Record :

Total Revolution On Bit : -- krev

This Run (m) : -- hrs

Cumulative Bit Life (m) : -- hrs

Bit Data

Bit #	--
Size	7 5/16"
Type	Polish mill
Mfgr	--
Serial No.	--
Nozzles	--
IADC Code	--
Depth In	4150
Depth Out	4150
Metrage	--
Hours Run	--
Av. ROP	--
Condition	--

Drilling & Mud Parameters :

WOB (klb)	--
RPM (rpm)	--
TOR (lbf.ft)	--
SPP (psi)	--
FLOW (gpm)	--
MW (pcf)	105
FV (sec)	52
PV / YP	29-8
Gel 0 / 10	2-3
Alk. / HPHT	10
FLT °C	--

Reason for POOH :

POOH due to change BHA

PUMP DATA

Pump 1: 6.299" Q = 4.616 gal/stk (95%)

Pump 2: 6.299" Q = 4.616 gal/stk (95%)

Pump 3: 6.299" Q = 4.616 gal/stk (95%)

Date : 23.06.2026

5" Liner Shoe @ 4150m ; ID: 4.276" ; Weight : 18lb/ft

Phase Diameter : 6 ⅛"

BHA # 30	Length	Cum Lgth
8 ½" Tci Bit	0.24	0.24
6 ½" Bit sub	1.17	1.410
6 × 5" HWDP	55.850	57.260
TOTAL BHA		57.260

Performance Record :

Total Revolution On Bit : -- krev

This Run (m) : -- hrs

Cumulative Bit Life (m) : -- hrs

Bit Data

Bit #	2 Run#5
Size	8 ½"
Type	Tci Bit
Mfgr	K.Dream
Serial No.	2408590JH
Nozzles	3 × 20/32"
IADC Code	HJT517G
Depth In	4150
Depth Out	4150
Metrage	--
Hours Run	--
Av. ROP	--
Condition	--

Drilling & Mud Parameters :

WOB (klb)	--
RPM (rpm)	--
TOR (lbf.ft)	--
SPP (psi)	--
FLOW (gpm)	--
MW (pcf)	105
FV (sec)	52
PV / YP	29-8
Gel 0 / 10	2-3
Alk. / HPHT	10
FLT °C	--

Reason for POOH :

POOH due to change BHA

PUMP DATA

Pump 1: 6.299" Q = 4.616 gal/stk (95%)

Pump 2: 6.299" Q = 4.616 gal/stk (95%)

Pump 3: 6.299" Q = 4.616 gal/stk (95%)

Date : 23.06.2026

5" Liner Shoe @ 4150m ; ID: 4.276" ; Weight : 18lb/ft

Phase Diameter : 6 ⅛"

BHA # 31	Length	Cum Lgth
6 ⅛" TCI Bit	0.19	0.19
4 ¾" Bit Sub	1.00	1.190
21 × 4 ¾" DC	191.120	192.310
6 × 3 ½" HWDP	54.99	247.300
99 × 3 ½" DP	953.230	1200.530
X.O.S	1.12	1201.650
TOTAL BHA		1201.650

Bit Data

Bit #	5 Run#5
Size	6 ⅛"
Type	Tci Bit
Mfgr	K.Dream
Serial No.	2408585JH
Nozzles	3 × 16/32"
IADC Code	517
Depth In	4150
Depth Out	4150
Metrage	0.00
Hours Run	--
Av. ROP	--
Condition	1-2-BT-A-E-1/16"-WT-BHA

Performance Record :

Total Revolution On Bit : -- krev

This Run (m) : -- hrs

Cumulative Bit Life (m) : -- hrs

Drilling & Mud Parameters :

WOB (klb)	--
RPM (rpm)	--
TOR (lbf.ft)	--
SPP (psi)	--
FLOW (gpm)	--
MW (pcf)	105
FV (sec)	52
PV / YP	29-8
Gel 0 / 10	2-3
Alk. / HPHT	10
FLT °C	--

Reason for POOH :

POOH due to change BHA

PUMP DATA

Pump 1: 6.299" Q = 4.616 gal/stk (95%)

Pump 2: 6.299" Q = 4.616 gal/stk (95%)

Pump 3: 6.299" Q = 4.616 gal/stk (95%)

Date : 25.06.2026

5" Liner Shoe @ 4150m ; ID: 4.276" ; Weight : 18lb/ft

Phase Diameter : 6 ⅛"

BHA # 32	Length	Cum Lgth
4 ⅛" M.M.Mill	0.87	0.87
3 ⅛" Bit Sub	0.73	1.600
19 × 3 ⅛" DC	176.060	177.660
24 × 2 ⅝" DP	227.28	404.940
X.O.S	1.170	406.110
378 × 3 ½" DP	3642.43	4048.540
X.O.S	1.12	4049.660
TOTAL BHA		4049.660

Bit Data

Bit #	5 Run#5
Size	6 ⅛"
Type	Tci Bit
Mfgr	K.Dream
Serial No.	2408585JH
Nozzles	3 × 16/32"
IADC Code	517
Depth In	4150
Depth Out	4150
Metrage	0.00
Hours Run	--
Av. ROP	--
Condition	5% used

Performance Record :

Total Revolution On Bit : -- krev

This Run (m) : -- hrs

Cumulative Bit Life (m) : -- hrs

Drilling & Mud Parameters :

WOB (klb)	--
RPM (rpm)	--
TOR (lbf.ft)	--
SPP (psi)	--
FLOW (gpm)	--
MW (pcf)	105
FV (sec)	52
PV / YP	29-8
Gel 0 / 10	2-3
Alk. / HPHT	10
FLT °C	--

Reason for POOH :

POOH due to change BHA

PUMP DATA

Pump 1: 6.299" Q = 4.616 gal/stk (95%)

Pump 2: 6.299" Q = 4.616 gal/stk (95%)

Pump 3: 6.299" Q = 4.616 gal/stk (95%)

Date : 05.07.2026

5" Liner Shoe @ 4150m ; ID: 4.276" ; Weight : 18lb/ft

Phase Diameter : 6 ⅛"

BHA # 33	Length	Cum Lgth
3 ½" Junk Mill	0.865	0.865
3 ⅛" Bit Sub	0.73	1.595
18 × 3 ¼" DC	166.740	168.335
27 × 2 ⅝" DP	255.34	423.675
X.O.S	1.170	424.845
375 × 3 ½" DP	3613.24	4038.080
X.O.S	1.12	4039.200
TOTAL BHA		4039.200

Bit Data

Bit #	--
Size	3 ½"
Type	Junk Mill
Mfgr	--
Serial No.	--
Nozzles	5 × 10/32"
IADC Code	--
Depth In	4150
Depth Out	4150
Metrage	0.00
Hours Run	--
Av. ROP	--
Condition	--

Performance Record :

Total Revolution On Bit : -- krev

This Run (m) : -- hrs

Cumulative Bit Life (m) : -- hrs

Drilling & Mud Parameters :

WOB (klb)	--
RPM (rpm)	--
TOR (lbf.ft)	--
SPP (psi)	--
FLOW (gpm)	--
MW (pcf)	105
FV (sec)	56
PV / YP	31-12
Gel 0 / 10	2-4
Alk. / HPHT	9.5
FLT °C	--

Reason for POOH :

POOH due to change BHA

PUMP DATA

Pump 1: 6.299" Q = 4.616 gal/stk (95%)

Pump 2: 6.299" Q = 4.616 gal/stk (95%)

Pump 3: 6.299" Q = 4.616 gal/stk (95%)

Date : 10.07.2026

5" Liner Shoe @ 4150m ; ID: 4.276" ; Weight : 18lb/ft

Phase Diameter : 6 ⅛"

BHA # 34	Length	Cum Lgth
5 ⅞" Tci Bit	0.18	0.180
7" Scraper	0.99	1.170
4 ¾" Bit Sub	1.000	2.170
6 × 3 ½" HWDP	54.99	57.160
372 × 3 ½" DP	3584.290	3641.450
X.O.S	1.12	3642.570
TOTAL BHA		3642.570

Bit Data

Bit #	7 Run#2
Size	5 ⅞"
Type	Tci Bit
Mfgr	K.Dream
Serial No.	2401822JH
Nozzles	3 × 18/32"
IADC Code	HJT537GK
Depth In	4150
Depth Out	4150
Metrage	0.00
Hours Run	--
Av. ROP	--
Condition	1-2-BT-N-E-I-NO-BHA

Performance Record :

Total Revolution On Bit : -- krev

This Run (m) : -- hrs

Cumulative Bit Life (m) : -- hrs

Drilling & Mud Parameters :

WOB (klb)	--
RPM (rpm)	--
TOR (lbf.ft)	--
SPP (psi)	--
FLOW (gpm)	--
MW (pcf)	105
FV (sec)	56
PV / YP	31-12
Gel 0 / 10	2-4
Alk. / HPHT	9.5
FLT °C	--

Reason for POOH :

POOH due to change BHA

PUMP DATA

Pump 1: 6.299" Q = 4.616 gal/stk (95%)

Pump 2: 6.299" Q = 4.616 gal/stk (95%)

Pump 3: 6.299" Q = 4.616 gal/stk (95%)

6. Casing Information

Casing Spec.		
Size (in)	**Shoe Depth (mMD)**	**Specification**
20	146	K – 55, 94^{ppf}, BTC
13 – 3/8	1441	N – 80, 68^{ppf}, BTC
9 – 5/8	3909	(0-2732.64m), T – 95, 53.5^{PPF}, TSH BLUE (2732.64-3909m), T – 95, 53.5^{PPF}, TPCQ
7”	2883.5-3890	L-80, 29^{PPF}, TPCQ
7” (Tie-Back #1)	2883.5-2826.8	L-80, 29^{PPF}, TPCQ
	2826.8-2793	P-110, 32^{PPF}, TPCQ
	2793-1284	L-80, 29^{PPF}, TPCQ
7” (Tie-Back #2)	1284-128.4	L-80, 29^{PPF}, TPCQ
5”	3763.5- 4150	L-80, 18^{PPF}, HSG3_FJ

Table 6-1: AZNS-127 Final Casing Data

7. Cement Job Report

7.1 CMT Plug #1 Operation Information

Operation Type: CMT Plug job

Hole Size: -

Liner Depth: 3780^{m}

Total Volume:

- Pump 4.69^{bbl} spacer 75^{pcf}
- Pump 12.2^{bbl} cement slurry 118^{pcf}
- Pump 0.97^{bbl} spacer 75^{pcf}

Total Displacement Volume: Displace with 186.8^{bbl} mud

7.2 Engineering Data

Slurry Data			
Name	Volume (bbl)	Density (pcf)	Remark
Cement Slurry	12.2	118	-

Table 7-1: AZNS-127 Engineering Data

7.3 Execution of Operation

Item	Description	Qty
1	Cementing pump truck & related connections (PD – 03)	1 ea.
2	Cementing pump truck & related connections (PD – 05)	1 ea.
3	Batch mixer	1 ea.
4	Air compressor (PD – C – 02)	1 ea.
5	Silo (PD – S – 07)	1 ea.

Table 7-2: AZNS-127 Equipment Used

Item	Description	Qty
1	Cementing Supervisor	1 per.
2	Cementing Operator	2 per.
3	Batch Mixer Operator	1 per.
4	Cementing Helper	5 per.
5	Batch Mixer Helper	1 per.

Table 7-3: AZNS-127 Operation Crew

7.4 Operation Instructions

Pre – Job Preparation

- Bulk plant R/U & preparations (prepare the checklist).
- Cementing pump truck R/U & preparations (prepare the checklist).
- Preparting mixing fluid (solution) with cooperation of the rig crew).
- Cementing high pressure line R/U to the rig floor (secure them with safety cable).
- Setting up HSE measurments for the operation.

Pre – Job Preparation

- M/U liner cementing head on string (dart plug already loaded), L/U CMT line to CMT head manifold.
- Pressure test CMT lines to 3000psi, Ok.
- Pump 4.69^{bbl} spacer 75^{pcf} by CMT pump truck.
- Mixed & pumped 12.2^{bbl} cement slurry 118^{pcf} as slurry w/ 4bpm / 700psi.
- Pump 0.97^{bbl} spacer 75^{pcf}
- Displaced w/ totally 186.8^{bbl} mud, bleed of pressure.
- P/U & checked the string weight, Ok. B/O & L/D CMT manifold.
- POOH 10 Stds, flush string & CBU.

7.5 Pumping Schedule

Name	Flow Rate (bb/min)	Volume (bbl)	Comments
Spacer	5	4.69	-
Slurry	4	12.2	-
Spacer	4	0.97	-
Displacement	6	186.8	-

Table 7-4: AZNS-127 Pumping Schedule

7.6 Amount of Material & Used in Operation

Slurry Type				
Wt: 118^{pcf}	S.V: 12.2^{bbl}	Mixed W. V: 7.2^{bbl}	Mixed F. V: 7^{bbl}	S.Y: 1.3571 ft^2/sk
Row	**Material Name**	**Consumbles**	**Unit**	**Description**
1	Cement G class	50.68	sks	-
2	Retarder SE-R-02	40.5	lb	-
3	Dispersant SE-D-01	15.2	lb	-
4	Dispersant SE-D-31	0.5	gal	-
8	Anti foam SE-A20	1.5	gal	-

Table 7-5: AZNS-127 Material Used Table

7.7 CMT Plug #2 Operation Information

Operation Type: CMT Plug job

Hole Size: -

Liner Depth: 3177^{m}

Total Volume:

- Pump 7.73^{bbl} spacer 75^{pcf}
- Pump 19.9^{bbl} cement slurry 118^{pcf}
- Pump 0.97^{bbl} spacer 75^{pcf}

Total Displacement Volume: Displace with 152.7^{bbl} mud

7.8 Engineering Data

Slurry Data			
Name	Volume (bbl)	Density (pcf)	Remark
Cement Slurry	19.9	118	-

Table 7-6: AZNS-127 Engineering Data

7.9 Execution of Operation

Item	Description	Qty
1	Cementing pump truck & related connections (PD – 03)	1 ea.
2	Cementing pump truck & related connections (PD – 05)	1 ea.
3	Batch mixer	1 ea.
4	Air compressor (PD – C – 02)	1 ea.
5	Silo (PD – S – 07)	1 ea.

Table 7-7: AZNS-127 Equipment Used

Item	Description	Qty
1	Cementing Supervisor	1 per.
2	Cementing Operator	2 per.
3	Batch Mixer Operator	1 per.
4	Cementing Helper	5 per.
5	Batch Mixer Helper	1 per.

Table 7-8: AZNS-127 Operation Crew

7.10 Operation Instructions

Pre – Job Preparation

- Bulk plant R/U & preparations (prepare the checklist).
- Cementing pump truck R/U & preparations (prepare the checklist).
- Preparting mixing fluid (solution) with cooperation of the rig crew).
- Cementing high pressure line R/U to the rig floor (secure them with safety cable).
- Setting up HSE measurments for the operation.

Pre – Job Preparation

- M/U liner cementing head on string (dart plug already loaded), L/U CMT line to CMT head manifold.
- Pressure test CMT lines to 3000psi, Ok.
- Pump 7.73^{bbl} spacer 75^{pcf} by CMT pump truck.
- Mixed & pumped 19.9^{bbl} cement slurry 118^{pcf} as slurry w/ 4bpm / 700psi.
- Pump 0.97^{bbl} spacer 75^{pcf}
- Displaced w/ totally 152.7^{bbl} mud, bleed of pressure.
- P/U & checked the string weight, Ok. B/O & L/D CMT manifold.
- POOH 10 Stds, flush string & CBU.

7.11 Pumping Schedule

Name	Flow Rate (bb/min)	Volume (bbl)	Comments
Spacer	5	7.73	-
Slurry	4	19.9	-
Spacer	4	0.97	-
Displacement	6	152.7	-

Table 7-9: AZNS-127 Pumping Schedule

7.12 Amount of Material & Used in Operation

Slurry Type				
Wt: 118^{pcf}	S.V: 19.9^{bbl}	Mixed W. V: 11.5^{bbl}	Mixed F. V: 11.7^{bbl}	S.Y: 1.3559 ft^2/sk
Row	**Material Name**	**Consumbles**	**Unit**	**Description**
1	Cement G class	82.44	sks	-
2	Retarder SE-R-02	49.5	lb	-
3	Dispersant SE-D-01	24.7	lb	-
4	Dispersant SE-D-31	0.4	gal	-
8	Anti foam SE-A20	2.5	gal	-

Table 7-10: AZNS-127 Material Used Table

7.13 CMT Plug #3 Operation Information

Operation Type: CMT Plug job

Hole Size: -

Liner Depth: 3100^{m}

Total Volume:

- Pump 10^{bbl} spacer 62.4^{pcf}
- Pump 20^{bbl} cement slurry 118^{pcf}
- Pump 3.82^{bbl} spacer 62.4^{pcf}

Total Displacement Volume: Displace with 171.30^{bbl} mud

7.14 Engineering Data

Slurry Data			
Name	Volume (bbl)	Density (pcf)	Remark
Cement Slurry	20	118	-

Table 7-11: AZNS-127 Engineering Data

7.15 Execution of Operation

Item	Description	Qty
1	Cementing pump truck & related connections	1 ea.
2	Cementing pump truck & related connections	1 ea.
3	Batch mixer	1 ea.
4	Air compressor	1 ea.
5	Silo	1 ea.

Table 7-12: AZNS-127 Equipment Used

Item	Description	Qty
1	Cementing Supervisor	1 per.
2	Cementing Operator	2 per.
3	Batch Mixer Operator	1 per.
4	Cementing Helper	5 per.
5	Batch Mixer Helper	1 per.

Table 7-13: AZNS-127 Operation Crew

7.16 Operation Instructions

Pre – Job Preparation

- Bulk plant R/U & preparations (prepare the checklist).
- Cementing pump truck R/U & preparations (prepare the checklist).
- Preparting mixing fluid (solution) with cooperation of the rig crew).
- Cementing high pressure line R/U to the rig floor (secure them with safety cable).
- Setting up HSE measurments for the operation.

Pre – Job Preparation

- Determine the proper Tanks, Clean up and prepare chemicals for cement slurry.
- Check and test the salinity of mixing water and its properties prior to prepare CMT solution to avoid any un-wanted flash set.
- Fill tanks with mixing water for preparing mixing fluid.
- With Co. man approval, start mixing cement additives and preparing mixing fluid according to the mixing procedure below:
- Add lb CFR-DA 3 to bbl Fresh Water and allow to be mixed for 5 minutes.
- Add lb CR-DA 4 and allow to be mixed for 5 minutes.
- Add gal DF-DA 3 and keep mixing until cement operation will be finished.
- Circulate mud for at least one drill pipe capacity.
- Pre job safety meeting with involved personnel and arrange with mud engineer to measure drilling fluid & cement loss / gain during cement job.
- Test Surface cement line W/ 3000 psi.
- Pump bbl as spacer ahead by Cement Unit.
- Mix and pump bbl cement slurry @ PCF.
- Pump bbl as spacer behind to balance by Cement Unit.
- Start displacement with mud as balanced plug (calculate at rig site) by Cement Unit.
- POOH drill pipe for 150 m above top of cement plug. (Slowly Pull out of Cement Plug, 10-15 m/min)
- Flush string, POOH 5 stands of drill pipe, Close the well and wait until cement gets hard.
- RIH and confirm cement plug.

7.17 Pumping Schedule

Name	Flow Rate (bb/min)	Volume (bbl)	Comments
Spacer	5	19	-
Slurry	4	20	-
Spacer	4	3.82	-
Displacement	6	171.30	-

Table 7-14: AZNS-127 Pumping Schedule

7.18 Amount of Material & Used in Operation

Slurry Type				
Wt: 118^{pcf}	S.V: 20^{bbl}	Mixed W. V: 6.23^{bbl}	Mixed F. V: 6.32^{bbl}	S.Y: 1.38 ft^2/sk
Row	**Material Name**	**Consumbles**	**Unit**	**Description**
1	Cement G class	4.060	MT	-
2	CFR-DA 3	31.3	lb	-
3	CR-DA 4	37.6	lb	-
4	DF-DA 3	1.6	gal	-

Table 7-15: AZNS-127 Material Used Table

7.19 7” Liner Cementing Operation Information

Operation Type: 7” Liner cementing job

Hole Size: 8- 1/2”

Liner Depth: 3890^{m}

Total Volume:

- Pump 20^{bbl} chemical wash 62.4^{pcf}
- Pump 60^{bbl} spacer 88^{pcf}
- Pump 155.4^{bbl} cement slurry 118^{pcf}

Total Displacement Volume: Displace with 283^{bbl} mud

7.20 Engineering Data

Slurry Data			
Name	Volume (bbl)	Density (pcf)	Remark
Cement Slurry	155.4	118	-

Table 7-16: AZNS-127 Engineering Data

7.21 Execution of Operation

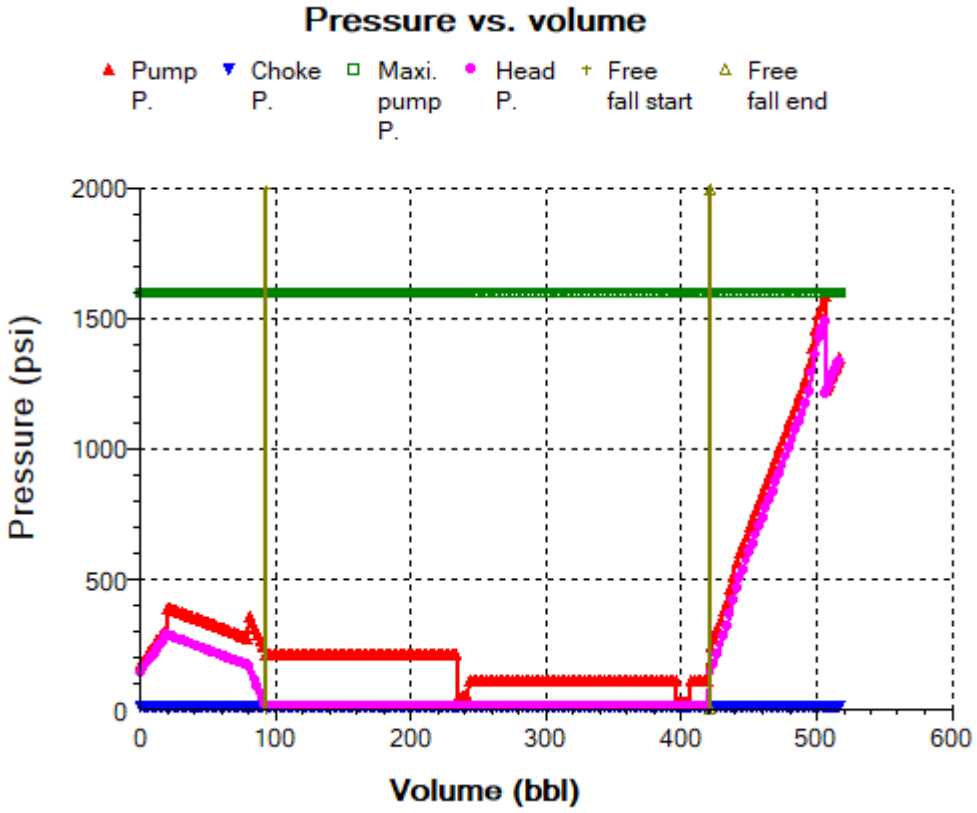
Item	Description	Qty
1	Cementing pump truck & related connections	1 ea.
2	Cementing pump truck & related connections	1 ea.
3	Batch mixer	1 ea.
4	Air compressor	1 ea.
5	Silo	1 ea.

Table 7-17: AZNS-127 Equipment Used

Item	Description	Qty
1	Cementing Supervisor	1 per.
2	Cementing Operator	2 per.
3	Batch Mixer Operator	1 per.
4	Cementing Helper	4 per.
5	Batch Mixer Helper	1 per.

Table 7-18: AZNS-127 Operation Crew

7.22 Job Graph



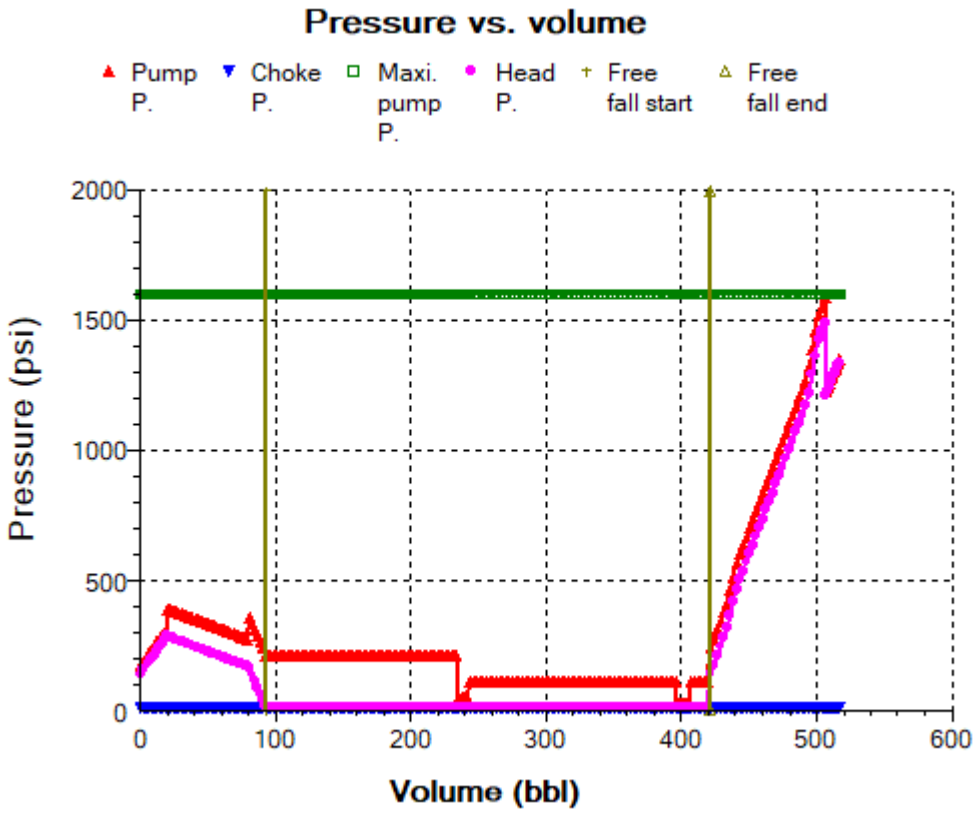


Figure 7-1: AZNS-127 7" Liner Job Graph

7.23 Operation Instructions

Pre – Job Preparation

- Bulk plant R/U & preparations (prepare the checklist).
- Cementing pump truck R/U & preparations (prepare the checklist).
- Preparting mixing fluid (solution) with cooperation of the rig crew).
- Cementing high pressure line R/U to the rig floor (secure them with safety cable).
- Setting up HSE measurments for the operation.

Job Preparation

- Determine the proper Tanks, clean up and prepare chemicals for spacer.
- Check and test the salinity of mixing water and its properties prior to prepare CMT solution to avoid any un-wanted flash set.
- Fill up Mud Pit and Batch Mixer with mixing water for preparing mixing fluid and test the salinity of mixing water.
- 6 hours before reaching liner shoe, start mixing cement additives with Company Man approval at the Batch Mixer .

Note: Efficiency time of solution is up to 36 hours

- Load dart (pump down plug) inside 7" cement head in the presence of company representative and check the wiper plug & dart & cement head's O-Rings and plug holder by Hangerman (offline job).
- After liner running, make up cement head, connect cement line by Hangerman.
- Perform a Pre-Job safety Meeting with all personnel involved on the operation as well as the client representative.
- Ensure communication between Cementer and Rig floor with phone/walkie-talkie.
- Test surface cement line with 500/2500 psi using cement unit (5 min/10 min).

Note: Circulate bottoms up for at least two-hole volumes before cementing. Make sure that the shale shakers are clean of cutting and mud weight in and mud weight out are the same.

Note: Carefully monitor losses at all stages of the operation.

- Pump 20.0 bbls of 62.0 pcf Chemical Wash by Cement Unit.
- Pump 60.0 bbls of 88.0 pcf Spacer Wash by Rig Pump.
- Transfer Solution by Batch mixer to Cement unit and Fly mix and Pump 15.4 bbl. 118 PCF / 5 BPM slurry by cement unit and mean while Start to wait up 140.0 bbls Slurry by Batch mixer.
- Mix and transfer 140.0 bbl. 118 PCF / 5 BPM slurry by Batch Mixer and Pump by Cement unit.
- Release displacement dart.
- Pump 2.0 bbl Cement Slurry 118 behind the Dart (as a part of displacement).
- Pump 8.0 bbl. of fresh water behind the dart (as a part of displacement).
- Total displacement volume is 283.0 bbl.
- Continue displacement by Cement unit with Mud (273.0 bbl)
- Slow down pump rate for 10.0 bbl. before displacement dart reaches wiper plug (Calculate at rig site based on last tally and tool joint data).
- Watch for indication of dart latching into wiper plug on pressure gauge. If a peak in pressure is noticed when both plugs latches, recalculate the remaining displacement volume to bump the plug.
- When Cement Slurry comes to the annulus, Loss amount should be carefully
- monitored from this time by mud engineer and mud logging.
- Decrease pump rate of last 10.0 bbl. displacement volume (Up to Company Man Decision)
- Bump plug to Surface pump pressure ± 500 or 1000 & perform liner integrity test (LIT) to 2000 psi and keep the final pressure for 15 minutes.

Note: Be careful not to exceed 75% of burst pressure of liners/pipes.

Note: If plug does not bump, do not over displace more than 25% of the shoe track volume.

- Bleed off pressure and monitor return line for checking backflow.

- POOH 5 stands of drill pipe from top of liner lap (± 2960.0 m), circulate 1.2 bottoms up, POOH to surface. Close the well, and hold 500 psi pressure on top of the cement to prevent fluid migration until cement sets.

7.24 Pumping Schedule

Timing Schedule				
Stage	**Rate** (bbl/min)	**Volume** (bbl)	**Time** (min)	**Total Time** (min)
Batch Mixing Time	--		40.0	40
Chemical Wash	5.0	20.0	4.0	44
Spacer	5.0	60.0	12.0	56
Cement Slurry	5.0	153.39	30.7	87
Release Dart	--		5.0	92
Cement Slurry (behind Dart)	5.0	2.0	0.4	92
Fresh Water (behind Dart)	5.0	8.0	1.6	94
Mud	6.0	152.5	25.4	119
Mud (Slow down to shear)	2.0	10.000	5.0	124
Mud	6.0	100.5	16.7	141
Mud (Slow down to bump)	2.0	10.000	5.0	146
POOH Drill Pipe W/ Setting tool	--		45.0	**191**

Table 7-19: AZNS-127 Pumping Schedule

7.25 Amount of Material & Used in Operation

Cement	70470	LB	31.96	MT
FLC-DA 9	458.1	LB	8.3	Sack
Paragas	352.4	GAL	6.4	Drum
CFR-DA 3	281.9	LB	5.6	Sack
CR-DA 4	211.4	LB	3.8	Sack
DF-DA 3	26.0	GAL	5.2	Can
E-DA 500	900	lb	16.4	Sack
CaCO3	22181	lb	10.1	MT
Musol	110.0	gal	2.0	Drum
PA-DA 5	44.0	gal	0.8	Drum

Table 7-20: AZNS-127 Material Used Table

7.26 7” Liner Tie-Back #1 Cementing Operation Information

Operation Type: 7” Liner Tie-Back cementing job

Hole Size: 8- 1/2”

Liner Depth: 2883.5 ^{m}

Total Volume:

- Pump 20^{bbl} chemical wash 62.4^{pcf}
- Pump 40^{bbl} spacer 95^{pcf}

- Pump 156.3^{bbl} cement slurry 118^{pcf}
- Pump 10^{bbl} chemical wash 62.4^{pcf}
-

Total Displacement Volume: Displace with 262.3 ^{bbl} mud

7.27 Engineering Data

Slurry Data			
Name	Volume (bbl)	Density (pcf)	Remark
Cement Slurry	156.3	118	-

Table 7-21: AZNS-127 Engineering Data

7.28 Execution of Operation

Item	Description	Qty
1	Cementing pump truck & related connections	1 ea.
2	Cementing pump truck & related connections	1 ea.
3	Batch mixer	1 ea.
4	Air compressor	1 ea.
5	Silo	1 ea.

Table 7-22: AZNS-127 Equipment Used

Item	Description	Qty
1	Cementing Supervisor	1 per.
2	Cementing Operator	2 per.
3	Batch Mixer Operator	1 per.
4	Cementing Helper	4 per.
5	Batch Mixer Helper	1 per.

Table 7-23: AZNS-127 Operation Crew

7.29 Operation Instructions

Pre – Job Preparation

- Bulk plant R/U & preparations (prepare the checklist).
- Cementing pump truck R/U & preparations (prepare the checklist).
- Preparting mixing fluid (solution) with cooperation of the rig crew).
- Cementing high pressure line R/U to the rig floor (secure them with safety cable).
- Setting up HSE measurments for the operation.

Job Preparation

- Determine the proper Tanks, clean up and prepare chemicals for cement slurry.
- Check and test the salinity of mixing water and its properties prior to prepare CMT solution to avoid any un-wanted flash set.
- Fill tanks with mixing water for preparing mixing fluid.
- 5 hours before reaching tie-back liner point, start mixing cement additives with
- Company Man approval.
- After liner running, make up cement head, connect cement line.
- Perform a Pre-Job safety Meeting with all personnel involved on the operation as well as the client representative.
- Ensure communication between Cementer and Rig floor.
- Test surface cement line with 500/3000 psi using cement unit (5 min/10 min).
- Circulate bottoms up for at least one-hole volume before cementing.
- Pump 20.0 bbl. chemical wash.
- Pump 40 bbl. of 95 pcf spacer.
- Transfer Solution by Batch mixer to Cement unit and Fly mix and Pump 16.3 bbl. 118 PCF / 5 BPM slurry by cement unit and mean while Start to wait up 140.0 bbls Slurry by Batch mixer.
- Mix and transfer 140.0 bbl. 118 PCF / 5 BPM slurry by Batch Mixer and Pump by Cement unit.
- Release displacement dart.
- Pump 10.0 bbl. Fresh Water behind the displacement dart (as a part of displacement).
- Continue displacement by Cement Unit with drilling fluid (262.3 bbl. Mud).
- Slow down pump rate for 10.0 bbl. before displacement dart reaches wiper plug (Calculate at rig site based on last tally and tool joint data).
- Watch for indication of dart latching into wiper plug on pressure gauge. If a peak in pressure is noticed when both plugs latches, recalculate the remaining displacement volume.
- Decrease pump rate of last 10.0 bbl. displacement volume (Up to Company Man Decision).

- Sting in seal nipple in tie-back sleeve meanwhile release pressure slowly in cement unit displacement tank.
- Bleed off pressure and monitor return line for checking backflow.

7.30 Pumping Schedule

Timing Schedule				
Stage	**Rate** (bbl/min)	**Volume** (bbl)	**Time** (min)	**Total Time** (min)
Chemical Wash	5.0	20.0	4.0	4
Spacer	5.0	40.0	8.0	12
Cement Slurry	5.0	156.3	31.3	43
Release Dart	--		5.0	48
Fresh Water	5.0	10.0	2.0	50
Mud	6.0	49.9	8.3	59
Mud (Slow down to shear)	2.0	10.0	5.0	64
Mud	6.0	192.4	32.1	96
Mud (Slow down to bump)	2.0	10.0	5.0	101
POOH Drill Pipe W/ Setting tool	--		45.0	**146**

Table 7-24: AZNS-127 Pumping Schedule

7.31 Amount of Material & Used in Operation

Cement	70522	LB	31.98	MT
FLC-DA 9	351.6	LB	7.0	Sack
CFR-DA 3	301.4	LB	6.0	Sack
CR-DA 4	200.9	LB	3.7	Sack
DF-DA 3	25.3	GAL	5.1	Can
E-DA 500	490.0	lb	8.9	Sack
CaCO3	20005.3	lb	9.1	MT
Musol	45.0	gal	0.8	Drum
PA-DA 5	18.0	gal	3.6	Can

Table 7-25: AZNS-127 Material Used Table

7.32 7” Liner Tie-Back #2 Cementing Operation Information

Operation Type: 7” Liner Tie-Back cementing job

Hole Size: 8- 1/2”

Liner Depth: 1278 ^{m}

Total Volume:

- Pump 20^{bbl} chemical wash 62.4^{pcf}

- Pump 40^{bbl} spacer 95^{pcf}
- Pump 96.8^{bbl} cement slurry 118^{pcf}
- Pump 2^{bbl} chemical wash 62.4^{pcf}

Total Displacement Volume: Displace with 146.6 ^{bbl} mud

7.33 Engineering Data

Slurry Data			
Name	Volume (bbl)	Density (pcf)	Remark
Cement Slurry	96.8	118	-

Table 7-26: AZNS-127 Engineering Data

7.34 Execution of Operation

Item	Description	Qty
1	Cementing pump truck & related connections	1 ea.
2	Cementing pump truck & related connections	1 ea.
3	Batch mixer	1 ea.
4	Air compressor	1 ea.
5	Silo	1 ea.

Table 7-27: AZNS-127 Equipment Used

Item	Description	Qty
1	Cementing Supervisor	1 per.
2	Cementing Operator	2 per.
3	Batch Mixer Operator	1 per.
4	Cementing Helper	4 per.
5	Batch Mixer Helper	1 per.

Table 7-28: AZNS-127 Operation Crew

7.35 Operation Instructions

Pre – Job Preparation

- Bulk plant R/U & preparations (prepare the checklist).
- Cementing pump truck R/U & preparations (prepare the checklist).
- Preparting mixing fluid (solution) with cooperation of the rig crew).
- Cementing high pressure line R/U to the rig floor (secure them with safety cable).
- Setting up HSE measurments for the operation.

Job Preparation

- Determine the proper Tanks, clean up and prepare chemicals for cement slurry.
- Check and test the salinity of mixing water and its properties prior to prepare CMT solution to avoid any un-wanted flash set.
- Fill tanks with mixing water for preparing mixing fluid.
- 5 hours before reaching tie-back liner point, start mixing cement additives with
- Company Man approval.
- After liner running, make up cement head, connect cement line.
- Perform a Pre-Job safety Meeting with all personnel involved on the operation as well as the client representative.
- Ensure communication between Cementer and Rig floor.
- Test surface cement line with 500/3000 psi using cement unit (5 min/10 min).
- Circulate bottoms up for at least one-hole volume before cementing.
- Pump 20.0 bbl. chemical wash.
- Pump 40 bbl. of 95 pcf spacer.
- Transfer Solution by Batch mixer to Cement unit and Fly mix and Pump 96.8 bbls Slurry by Batch mixer.
- Mixer and Pump by Cement unit.
- Release displacement dart.
- Pump 2 bbl. Fresh Water behind the displacement dart (as a part of displacement).
- Continue displacement by Cement Unit with drilling fluid (146.6 bbl. Mud).
- Slow down pump rate for 10.0 bbl. before displacement dart reaches wiper plug (Calculate at rig site based on last tally and tool joint data).
- Watch for indication of dart latching into wiper plug on pressure gauge. If a peak in pressure is noticed when both plugs latches, recalculate the remaining displacement volume.
- Decrease pump rate of last 10.0 bbl. displacement volume (Up to Company Man Decision).
- Sting in seal nipple in tie-back sleeve meanwhile release pressure slowly in cement unit displacement tank.
- Bleed off pressure and monitor return line for checking backflow.

7.36 Pumping Schedule

Timing Schedule				
Stage	**Rate** (bbl/min)	**Volume** (bbl)	**Time** (min)	**Total Time** (min)
Chemical Wash	5.0	20.0	4.0	4
Spacer	5.0	40.0	8.0	12
Cement Slurry	5.0	96.8	19.4	31
Release Dart	--		5.0	36
Fresh Water	5.0	2.0	0.4	37
Mud	6.0	1.8	0.3	37
Mud (Slow down to shear)	2.0	2.0	1.0	38
Mud	6.0	130.8	21.8	60
Mud (Slow down to bump)	2.0	10.0	5.0	65
POOH Drill Pipe W/ Setting tool	--		45.0	110

Table 7-29: AZNS-127 Pumping Schedule

7.37 Amount of Material & Used in Operation

Cement	44615	LB	20.23	MT
FLC-DA 9	156.2	LB	3.1	Sack
CFR-DA 3	133.8	LB	2.7	Sack
CR-DA 4	13.4	LB	0.2	Sack
DF-DA 3	15.1	GAL	3.0	Can
E-DA 500	490.0	lb	8.9	Sack
CaCO3	20005.3	lb	9.1	MT
Musol	45.0	gal	0.8	Drum
PA-DA 5	18.0	gal	3.6	Can

Table 7-30: AZNS-127 Material Used Table

8. Completion Report

8.1 Completion Tubing Information

Tubing Size(in)	Weight (ppf)	Grade	Ultimate Strengths	Connection	Collapse Pressure (psi)	Burst Pressure (psi)	Interval (m)
4 – 1/2	18.9	L – 80	440 KLB	TP – G2	13830	13370	0 – 87.515
3 – 1/2	10.2	L – 80	233 KLB	TP – G2	12120	11560	87.515 – 2811.9

Table 8-1: AZNS-127-ST2 Tubing Data

8.2 Completion Tools Specification Checklist

Item	Equipment Description	
1	**CONTROL LINE "ROCK":**	
	THINKNESS:	0.065"
	WORK PRESSURE:	15,000 psi
	O.D.:	0.25"
	TYPE:	SEAMLESS
	MATERIAL:	INC 825
	LENGTH:	120 m/Roll
2	**UPPER FLOW COUPLING "ROCK" :**	
	OD:	5.500"
	ID:	3.640"
	THREADS:	4-1/2" 18.9 PPF, TP–G2
	WORKING PRESSURE:	10,000 psi
	LENGTH:	6 ft.
	MATERIAL:	13Cr – 110
	LOWER FLOW COUPLING "ROCK" :	
	OD:	5.500"
	ID:	3.640"
	THREADS:	4-1/2" 18.9 PPF, TP–G2
	WORKING PRESSURE:	10,000 psi
	LENGTH:	6 ft.
	MATERIAL:	13Cr – 110
3	**TUBING RETRIEVABL SAFETY VALVE " ROCK" :**	
	SETTING DEPTH:	63.487[m]

Item	Equipment Description	
	WORKING PRESSURE:	10,000 psi
	TEMPERATURE:	325 °F
	MAX O.D.:	7.00"
	MIN. I.D.:	3.437"
	PROFILE:	3.437R
	SELF-EQUALIZING FEATURE	HYDRAULIC CONTROL
	MATERIAL:	13Cr – 110KSI
	THREADS:	4-1/2" 18.9 PPF, TP–G2
	PROTECTION SLEEVE	
	PROFILE	3.640R
	MIN ID	2.90"
4	**TRAVELING JOINT "ROCK" :**	
	STROKE LENGTH	10 ft.
	SHEAR PIN SET:	15,000 lb.
	ELASTOMER:	AFLAS
	WORKING PRESSURE:	10,000 psi
	TEMPERATURE:	300 °F
	TOOL OD:	5.240"
	TOOL ID:	2.922"
	THREADS:	3-1/2" 10.20 PPF, TP–G2
	MATERIAL:	13Cr – 110
	TRANSFER TORQUE FEATURE	YES
5	**SLIDING SIDE DOOR " ROCK" :**	
	PROFILE:	X
	MAX.OD:	4.551"
	MIN ID:	2.750"
	PRESSURE RATING:	10,000 PSI
	TEMPERATURE:	300 DEG F
	THREADS:	3-1/2" 10.20 PPF, TP–G2
	MATERIAL:	13Cr – 110
	OPEN METHOD	DOWNWARD OPEN
6	**COMPLETION PACKER " ROCK" :**	
	TYPE:	PERMANENT
	CASING :	7" 26-32 PPF
	OD:	5.787"
	ID:	2.797"
	WORKING PRESSURE:	10,000 PSI
	TEMPERATURE:	300 DEG F
	THREADS:	3-1/2" 10.20 PPF TP–G2 pin
	MATERIAL:	13Cr – 110
	ELEMENT MATERIAL:	AFLAS
	4.0" ANCHOR SEAL	
	MAX OD (PACKING):	5.700"
	ID:	2.922"

Item	Equipment Description	
	WORKING PRESSURE:	10,000PSI
	TEMPERATURE:	300 DEG F
	THREADS:	3-1/2" 10.20 PPF, TP–G2 box
	TYPE:	RATCH LATCH
7	**LANDING NIPPLE " ROCK" :**	
	PROFILE TYPE:	R
	WORKING PRESSURE:	10,000 PSI
	MAX O.D.:	4.5"
	SEAL BORE:	2.562”
	MIN ID:	2.562"
	THREADS:	3-1/2" 10.20 PPF, TP–G2
	TEMPERATURE:	300 DEG F
	MATERIAL:	13Cr – 110
8	**RE-ENTRY GUIDE SHOE " ROCK" :**	
	OD:	4.5"
	MIN ID:	2.922"
	TOP CONNECTION	3-1/2" 10.20 PPF, TP–G2 box
	MATERIAL:	13Cr – 110

Table 8-2: AZNS-127-ST2 Equipment Checklist

Item	Name	Description
1	**Tubing Hanger**	11" BOWL x 4-1/2” 18.9 PPF BOX TPCQ-EX CONNECTION BOTTOM & 4-1/2” 4-2G ACME BOX TOP WITH 4-1/2” EXTENDED NECK, WITH ONE CONTINUOUS 1/4" NPT C. LINE EXIT FOR SSSV, ONE 1/4" LINE EXIT FOR DHPG, INSTALLATION COMPLETE WITH RELATED FITTINGS AND PLUGS, WITH TWO CHANNEL FOR 3/8” CHEMICAL. BPV: 4" TYPE H THREAD PREPARATION, THREE FS SEAL TO PACK OFF THE UPPER NECK AND TWO S SEAL TO PACK OFF THE BODY OF HANGER, MATERIAL: 410SS. M.C: FF-0.5 T.C: U PSL:3G PR:2 COMPANY: MSP
2	**Fluted Adaptor**	4 1/2" 18.9 PPF, L-80 HSM3 PIN * TPCQ EX PIN, OD: 5.5’’ ID: 3.64’’ SLOTS: 6 * 1 INCH WIDTH

Table 8-3: AZNS-127-ST2 Equipment Checklist

8.3 Assembling Test Report

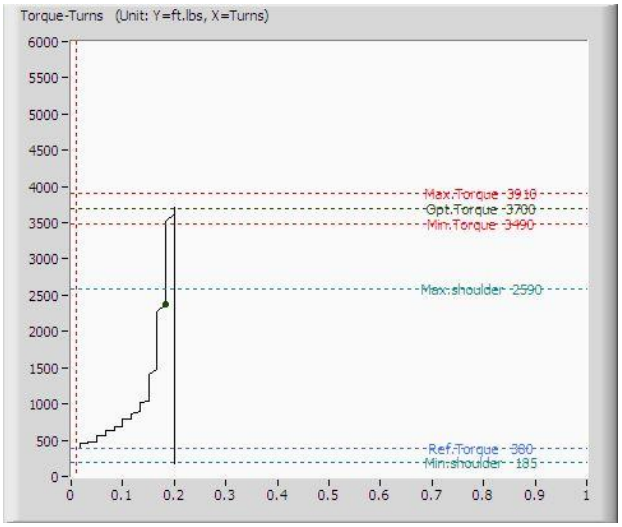


Figure 12 Mule Shoe & No-Go Connections

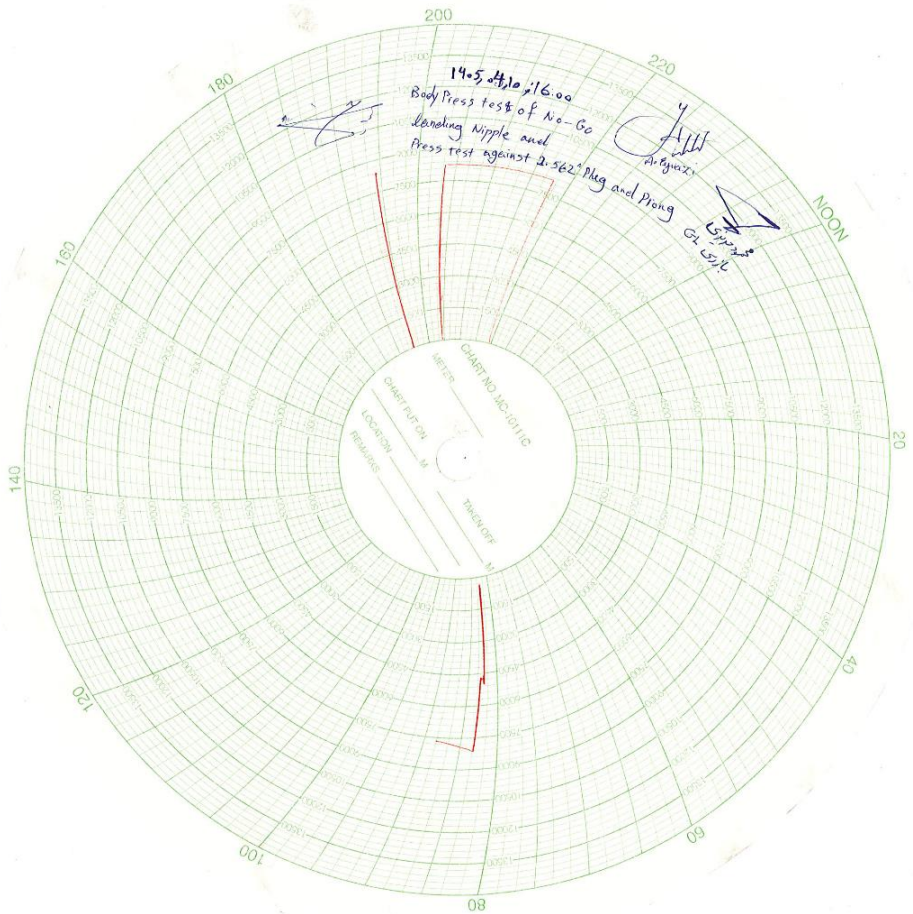
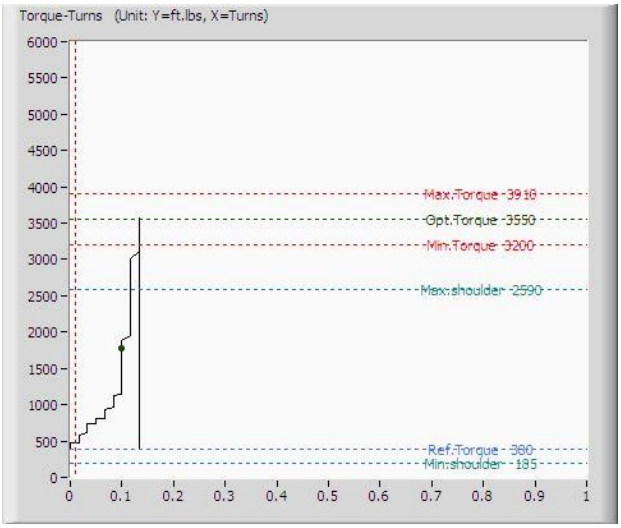


Figure 13: Mule Shoe & No-Go Pressure Test


Torque-Turns (Unit: Y=ft.lbs, X=Turns)
6000
5500
5000
4500
4000
3500
3000
2500
2000
1500
1000
500
0
0
0.1
0.2
0.3
0.4
0.5
0.6
0.7
0.8
0.9
1
Max.Torque 3910
Opt.Torque 3550
Min.Torque 3200
Max.shoulder 2590
Ref.Torque 360
Min.shoulder 185

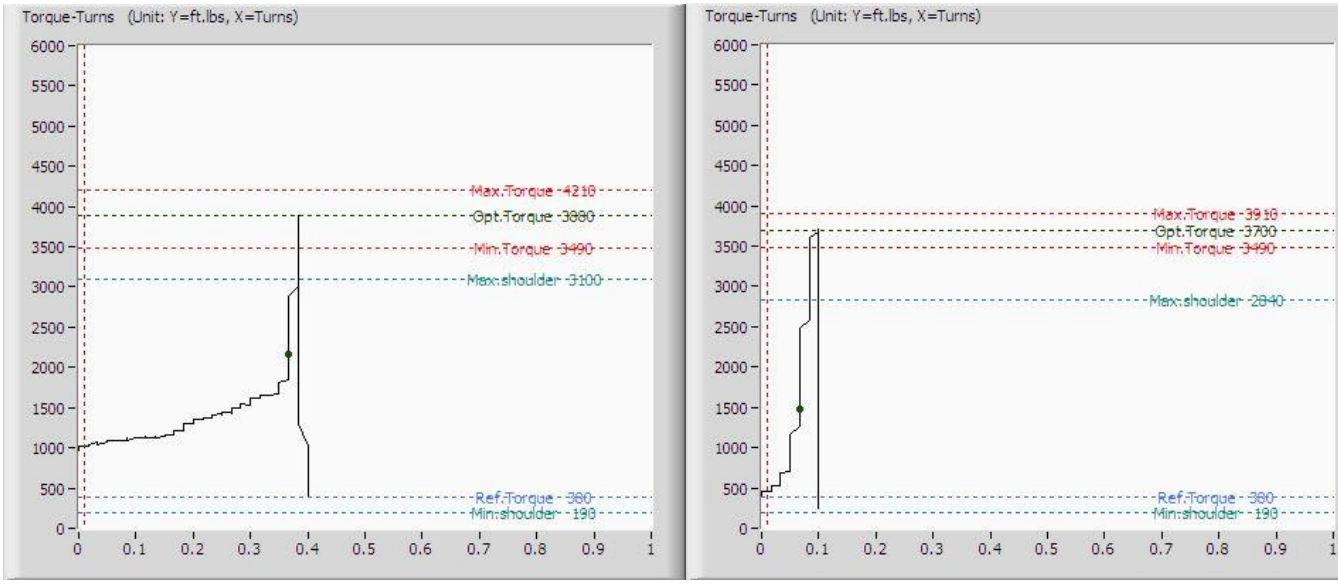


Figure 14: Permanent Packer Connections

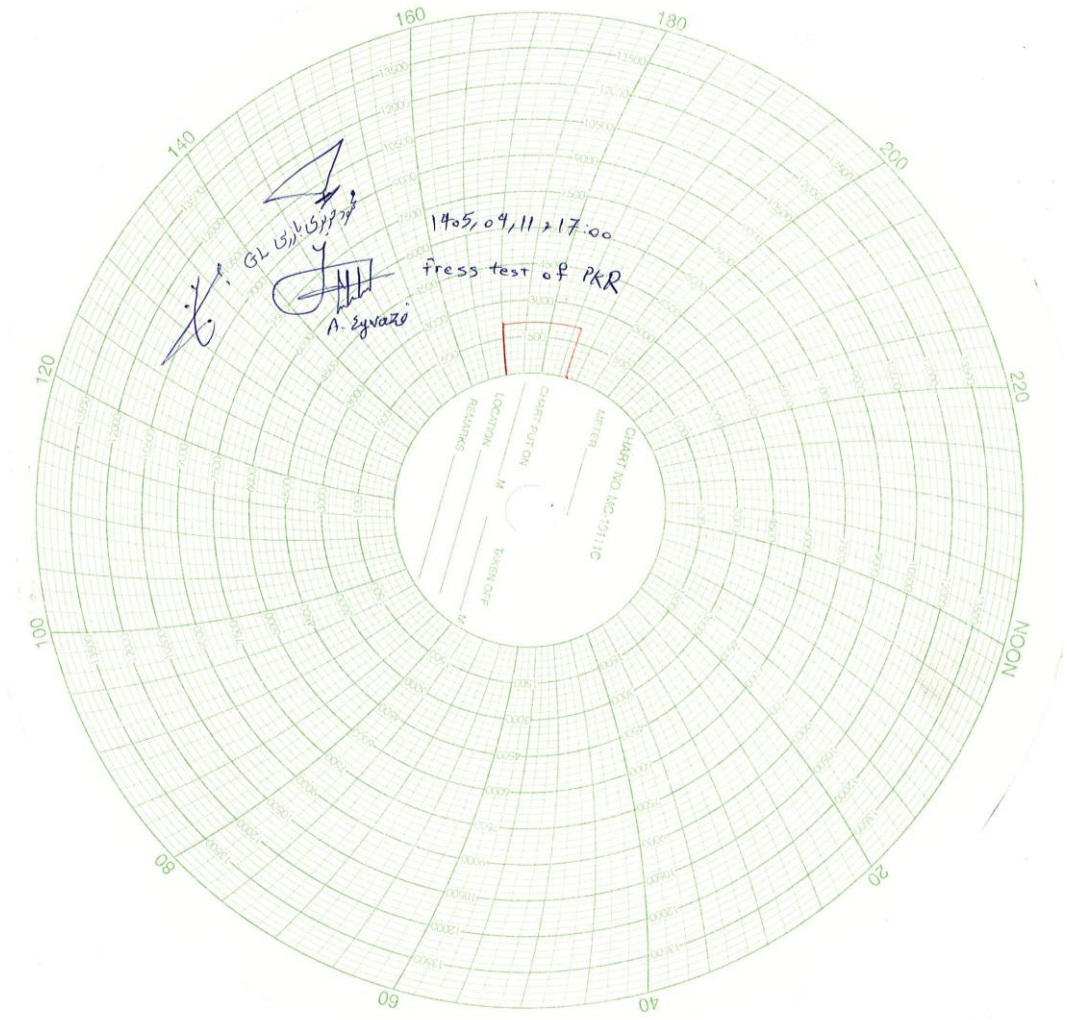


Figure 5: Packer Pressure Test

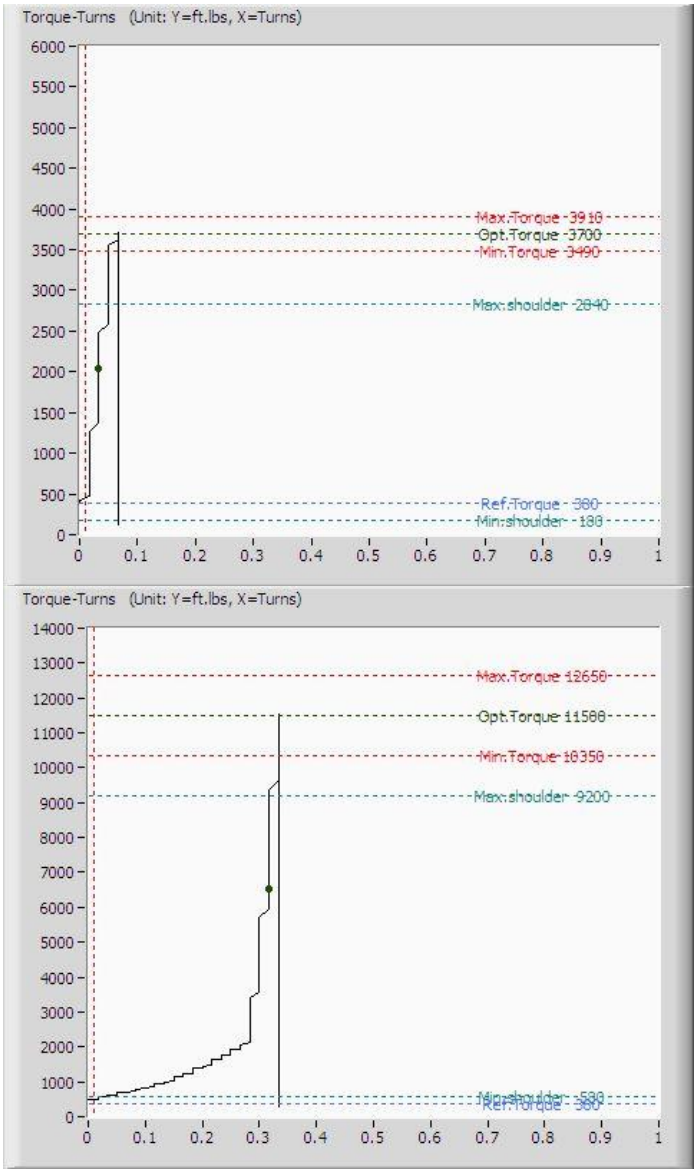


Figure 6: Sliding Side Door Connections

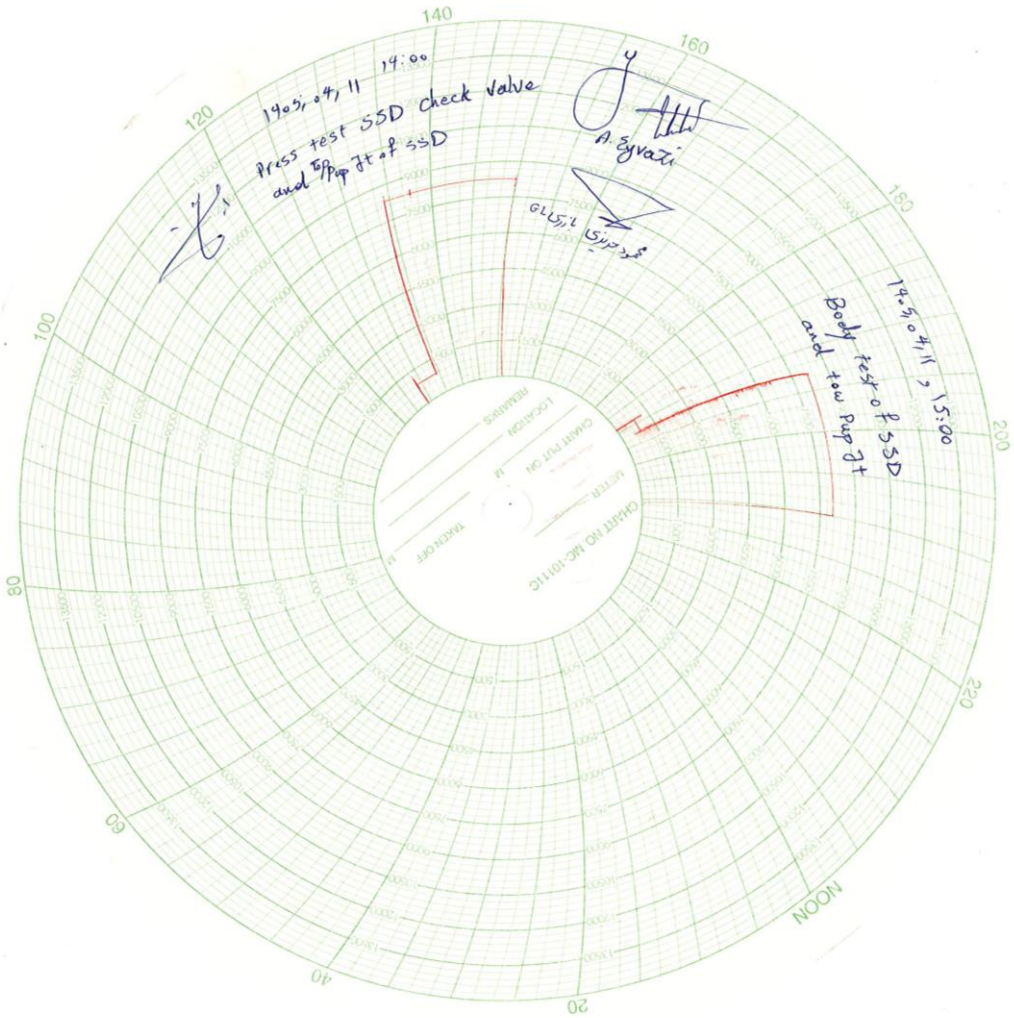


Figure 7: Sliding Side Door Pressure Test

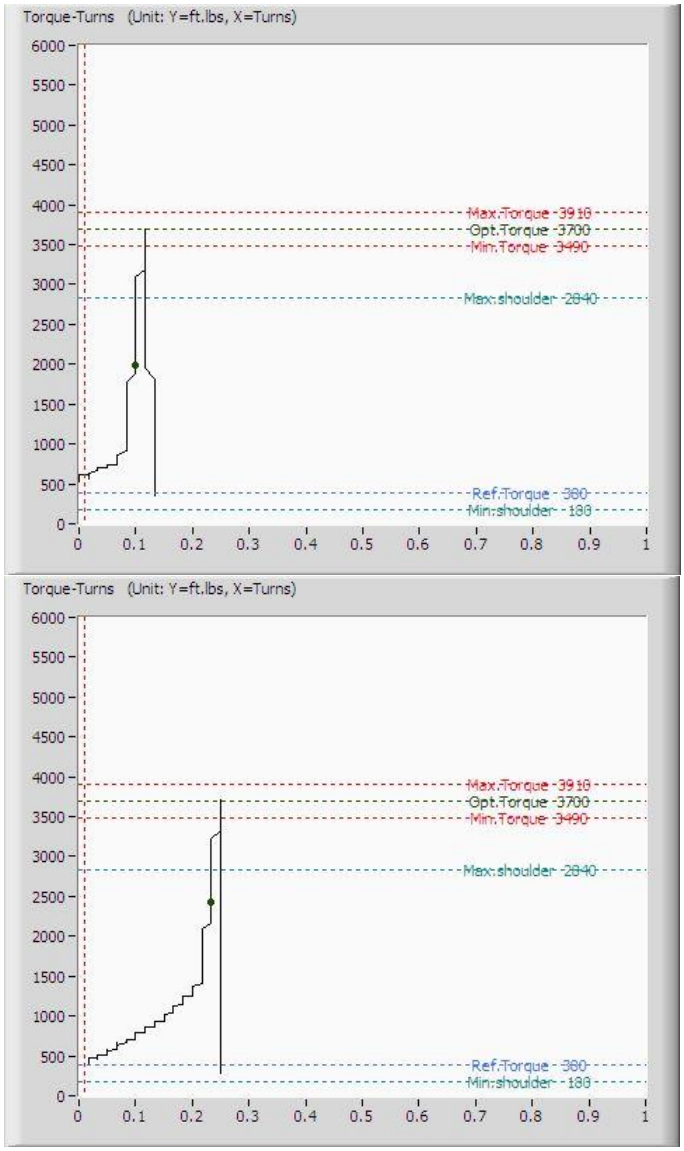


Figure 8: Traveling Joint Connections

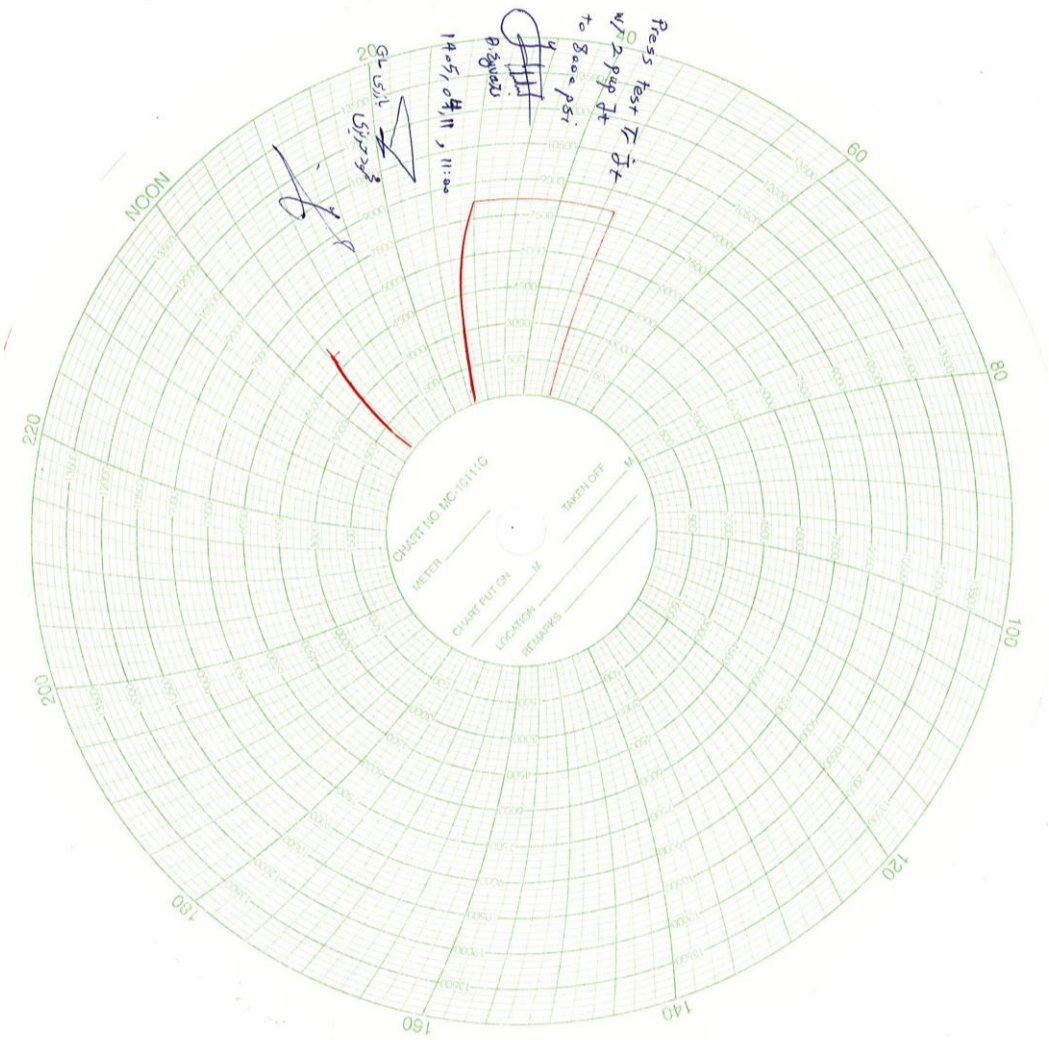


Figure 9: Traveling Joint Pressure Test

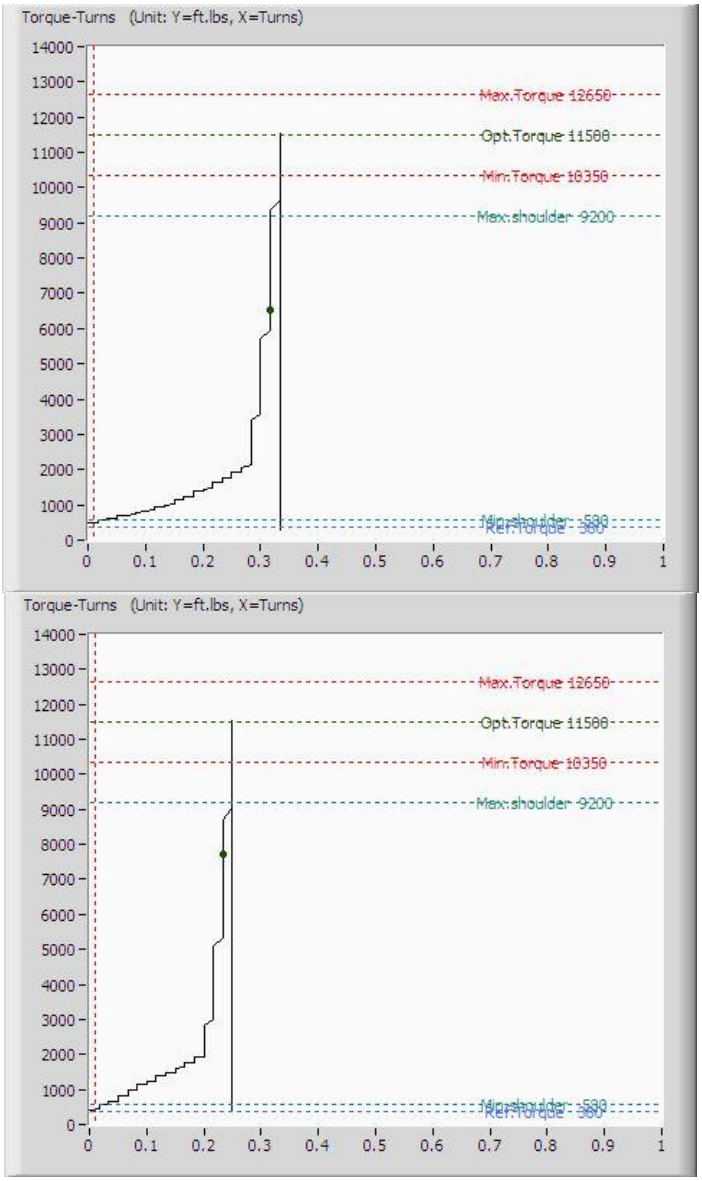


Figure 10: TRSSSV & Flow Couplings Connections

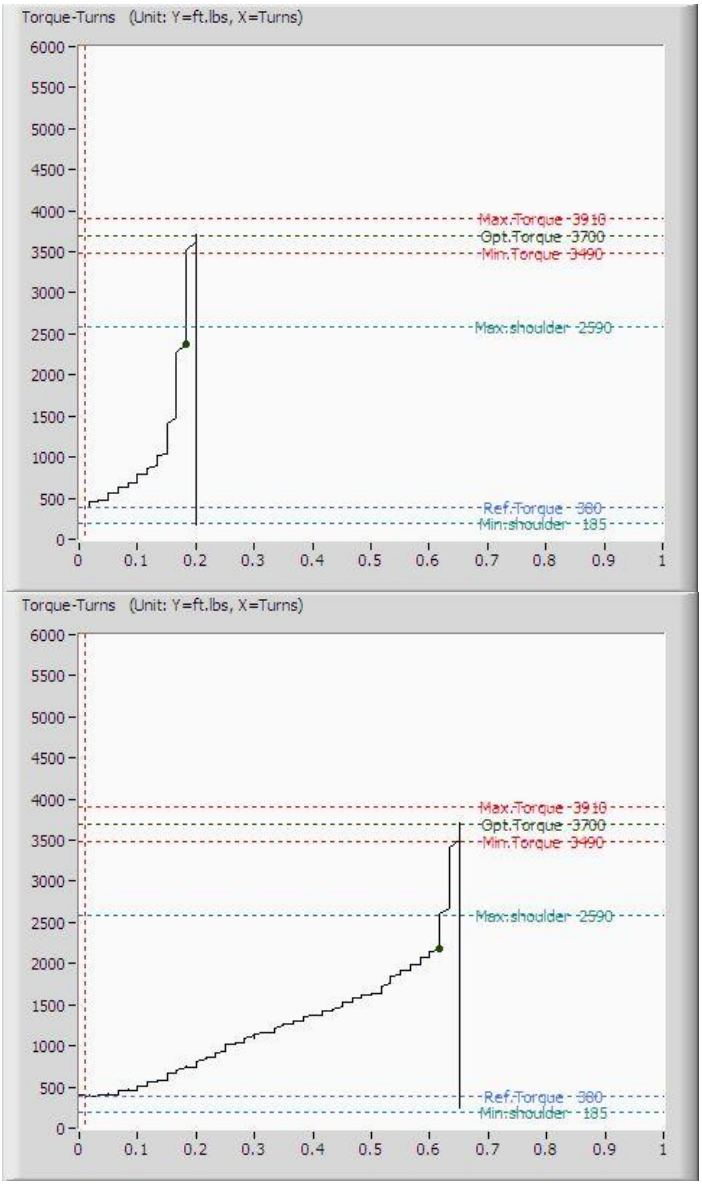


Figure 11: Flow Coupling & Pup Joints Connections

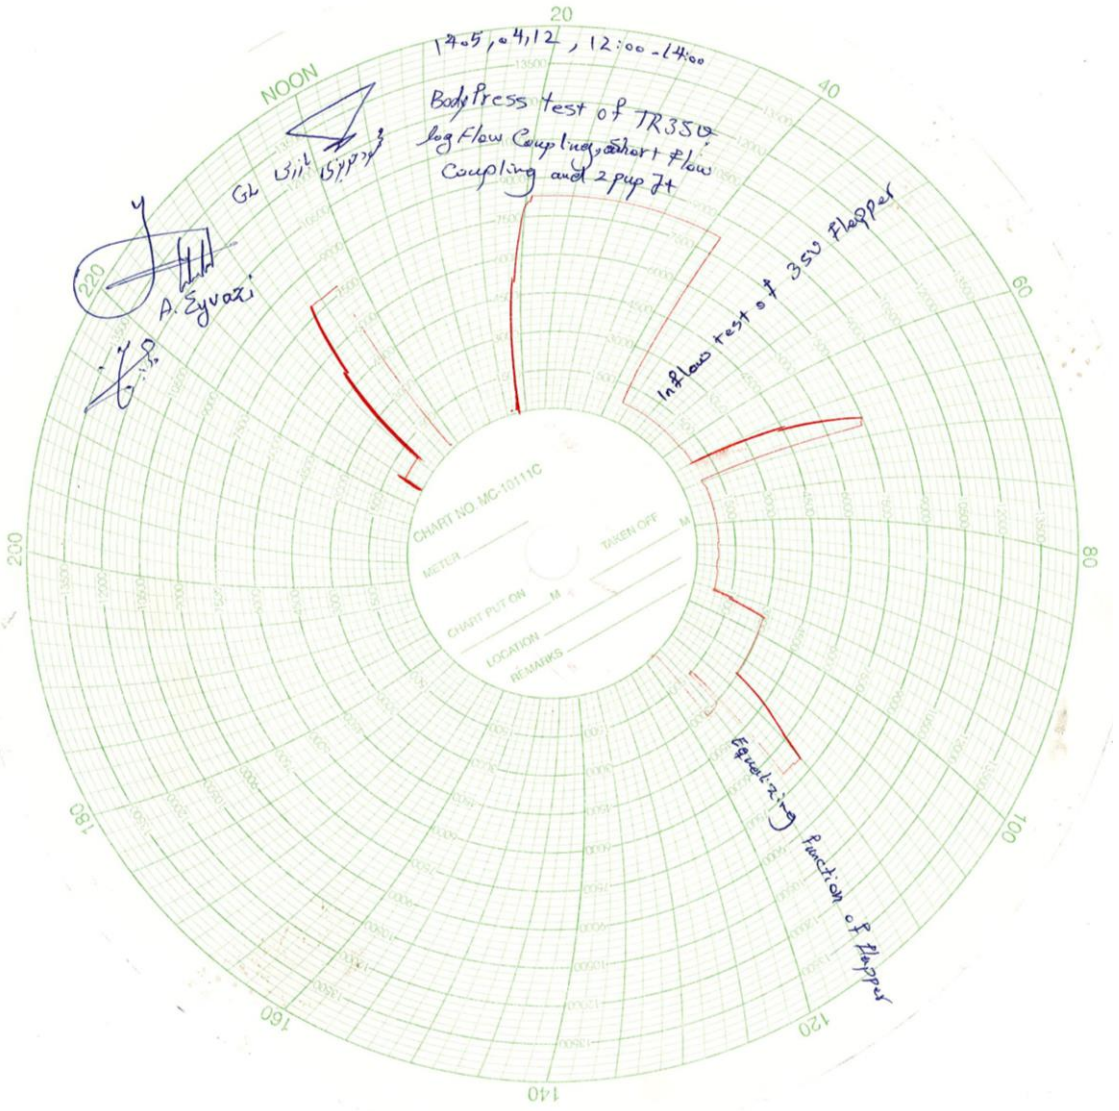


Figure 12: TRSSSV Pressure Test

8.4 Completion Operation Checklist

Item	Operation Name	Remark	Check Mark✓
1	Scraper Trip	Packer depth should be scraped	√
2	Pre-job	Pre-connection All Down Hole Equipment With Upper & Lower Pup	√

	preparation	Joints On Confirmed Thread-makeup at Workshop, And Pressure Test Prior To Being Transported To Well Site.	
		Retrieve Wear Bushing, M/U Jet Sub And Flush Bop Stack & Well Head With Fresh Water.	√
		All Crossovers, Pup Joints For Space Out Measured Put In Right Place.	√
		Lift Control Line And Protectors On Rig Floor.	√
		Hold A Pre-Job Safety Meeting For Running Upper Completion String.	√
3	Assembling and RIH	M/U 3-1/2" Re-entry Guide Shoe w/ 1 Joint Tubing as Per Tally And 3-1/2" BTM No Go Landing Nipple	√
		Check The Conditions Landing Nipple To Make Sure There Is No Damage, Observe There Is No Any Trash Trapped Inside.	√
		Assemble Landing Nipple.	√
		RIH 1 Joint Tubing As Per Tally	√
		P/U And M/U Hydraulic-Set PERMANENT Production Packer.	√
		Much More Care Should Be Taken When Packer Is Passing Well Head And Liner Hanger While RIH,	√
		Assemble Ratch Latch If Packer	-
		Slack Off Packer Assembly, Double Check The Quantity Of Shear Pins, Remove The Tape On The Element, Check If Any Damages On It.	√
		RIH 1 Joint Tubing As Per Tally	√
		M/U Pup Joint And SSD (close Position) To Tubing String With check valve Inside.	√
		Pressure Test Tubing String 7500psi/15min Every 100 JTs.	√
		RIH Completion String and M/U traveling joint as per running tally.	√

		M/U 2 NO. CIV as per running tally& Press Test to 2000 Psi.	-
		Cont. Running Tubing as per Tally while Install Cross protector for the 2 NO. 3/8"control line.	-
		M/U TRSSSV	√
		Install control line to TRSSSV and pressure test control line 8000psi x 15mins. And then keep 5000psi pressure while running to ensure TRSSSV open. Install TRSSSV protector for the 1/4" control line. Continue to run 4-1/2" tubing as per running tally.	√
4	M/U and Space out Tubing Hanger	Pick up & M/U tubing hanger with double pin crossover. M/U landing joint. Check string weight upward and downward.	√
		Roughly cut control line about 2 meters above tubing hanger, wrap 2-3 turns and then feed through Tubing Hanger.	√
		Check string weight upward and downward and Space out Tubing Hanger 1.5 m (Half stroke) above tubing head spool	√
Item	**Operation Name**	**Remark**	**Check Mark✓**
5	Set production packer	R/Up Slick Line. Remove Check valve inside SSD	√
		RIH and Set plug & prong in Landing Nipple. POOH to surface.	√
		Pressurize inside tubing to 500psi to ensure traveling joint is full open. Increase Pressure gradually to SET PACKER. Increase pressure to 7500 Psi to Test String.	√
7	Land Tubing hanger	Move down completion string and apply required weight to shear traveling joint load pins and Land Tubing hanger in T.H.S. Slack off completely & Record the weight.	√


		Drain the BOP stack through the gate valves of tubing head before landing hanger in THS. Leave the valves open.	√
		Tie Down Screws on THS should be fully open before Operation	√
8	N/D BOP & N/U X-mas tree	Tighten tie down screws.	√
		Test inside string w/ 5000 psi, 15 min.	√
		R/Up Slick Line. RIH with slick line and Ret. Plug & prong from Landing Nipple. POOH to surface.	√
		Test Annulus w/ 2000 Psi 15min.	√
		Close BOP ram and test above tubing hanger (annulus between BOP and landing joint) to 2000psi.	√
		B/O & L/D landing joint.	√
		Set 4” 2Way in TBG Hanger & Test it, Back off and L/D Running Tool.	√
		N/D BOP.	√
		Feed control line, through head bonnet.	√
		Check hanger for any damage and pressure test control line to 5000psi	√
		Pressure test chemical injection line & rapture the disc after installing Bonnet.	-
		N/U x-mass tree as program.(Bottom Master)	√
		Perform required tests for X-mass tree. (Bottom Master)	√
		Connect from X-mass tree kill valve to the pump unit and test X-Mas tree body to 1000/8000psi for 15 min against TWCV.	√
		Remove 4" two way, install 4" one way	√
		Close TRSSSV	√

		Release the rig. Clean the well site.	√

Table 8-4: AZNS-127 Operation Checklist

8.5 Completion Sketch & Tally

Contractor		Completion Well Schematic						Client			
		Liner & Tubing Data									
Field	AZADEGAN	Description	7" Tie-Back #1	7"Tie-Back #2	5" Liner	3 1/2" Tubing	4 1/2" Tubing	Perforation	7" Liner Lap		128.4
Well Number:	AZNS-127	OD[in]	7	7	5	3.5	4.5	4115.78-4121.78 4094.4-4100.4 4088.9-4094.4 4074-4080 4071-4074	7" Tie-Back L. Lap #1 7" Tie-Back L. Lap #2		2883.5 1284
Rig :	OEOC-201	Nominal weight [lb/ft]	29, 32	29	18	10.2	18.9		5" Liner Lap		3763.5
RTE-GLE	12.95	Grade	L-80, P110	L-80	L-80	L-80	L-80	4060.6-4066 4052-4058 4047.4-4052 4023.2-4028.9	5" Liner Shoe		4150
RTE-THF	3.95	Thread	TPCQ	TPCQ	HSG3-FJTHD	TP-G2	TP-G2		Total Depth:		4150
Rig Spudded Date :	2026.04.03	Inside diameter [in]	6.184, 6.094	6.184	4.28	2.922	3.640	4000-4006 3993.8-3999.9 3987.7-3993.8 3984-3987.7	X-mass Tree:		MSP-T Type
End of Operation	2026.07.17	API Drift Diameter	6.125	6.125	3.75	2.797	3.515		Size & Rating:		4-1/16"-10K

Schematic		Description	Max OD	Min ID	Length (m)	BTM(m)	TOP(m)
		Elevation (floor - TBG Head Flange)	-	-	10.2	10.2	0
	1	TBG HANGER MSP/Drilex, 10K, 11" X 4 1/2" ACME Box up X 4 1/2" TPCQ-EX Box Down L-80 18.9#, M/C: FF-0.5 T/C: UPSL: 3G PR: 2, 4" Type "H" Two Way (Min Bore: 3.68")	5.118	3.68	0.47	10.672	10.2
	2	Pup Jt 4 1/2",TPCQ , Box Down,18.9#, L-80	5.118	3.515	1.32	11.994	10.672
	3	4-1/2" Fluted swage adapter D/P, 18.9# TPCQ-EX Pin on top X HSM3 Pin , 9Cr1MO, Chengdu Rock Petroleum Co	6.1	3.64	1.12	13.116	11.994
	4	X.O.S 4-1/2", 18.9#, L-80, TYPE-1, HSM3 Box up * TPG-2 Pin Down	5.118	3.64	0.94	14.058	13.116
	5	5 JOINTs TUBING 4 1/2", TP-G2 ,18.9#, L-80, Type-1	5.118	3.515	45.90	59.956	14.058
	6	Pup Jt 4 1/2",TPG2 ,18.9#, L-80, Type-1	5.118	3.515	1.91	61.866	59.956
	7	4-1/2" Flow Coupling,18.9#, 13Cr-110, TPG2	5.5	3.64	1.72	63.586	61.866
	8	4 1/2" Tubing Retrievable Saftey Valve, 18.9#TP-G2 , SUPER 13CR-110KSI, 10K WP With AF Profile, Flapper TypePUP	7	3.437	2.01	65.596	63.586
	9	4-1/2" Flow Coupling, 18.9#, 13Cr-110, TPG2,	5.5	3.64	1.72	67.316	65.596
	10	Pup Jt 4 1/2",TPG2 ,18.9#, L-80, Type-1	5.118	3.515	1.91	69.224	67.316
	11	2 JOINTs TUBING 4 1/2", TP-G2 ,18.9#, L-80, Type-1	5.118	3.515	18.39	87.614	69.224
	12	X-over 4-1/2"TPG2, 18.9# BOX * 3-1/2"TPG2 , 10.2# PIN,	5.118	3.515	0.83	88.444	87.614
	13	287 JOINTs TUBING 3-1/2"TP-G2 , 10.2#, L-80.Type-1	4.25	2.922	2665.53	2753.972	88.444
	14	3-1/2" EXP. JOINT, TP-G2 , 13CR-110, 10'STK (Half Open),10K	5.24	2.922	6.15	2760.122	2753.972
	15	TBG 3-1/2", 10.2#, L-80,TPG2	4.25	2.922	9.33	2769.453	2760.122
	16	3-1/2" Pup Jt,TPG2 , 10.2#, L-80, Type-1	4.25	2.922	1.80	2771.253	2769.453
	17	3-1/2" SLIDING SIDE DOOR, 13CR-110, TP-G2 With Type X Selective Profile (PROFILE: 2.750" X, DOWNWARD OPEN)	4.551	2.75	1.28	2772.528	2771.253
	18	3-1/2" Pup Jt,TPG2 , 10.2#, L-80, Type-1	4.25	2.922	1.84	2774.37	2772.528
	19	TBG 3-1/2", 10.2#, L-80,TPG2	4.25	2.922	9.34	2783.712	2774.37
	20	3-1/2" Pup Jt,TPG2 , 10.2#, L-80, Type-1	4.25	2.922	1.90	2785.612	2783.712
	21	7", 26-32PPF TP-G2 Connection CASING HYDRAULIC SET RERMANENT PRODUCTION PACKER TO BE RUN IN 7.00" 26-32PPF CASING, SUPER 13CR-110, ID: 2.797", OD: 5.787" Rock Petroleum Co C/W 3-1/2" ANCHOR SEAL ASSEMBLY, TP-G2 10.2# Top Connection, 13CR-110 Tubing and 3-1/2" Mill OUT EXTENSION	5.787	2.797	3.4	2789.007	2785.612
	22	3-1/2" Pup Jt,TPG2 , 10.2#, L-80, Type-1	4.25	2.922	2.09	2791.097	2789.007
	23	TBG 3-1/2", 10.2#, L-80,TPG2	4.25	2.922	9.27	2800.368	2791.097
	24	3-1/2" Pup Jt,TPG2 , 10.2#, L-80, Type-1	4.25	2.922	1.72	2802.09	2800.368
	25	3-1/2" BOTTOM NO-GO LANDING NIPPLE, TP-G2 , 10.2#, 13CR-110 W/ Seal Bore 2.562" TYPE R Profile (NO-GO ID: 2.562"), 10K	4.5	2.562	0.36	2802.445	2802.09
	26	TBG 3-1/2", 10.2#, L-80,TPG2	4.25	2.922	9.34	2811.789	2802.445
	27	3-1/2" Wireline Re-Entry Guide, TP-G2 BOX, 10.2#, 13CR-110, ID: 2.922", OD: 4.250"	4.5	2.922	0.21	2811.999	2811.789
	END OF COMPL					2811.999	2811.999

Tubing Retrievable		
Traveling Joint	11.994	10.672
SSD	2772.528	2771.253
7" HYDRAULIC	2789.007	2785.612
NO-GO Landing	2802.09	2800.368
Entry Guide	2811.789	2802.445

Figure 8-13: AZNS-127 Completion Sketch

MSA

Field :	S.Azadegan	Well NO:	AZNS127 WO:	Rig NO:	OEOC201	Drig CO:	OEOC
PEDEC, PPL		Completion String					

Grade	ID "	Drift "	Weight lb/ft	Burst psi	Collaspse psi	Yield klbs	Coupling "	TQ ft x lb	Nominal Dia. OD
L-80	2.922	2.797	10.2	11,560.0	12,120.0	233	3.962	3200-3550-3900	3-1/2"
L-80	3.640	3.515	18.9	13,370.0	13,830.0	440	5.137	8910-9900-10880	4-1/2"

BTM NO GO Depth:	2801.99	Formation Name :	Fahlyan	Hook Weight :	68 k lb
BTM of String	2811.90	Formation Top :	3937	VOLUME (TOTAL)	96.94
Packer Depth :	2785.51			Mud Weight (pcf) :	105

Number on jt	Grade	Run In No.	Jt Length (m)	Cum Length (m)	Dist to RT (m)	M/D weight (Klbs)	VOL(BBL)	Remarks	
								joint no	IN / OUT
					2811.9	68.00			
3-1/2" Wireline Re-Entry Guide, TP-G2 BOX, 10.2#, 13CR-110, ID: 2.922", OD: 4.250"	3-1/2" Mule Shoe		0.21	0.21	2811.690	68.01	0.01		
1	TBG 3-1/2", 10.2#, L-80,TPG2		9.34	9.55	2802.346	68.01	0.01	1	
3-1/2" BOTTOM NO-GO LANDING NIPPLE, TP-G2 , 10.2#, 13CR-110 W/ Seal Bore 2.562" TYPE R Profile (NO-GO ID: 2.562"), 10K	3-1/2" BTM NO GO		0.36	9.91	2801.991	68.02	0.02		
3-1/2" Pup Jt,TPG2 , 10.2#, L-80, Type-1	Pup Jt 3-1/2", 10.2#,TPG2		1.72	11.63	2800.269	68.02	0.02		
2	TBG 3-1/2", 10.2#, L-80,TPG2	2	9.27	20.90	2790.998	68.27	0.27	2	
3-1/2" Pup Jt,TPG2 , 10.2#, L-80, Type-1	Pup Jt 3-1/2", 10.2#,TPG2	0	2.09	22.99	2788.91	68.27	0.27	0	
7", 26-32PPF TP-G2 Connection CASING HYDRAULIC SET RERMANENT PRODUCTION PACKER TO BE RUN IN 7.00" 26-32PPF CASING, SUPER 13CR-110, ID: 2.797", OD: 5.787" Rock Petroleum Co C/W 3-1/2" ANCHOR SEAL ASSEMBLY, TP-G2 10.2# Top Connection, 13CR-110 Tubing and 3-1/2" Mill OUT EXTENSION	PKR		3.40	26.39	2785.513	68.37	0.36		
3-1/2" Pup Jt,TPG2 , 10.2#, L-80, Type-1	Pup Jt 3-1/2", 10.2#,TPG2		1.90	28.29	2783.61	68.27	0.27		
3	TBG 3-1/2", 10.2#, L-80,TPG2	3	9.34	37.63	2774.271	68.63	0.61	3	
3-1/2" Pup Jt,TPG2 , 10.2#, L-80, Type-1	Pup Jt 3-1/2", 10.2#,TPG2		1.84	39.47	2772.429	68.63	0.61		
3-1/2" SLIDING SIDE DOOR, 13CR-110, TP-G2 With Type X Selective Profile (PROFILE: 2.750" X, DOWNWARD OPEN)	SSD		1.28	40.75	2771.154	68.66	0.65		
3-1/2" Pup Jt,TPG2 , 10.2#, L-80, Type-1	Pup Jt 3-1/2", 10.2#,TPG2		1.80	42.55	2769.354	68.71	0.70		
5	TBG 3-1/2", 10.2#, L-80,TPG2	4	9.33	51.88	2760.023	68.97	0.95	4	
3-1/2" Pup Jt,TPG2 , 10.2#, L-80, Type-1	Pup Jt 3-1/2", 10.2#,TPG2		0.00	51.88	OUT	68.97	0.95	0	OUT
3-1/2" EXP. JOINT, TP-G2 , 13CR-110, 10'STK (Half Open),10K	Traveling Jt		6.15	58.03	2753.873	69.14	1.12	0	
3-1/2" Pup Jt,TPG2 , 10.2#, L-80, Type-1	Pup Jt 3-1/2", 10.2#,TPG2		0.00	58.03	OUT	69.14	1.12	0	OUT

6	TBG 3-1/2", 10.2#, L-80,TPG2	5	9.34	67.37	2744.535	69.14	1.12	5
7	TBG 3-1/2", 10.2#, L-80,TPG3	6	9.34	76.70	2735.197	69.40	1.37	6
8	TBG 3-1/2", 10.2#, L-80,TPG2	7	9.31	86.02	2725.885	69.66	1.63	7
9	TBG 3-1/2", 10.2#, L-80,TPG2	8	9.33	95.35	2716.551	69.92	1.88	8
10	TBG 3-1/2", 10.2#, L-80,TPG2	9	9.34	104.69	2707.215	70.17	2.13	9
11	TBG 3-1/2", 10.2#, L-80,TPG2	10	9.27	113.96	2697.943	70.43	2.39	10
12	TBG 3-1/2", 10.2#, L-80,TPG2	11	9.29	123.25	2688.655	70.69	2.64	11
13	TBG 3-1/2", 10.2#, L-80,TPG2	12	9.34	132.58	2679.317	70.95	2.89	12
14	TBG 3-1/2", 10.2#, L-80,TPG2	13	9.34	141.92	2669.976	71.21	3.15	13
15	TBG 3-1/2", 10.2#, L-80,TPG2	14	9.34	151.27	2660.634	71.47	3.40	14
16	TBG 3-1/2", 10.2#, L-80,TPG2	15	9.31	160.58	2651.322	71.72	3.66	15
17	TBG 3-1/2", 10.2#, L-80,TPG2	16	9.34	169.92	2641.982	71.98	3.91	16
18	TBG 3-1/2", 10.2#, L-80,TPG2	17	9.34	179.26	2632.643	72.24	4.16	17
19	TBG 3-1/2", 10.2#, L-80,TPG2	18	9.28	188.53	2623.366	72.50	4.42	18
20	TBG 3-1/2", 10.2#, L-80,TPG2	19	9.29	197.83	2614.072	72.76	4.67	19
21	TBG 3-1/2", 10.2#, L-80,TPG2	20	9.28	207.10	2604.796	73.01	4.92	20
22	TBG 3-1/2", 10.2#, L-80,TPG2	21	9.28	216.39	2595.512	73.27	5.17	21
23	TBG 3-1/2", 10.2#, L-80,TPG2	22	9.29	225.68	2586.224	73.53	5.43	22
24	TBG 3-1/2", 10.2#, L-80,TPG2	23	9.27	234.95	2576.950	73.79	5.68	23
25	TBG 3-1/2", 10.2#, L-80,TPG2	24	9.29	244.24	2567.658	74.04	5.93	24
26	TBG 3-1/2", 10.2#, L-80,TPG2	25	9.29	253.53	2558.368	74.30	6.19	25
27	TBG 3-1/2", 10.2#, L-80,TPG2	26	9.29	262.82	2549.077	74.56	6.44	26
28	TBG 3-1/2", 10.2#, L-80,TPG2	27	9.29	272.11	2539.786	74.82	6.69	27
29	TBG 3-1/2", 10.2#, L-80,TPG2	28	9.30	281.41	2530.490	75.07	6.94	28
30	TBG 3-1/2", 10.2#, L-80,TPG2	29	9.27	290.68	2521.225	75.33	7.20	29
31	TBG 3-1/2", 10.2#, L-80,TPG2	30	9.28	299.96	2511.944	75.59	7.45	30
32	TBG 3-1/2", 10.2#, L-80,TPG2	31	9.27	309.22	2502.679	75.84	7.70	31
33	TBG 3-1/2", 10.2#, L-80,TPG2	32	9.27	318.49	2493.407	76.10	7.95	32
34	TBG 3-1/2", 10.2#, L-80,TPG2	33	9.03	327.53	2484.375	76.35	8.20	33
35	TBG 3-1/2", 10.2#, L-80,TPG2	34	9.29	336.81	2475.086	76.61	8.45	34
36	TBG 3-1/2", 10.2#, L-80,TPG2	35	9.26	346.08	2465.823	76.87	8.70	35
37	TBG 3-1/2", 10.2#, L-80,TPG2	36	9.29	355.36	2456.537	77.12	8.96	36
38	TBG 3-1/2", 10.2#, L-80,TPG2	37	9.32	364.68	2447.221	77.38	9.21	37
39	TBG 3-1/2", 10.2#, L-80,TPG2	38	9.33	374.01	2437.894	77.64	9.46	38
40	TBG 3-1/2", 10.2#, L-80,TPG2	39	9.33	383.34	2428.565	77.90	9.72	39
41	TBG 3-1/2", 10.2#, L-80,TPG2	40	9.33	392.66	2419.237	78.16	9.97	40
42	TBG 3-1/2", 10.2#, L-80,TPG2	41	9.32	401.98	2409.920	78.41	10.23	41
43	TBG 3-1/2", 10.2#, L-80,TPG2	42	9.32	411.30	2400.599	78.67	10.48	42
44	TBG 3-1/2", 10.2#, L-80,TPG2	43	9.28	420.58	2391.317	78.93	10.73	43
45	TBG 3-1/2", 10.2#, L-80,TPG2	44	9.28	429.87	2382.033	79.19	10.98	44
46	TBG 3-1/2", 10.2#, L-80,TPG2	45	9.27	439.14	2372.763	79.44	11.24	45
47	TBG 3-1/2", 10.2#, L-80,TPG2	46	9.28	448.41	2363.488	79.70	11.49	46
48	TBG 3-1/2", 10.2#, L-80,TPG2	47	9.32	457.73	2354.169	79.96	11.74	47
49	TBG 3-1/2", 10.2#, L-80,TPG2	48	9.28	467.01	2344.887	80.22	11.99	48
50	TBG 3-1/2", 10.2#, L-80,TPG2	49	9.28	476.30	2335.604	80.47	12.25	49
51	TBG 3-1/2", 10.2#, L-80,TPG2	50	9.27	485.56	2326.336	80.73	12.50	50
52	TBG 3-1/2", 10.2#, L-80,TPG2	51	9.31	494.88	2317.022	80.99	12.75	51
53	TBG 3-1/2", 10.2#, L-80,TPG2	52	9.32	504.20	2307.701	81.25	13.01	52
54	TBG 3-1/2", 10.2#, L-80,TPG2	53	9.32	513.52	2298.384	81.51	13.26	53
55	TBG 3-1/2", 10.2#, L-80,TPG2	54	9.32	522.83	2289.066	81.76	13.51	54
56	TBG 3-1/2", 10.2#, L-80,TPG2	55	9.32	532.16	2279.744	82.02	13.77	55
57	TBG 3-1/2", 10.2#, L-80,TPG2	56	9.28	541.43	2270.467	82.28	14.02	56

6	TBG 3-1/2", 10.2#, L-80,TPG2	5	9.34	67.37	2744.535	69.14	1.12	5
7	TBG 3-1/2", 10.2#, L-80,TPG3	6	9.34	76.70	2735.197	69.40	1.37	6
8	TBG 3-1/2", 10.2#, L-80,TPG2	7	9.31	86.02	2725.885	69.66	1.63	7
9	TBG 3-1/2", 10.2#, L-80,TPG2	8	9.33	95.35	2716.551	69.92	1.88	8
10	TBG 3-1/2", 10.2#, L-80,TPG2	9	9.34	104.69	2707.215	70.17	2.13	9
11	TBG 3-1/2", 10.2#, L-80,TPG2	10	9.27	113.96	2697.943	70.43	2.39	10
12	TBG 3-1/2", 10.2#, L-80,TPG2	11	9.29	123.25	2688.655	70.69	2.64	11
13	TBG 3-1/2", 10.2#, L-80,TPG2	12	9.34	132.58	2679.317	70.95	2.89	12
14	TBG 3-1/2", 10.2#, L-80,TPG2	13	9.34	141.92	2669.976	71.21	3.15	13
15	TBG 3-1/2", 10.2#, L-80,TPG2	14	9.34	151.27	2660.634	71.47	3.40	14
16	TBG 3-1/2", 10.2#, L-80,TPG2	15	9.31	160.58	2651.322	71.72	3.66	15
17	TBG 3-1/2", 10.2#, L-80,TPG2	16	9.34	169.92	2641.982	71.98	3.91	16
18	TBG 3-1/2", 10.2#, L-80,TPG2	17	9.34	179.26	2632.643	72.24	4.16	17
19	TBG 3-1/2", 10.2#, L-80,TPG2	18	9.28	188.53	2623.366	72.50	4.42	18
20	TBG 3-1/2", 10.2#, L-80,TPG2	19	9.29	197.83	2614.072	72.76	4.67	19
21	TBG 3-1/2", 10.2#, L-80,TPG2	20	9.28	207.10	2604.796	73.01	4.92	20
22	TBG 3-1/2", 10.2#, L-80,TPG2	21	9.28	216.39	2595.512	73.27	5.17	21
23	TBG 3-1/2", 10.2#, L-80,TPG2	22	9.29	225.68	2586.224	73.53	5.43	22
24	TBG 3-1/2", 10.2#, L-80,TPG2	23	9.27	234.95	2576.950	73.79	5.68	23
25	TBG 3-1/2", 10.2#, L-80,TPG2	24	9.29	244.24	2567.658	74.04	5.93	24
26	TBG 3-1/2", 10.2#, L-80,TPG2	25	9.29	253.53	2558.368	74.30	6.19	25
27	TBG 3-1/2", 10.2#, L-80,TPG2	26	9.29	262.82	2549.077	74.56	6.44	26
28	TBG 3-1/2", 10.2#, L-80,TPG2	27	9.29	272.11	2539.786	74.82	6.69	27
29	TBG 3-1/2", 10.2#, L-80,TPG2	28	9.30	281.41	2530.490	75.07	6.94	28
30	TBG 3-1/2", 10.2#, L-80,TPG2	29	9.27	290.68	2521.225	75.33	7.20	29
31	TBG 3-1/2", 10.2#, L-80,TPG2	30	9.28	299.96	2511.944	75.59	7.45	30
32	TBG 3-1/2", 10.2#, L-80,TPG2	31	9.27	309.22	2502.679	75.84	7.70	31
33	TBG 3-1/2", 10.2#, L-80,TPG2	32	9.27	318.49	2493.407	76.10	7.95	32
34	TBG 3-1/2", 10.2#, L-80,TPG2	33	9.03	327.53	2484.375	76.35	8.20	33
35	TBG 3-1/2", 10.2#, L-80,TPG2	34	9.29	336.81	2475.086	76.61	8.45	34
36	TBG 3-1/2", 10.2#, L-80,TPG2	35	9.26	346.08	2465.823	76.87	8.70	35
37	TBG 3-1/2", 10.2#, L-80,TPG2	36	9.29	355.36	2456.537	77.12	8.96	36
38	TBG 3-1/2", 10.2#, L-80,TPG2	37	9.32	364.68	2447.221	77.38	9.21	37
39	TBG 3-1/2", 10.2#, L-80,TPG2	38	9.33	374.01	2437.894	77.64	9.46	38
40	TBG 3-1/2", 10.2#, L-80,TPG2	39	9.33	383.34	2428.565	77.90	9.72	39
41	TBG 3-1/2", 10.2#, L-80,TPG2	40	9.33	392.66	2419.237	78.16	9.97	40
42	TBG 3-1/2", 10.2#, L-80,TPG2	41	9.32	401.98	2409.920	78.41	10.23	41
43	TBG 3-1/2", 10.2#, L-80,TPG2	42	9.32	411.30	2400.599	78.67	10.48	42
44	TBG 3-1/2", 10.2#, L-80,TPG2	43	9.28	420.58	2391.317	78.93	10.73	43
45	TBG 3-1/2", 10.2#, L-80,TPG2	44	9.28	429.87	2382.033	79.19	10.98	44
46	TBG 3-1/2", 10.2#, L-80,TPG2	45	9.27	439.14	2372.763	79.44	11.24	45
47	TBG 3-1/2", 10.2#, L-80,TPG2	46	9.28	448.41	2363.488	79.70	11.49	46
48	TBG 3-1/2", 10.2#, L-80,TPG2	47	9.32	457.73	2354.169	79.96	11.74	47
49	TBG 3-1/2", 10.2#, L-80,TPG2	48	9.28	467.01	2344.887	80.22	11.99	48
50	TBG 3-1/2", 10.2#, L-80,TPG2	49	9.28	476.30	2335.604	80.47	12.25	49
51	TBG 3-1/2", 10.2#, L-80,TPG2	50	9.27	485.56	2326.336	80.73	12.50	50
52	TBG 3-1/2", 10.2#, L-80,TPG2	51	9.31	494.88	2317.022	80.99	12.75	51
53	TBG 3-1/2", 10.2#, L-80,TPG2	52	9.32	504.20	2307.701	81.25	13.01	52
54	TBG 3-1/2", 10.2#, L-80,TPG2	53	9.32	513.52	2298.384	81.51	13.26	53
55	TBG 3-1/2", 10.2#, L-80,TPG2	54	9.32	522.83	2289.066	81.76	13.51	54
56	TBG 3-1/2", 10.2#, L-80,TPG2	55	9.32	532.16	2279.744	82.02	13.77	55
57	TBG 3-1/2", 10.2#, L-80,TPG2	56	9.28	541.43	2270.467	82.28	14.02	56

58	TBG 3-1/2", 10.2#, L-80,TPG2	57	9.29	550.72	2261.176	82.54	14.27	57
59	TBG 3-1/2", 10.2#, L-80,TPG2	58	9.19	559.92	2251.984	82.79	14.52	58
61	TBG 3-1/2", 10.2#, L-80,TPG2	59	9.29	569.20	2242.698	83.05	14.78	60
62	TBG 3-1/2", 10.2#, L-80,TPG2	60	9.20	578.40	2233.502	83.30	15.03	61
65	TBG 3-1/2", 10.2#, L-80,TPG2	61	9.29	587.69	2224.211	83.56	15.28	64
66	TBG 3-1/2", 10.2#, L-80,TPG2	62	9.29	596.98	2214.922	83.82	15.53	65
67	TBG 3-1/2", 10.2#, L-80,TPG2	63	9.19	606.17	2205.730	84.07	15.78	66
68	TBG 3-1/2", 10.2#, L-80,TPG2	64	9.27	615.44	2196.465	84.33	16.03	67
74	TBG 3-1/2", 10.2#, L-80,TPG2	65	9.29	624.73	2187.175	84.59	16.29	73
76	TBG 3-1/2", 10.2#, L-80,TPG2	66	9.28	634.01	2177.892	84.85	16.54	75
77	TBG 3-1/2", 10.2#, L-80,TPG2	67	9.29	643.29	2168.607	85.10	16.79	76
78	TBG 3-1/2", 10.2#, L-80,TPG2	68	9.31	652.60	2159.300	85.36	17.19	77
79	TBG 3-1/2", 10.2#, L-80,TPG2	69	9.32	661.92	2149.984	85.62	17.58	78
80	TBG 3-1/2", 10.2#, L-80,TPG2	70	9.34	671.25	2140.647	85.88	17.97	79
81	TBG 3-1/2", 10.2#, L-80,TPG2	71	9.31	680.56	2131.337	86.14	18.37	80
82	TBG 3-1/2", 10.2#, L-80,TPG2	72	9.32	689.88	2122.018	86.39	18.76	81
83	TBG 3-1/2", 10.2#, L-80,TPG2	73	9.29	699.17	2112.731	86.65	19.15	82
84	TBG 3-1/2", 10.2#, L-80,TPG2	74	9.34	708.51	2103.392	86.91	19.55	83
85	TBG 3-1/2", 10.2#, L-80,TPG2	75	9.31	717.82	2094.079	87.17	19.94	84
86	TBG 3-1/2", 10.2#, L-80,TPG2	76	9.31	727.13	2084.768	87.43	20.33	85
87	TBG 3-1/2", 10.2#, L-80,TPG2	77	9.29	736.42	2075.481	87.68	20.72	86
88	TBG 3-1/2", 10.2#, L-80,TPG2	78	9.34	745.76	2066.141	87.94	21.12	87
89	TBG 3-1/2", 10.2#, L-80,TPG2	79	9.29	755.05	2056.855	88.20	21.51	88
90	TBG 3-1/2", 10.2#, L-80,TPG2	80	9.31	764.35	2047.547	88.46	21.90	89
91	TBG 3-1/2", 10.2#, L-80,TPG2	81	9.31	773.66	2038.237	88.72	22.30	90
93	TBG 3-1/2", 10.2#, L-80,TPG2	82	9.31	782.98	2028.923	88.97	22.69	92
94	TBG 3-1/2", 10.2#, L-80,TPG2	83	9.29	792.27	2019.635	89.23	23.08	93
95	TBG 3-1/2", 10.2#, L-80,TPG2	84	9.19	801.46	2010.445	89.49	23.47	94
96	TBG 3-1/2", 10.2#, L-80,TPG2	85	9.28	810.74	2001.165	89.74	23.86	95
98	TBG 3-1/2", 10.2#, L-80,TPG2	86	9.32	820.06	1991.843	90.00	24.26	97
100	TBG 3-1/2", 10.2#, L-80,TPG2	87	9.31	829.37	1982.532	90.26	24.65	99
102	TBG 3-1/2", 10.2#, L-80,TPG2	88	9.29	838.66	1973.245	90.52	25.04	101
103	TBG 3-1/2", 10.2#, L-80,TPG2	89	9.34	847.99	1963.909	90.78	25.44	102
104	TBG 3-1/2", 10.2#, L-80,TPG2	90	9.29	857.28	1954.622	91.03	25.83	103
105	TBG 3-1/2", 10.2#, L-80,TPG2	91	9.27	866.55	1945.350	91.29	26.22	104
106	TBG 3-1/2", 10.2#, L-80,TPG2	92	9.26	875.81	1936.091	91.55	26.61	105
107	TBG 3-1/2", 10.2#, L-80,TPG2	93	9.27	885.08	1926.819	91.80	27.00	106
108	TBG 3-1/2", 10.2#, L-80,TPG2	94	9.29	894.37	1917.533	92.06	27.39	107
109	TBG 3-1/2", 10.2#, L-80,TPG2	95	9.26	903.63	1908.273	92.32	27.79	108
110	TBG 3-1/2", 10.2#, L-80,TPG2	96	9.34	912.96	1898.938	92.58	28.18	109
111	TBG 3-1/2", 10.2#, L-80,TPG2	97	9.29	922.25	1889.650	92.84	28.57	110
112	TBG 3-1/2", 10.2#, L-80,TPG2	98	9.27	931.52	1880.384	93.09	28.96	111
113	TBG 3-1/2", 10.2#, L-80,TPG2	99	9.34	940.86	1871.045	93.35	29.36	112
115	TBG 3-1/2", 10.2#, L-80,TPG2	100	9.30	950.15	1861.748	93.61	29.75	114
116	TBG 3-1/2", 10.2#, L-80,TPG2	101	9.30	959.45	1852.453	93.87	30.14	115
117	TBG 3-1/2", 10.2#, L-80,TPG2	102	9.29	968.74	1843.159	94.12	30.54	116
118	TBG 3-1/2", 10.2#, L-80,TPG2	103	9.28	978.02	1833.880	94.38	30.93	117
119	TBG 3-1/2", 10.2#, L-80,TPG2	104	9.28	987.30	1824.598	94.64	31.32	118

121	TBG 3-1/2", 10.2#, L-80,TPG2	105	9.28	996.58	1815.317	94.90	31.71	120
122	TBG 3-1/2", 10.2#, L-80,TPG2	106	9.28	1005.86	1806.039	95.15	32.10	121
123	TBG 3-1/2", 10.2#, L-80,TPG2	107	9.28	1015.15	1796.755	95.41	32.50	122
124	TBG 3-1/2", 10.2#, L-80,TPG2	108	9.29	1024.43	1787.468	95.67	32.89	123
125	TBG 3-1/2", 10.2#, L-80,TPG2	109	9.31	1033.74	1778.160	95.93	33.28	124
126	TBG 3-1/2", 10.2#, L-80,TPG2	110	9.27	1043.01	1768.892	96.18	33.67	125
127	TBG 3-1/2", 10.2#, L-80,TPG2	111	9.29	1052.30	1759.598	96.44	34.06	126
128	TBG 3-1/2", 10.2#, L-80,TPG2	112	9.28	1061.58	1750.320	96.70	34.46	127
129	TBG 3-1/2", 10.2#, L-80,TPG2	113	9.34	1070.92	1740.978	96.96	34.85	128
130	TBG 3-1/2", 10.2#, L-80,TPG2	114	9.20	1080.12	1731.777	97.21	35.24	129
131	TBG 3-1/2", 10.2#, L-80,TPG2	115	9.29	1089.41	1722.491	97.47	35.63	130
132	TBG 3-1/2", 10.2#, L-80,TPG2	116	9.26	1098.67	1713.233	97.73	36.02	131
133	TBG 3-1/2", 10.2#, L-80,TPG2	117	9.28	1107.95	1703.951	97.98	36.41	132
134	TBG 3-1/2", 10.2#, L-80,TPG2	118	9.27	1117.22	1694.681	98.24	36.81	133
135	TBG 3-1/2", 10.2#, L-80,TPG2	119	9.23	1126.45	1685.449	98.50	37.20	134
136	TBG 3-1/2", 10.2#, L-80,TPG2	120	9.29	1135.74	1676.161	98.75	37.59	135
137	TBG 3-1/2", 10.2#, L-80,TPG2	121	9.28	1145.02	1666.885	99.01	37.98	136
138	TBG 3-1/2", 10.2#, L-80,TPG2	122	9.28	1154.29	1657.609	99.27	38.37	137
139	TBG 3-1/2", 10.2#, L-80,TPG2	123	9.28	1163.58	1648.325	99.52	38.76	138
140	TBG 3-1/2", 10.2#, L-80,TPG2	124	9.29	1172.86	1639.040	99.78	39.16	139
142	TBG 3-1/2", 10.2#, L-80,TPG2	125	9.28	1182.14	1629.758	100.04	39.55	141
145	TBG 3-1/2", 10.2#, L-80,TPG2	126	9.21	1191.36	1620.544	100.29	39.94	126
146	TBG 3-1/2", 10.2#, L-80,TPG2	127	9.29	1200.64	1611.258	100.55	40.33	127
147	TBG 3-1/2", 10.2#, L-80,TPG2	128	9.27	1209.92	1601.985	100.81	40.72	128
148	TBG 3-1/2", 10.2#, L-80,TPG2	129	9.28	1219.20	1592.703	101.07	41.11	129
149	TBG 3-1/2", 10.2#, L-80,TPG2	130	9.28	1228.47	1583.426	101.32	41.50	130
150	TBG 3-1/2", 10.2#, L-80,TPG2	131	9.22	1237.69	1574.206	101.58	41.89	131
151	TBG 3-1/2", 10.2#, L-80,TPG2	132	9.27	1246.97	1564.935	101.84	42.29	132
152	TBG 3-1/2", 10.2#, L-80,TPG2	133	9.33	1256.29	1555.610	102.09	42.68	133
153	TBG 3-1/2", 10.2#, L-80,TPG2	134	9.34	1265.63	1546.266	102.35	43.07	134
154	TBG 3-1/2", 10.2#, L-80,TPG2	135	9.28	1274.91	1536.986	102.61	43.47	135
155	TBG 3-1/2", 10.2#, L-80,TPG2	136	9.34	1284.25	1527.650	102.87	43.86	136
156	TBG 3-1/2", 10.2#, L-80,TPG2	137	9.34	1293.59	1518.313	103.13	44.25	137
157	TBG 3-1/2", 10.2#, L-80,TPG2	138	9.28	1302.87	1509.033	103.38	44.65	138
158	TBG 3-1/2", 10.2#, L-80,TPG2	139	9.31	1312.18	1499.723	103.64	45.04	139
159	TBG 3-1/2", 10.2#, L-80,TPG2	140	9.06	1321.24	1490.664	103.89	45.42	140
160	TBG 3-1/2", 10.2#, L-80,TPG2	141	9.28	1330.51	1481.388	104.15	45.81	141
161	TBG 3-1/2", 10.2#, L-80,TPG2	142	9.33	1339.84	1472.063	104.41	46.21	142
162	TBG 3-1/2", 10.2#, L-80,TPG2	143	9.33	1349.17	1462.735	104.67	46.60	143
163	TBG 3-1/2", 10.2#, L-80,TPG2	144	9.28	1358.44	1453.459	104.93	46.99	144
164	TBG 3-1/2", 10.2#, L-80,TPG2	145	9.28	1367.72	1444.180	105.18	47.38	145
165	TBG 3-1/2", 10.2#, L-80,TPG2	146	9.34	1377.06	1434.843	105.44	47.78	146
166	TBG 3-1/2", 10.2#, L-80,TPG2	147	9.29	1386.34	1425.556	105.70	48.17	147
167	TBG 3-1/2", 10.2#, L-80,TPG2	148	9.02	1395.37	1416.532	105.95	48.55	148
168	TBG 3-1/2", 10.2#, L-80,TPG2	149	9.16	1404.53	1407.369	106.20	48.94	149
169	TBG 3-1/2", 10.2#, L-80,TPG2	150	9.28	1413.81	1398.086	106.46	49.33	150
170	TBG 3-1/2", 10.2#, L-80,TPG2	151	9.19	1423.00	1388.896	106.71	49.72	151
171	TBG 3-1/2", 10.2#, L-80,TPG2	152	9.21	1432.22	1379.685	106.97	50.11	152
172	TBG 3-1/2", 10.2#, L-80,TPG2	153	9.33	1441.54	1370.357	107.23	50.50	153
173	TBG 3-1/2", 10.2#, L-80,TPG2	154	9.27	1450.82	1361.084	107.49	50.89	154
174	TBG 3-1/2", 10.2#, L-80,TPG2	155	9.28	1460.09	1351.807	107.74	51.29	155

175	TBG 3-1/2", 10.2#, L-80,TPG2	156	9.28	1469.38	1342.524	108.00	51.68	156
176	TBG 3-1/2", 10.2#, L-80,TPG2	157	9.28	1478.65	1333.247	108.26	52.07	157
177	TBG 3-1/2", 10.2#, L-80,TPG2	158	9.28	1487.94	1323.965	108.51	52.46	158
178	TBG 3-1/2", 10.2#, L-80,TPG2	159	9.28	1497.22	1314.683	108.77	52.85	159
179	TBG 3-1/2", 10.2#, L-80,TPG2	160	9.28	1506.50	1305.405	109.03	53.25	160
180	TBG 3-1/2", 10.2#, L-80,TPG2	161	9.28	1515.77	1296.130	109.29	53.64	161
181	TBG 3-1/2", 10.2#, L-80,TPG2	162	9.28	1525.05	1286.846	109.54	54.03	162
182	TBG 3-1/2", 10.2#, L-80,TPG2	163	9.28	1534.33	1277.568	109.80	54.42	163
183	TBG 3-1/2", 10.2#, L-80,TPG2	164	9.27	1543.61	1268.294	110.06	54.81	164
184	TBG 3-1/2", 10.2#, L-80,TPG2	165	9.29	1552.89	1259.006	110.31	55.20	165
185	TBG 3-1/2", 10.2#, L-80,TPG2	166	9.28	1562.18	1249.722	110.57	55.60	166
186	TBG 3-1/2", 10.2#, L-80,TPG2	167	9.30	1571.47	1240.427	110.83	55.99	167
187	TBG 3-1/2", 10.2#, L-80,TPG2	168	9.29	1580.76	1231.142	111.09	56.38	168
188	TBG 3-1/2", 10.2#, L-80,TPG2	169	9.29	1590.05	1221.853	111.34	56.77	169
189	TBG 3-1/2", 10.2#, L-80,TPG2	170	9.29	1599.34	1212.565	111.60	57.17	170
190	TBG 3-1/2", 10.2#, L-80,TPG2	171	9.28	1608.61	1203.286	111.86	57.56	171
191	TBG 3-1/2", 10.2#, L-80,TPG2	172	9.28	1617.89	1194.011	112.12	57.95	172
192	TBG 3-1/2", 10.2#, L-80,TPG2	173	9.30	1627.19	1184.715	112.37	58.34	173
193	TBG 3-1/2", 10.2#, L-80,TPG2	174	9.28	1636.46	1175.437	112.63	58.73	174
194	TBG 3-1/2", 10.2#, L-80,TPG2	175	9.28	1645.74	1166.156	112.89	59.13	175
195	TBG 3-1/2", 10.2#, L-80,TPG2	176	9.29	1655.03	1156.869	113.15	59.52	176
196	TBG 3-1/2", 10.2#, L-80,TPG2	177	9.29	1664.32	1147.580	113.40	59.91	177
197	TBG 3-1/2", 10.2#, L-80,TPG2	178	9.29	1673.61	1138.291	113.66	60.30	178
198	TBG 3-1/2", 10.2#, L-80,TPG2	179	9.28	1682.89	1129.007	113.92	60.69	179
199	TBG 3-1/2", 10.2#, L-80,TPG2	180	9.29	1692.18	1119.718	114.18	61.09	180
200	TBG 3-1/2", 10.2#, L-80,TPG2	181	9.28	1701.46	1110.440	114.43	61.48	181
201	TBG 3-1/2", 10.2#, L-80,TPG2	182	9.29	1710.75	1101.146	114.69	61.87	182
202	TBG 3-1/2", 10.2#, L-80,TPG2	183	9.28	1720.04	1091.864	114.95	62.26	183
203	TBG 3-1/2", 10.2#, L-80,TPG2	184	9.28	1729.32	1082.582	115.21	62.65	184
205	TBG 3-1/2", 10.2#, L-80,TPG2	185	9.28	1738.60	1073.298	115.46	63.05	185
206	TBG 3-1/2", 10.2#, L-80,TPG2	186	9.28	1747.88	1064.016	115.72	63.44	186
207	TBG 3-1/2", 10.2#, L-80,TPG2	187	9.29	1757.17	1054.729	115.98	63.83	187
208	TBG 3-1/2", 10.2#, L-80,TPG2	188	9.29	1766.46	1045.443	116.23	64.22	188
209	TBG 3-1/2", 10.2#, L-80,TPG2	189	9.29	1775.75	1036.149	116.49	64.62	189
210	TBG 3-1/2", 10.2#, L-80,TPG2	190	9.28	1785.03	1026.873	116.75	65.01	190
211	TBG 3-1/2", 10.2#, L-80,TPG2	191	9.34	1794.37	1017.534	117.01	65.40	191
212	TBG 3-1/2", 10.2#, L-80,TPG2	192	9.28	1803.65	1008.250	117.27	65.79	192
213	TBG 3-1/2", 10.2#, L-80,TPG2	193	9.29	1812.94	998.965	117.52	66.19	193
214	TBG 3-1/2", 10.2#, L-80,TPG2	194	9.29	1822.22	989.679	117.78	66.58	194
215	TBG 3-1/2", 10.2#, L-80,TPG2	195	9.31	1831.53	980.367	118.04	66.97	195
216	TBG 3-1/2", 10.2#, L-80,TPG2	196	9.29	1840.82	971.078	118.30	67.36	196
217	TBG 3-1/2", 10.2#, L-80,TPG2	197	9.33	1850.15	961.748	118.55	67.76	197
218	TBG 3-1/2", 10.2#, L-80,TPG2	198	9.29	1859.44	952.460	118.81	68.15	198
219	TBG 3-1/2", 10.2#, L-80,TPG2	199	9.33	1868.77	943.131	119.07	68.54	199
220	TBG 3-1/2", 10.2#, L-80,TPG2	200	9.32	1878.09	933.814	119.33	68.94	200
221	TBG 3-1/2", 10.2#, L-80,TPG2	201	9.28	1887.37	924.531	119.59	69.33	201
222	TBG 3-1/2", 10.2#, L-80,TPG2	202	9.29	1896.66	915.245	119.84	69.72	202
223	TBG 3-1/2", 10.2#, L-80,TPG2	203	9.26	1905.91	905.986	120.10	70.11	203
224	TBG 3-1/2", 10.2#, L-80,TPG2	204	9.26	1915.18	896.723	120.36	70.50	204
225	TBG 3-1/2", 10.2#, L-80,TPG2	205	9.29	1924.46	887.436	120.61	70.90	205
226	TBG 3-1/2", 10.2#, L-80,TPG2	206	9.29	1933.75	878.150	120.87	71.29	206
227	TBG 3-1/2", 10.2#, L-80,TPG2	207	9.29	1943.04	868.861	121.13	71.68	207

229	TBG 3-1/2", 10.2#, L-80,TPG2	208	9.29	1952.33	859.569	121.39	72.07	208
230	TBG 3-1/2", 10.2#, L-80,TPG2	209	9.32	1961.65	850.248	121.64	72.47	209
231	TBG 3-1/2", 10.2#, L-80,TPG2	210	9.28	1970.93	840.969	121.90	72.86	210
232	TBG 3-1/2", 10.2#, L-80,TPG2	211	9.27	1980.20	831.696	122.16	73.25	211
233	TBG 3-1/2", 10.2#, L-80,TPG2	212	9.15	1989.36	822.543	122.41	73.64	212
234	TBG 3-1/2", 10.2#, L-80,TPG2	213	9.19	1998.55	813.349	122.67	74.02	213
235	TBG 3-1/2", 10.2#, L-80,TPG2	214	9.20	2007.75	804.149	122.92	74.41	214
236	TBG 3-1/2", 10.2#, L-80,TPG2	215	9.21	2016.96	794.941	123.18	74.80	215
237	TBG 3-1/2", 10.2#, L-80,TPG2	216	9.34	2026.30	785.598	123.44	75.20	216
238	TBG 3-1/2", 10.2#, L-80,TPG2	217	9.28	2035.58	776.319	123.69	75.59	217
239	TBG 3-1/2", 10.2#, L-80,TPG2	218	9.33	2044.91	766.994	123.95	75.98	218
240	TBG 3-1/2", 10.2#, L-80,TPG2	219	9.34	2054.25	757.654	124.21	76.38	219
241	TBG 3-1/2", 10.2#, L-80,TPG2	220	9.34	2063.58	748.316	124.47	76.77	220
242	TBG 3-1/2", 10.2#, L-80,TPG2	221	9.27	2072.85	739.048	124.73	77.16	221
243	TBG 3-1/2", 10.2#, L-80,TPG2	222	9.34	2082.19	729.707	124.99	77.56	222
244	TBG 3-1/2", 10.2#, L-80,TPG2	223	9.34	2091.53	720.370	125.24	77.95	223
245	TBG 3-1/2", 10.2#, L-80,TPG2	224	9.31	2100.84	711.062	125.50	78.34	224
246	TBG 3-1/2", 10.2#, L-80,TPG2	225	9.34	2110.18	701.724	125.76	78.74	225
247	TBG 3-1/2", 10.2#, L-80,TPG2	226	9.34	2119.51	692.388	126.02	79.13	226
248	TBG 3-1/2", 10.2#, L-80,TPG2	227	9.33	2128.84	683.062	126.28	79.53	227
249	TBG 3-1/2", 10.2#, L-80,TPG2	228	9.31	2138.15	673.753	126.54	79.92	228
250	TBG 3-1/2", 10.2#, L-80,TPG2	229	9.27	2147.41	664.486	126.79	80.31	229
251	TBG 3-1/2", 10.2#, L-80,TPG2	230	9.33	2156.74	655.161	127.05	80.70	230
252	TBG 3-1/2", 10.2#, L-80,TPG2	231	9.29	2166.03	645.875	127.31	81.10	231
253	TBG 3-1/2", 10.2#, L-80,TPG2	232	9.31	2175.33	636.566	127.57	81.49	232
267	TBG 3-1/2", 10.2#, L-80,TPG2	233	9.26	2184.60	627.304	127.82	81.88	233
268	TBG 3-1/2", 10.2#, L-80,TPG2	234	9.31	2193.91	617.992	128.08	82.27	234
269	TBG 3-1/2", 10.2#, L-80,TPG2	235	9.31	2203.22	608.683	128.34	82.67	235
270	TBG 3-1/2", 10.2#, L-80,TPG2	236	9.34	2212.55	599.347	128.60	83.06	236
271	TBG 3-1/2", 10.2#, L-80,TPG2	237	9.31	2221.86	590.038	128.86	83.45	237
272	TBG 3-1/2", 10.2#, L-80,TPG2	238	9.31	2231.17	580.729	129.12	83.85	238
273	TBG 3-1/2", 10.2#, L-80,TPG2	239	9.31	2240.48	571.419	129.37	84.24	239
274	TBG 3-1/2", 10.2#, L-80,TPG2	240	9.28	2249.76	562.137	129.63	84.63	240
275	TBG 3-1/2", 10.2#, L-80,TPG2	241	9.31	2259.07	552.829	129.89	85.03	241
276	TBG 3-1/2", 10.2#, L-80,TPG2	242	9.31	2268.39	543.515	130.15	85.42	242
277	TBG 3-1/2", 10.2#, L-80,TPG2	243	9.31	2277.70	534.205	130.40	85.81	243
278	TBG 3-1/2", 10.2#, L-80,TPG2	244	9.31	2287.00	524.899	130.66	86.21	244
279	TBG 3-1/2", 10.2#, L-80,TPG2	245	9.31	2296.31	515.587	130.92	86.60	245
280	TBG 3-1/2", 10.2#, L-80,TPG2	246	9.33	2305.64	506.262	131.18	86.99	246
281	TBG 3-1/2", 10.2#, L-80,TPG2	247	9.33	2314.97	496.934	131.44	87.39	247
282	TBG 3-1/2", 10.2#, L-80,TPG2	248	9.31	2324.27	487.626	131.70	87.78	248
283	TBG 3-1/2", 10.2#, L-80,TPG2	249	9.34	2333.61	478.289	131.95	88.17	249
284	TBG 3-1/2", 10.2#, L-80,TPG2	250	9.28	2342.89	469.006	132.21	88.57	250
286	TBG 3-1/2", 10.2#, L-80,TPG2	251	9.28	2352.18	459.722	132.47	88.96	251
287	TBG 3-1/2", 10.2#, L-80,TPG2	252	9.33	2361.50	450.396	132.73	89.35	252
289	TBG 3-1/2", 10.2#, L-80,TPG2	253	9.29	2370.79	441.110	132.98	89.74	253

291	TBG 3-1/2", 10.2#, L-80,TPG2	254	9.31	2380.10	431.803	133.24	90.14	254	
292	TBG 3-1/2", 10.2#, L-80,TPG2	255	9.29	2389.38	422.517	133.50	90.53	255	
293	TBG 3-1/2", 10.2#, L-80,TPG2	256	9.29	2398.67	413.232	133.76	90.92	256	
294	TBG 3-1/2", 10.2#, L-80,TPG2	257	9.28	2407.95	403.949	134.01	91.31	257	
295	TBG 3-1/2", 10.2#, L-80,TPG2	258	9.31	2417.26	394.638	134.27	91.71	258	
296	TBG 3-1/2", 10.2#, L-80,TPG2	259	9.32	2426.58	385.316	134.53	92.10	259	
298	TBG 3-1/2", 10.2#, L-80,TPG2	260	9.27	2435.85	376.051	134.79	92.49	260	
299	TBG 3-1/2", 10.2#, L-80,TPG2	261	9.26	2445.11	366.792	135.04	92.88	261	
300	TBG 3-1/2", 10.2#, L-80,TPG2	262	9.27	2454.38	357.522	135.30	93.27	262	
301	TBG 3-1/2", 10.2#, L-80,TPG2	263	9.26	2463.64	348.258	135.56	93.67	263	
302	TBG 3-1/2", 10.2#, L-80,TPG2	264	9.32	2472.96	338.940	135.82	94.06	264	
303	TBG 3-1/2", 10.2#, L-80,TPG2	265	9.32	2482.28	329.623	136.08	94.45	265	
304	TBG 3-1/2", 10.2#, L-80,TPG2	266	9.32	2491.60	320.304	136.08	94.45	266	
305	TBG 3-1/2", 10.2#, L-80,TPG2	267	9.26	2500.86	311.042	136.08	94.45	267	
306	TBG 3-1/2", 10.2#, L-80,TPG2	268	9.29	2510.14	301.756	136.08	94.45	268	
307	TBG 3-1/2", 10.2#, L-80,TPG2	269	9.28	2519.43	292.475	136.08	94.45	269	
308	TBG 3-1/2", 10.2#, L-80,TPG2	270	9.28	2528.70	283.199	136.08	94.45	270	
309	TBG 3-1/2", 10.2#, L-80,TPG2	271	9.28	2537.98	273.922	136.08	94.45	271	
310	TBG 3-1/2", 10.2#, L-80,TPG2	272	9.28	2547.26	264.644	136.08	94.45	272	
311	TBG 3-1/2", 10.2#, L-80,TPG2	273	9.32	2556.58	255.322	136.08	94.45	273	
312	TBG 3-1/2", 10.2#, L-80,TPG2	274	9.33	2565.90	245.996	136.08	94.45	274	
313	TBG 3-1/2", 10.2#, L-80,TPG2	275	9.26	2575.17	236.733	136.08	94.45	275	
314	TBG 3-1/2", 10.2#, L-80,TPG2	276	9.28	2584.45	227.455	136.08	94.45	276	
315	TBG 3-1/2", 10.2#, L-80,TPG2	277	9.33	2593.77	218.130	136.08	94.45	277	
316	TBG 3-1/2", 10.2#, L-80,TPG2	278	9.19	2602.96	208.937	136.08	94.45	278	
317	TBG 3-1/2", 10.2#, L-80,TPG2	279	9.27	2612.23	199.668	136.08	94.45	279	
318	TBG 3-1/2", 10.2#, L-80,TPG2	280	9.29	2621.52	190.383	136.08	94.45	280	
319	TBG 3-1/2", 10.2#, L-80,TPG2	281	9.29	2630.80	181.096	136.08	94.45	281	
320	TBG 3-1/2", 10.2#, L-80,TPG2	282	9.29	2640.09	171.811	136.08	94.45	282	
321	TBG 3-1/2", 10.2#, L-80,TPG2	283	9.32	2649.41	162.488	136.08	94.45	283	
322	TBG 3-1/2", 10.2#, L-80,TPG2	284	9.29	2658.70	153.202	136.08	94.45	284	
323	TBG 3-1/2", 10.2#, L-80,TPG2	285	9.26	2667.96	143.945	136.08	94.45	285	
324	TBG 3-1/2", 10.2#, L-80,TPG2	286	9.26	2677.22	134.684	136.08	94.45	286	
325	TBG 3-1/2", 10.2#, L-80,TPG2	287	9.29	2686.50	125.396	136.08	94.45	287	
326	TBG 3-1/2", 10.2#, L-80,TPG2	288	9.29	2695.79	116.111	136.08	94.45	288	
327	TBG 3-1/2", 10.2#, L-80,TPG2	289	9.33	2705.12	106.783	136.08	94.45	289	
328	TBG 3-1/2", 10.2#, L-80,TPG2	290	9.16	2714.27	97.628	136.08	94.45	290	
329	TBG 3-1/2", 10.2#, L-80,TPG2	291	9.28	2723.56	88.345	136.08	94.45	291	
X-over 4-1/2"TPG2, 18.9# BOX * 3-1/2"TPG2 , 10.2# PIN,	X-over 4-1/2"TPG2, 18.9# BOX * 3-1/2"TPG2 , 10.2# PIN,	0	0.83	2724.39	87.515	136.08	94.45	0	
351	TBG 4-1/2", 18.9#, L-80,TPG2	293	9.05	2733.43	78.467	136.08	94.45	293	
352	TBG 4-1/2", 18.9#, L-80,TPG2	293	9.34	2742.78	69.125	136.08	94.45	293	
Pup Jt 4 1/2",TPG2 ,18.9#, L-80, Type-1	Pup Jt 4 1/2",TPG2 ,18.9#, L-80, Type-1		1.91	2744.68	67.217	136.08	94.45		
4-1/2" Flow Coupling, 18.9#, 13Cr-110, TPG2,			1.72	2746.40	65.497	136.08	94.45		
4 1/2" Tubing Retrievable Saftey Valve, 18.9#TP-G2 , SUPER 13CR-110KSI, 10K WP With AF Profile, Flapper TypePUP			2.01	2748.41	63.487	136.08	94.45		
4-1/2" Flow Coupling,18.9#, 13Cr-110, TPG2			1.72	2750.13	61.767	136.08	94.45		
Pup Jt 4 1/2",TPG2 ,18.9#, L-80, Type-1			1.91	2752.04	59.857	136.08	94.45		Protector
355	TBG 4-1/2", 18.9#, L-80,TPG2	294	9.09	2761.13	50.766	136.54	94.84	294	Protector

357	TBG 4-1/2", 18.9#, L-80,TPG2	295	9.22	2770.35	41.547	137.02	95.23	295	Protector
358	TBG 4-1/2", 18.9#, L-80,TPG2	296	8.95	2779.30	32.602	137.47	95.60	296	Protector
359	TBG 4-1/2", 18.9#, L-80,TPG2	297	9.29	2788.59	23.313	137.95	96.00	297	
360	TBG 4-1/2", 18.9#, L-80,TPG2	298	9.35	2797.94	13.959	138.43	96.39	298	
X.O.S 4-1/2", 18.9#, L-80, TYPE-1, HSM3 Box up * TPG-2 Pin Down	X.O.S	0	0.94	2798.88	13.017	138.48	96.39	0	
4-1/2" Fluted swage adapter D/P, 18.9# TPCQ-EX Pin on top X HSM3 Pin , 9Cr1MO, Chengdu Rock Petroleum Co	Fluted Swage	0	1.12	2800.01	11.895	138.49	96.44	0	
Pup Jt 4 1/2",TPCQ , Box Down,18.9#, L-80	Pup Jt 4 1/2",TPCQ , Box Down,18.9#, L-8(	0	1.32	2801.33	10.573	138.55	96.45	0	
TBG HANGER MSP/Drilex, 10K, 11" X 4 1/2" ACME Box up X 4 1/2" TPCQ-EX Box Down L-80 18.9#, M/C: FF-0.5 T/C: UPSL: 3G PR: 2, 4" Type "H" Two Way (Min Bore: 3.68")	TBG HGR	0	0.47	2801.80	10.101	138.51	96.46	0	
TBG Hanger Running Tool	TBG Hanger Running Tool	0	0.22	2802.02	9.879	138.53	96.47	0	
L/Joint	L/Joint	0	11.22	2813.24	-1.343	139.10	96.94	0	

Figure 8-14: AZNS-127 Completion Tally

8.6 Completion String Pressure Test

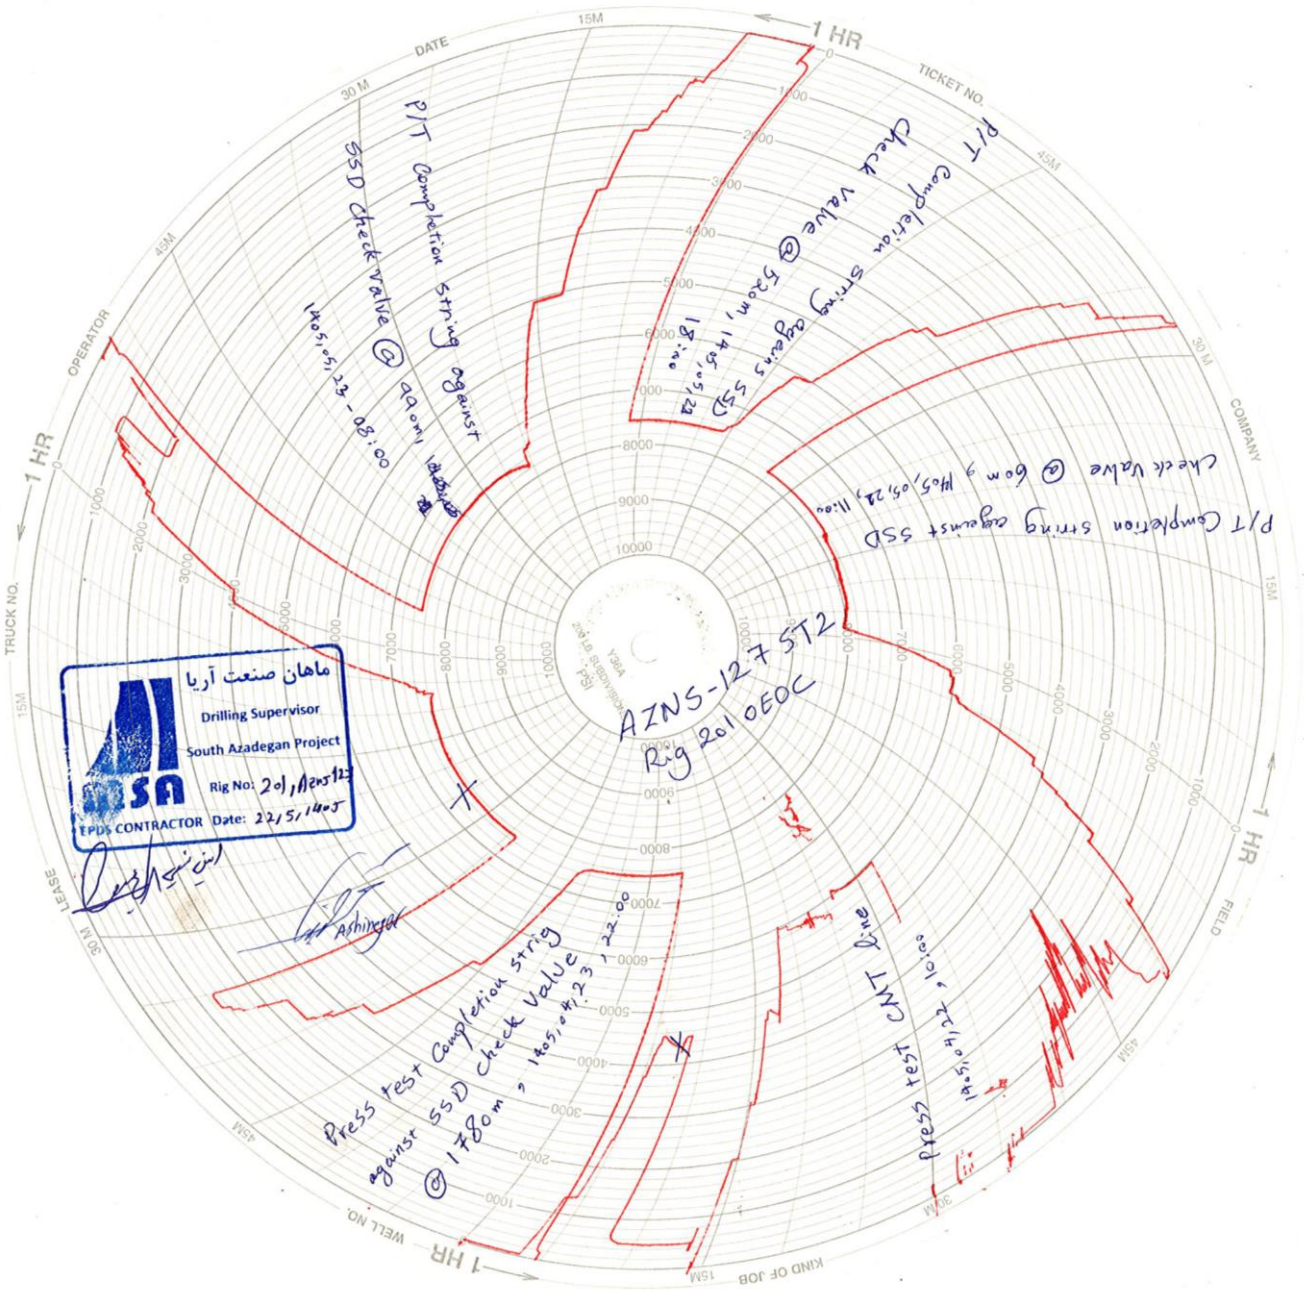


Figure 15: Completion String Pressure Test

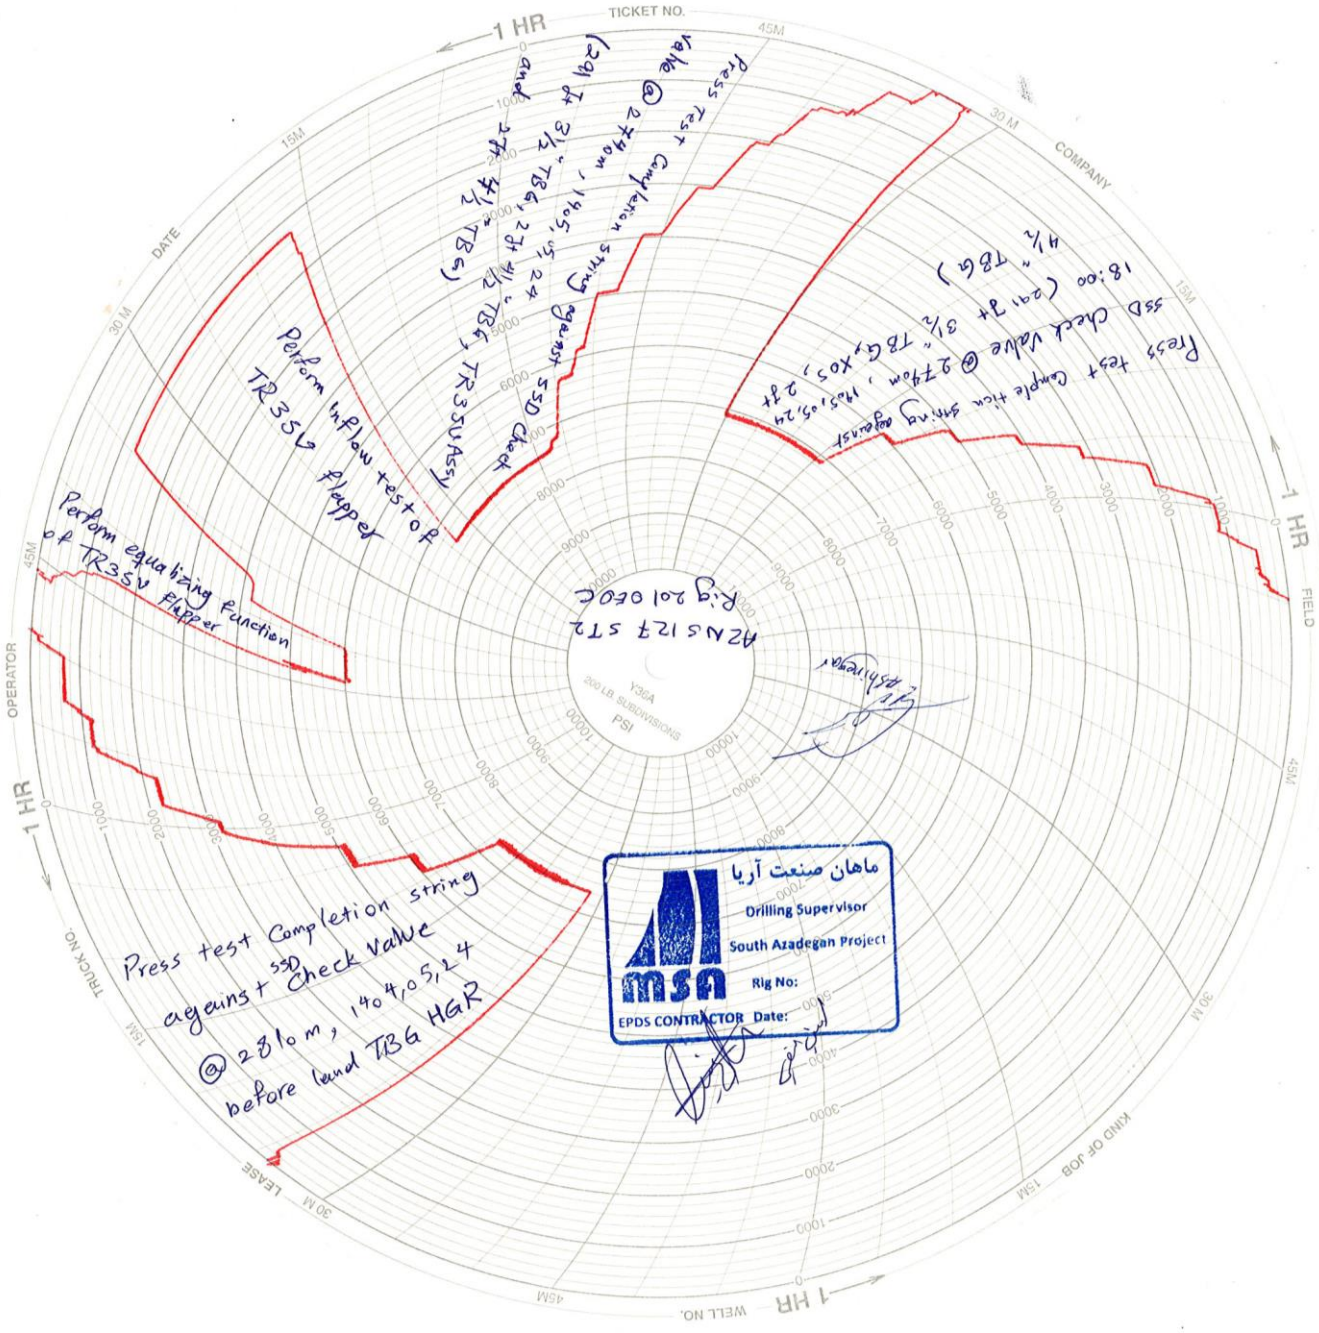


Figure 16: Pressure Test String & 3SV

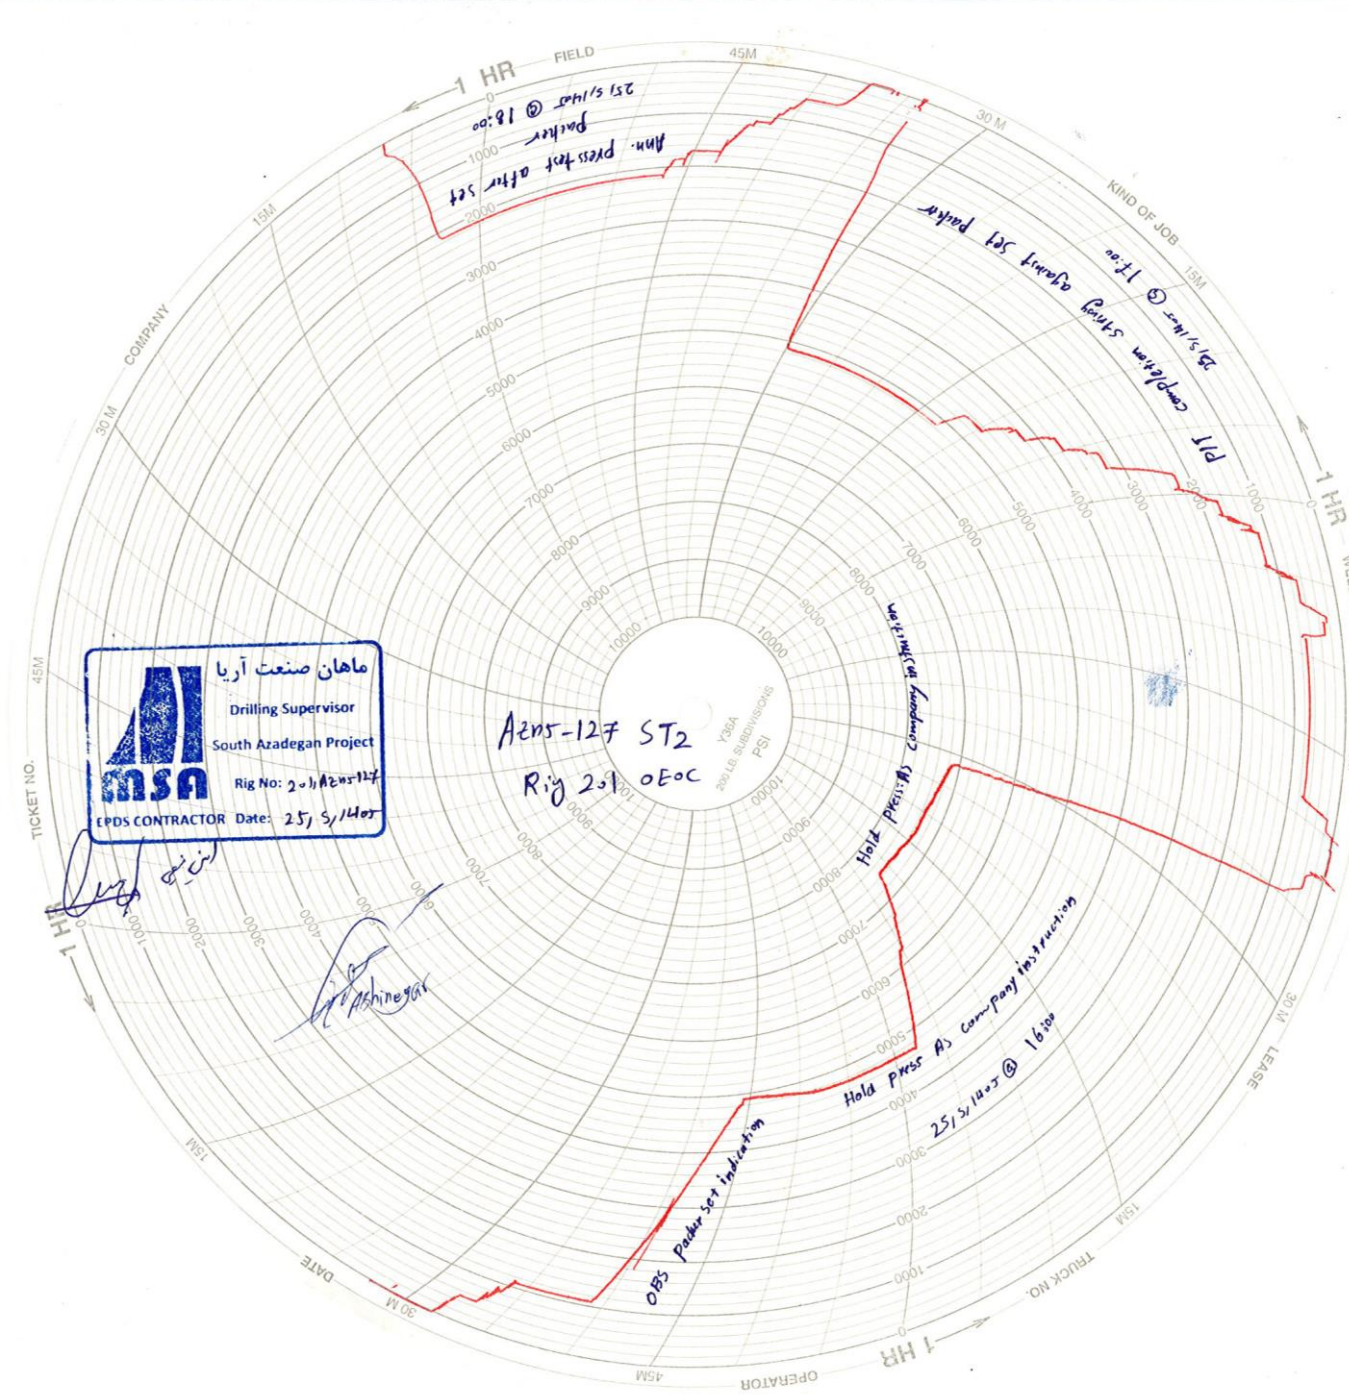


Figure 17: Packer Set & Final Pressure Test of String

9. Wellhead Report

9.1 Final Well Status

Well Head

Item	Specification (size, pressure rating, M/C)	Test Pressure	Test Duratic
C.H.H	20-3/4'' 3K, DD-0.5 PSL1, PR1	Already Installed	
C.H.S	20-3/4'' 3K * 13-5/8'' 5K , DD-0.5, PSL1, PR1	Already Installed	
T.H.S.	13-5/8'' 5K * 11''-10K, FF-0.5, PSL3, PR2	Already Installed	
X-MASS TREE(BTM)	4-1/16''-10K, FF-0.5, PSL3G, PR2	8000 psi	15 MIN

Wellbore Completion Fluids

Well bore	Fluid Type	Weight (pcf)
Cased Hole	$CaBr_2$	104

Well Head Pressure Record

Annulus	Pressure (psi)	Date / Time
Wellhead	0	1405.05.26
Tubing- 9 5/8"	0	1405.05.26
9 5/8" – 13 3/8"	0	1405.05.26
13 3/8" – 20"	0	1405.05.26

Barriers

Barrier Type	Depth	Pressure Test	Date Tested
Close TRSSSV	63.487m	500psi (inflow test after finish flow the well)	1405.04.24

Temporary Installed Equipment:

Table 9-1: AZNS-127 Final Well Status

9.2 Wellhead & X-mass tree Specification

Well Type	Specification
Well Head 10,000 Psi for Fahliyan Wells	**TUBING HEAD ADAPTOR** BOTTOM STUDDED FLANGE 11", 10000 PSI, BX158 TOP STUDDED FLANGE 4-1/16" 10000 PSI BX155 FULL BORE PREPARED WITH TWO S-SEAL AND ONE METAL TO METAL SEAL TO PACK TOP NECK OF TUBING HANGER C/W RELATED TEST AND INJECTION PORTS PREPARTION. C/W TWO CONTINUOUS FEED THROUGH TYPE 1/4" NPT CONTROL LINE EXITS PREPARTION (ONE FOR 1/4" TRSSSV CL AND ONE FOR 1/4" DOWNHOLE PRESSURE GAUGE) AND TWO 3/8" NPT CONTINUOUS FEED THROUGH TYPE LINE PORTS FOR CHEMCIAL INJECTION LINE EXIT INCLUDING RELATED SWAGE LOCK FITTINGS C/WITH ONE 4-1/16", 10K WP FULL BORE MANUAL GATE VALVE FORGED BODY AND BONNET, ALLOY STAINLESS STEEL 410SS GATE & SEAT AISI 410 COATED WITH TUNGSTEN CARBIDE USING HVOF METHOD STEM: INCONEL 718 WITH BACK SEAT CAPABILITY, NON RISING STEM METAL TO METAL SEAL BETWEEN SEAT AND GATE C/W HAND WHEEL FORGED BODY ALLOY STEEL AISI 410 MAXIMUM HEIGHT: 800MM M/C: FF-0.5 T/C: U PSL:3G PR:2 CROSS T-TYPE SOLID BLOCK CROSS T-TYPE SOLID BLOCK, BOTTOM FLANGED 4-1/16" API 10000 PSI WP TOP FLANGED STUDDED 4-1/16" API 10000 PSI WP FOR TREE CAP WITH TWO STUDDED SIDE OUTLETS 4-1/16" 10000PSI WP ELEVATED AT 900 DEG AND TWO 4-1/16", 10000 PSI MANUAL GATE VALVE AT THE TOP AND BOTTOM AND ONE 4-1/16", 10000 PSI WP SAFETY VALVE EQUIPPED WITH HYDRAULIC WIRE CUT ACTUATOR AS UPPER MASTER VALVE MATERIAL OF BODY, BONNET: AISI 410 SEAT, GATE: AISI 410SS HARD FACED WITH TUNGSTEN CARBIDE UASING HVOP METHOD MATERIAL OF STEM: INCONEL 718 M/C: FF-0.5 T/C: U PSL:3G PR:2G. MANUAL GATE VALVE API 4-1/16" 10000 PSI WP. FLANGED ENDS AND FULL BORE METAL TO METAL SEAL BETWEEN BODY/SEAT/GATE WITH BACK SEAT CAPABILITY, NON RISING STEM C/W HANDWHEELS MATERIAL OF BODY, BONNET, SEAT, GATE: AISI 410SS MATERIAL OF STEM: INCONEL 718 GATE&SEAT HARD FACED WITH TUNGSTEN CARBIDE BY HOVF METHOD M/C: FF-0.5 T/C: U PSL:3G PR:2 X-MAS TREE CAP 4-1/16" API 10000 PSI WP, FLANGED BOTTOM (4-1/16", BORE) 8-3/8"-4ACME-2G THREAD TOP, BLANKING PLUG TAPPED WITH 1/2" NPT THREAD, FORGED BODY, MATERIAL: STAINLESS STEEL 410 M/C:FF-0.5 T/C:U PSL:3G PR:2

Table 9-2: AZNS-127 Equipment Specification

9.3 Wellhead Schematic



Figure 9-1: AZNS-127 Wellhead Sketch

9.4 X-mass Tree Specification (Section D)

Item	Equipment	M/C	T/C	PSL	Qty
1	BTM Master Valve 11” * 4 1/16” 10K	FF-0.5	U	3G	1
2	TOP Master Valve 4 1/16” 10K	FF-0.5	U	3G	1
3	Surface Safety Valve 4 1/16” 10K	FF-0.5	U	3G	1
4	Deeping Valve 4 1/16” 10K	FF-0.5	U	3G	1
5	Wing gate valve-1 (Kill Valve) 4 1/16" 10K	FF-0.5	U	3G	1
6	Wing gate valve-2 (production valve) 10K	FF-0.5	U	3G	1
7	41/16" Choke valve 4 1/16" 10K	FF-0.5	U	3G	1
8	Christ Mas Tree	FF-0.5	U	3G	1

Table 9-3: AZNS-127 Section "D" Specification

9.5 X-mass Tree Pressure Test Report (Section D – befor install)

Item	Test	Check Mark and Result
1	Pressure test for the kill Valve W/ 1000 & 8000 Psi / 15 min	OK
2	Pressure test for the SSV W/ 1000 & 8000 Psi / 15 min	OK
3	Pressure test for the top master valve W/ 1000 & 8000 Psi / 15 min	OK
4	Pressure test for Swab valve W/ 1000 & 8000 Psi / 15 min	OK
5	Pressure test for the Production valve W/ 1000 & 8000 Psi / 15 min	OK

Table 9-4: AZNS-127 Section "D" Test Report Befor Installation

9.6 X-mass Tree Pressure Test Report (Section D – after install)

Item	Test	Check mark and Result
1	Pressure test X-MAS TREE solid block and bottom section W/1000 &8000 psi for 15min	OK
2	Pressure test for the SSV Exit block W/ 8000 Psi / 15 min	OK
3	Pressure test neck of tubing hanger metal seal	OK

	W/1000 &8000 psi for 15min	
4	Pressure test for Swab valve W/ 4500 Psi / 15 min	-
5	Pressure test for Production valve W/4500 Psi / 15 min	-
6	Pressure test cavity of F.S. seal and Ring Gasket W 8000 Psi / 15 min	OK
7	Pressure test CIV line to 2000psi	OK

Table 9-5: AZNS-127 Section "D" Test Report After Installation

9.7 Wellhead Related Test Reports

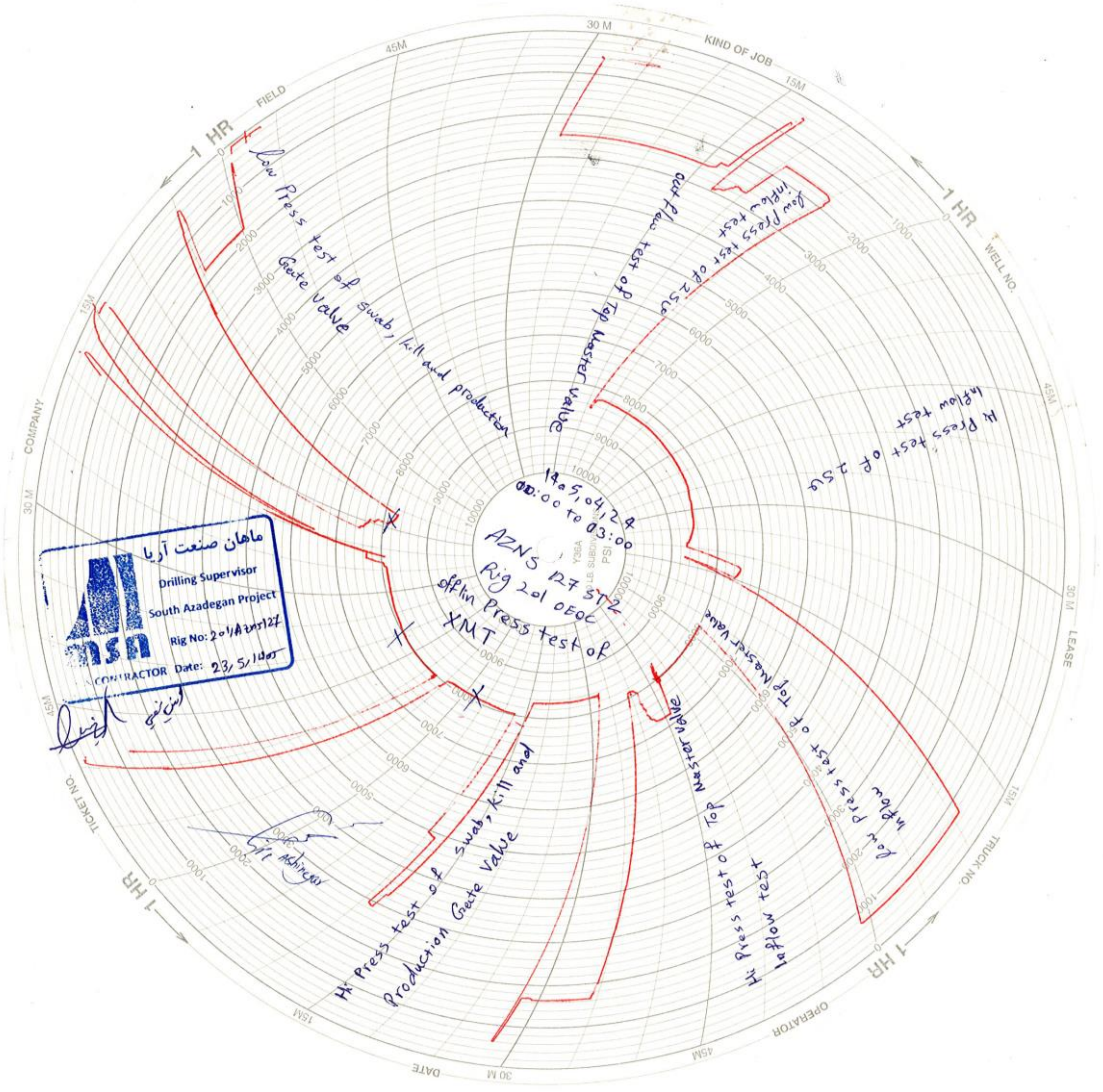


Figure 9-2: AZNS-127 X-Mass Tree Body Pressure Test Graph Before Installation

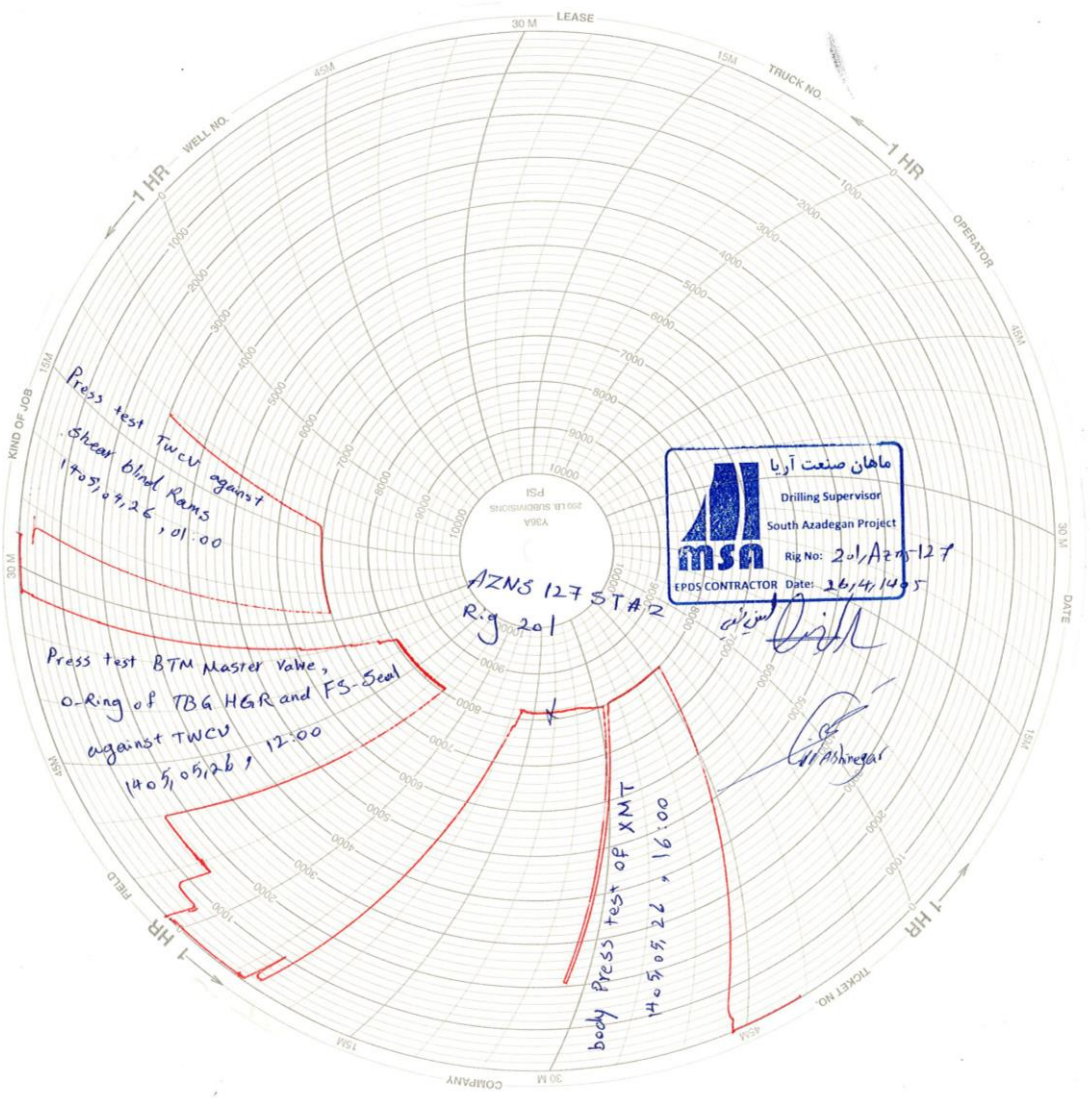


Figure 9-3: AZNS-127 X-Mass Tree Body Pressure Test Graph After Installation

تاریخ: 1405/04/24
پیوست: دارد

بسمه تعالی

موضوع: صورتجلسه تست سطحی تاج چاه 127 آزادگان جنوبی، قبل از نصب در دکل 201 عملیات اکتشاف نفت

بدینوسیله در مورخه تست‌های سطحی تاج چاه X-Mass Tree Solid Block "T" Type 4 – 1/16" 10k, MSP DRILEX مرتبط به چاه شماره 127 آزادگان جنوبی با حضور نماینده محترم کارفرما (پتروپارس) در محل دستگاه 201 عملیات اکتشاف نفت، قبل از نصب بر روی تاج چاه به شرح ذیل انجام پذیرفت:

- Body Pressure Test of X – Mass Tree Solid Block w/ 1000^{psi}, 5min & 8000^{psi}, 15min "OK" S/N: CT2502N160009A/0
- Inflow Pressure Test of 4 – 1/16" Production (WING) Valve w/ 1000^{psi}, 5min & 8000^{psi}, 15min "OK". S/N: 002934AN180050
- Inflow Pressure Test of 4 – 1/16" Dipping (SWAB) Valve w/ 1000^{psi}, 5min & 8000^{psi}, 15min "OK". S/N: 008929FN160009
- Inflow Pressure Test of 4 – 1/16" Kill Valve w/ 1000^{psi}, 5min & 8000^{psi}, 15min "OK" S/N: 002934AN180046
- Inflow Pressure Test of 4 – 1/16" Surface Safety Valve w/ 1000^{psi}, 5min & 8000^{psi}, 15min "OK". S/N: 0269167N160009
- Inflow & Out Flow Pressure Test of 4 – 1/16" Top Master Valve w/ 1000^{psi}, 5min & 8000^{psi}, 15min "OK". S/N: 008929DN160009
- Pressure Test of 2SV Actuator w/ 1500^{psi}, 15min "OK". S/N: 096041N160009

– گراف مربوط به تست فشار پیوست صورتجلسه گردید.

نماینده محترم تکمیل چاه کارفرما
شرکت مشاوران انرژی تهران

ناظر عملیات حفاری
شرکت ماهان صنعت آریا
ماهان صنعت آریا
Drilling Supervisor
South Azadegan Project
Rig No: 201/Azn-127
EPDS CONTRACTOR Date: 24/4/1405

Figure 9-4: AZNS-127 Wellhead MOM Befor Installation

تاریخ: 1405/04/26

پیوست: دارد

بسمه تعالی

موضوع: صورتجلسه تست‌های پس از نصب تاج و ولهد چاه 127 آزادگان جنوبی بعد از نصب در دکل 201 عملیات اکتشاف نفت

بدینوسیله در مورخه 1405/04/26 تست‌های تاج چاه X-Mass Tree Solid Block "T" Type 4 – 1/16" 10k, MSP و ولهد چاه شماره 127 آزادگان جنوبی با حضور نماینده محترم تکمیل چاه کارفرما و نماینده عملیات حفاری ماهان صنعت آریا در محل دستگاه حفاری 201 عملیات اکتشاف نفت بعد از نصب بر روی چاه به شرح ذیل انجام پذیرفت:

DRILEX

- Body Pressure Test of X – Mass Tree Solid Block w/ 10k 11" * 4 – 1/16" 10k Tubing Head Adaptor (BTM MASTER VALVE) 10k MSP/DRILEX w/ 8000^{psi} for 15min, "OK". S/N: 008929CN160008
- Pressure Test TBG HGR Metal Seal to 1000^{psi} for 5min, 8000^{psi} for 15min, "OK".
- Pressure Test F–Seal & Ring Gasket between T.H.S & Tubing Head Adaptor (BTM MASTER VALVE) to 8000^{psi} for 15min, "OK".
- Pressure Test Neck of TBG HGR F-Seal to 8000^{psi} for 15min, "OK".
- Pressure Test 1/4" Control Line (CL) to 8000^{psi} for 15min, "OK".

– فشار تمامی دالیزها بررسی گردید که فشار آنها صفر بود.
– خروجی کنترل لاین شیر ایمنی درون چاهی در جهت شیر اصلی پایینی می‌باشد
– گراف مربوط به تست فشار پیوست صورتجلسه گردید.

نماینده محترم تکمیل چاه کارفرما

شرکت مشاوران انرژی تهران

ناظر عملیات حفاری

شرکت ماهان صنعت آریا

ماهان صنعت آریا
Drilling Supervisor
South Azadegan Project
Rig No: 201/Azn/127
EPDS CONTRACTOR Date:

Figure 9-5: AZNS-127 Wellhead MOM After Installation

10. Drilling Fluid Information

10.1 Summary

Hole size (in)	Casing size (in)	CSG Depth (m MD)	Drilling Fluid system	Mud Properties
26”	20’’	146 M	Already has been drilled.	
17 ½”	13 3/8”	1441 M	Already has been drilled.	
12 ¼”	9 5/8”	3909 M	Already has been drilled.	
8 ½’’	7” Liner	3777 M To 4226 M	Already has been drilled.	
8 1/2” Side-Track	7” Liner	128.4 M To 3890 M	KCL Poly Mud	MW: 85 – 87 PCF
6 1/8” Side-Track	5” Liner	3763.5 M To 4150 M	KCL Poly Mud	MW: 100 – 104 PCF

Table 10-1: AZNS-127 Summary of Fluid

10.2 Interval Remark

WorkOver Section

Spud the rig 29-Dec-2025 on AZN-127. P/UP & M/UP coil TBG EQ. RIH with 1 1/16" CT to 3809 m, Displace the well with 106 PCF S/Poly Mud, while POOH to 3000 M & increased MW to 110 PCF and then POOH to surface, cont. kill the well using W&W method, confirm stable return & gradually replace with 112 PCF.
R/UP Slick line EQ and RIH to 3294 M (top SSD) to set in No-Go, tool string is stuck in 3294 M, Work On stuck & make tool string free, RIH to 3303 M, POOH to surface.
RIH with slick line & ret. Protection sleeve & set TWCV and pressure test "NO SUCC", POOH to surface and RIH with protection sleeve & set in positon.
RIH with 2.75 check valve tool string to 3226 m, OBS, slick line cable tension drop, try to pass same depth with "NO SUCC", POOH to surface.
RIH with slick line & ret. Protection sleeve then set TWCV and pressure test, "OK". Try to unlatch comp. String several times with "No SUCC".
Ret. TWCV & Set protection sleeve. RIH with slick line tool & try to pass 3099 m, with NO SUCC, POOH to surface. RIH with CT BHA to 3324 M (No-Go Depth) and POOH to surface. RIH with 2.75 check valve to 1547 m and try to pass with No SUCC, POOH to surface. RIH with 2 1/8" CT BHA to 3324 m several times and POOH to surface.
RIH with slick line + 2.75 "check valve to 3089 m, try to pass with No SUCC, POOH to surface (try to pass same depth & unlatch comp. string several times with NO SUCC). R/UP CSG EQ and POOH with completion string to surface (totally 167 jts).
RIH with 5 5/8" O. Shot to catch the fish & try to catch fish, POOH to surface, OBS, 14 m of fish recovered. RIH with 6" milling BHA 3258 m (TOF), start milling 60 CM and POOH to surface. RIH with O. Shot to TOF and work on fish, POOH to surface.
RIH with milling BHA to 3301 m and start milling to 3301.7 m, OBS string got stuck, work on stuck, string got free, cont. milling to 3302.5 m, POOH to surface.
Change the mill and RIH with 6" milling BHA to 3302.5, commenced milling to 3303.6 m, wash down to 3480 m, POOH to surface. RIH with 2" * 4" Taper tap to 3763.5 m and work on fish, POOH to surface, OBS, ret. All packer tail.
RIH with tandem scraper and work on scraper while decrease MW to 104 PCF.
Performed Logging job. RIH with 55 7/8" j.Mill to 3780 m (4 1/2" L.Liner), Circ & clean the well then POOH to surface. Performed 2 CMT plug job as program.

8 – 1/2” Hole Section

6 – 1/8” Hole Section

Completion Section

10.3 WorkOver Section Drilling Fluid type

FLUID PROPERTIES RECAP					
KCL Pol Mud		Drilling start	Range		Drilling End
MW (min)	pcf	104	104	112	104
Funnel Viscosity	sec/qt	49	48	57	53
PV	cps	20	20	34	30
YP	lb/100sq.ft	12	12	17	14
pH		9.3	9.3	9.6	9.5
Cl (NaCl)	mg/L	180,000	180000	190000	180,000
Total Hardness	mg/L	1,240	800	920	1,240
Ca Hardness	mg/L	800	800	1040	1,040

Table 10-2: AZNS-127 Fluid Properties Recap Table

10.4 WorkOver Section Material Consumption Analysis

Products	Units Used	Unit wt lbs	Total wt		Effective Concentration	
Caustic Soda	14	55	770	lbs	0.27	ppb
Lime	115	55	6,325	lbs	2.24	ppb
Limestone	335	2,200	737,000	lbs	261.44	ppb
Salt (NaCl)	96	2,200	211,200	lbs	74.92	ppb
Starch LV	180	55	9,900	lbs	3.51	ppb
Soda ASH	12	55	660	lbs	0.23	ppb
Hematite	73	3,300	240,900	lbs	85.46	ppb
Xanthan Gum	26	55	1,430	lbs	0.51	ppb

Initial Volume	0.0 bbl
Total Volume Built	2,819.0 bbl
Volume received	0.0 bbl
Volume Returned	0.0 bbl
Total Volume Consumed	1,671 bbl
Volume Transfer to Next Section	1,148.0 bbl
Meter Drilled	0 m

Table 10-3: AZNS-127 Material Consumption Analysis Table

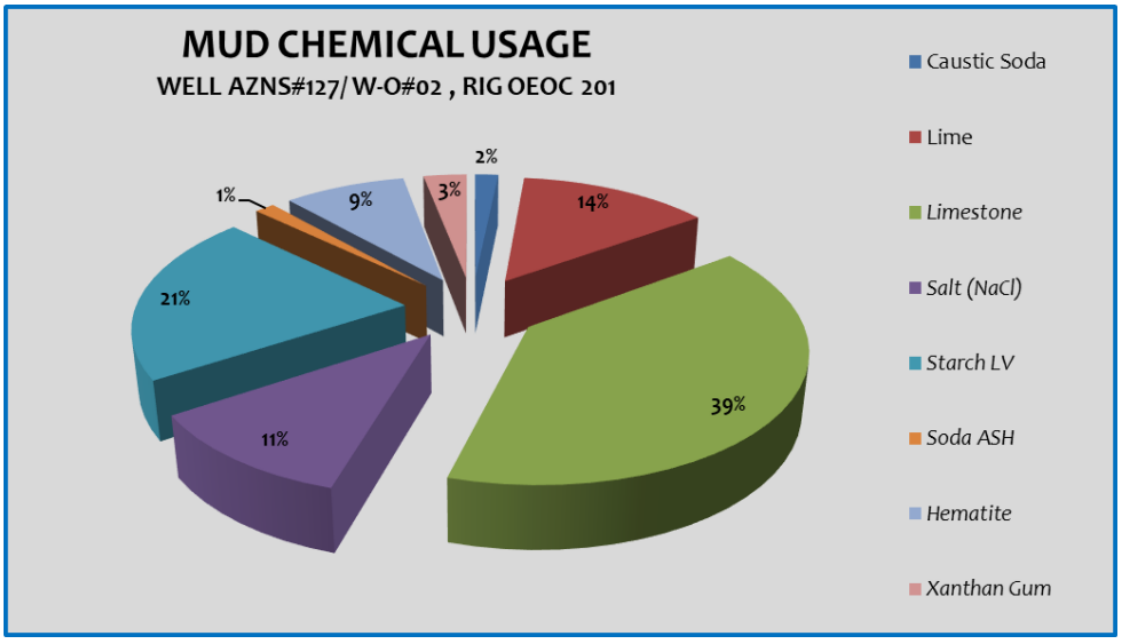


Figure 10-1: AZNS-127 Mud Chemical Usage

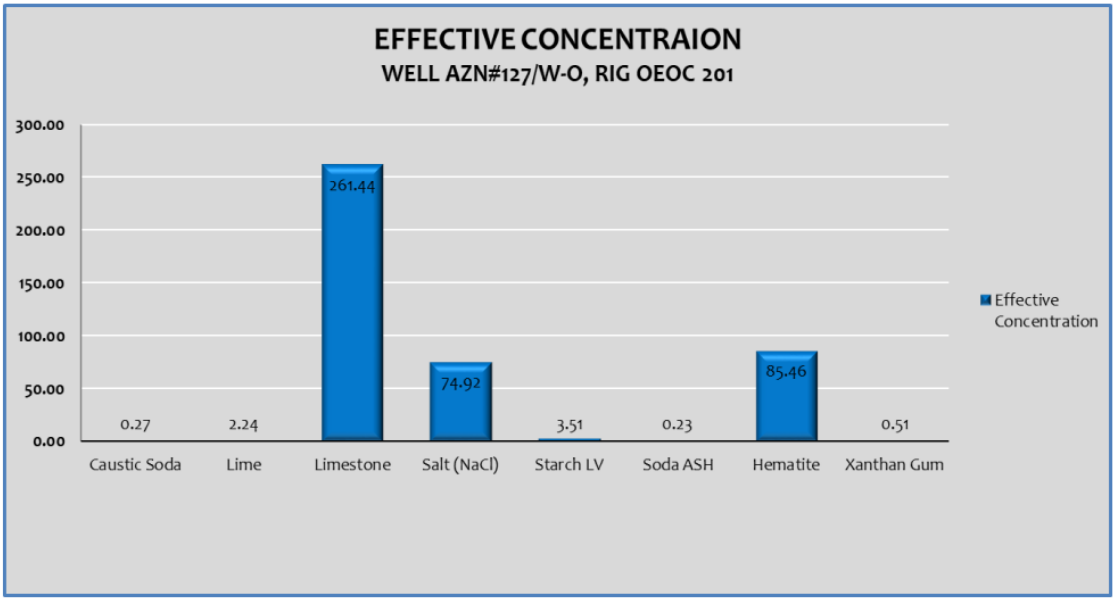


Figure 10-2: AZNS-127 Effective Concentration

10.5 WorkOver Section Volume Analysis

WELL AZN#127, RIG OEOC 201 VOLUME ANALYSIS		
Initial Volume	bbls	0.0
Received Volume	bbls	0.0
Volume Return	bbls	0.0
Volume Built	bbls	2,819.0
Surface Losses/Dumped	bbls	1,671.0
Formation Losses	bbls	0.0
Total Losses	bbls	1,671.0
Volume Transfer Out	bbls	1,148

Table 10-4: AZNS-127 Volume Analysis Table

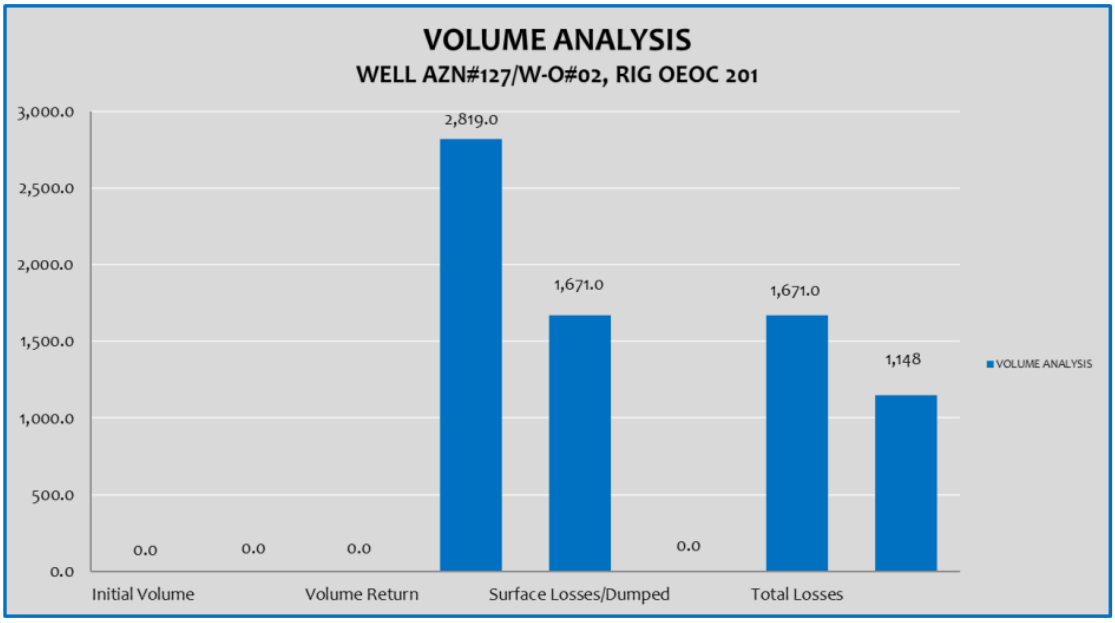


Figure 10-3: AZNS-127 Volume Analysis Chart

10.6 WorkOver Section Daily volume Breakdown

Date/DMR.N		Volume of Built	Surface Losses	Formation Losses
29-Dec-25	01	0.0	0	0
30-Dec-25	02	0.0	0	0
31-Dec-25	03	0.0	0	0
1-Jan-26	04	0.0	0	0
2-Jan-26	05	0.0	0	0
3-Jan-26	06	0.0	0	0
4-Jan-26	07	0.0	0	0
5-Jan-26	08	0.0	0	0
6-Jan-26	09	0.0	0	0
7-Jan-26	10	0.0	0	0
8-Jan-26	11	958.2	0	0
9-Jan-26	12	562.4	0	0
10-Jan-26	13	19.3	0	0
11-Jan-26	14	0.0	0	0
12-Jan-26	15	34.5	0	0
13-Jan-26	16	622.7	390	0
14-Jan-26	17	92.1	5	0
15-Jan-26	18	12.6	53	0
16-Jan-26	19	0.0	5	0
17-Jan-26	20	0.0	5	0
18-Jan-26	21	6.9	63	0
19-Jan-26	22	14.1	16	0
20-Jan-26	23	0.0	44	0
21-Jan-26	24	0.0	4	0
22-Jan-26	25	0.0	19	0
23-Jan-26	26	0.0	12	0
24-Jan-26	27	0.0	7	0
25-Jan-26	28	0.0	18	0
26-Jan-26	29	0.1	7	0
27-Jan-26	30	0.1	0	0
28-Jan-26	31	0.0	12	0
29-Jan-26	32	0.0	26	0
30-Jan-26	33	0.0	28	0
31-Jan-26	34	0.0	7	0
1-Feb-26	35	0.2	10	0
2-Feb-26	36	0.3	9	0
3-Feb-26	37	0.2	15	0

4-Feb-26	38	0.1	20	0
5-Feb-26	39	0.1	20	0
6-Feb-26	40	0.1	22	0
7-Feb-26	41	0.0	35	0
8-Feb-26	42	9.3	30	0
9-Feb-26	43	0.0	65	0
10-Feb-26	44	7.1	20	0
11-Feb-26	45	0.8	15	0
12-Feb-26	46	0.1	45	0
13-Feb-26	47	1.9	57	0
14-Feb-26	48	43.8	20	0
15-Feb-26	49	4.3	35	0
16-Feb-26	50	123.0	32	0
17-Feb-26	51	4.9	52	0
18-Feb-26	52	72.7	12	0
19-Feb-26	53	89.2	82	0
20-Feb-26	54	119.6	25	0
21-Feb-26	55	1.4	25	0
22-Feb-26	56	0.2	58	0
23-Feb-26	57	0.0	8	0
24-Feb-26	58	0.0	0	0
25-Feb-26	59	0.3	2	0
26-Feb-26	60	0.0	20	0
27-Feb-26	61	0.0	0	0
28-Feb-26	62	0.0	65	0
1-Mar-26	63	0.0	4	0
2-Mar-26	64	0.0	0	0
3-Mar-26	65	7.1	15	0
4-Mar-26	66	9.3	50	0
5-Mar-26	67	0.0	27	0
6-Mar-26	68	0.0	0	0
7-Mar-26	69	0.0	0	0
8-Mar-26	70	0.0	55	0
9-Mar-26	71	0.0	0	0
10-Mar-26	72	0.0	0	0
Total (bbl)		Volume of Built	Surface Losses	Formation Losses
		2,819.0	1,671	0

Table 10-5: AZNS-127 Daily Volume Break Down Table

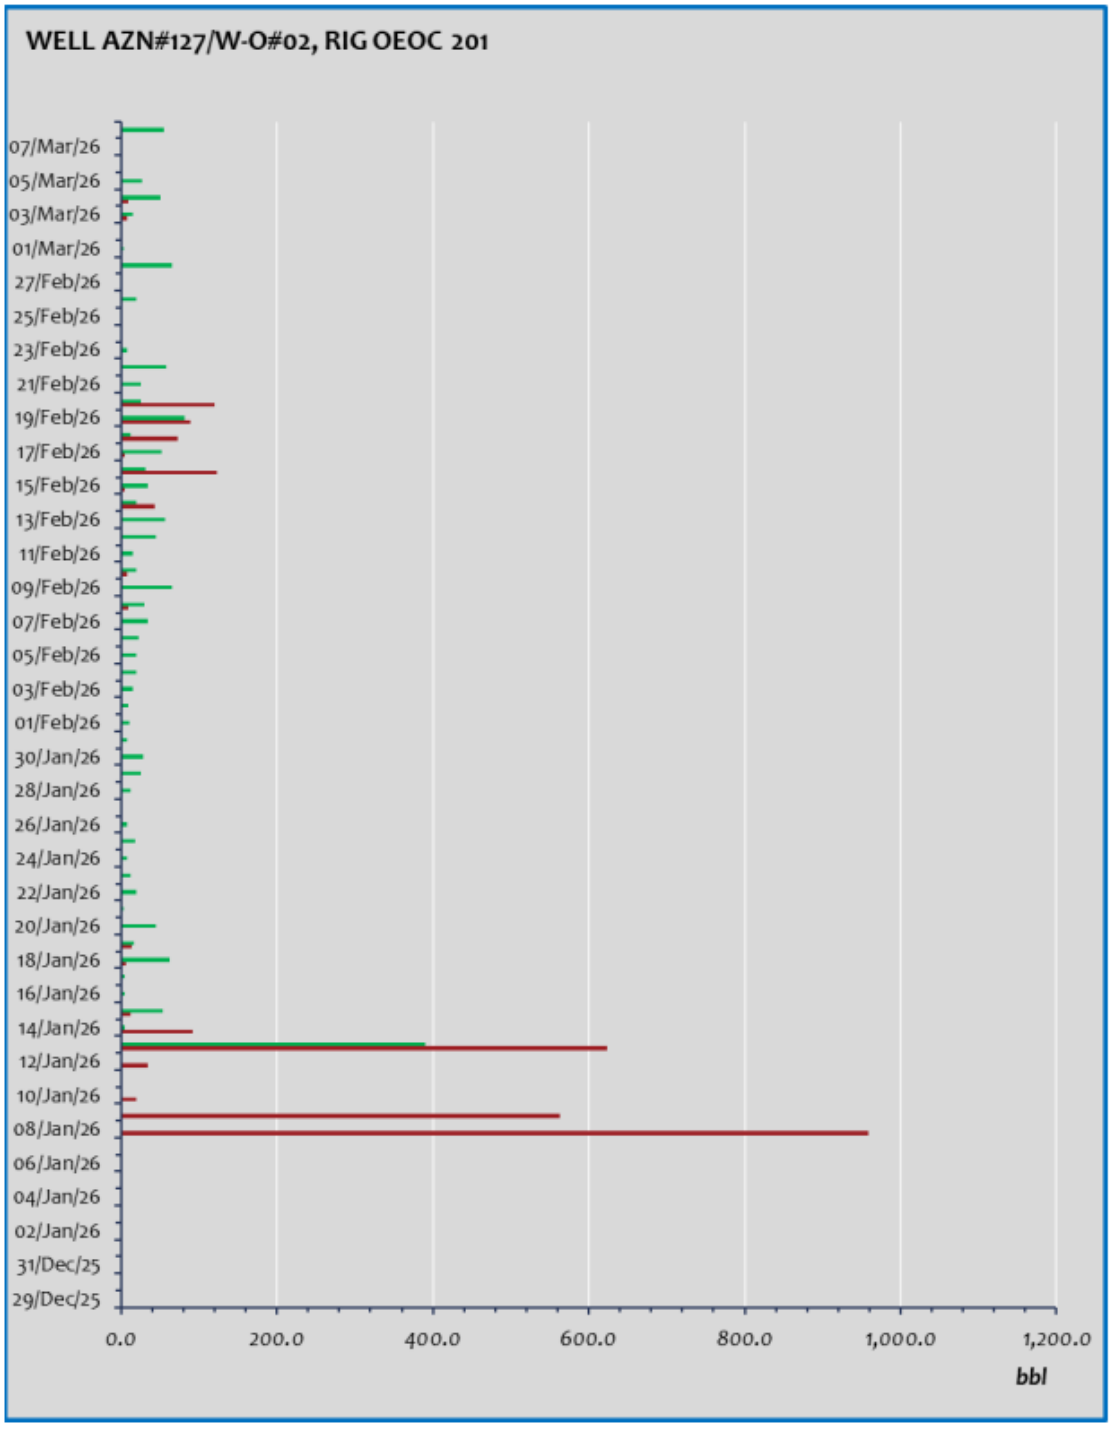


Figure 10-4: AZNS-127 Daily Volume Break Down Chart

10.7 WorkOver Section Loss Distribution

Date/DMR.N		Volume of Built	Dump/Contamination	Shakers	Evaporation	Centrifuge	Trip	Mud cleaner	Pit Cleaning	Formation	Other
29-Dec-25	01	0.0	0	0	0	0	0	0	0	0	0
30-Dec-25	02	0.0	0	0	0	0	0	0	0	0	0
31-Dec-25	03	0.0	0	0	0	0	0	0	0	0	0
1-Jan-26	04	0.0	0	0	0	0	0	0	0	0	0
2-Jan-26	05	0.0	0	0	0	0	0	0	0	0	0
3-Jan-26	06	0.0	0	0	0	0	0	0	0	0	0
4-Jan-26	07	0.0	0	0	0	0	0	0	0	0	0
5-Jan-26	08	0.0	0	0	0	0	0	0	0	0	0
6-Jan-26	09	0.0	0	0	0	0	0	0	0	0	0
7-Jan-26	10	0.0	0	0	0	0	0	0	0	0	0
8-Jan-26	11	958.2	0	0	0	0	0	0	0	0	0
9-Jan-26	12	562.4	0	0	0	0	0	0	0	0	0
10-Jan-26	13	19.3	0	0	0	0	0	0	0	0	0
11-Jan-26	14	0.0	0	0	0	0	0	0	0	0	0
12-Jan-26	15	34.5	0	0	0	0	0	0	0	0	0
13-Jan-26	16	622.7	120	0	0	0	0	0	0	0	270
14-Jan-26	17	92.1	0	0	0	0	0	0	0	0	5
15-Jan-26	18	12.6	0	0	3	0	0	0	5	0	45
16-Jan-26	19	0.0	0	0	0	0	0	0	5	0	0
17-Jan-26	20	0.0	0	0	0	0	0	0	0	0	5
18-Jan-26	21	6.9	0	0	3	0	0	0	20	0	40
19-Jan-26	22	14.1	0	0	4	0	0	0	0	0	12
20-Jan-26	23	0.0	0	0	4	0	0	0	0	0	40
21-Jan-26	24	0.0	0	0	4	0	0	0	0	0	0
22-Jan-26	25	0.0	0	0	4	0	0	0	0	0	15
23-Jan-26	26	0.0	0	0	2	0	0	0	0	0	10
24-Jan-26	27	0.0	0	0	2	0	0	0	5	0	0
25-Jan-26	28	0.0	0	0	3	0	0	0	0	0	15
26-Jan-26	29	0.1	0	0	2	0	0	0	0	0	5
27-Jan-26	30	0.1	0	0	0	0	0	0	0	0	0
28-Jan-26	31	0.0	0	0	0	0	0	0	0	0	12
29-Jan-26	32	0.0	0	0	0	0	22	0	0	0	4
30-Jan-26	33	0.0	0	0	0	0	28	0	0	0	0
31-Jan-26	34	0.0	0	0	0	0	7	0	0	0	0
1-Feb-26	35	0.2	0	2	0	0	8	0	0	0	0
2-Feb-26	36	0.3	0	2	0	0	7	0	0	0	0
3-Feb-26	37	0.2	0	5	0	0	10	0	0	0	0

4-Feb-26	38	0.1	0	0	0	0	20	0	0	0	0
5-Feb-26	39	0.1	0	0	0	0	20	0	0	0	0
6-Feb-26	40	0.1	0	0	0	0	22	0	0	0	0
7-Feb-26	41	0.0	0	0	0	0	35	0	0	0	0
8-Feb-26	42	9.3	0	0	0	0	30	0	0	0	0
9-Feb-26	43	0.0	0	0	0	0	50	0	0	0	15
10-Feb-26	44	7.1	0	0	0	0	20	0	0	0	0
11-Feb-26	45	0.8	0	0	0	0	0	0	0	0	15
12-Feb-26	46	0.1	0	20	3	0	2	0	0	0	20
13-Feb-26	47	1.9	0	0	2	0	30	0	0	0	25
14-Feb-26	48	43.8	0	10	0	0	0	0	0	0	10
15-Feb-26	49	4.3	0	10	0	10	10	0	5	0	0
16-Feb-26	50	123.0	0	15	2	0	0	0	0	0	15
17-Feb-26	51	4.9	0	12	0	0	15	0	0	0	25
18-Feb-26	52	72.7	0	12	0	0	0	0	0	0	0
19-Feb-26	53	89.2	0	12	0	15	50	0	5	0	0
20-Feb-26	54	119.6	0	12	0	13	0	0	0	0	0
21-Feb-26	55	1.4	0	10	0	15	0	0	0	0	0
22-Feb-26	56	0.2	0	0	0	0	58	0	0	0	0
23-Feb-26	57	0.0	0	0	0	0	8	0	0	0	0
24-Feb-26	58	0.0	0	0	0	0	0	0	0	0	0
25-Feb-26	59	0.3	0	2	0	0	0	0	0	0	0
26-Feb-26	60	0.0	0	0	0	0	8	0	12	0	0
27-Feb-26	61	0.0	0	0	0	0	0	0	0	0	0
28-Feb-26	62	0.0	0	3	0	0	62	0	0	0	0
1-Mar-26	63	0.0	0	0	0	0	0	0	0	0	4
2-Mar-26	64	0.0	0	0	0	0	0	0	0	0	0
3-Mar-26	65	7.1	0	0	0	0	0	0	0	0	15
4-Mar-26	66	9.3	0	5	0	0	15	0	30	0	0
5-Mar-26	67	0.0	0	2	0	0	25	0	0	0	0
6-Mar-26	68	0.0	0	0	0	0	0	0	0	0	0
7-Mar-26	69	0.0	0	0	0	0	0	0	0	0	0
8-Mar-26	70	0.0	0	0	0	0	0	0	25	0	30
9-Mar-26	71	0.0	0	0	0	0	0	0	0	0	0
10-Mar-26	72	0.0	0	0	0	0	0	0	0	0	0
Total (bbl)		Volume of Built	Dump/Contaminate	Shakers	Evaporation	Centrifuge	Trip	Mud cleaner	Pit Cleaning	Formation	Other
		2,819.0	120	134	38	53	562	0	112	0	652.0

Table 10-6: AZNS-127 Loss Distribution

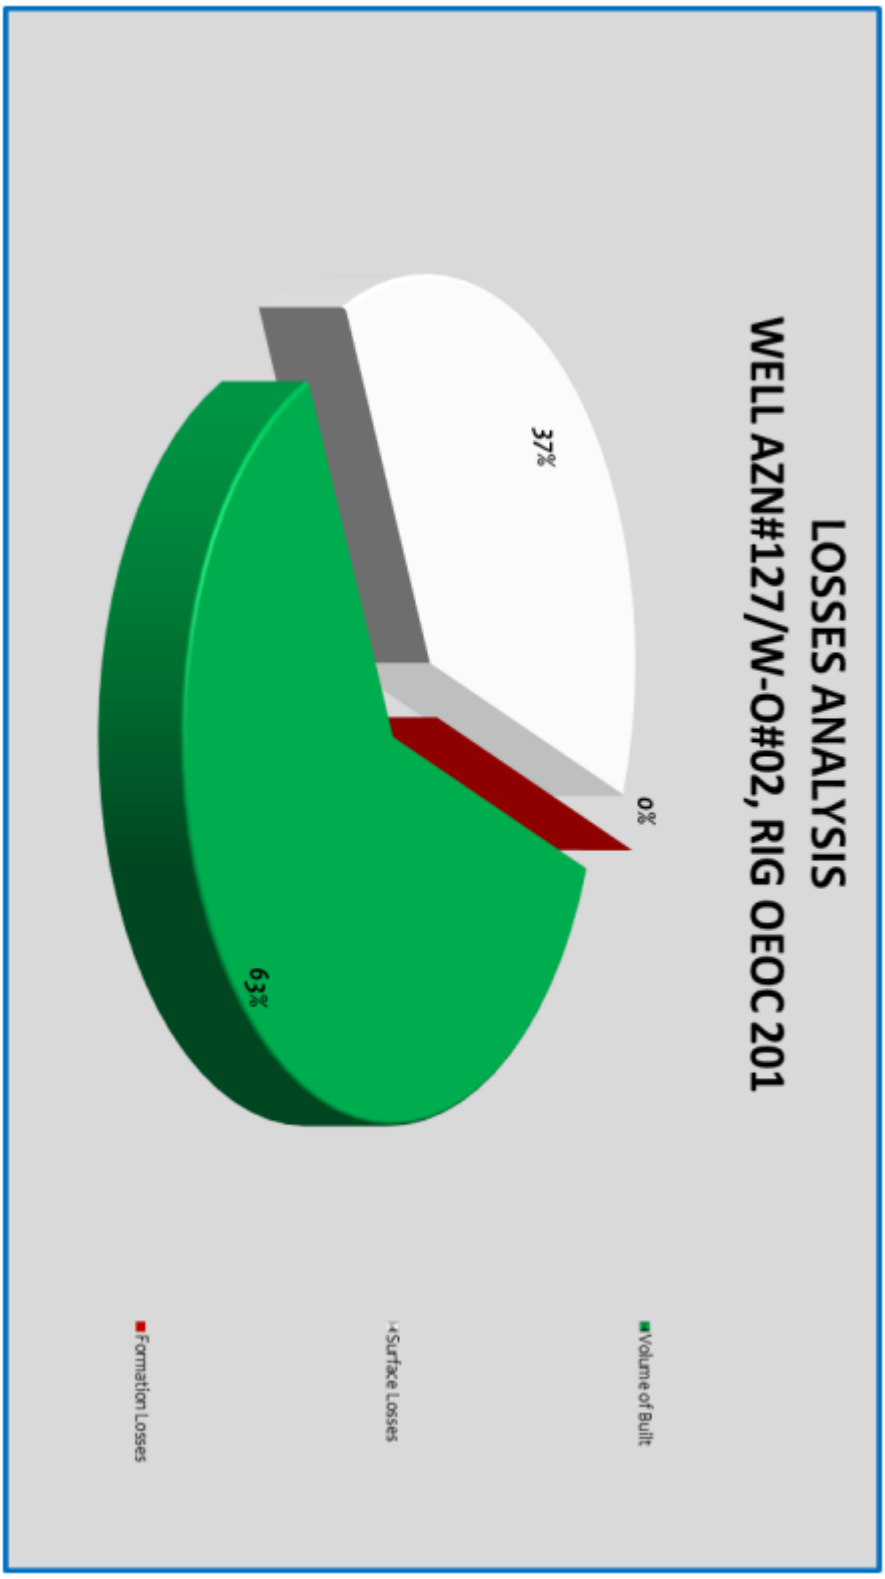


Figure 10-5: AZNS-127 Loss Analysis

10.8 WorkOver Section Interval Fluid Properties Recap

Date	DEPTH	Density	VIS	PV	YP	Water Loss	pH	Chloride	Calcium	Total Hardness	Mud Type
29-Dec-25											
30-Dec-25											
31-Dec-25											
1-Jan-26											
2-Jan-26											
3-Jan-26											
4-Jan-26											
5-Jan-26											
6-Jan-26											
7-Jan-26											
8-Jan-26	4139	104	49	20	12	15	9.3	180,000	600	800	Salt/Poly Mud
9-Jan-26	4139	104	49	20	12	15	9.3	180,000	600	800	Salt/Poly Mud
10-Jan-26	4139	106	50	20	13	15	9.5	180,000	600	800	Salt/Poly Mud
11-Jan-26	4139	106	50	20	13	15	9.5	180,000	600	800	Salt/Poly Mud
12-Jan-26	4139	106	50	20	13	15	9.5	180,000	600	800	Salt/Poly Mud
13-Jan-26	4139	110	54	24	13	20	9.4	180,000	600	800	Salt/Poly Mud
14-Jan-26	4139	112	55	28	14	25	9.5	180,000	600	800	Salt/Poly Mud
15-Jan-26	4139	112	55	28	14	25	9.5	180,000	600	800	Salt/Poly Mud
16-Jan-26	4139	112	55	28	14	25	9.5	180,000	600	800	Salt/Poly Mud
17-Jan-26	4139	112	55	28	14	25	9.5	180,000	600	800	Salt/Poly Mud
18-Jan-26	4139	112	55	28	14	25	9.6	180,000	600	800	Salt/Poly Mud
19-Jan-26	4139	112	55	28	14	25	9.5	180,000	600	800	Salt/Poly Mud
20-Jan-26	4139	112	57	33	13	35	9.5	189,000	720	880	Salt/Poly Mud
21-Jan-26	4139	112	55	34	13	40	9.5	189,000	720	880	Salt/Poly Mud
22-Jan-26	4139	112	55	29	13	41	9.5	189,000	720	880	Salt/Poly Mud
23-Jan-26	4139	112	53	28	13	42	9.4	189,000	720	880	Salt/Poly Mud
24-Jan-26	4139	112	57	31	13	39	9.5	190,000	720	880	Salt/Poly Mud
25-Jan-26	4139	112	56	31	13	39	9.5	189,000	720	880	Salt/Poly Mud
26-Jan-26	4139	112	57	33	14	39	9.5	189,000	720	880	Salt/Poly Mud
27-Jan-26	4139	112	55	33	14	30	9.5	189,000	720	880	Salt/Poly Mud
28-Jan-26	4139	112	55	33	14	30	9.5	189,000	720	880	Salt/Poly Mud
29-Jan-26	4139	112	56	33	14	30	9.5	189,000	720	880	Salt/Poly Mud
30-Jan-26	4139	112	56	33	14	30	9.5	189,000	720	880	Salt/Poly Mud
31-Jan-26	4139	112	56	33	14	30	9.5	189,000	720	880	Salt/Poly Mud
1-Feb-26	4139	112	54	32	13	22	9.6	189,000	720	880	Salt/Poly Mud
2-Feb-26	4139	112	53	32	13	23	9.6	189,000	720	880	Salt/Poly Mud
3-Feb-26	4139	112	53	32	13	22	9.5	189,000	720	880	Salt/Poly Mud

4-Feb-26	4139	112	53	32	13	22	9.5	189,000	720	880	Salt/Poly Mud
5-Feb-26	4139	112	53	32	13	22	9.5	189,000	720	880	Salt/Poly Mud
6-Feb-26	4139	112	53	32	13	22	9.5	189,000	720	880	Salt/Poly Mud
7-Feb-26	4139	112	53	32	13	22	9.5	189,000	720	880	Salt/Poly Mud
8-Feb-26	4139	112	53	32	13	22	9.5	189,000	720	880	Salt/Poly Mud
9-Feb-26	4139	112	53	32	13	22	9.5	189,000	720	880	Salt/Poly Mud
10-Feb-26	4139	112	53	32	13	22	9.5	189,000	720	880	Salt/Poly Mud
11-Feb-26	4139	112	53	32	13	22	9.6	189,000	720	880	Salt/Poly Mud
12-Feb-26	4139	112	53	32	13	22	9.5	189,000	720	880	Salt/Poly Mud
13-Feb-26	4139	112	53	32	13	22	9.5	189,000	720	880	Salt/Poly Mud
14-Feb-26	4139	110	52	27	12	22	9.5	189,000	720	880	Salt/Poly Mud
15-Feb-26	4139	110	52	27	12	22	9.5	189,000	720	880	Salt/Poly Mud
16-Feb-26	4139	110	52	27	12	22	9.6	189,000	720	880	Salt/Poly Mud
17-Feb-26	4139	110	52	27	12	22	9.5	189,000	720	880	Salt/Poly Mud
18-Feb-26	4139	110	52	27	12	22	9.5	189,000	720	880	Salt/Poly Mud
19-Feb-26	4139	110	52	27	12	22	9.5	189,000	720	880	Salt/Poly Mud
20-Feb-26	4139	110	52	27	12	22	9.5	189,000	720	880	Salt/Poly Mud
21-Feb-26	4139	104	48	23	12	10	9.5	180,000	760	920	Salt/Poly Mud
22-Feb-26	4139	104	48	25	12	10	9.5	180,000	760	920	Salt/Poly Mud
23-Feb-26	4139	104	48	25	12	10	9.5	180,000	760	920	Salt/Poly Mud
24-Feb-26	4139	104	48	25	12	10	9.5	180,000	760	920	Salt/Poly Mud
25-Feb-26	4139	104	55	32	17	12	9.5	180,000	760	920	Salt/Poly Mud
26-Feb-26	4139	104	54	31	16	12	9.5	180,000	760	920	Salt/Poly Mud
27-Feb-26	4139	104	53	31	16	12	9.5	180,000	760	920	Salt/Poly Mud
28-Feb-26	4139	104	53	31	16	12	9.5	180,000	760	920	Salt/Poly Mud
1-Mar-26	4139	104	53	31	16	12	9.5	180,000	760	920	Salt/Poly Mud
2-Mar-26	4139	104	52	31	16	12	9.5	180,000	760	920	Salt/Poly Mud
3-Mar-26	4139	104	51	30	14	13	9.6	180,000	960	1040	Salt/Poly Mud
4-Mar-26	4139	104	51	30	14	13	9.6	180,000	960	1040	Salt/Poly Mud
5-Mar-26	4139	104	53	30	14	13	9.6	180,000	960	1040	Salt/Poly Mud
6-Mar-26	4139	104	53	30	14	13	9.5	180,000	960	1040	Salt/Poly Mud
7-Mar-26	4139	104	53	30	14	13	9.5	180,000	960	1040	Salt/Poly Mud
8-Mar-26	4139	104	53	30	14	13	9.5	180,000	960	1040	Salt/Poly Mud
9-Mar-26	4139	104	53	30	14	13	9.5	180,000	960	1040	Salt/Poly Mud
10-Mar-26	4139	104	53	30	14	13	9.5	180,000	960	1040	Salt/Poly Mud
Drilling Start											
Drilling End											

Table 10-7: AZNS-127 Fluid Properties Recap

10.9 WorkOver Section Solid Control Disscusion

Rig OEOC 201 has 3 shale shakers were dressed with:

Shaker#1: 100 Mesh Screen

Shaker#2: 100 Mesh Screen

Shaker#3: 100 Mesh Screen

WELL AZN#127, RIG OEOC 201	
Solid Control Equipment Working Hr.s	
Shaker # 01	89
Shaker # 02	267
Shaker # 03	145
Centrifuge	41

Table 10-8: AZNS-127 Solid Control Desscusion

10.10 8 – 1/2” Hole Section Drilling Fluid Types

FLUID PROPERTIES RECAP					
		Drilling start	Range		Drilling End
MW (min)	pcf	80	80	81.0	81.0
Funnel Viscosity	sec/qt	40	40	43	42
PV	cps	8	8	15	14
YP	lb/100sq.ft	9	9	15	13
API Fluid loss	cc	3	2	3	2
pH		9.5	9.5	9.5	9.5
Solid	%	17	17	18	18
KCL	%	-	-	5	5
Cl (NaCl)	mg/L	180,000	172,000	180,000	172,000
Total Hardness	mg/L	1,600	1,360	2,040	2,040
Ca Hardness	mg/L	1,400	1,280	1,920	1,920

Table 10-9: AZNS-127 8-1/2” Fluid Properties Recap Table

10.11 8 1/2” Interval Material Consumption Analysis

Products	Units Used	Unit wt lbs	Total wt	Effective Concentration
Caustic Soda	37	55	2,035 lbs	0.43 ppb
Limestone	161	2,200	354,200 lbs	75.26 ppb
KCL	36	2,200	79,200 lbs	16.83 ppb
Starch LV	573	55	31,515 lbs	6.70 ppb
Strach HT	160	55	8,800 lbs	1.87 ppb
Xantan gum	82	55	4,510 lbs	0.96 ppb
Salt (NACL)	153	2,200	336,600 lbs	71.52 ppb
Soda Ash	51	55	2,805 lbs	0.60 ppb
Lime	141	55	7,755 lbs	1.65 ppb

Initial Volume	880.0 bbl
Total Volume Built	4,706.1 bbl
Volume received	0.0 bbl
Left In Hole	196.0 bbl
Total Volume Consumed	3,931 bbl
Volume Transfer to Next Section	1,655.1 bbl
Meter Drilled	830.0 m

Table 10-10: AZNS-127 8-1/2” Interval Material Consumption Analysis

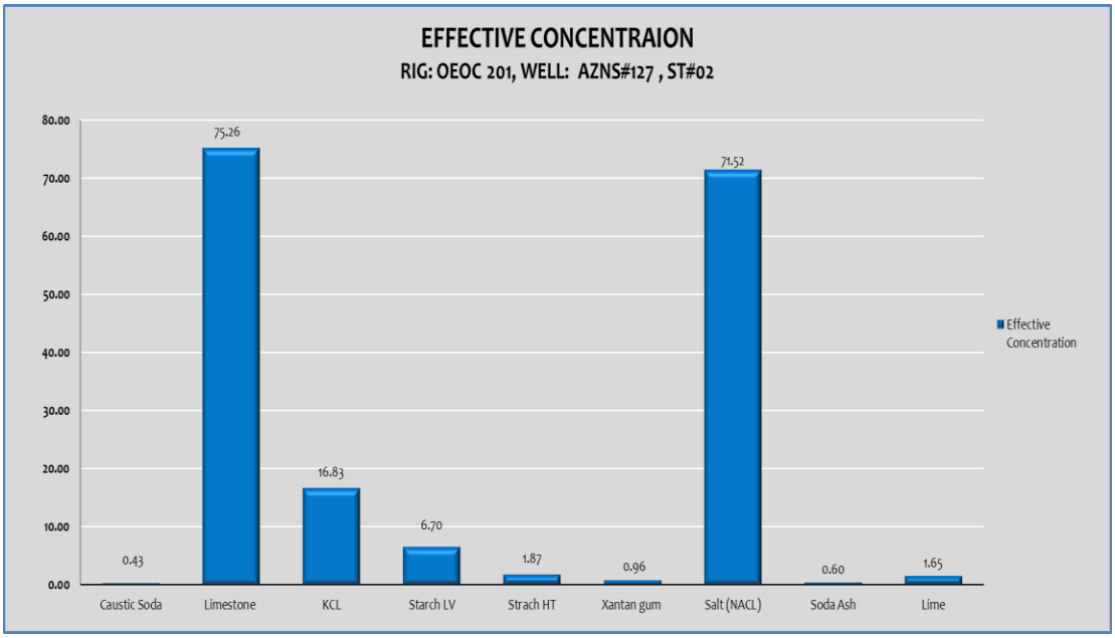


Figure 10-6: AZNS-127 8 -1/2" Effective Concentration

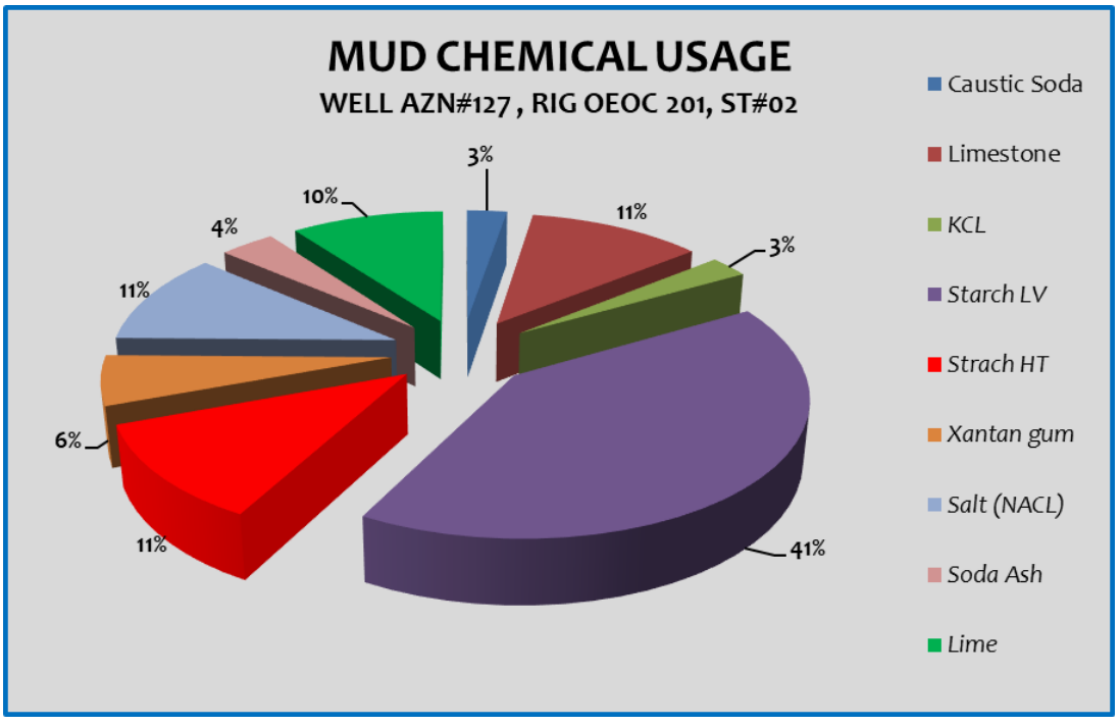


Figure 10-7: AZNS-127 8-1/2" Mud Chemical Usage

10.12 8 1/2” Interval Volume Analysis

RIG: OEOC 201, WELL: AZNS#75 , Re-Entry VOLUME ANALYSIS		
Initial Volume	bbls	880.0
Received Volume	bbls	0.0
Volume Built	bbls	4,706.1
Surface Losses/Dumped	bbls	2,976.0
Left In Hole	bbls	196.0
Formation Losses	bbls	759.0
Total Losses	bbls	3,931.0
Volume Transfer Out	bbls	1,655

Table 10-11: AZNS-127 8-1/2” Interval Volume Analysis

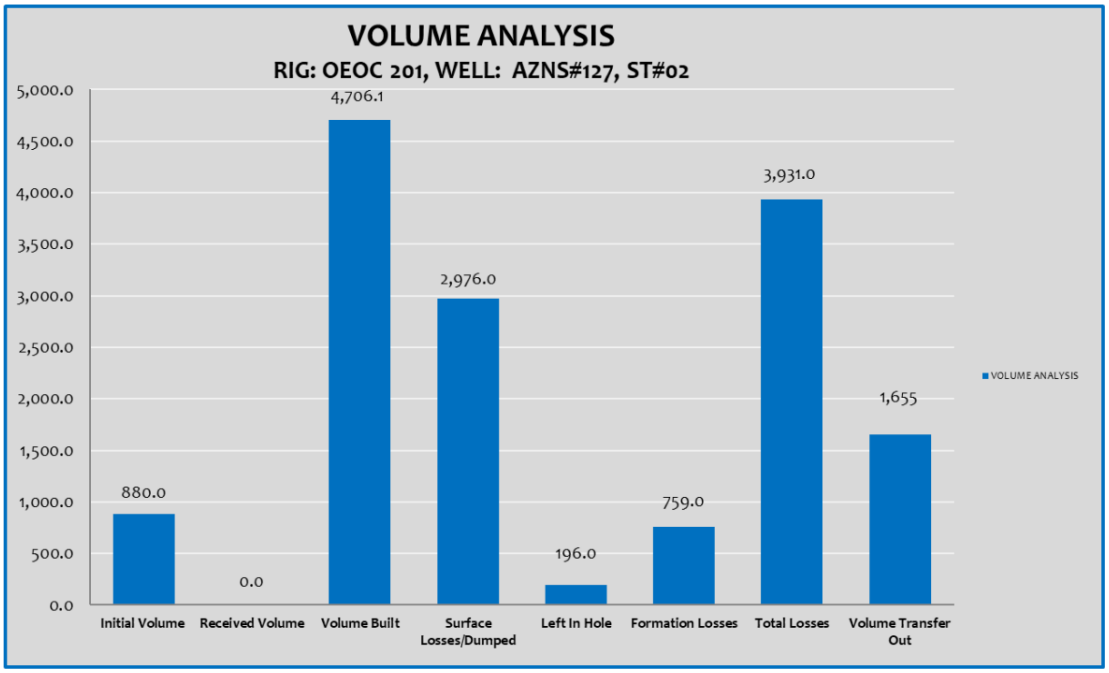


Figure 10-8: AZNS-127 8-1/2" Interval Volume Analysis

10.13 8 1/2” Interval Daily Volume Breakdown

Date/DMR.N		Volume of Built	Surface Losses	Formation Losses
3-Apr-26	96	150.5	30	0
4-Apr-26	97	0.0	42	0
5-Apr-26	98	93.2	23	0
6-Apr-26	99	498.1	70	0
7-Apr-26	100	488.4	40	0
8-Apr-26	101	159.3	235	0
9-Apr-26	102	292.1	0	0
10-Apr-26	103	126.0	10	0
11-Apr-26	104	0.2	20	0
12-Apr-26	105	111.2	57	0
13-Apr-26	106	0.0	20	0
14-Apr-26	107	50.3	50	0
15-Apr-26	108	23.1	40	0
16-Apr-26	109	0.1	39	0
17-Apr-26	110	0.1	12	0
18-Apr-26	111	367.4	584	0
19-Apr-26	112	6.4	220	0
20-Apr-26	113	164.9	55	16
21-Apr-26	114	151.1	75	48
22-Apr-26	115	97.4	103	45
23-Apr-26	116	158.5	97	45
24-Apr-26	117	0.0	120	24
25-Apr-26	118	323.5	40	45
26-Apr-26	119	185.0	24	48
27-Apr-26	120	125.3	45	48
28-Apr-26	121	159.7	48	30
29-Apr-26	122	0.1	190	20
30-Apr-26	123	170.5	27	20
1-May-26	124	150.1	85	20
2-May-26	125	28.6	35	0
3-May-26	126	31.9	58	56
4-May-26	127	129.7	119	25
5-May-26	128	15.3	59	12
6-May-26	129	135.5	81	27
7-May-26	130	5.6	50	10
8-May-26	131	169.9	98	70
9-May-26	132	17.0	23	70
10-May-26	133	30.0	0	50
11-May-26	134	90.1	52	30
Total (bbl)		Volume of Built	Surface Losses	Formation Losses
		4,706	2,976	759

Table 10-12: AZNS-127 8-1/2" Interval Daily Volume Breakdown

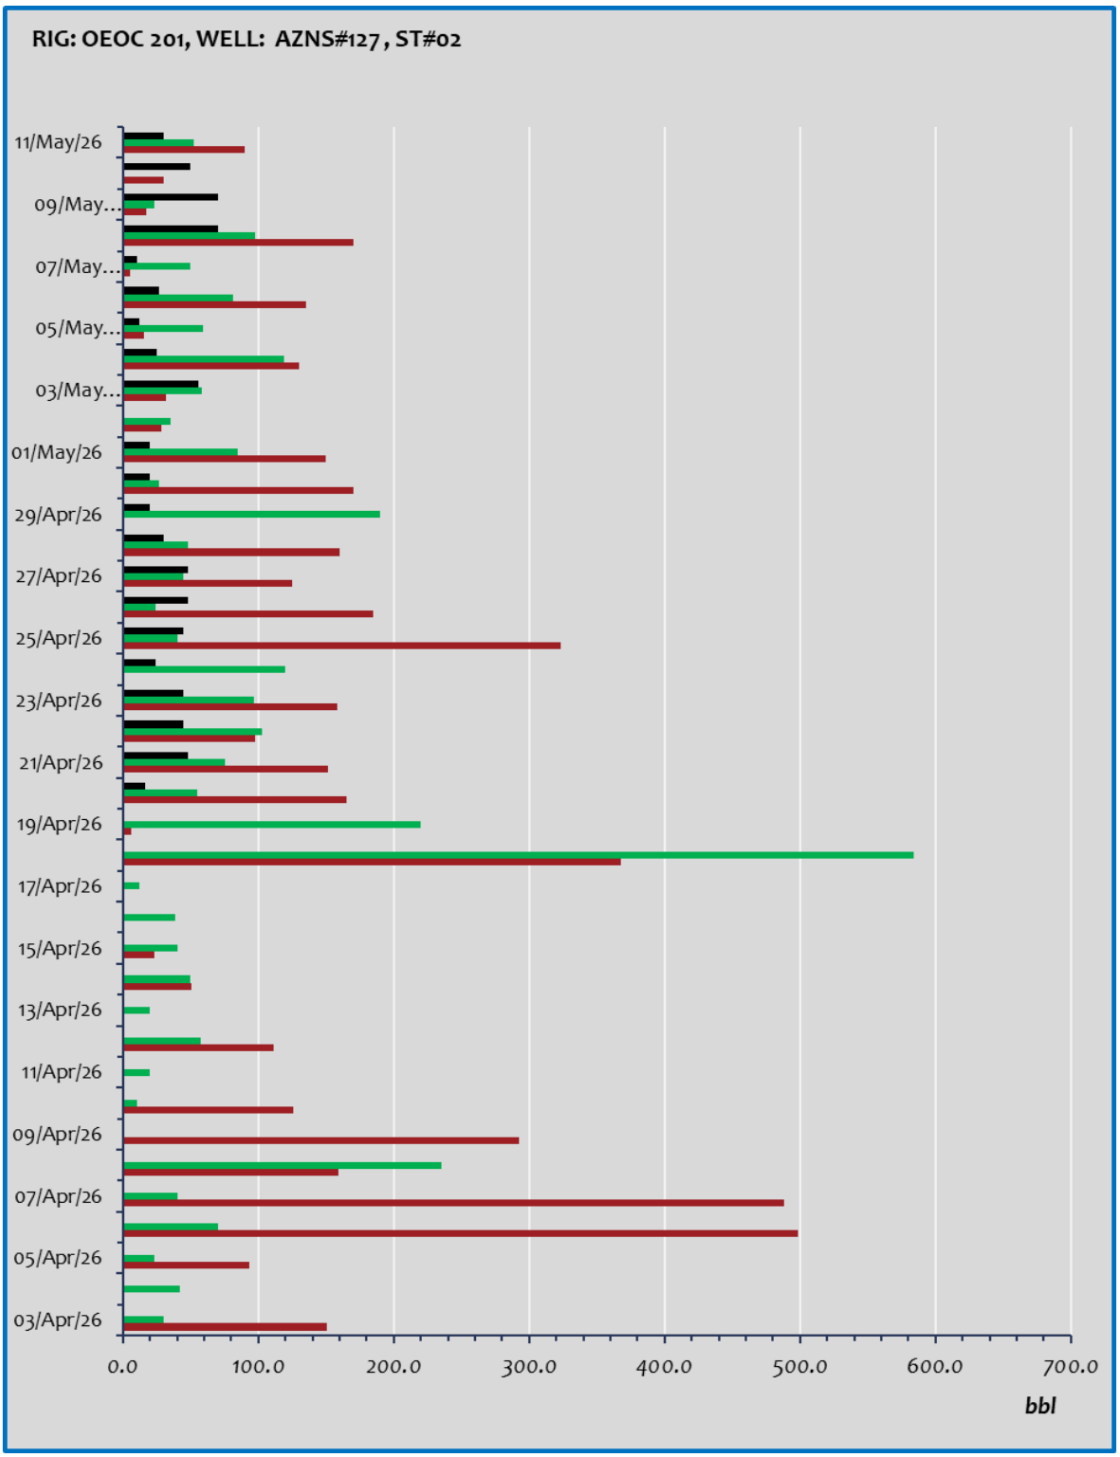


Figure 10-9: AZNS-127 8-1/2" Interval Daily Volume Breakdown

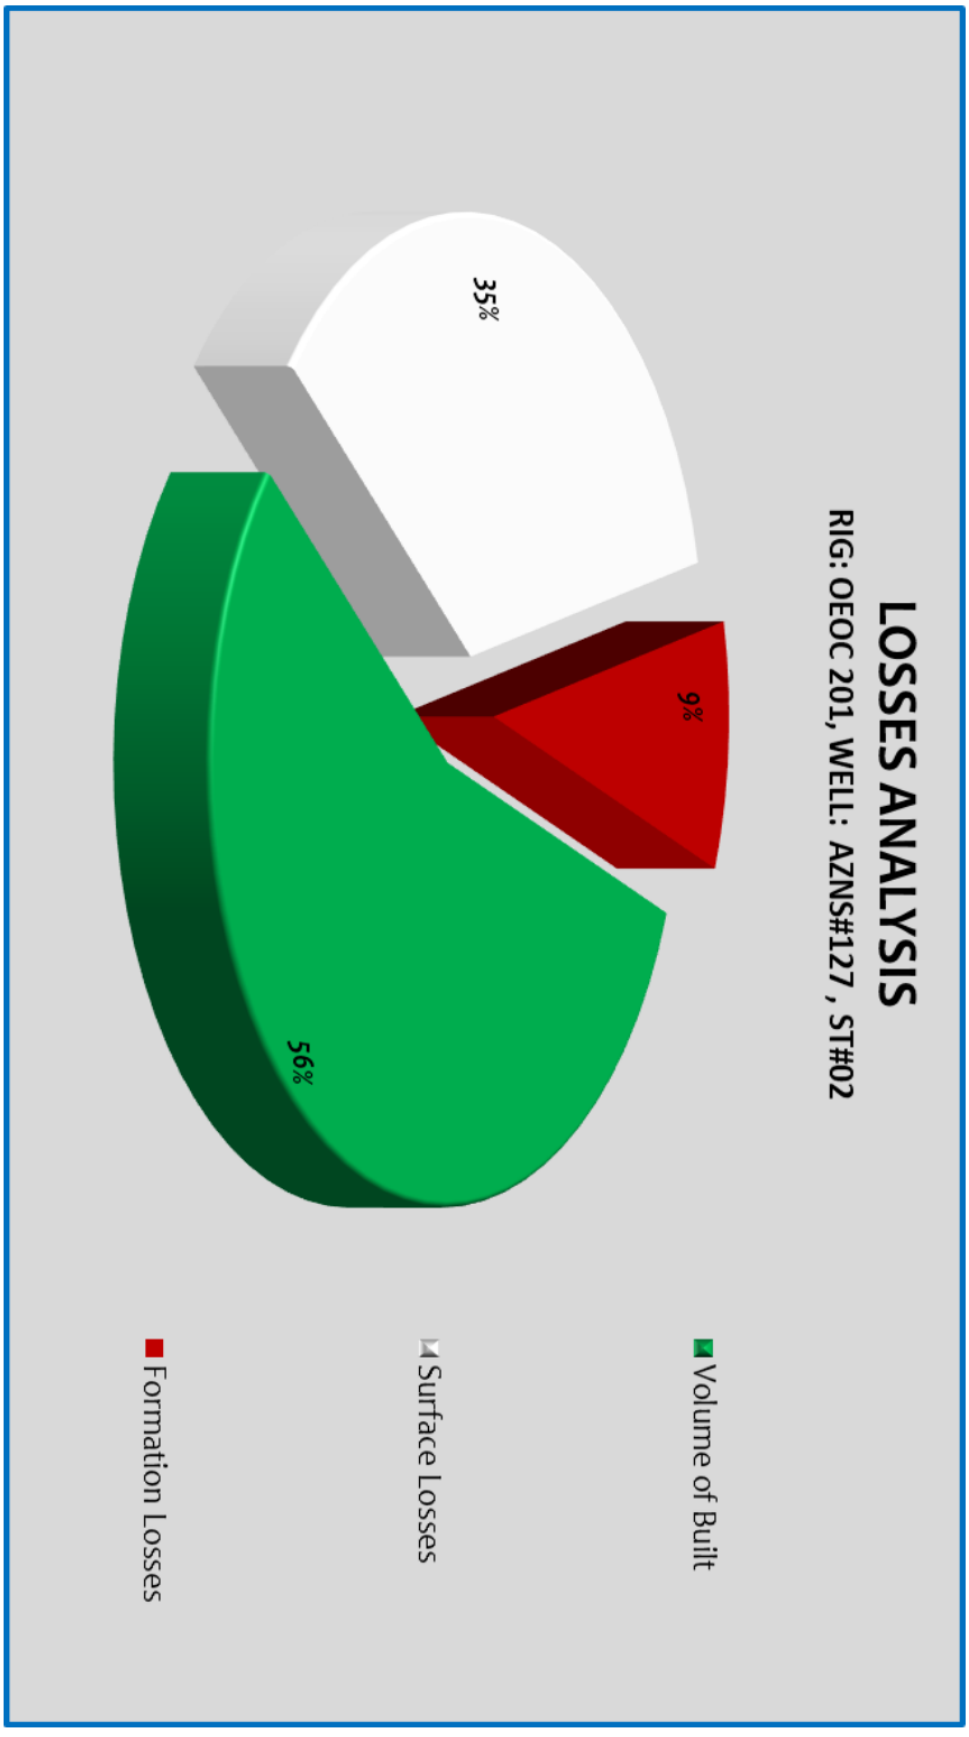

LOSSES ANALYSIS
RIG: OEOC 201, WELL: AZNS#127 , ST#02
35%
9%
56%
Volume of Built
Surface Losses
Formation Losses

Figure 10-10: AZNS-127 8-1/2” Losses Analysis

10.14 8 – 1/2" Interval Loss Distribution

Date/DMR.N		Volume of Built	Dump/Contamination	Shakers	Evaporation	Centrifuge	Trip	Mud cleaner	Pit Cleaning	Formation	Other
3-Apr-26	96	150.5	0	0	0	0	0	0	0	0	30
4-Apr-26	97	0.0	0	12	0	0	0	0	0	0	30
5-Apr-26	98	93.2	0	8	0	0	10	0	0	0	5
6-Apr-26	99	498.1	0	10	0	0	20	0	0	0	40
7-Apr-26	100	488.4	0	12	0	0	0	0	8	0	20
8-Apr-26	101	159.3	100	15	0	0	0	0	100	0	20
9-Apr-26	102	292.1	0	0	0	0	0	0	0	0	0
10-Apr-26	103	126.0	0	10	0	0	0	0	0	0	0
11-Apr-26	104	0.2	0	10	0	0	10	0	0	0	0
12-Apr-26	105	111.2	0	17	0	0	20	0	20	0	0
13-Apr-26	106	0.0	0	0	0	0	10	0	10	0	0
14-Apr-26	107	50.3	0	0	0	0	40	0	10	0	0
15-Apr-26	108	23.1	0	20	0	0	10	0	10	0	0
16-Apr-26	109	0.1	0	0	0	0	14	0	0	0	25
17-Apr-26	110	0.1	0	0	0	0	12	0	0	0	0
18-Apr-26	111	367.4	584	0	0	0	0	0	0	0	0
19-Apr-26	112	6.4	105	0	0	0	90	0	25	0	0
20-Apr-26	113	164.9	0	40	0	0	0	0	0	16	15
21-Apr-26	114	151.1	0	35	0	20	0	0	20	48	0
22-Apr-26	115	97.4	0	35	0	48	0	0	20	45	0
23-Apr-26	116	158.5	0	35	0	42	0	0	20	45	0
24-Apr-26	117	0.0	50	0	0	0	50	0	20	24	0
25-Apr-26	118	323.5	0	20	0	0	0	0	20	45	0
26-Apr-26	119	185.0	0	24	0	0	0	0	0	48	0
27-Apr-26	120	125.3	10	30	5	0	0	0	0	48	0
28-Apr-26	121	159.7	0	20	0	8	20	0	0	30	0
29-Apr-26	122	0.1	40	0	0	0	130	0	10	20	10
30-Apr-26	123	170.5	0	10	5	12	0	0	0	20	0
1-May-26	124	150.1	0	18	7	20	40	0	0	20	0
2-May-26	125	28.6	0	10	7	8	10	0	0	0	0
3-May-26	126	31.9	10	24	8	16	0	0	0	56	0
4-May-26	127	129.7	30	12	0	12	55	0	10	25	0
5-May-26	128	15.3	0	12	8	14	0	0	10	12	15
6-May-26	129	135.5	0	10	7	4	50	0	10	27	0
7-May-26	130	5.6	20	10	8	12	0	0	0	10	0
8-May-26	131	169.9	20	30	8	30	0	0	0	70	10
9-May-26	132	17.0	0	15	8	0	0	0	0	70	0
10-May-26	133	30.0	0	0	0	0	0	0	0	50	0
11-May-26	134	90.1	50	2	0	0	0	0	0	30	0
Total (bbl)		Volume of Built	Dump/Contaminate	Shakers	Evaporation	Centrifuge	Trip	Mud cleaner	Pit Cleaning	Formation	Other
		4,706.1	1,019	506	71	246	591	0	323	759	220.0

Table 10-13: AZNS-127 8-1/2" Interval Loss Distribution

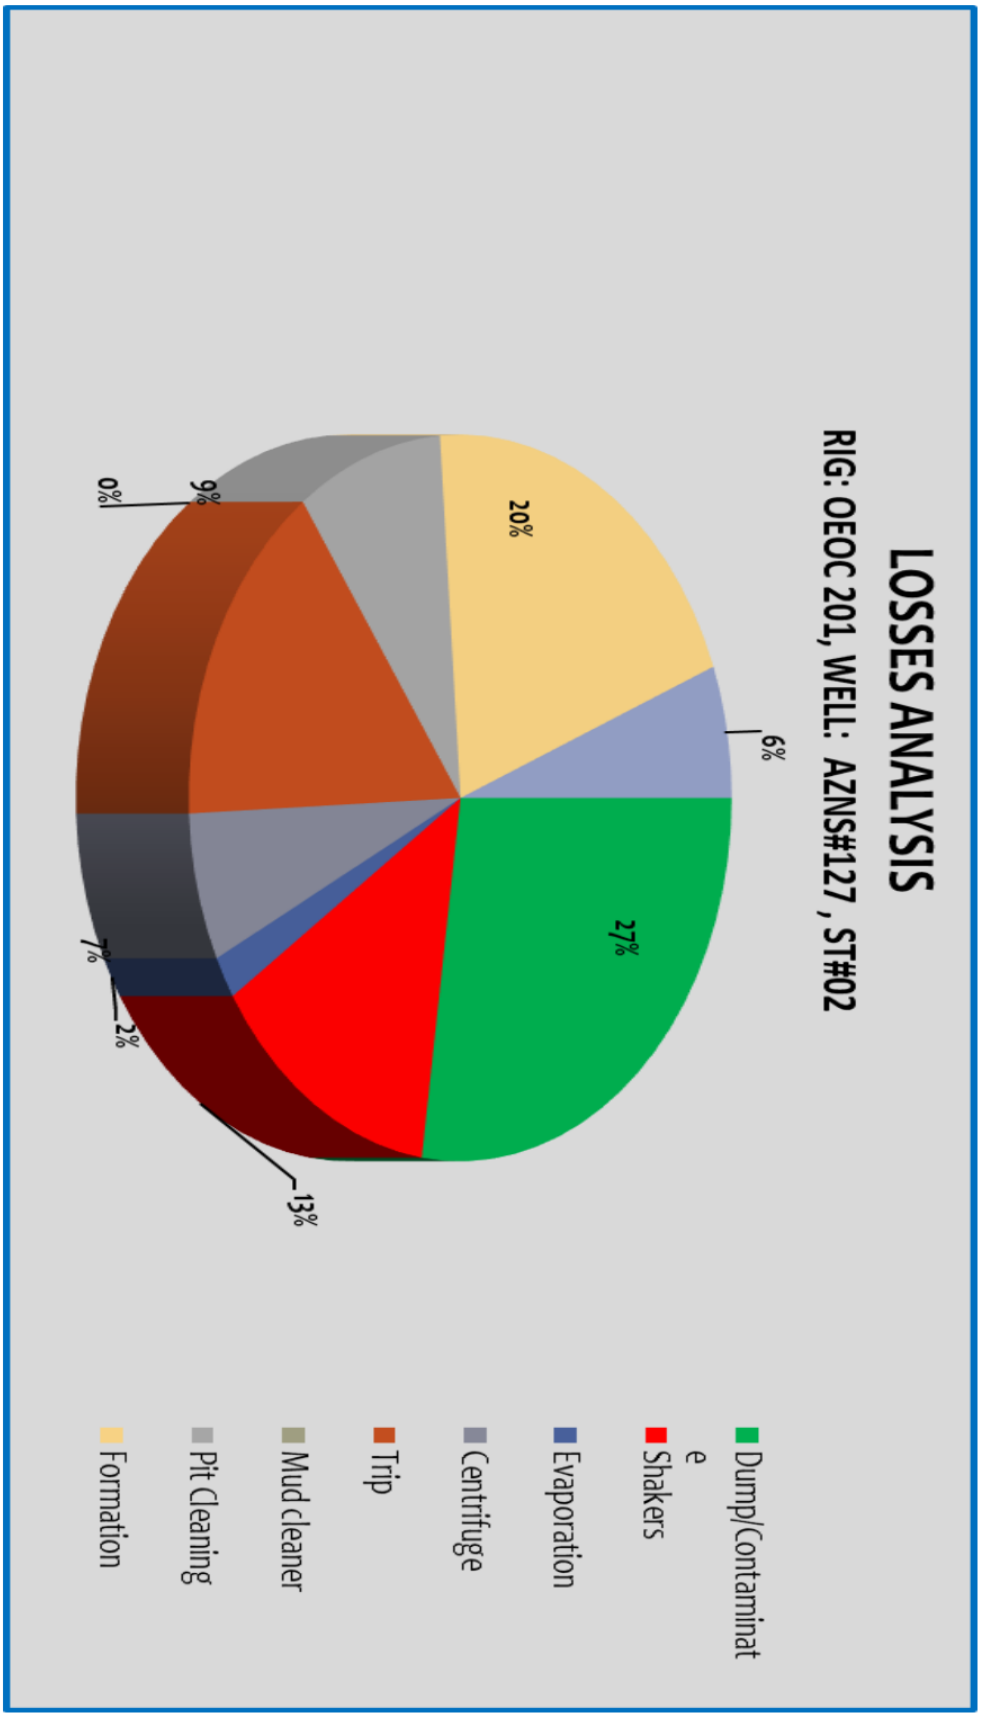

LOSSES ANALYSIS
RIG: OEOC 201, WELL: AZNS#127 , ST#02
20%
6%
27%
13%
2%
7%
0%
9%
Dump/Contaminate
Shakers
Evaporation
Centrifuge
Trip
Mud cleaner
Pit Cleaning
Formation

Figure 10-11: AZNS-127 8-1/2” Losses Analysis

10.15 8 – 1/2” Interval Fluid Properties Recap

Date	DEPTH	Density	VIS	PV	YP	Water Loss	pH	Solid %	Chloride	KCL (%Wt)	Calcium	Total Hardness	Mud Type
3-Apr-26	4,140	104	52	30	14	17	10	27	180,000		960	1,040	SALT/POL MUD
4-Apr-26	4,140	104	52	30	14	17	10	27	180,000		960	1,040	SALT/POL MUD
5-Apr-26	4,140	104	45	25	11	17	10	24	175,000		960	1,040	SALT/POL MUD
6-Apr-26	4,140	102	42	19	8	35	10	24	175,000		1,000	1,200	SALT/POL MUD
7-Apr-26	4,140	103	42	19	8	35	10	24	175,000		1,000	1,200	SALT/POL MUD
8-Apr-26	4,140	80	42	13	8	7	9	17	175,000		1,200	1,400	SALT/POL MUD
9-Apr-26	4,140	80	42	13	8	7	9	17	175,000		1,200	1,400	SALT/POL MUD
10-Apr-26	4,140	80	42	13	8	7	9	17	175,000		1,200	1,400	SALT/POL MUD
11-Apr-26	3,056	80	42	13	8	7	9	17	175,000		1,200	1,400	SALT/POL MUD
12-Apr-26	3,056	80	42	13	8	3	9	17	180,000		1,200	1,400	SALT/POL MUD
13-Apr-26	3,056	80	42	13	8	3	9	17	180,000		1,200	1,400	SALT/POL MUD
14-Apr-26	3,056	80	42	13	8	3	9	17	180,000		1,200	1,400	SALT/POL MUD
15-Apr-26	3,060	80	42	12	8	3	10	17	180,000		1,400	1,600	SALT/POL MUD
16-Apr-26	3,060	80	42	12	8	3	10	17	180,000		1,400	1,600	SALT/POL MUD
17-Apr-26	3,065	80	43	11	10	3	10	17	180,000		1,400	1,600	SALT/POL MUD
18-Apr-26	3,090	80	40	8	9	3	10	17	180,000	5	1,400	1,600	Kcl Poly Mud
19-Apr-26	3,090	80	40	8	9	3	10	17	180,000	5	1,400	1,600	Kcl Poly Mud
20-Apr-26	3,137	80	40	8	9	2	10	17	172,000	5	1,400	1,600	Kcl Poly Mud
21-Apr-26	3,212	80	42	10	10	2	10	17	172,000	5	1,400	1,600	Kcl Poly Mud
22-Apr-26	3,270	80	41	11	12	2	10	17	172,000	5	1,400	1,600	Kcl Poly Mud
23-Apr-26	3,324	80	42	11	13	2	10	17	172,000	5	1,400	1,600	Kcl Poly Mud
24-Apr-26	3,324	80	42	11	13	2	10	17	172,000	5	1,280	1,400	Kcl Poly Mud
25-Apr-26	3,411	80	42	12	13	3	10	17	172,000	5	1,280	1,400	Kcl Poly Mud
26-Apr-26	3,411	80	42	12	13	3	10	17	172,000	5	1,280	1,400	Kcl Poly Mud
27-Apr-26	3,571	80	42	12	13	2	10	17	172,000	5	1,240	1,360	Kcl Poly Mud
28-Apr-26	3,571	80	43	13	15	2	10	17	174,000	5	1,240	1,360	Kcl Poly Mud
29-Apr-26	3,571	80	43	13	15	2	10	17	174,000	5	1,240	1,360	Kcl Poly Mud
30-Apr-26	3,684	80	42	14	13	2	10	17	174,000	5	1,280	1,400	Kcl Poly Mud
1-May-26	3,738	80	43	14	15	2	10	17	174,000	5	1,280	1,400	Kcl Poly Mud
2-May-26	3,762	81	43	14	15	2	10	18	176,000	5	1,720	1,880	Kcl Poly Mud
3-May-26	3,788	81	42	13	14	2	10	18	176,000	5	1,800	1,920	Kcl Poly Mud
4-May-26	3,792	81	42	13	14	2	10	18	176,000	5	1,800	1,920	Kcl Poly Mud
5-May-26	3,810	81	42	13	14	2	10	18	172,000	5	1,880	2,000	Kcl Poly Mud
6-May-26	3,810	81	42	15	14	2	10	18	172,000	5	1,880	2,000	Kcl Poly Mud
7-May-26	3,823	81	42	15	14	2	10	18	172,000	5	1,920	2,040	Kcl Poly Mud
8-May-26	3,890	81	42	14	13	2	10	18	172,000	5	1,920	2,040	Kcl Poly Mud
9-May-26	3,890	81	44	16	13	2	10	18	174,000	5	1,920	2,040	Kcl Poly Mud
10-May-26	3,890	81	44	16	13	2	10	18	174,000	5	1,920	2,040	Kcl Poly Mud
11-May-26	3,890	81	44	16	13	2	10	18	174,000	5	1,920	2,040	Kcl Poly Mud
Drilling Start													
Drilling End													

Table 10-14: AZNS-127 8-1/2” Interval Fluid Properties

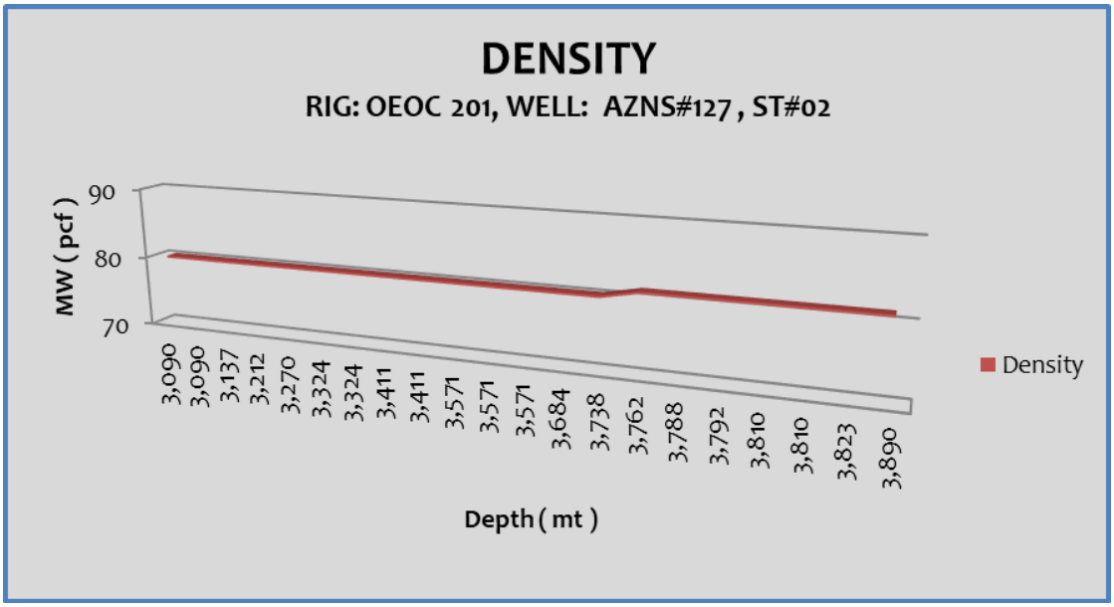


Figure 10-12: AZNS-127 8-1/2" Density Graph

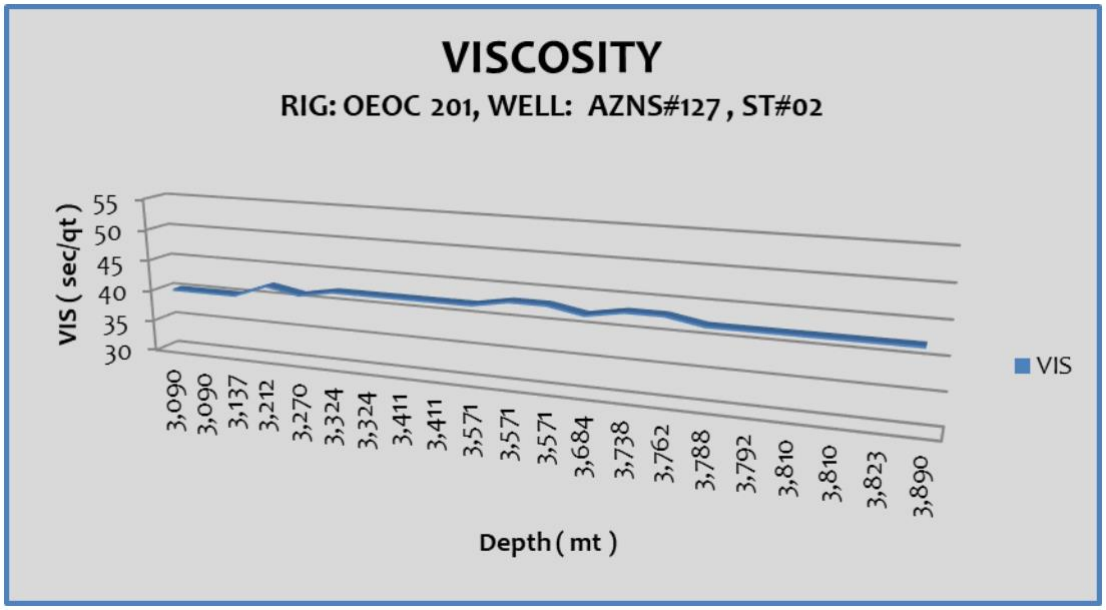


Figure 10-13: AZNS-127 8-1/2" Viscosity Graph

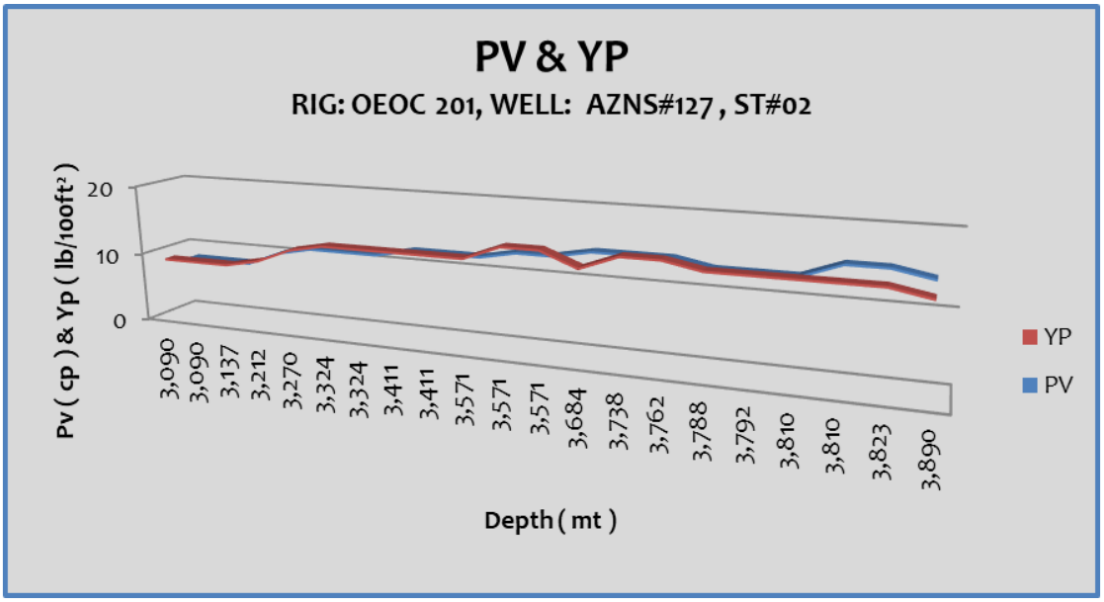


Figure 10-14: AZNS-127 8-1/2" PV & YP Graph

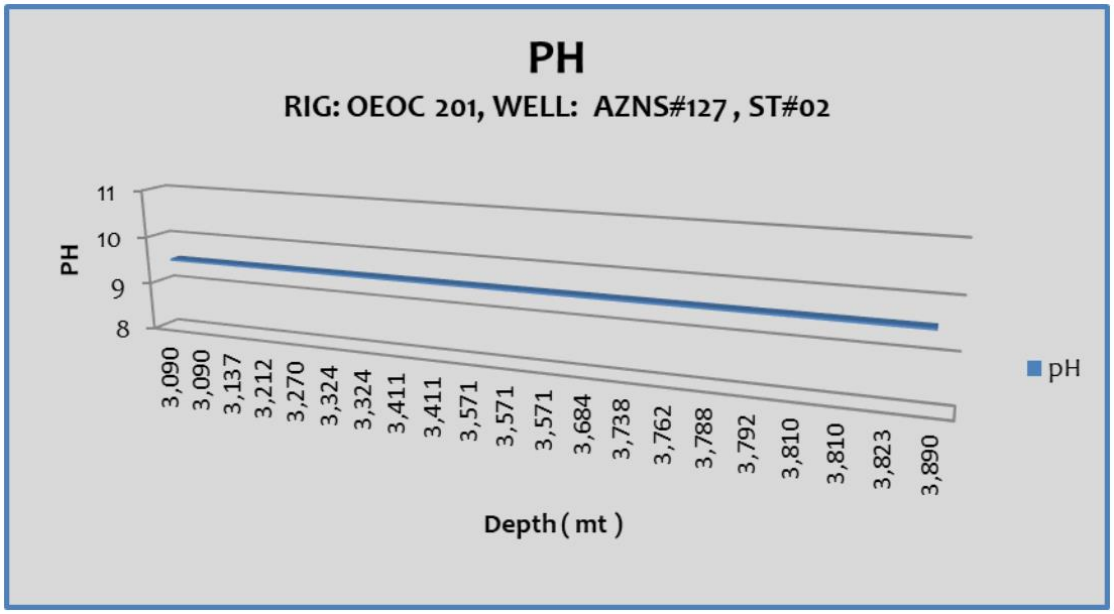


Figure 10-15: AZNS-127 8-1/2" PH Graph

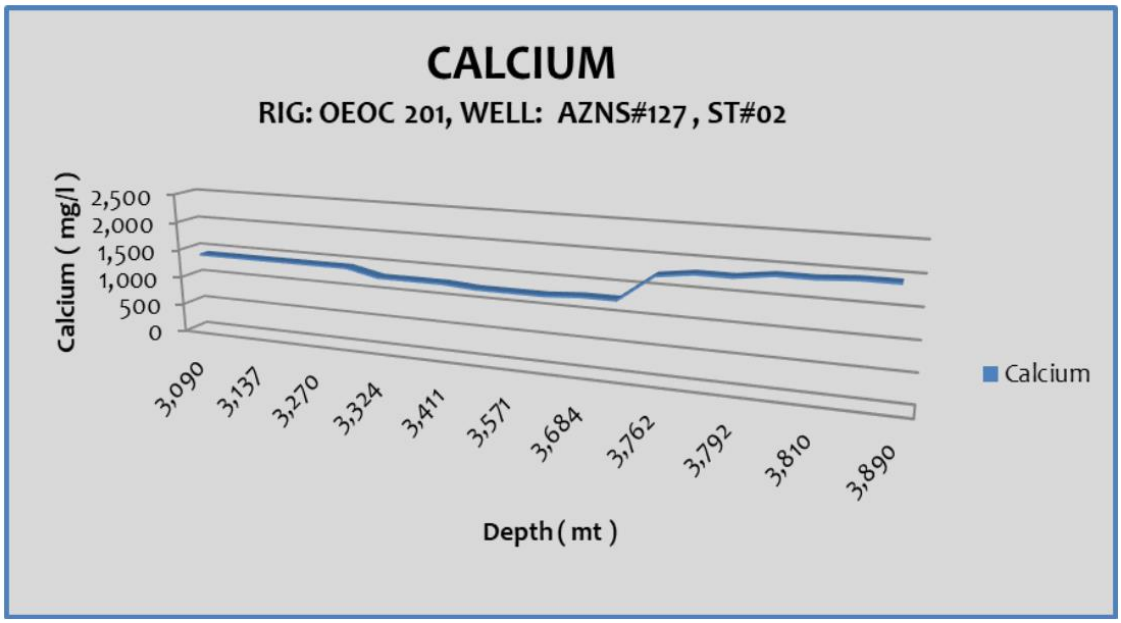


Figure 10-16: AZNS-127 8-1/2" Calcium Graph

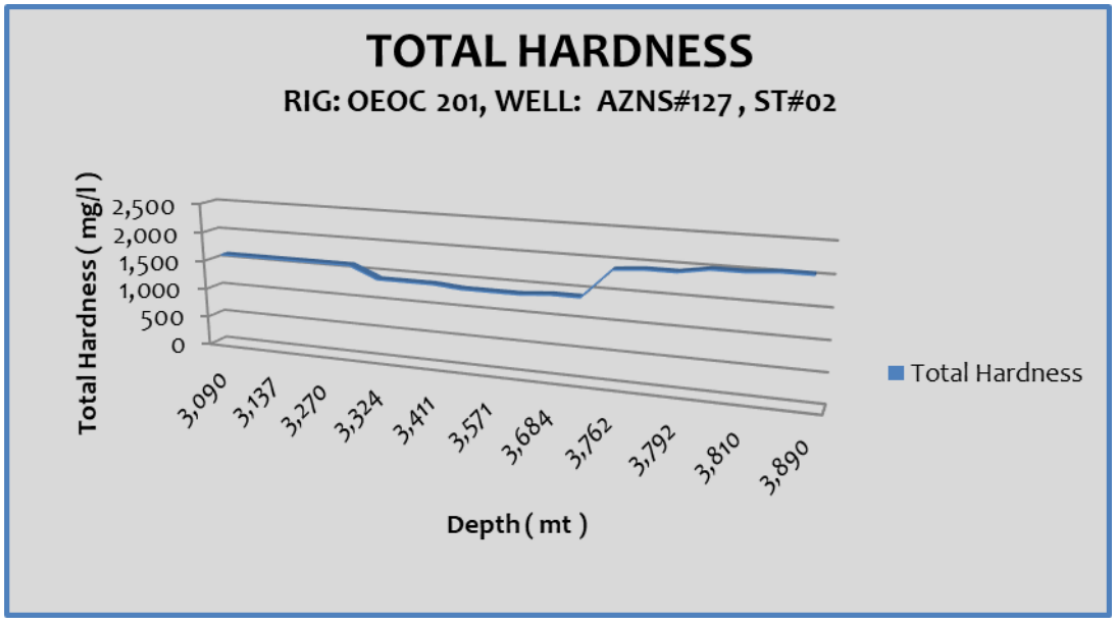


Figure 10-17: AZNS-127 8-1/2" Total Hardness Graph

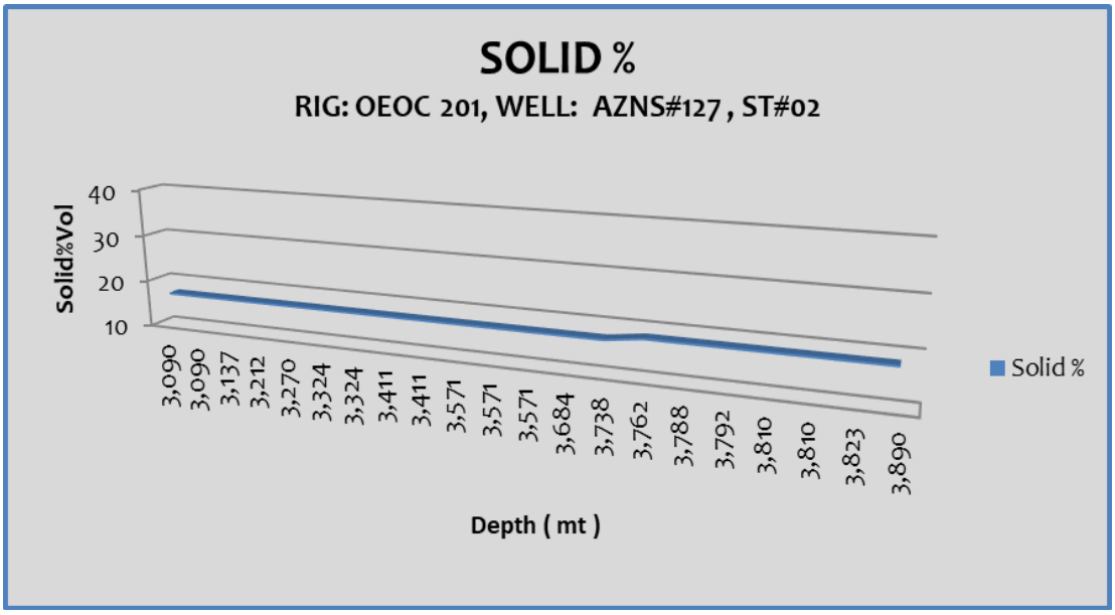


Figure 10-18: AZNS-127 8-1/2" Solid% Graph

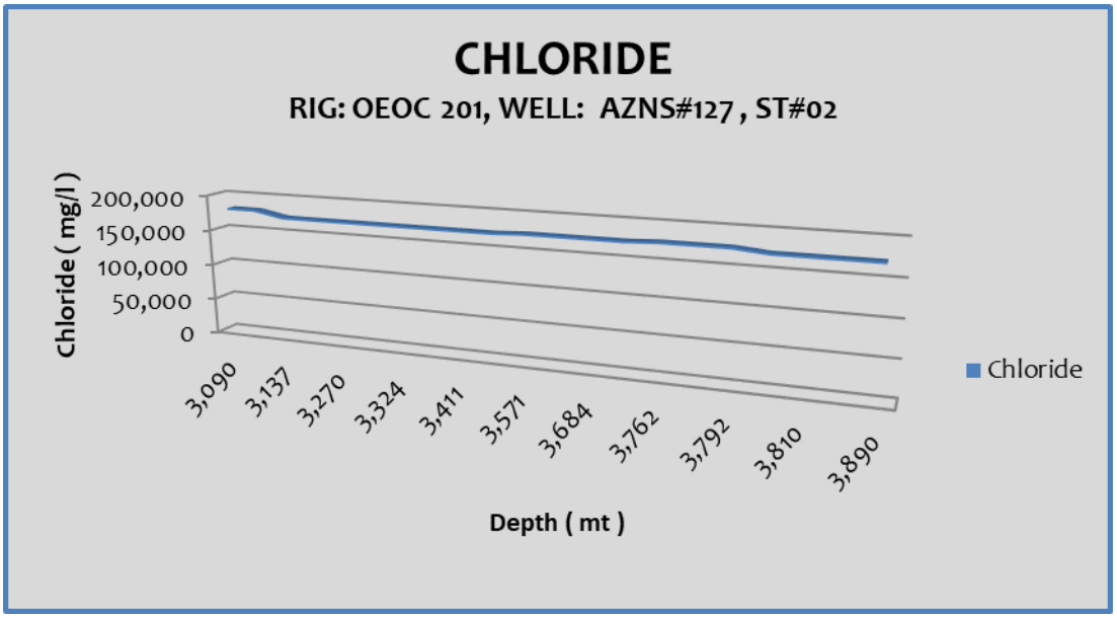


Figure 10-19: AZNS-127 8-1/2" Chloride Graph

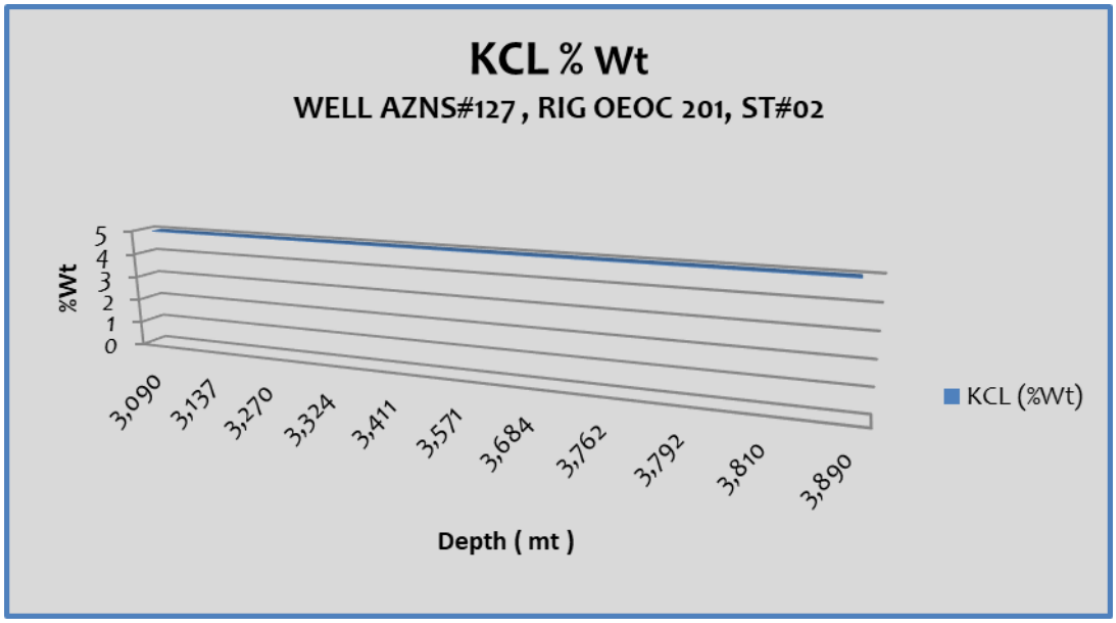


Figure 10-20: AZNS-127 8-1/2" KCl % Wt Graph

10.16 8 – ½" Hole Section Solid Control Disscusion

Rig OEOC 208 has 3 shale shakers were dressed with:

Shaker#1: 100-200 Mesh Screen

Shaker#2: 100-200 Mesh Screen

Shaker#3: 100-200 Mesh Screen

RIG: OEOC 201, WELL: AZNS#127 , ST#02 Solid Control Equipment Working Hr.s	
Derrick Shaker #1	593
Derrick Shaker #2	539
Derrick Shaker #3	86
Centrifuge # 01	131
Centrifuge # 02	266

Table 10-15: AZNS-127 8-1/2" Solid Control Desscusion

10.17 6 – 1/8” Hole Section Drilling Fluid Types

FLUID PROPERTIES RECAP					
		Drilling start	Range		Drilling End
MW (min)	pcf	104	104	105.0	105.0
Funnel Viscosity	sec/qt	46	46	52	52
PV	cps	26	26	32	29
YP	lb/100sq.ft	14	12	14	12
API Fluid loss	cc	2	1.8	2	1.8
pH		10	9.5	10.0	9.5
KCL	%	5	4.2	5	4.2
Cl (NaCl)	mg/L	172,000	172,000	178,000	178,000
Total Hardness	mg/L	2,280	2,000	2,280	2,000
Ca Hardness	mg/L	2,200	1,920	2,200	1,920

Table 10-16: AZNS-127 6-1/8” Fluid Properties Recap Table

10.18 6-1/8” Interval Material Consumption Analysis

Products	Units Used	Unit wt lbs	Total wt		Effective Concentration	
Hematite	79	3,300	260,700	lbs	156.80	ppb
Caustic Soda	5	55	275	lbs	0.17	ppb
Limestone	218	2,200	479,600	lbs	288.46	ppb
Citric acid	28	55	1,540	lbs	0.93	ppb
KCL	1	2,200	2,200	lbs	1.32	ppb
Starch LV	232	55	12,760	lbs	7.67	ppb
Sodium Bicarbonate	39	55	2,145	lbs	1.29	ppb
Xantan gum	27	55	1,485	lbs	0.89	ppb
Salt (NACL)	30	2,200	66,000	lbs	39.70	ppb
Soda Ash	4	110	440	lbs	0.26	ppb
Lime	54	55	2,970	lbs	1.79	ppb

Note: The effective concentrations shown in this table are calculated based only on the mud volume built during the current section. Materials added for the treatment of mud transferred from the previous hole section are included in the material consumption; however,the transferred mud volume is not included in the concentration calculation. Therefore, the actual concentrations in the active mud system are lower than the concentrations reported in this table.

Initial Volume	1,655.0	bbl
Total Volume Built	1,662.6	bbl
Volume received	0.0	bbl
Left In Hole	0.0	bbl
Total Volume Consumed	2,426	bbl
Volume Transfer to Next Section	891.6	bbl
Meter Drilled	260.0	m

Table 10-17: AZNS-127 6-1/8” Interval Material Consumption Analysis

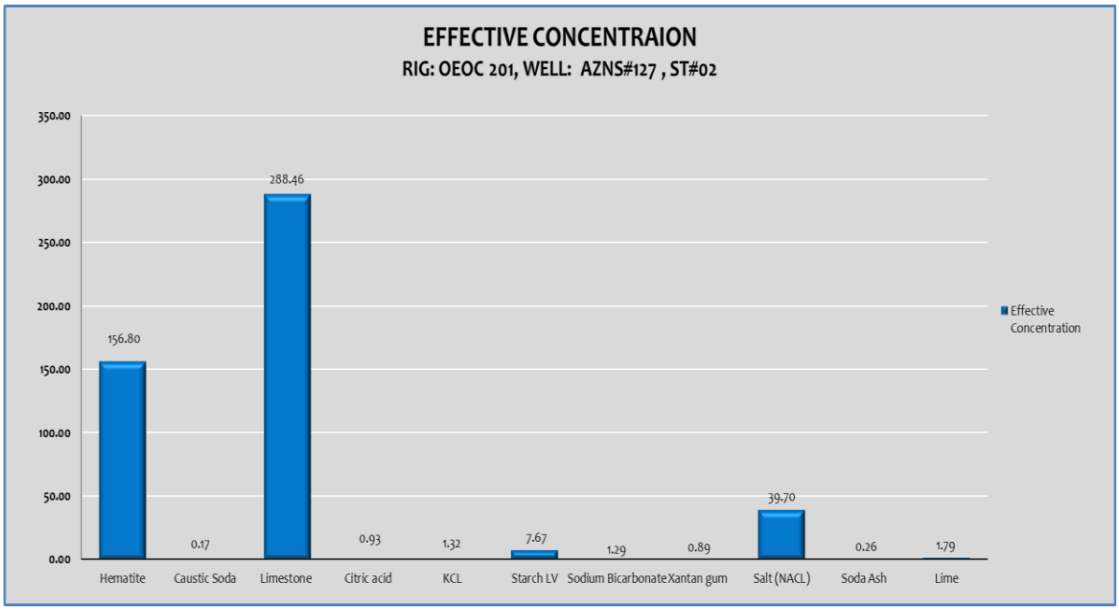


Figure 10-21: AZNS-127 6-1/8" Effective Concentration

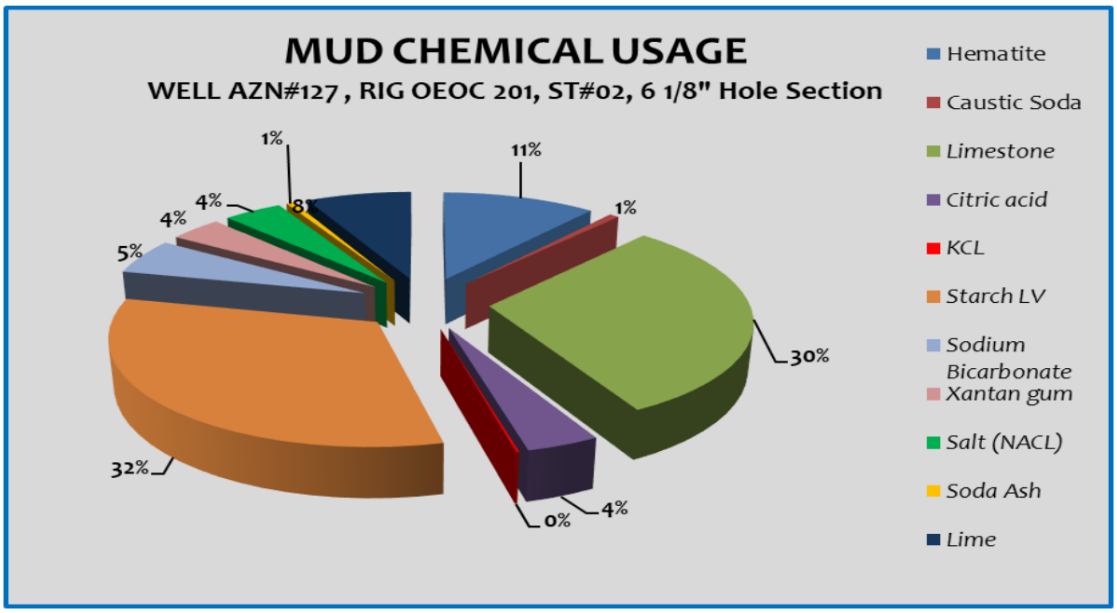


Figure 10-22: AZNS-127 6-1/8" Mud Chemical Usage

10.19 6-1/8" Interval Volume Analysis

RIG: OEOC 201, WELL: AZNS#75 , Re-Entry VOLUME ANALYSIS		
Initial Volume	bbls	1,655.0
Received Volume	bbls	0.0
Volume Built	bbls	1,662.6
Surface Losses/Dumped	bbls	2,396.0
Left In Hole	bbls	0.0
Formation Losses	bbls	30.0
Total Losses	bbls	2,426.0
Volume Transfer Out	bbls	891.6

Table 10-18: AZNS-127 6-1/8" Interval Volume Analysis

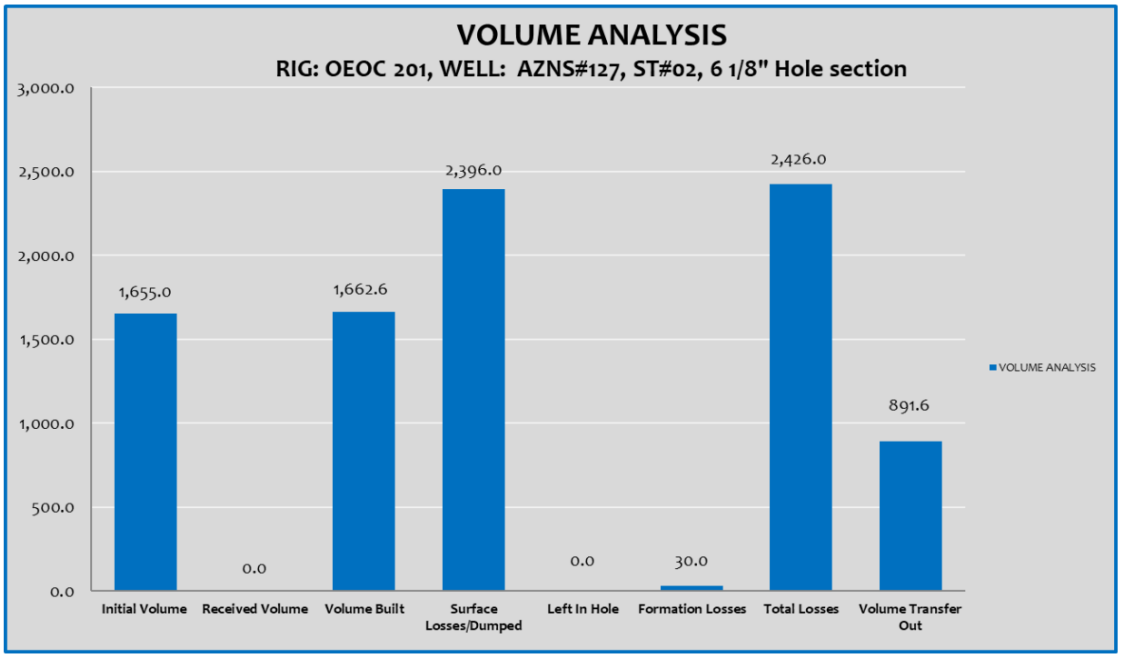


Figure 10-23: AZNS-127 6-1/8" Interval Volume Analysis

10.20 6-1/8” Interval Daily Volume Breakdown

Date/DMR.N		Volume of Built	Surface Losses	Formation Losses
12-May-26	135	0.4	143	0
13-May-26	136	0.0	59	0
14-May-26	137	0.1	56	0
15-May-26	138	0.0	49	0
16-May-26	139	90.0	13	0
17-May-26	140	0.0	20	0
18-May-26	141	0.0	0	0
19-May-26	142	0.0	0	0
20-May-26	143	0.2	4	0
21-May-26	144	88.8	30	0
22-May-26	145	0.1	34	0
23-May-26	146	0.0	45	0
24-May-26	147	437.1	33	0
25-May-26	148	19.5	35	0
26-May-26	149	82.2	53	0
27-May-26	150	54.4	88	30
28-May-26	151	69.7	58	0
29-May-26	152	0.3	73	0
30-May-26	153	5.3	18	0
31-May-26	154	2.4	283	0
1-Jun-26	155	0.0	21	0
2-Jun-26	156	0.2	32	0
3-Jun-26	157	0.0	126	0
4-Jun-26	158	24.3	100	0
5-Jun-26	159	117.3	18	0
6-Jun-26	160	0.3	38	0
7-Jun-26	161	0.0	8	0
8-Jun-26	162	20.5	16	0
9-Jun-26	163	10.1	20	0
10-Jun-26	164	0.0	20	0
11-Jun-26	165	0.0	58	0
12-Jun-26	166	133.4	76	0

13-Jun-26	167	160.4	32	0
14-Jun-26	168	0.0	18	0
15-Jun-26	169	8.0	38	0
16-Jun-26	170	70.8	13	0
17-Jun-26	171	0.4	18	0
18-Jun-26	172	0.4	38	0
19-Jun-26	173	0.3	18	0
20-Jun-26	174	0.2	10	0
21-Jun-26	175	0.0	56	0
22-Jun-26	176	94.3	44	0
23-Jun-26	177	0.0	22	0
24-Jun-26	178	15.8	9	0
25-Jun-26	179	0.1	47	0
26-Jun-26	180	0.3	46	0
27-Jun-26	181	0.1	30	0
28-Jun-26	182	0.0	35	0
29-Jun-26	183	0.0	20	0
30-Jun-26	184	60.6	45	0
1-Jul-26	185	0.1	8	0
2-Jul-26	186	0.0	5	0
3-Jul-26	187	0.0	53	0
4-Jul-26	188	0.0	8	0
5-Jul-26	189	94.1	8	0
6-Jul-26	190	0.1	48	0
7-Jul-26	191	0.0	8	0
8-Jul-26	192	0.0	8	0
9-Jul-26	193	0.0	8	0
10-Jul-26	194	0.0	8	0
11-Jul-26	195	0.0	68	0
Total (bbl)		Volume of Built	Surface Losses	Formation Losses
		1,663	2,396	30

Table 10-19: AZNS-127 6-1/8" Interval Daily Volume Breakdown

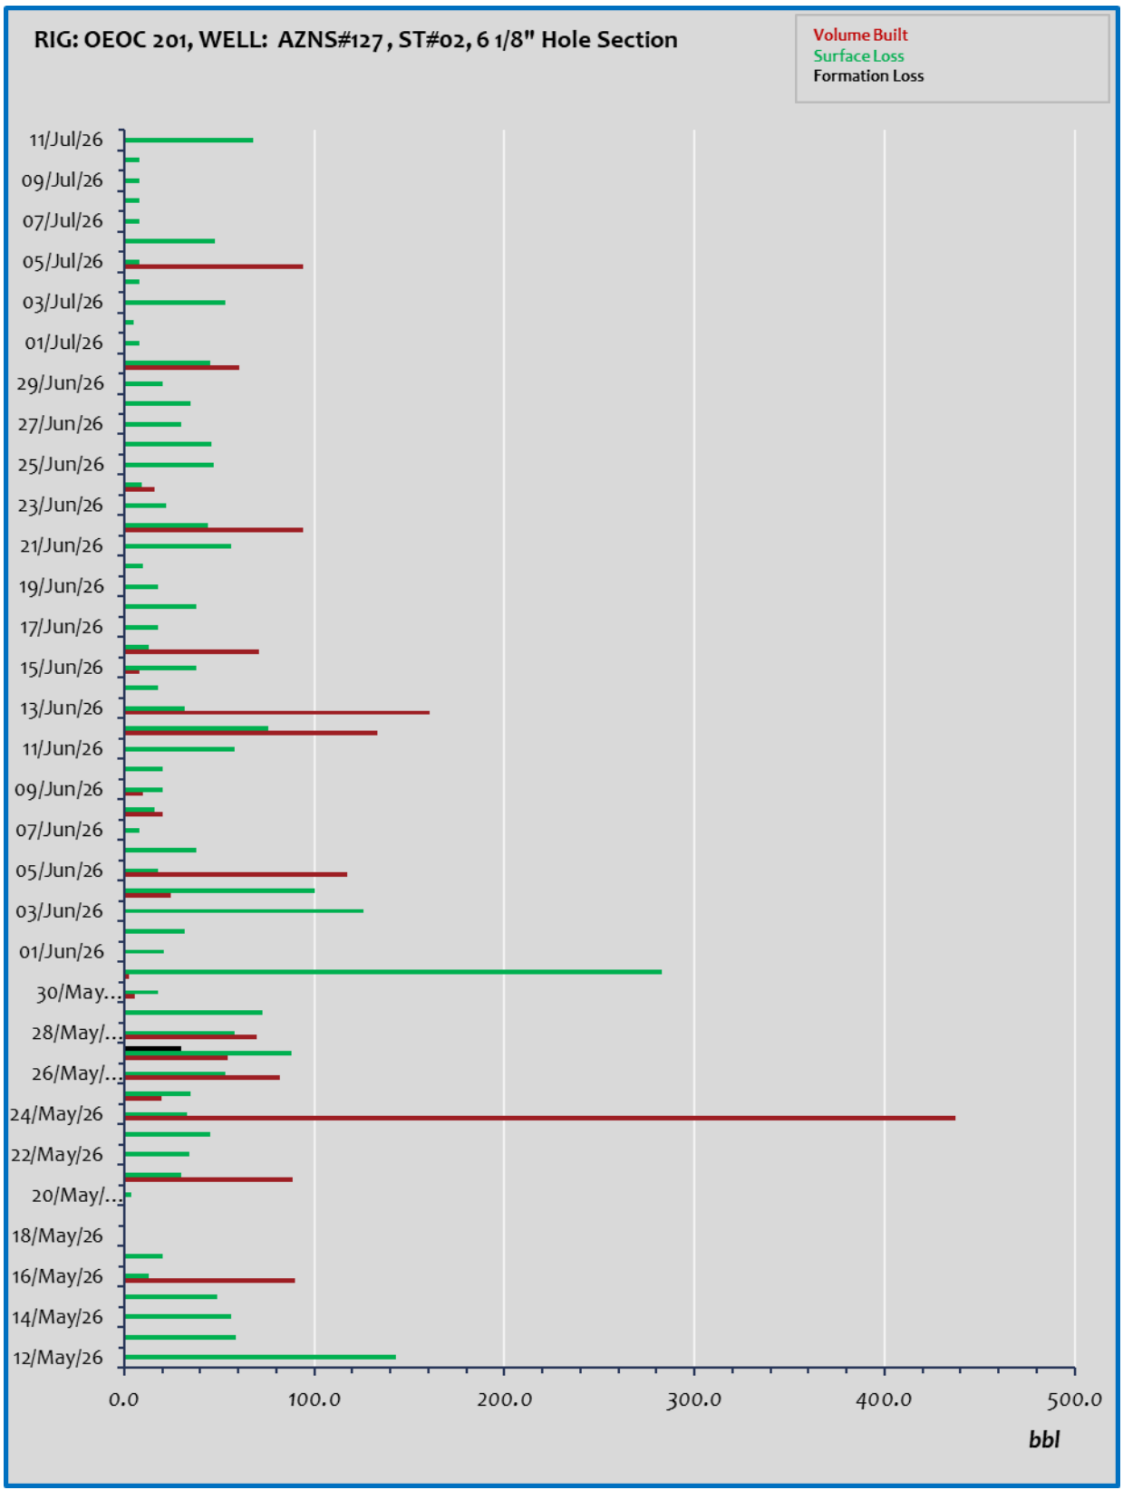


Figure 10-24: AZNS-127 6-1/8" Interval Daily Volume Breakdown

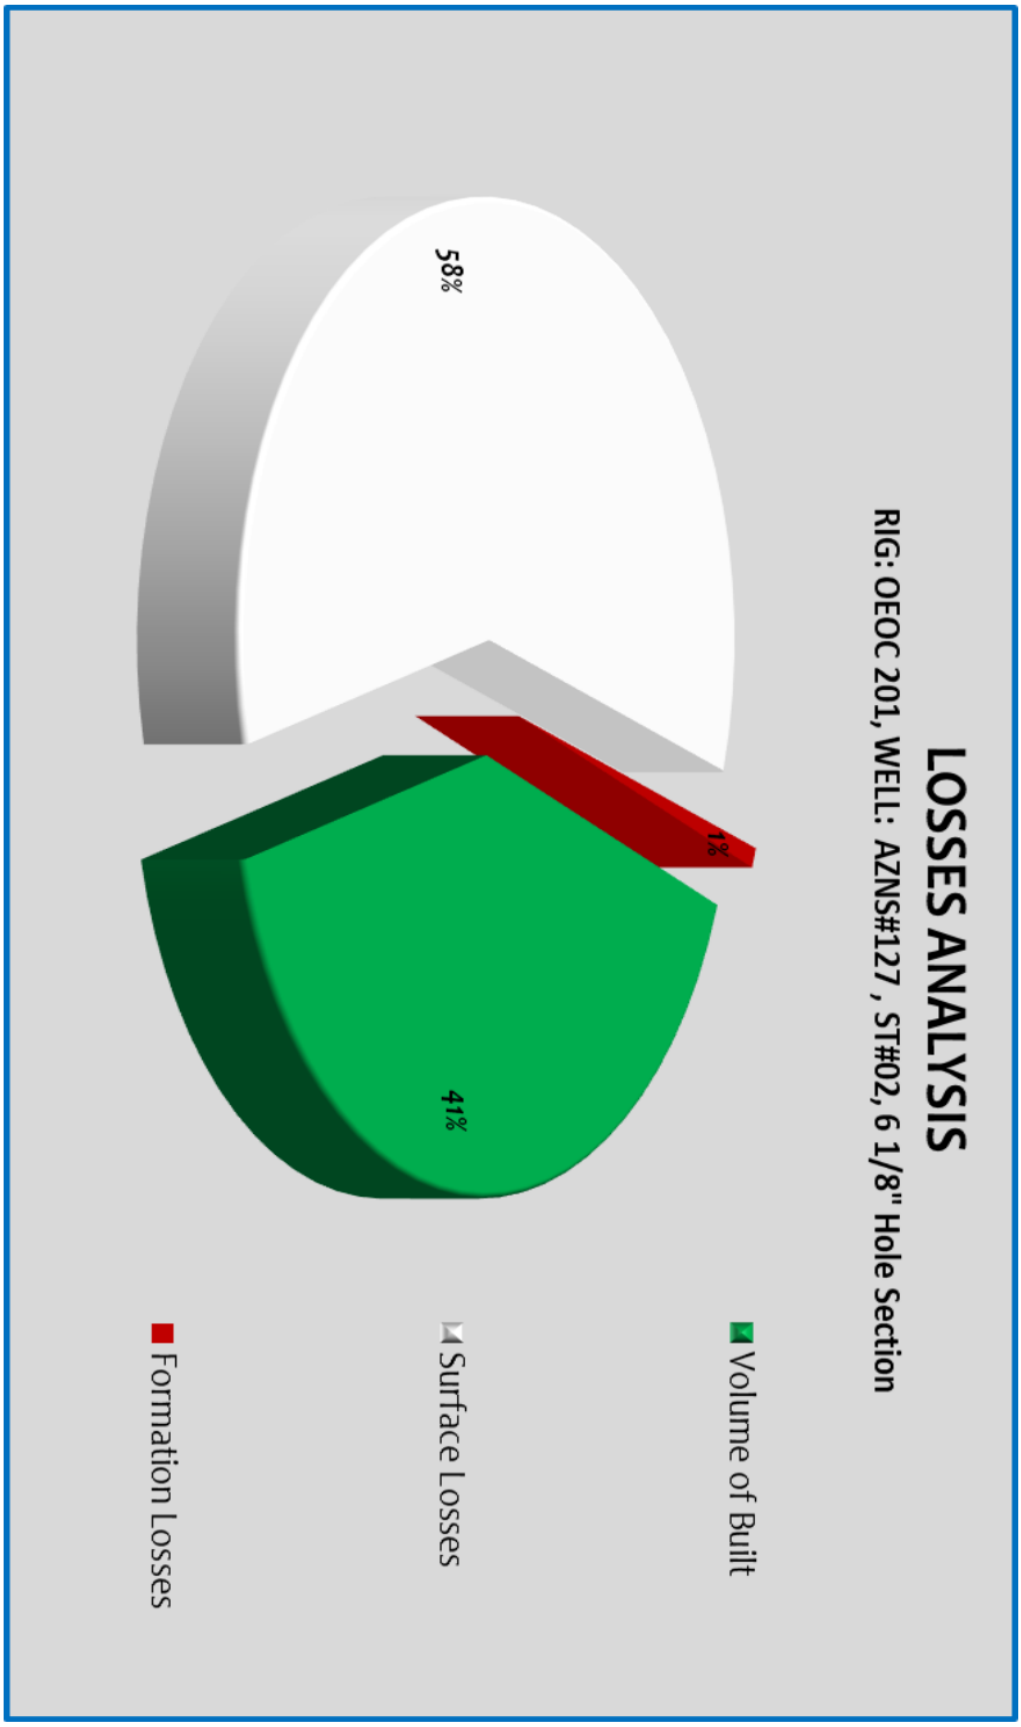

LOSSES ANALYSIS
RIG: OEOC 201, WELL: AZNS#127 , ST#02, 6 1/8" Hole Section
58%
1%
41%
Volume of Built
Surface Losses
Formation Losses

Figure 10-25: AZNS-127 6-1/8” Losses Analysis

10.21 6-1/8" Interval Loss Distribution

Date/DMR.N		Volume of Built	Dump/Contamination	Shakers	Evaporation	Centrifuge	Trip	Mud cleaner	Pit Cleaning	Formation	Other
12-May-26	135	0.4	130	7	0	0	6	0	0	0	0
13-May-26	136	0.0	47	0	2	0	10	0	0	0	0
14-May-26	137	0.1	0	20	4	0	32	0	0	0	0
15-May-26	138	0.0	0	5	4	0	25	0	0	0	15
16-May-26	139	90.0	0	2	4	0	7	0	0	0	0
17-May-26	140	0.0	0	5	5	0	10	0	0	0	0
18-May-26	141	0.0	0	0	0	0	0	0	0	0	0
19-May-26	142	0.0	0	0	0	0	0	0	0	0	0
20-May-26	143	0.2	0	0	4	0	0	0	0	0	0
21-May-26	144	88.8	0	5	5	0	0	0	0	0	20
22-May-26	145	0.1	0	4	5	0	10	0	0	0	15
23-May-26	146	0.0	0	0	5	0	10	0	30	0	0
24-May-26	147	437.1	0	8	5	0	10	0	0	0	10
25-May-26	148	19.5	0	15	5	0	0	0	0	0	15
26-May-26	149	82.2	0	10	5	0	0	0	0	0	38
27-May-26	150	54.4	0	30	8	0	0	0	0	30	50
28-May-26	151	69.7	0	30	8	0	0	0	0	0	20
29-May-26	152	0.3	0	10	8	0	35	0	0	0	20
30-May-26	153	5.3	0	10	8	0	0	0	0	0	0
31-May-26	154	2.4	200	15	8	0	40	0	20	0	0
1-Jun-26	155	0.0	0	0	8	0	0	0	0	0	13
2-Jun-26	156	0.2	0	4	8	0	10	0	0	0	10
3-Jun-26	157	0.0	108	0	8	0	0	0	10	0	0
4-Jun-26	158	24.3	87	5	8	0	0	0	0	0	0
5-Jun-26	159	117.3	0	0	8	0	0	0	10	0	0
6-Jun-26	160	0.3	0	15	8	0	0	0	0	0	15
7-Jun-26	161	0.0	0	0	8	0	0	0	0	0	0
8-Jun-26	162	20.5	0	8	8	0	0	0	0	0	0
9-Jun-26	163	10.1	0	12	8	0	0	0	0	0	0
10-Jun-26	164	0.0	0	12	8	0	0	0	0	0	0
11-Jun-26	165	0.0	0	10	8	0	10	0	0	0	30
12-Jun-26	166	133.4	0	8	8	0	30	0	30	0	0

13-Jun-26	167	160.4	0	10	8	0	14	0	0	0	0
14-Jun-26	168	0.0	0	10	8	0	0	0	0	0	0
15-Jun-26	169	8.0	0	10	8	0	0	0	0	0	20
16-Jun-26	170	70.8	0	5	8	0	0	0	0	0	0
17-Jun-26	171	0.4	0	10	8	0	0	0	0	0	0
18-Jun-26	172	0.4	0	10	8	0	5	0	0	0	15
19-Jun-26	173	0.3	0	10	8	0	0	0	0	0	0
20-Jun-26	174	0.2	0	0	0	0	10	0	0	0	0
21-Jun-26	175	0.0	0	0	8	0	38	0	0	0	10
22-Jun-26	176	94.3	0	0	8	0	36	0	0	0	0
23-Jun-26	177	0.0	0	0	7	0	0	0	0	0	15
24-Jun-26	178	15.8	0	4	5	0	0	0	0	0	0
25-Jun-26	179	0.1	42		5	0	0	0	0	0	0
26-Jun-26	180	0.3	0	8	8	0	15	0	15	0	0
27-Jun-26	181	0.1	0	5	5	0	15	0	0	0	5
28-Jun-26	182	0.0	0	0	5	0	15	0	0	0	15
29-Jun-26	183	0.0	0	5	0	0	15	0	0	0	0
30-Jun-26	184	60.6	0	5	0	0	10	0	30	0	0
1-Jul-26	185	0.1	0	0	8	0	0	0	0	0	0
2-Jul-26	186	0.0	0	0	5	0	0	0	0	0	0
3-Jul-26	187	0.0	0	0	8	0	0	0	30	0	15
4-Jul-26	188	0.0	0	0	8	0	0	0	0	0	0
5-Jul-26	189	94.1	0	0	8	0	0	0	0	0	0
6-Jul-26	190	0.1	0	10	8	0	10	0	0	0	20
7-Jul-26	191	0.0	0	0	8	0	0	0	0	0	0
8-Jul-26	192	0.0	0	0	8	0	0	0	0	0	0
9-Jul-26	193	0.0	0	0	8	0	0	0	0	0	0
10-Jul-26	194	0.0	0	0	8	0	0	0	0	0	0
11-Jul-26	195	0.0	40	0	8	0	0	0	0	0	20
Total (bbl)		Volume of Built	Dump/Contaminate	Shakers	Evaporation	Centrifuge	Trip	Mud cleaner	Pit Cleaning	Formation	Other
		1,662.6	654	352	381	0	428	0	175	30	406.0

Note: Prepared 621.1 bbl Caco3 Mud as Spacer + CaBr2 (DMR#195) that is consider in completion fluid section.

Table 10-20: AZNS-127 6-1/8" Interval Loss Distribution

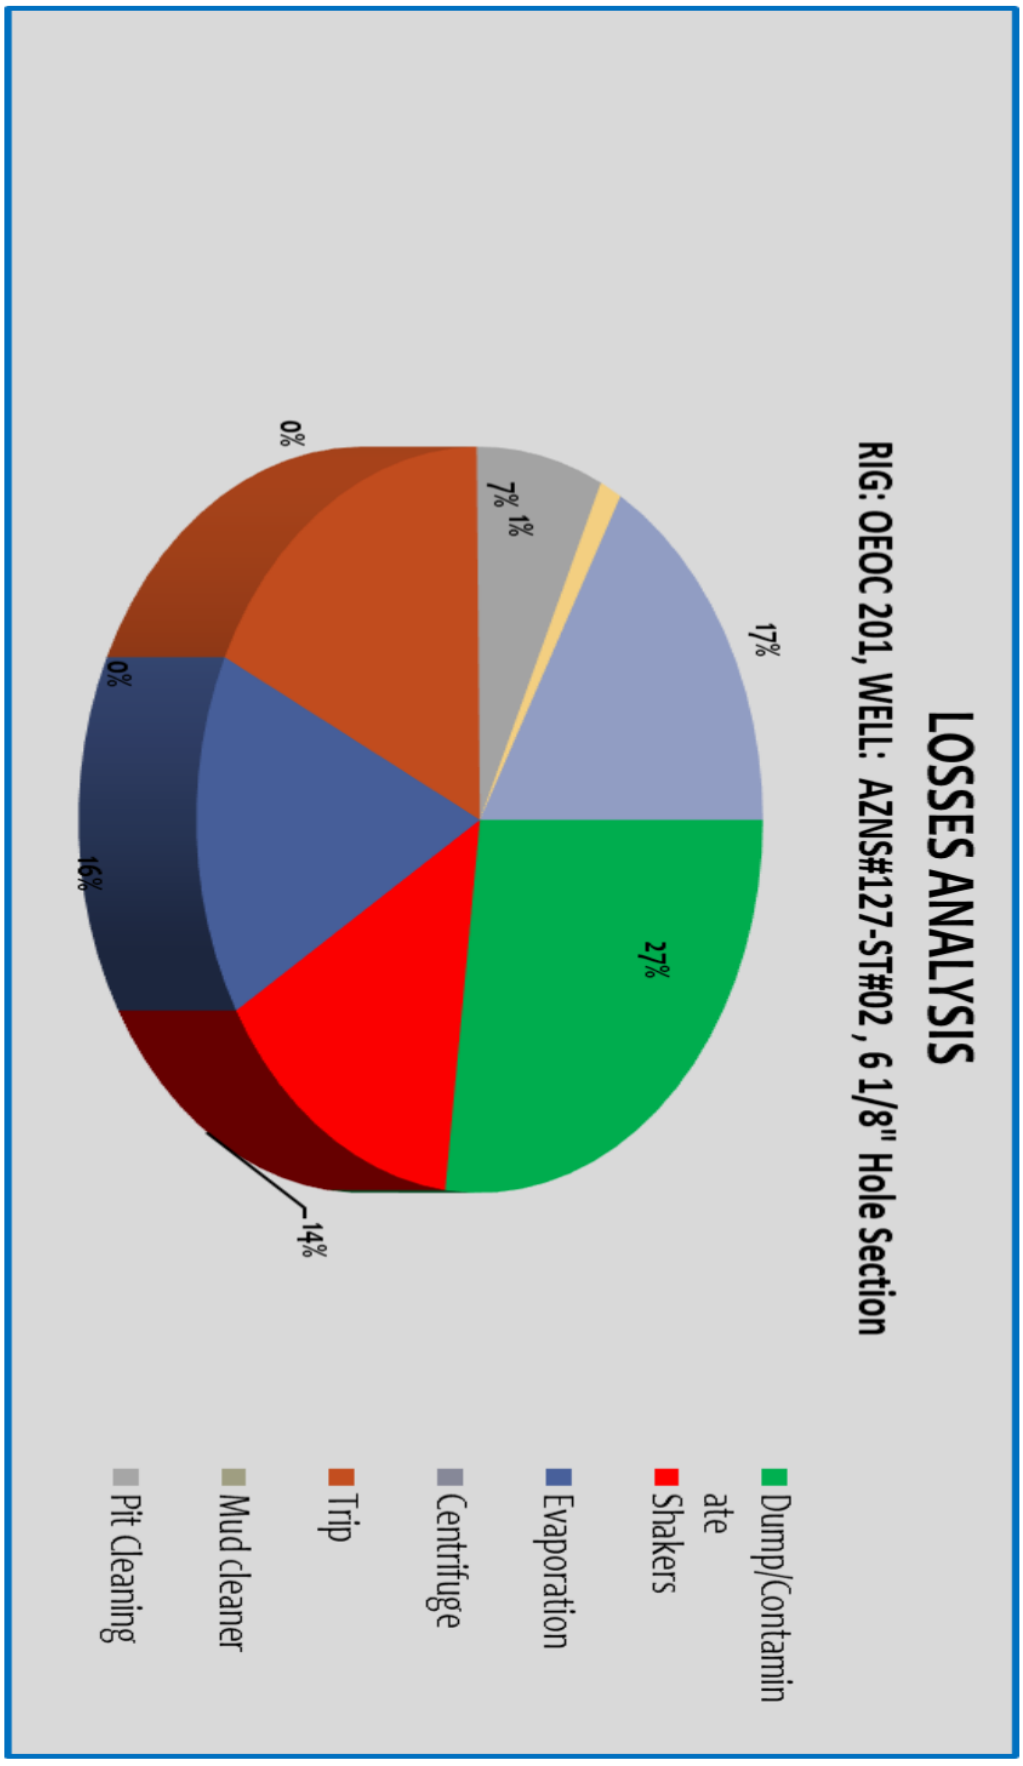

LOSSES ANALYSIS
RIG: OEOC 201, WELL: AZNS#127-ST#02 , 6 1/8" Hole Section
17%
27%
14%
16%
0%
0%
7%
1%
Dump/Contamin ate
Shakers
Evaporation
Centrifuge
Trip
Mud cleaner
Pit Cleaning

Figure 10-26: AZNS-127 6-1/8” Losses Analysis

10.22 6-1/8" Interval Fluid Properties Recap

Date	DEPTH	Density	VIS	PV	YP	Water Loss	pH	Chloride	KCL (%Wt)	Calcium	Total Hardness	Mud Type
12-May-26	3,890	82	42	17	11	3.0	10.7	170,000	5.0	2,320	2,440	SALT/POL MUD
13-May-26	3,890	82	42	17	11	3.0	10.5	170,000	5.0	2,320	2,440	SALT/POL MUD
14-May-26	3,890	82	40	14	9	3.2	10.6	170,000	5.0	2,520	2,600	Kcl Poly Mud
15-May-26	3,890	82	40	14	9	3.2	10.6	170,000	5.0	2,520	2,600	Kcl Poly Mud
16-May-26	3,890	82	40	14	9	3.2	10.6	170,000	5.0	2,520	2,600	Kcl Poly Mud
17-May-26	3,890	82	40	14	9	3.2	10.8	170,000	5.0	2,520	2,600	Kcl Poly Mud
18-May-26	3,890	82	40	14	9	3.2	10.8	170,000	5.0	2,520	2,600	Kcl Poly Mud
19-May-26	3,890	82	40	14	9	3.2	10.8	170,000	5.0	2,520	2,600	Kcl Poly Mud
20-May-26	3,890	82	40	14	9	3.2	10.8	170,000	5.0	2,520	2,600	Kcl Poly Mud
21-May-26	3,893	82	40	14	9	3.2	10.8	174,000	5.0	2,520	2,600	Kcl Poly Mud
22-May-26	3,893	82	40	14	9	3.2	10.8	174,000	5.0	2,520	2,600	Kcl Poly Mud
23-May-26	3,893	82	39	14	9	3.4	10.9	174,000	5.0	2,400	2,480	Kcl Poly Mud
24-May-26	3,902	104	46	26	14	2.0	10.0	172,000	5.0	2,200	2,280	Kcl Poly Mud
25-May-26	3,956	104	48	27	14	1.8	9.8	178,000	5.0	2,200	2,280	Kcl Poly Mud
26-May-26	4,010	104.5	50	32	14	1.8	9.8	178,000	5.0	1,920	2,000	Kcl Poly Mud
27-May-26	4,094	104.5	52	29	12	1.8	9.4	178,000	5.0	1,920	2,000	Kcl Poly Mud
28-May-26	4,094	105.0	52	29	12	1.8	9.5	176,000	4.2	1,920	2,000	Kcl Poly Mud
29-May-26	4,150	105.0	52	29	12	1.8	9.5	176,000	4.2	1,920	2,000	Kcl Poly Mud
30-May-26	4,150	105.0	52	29	12	1.8	9.5	176,000	4.2	1,920	2,000	Kcl Poly Mud
31-May-26	4,150	105.0	52	29	12	1.8	9.5	178,000	4.2	1,920	2,000	Kcl Poly Mud
1-Jun-26	4,150	105.0	52	29	12	1.8	9.5	178,000	4.2	1,920	2,000	Kcl Poly Mud
2-Jun-26	4,150	105.0	52	29	12	1.8	9.5	178,000	4.2	1,920	2,000	Kcl Poly Mud
3-Jun-26	4,150	105.0	52	29	12	1.8	9.5	178,000	4.2	1,920	2,000	Kcl Poly Mud
4-Jun-26	4,150	105.0	52	29	12	1.8	9.5	178,000	4.2	1,920	2,000	Kcl Poly Mud
5-Jun-26	4,150	105.0	52	29	12	1.8	9.5	178,000	3.3	1,920	2,000	Kcl Poly Mud
6-Jun-26	4,150	105.0	52	29	11	2.0	10.3	178,000	3.3	2,000	2,200	Kcl Poly Mud
7-Jun-26	4,150	105.0	52	29	11	2.0	10.3	178,000	3.3	2,000	2,200	Kcl Poly Mud
8-Jun-26	4,150	105.0	52	29	11	2.0	10.3	174,000	3.3	2,000	2,200	Kcl Poly Mud
9-Jun-26	4,150	105.0	52	29	11	2.0	10.3	174,000	3.3	2,000	2,200	Kcl Poly Mud
10-Jun-26	4,150	105.0	52	29	11	2.0	10.3	174,000	3.3	1,800	2,000	Kcl Poly Mud
11-Jun-26	4,150	105.0	52	29	11	2.0	10.3	174,000	3.3	1,800	2,000	Kcl Poly Mud
12-Jun-26	4,150	105.0	52	29	11	2.0	10.3	174,000	3.3	1,800	2,000	Kcl Poly Mud
13-Jun-26	4,150	105.0	52	29	11	2.0	10.3	174,000	3.3	1,800	2,000	Kcl Poly Mud
14-Jun-26	4,150	105.0	52	29	11	2.0	10.1	174,000	3.3	1,800	2,000	Kcl Poly Mud
15-Jun-26	4,150	105.0	52	29	11	2.0	10.0	174,000	3.3	1,800	2,000	Kcl Poly Mud
16-Jun-26	4,150	105.0	52	29	8	2.0	10.0	174,000	3.3	2,200	2,200	Kcl Poly Mud
17-Jun-26	4,150	105.0	58	33	13	2.6	9.7	172,000	3.3	2,200	2,280	Kcl Poly Mud

18-Jun-26	4,150	105.0	58	33	13	2.6	9.7	172,000	3.3	2,200	2,280	Kcl Poly Mud
19-Jun-26	4,150	105.0	58	33	13	2.6	9.8	174,000	3.3	2,200	2,280	Kcl Poly Mud
20-Jun-26	4,150	105.0	58	33	13	2.6	9.8	174,000	3.3	2,200	2,280	Kcl Poly Mud
21-Jun-26	4150	105.0	56	34	13	2.8	9.8	174000	3.3	2000	2080	Kcl Poly Mud
22-Jun-26	4150	105.0	56	34	13	2.8	9.8	174000	3.3	2000	2080	Kcl Poly Mud
23-Jun-26	4150	105.0	56	34	13	2.9	9.8	175000	3.3	1800	2000	Kcl Poly Mud
24-Jun-26	4150	105.0	54	29	11	2.8	10.2	174000	3.3	2000	2080	Kcl Poly Mud
25-Jun-26	4150	105.0	54	30	11	2.8	10.0	174000	3.3	2000	2080	Kcl Poly Mud
26-Jun-26	4150	105.0	56	32	13	3.2	10.0	174000	3.3	1800	2000	Kcl Poly Mud
27-Jun-26	4150	105.0	55	31	11	3.4	10.0	174000	3.3	1920	2000	Kcl Poly Mud
28-Jun-26	4150	105.0	55	31	11	3.4	10.0	174000	3.3	1920	2000	Kcl Poly Mud
29-Jun-26	4150	105.0	56	33	12	3.4	10.1	174000	3.3	1920	2000	Kcl Poly Mud
30-Jun-26	4150	105.0	58	33	13	3.4	10.0	174000	3.3	1920	2000	Kcl Poly Mud
1-Jul-26	4150	105.0	56	31	12	3.4	9.5	174000	3.3	1920	2000	Kcl Poly Mud
2-Jul-26	4150	105.0	56	31	12	3.4	9.5	174000	3.3	1920	2000	Kcl Poly Mud
3-Jul-26	4150	105.0	56	31	12	3.4	9.5	174000	3.3	1920	2000	Kcl Poly Mud
4-Jul-26	4150	105.0	56	31	12	3.4	9.5	174000	3.3	1920	2000	Kcl Poly Mud
5-Jul-26	4150	105.0	56	31	12	3.4	9.5	174000	3.3	1920	2000	Kcl Poly Mud
6-Jul-26	4150	105.0	60	37	14	3.4	10.0	174000	3.3	1920	2000	Kcl Poly Mud
7-Jul-26	4150	105.0	60	37	14	3.4	10.0	174000	3.3	1920	2000	Kcl Poly Mud
8-Jul-26	4150	105.0	60	37	14	3.4	10.0	174000	3.3	1920	2000	Kcl Poly Mud
9-Jul-26	4150	105.0	60	37	14	3.4	10.0	174000	3.3	1920	2000	Kcl Poly Mud
10-Jul-26	4150	105.0	60	37	14	3.4	10.0	174000	3.3	1920	2000	Kcl Poly Mud
11-Jul-26	4150	105.0	60	37	14	3.4	10.0	174000	3.3	1920	2000	Kcl Poly Mud
Drilling Start												
Drilling End												

Table 10-21: AZNS-127 6-1/8" Interval Fluid Properties

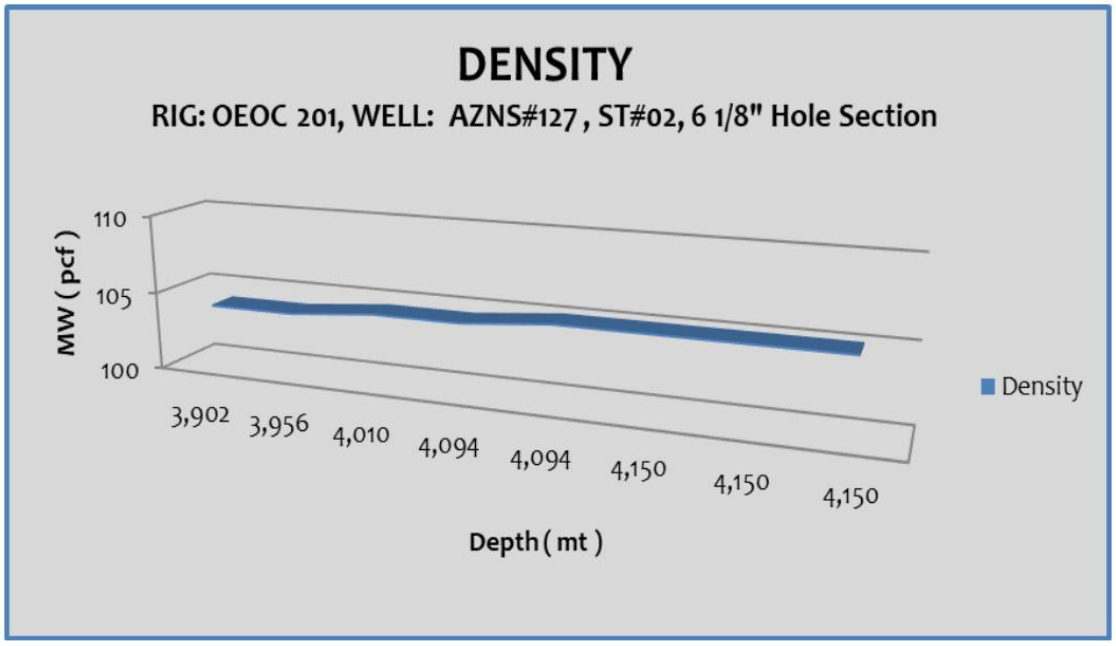


Figure 10-27: AZNS-127 6-1/8" Density Graph

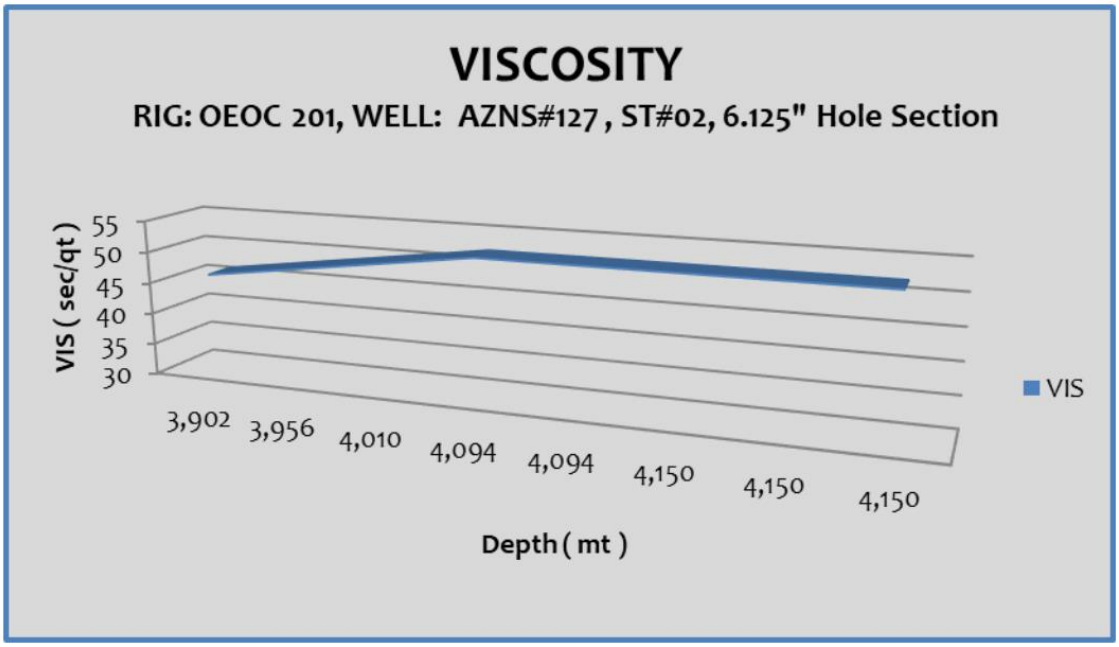


Figure 10-28: AZNS-127 6-1/8" Viscosity Graph

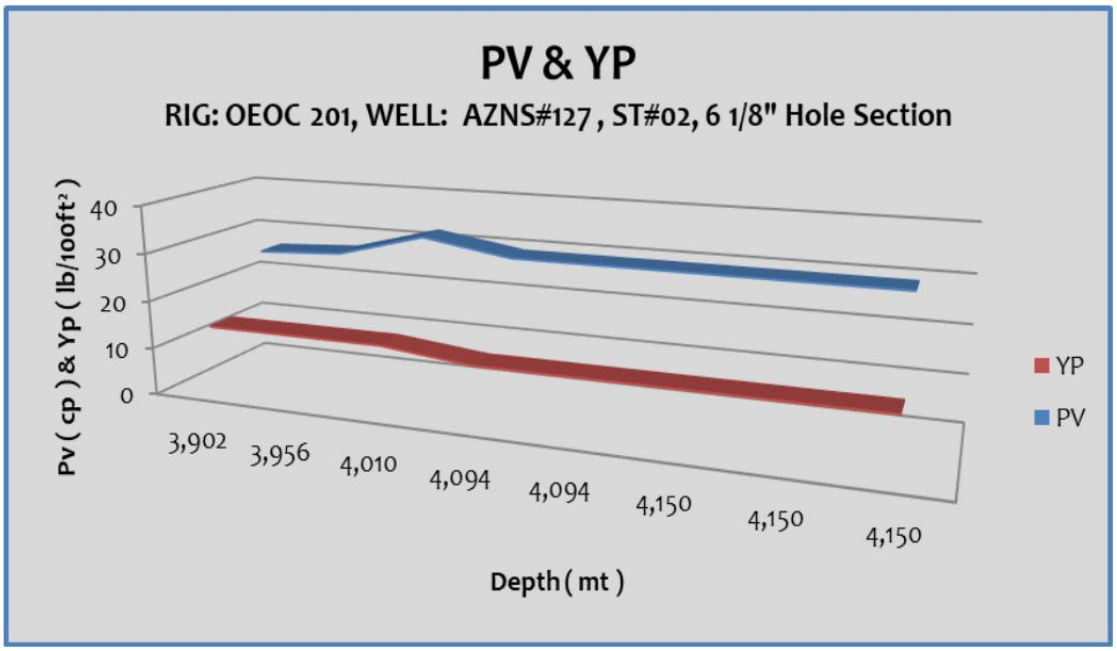


Figure 10-29: AZNS-127 6-1/8" PV & YP Graph

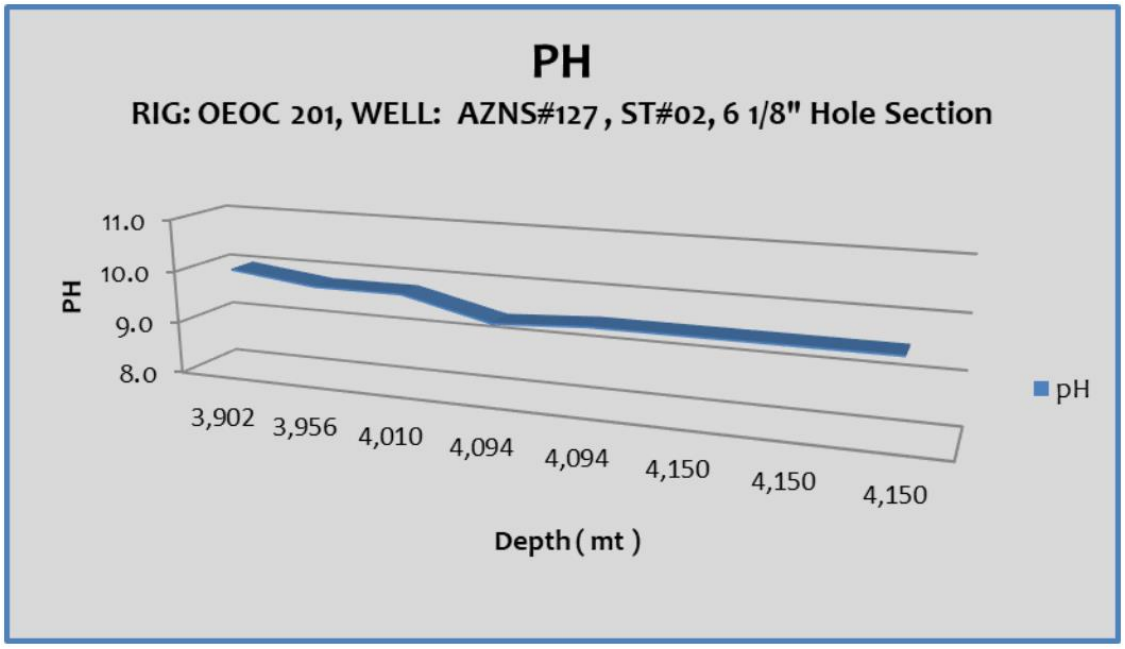


Figure 10-30: AZNS-127 6-1/8" PH Graph

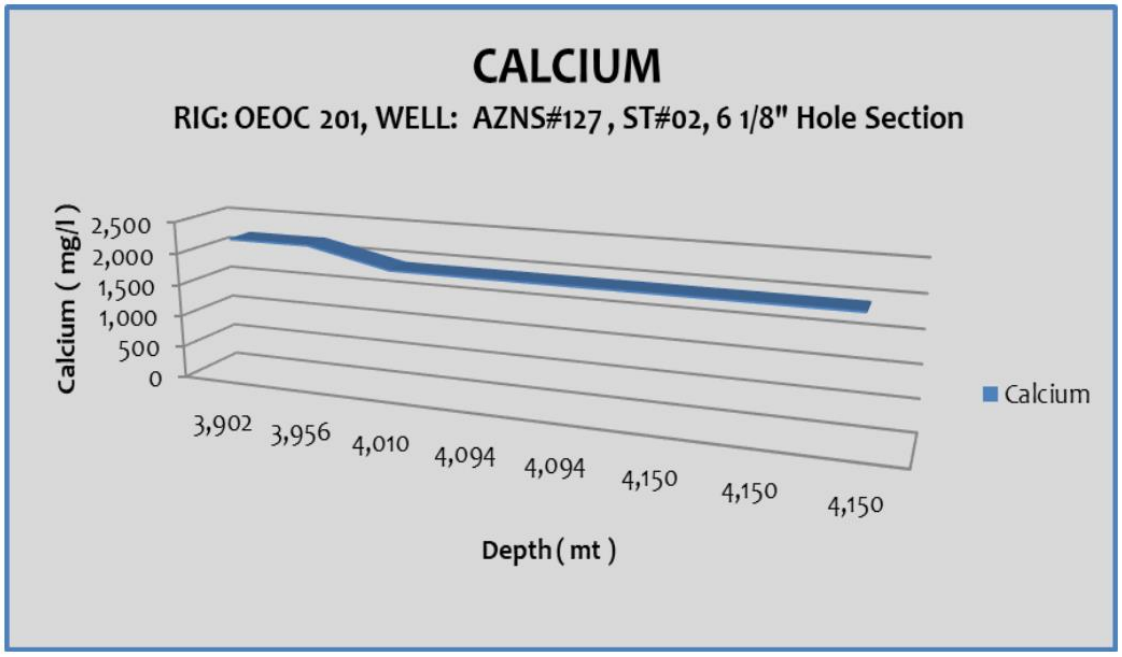


Figure 10-31: AZNS-127 6-1/8" Calcium Graph

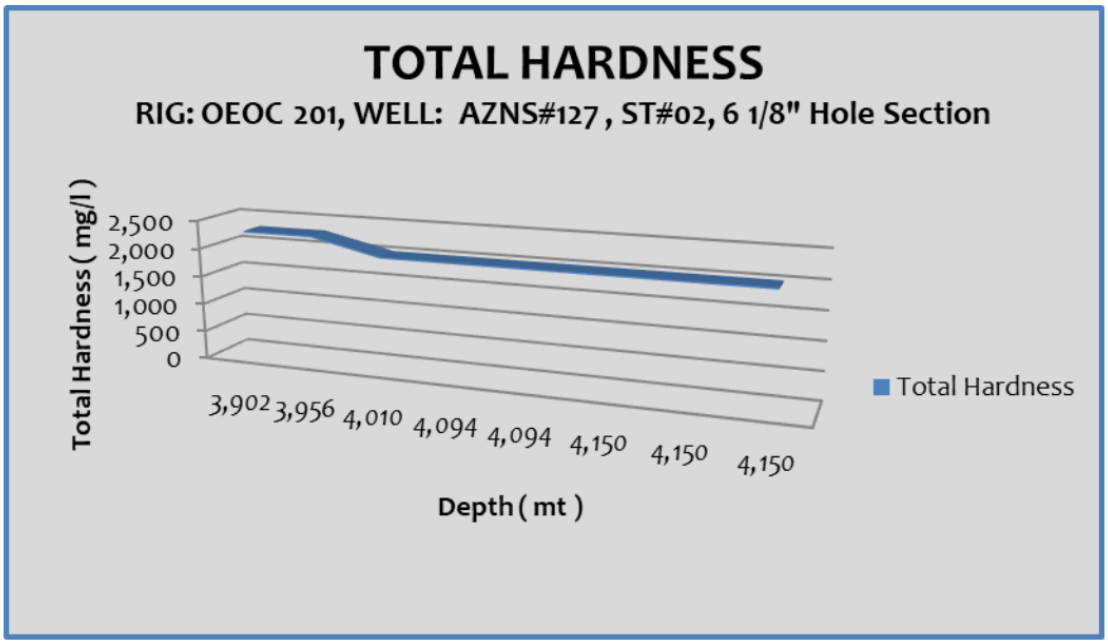


Figure 10-32: AZNS-127 6-1/8" Total Hardness Graph

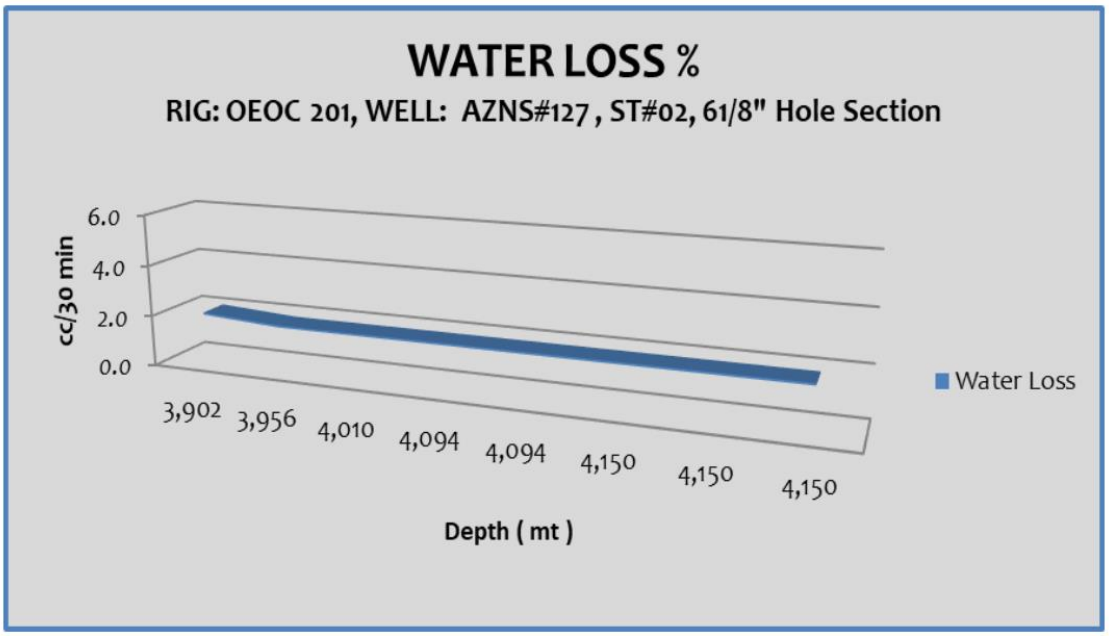


Figure 10-33: AZNS-127 6-1/8" Water Loss% Graph

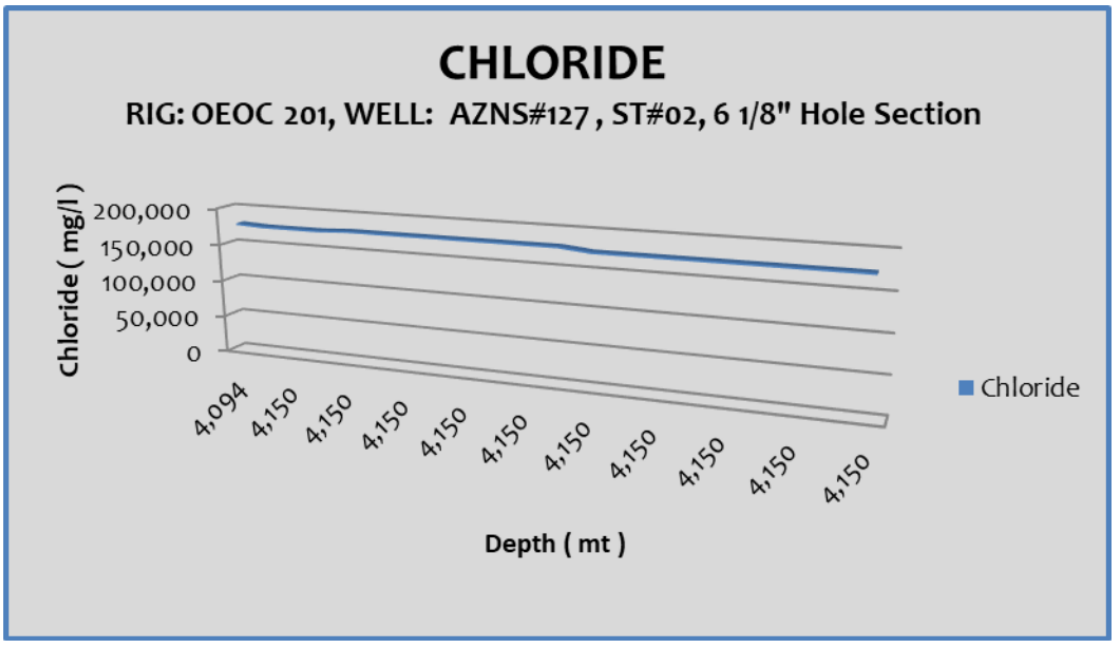


Figure 10-34: AZNS-127 6-1/8" Chloride Graph

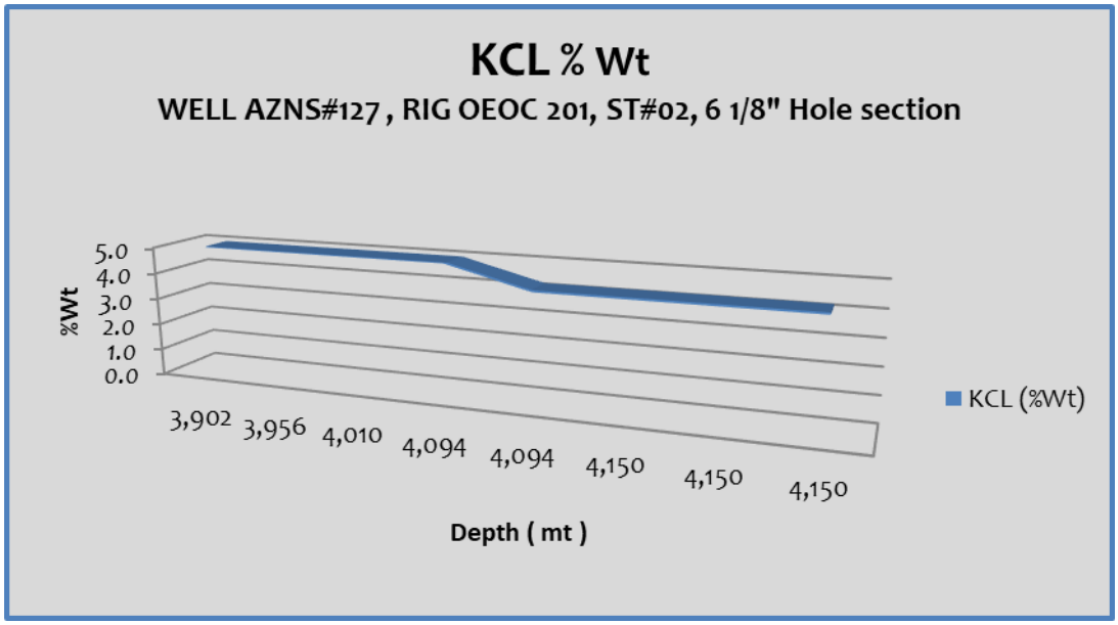


Figure 10-35: AZNS-127 6-1/8" KCl % Wt Graph

10.23 6-1/8” Interval Solid Control Disscusion

Rig OEOC 208 has 3 shale shakers were dressed with:

Shaker#1: 170 – 200 Mesh Screen

Shaker#2: 170 – 200 Mesh Screen

Shaker#3: 170 – 200 Mesh Screen

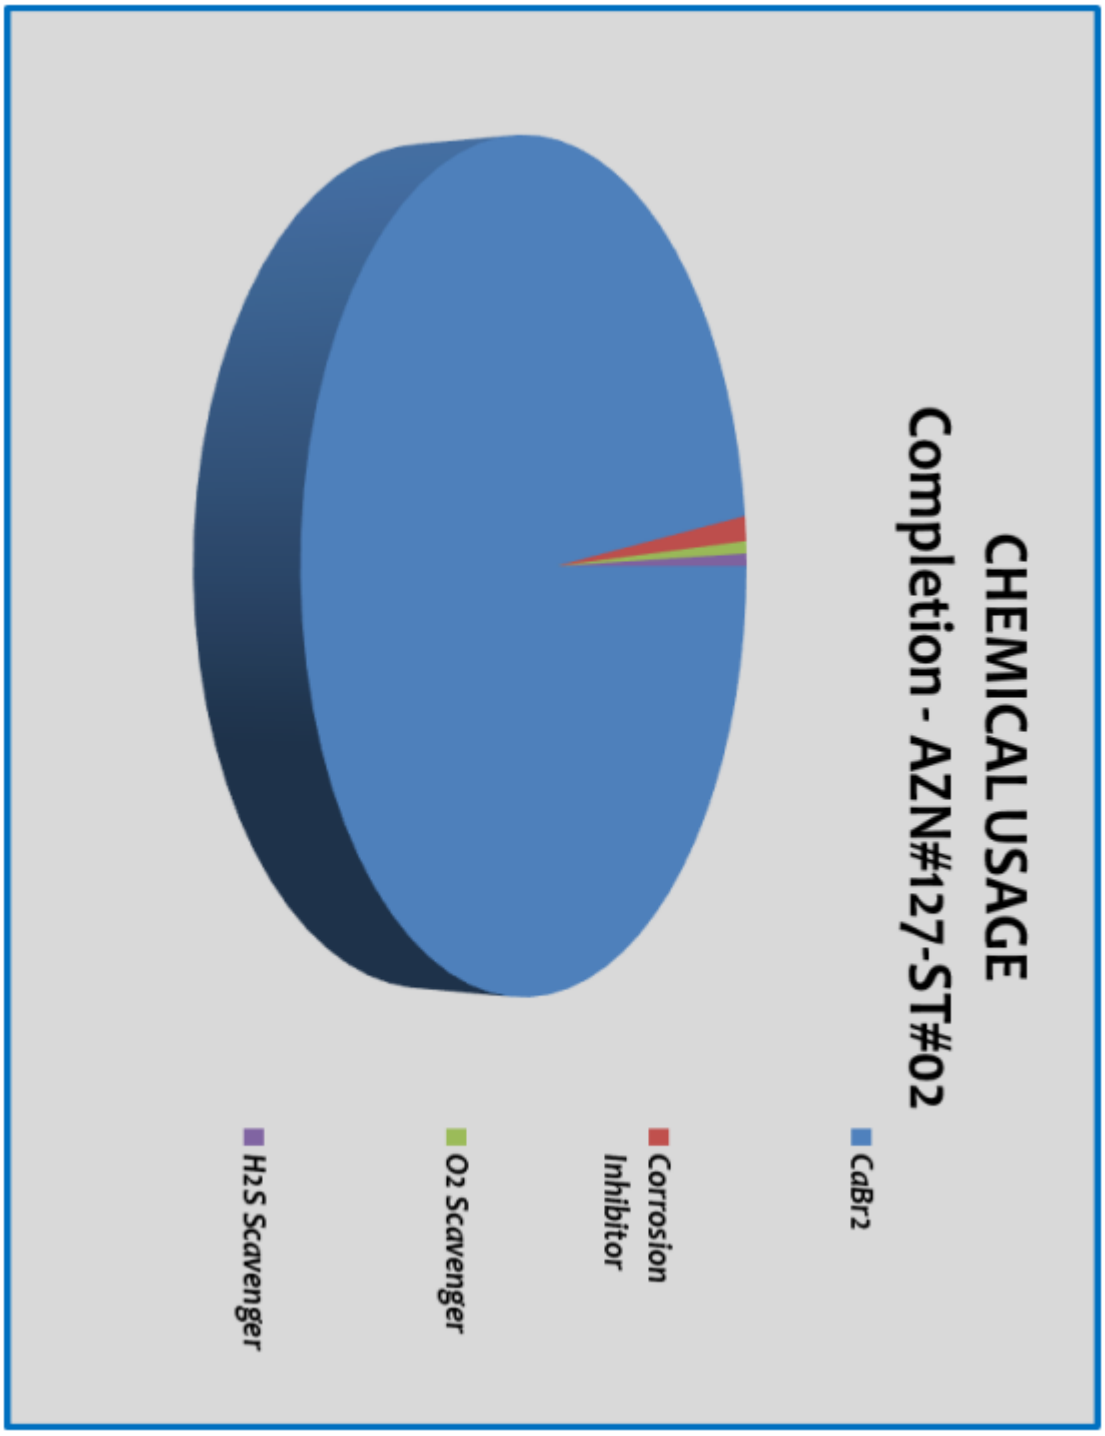
RIG: OEOC 201, WELL: AZNS#127 , ST#02 Solid Control Equipment Working Hr.s	
Derrick Shaker #1	732
Derrick Shaker #2	468
Derrick Shaker #3	96
Centrifuge # 01	0
Centrifuge # 02	0

Table 10-22: AZNS-127 6-1/8” Solid Control Desscusion

10.24 Interval Completion Section

Completion						
Products	Units Used	Unit wt lbs	Total wt		Effective Concentration	
998 bbl Completion fluid has been made						
CaBr2	485	BBL	20030.5	gals	37.64	gpb
Corrosion Inhibitor	4	55 Gal	220	gals	0.41	gpb
O2 Scavenger	2	55 Gal	110	gals	0.21	gpb
H2S Scavenger	2	55 Gal	110	gals	0.21	gpb
Cacl2 Brine						
MW :			105.0		pcf	
Initial Volume :			0.0		bbl	
Total Volume Built (Completion Fluid) :			532.2		bbl	

Table 10-23: AZNS-127 Completion Section


CHEMICAL USAGE
Completion - AZN#127-ST#02
CaBr2
Corrosion Inhibitor
O2 Scavenger
H2S Scavenger

11. List of Contractors

Item	Service Item	Contractor
1	Drilling Rig, Mobilization and Demobilization the Rig, Rig Move Between Well Pads	OEOC
2	Drilling Fluids and Completion Fluids	VIRA
3	Waste Management	Behsan
4	Electrical Logging and Perforation	PANIZ
5	Mud Logging	PGO
6	Directional Drilling (MWD)	Hana Energy
7	H2S Monitoring and Control	PSAJ
8	Casing and Tubing Running	OEOC
9	Cementing	Dana Energy
10	Dry Test, DST and RTTS	OEOC
11	Slick Line	OEOC
12	Stimulation (Coiled Tubing and Acidizing and Nitrogen Lifting)	OEOC
13	Surface Well Testing	OEOC
14	Liner Hanger	PARS POOLAD
15	Well Head	OEOC

Table 11-1: AZNS-127 Contractors Involved

12. Appendix

12.1 DDR Summary

Date	Remark
2026-04-03	Open the Well Thru. Choke Manifold & Record Well Press. For a while, Confirm Well Static; Set 11" Plug Tester in T.H.S Bowl; Perform BOP Test as per NIOC Policy; P/U & M/U Tubular Stds & Rack back in Derrick Jt by Jt, While Hammer, Wash and Pass Drift Thru. All Jts is in progress @ M.N.
2026-04-04	Cont. P/U & M/U Tubular Stds & Rack back in Derrick Jt by Jt (Totally 14 Stds [6 Stds 6-1/2" D.C; 8 Stds 5" H.W.D.C]); P/U & M/U 6-1/8" BHA [6-1/8" C.C Bit + 4-3/4" Bit Sub + 33 Stds 3-1/2" DP (8 Stds Jt by Jt)] To 965m; Cont. RIH w/ Same BHA F/ 956 To 2980m On Elevator Followed by 5" DPs; Conn. TDS and Cont. RIH w/ Same BHA F/ 2987 To 3017m, NL-NG.
2026-04-05	Cont. RIH w/ Wash Dn w/ Same 6-1/8" BHA F/ 3017 To 3102m, Obs. Hold up Strg Wt. and Tag TOC @ 3102m, Confrim TOC w/ Apply WOB: 3klbs; CBU and Disp. In-hole Driling Mud w/ 104pcf Fresh Mud @ 3098m and uniform In/Out Mud MW; Perform CMT Balance plug; B/O Chiksan Pipes, POOH 6-1/8" BHA F/ 3100 To 2928m, Flush String, Cont. POOH 6-1/8" BHA F/ 2928 To 2757m; CBU @ 2757m; Cont. POOH 6-1/8" BHA F/ 2757 To 1300m, While Circ. C.W.H, NL-NG.
2026-04-06	Cont. POOH 6-1/8" BHA F/ 1300m To Surface; B/O & L/D C.C Bit & Rest of BHA; P/U & M/U 8-1/2" D/O BHA and RIH To 2880m; Conn. TDS and RIH w/ 8-1/2" D/O BHA w/ Pump out F/ 2880 To 3015m, Hold up Strg Wt. @ 3015m; Cont. RIH w/ Wash Dn F/ 3015 To 3023m, Hold up Strg Wt. & Tag TOC @ 3023m; D/O Hard CMT W/ 8-1/2" D/O BHA F/ 3023 To 3044m , NL-NG.
2026-04-07	Cont. D/O Hard CMT W/ 8-1/2" D/O BHA F/ 3044 To 3062m; Pump Hi-Vis Pill, CBU @ 3062m to sweep the well; P/U & M/U 9-5/8" Scraper BHA and RIH To 256m, F/U BHA & Break Circ. , Ok; Cont. RIH W/ 9-5/8" Scraper BHA F/ 256 To 1225m Followed by 5" DPs, While F/U Strg & Break Circ. At 10-Std Intervals, NL-NG.
2026-04-08	Cont. RIH W/ 9-5/8" Scraper BHA F/ 1225 To 3020m; Conn. TDS & Scrape Interval 3020 to 3062m Sev. Times, Setting Depth Area of 9-5/8" Hyd. Whipstock Sys. PKR; CBU @ 3062m till clean Sh.Shakers; Pump 70bbl 80pcf Hi-Vis Pill and Disp. In-hole Mud 103pcf w/ 80 pcf Fresh Mud; Static Flow Check for 0.5Hr. , Confirm the Well is static; Pump 60bbl Hi-Vis Pill and CBU till uniform In/Out Rheological properties and clean Sh.Shakers, while reciprocate Strg periodically; POOH 9-5/8" Scraper BHA F/ 3062 To 2140m, NL-NG.
2026-04-09	Cont. POOH 9-5/8" Scraper BHA F/ 2140m To Surface; P/U & M/U 9-5/8" Cased-Hole Sidetrack BHA To 46m; F/U 6-1/2" DC w/ Fresh Hi-Vis Pill; Cont. RIH W/ 9-5/8" Cased-Hole Sidetrack BHA F/ 46 To 2097m w/ Speed Control, While Drift all Tubular & F/U Strg w/ F/U Hose at 10-std interval and Monitor the Well, NL-NG.

2026-04-10	Cont. RIH W/ 9-5/8" Cased-Hole Sidetrack BHA F/ 2097 To 3060.5m; P/U & Assemble Wireline Tools as Gyro Tool String and RIH To 3041m, Set Whipface orientation to planned Azimuth (Az. :340deg) based on Gyro Data reading, POOH 1.8" Gyro Tool String to surface, L/D Wireline Tools; Set Whipstock PKR @ 3059.25m, Push/Pull Test at 25klbf, Shear 8-1/2" Rugby Mill shear screw, Rotate Strg at 20RPM to break knock-off plugs; CBU @ 3052m to Shear In/Out Mud; Start Window Milling W/ 8-1/2" Cased-hole sidetrack BHA F/ 3053.35 To 3054.6m, NL-NG.
2026-04-11	Cont. Window Milling w/ 8-1/2" Cased-hole Sidetrack BHA F/ 3054.6 To 3055.6m; POOH 8-1/2" Cased-hole Sidetrack BHA F/ 3055.6 To 900m; At 900m, Slip & Cut 110ft Drill Line, while Slow Circ. & Monitor the Well; Cont. POOH 8-1/2" Cased-hole Sidetrack BHA F/ 900m To Surface; P/U & M/U 8-1/2" Cased-hole Sidetrack BHA and RIH To 236m, F/U BHA & Break Circ. , Cont. RIH w/ 8-1/2" Cased-Hole Sidetrack BHA F/ 236 To 951m On Elevator, While F/U Strg & Break Circ. At 15-Std Intervals; Due to Windy Weather, at 951m stop RIH Op. , while Slow Circ. , NL-NG.
2026-04-12	Cont. RIH w/ 8-1/2" Cased-Hole Sidetrack BHA F/ 951 To 3042m On Elevator; Conn. TDS & Cont. RIH w/ 8-1/2" Cased-Hole Sidetrack BHA w/ pump out F/ 3042 To 3054m, Hold up Strg Wt. @ 3054m; Cont. Window Milling w/ 8-1/2" Cased-hole Sidetrack BHA F/ 3054 To 3056.4m, While Dress & Smooth the interval milled by Rugby Mill run w/ previous 8-1/2" Cased-Hole Sidetrack BHA, Pump Hi-Vis Pill periodically & check Ditch magnet, Sh.Shakers samples, Mud Treatment to optimize Rheological properties, and Monitor the Well, POOH To 2322m, NL-NG.
2026-04-13	Cont. POOH 8-1/2" Cased-hole Sidetrack BHA F/ 2322 To 1000m; Obs. The Well & Static Flow Check @ 1000m for 1Hr. ; CBU for a while and monitor the Well, Confirm Well Static; Cont. POOH 8-1/2" Cased-hole Sidetrack BHA F/ 1000m To Suface; ; Obs. Strg is twisted off B/O Remain part of 8-1/2" Tri-Mill & rest of BHA; Perform BOP Test as per NIOC Policy; P/U and M/U 4-3/4" Fishing BHA and RIH Followed by 5" DPs On Elevator, While F/U Strg & Break Circ. At 15-Std Intervals, NL-NG.
2026-04-14	Cont. RIH w/ 1-9/16" × 2-11/16" Taper Tap & 4-3/4" Fishing BHA F/ 2730 To 3044m; Conn. TDS and Cont. RIH w/ Same BHA F/ 3044 To 3052.9m w/ Wash Dn, Hold up Strg Wt. @ 3052.9m; Record Up & Dn ward Strg Wt. W/ & W/O Flow Rate & Rotation; Lower Strg & Engage W/ Fish & perform Tap Op. ; POOH 1-9/16" × 2-11/16" Taper Tap & 4-3/4" Fishing BHA To Surface On Elevator to check string, Fish Recovered; Work on Drawworks; RIH w/ 8-1/2" Cased-Hole Sidetrack BHA To 1950m ,While F/U Strg & Break Circ. At 10-Std Intervals, NL-NG.
2026-04-15	Cont. RIH w/ 8-1/2" Cased-Hole Sidetrack BHA F/ 1950 To 3042m On Elevator; CBU & Take SCR @ 3042; Conn. TDS & Cont. RIH w/ 8-1/2" Cased-Hole Sidetrack BHA w/ pump out To 3056m, Hold up Strg Wt. @ 3056m; Attempt to Cont. Window Milling w/ 8-1/2" Cased-hole Sidetrack BHA F/ 3056 To 3060m, While Dress & Smooth the interval milled & drilled by 8-1/2" previous & in-hole Tri-Mill run 8-1/2" Cased-Hole Sidetrack BHA & Sev. Times @ 3060m, Pump Hi-Vis Pill periodically & check Ditch magnet; Pump Hi-Vis Pill, CBU @ 3060m, and Monitor the Well, NL-NG.
2026-04-16	POOH w/ 8-1/2" Tri mill f/ 3060m to surface. L/D Same. RIH 8-1/2" TCI Bit & 6-3/4"D.H.M (Ako: 1.5 Deg) & MWD Tool to 1800m.
2026-04-17	Cont. RIH Directional BHA (6-3/4"D.H.M & MWD Tools) w/ Gyro Sub & Followed by 5"DPs f / 1800 to 3060m (BTM), Resume D.Drlg as Rotation to 3062m, POOH to 3061.5m, R/U Logging Equip., Run Gyro Tools to 3052m, Adjust

	Tool Face of D.H.M, POOH & R/D Logging Equip., Resume D.DRLG as Slide Mode to 3065.7m.
2026-04-18	Cont. D.Drlg as Slide & Rotation mode f/ 3065.6 to 3090.3m.
2026-04-19	Cont. D.Drlg as rotation mode to 3093.5m. POOH Directional BHA f/ 3093.5 to surface. P/U & M/U New DHM, MWD tools & 8-1/2" PDC Bit, RIH to 2600m.
2026-04-20	Cont. Directional Drlg f/ 3093.3 to 3141m.
2026-04-21	Cont. Directional Drlg f/ 3141 to 3212m.
2026-04-22	Cont. D.Drlg f/ 3212 to 3270m.
2026-04-23	Cont. D.Drlg as Slide & Rotation Mode f/ 3270 to 3324m, Circ. Btm's up. POOH to 3115m.
2026-04-24	Cont. POOH to surface, Change BHA, M/U 8-1/2" PDC Bit & 6-3/4" D.DRLG BHA to 2138m.
2026-04-25	Cont. RIH w/ 8-1/2" PDC Bit & 6-3/4" D.DRLG BHA to 3324m (BTM). Resume Performance Drlg 8-1/2" H.S f/ 3324 to 3410m.
2026-04-26	Cont. Performance Drlg 8-1/2" H.S f 3410 to 3490m.
2026-04-27	Cont. Performance Drlg 8-1/2" H.S f 3490 to 3571.5m.
2026-04-28	Cont. Drlg 8-1/2" H.S f/ 3571.5 to 3634.22m. POOH In order to change Bit, f/ 3634 to 3053m.
2026-04-29	Cont. POOH to surface. While Slip & Cut 100ft Drlg line, Change BHA , RIH To 1500m.
2026-04-30	Cont. RIH W/ 8-1/2" Dir. Drlg BHA F/ 1500 To 3055m (KOP Depth - Cased Hole); Cont. RIH W/ 8-1/2" Dir. Drlg BHA F/ 3055 To 3500m (Open Hole) On Elevator W/ Good Hole Condition; Hold Up Strg Wt. @ 3500m; Conn. TDS & F/U Strg; Take SCR @ 3500m; Adjust Gamma Sensor & Check MWD Signal, Ok; Cont. RIH W/ 8-1/2" Dir. Drlg W/ Wash & Ream Dn F/ 3500 To 3634m; Cont. Dir. Drlg 8-1/2" Hole Section As Rotating Mode F/ 3634 to 3657.6m; Take Survey @ 3658.3m; Cont. Dir. Drlg 8-1/2" Hole Section As Rotating Mode F/ 3657.6 to 3684.8m; Take Survey @ 3680m, 1-3BPH Loss.
2026-05-01	Cont. 8-1/2" hole Drlg from 3684.8 to 3738m. At 3738m, obs. gradual decrease in SPP by ~150 psi; completed successful surface equipment Press. Test and Verified reduction against SCR; To check for potential washout, POOH 8-1/2" BHA from 3738m to 1625m W/ Pump out & soft B/R. Visually inspected all Stds for washout while monitoring well & Circ. C.W.H; 1-3BPH loss.
2026-05-02	POOH 8-1/2" BHA to 660m for inspection; observed drill string washout at 3078m (Std #15); Replaced 5" DP Jt (G-Grade) and performed MWD/DHM Functional Tests (Ok); RIH back W/ 8-1/2" Dir. Drlg BHA F/ 660 To 3055m (KOP Depth - Cased Hole) On Elevator; Cont. RIH W/ 8-1/2" Dir. Drlg BHA F/ 3055 To 3656m (Open Hole) On Elevator W/

	Good Hole Condition; Conn. TDS & F/U Strg, then Cont. RIH W/ 8-1/2" Dir. Drlg W/ Wash & Soft Ream Dn F/ 3656 To 3738.3m; Cont. Dir. Drlg 8-1/2" Hole Section As Rotating Mode F/ 3738.3 to 3762m; 0-1BPH Loss.
2026-05-03	Cont. Dir. Drlg 8-1/2" hole section in rotating mode from 3762.3m to 3788.9m; Stop Drlg due to TDS Gooseneck Leakage, To Fix Goosneck Leakage, POOH 8-1/2" Dir. Drlg BHA F/ 3768 To 3685m, W/ Soft B/R & Pump out, Work on Goosneck Leakage, While Circ. at 3685m Thru. Strg, Fix TDS Gooseneck Leakage and RIH W/ 8-1/2" Dir. Drlg W/ Wash & Soft Ream Dn F/ 3685 To 3768m; Adjust Gamma Sensor & Check MWD Signal, Ok; Resume Dir. Drlg 8-1/2" Hole Section As Rotating Mode F/ 3768 to 3788.9m; Stop Drlg due to TDS Gooseneck Leakage, To Fix Goosneck Leakage, POOH 8-1/2" Dir. Drlg BHA F/ 3788.9 To 3743.5m, Work on Goosneck Leakage, While Circ. at 3743.5m Thru. Strg; 2-3BPH Loss.
2026-05-04	Cont. Work on Goosneck Leakage, While Circ. at 3743.5m Thru. Strg; Fix TDS Gooseneck Leakage and RIH W/ 8-1/2" Dir. Drlg W/ Wash & Soft Ream Dn F/ 3743 To 3788.9m; Take SCR; Adjust Gamma Sensor & Check MWD Signal, Ok; Resume Dir. Drlg 8-1/2" Hole Section As Rotating Mode F/ 3788.9 to 3791m; At 3791m, Obs. gradual decrease in SPP during Drlg; Surface equipment Press. Test completed successfully, Ok; Verified against SCR to confirm SPP, Ok; Confirm DHM Diff. Press. and MWD pulse are gone, Decide To POOH to check DHM & MWD; POOH 8-1/2" Dir. Drlg BHA F/ 3791 To 3428m W/ Pump out & Soft B/R W/ Good Hole condition; POOH 8-1/2" Dir. Drlg BHA F/ 3428m To Surface On Elevator, B/O DHM & rest of BHA is in progress, 2-3BPH Loss.
2026-05-05	Cont. B/O & L/D 8-1/2" PDC Bit (Dull Grade: 1-1-WT-A-X-IG-NO-DMF), DHM & rest of BHA; P/U 6-3/4" DHM, Shallow Test W/ 450gpm got 230psi Pressure (M.L), then M/U 8-1/2" PDC Bit , Shallow Test W/ 450gpm, got 400psi Pressure (M.L), P/U & M/U Rest of BHA; Cont. RIH w/ 8-1/2" Dir. Drlg BHA F/ 249 To 3060m (KOP Depth - Cased Hole) Followed by 5" DPs On Elevator; Cont. RIH W/ 8-1/2" Dir. Drlg BHA F/ 3060 To 3761m (Open Hole) Followed by 5"DPs On Elevator W/ Good Hole Condition; Conn. TDS Cont. RIH W/ 8-1/2" Dir. Drlg W/ Wash & Soft Ream Dn F/ 3761 To 3791m, Hold up Strg Wt. @ 3791m; Cont. Dir. Drlg 8-1/2" Hole Section As Rotating Mode F/ 3791 To 3810.3m; 2-3BPH Loss.
2026-05-06	While Dir. Drlg at 3810.3m, Obs. gradual decrease in SPP during Drlg by approximately 200 psi; To check for potential washout or DHM failure; POOH 8-1/2" Dir. Drlg F/ 3810.3 To 3350m (Open Hole) W/ Pump out & Soft B/R; Cont. POOH 8-1/2" Dir. Drlg BHA F/ 3350 To 3050 (Open Hole); Cont. POOH 8-1/2" Dir. Drlg BHA F/ 3350 To 250m (Cased Hole); Cont. POOH 8-1/2" Dir. Drlg BHA F/ 250m To Surface, B/O & L/D 8-1/2" PDC Bit, DHM & rest of BHA; Obs. Fluid bypassing Thru. DHM & Bit Nozzles W/O inducing Flow Rate; Change Top Ram F/ VBR 2-7/8" - 5" To 4-1/2" - 7"; Prepare To BOP Test as per NIOC Policy is in progress, 2-3BPH Loss.
2026-05-07	Cont. BOP Test as per NIOC Policy; P/U & M/U 8-1/2" Rotary BHA and RIH To 279m, F/U BHA & Break Circ. ; Cont. RIH W/ 8-1/2" Rotary BHA F/ 279 To 3060m (Cased hole) On Elevator; Cont. RIH W/ 8-1/2" Rotary BHA F/ 3060 To 3503m (Open hole) On Elevator, Hold up Strg Wt. @ 3503m; Conn. TDS & Cont. RIH W/ 8-1/2" Rotary BHA F/ 3503 To 3810.3m (Open hole) W/ Wash & Ream Dn, Hold up Strg Wt. @ 3810.3m; Cont. Drlg 8-1/2" Hole Section F/ 3810.3 To 3823m, 1-2BPH Loss.
2026-05-08	Cont. Drlg 8-1/2" Hole Section To 3890m; Pump 30bbl Hi-Vis Pill @ 3890m, Hi-Rate CBU & Shaker out the pumped

	Hi-Vis pill, Confirm Sh.Shakers are clean; POOH 8-1/2" Rotary BHA F/ 3890 To 3860m W/ Pump out & B/R As Condition Trip, 1-3BPH Loss.
2026-05-09	Cont. POOH 8-1/2" Rotary BHA F/ 3860 To 3620m W/ Pump out & B/R As Condition Trip; Strg got Stuck @ 3860m; worked off Stuck pipe and successfully freed; Observed and smoothed Tight Hole Intervals during B/R Sev. Times; RIH Back W/ 8-1/2" Rotary BHA F/ 3620 To 3890m W/ Wash & Ream Dn As Condition Trip; Pump 30bbl Hi-Vis Pill @ 3890m, Hi-Rate CBU; Then Spot 200bbl 86pcf Hi-Vis Pill @ 3890m, While Reciprocate Strg periodically; POOH 8-1/2" Rotary BHA F/ 3890 To 3060m (Open hole) On Elevator W/ Good Hole Condtion; Cont. POOH 8-1/2" Rotary BHA F/ 3060 To 279m (KOP - Cased hole) On Elevator; Cont. POOH 8-1/2" Rotary BHA F/ 279m To Surface, While B/O 8-1/2" W/ Same Condition & Rest of BHA, While Circ. C.W.H, 1-3BPH Loss.
2026-05-10	R/U CSG Running Eqp. ; Held PJSM; P/U & M/U 7" LNR Assembly; Cont. RIH W/ 7" LNR Assy. F/ 45 To 1002m Followed by 85Jts 7" LNR (29#, TPCQ,L-80) [Totally : 89 Jts); P/U 8-1/2" Rotational Hyd. HGR & Setting Tools W/ Top PKR; Shear-Pin 6-5/8" LWP to Slick Joint Slot; Lubricate Setting Tools W/ Grease and Oil; M/U same Assy. on LNR Strg; Check Setting Tools and all other connections, OK; Function test Running Tool Rotation, OK; RIH To 1010m; Record Strg Wt. in Both Upward & Dnward Directions; Cont. RIH W/ 7" LNR Assy. F/ 1002 To 2866m (KOP - Cased hole), While pass Drift Thru. all DPs, 1-3BPH Loss.
2026-05-11	Cont. RIH W/ 7" LNR Assy. F/ 2866 To 3050m (Cased hole) Followed by 5" DPs; Conn. TDS & CBU @ 3050m Shear the Mud; Record Strg Wt. in Both Upward & Dnward Directions; Cont. RIH W/ 7" LNR Assy. F/ 3050 To 3890m (Open hole) Followed by 5" DPs, While pass Drift Thru. all DPs; CBU @ 3888m; Hanger Setting Ops: Set 8-1/2" Hyd. LNR Hanger @ 1900 psi (Verified via Push Test); Sheared Ball Seat @ 2900 psi. Released Tool W/ 27 RH turns (Verified via 1m Sting-out); Cementing: Pump Chemical Wash (Vol. : 20 bbl, Wt. : 62.4 pcf), Spacer Wash (Vol. : 60 bbl, Wt. : 88 pcf) and CMT Slurry (Vol. : 155 bbl, Wt. : 118 pcf), Disp. Slurry W/ Mud (T.Vol: 277 bbl, Wt: 81 pcf), Confirmed Latching/Shearing @ 2400 psi & Plug Bump @ 2500 psi; LNR Integrity: LIT performed (15 min/OK); Set Top Packer via S/O weight (Confirmed by positive Shear on Wt. Indicator), POOH Setting Tool to 1460m, NL-NG.
2026-05-12	Cont. POOH W/ Setting Tools 1460m To Surface, B/O & L/D Setting Tools; L/D CMT Chiksan Pipes; Set Wear Bushing; P/U & M/U 8-1/2" D/O BHA and RIH to 142m, F/U BHA & Break Circ. ; Cont. RIH W/ 8-1/2" D/O BHA F/ 142 To 1230m On Elevator Followed by 5" DPs, Slip & Cut Drlg Line @ 1230m; Cont. RIH W/ 8-1/2" D/O BHA F/ 1230 To 2600m On Elevator Followed by 5" DPs; Conn. TDS and Cont. RIH W/ 8-1/2" D/O BHA F/ 2600 To 2860m W/ Wash Dn, Tag TOC @ 2860m; D/O Medium CMT W/ 8-1/2" D/O BHA F/ 2860 To 2883.5m (7" L.Lap) - Note 7" L.Lap confirmed @ 2883.5m; Pump 40bbl Hi-Vis Pill and CBU @ 2882m till Shakering out the pumped Hi-Vis Pill, Confirm Sh.Shakers cleaning; POOH 8-1/2" D/O BHA F/ 2882 To 1921m On Elevator, While Circ. C.W.H, NL-NG.
2026-05-13	Cont. POOH 8-1/2" D/O BHA F/ 1921 To 961m On Elevator; Cont. POOH 8-1/2" D/O BHA F/ 961 To 140m On Elevator, While B/O & L/D Extra 5" Stds (Totally B/O & L/D 29Stds 5" DP G-Grade & 1 Std 5" DP S-Grade) Jt by Jt; Cont. POOH 8-1/2" D/O BHA F/ 140m To Surface, L/D 8-1/2" Tri-Cone Bit W/ Same Condition; P/U & M/U 6-1/8" D/O BHA and RIH to 1175m, While Wash, Hammer, Drift 10 Stds 3-1/2" DP Jt by Jt, and F/U BHA & Break Circ. ; Cont. RIH W/ 6-1/8" D/O BHA F/ 1175 To 1375m On Elevator; Stop RIH @ 1375m, While Slow Circ. Thru. Strg; Cont. RIH W/ 6-1/8" D/O BHA F/ 1375 To 2745m On Elevator Followed by 5" DPs, While F/U Strg & Break Circ. Every 15

	Stds, NL-NG.
2026-05-14	Cont. RIH W/ 6-1/8" TCI Bit and clean out BHA to 2887m. D/O & Clean out inside 7" liner to 3842.5m, Circ. Btm's up. POOH f/ 3842.5m to surface. B/O & L/D 6-1/8" TCI Bit.
2026-05-15	RIH w/ 9-5/8" Scraper to 2800m while scrap dry test PKR Setting depth, CBU, POOH To Surface. Run 9-5/8" Dry test tools for 7" L.Lap to 300m.
2026-05-16	Cont. Run 9-5/8" Dry test tools for 7" L.Lap to 2850m, Set 9-5/8" Dry test PKR at 2850 m, Monitor Open period for 3Hrs; "No-Bubble". Close DCIP Valve. Record Close Period for 0.5 Hr is in progress till M.N
2026-05-17	Record Close Period for totally 6 Hrs, Rev. Circ. To uniform MW, Unset the 9-5/8" Dry Test PKR, Change TDS link & CBU, Static flow check, POOH 9-5/8" Dry test Assy to surface. Perform BOP Test as NIOC Policy.
2026-05-18	Cont. BOP Test as NIOC Policy. RIH w/ 6-1/8" TCI Bit to 400m.
2026-05-19	Cont. Slow Circ. Thru string and wait on client.
2026-05-20	Cont. Slow Circ. Thru string and wait on client. Resume RIH w/ 6-1/8" TCI Bit & C/O BHA f/ 400 to 2650m. Perform integrity test; OK. Resume RIH to 3800m.
2026-05-21	Cont. D/O F.Collar, Hard CMT, F.shoe to 3890m, Commence Drlg formation to 3893m, Circ. Btm's up.
2026-05-22	Cont. POOH w/ 6-1/8" TCI Bit & D/O BHA f/ 3885 to Surface. RIH w/ 6-1/8" TCI Bit & Clean out BHA to 3889m , Pump Hi-Vis Pill. C.B.U Till Clean Shaker.
2026-05-23	Cont. POOH w/ 6-1/8" TCI Bit & 7" Scraper to surface, Run W/L logging tools (RBT/VDL/GR/CCL), RIH w/ 6-1/8" PDC Bit & Rotary BHA to 20m.
2026-05-24	Cont. RIH w/ 6-1/8" PDC Bit to 3893m (BTM Hole) , Cont. Drlg 6-1/8" H.S f/ 3893 to 3902m while slip & Cut DRLG line @ 1600m and gradually Inc. MW During DRLG Operation as per plan.
2026-05-25	Cont. Drlg 6-1/8" H.S to 3956m.
2026-05-26	Cont. Drlg 6-1/8" H.S to 4010m while work on mud rheology to normal parameters and uniform MW to 104.5pcf, NL-NG.
2026-05-27	Cont. Drlg 6-1/8" H.S to 4094m while back ream & Ream down last std.
2026-05-28	Cont. Drlg 6-1/8" Hole Section F/ 4094 To 4150m (TD), While Reciprocate the Drilled Interval (B/R & R/D) W/ Good Hole Condition and Pump Hi-Vis Pill before M/U Next Std, NL-NG; POOH 6-1/8" Rotary BHA F/ 4150 To 3890m (7" LNR Shoe Depth) W/ Pump out & B/R RIH Back W/ 6-1/8" Rotary BHA F/ 3890 To 4150m On Elevator As Condition Trip W/ Good Hole Condition; Hi-Rate CBU W/ MW & Drlg Mud Props. Check, BTMs Up Ok; Pump 20bbl Hi-Vis Pill

	@ 4150m, Then Hi-Rate CBU To Disp. & Shaker out the pumped Hi-Vis pill, Confirm Sh.Shakers are clean; While CBU, Obs. Gas-Cut Mud (Total Gas 5%) On Shakers @ 101pcf, Decide to Weight Up In-Hole Mud; MW W/U F/ 104+ to 105+ pcf in progress; NL-NG.
2026-05-29	MW W/U from 104+ to 105+ pcf W/ uniform In/Out MW achieved; Mud conditioned & 50 bbl Hi-Vis Pill spotted at 4150m; POOH 6-1/8" Rotary BHA to surface and L/D PDC Bit (Dull Grade: 2-1-WT-G-X-I-NO-TD); Prepare Rig Floor to perform Wire Line Logging Op. ; Ret. 11" Wear Bushing; R/D Mouse Hole; Change 13-5/8" 10K Top Rams VBR, R/U and Set 7" Shooting Nipple, P/U & M/U Wireline BOP on Shooting Nipple, Wireline BOP & Top Rams Press. Test, OK; PJSM; R/U Paniz Co. Wire Line Eqp. ; Paniz Co. Wireline Eqps. R/U; assembled Full Suite Tool String Run#1 (DLL-MSFL-GR: INSU, MSFL, GR, TELC, TPMS_B, BRIDLE; 16.28m, 400 kg, 4.22" OD) and RIH to 900m, While Record Normal Tension / position Every 500m, and Circ. C.W.H & Monitor the Well, NL-NG.
2026-05-30	Cont. RIH W/ Wireline Tool String (Run#1 for Full Suite Logging) F/ 900 To 3950m; RIH Op. encounter insufficient Wireline Cable Length (Single Wrap remaining on Reel); Decide To POOH Wireline Tool String; POOH Wireline Tool String F/ 3950m To Surface; L/D Wireline Tool Strg & Surface Tools, and 7" Shooting Nipple; Change 13-5/8" 10K Top Rams VBR, Press. Test the changed Rams, Ok; R/U& Mouse Hole; Set 11" Wear Bushing in T.H.S Bowl; Prepare Rig Floor to RIH 6-1/8" Condition BHA; P/U & M/U 6-1/8" Condition BHA and RIH to 300m, F/U BHA & Break Circ. ; Cont. RIH W/ 6-1/8" Condition BHA F/ 300 To 3890m (Cased Hole - 7" LNR Shoe Depth) On Elevator Followed by 3-1/2" & 5" DPs, While F/U Strg & Break Circ. Every 10Stds, NL-NG.
2026-05-31	Cont. RIH W/ 6-1/8" Condition BHA F/ 3890 To 4090m (Open Hole) W/ Good Hole Condition On Elevator; Conn. TDS & Cont. RIH W/ 6-1/8" Condition BHA F/ 4090 To 4150m (Open Hole) W/ Good Hole Condition W/ Wash Dn, Obs. Some Tight Interval, Smooth via Applying parameters, CBU @ 4150m To Uniform In/Out MW, Simultaneously Condition & Optimize Drlg Mud; POOH 6-1/8" Condition BHA F/ 4150 Tob1384m On Elevator W/ Good Hole Condition in Open Hole; Static Flow Check @ 1384m, Confirm Well Static; Cont. POOH 6-1/8" Condition BHA F/ 1384 To 227m On Elevator; Cont. POOH 6-1/8" Condition BHA F/ 227m To Surface On Elevator, L/D Bit W/ Same Condition & Rest of BHA, While Circ. C.W.H, NL-NG.
2026-06-01	Rig floor prepared for Wireline Operations; 13-5/8" Top Rams changed to 4-1/2"x7" VBR and Wireline BOP installed/Tested, Ok; Complete two Logging Runs: Run #1 (DLL-MSFL-GR) RIH to 4142m and Logged up to 3820m; Run #2 (CNT-DAS-GR) RIH to 4127m and Logged up to 3840m; Following POOH and LD of tools, Top Tams reverted to 2-7/8"x5" VBR; Full BOP Press. Test conducted per NIOC policy (Annular, BTM, Top, and Shear Rams, and all Choke Manifold valves) W/ all results OK; Currently preparing to RIH with 6-1/8" Condition BHA, While Circ. C.W.H & Monitor the Well, NL-NG.
2026-06-02	Cont. P/U & M/U 6-1/8" Condition BHA and RIH to 300m; F/U BHA & Break Circ. ; Conn. TDS & Cont. RIH W/ 6-1/8" Condition BHA F/ 4090 To 4150m (Open Hole) W/ Good Hole Condition W/ Wash Dn; CBU @ 4150m To Uniform In/Out MW; POOH 6-1/8" Condition BHA F/ 4150 To 4036m & RIH Back To 4150m As Condition Trip On Elevator W/ Good Hole Condition; CBU @ 4150m To Uniform In/Out MW, Simultaneously Optimize Drlg Mud; POOH 6-1/8" Condition BHA F/ 4150 To 1227m On Elevator W/ Good Hole Condition, While Circ. C.W.H, NL-NG.

2026-06-03	Cont. POOH 6-1/8" Condition BHA F/ 1227m To Surface; R/U CSG Running Eqp. ; Held PJSM; P/U & M/U 5" LNR Assembly; Cont. RIH W/ 5" LNR Assy. F/ 36.7 To 381.6m Followed by 29Jts 5" LNR (18#, HSG3, L-80, FJ THD) [Totally : 32 Jts); P/U 5-3/4" Rotational Hyd. HGR & Setting Tools W/ Top PKR; Shear-Pin 4-1/2" LWP to Slick Joint Slot; Lubricate Setting Tools W/ Grease and Oil; M/U same Assy. on LNR Strg; Check Setting Tools and all other connections, OK; Function test Running Tool Rotation, OK; RIH To 386m; Record Strg Wt. in Both Upward & Dnward Directions; Cont. RIH W/ 5" LNR Assy. F/ 386 To 2545m (KOP - Cased hole), While pass Drift Thru. all DPs, and F/U Strg Break Circ. Every 10 Jts, NL-NG.
2026-06-04	Cont. RIH W/ 5" LNR Assy. F/ 2545 To 3860m Followed by 5" DPs; Conn. TDS & CBU @ 3860m Shear the Mud; Record Strg Wt. in Both Upward & Dnward Directions; Cont. RIH W/ 5" LNR Assy. F/ 3860 To 4150m Followed by 5" DPs, While pass Drift Thru. all DPs; CBU @ 4148m; Hanger Setting Ops: Set 5" Hyd. LNR Hanger @ 1700 psi (Verified via Push Test); Sheared Ball Seat @ 3000 psi. Released Tool W/ 26 RH turns (Verified via 1m Sting-out); CMT Op. : Pump Chemical Wash (Vol. : 20 bbl, Wt. : 62.4 pcf), Spacer Wash (Vol. : 50 bbl, Wt. : 110 pcf) and CMT Slurry (Vol. : 47 bbl, Wt. : 118 pcf), Disp. Slurry W/ Mud (T.Vol: 188 bbl, Wt: 105+ pcf), Confirmed Latching/Shearing & Plug Bump; LNR Integrity: LIT performed (15 min/OK); Set Top Packer via S/O weight (Confirmed by positive Shear on Wt. Indicator), POOH Setting Tool to 3400m; CBU & Flush Strg is in progress, NL-NG.
2026-06-05	CBU @ 3400m To uniform In/Out MW; Cont. POOH W/ Setting Tools 3400m To Surface, B/O & L/D Setting Tools; P/U & M/U 6-1/8" D/O BHA and RIH to 138m, F/U BHA & Break Circ. , Cont. RIH W/ 6-1/8" D/O BHA F/ 138 To 744m On Elevator Followed by 3-1/2" & 5" DPs; Due to Windy Weather, Stop RIH Op. at the request of OEOC HSE Officer @ 744m, While Slow Circ. ; Cont. RIH W/ 6-1/8" D/O BHA F/ 744 To 3430m On Elevator Followed 3-1/2" (Totally 21Stds) & 5" DPs, While F/U Strg & Break Circ. Every 15 Stds; Conn. TDS and Cont. RIH W/ 6-1/8" D/O BHA F/ 3430 To 3460m W/ Wash & Ream Dn, NL-NG.
2026-06-06	Cont. RIH W/ 6-1/8" D/O BHA F/ 3460 To 3582m W/ Wash & Ream Dn, While D/O CMT Bridges via Apply Parameters; D/O CMT W/ 6-1/8" D/O BHA F/ 3582 To 3763.5m (5" L.Lap Depth); Pump 40bbl Hi-Vis Pill and CBU @ 3762m till Shakering out the pumped Hi-Vis Pill, Confirm Sh.Shakers cleaning; Cont. POOH 6-1/8" D/O BHA F/ 3762 To 1030m On Elevator; In order to B/O & L/D Extra Stds, RIH W/ 6-1/8" D/O BHA F/ 1030 To 1150m Followed by 3Stds 6-1/2" DC + 1Std 5" DPs [Drift is stuck]), While Circ. C.W.H, NL-NG is in progress @ M.N.
2026-06-07	B/O & L/D Extra Stds; Slip & Cut Drlg Line; Cont. POOH 6-1/8" Clean out BHA To Surface; RIH W/ 3-3/4" D/O BHA To 2580mTo D/O inside 5" LNR, While F/U Strg & Break Circ. Every 10Stds, NL-NG.
2026-06-08	Cont. RIH W/ 3-3/4" D/O BHA F/ 2550 To 3717m Followed by 5" DPs On Elevator; Conn. TDS & Cont. RIH W/ 3-3/4" D/O BHA F/ 3717 To 3763.5m W/ Wash Dn; Record Strg Wt. W/ & W/O Rotation and Flow Rate; Cont. RIH W/ 3-3/4" D/O BHA and Pass Tie-back Sleeve Gently W/O any Drag, D/O Pack Of Bushing, While Smooth & Dress 8-1/2" PBR & P.O.B intervals Sev. Times; Cont. RIH W/ 3-3/4" D/O BHA To 3935m W/ Wash Dn; Cont. RIH W/ 3-3/4" D/O BHA F/ 3935 To 3983m W/ Wash & Ream Dn, While Reciprocate the last Std Before Each Connection, NL-NG.
2026-06-09	Cont. RIH W/ 3-3/4" D/O BHA F/ 3983 To 4052m W/ Wash & Ream Dn, While Reciprocate the last Std Before Each

	Connection, NL-NG.
2026-06-10	Cont. RIH W/ 3-3/4" D/O BHA F/ 4052 To 4072m W/ Wash & Ream Dn, While Reciprocate the last Std Before Each Connection; Stop RIH Op. due to Wash pipe Leakage; POOH 3-3/4" D/O BHA F/ 4072 To 4040m; Change Wash pipe, While Circ. Thru. Strg; Cont. RIH back To 4072m W/ Wash; Resume RIH W/ 3-3/4" D/O BHA F/ 4072 To 4118m W/ Wash & Ream Dn, While Reciprocate the last Std Before Each Connection, NL-NG.
2026-06-11	Cont. RIH W/ 3-3/4" D/O BHA to 4126.5m W/ Wash Dn, Hold up Strg Wt. Try D/O DPWP, LWP & LDC. High Torque Observed, Circ. BTM's Up, Hole Cleaned. POOH F/ 4126.5m to surface. RIH W/ 7-5/16" Polish BHA to 166m.
2026-06-12	Cont. RIH w/ 7-5/8" Polish mill to 2883.5m (7" L.Lap), While W/D Last Std. Dress, Polish & Clean inside 7" TBS Several times. Tag LG @ 2886m & Try to take L.G mark. CBU. POOH w/ 7-5/16" Polish BHA to surface, R/U OEOC CSG Running equipment, Run 7" Tie - Back as per program to 56m
2026-06-13	Cont. RIH w/ 7" LNR Tie-Back Assy to 2877m. Wait on Rec. Pump truck, while slow Circ. Thru string.
2026-06-14	Cont. Wait on Rec. Pump truck, While slow Circ. Thru string. Resume RIH w/ 7" LNR Tie-Back Assy on 5" DPs to 2883.5m, Sting in previous Tie-Back sleeve, P/U String & Bleed off press., M/U CMT Head manifold
2026-06-15	Perform CMT Job as per program, Sting in SN Fully in TBS , Release running tools, POOH 15 Stds. Flash string & CBU, Cont. POOH to surface, RIH w/ 8-1/2" TCI to New 7" L.Lap, CBU, POOH to 640m, While B/O & L/D Extra Stds
2026-06-16	POOH w/ 8-1/2" D/O BHA to surface. While B/O & L/D 22 Stds. 5" DPs. Jt by Jt. RIH w/ 5-7/8" TCI Bit & D/O BHA While P/U totally 81 Jts 3-1/2" DPs to 1285.2m, Tag POB @ 1285.2m, Commence D/O POB W/ Different Parameters.
2026-06-17	Cont. D/O POB w/ 5-7/8" TCI Bit W/ Different Parameters, While smooth & Dress POB intervals Sev.Times. Cont. RIH f/ 1285.2 to 2848.6m. Commence D/O P.O.B Debris, Plugs, LDC & CMT to 2888m, While work on mud properties
2026-06-18	Cont. RIH w/ 5-7/8" TCI Bit & D/O BHA to 3763.5m (5" L.Lap), While pump 20 bbl Hi-Vis Pill @ Two stage. POOH w/ 5-7/8" TCI Bit & D/O BHA F/ 3763.5 to surface. While M/U 5 Stds. 3-1/2" DPs. RIH w/ 4-1/8" Junk Mill & D/O BHA to 460m.
2026-06-19	Cont. RIH W/ 4-1/8" J.Mill & D/O BHA F/ 460 to 3763.5m. Hard Wash & Ream Down & Clerance inside 5" LNR to 3998m, NL-NG.
2026-06-20	Cont. RIH w/ 4-1/8" J.Mill & D/O BHA F/ 3998 to 4126.5m w / Wash down. Try to D/O Inside 5" LNR W/ Different parameters, NO Progress & Observed High torque, Stall Strg. Several Times. POOH to 3830m.
2026-06-21	Cont. POOH to surf. L/D 4-1/8"J.Mill , M/up & RIH W/7-5/16" Polish Mill to 1284m(7"L.Lap), Take LG Mark. POOH to 980m .

2026-06-22	Cont. POOH W/ 7-5/16" Polish mill F/ 980 to surface. R/U OEOC CSG Running equipment, Run 7" Tie-Back as per program to 1284m.
2026-06-23	Perform CMT Job as per program, Sting in SN Fully in TBS , Release running tools, POOH to surface. Slip & Cut 103 ft drilling line. RIH w/ 8-1/2" TCI to New 7" L.Lap, C.B.U, POOH to surface, While B/O & L/D 3 Std. 5" HWDP (Jt by Jt). RIH w/ 6-1/8" TCI Bit & D/O BHA to 130m. Tag P.O.B @ 130m. Commence D/O P.O.B W/ Different parameters. Cont. RIH to 250m.
2026-06-24	Cont. RIH w/ 6-1/8" TCI Bit & D/O BHA to 1235m. D/O Plugs, LDC & Hard CMT to 1280m.
2026-06-25	Cont. D/O Hard CMT W/ 6-1/8" D/O BHA F/ 1280 to 1286m; Cont. RIH W/ 6-1/8" D/O BHA F/ 1286 To 1450m W/ Wash & Ream Dn, While D/O CMT Bridges; Pump 20bbl Hi-Vis Pill @ 1450m, Then Hi-Rate CBU To Disp. & Shaker out the pumped Hi-Vis pill, Confirm Sh.Shakers are clean; To P/U & M/U required Tubulars, including 7 Stds 3-1/2" DP Jt by Jt, Cont. RIH W/ 6-1/8" D/O BHA F/ 1450 To 1670m On Elevator; POOH 6-1/8" D/O BHA F/ 1670m To Surface (BHA) On Elevator, L/D 6-1/8" TCI Bit [D.G: 1-2-BT-A-E-1/16"- WT-BHA] and Rest of BHA; BOP Test as per NIOC Policy; P/U & M/U 4-1/8" Clean out BHA and RIH To 1012m On Elevator Followed by 3-1/2" DPs, While F/U Strg & Break Circ. Every 10Stds, NL-NG.
2026-06-26	Cont. RIH W/ 4-1/8" Clean out BHA F/ 1012 To 3763m On Elevator Followed by 3-1/2" & 5" DPs; Conn. TDS and Cont. RIH W/ 4-1/8" Clean out BHA F/ 3763 To 4126.5m W/ Wash Dn; Tag LDC, LWP, and DPWP @ 4126.5m; Attempt to Start D/O F/ 4126.5m, While Reciprocate Strg & Apply various Drlg Parameters; however, due to High Torque, Strg repeatedly Stalled & no Progress was achieved; NL-NG.
2026-06-27	Attempt to Start D/O W/ 4-1/8" Clean out BHA F/ 4126.5m, While Reciprocate Strg & Apply various Drlg Parameters; however, due to High Torque, Strg repeatedly Stalled and no Progress was achieved; Procced to check Strg Torque; POOH 4-1/8" Clean out BHA F/ 4126.5 To 3640m (above 5" L.Lap Depth) On Elevator, Conn. TDS and Check Strg Tq. via Apply F.Rate, and Rotation 30RPM, Got Torque 2300-2500 lbf.ft, Confirm observation of normal Tq. ; RIH back W/ 4-1/8" Clean out BHA F/ 3640 To 4047m Followed by 3-1/2" DPs On Elevator; Conn. TDS and Cont. RIH W/ 4-1/8" Clean out BHA F/ 4047 To 4126.5m Followed by 5" DPs W/ Wash Dn; Circ. For a while @ 4126.5m; Spot 25bbl 105pcf CaBr2 in Perforation Intervals; POOH 4-1/8" Clean out BHA F/ 4126.5 To 3840m On Elevator, While Circ C.W.H, NL-NG.
2026-06-28	Cont. POOH 4-1/8" Clean out BHA F/ 3840 To 403m On Elevator; Cont. POOH 4-1/8" Clean out BHA F/ 403m To Surface (BHA) On Elevator, B/O & L/D 4-1/8" J.Mill (5% Used) & BHA; P/U & Assemble Wireline Tool String for Cement Bond Evaluation of 5" LNR (RBT-VDL-GR-CCL), RIH W/ Wireline Tool String (for Cement Bond Evaluation of 5" LNR)To 3900m, Hold up Wireline Cable Tension @ 3900m, Procced To POOH; POOH Wireline Logging Tool Strg To Surface, B/O & L/D Wireline Logging Tool Strg; P/U & Assemble Wireline Tool String as Dummy Run, While Circ. C.W.H & Monitor the Well, NL-NG.
2026-06-29	Cont. RIH W/ Wireline Tool String as Dummy Run To 3920m, Hold up Wireline Cable Tension @ 3920m, Attempt to pass the same Depth Sev. Times, No Success; Procced To POOH; POOH Wireline Logging Tool Strg To Surface;

	B/O & L/D Wireline Logging Tool Strg, Surface Tools, Wireline BOP, and 7" Shooting Nipple, Change 13-5/8" 10K Top Rams VBR, Press. Test the changed Rams, Ok; R/U Mouse Hole; Set 11" Wear Bushing in T.H.S Bowl; M/U 3-1/8" Open End BHA and RIH To 4126.5m, NL-NG.
2026-06-30	Circ. @ 4126.5m to Sweep the Well (2 Cycle Direct Circulation & 1 Cycle Reverse Circulation), While simultaneously optimize Mud Properties & Rheology W/ Max F.Rate & SPP; Spot 25bbl 105pcf CaBr2 in Perforation Intervals; POOH 3-1/8" Open End BHA F/ 4126.5 To 1125m On Elevator, While Circ C.W.H, NL-NG.
2026-07-01	Cont. POOH 3-1/8" Open End BHA F/ 1125m To Surface; R/U W/L Logging Eqps. , Assemble W/L Tool String for Cement Bond Evaluation of 5" LNR and RIH to 7.2m; Cont. RIH W/ the same W/L Tool String F/ 7.2 To 3800m, Hold up W/L Cable Tension @ 3800m, Attempt to pass the same Depth Sev. Times, No Success; POOH W/L Logging Tool Strg To Surface; B/O & L/D W/L Logging Tool Strg; P/U & Assemble W/L Tool String as Dummy Run, Cont. RIH W/ W/L Tool String as Dummy Run To 4123m, Hold up W/L Cable Tension @ Sev. Depths, Work on the Choke points and Pass the same; Cont. RIH & Obs. Hold up W/L Cable Tension @ 4123m, Attempt to pass the same Depth Sev. Times, No Success; POOH W/L Logging Tool Strg To Surface; B/O & L/D W/L Logging Tool Strg, P/U & Assemble W/L Tool String for Cement Bond Evaluation of 5" LNR and RIH to 7.2m, While Circ. C.W.H, NL-NG.
2026-07-02	Cont. RIH W/ Wireline Logging Tool String (for Cement Bond Evaluation of 5" LNR) F/ 7.2 To 4123m; Commence Data Acquisition Logging Up F/ 4123 To 3750m; POOH Wireline Logging Tool String To Surface; P/U & Assemble Wireline Tool String as Dummy Run To 4126.5m Normally; POOH Wireline Tool Strg To Surface; B/O & L/D Wireline Logging Tool Strg; P/U & Assemble Wireline Tool String as Perforation Run#1 and RIH To 4122m, Correlate the Depth, Fire the Gun & Shoot the Bullets at Interval 4115.78 To 4121.78m, Obs. Electrical & Tension Cable Indications; POOH Wire Line Tools and L/D Wire Line Tools, Obs. all Bullets were Shot successfully, All Done by Supervision of Client Witness; Wait on Day Light, While Circ. C.W.H and Monitor the Well, NL-NG.
2026-07-03	Cont. Wait on Day Light; P/U & Assemble Wireline Tool String as Dummy Run To 4089m Normally; POOH Wireline Tool Strg To Surface; B/O & L/D Wireline Logging Tool Strg; P/U & Assemble Wireline Tool String as Perforation Run#2 and RIH To 4101m, Correlate the Depth, Fire the Gun & Shoot the Bullets at Interval 4094.4 To 4100.4m, Obs. Electrical & Tension Cable Indications; POOH Wire Line Tools and L/D Wire Line Tools, Obs. all Bullets were Shot ; P/U & Assemble Wireline Tool String as Perforation Run#3 and RIH To 4095m, Correlate the Depth, Fire the Gun & Shoot the Bullets at Interval 4088.9 To 4094.4m, Obs. Electrical & Tension Cable Indications; POOH Wire Line Tools and L/D Wire Line Tools, Obs. all Bullets were Shot ;Wait on Day Light, While Circ. C.W.H and Monitor the Well, NL-NG.
2026-07-04	Cont. Wait on Day Light; P/U & Assemble W/L Tool Strg as Dummy Run To 4081m Normally; POOH W/L Tool Strg To Surface; B/O & L/D W/L Logging Tool Strg; P/U & Assemble W/L Tool String as Perforation Run#4 and RIH To 4081m, Correlate the Depth, Fire the Gun & Shoot the Bullets at Interval 4074 To 4080m, Obs. Electrical & Tension Cable Indications; POH W/L Tools and L/D W/L Tools, Obs. all Bullets were Shot ; P/U & Assemble W/L Tool Strg as Perforation Run#5 and RIH To 4072m, 4072m, Hold up W/L Cable Tension @ 4072m, Attempt to pass, No Success; POH W/L Tools and L/D Wireline Tools; P/U & Assemble W/L Tool Strg as Dummy Run To 4073m, Attempt to pass, No Success, POH To Surf. ; P/U & Assemble W/L Tool Strg as Dummy Run To 4074m, Attempt to pass, No Success,

	POH To Surf. , While Circ. C.W.H and Monitor the Well, NL-NG.
2026-07-05	Cont. Wait on Day Light; P/U & Assemble W/L Tool Strg as Dummy Run To 4072m, Attempt to pass, No Success; POOH Wireline Tool Strg To Surface; B/O & L/D Wireline Tool Strg, Surface Tools, Wireline BOP, and 7" Shooting Nipple, Change 13-5/8" 10K Top Rams VBR, Press. Test the changed Rams, Ok; R/U Mouse Hole; Set 11" Wear Bushing in T.H.S Bowl; P/U & M/U 3-1/2" Clean out BHA and RIH To 3572m On Elevator Followed by 3-1/2" DPs, While F/U Strg & Break Circ. Every 15Stds, NL-NG.
2026-07-06	Cont. RIH W/ 3-1/2" Clean out BHA F/ 3571 To 3760m On Elevator, Circ. for a while @ 5" L.Lap; Cont. RIH W/ 3-1/2" Clean out BHA F/ 3760 To 4035m On Elevator, Change Handling Eqps. & Elevator; Conn. TDS & Cont. RIH W/ 3-1/2" Clean out BHA F/ 4035 To 4088m W/ Wash Dn, While soft Wash & Ream Dn Choke Points and pass Perforated intervals gently; POOH 3-1/2" Clean out BHA F/ 4088 To 4070m W/ Pump out; Pump 90bbl Fresh Mud & Circ. @ 4070m to Sweep the Well, While simultaneously optimize Mud Properties & Rheology W/ Max F.Rate & SPP; Spot 25bbl CaBr2 @ 4074m; POOH 3-1/2" Clean out BHA F/ 4074m To Surface On Elevator, While Circ. C.W.H; NL-NG.
2026-07-07	Prepare Rig to perform W/L Perforation Op. ;P/U & Assemble W/L Tool Strg as Dummy Run To 4075m Normally; POOH W/L Tool Strg To Surface; B/O & L/D W/L Tool Strg; P/U & Assemble W/L Tool Strg as Perforation Run#5 and RIH To 4075m, Correlate the Depth, Fire the Gun & Shoot the Bullets at Interval 4071 To 4074m; POOH W/L Tools and L/D W/L Tools, Obs. all Bullets were Shot ; P/U & Assemble W/L Tool Strg as Perforation Run#6 and RIH To 4067m, Correlate the Depth, Fire the Gun & Shoot the Bullets at Interval 4060.6 To 4066m; POOH W/L Tools and L/D W/L Tools, Obs. all Bullets were Shot ; P/U & Assemble W/L Tool Strg as Perforation Run#7 and RIH To 4059m, Correlate the Depth, Fire the Gun & Shoot the Bullets at Interval 4052 To 4058m; POOH W/Tools and L/D W/L Tools, Obs. all Bullets were Shot ;Wait on Day Light, While Circ. C.W.H and Monitor the Well, NL-NG.
2026-07-08	Prepare Rig to perform W/L Perforation Op. ;P/U & Assemble W/L Tool Strg as Dummy Run To 4075m Normally; POOH W/L Tool Strg To Surface; B/O & L/D W/L Tool Strg; P/U & Assemble W/L Tool Strg as Perforation Run#8 and RIH To 4053m, Correlate the Depth, Fire the Gun & Shoot the Bullets at Interval 4047.4 To 4052m; POOH W/L Tools and L/D W/L Tools, Obs. all Bullets were Shot ; P/U & Assemble W/L Tool Strg as Perforation Run#9 and RIH To 4030m, Correlate the Depth, Fire the Gun & Shoot the Bullets at Interval 4023.2 To 4028.9m; POOH W/L Tools and L/D W/L Tools, Obs. all Bullets were Shot ; P/U & Assemble W/L Tool Strg as Perforation Run#10 and RIH To 4007m, Correlate the Depth, Fire the Gun & Shoot the Bullets at Interval 4000 To 4006m; POOH W/Tools and L/D W/L Tools, Obs. all Bullets were Shot ;Wait on Day Light, While Circ. C.W.H and Monitor the Well, NL-NG.
2026-07-09	Wait on daylight, Perform 3 Runs of perforation, Change Top rams, Perform BOP test.
2026-07-10	Cont. BOP Test as NIOC Policy. B/O & L/D Extra Stds. RIH w/ 5-7/8" TCI Bit & 7" Scraper to 1100m.
2026-07-11	Cont. RIH w/ 5-7/8" TCI Bit & 7" Scraper to 3763m (0.5m Above 5" L.Lap). C.B.U, L/U CMT Line to string, Press. Test Same; OK, Displace well w/ Non-Solid Completion fluid, POOH to 2770m.

2026-07-12	Cont. POOH to 57m & L/D All Tubulars.
2026-07-13	Cont. POOH to surface & L/D All tubulars. R/U Completion string running equipment, Run completion as per program to 520m. Meanwhile perform P/T@ 68m & 520m, Run gauge ring @ 30m, 68m & 520m
2026-07-14	Cont. Run completion as per program to 1780m. Meanwhile perform P/T @ 995m, 1780m. Run gauge ring @ 995, 1450, 1780m.
2026-07-15	Cont. Run completion as per program to 2760m. Meanwhile perform P/T @ 2760m. Run Gauge ring @ 2248, 2270m.
2026-07-16	Cont. Run completion as per program to 2811.9m. P/T, Set P.Sleeve, Set Check valve in No-Go, Set PKR, P/T, Land TBG HGR & P/T, P/T PKR f/ Ann. As per program.
2026-07-17	N/D BOP Stack, Install XMT & P/T, Ret. TWCV, Release the rig.

Table 12-1: AZNS-127 Daily Drilling Report Summary

13. Comments & Revision