

UR5e known-case failure: residual liquid leaves during subsequent release

Pour hold: liquid still retained
native 12.001864s | pour_hold

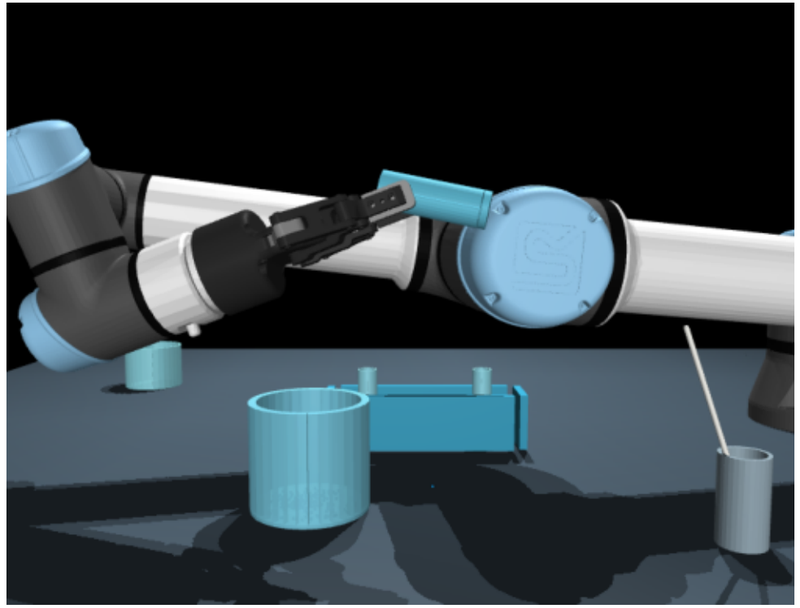


Source 64 Receiver 175 Outside/flight 1

End of feedback: 64 retained
native 15.001931s | untilt

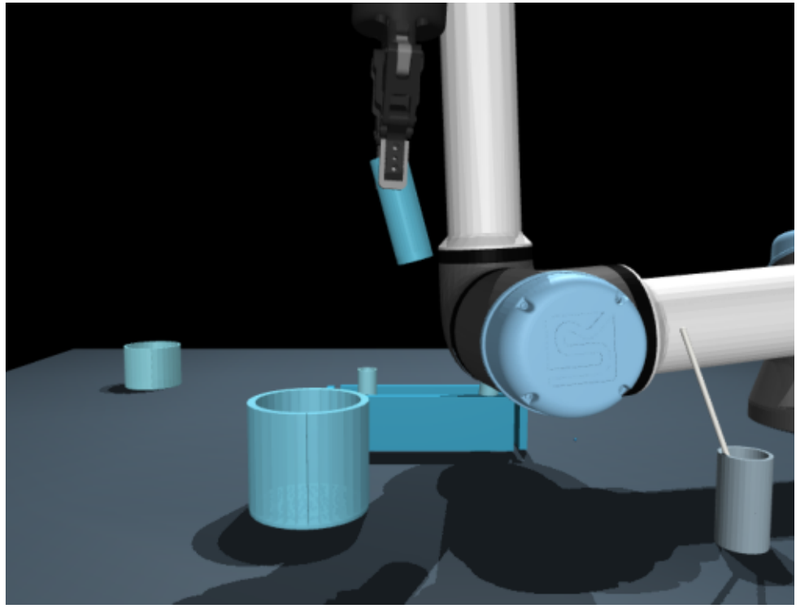

Source 64 Receiver 175 Outside/flight 1

After release: outside count rises
native 19.400217s | release

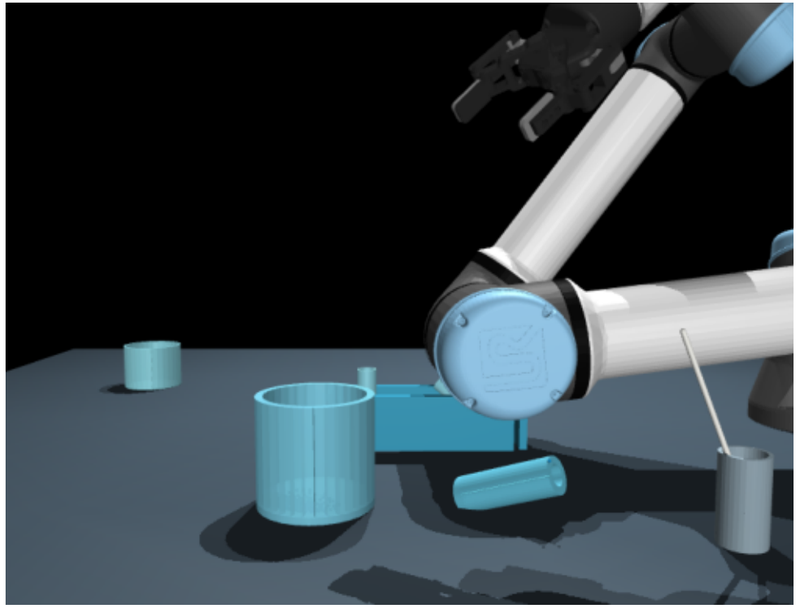

Source 63 Receiver 175 Outside/flight 2

Stable original indices: 64 in source at 15.001931 s → at final 23.000352 s: 2 source, 0 receiver, 62 outside.

The final cohort tally comes from the final archive, not the 19.4 s panel. Receiver remains 175/240; counts do not identify contact or wall-crossing cause.

Exact saved states; one fixed camera; no interpolation, new dynamics, GPU, or material/particle-display changes. Arm/vessel opacity may obscure liquid.

CPU/CAD material + spherical particle-center diagnostic; not original GRID liquid-surface visual reproduction.